

## FUGRO TECHNICAL SERVICES LIMITED

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



Report No.: 0064/18/ED/0855A

### MONTHLY EM&A REPORT

February 2025

**Client** : Civil Engineering and Development  
Department, HKSAR


**Contract No.** : NDO 03/2018

**Contract Name** : Road Widening and Retrofitting Noise Barriers  
on Tai Po Road (Sha Tin Section)

**Report No.** : 0064/18/ED/0855A

**Prepared by** : Eric Chan

**Reviewed by** : Calvin Leung

**Certified by** :   
Calvin Leung  
Environmental Team Leader  
Fugro Technical Services Limited

Our ref: PL-202503051

Unit 2320, Level 23,  
Tower I, Metroplaza,  
223 Hing Fong Road, Kwai Fong,  
N.T., Hong Kong.

Attention: Mr. Joseph YAN

18 March 2025

Dear Joseph,

**NE/2017/05**

**Road Widening and Retrofitting Noise Barriers on Tai Po Road (Sha Tin Section)  
Monthly EM&A Report for February 2025**

I refer to the email of the ET regarding to the captioned Monthly EM&A Report with report No. 0064/18/ED/0855A, I have no adverse comment on it and verify this monthly report according to section 1.9 of the Environmental Permit with Permit No. EP- 463/2013/B.

Yours faithfully,



Li Wai Ming Kevin  
Independent Environmental Checker

cc. CRE – Mr. YU Albert (by email only: [albert.yu@aecom.com](mailto:albert.yu@aecom.com))  
CEDD – Mr. YAN Joseph (by email only: [jkeyan@cedd.gov.hk](mailto:jkeyan@cedd.gov.hk))



## TABLE OF CONTENTS

|                                                                      |           |
|----------------------------------------------------------------------|-----------|
| <b>EXECUTIVE SUMMARY</b>                                             | <b>I</b>  |
| <b>1. INTRODUCTION</b>                                               | <b>1</b>  |
| <b>2. AIR QUALITY</b>                                                | <b>5</b>  |
| <b>3. NOISE</b>                                                      | <b>9</b>  |
| <b>4. LANDSCAPE AND VISUAL</b>                                       | <b>14</b> |
| <b>5. WASTE MANAGEMENT</b>                                           | <b>15</b> |
| <b>6. SITE INSPECTION</b>                                            | <b>16</b> |
| <b>7. ENVIRONMENTAL COMPLAINT AND NON-COMPLIANCE</b>                 | <b>17</b> |
| <b>8. IMPLEMENTATION STATUS OF ENVIRONMENTAL MITIGATION MEASURES</b> | <b>17</b> |
| <b>9. FUTURE KEY ISSUES</b>                                          | <b>19</b> |
| <b>10. CONCLUSIONS</b>                                               | <b>20</b> |

## FIGURES

|           |                            |
|-----------|----------------------------|
| Figure 1  | Project General Layout     |
| Figure 2a | Air Monitoring Locations   |
| Figure 2b | Noise Monitoring Locations |

## LIST OF APPENDICES

|            |                                                                                                                            |
|------------|----------------------------------------------------------------------------------------------------------------------------|
| Appendix A | Construction Programme                                                                                                     |
| Appendix B | Project Organization Chart                                                                                                 |
| Appendix C | Action and Limit Levels for Air Quality and Noise                                                                          |
| Appendix D | Calibration Certificates of Monitoring Equipment                                                                           |
| Appendix E | Environmental Monitoring Schedules, Examination Schedules and Arrangements on Deferral of Class Resumption for All Schools |
| Appendix F | Air Quality Monitoring Data                                                                                                |
| Appendix G | Noise Monitoring Data                                                                                                      |
| Appendix H | Event Action Plans                                                                                                         |
| Appendix I | Waste Flow Table                                                                                                           |
| Appendix J | Environmental Mitigation Implementation Schedule (EMIS)                                                                    |
| Appendix K | Weather and Meteorological Conditions during Reporting Month                                                               |
| Appendix L | Cumulative statistics on Environmental Complaints, Notifications of Summons and Successful Prosecutions                    |
| Appendix M | Summary of Site Audit in the Reporting Month                                                                               |

**EXECUTIVE SUMMARY**

- i. The Civil Engineering and Development Department HKSAR has appointed Fugro Technical Services Limited (FTS) to undertake the Environmental Team services for the Project and implement the EM&A works.
- ii. This Monthly EM&A report presents the environmental monitoring and audit works for the period between 1 February 2025 and 28 February 2025. As informed by the Contractor, major activities in the reporting month were summarized as below table:

| Zone 1                                                                                                                                                  | Zone 2                                                                                                                                                                                                    | Zone 3                                                                                                                                                                                                                            | Zone 4                                                                                                                                                                  | Zone 5                                                                                                                                                                                                   |
|---------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <ul style="list-style-type: none"><li>• Noise Barrier Remaining Installation</li><li>• Irrigation Work</li><li>• Planting Work (Tree / Shrub)</li></ul> | <ul style="list-style-type: none"><li>• Noise Barrier Remaining Installation</li><li>• Irrigation Work</li><li>• Planting Work (Tree / Shrub)</li><li>• Construction of Draw pit and Pillar box</li></ul> | <ul style="list-style-type: none"><li>• Tree Works (including preservation / felling/ pruning/ transplantation)</li><li>• Road surface Maintenance</li><li>• Noise Barrier Remaining Installation</li><li>• Slope works</li></ul> | <ul style="list-style-type: none"><li>• Road surface Maintenance</li><li>• Noise Barrier Remaining Installation</li><li>• Irrigation Work + Landscaping Works</li></ul> | <ul style="list-style-type: none"><li>• Road surface Maintenance</li><li>• Noise Barrier Remaining Installation</li><li>• Slope Landscaping Works + Irrigation System for Landscaping on Slope</li></ul> |

**Breaches of the Action and Limit Levels**

- iii. 24-hour and 1-hour TSP impact monitoring were carried out in the reporting month, no Action / Limit Level exceedance was recorded during the period.
- iv. Day time construction noise monitoring was carried out in the reporting month, no Action / Limit Level exceedance was recorded during the period.
- v. Regular night time noise monitoring was carried out on 6, 11, 19 and 25 February 2025 respectively and no exceedance case was recorded between 2300 and 0700 of the next day during the reporting month.



## **Complaint, Notification of Summons and Successful Prosecution**

vi. One complaint was received in the reporting month. The summaries are listed below:

- A further complaint of CASE no.: 3-8199986833 was received via 1823 (CASE no.: 3-8596770160) on 28<sup>th</sup> January 2025 and referred to EPD (EPD Ref: RN2794-25). Two other further complaints were received via 1823 on 7<sup>th</sup> February 2025 and 12<sup>th</sup> February 2025 respectively. Another complaint was received by EPD from the same complainant on 7<sup>th</sup> February 2025 (EPD Ref: RN3357-25). The complainant concerned about the noise nuisance generated from night-time construction works near Sha Tin Rural Committee Road and Shatin Plaza. The complaint was referred from AECOM to Environmental Team (ET) on 3<sup>rd</sup> February 2025 9:27, 7<sup>th</sup> February 2025 14:56 and 12<sup>th</sup> February 2025 15:04.

## **Reporting Changes**

vii. There was no reporting change in the reporting month.

## **Future Key Issues**

viii. The key issues to be considered in the coming reporting month include:

Potential environmental impacts arising from the above construction activities are mainly associated with construction dust, construction noise, water quality, waste management and landscape and visual impact.



## **1. INTRODUCTION**

### **1.1 Background**

1.1.1 Contract No. NE/2017/05 – Road Widening and Retrofitting Noise Barriers on Tai Po Road (Sha Tin Section) (TPR-ST) (hereafter referred as “the Contract”), is the Works Contract involved the construction of road widening and retrofitting noise barriers on TPR-ST.

1.1.2 The Works of road widening on TPR-ST is classified as a designated project (DP) under the Part I of Schedule 2 of the Environmental Impact Assessment Ordinance (EIAO) (Cap. 499). The scale and scope of DP is classified as below:

- Widening and reconstruction of an approximate 1.2 km long of the existing Tai Po Road (Sha Tin Section) from dual 2-lane to dual 3-lane carriageway; and improvement of the existing Sha Tin Rural Committee Road and its junctions.

1.1.3 The Environmental Monitoring and Audit (EM&A) programme under this Contract is governed by the Environmental Permit (EP) (EP No: EP-463/2013/B) and the updated EM&A Manual (Reference No.: 0064/18/ED/0122D). The Works to be executed under this Contract and corresponding EPs include but not be limited to the following main items:

(i) Road widening works of TPR-ST:

- a. widening of TPR-ST of about 1.1 kilometres between Sha Tin Rural Committee Road (STRCR) and Fo Tan Road from dual two-lane to dual three-lane;
- b. modification to the existing diamond interchange at TPR-ST / STRCR (STRCR Interchange);
- c. provision of two pedestrian lifts, re-provision of staircase and cycle track ramp at the modified STRCR Interchange;
- d. modification of existing cycle track subway no. NS30 near Sha Tin Plaza;
- e. modification of the existing footbridge no. NF40 across TPR-ST near Wo Che Street;
- f. modification of the existing footbridge no. NF66 near Fung Wo Lane;
- g. installation of noise mitigation measures between Citylink Plaza and Mei Wo House of Wo Che Estate;
- h. associated drainage works, waterworks, street lighting works and traffic control and surveillance system (TCSS).

(ii) Retrofitting of noise barriers along TPR-ST:

- (a) western section between Citylink Plaza and Scenery Court;
- (b) eastern section between Mei Wo House of Wo Che Estate and Fo Tan Road; and
- (c) associated drainage works, waterworks and street lighting works.

(iii) Associated street furniture, road marking, traffic signs, directional signs, services and utilities, and

(iv) Associated landscaping works.

1.1.4 The location and boundary of the site is shown in **Figure 1**.

1.1.5 This Monthly EM&A report is required under EP-463/2013/B Condition 3.4. It is to report the results and findings of the EM&A programme required in the updated EM&A Manual.

1.1.6 This is the 75<sup>th</sup> monthly EM&A Report which summarized the impact monitoring results and audit findings for the construction of the road widening and retrofitting noise barriers on Tai Po Road (Sha Tin Section) (TPR-ST) (hereafter referred as “the Project”) within the period between 1 February 2025 and 28 February 2025.

## 1.2 Project Organization

1.2.1 The project proponent was the Civil Engineering and Development Department, HKSAR (CEDD). AECOM Asia Co. Ltd. (AECOM) was commissioned by CEDD as the Engineer for the Project. Acuity Sustainability Consulting Limited – Nature & Technologies (HK) Limited Joint Venture was commissioned as the Independent Environmental Checker (IEC). China railway – China Railway First Group – Zhen Hua Engineering Joint Venture (CCZJV) was appointed as the main contractor for the construction works under the contract NE/2017/05. Fugro Technical Services Limited (FTS) was appointed as the Environmental Team (ET) by CEDD to implement the EM&A programme for the Project.

1.2.2 The organization structure is shown in **Appendix B**. The key personnel contact names and numbers for the Project are summarized in **Table 1.1**.

**Table 1.1 Contact Information of Key Personnel**

| Party                                                                                                | Position                          | Name             | Telephone |
|------------------------------------------------------------------------------------------------------|-----------------------------------|------------------|-----------|
| Project Proponent (CEDD)                                                                             | Senior Engineer                   | Mr. Joseph Yan   | 3152 3551 |
| Engineer's Representative (AECOM)                                                                    | Chief Resident Engineer           | Mr. Jacky Choi   | 3959 9673 |
| IEC<br>(Acuity Sustainability Consulting Limited – Nature & Technologies (HK) Limited Joint Venture) | Independent Environmental Checker | Mr. Kevin Li     | 9779 2247 |
| Main Contractor (CCZJV)                                                                              | Site Agent                        | Mr. S.Y. Wong    | 9257 8521 |
|                                                                                                      | Environmental Officer             | Mr. Worden Woo   | 5223 7429 |
| ET (FTS)                                                                                             | Environmental Team Leader         | Mr. Calvin Leung | 3565 4441 |
|                                                                                                      | Environmental Team Member         | Mr. Eric Chan    | 3656 1004 |



### 1.3 Construction Programme and Activities

1.3.1 This project was commenced on 29 November 2018 and the construction works is expected to be completed in year 2025. The construction programme is shown in **Appendix A**.

1.3.2 A summary of the major construction activities undertaken in the reporting month were shown in below table:

| Zone 1                                                                                                                                                  | Zone 2                                                                                                                                                                                                    | Zone 3                                                                                                                                                                                                                            | Zone 4                                                                                                                                                                  | Zone 5                                                                                                                                                                                                   |
|---------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <ul style="list-style-type: none"><li>• Noise Barrier Remaining Installation</li><li>• Irrigation Work</li><li>• Planting Work (Tree / Shrub)</li></ul> | <ul style="list-style-type: none"><li>• Noise Barrier Remaining Installation</li><li>• Irrigation Work</li><li>• Planting Work (Tree / Shrub)</li><li>• Construction of Draw pit and Pillar box</li></ul> | <ul style="list-style-type: none"><li>• Tree Works (including preservation / felling/ pruning/ transplantation)</li><li>• Road surface Maintenance</li><li>• Noise Barrier Remaining Installation</li><li>• Slope works</li></ul> | <ul style="list-style-type: none"><li>• Road surface Maintenance</li><li>• Noise Barrier Remaining Installation</li><li>• Irrigation Work + Landscaping Works</li></ul> | <ul style="list-style-type: none"><li>• Road surface Maintenance</li><li>• Noise Barrier Remaining Installation</li><li>• Slope Landscaping Works + Irrigation System for Landscaping on Slope</li></ul> |

## 1.4 Status of Environmental Licenses, Notifications and Permits

1.4.1 A summary of the relevant environmental licenses, permits and/or notifications on environmental protection for this Contract is presented in **Table 1.2**.

**Table 1.2 Relevant Environmental Licenses, Permits and/or Notifications**

| Environmental License / Permit / Notification                                                    | Reference Number  | Valid From | Valid Till |
|--------------------------------------------------------------------------------------------------|-------------------|------------|------------|
| Environmental Permit for whole project                                                           | EP-463/2013/B     | 20/12/2016 | Nil        |
| Receipt of the notification of construction dust production                                      | Form NA           | 27/7/2018  | Nil        |
| Construction Waste Disposal Account                                                              | 7031619           | 17/8/2018  | Nil        |
| Chemical Waste Producer Registration                                                             | 5318-758-C4314-01 | 06/11/2018 | Nil        |
| Effluent Discharge License (Zone 1 – 5)                                                          | WT10001554-2023   | 07/11/2023 | 30/11/2028 |
| Construction Noise Permit for 24 hours Water Pump (Zone 1 – 5)                                   | GW-RN1074-24      | 01/10/2024 | 31/03/2025 |
| Construction Noise Permit for Road Closure, General Night Works (Zone 1 – 5)                     | GW-RN1508-24      | 01/02/2024 | 30/04/2025 |
| Construction Noise Permit for Road Closure, Extended Hours for Sun & Public Holiday (Zone 3 – 5) | GW-RN1482-24      | 03/01/2025 | 02/03/2025 |

## 2. AIR QUALITY

### 2.1 Monitoring Requirement

In accordance with the updated EM&A Manuals, 24-hour & 1-hour Total Suspended Particulates (TSP) level at the designated air quality monitoring station are required. Impact 24-hour and 1-hour TSP monitoring should be carried out at least once every 6 days. The Action and Limit Levels of the air quality monitoring are given in **Appendix C**.

### 2.2 Monitoring Equipment

The 24-hour and 1-hour TSP air quality monitoring was performed using High Volume Air Samplers (HVS) and portable TSP Monitors located at each of the designated monitoring station respectively.

**Table 2.1 and 2.2** summarizes the equipment used in air quality monitoring.

**Table 2.1 24-hour TSP Monitoring Equipment**

| Item | Location | Brand   | Model       | Equipment                    | Serial Number |
|------|----------|---------|-------------|------------------------------|---------------|
| 1    | AMS5     | *Sibata | Model LD-5R | Sibata Portable TSP Monitors | 882147        |
| 2    | AMS7A    | *Sibata | Model LD-5R | Sibata Portable TSP Monitors | 882149        |
| 3    | AMS14    | *Sibata | Model LD-5R | Sibata Portable TSP Monitors | 882185        |
| 4    | AMS15    | *Sibata | Model LD-5R | Sibata Portable TSP Monitors | 620407        |

\*Notes: As electricity supply is not available and accessible for the High Volume Samplers (HVS) at AMS 5, 7A, 14 and 15 portable Laser Particle Photometer Monitors will be utilized for 24-hour TSP monitoring instead of High Volume samplers (HVS). The correlation between HVS and the portable Laser Particle Photometer Monitors are presented in Appendix D.

**Table 2.2 1-hour TSP Monitoring Equipment**

| Item | Location | Brand  | Model       | Equipment                    | Serial Number |
|------|----------|--------|-------------|------------------------------|---------------|
| 1    | AMS5     | Sibata | Model LD-5R | Sibata Portable TSP Monitors | 882147        |
| 2    | AMS7A    | Sibata | Model LD-5R | Sibata Portable TSP Monitors | 882149        |
| 3    | AMS14    | Sibata | Model LD-5R | Sibata Portable TSP Monitors | 882185        |
| 4    | AMS15    | Sibata | Model LD-5R | Sibata Portable TSP Monitors | 620407        |

### 2.3 Monitoring Methodology

#### 2.3.1 24-hour TSP air quality monitoring by High Volume Air Samplers (HVS)

##### HVS Installation

The following guidelines were adopted during the installation of HVS:

- Sufficient support is provided to secure the samplers against gusty wind.
- No two samplers are placed less than 2 meters apart.
- The distance between the sampler and an obstacle, such as buildings, is at least twice the height that the obstacle protrudes above the sampler.
- A minimum of 2 meters of separation from walls, parapets and penthouses is required for rooftop samples.
- A minimum of 2 meters separation from any supporting structure, measured horizontally is required.
- No furnaces or incineration flues are nearby.



- Airflow around the samplers is unrestricted.
- The samplers are more than 20 meters from the drip line.
- Any wire fence and gate, to protect the sampler, should not cause any obstruction during monitoring.

#### Filters Preparation

Fiberglass filters (provided by the HOKLAS accredited laboratory) shall be used (Note: these filters have a collection efficiency of larger than 99% for particles of 0.3  $\mu\text{m}$  diameter). A HOKLAS accredited laboratory (Fugro Technical Services Limited) is responsible for the preparation of 24-hr conditioned and pre-weighed filter papers for monitoring team.

All filters are equilibrated in the conditioning environment for 24 hours before weighing. The conditioning environment temperature is around 25°C and not variable by more than  $\pm 3^\circ\text{C}$ ; the relative humidity (RH) is  $< 50\%$  and not variable by more than  $\pm 5\%$ . A convenient working RH is 40%.

#### Operating / Analytical Procedures

Operating / analytical procedures for the air quality monitoring are highlighted as follows:

- Prior to the commencement of the dust sampling, the flow rate of the HVS are properly set (between 0.6  $\text{m}^3/\text{min}$  and 1.7  $\text{m}^3/\text{min}$ ) in accordance with the EM&A manual. The flow rate shall be indicated on the flow rate chart.
- The power supply shall be checked to ensure the samplers worked properly.
- On sampling, the samplers shall be operated for 5 minutes to establish thermal equilibrium before placing any filter media at the designated air quality monitoring station.
- The filter holding frame is then removed by loosening the site nuts and carefully a weighted and conditioned filter is centered with the stamped number upwards, on a supporting screen.
- The filter shall be aligned on the screen so that the gasket formed an airtight seal on the outer edges of the filter. Then the filter holding frame is tightened to the filter holder with swing bolts. The applied pressure should be sufficient to avoid air leakage at the edges.
- The shelter lid shall be closed and secured with the aluminum strip.
- The timer is then programmed. Information shall be recorded on the record sheet, which included the starting time, the weather condition and the filter number (the initial weight of the filter paper can be found out by using the filter number).
- After sampling, the filter shall be removed and sent to laboratory for weighing. The elapsed time is also recorded.
- Before weighing, all filters are equilibrated in a conditioning environment for 24 hours. The conditioning environment temperature should be between 25°C and 30°C and not vary by more than  $\pm 3^\circ\text{C}$ ; the relative humidity (RH) should be  $< 50\%$  and not vary by more than  $\pm 5\%$ . A convenient working RH is 40%. Weighing results are returned to MCL for further analysis of TSP concentrations collected by each filter.

### 2.3.2 24-hour TSP air quality monitoring by portable Laser Particle Photometer Monitors

#### Operating / Analytical Procedures

The measuring procedures of the 24-hr dust meter are in accordance with the Manufacturer's instruction Manual as follows:

- Pull up the air sampling inlet cover
- Change the Mode 0 to BG once
- Push Start/Stop switch once
- Turn the knob to SENSI.ADJ and press it
- Push Start/Stop switch once
- Return the knob to the position MEASURE slowly
- Push the timer set switch to set measuring time
- Remove the cap and make a measurement

Calculation of the value of 24-hr TSP concentration is given by the average of 24 calculated 1-hr TSP concentration, where the calculated 1-hr TSP concentration is given by the product of the direct reading and the K-factor based on the correlation results between the direct reading meter and high volume sampler.

### 2.3.3 1-hour TSP air quality monitoring

#### Operating / Analytical Procedures

The measuring procedures of the 1-hr dust meter are in accordance with the Manufacturer's instruction Manual as follows:

- Pull up the air sampling inlet cover
- Change the Mode 0 to BG once
- Push Start/Stop switch once
- Turn the knob to SENSI.ADJ and press it
- Push Start/Stop switch once
- Return the knob to the position MEASURE slowly
- Push the timer set switch to set measuring time
- Remove the cap and make a measurement

## 2.4 Maintenance / Calibration

### 2.4.1 24-hour TSP air quality monitoring

The following maintenance / calibration are required for the HVS:

- The high volume motors and their accessories are properly maintained. Appropriate maintenance such as routine motor brushes replacement and electrical wiring checking are made to ensure that the equipment and necessary power supply are in good working condition.
- All HVS shall be calibrated (five point calibration) using Calibration Kit upon installation and thereafter in every 3 months.
- A copy of the calibration certificates for the HVS and calibrator are provided in **Appendix D**.

## 2.4.2 1-hour TSP air quality monitoring

- The portable TSP monitor should be calibrated at 1-year intervals.

## 2.5 Monitoring Locations

2.5.1 The Impact Air Monitoring Stations to be monitored should be selected based on the prevailing wind direction and their proximity to the active construction works. According to the Hong Kong Observatory, wind direction in September 2024 was southwest. The most updated locations are summarized in **Table 2.3** and shown in **Figure 2a**.

**Table 2.3 Location of Air Quality Monitoring Station**

| Monitoring Station | Location      | Land uses           |
|--------------------|---------------|---------------------|
| AMS5               | Tin Liu       | Residential Village |
| AMS7A              | Sheung Wo Che | Residential Village |
| AMS14              | Ha Wo Che     | Residential Village |
| AMS15              | Ha Wo Che     | Residential Village |

## 2.6 Results and Observations

2.6.1 The schedule of air quality monitoring in reporting month is provided in **Appendix E**.

2.6.2 No Action / Limit Level exceedance was recorded for 24-hr and 1-hr TSP at AMS 4A, 7A, 12 and 17 in the reporting month.

2.6.3 During the reporting month, major dust sources included trial pits excavation, piling works, demolition of existing parapet, removal of existing staircase, road surface maintenance and ELS works were observed in the site. Other factors such as road traffic along Tai Po Road may affect the monitoring results.

2.6.4 The weather conditions during the monitoring are provided in **Appendix K**.

2.6.5 The monitoring data of 24-hr and 1-hr TSP are summarized in **Table 2.4** and **2.5**. Detailed monitoring data are presented in **Appendix F**.

**Table 2.4 Summary of 24-hr TSP Monitoring Results**

| Parameter                             | Monitoring Station | Average ( $\mu\text{g}/\text{m}^3$ ) | Range ( $\mu\text{g}/\text{m}^3$ ) | Action Level ( $\mu\text{g}/\text{m}^3$ ) | Limit Level ( $\mu\text{g}/\text{m}^3$ ) |
|---------------------------------------|--------------------|--------------------------------------|------------------------------------|-------------------------------------------|------------------------------------------|
| 24-hr TSP in $\mu\text{g}/\text{m}^3$ | AMS5               | 47                                   | 35-65                              | 156                                       | 260                                      |
|                                       | AMS7A              | 47                                   | 39-62                              | 171                                       |                                          |
|                                       | AMS14              | 46                                   | 38-57                              | 174                                       |                                          |
|                                       | AMS15              | 53                                   | 44-67                              | 172                                       |                                          |

**Table 2.5 Summary of 1-hr TSP Monitoring Results**

| Parameter                            | Monitoring Station | Average ( $\mu\text{g}/\text{m}^3$ ) | Range ( $\mu\text{g}/\text{m}^3$ ) | Action Level ( $\mu\text{g}/\text{m}^3$ ) | Limit Level ( $\mu\text{g}/\text{m}^3$ ) |
|--------------------------------------|--------------------|--------------------------------------|------------------------------------|-------------------------------------------|------------------------------------------|
| 1-hr TSP in $\mu\text{g}/\text{m}^3$ | AMS5               | 57                                   | 46-77                              | 340                                       | 500                                      |
|                                      | AMS7A              | 58                                   | 42-77                              | 344                                       |                                          |
|                                      | AMS14              | 54                                   | 39-72                              | 350                                       |                                          |
|                                      | AMS15              | 62                                   | 47-78                              | 350                                       |                                          |

2.6.6 The Event and Action Plan for air quality is given in **Appendix H**.

### 3. NOISE

#### 3.1 Monitoring Requirement

3.1.1 In accordance with the updated EM&A Manuals,  $L_{eq}$  (30min) monitoring is conducted for at least once a week during the construction phase between 0700 and 1900 on normal weekdays at the designated monitoring locations.

#### 3.2 Monitoring Equipment

3.2.1 The sound level meter used in noise monitoring will comply with the International Electrotechnical Commission Publication 651:1979 (Type 1) and 804:1985 (Type 1) specifications as referred to in the Technical Memorandum issued under the Noise Control Ordinance (NCO).

3.2.2 Sound level calibrator will be used for the on-site calibration of the meter. This calibrator complies with the IEC Publication 942 (1988) Class 1 and ANSI S1.40 - 1984. Noise measurements were only accepted to be valid if the calibration levels from before and after the measurement agree to within 1.0dB.

3.2.3 Measurements shall be recorded to the nearest 0.1dB. Sound level meters are programmed to measure A-weighted equivalent continuous sound pressure level at 30-minute intervals between 0700 and 1900 on normal weekdays at least once a week when construction activities are underway.

**Table 3.1** summarizes the noise monitoring equipment model being used for this project.

**Table 3.1 Noise Monitoring Equipment**

| Item | Brand   | Model          | Equipment                     | Serial Number |
|------|---------|----------------|-------------------------------|---------------|
| 1    | Casella | CEL-63X Series | Integrating Sound Level Meter | 1488269       |
| 2    | Casella | CEL-63X Series | Integrating Sound Level Meter | 1488279       |
| 3    | Casella | CEL-63X Series | Integrating Sound Level Meter | 1488304       |
| 4    | Casella | CEL-63X Series | Integrating Sound Level Meter | 1488306       |
| 5    | Casella | CEL-120 Series | Calibrator                    | 2092809       |
| 6    | Casella | CEL-120 Series | Calibrator                    | 2383687       |
| 7    | Casella | CEL-120 Series | Calibrator                    | 2383707       |
| 8    | Casella | CEL-120 Series | Calibrator                    | 2383886       |

#### 3.3 Monitoring Parameters and Frequency

**Table 3.2** presents the noise monitoring parameters and frequencies.

**Table 3.2 Monitoring Parameters and Frequencies of Noise Monitoring**

| Parameter                                                                     | Frequency and Period                                                                |
|-------------------------------------------------------------------------------|-------------------------------------------------------------------------------------|
| $L_{Aeq}$ (30min)<br><br>$L_{10}$ and $L_{90}$ will be recorded for reference | At each station at 0700-1900 hours on normal weekdays at a frequency of once a week |

### 3.4 Monitoring Methodology

#### 3.4.1 The monitoring procedures are as follows:

- The monitoring station is set at a point 1m from the exterior of the sensitive receivers building façade and set at a position 1.2m above the ground.
- The battery condition is checked to ensure good functioning of the meter.
- Parameters such as frequency weighting, the time weighting and the measurement time are set as follows:
  - frequency weighting : A
  - time weighting : Fast
  - measurement time : Weekly 30 minutes between 0700-1900 on normal weekdays
- Prior to and after noise measurement, the meter shall be calibrated using the calibrator for 94.0 dB at 1000 Hz. If the difference in the calibration level before and after measurement is more than 1.0 dB, the measurement will be considered invalid and repeat of noise measurement is required after re-calibration or repair of the equipment.
- Noise monitoring should be cancelled in the presence of fog, rain, and wind with a steady speed exceeding 5 m/s, or wind with gusts exceeding 10 m/s.
- Noise measurement should be paused during periods of high intrusive noise if possible and observation shall be recorded when intrusive noise is not avoided.
- At the end of the monitoring period, the Leq, L10 and L90 are recorded. In addition, site conditions and noise sources are recorded on a standard record sheet.

### 3.5 Maintenance / Calibration

#### 3.5.1 Maintenance and Calibration procedures are as follows:

- The microphone head of the sound level meter and calibrator should be cleaned with a soft cloth at quarterly intervals.
- The sound level meter and calibrator should be calibrated annually by a HOKLAS laboratory.
- Relevant calibration certificates are provided in **Appendix D**.

### 3.6 Monitoring Locations

#### 3.6.1 According to the updated EM&A Manual, 25 noise monitoring locations were included during the noise monitoring. The monitoring locations are summarized in **Table 3.3** and shown in **Figure 2b**.

**Table 3.3 Location of Noise Monitoring Station**

| Monitoring Station | Location                       | Land Uses           | Type of Measurement |
|--------------------|--------------------------------|---------------------|---------------------|
| NMS1               | Scenery Court                  | Residential         | Façade              |
| NMS2               | Villa Le Parc                  | Residential         | Façade              |
| NMS3               | Hilton Plaza                   | Residential         | Façade              |
| NMS4               | Tin Liu                        | Residential Village | Façade              |
| NMS5A              | Wai Wah Centre (Site Boundary) | Residential         | Façade              |
| NMS6A              | Wai Wah Centre (Site Boundary) | Residential         | Façade              |
| NMS7               | Tin Liu                        | Residential Village | Façade              |
| NMS8               | Shatin Plaza                   | Residential         | Façade              |
| NMS9               | Lek Yuen Estate                | Residential         | Façade              |
| NMS10A             | Shatin Tsung Tsin School       | School              | Façade              |
| NMS11              | Sheung Wo Che                  | Residential Village | Façade              |
| NMS12              | SKH Holy Spirit Primary School | School              | Façade              |
| NMS13              | Lek Yuen Estate                | Residential         | Façade              |
| NMS14              | Sheung Wo Che                  | Residential Village | Façade              |
| NMS15              | Ha Wo Che                      | Residential Village | Façade              |
| NMS16              | Ha Wo Che                      | Residential Village | Façade              |
| NMS17              | Shatin Pui Ying College        | School              | Façade              |
| NMS18              | Ha Wo Che                      | Residential Village | Façade              |
| NMS19              | Wo Che Estate                  | Residential         | Façade              |
| NMS20              | Wo Che Estate                  | Residential         | Façade              |
| NMS23              | Pai Tau                        | Residential Village | Façade              |
| NMS24              | Shatin Plaza                   | Residential         | Façade              |
| NMS25A             | Sheung Wo Che                  | Residential Village | Façade              |
| NMS26              | Wo Che Estate                  | Residential         | Façade              |
| NMS27              | Jockey Club Ti-I College       | School              | Façade              |

### 3.7 Results and Observations

- 3.7.1 The schedule of noise monitoring in reporting month is provided in **Appendix E**.
- 3.7.2 The exam schedules of the schools and Arrangements on Deferral of Class Resumption for All Schools are provided in **Appendix E**.
- 3.7.3 During the monitoring month, road traffic along Tai Po Road was observed which may affect the monitoring results.
- 3.7.4 According to the onsite observation, no raining was observed and no wind speed over 5 m/s was measured during the noise monitoring. The weather conditions during the monitoring month are provided in **Appendix K**.
- 3.7.5 The daytime noise monitoring data are summarized in **Table 3.4**. Detailed monitoring data are presented in **Appendix G**.

**Table 3.4 Summary of Day Time Noise Impact Monitoring Results**

| Monitoring Station | Leq (30min) Range, dB(A) | Leq (30min) Limit Level, dB(A) |
|--------------------|--------------------------|--------------------------------|
|                    | Construction Noise Level |                                |
| NMS1               | 61.1 – 65.6              | 75                             |
| NMS2               | 53.0 – 55.9              | 75                             |
| NMS3               | 62.5 – 65.7              | 75                             |
| NMS4               | 63.1 – 66.8              | 75                             |
| NMS5A              | 66.4 – 68.6              | 75                             |
| NMS6A              | 68.1 – 72.1              | 75                             |
| NMS7               | 62.1 – 64.3              | 75                             |
| NMS8               | 64.2 – 66.6              | 75                             |
| NMS9               | 65.5 – 68.8              | 75                             |
| NMS10A             | 62.5 – 64.5              | 65/70 <sup>[2]</sup>           |
| NMS11              | 65.3 – 67.2              | 75                             |
| NMS12              | 61.1 – 62.4              | 65/70 <sup>[2]</sup>           |
| NMS13              | 65.1 – 67.7              | 75                             |
| NMS14              | 61.3 – 62.0              | 75                             |
| NMS15              | 59.1 – 60.9              | 75                             |
| NMS16              | 59.9 – 63.2              | 75                             |
| NMS17              | 62.8 – 65.0              | 65/70 <sup>[2]</sup>           |
| NMS18              | 59.4 – 61.4              | 75                             |
| NMS19              | 66.6 – 71.0              | 75                             |
| NMS20              | 61.1 – 64.0              | 75                             |
| NMS23              | 62.2 – 63.9              | 75                             |
| NMS24              | 63.7 – 64.6              | 75                             |
| NMS25A             | 64.5 – 66.8              | 75                             |
| NMS26              | 66.4 – 69.0              | 75                             |
| NMS27              | 61.9 – 63.2              | 65/70 <sup>[2]</sup>           |

Note: 1.  $L_{eq} (30min)$  was measured at day-time (0700-1900) on normal weekdays.  
 2. 70 dB (A) for schools and 65 dB (A) for schools during examination period. The school calendars are provided in **Appendix E**.

- 3.7.6 Regular night time noise monitoring were conducted on 6, 11, 19 and 25 February 2025 and the results are summarized in **Table 3.5**. Detailed monitoring data are presented in **Appendix G**.

**Table 3.5 Summary of Night Time Noise Impact Monitoring Results**

| Monitoring Station | Leq (15min) Range, dB(A)   | Leq (15min) Limit Level, dB(A) | Leq (15min) Baseline, dB(A) |
|--------------------|----------------------------|--------------------------------|-----------------------------|
|                    | Construction Noise Level   |                                |                             |
| NMS1               | 56.9 – 60.3                | 55                             | 61.4                        |
| NMS2               | 51.6 – 52.6                | 55                             | 49.7                        |
| NMS3               | 57.5 – 59.4                | 55                             | 70.9                        |
| NMS4               | 57.0 – 60.0                | 55                             | 62.6                        |
| NMS5A              | 59.8 – 61.7                | 55                             | 67.9                        |
| NMS6A              | 62.9 – 70.1                | 55                             | 71.5                        |
| NMS7               | 56.7 – 56.8                | 55                             | 59.0                        |
| NMS8               | 57.3 – 63.2                | 55                             | 64.4                        |
| NMS9               | 52.4 – 54.1 <sup>[2]</sup> | 55                             | 53.5                        |
| NMS11              | 51.6 – 53.7                | 55                             | 53.2                        |
| NMS13              | 53.1 – 56.7                | 55                             | 57.3                        |
| NMS14              | 48.2 – 55.0 <sup>[2]</sup> | 55                             | 54.1                        |
| NMS15              | 53.7 – 55.3                | 55                             | 58.8                        |
| NMS16              | 54.6 – 55.6                | 55                             | 60.1                        |
| NMS18              | 52.2 – 53.7                | 55                             | 63.2                        |
| NMS19              | 52.8 – 54.5                | 55                             | 61.7                        |
| NMS20              | 50.3 – 53.5                | 55                             | 57.7                        |
| NMS23              | 55.1 – 57.9                | 55                             | 59.9                        |
| NMS24              | 46.5 – 55.8 <sup>[2]</sup> | 55                             | 58.0                        |
| NMS25A             | 54.2 – 57.6                | 55                             | 59.7                        |
| NMS26              | 57.3 – 59.8                | 55                             | 61.2                        |

Note: 1. Leq (15min) was measured at night-time (2300-0700).

2. If measured noise level (Leq) > limit level, Corrected noise level (CNL) is calculated as:

$$10 \times \log \left[ \left( 10^{\frac{\text{Measured noise level, Leq}}{10}} \right) - \left( 10^{\frac{\text{Baseline noise level}}{10}} \right) \right]$$

3. Detailed analysis of each monitoring location is provided in **Appendix G**.

3.7.7 Day time construction noise monitoring was carried out in the reporting month, no Action / Limit Level exceedance was recorded during the period. For night time noise monitoring, no exceedance case due to construction activity was recorded between 2300 and 0700 of the next day during the reporting month.

3.7.8 The Action and Limit Levels for noise impact monitoring have been set and are presented in **Appendix C**.

3.7.9 The Event and Action Plan for noise is given in **Appendix H**.



## **4. LANDSCAPE AND VISUAL**

### **4.1 Audit Requirements**

- 4.1.1 In accordance with the EM&A Manual, the landscape and visual mitigation measures during the construction phase are primarily due to those associated temporary works for the construction of retrofitting noise barriers/enclosures. To ensure compliance with the intended aims of the measures, weekly site inspections are undertaken throughout the construction period.
- 4.1.2 According to the updated EM&A Manual, measures to mitigate landscape and visual impacts during construction should be checked to ensure compliance with the intended aims of the measures. The progress of the engineering works shall be regularly reviewed onsite to identify the earliest practical opportunities for the landscape works to be undertaken. The ET shall report on the Contractor's compliance on a weekly basis.

### **4.2 Results and Observations**

- 4.2.1 Site audits were carried out to monitor and audit the implementation of landscape and visual mitigation measures. The summary of the site audits is given in **Appendix M**.
- 4.2.2 No non-compliance of the landscape and visual impact was recorded in the reporting month.



## **5. WASTE MANAGEMENT**

### **5.1 Audit Requirements**

- 5.1.1 The effective management of waste arising during the construction phase will be monitored through the site audit programme. Regular audits and site inspections should be carried out to ensure that the recommended good site practices and other mitigation measures are implemented by the Contractor.
- 5.1.2 The audit should look at all aspects of on-site waste management practices including the waste generation, storage, recycling, transport and disposal. The aims of waste audit are:
- to ensure the waste arising from the works are handled, stored, collected, transferred and disposed of in an environmentally acceptable manner;
  - verify the implementation status and evaluate the effectiveness of the mitigation measures; and
  - to encourage the reuse and recycling of material.

### **5.2 Results and Observations**

- 5.2.1 C&D materials and wastes sorting were carried out on site. Receptacles were available for C&D wastes and general refuse collection.
- 5.2.2 The amount of wastes generated by the site activities in the reporting month is shown in **Appendix I**.



## **6. SITE INSPECTION**

### **6.1 Site Inspection**

- 6.1.1 Site inspections were carried out weekly to monitor the implementation of proper environmental pollution control and mitigation measures for the Project. A summary of the mitigation measures implementation schedule is provided in **Appendix J**.
- 6.1.2 In the reporting month, four site inspections were carried out on 6, 13, 17 and 25 February 2025. The site inspection held on 17 February 2025 were joint inspection with the IEC, ER, the Contractor and the ET during the reporting period.
- 6.1.3 The follow-up actions requested by ET and IEC during the site inspections were completed as reported by the Contractor. All the rectifications during the reporting period were fulfilled with the requirement of Proposal of Site Inspection, Deficiency and Remedial Action. No outstanding issues were reported during the reporting month. Details of observations recorded during the site inspections are summarized in **Appendix M**.

## **7. ENVIRONMENTAL COMPLAINT AND NON-COMPLIANCE**

### **7.1 Environmental Exceedance**

- 7.1.1 24-hour and 1-hour TSP impact monitoring were carried out in the reporting month, no Action / Limit Level exceedance was recorded during the period.
- 7.1.2 Day time construction noise monitoring was carried out in the reporting month, no Action / Limit Level exceedance was recorded during the period. Regular night time noise monitoring was carried out on 6, 11, 19 and 25 February 2025 and no exceedance case was recorded between 2300 and 0700 of the next day during the reporting month.

### **7.2 Complaints, Notification of Summons and Prosecution**

- 7.2.1 One complaint was received in the reporting month. The summaries are listed below:

- A further complaint of CASE no.: 3-8199986833 was received via 1823 (CASE no.: 3-8596770160) on 28<sup>th</sup> January 2025 and referred to EPD (EPD Ref: RN2794-25). Two other further complaints were received via 1823 on 7<sup>th</sup> February 2025 and 12<sup>th</sup> February 2025 respectively. Another complaint was received by EPD from the same complainant on 7<sup>th</sup> February 2025 (EPD Ref: RN3357-25). The complainant concerned about the noise nuisance generated from night-time construction works near Sha Tin Rural Committee Road and Shatin Plaza. The complaint was referred from AECOM to Environmental Team (ET) on 3<sup>rd</sup> February 2025 9:27, 7<sup>th</sup> February 2025 14:56 and 12<sup>th</sup> February 2025 15:04.

Base on the current information provided, ET checked that there was no evidence showing the Main Contractor had violated the conditions listed in CNPs No.: GW-RN1275-24 and GW-RN1508-24. The Main Contractor was reminded to strictly follow and fully comply with the requirements listed in the CNPs and the mitigation measures stipulated in the EM&A Manual when carrying out construction activities during the restricted hours. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers.

ET carried out regular night-time noise monitoring at NMS9 and NMS24 on 6 ^ 7 February 2025, and NMS8 and NMS24 on 11 ^ 12 February 2025, no exceedance case was found. The noise monitoring results at NMS9 and NMS24 during 6 ^ 7 February 2025 were lower than the limit level after correction while the noise monitoring results at NMS8 and NMS24 on 12 February 2025 were lower than the baseline level.

The Main Contractor was reminded to use the allowable PMEs listed in CNPs condition 3.d for performing night-time construction works. Mitigation measures need to be applied according to the requirements in conditions 3.d and 4.d.

The Main Contractor was advised to provide movable noise barriers on both sides of the PMEs when carrying out road reinstatement works, in order to minimize the noise impact caused by the works.

- 7.2.2 Cumulative complaint log, summaries of complaints, notification of summons and successful prosecutions are presented in **Appendix L**.



## **8. IMPLEMENTATION STATUS OF ENVIRONMENTAL MITIGATION MEASURES**

### **8.1 Implementation Status**

8.1.1 The Contractor has implemented environmental mitigation measures and requirements as stated in the EIA Review Report, the EP and the updated EM&A Manuals. The implementation status of the mitigation measures during the reporting month is summarized in **Appendix J**.

8.1.2 According to the environmental audit performed in the reporting month, the following recommendations were made:

#### Air Quality Impact

- Mini-stockpiles should be covered properly. (Zone 3)
- Stockpile should be covered with tarpaulin for dust suppression. (Zone 3)
- Stockpile should be covered with tarpaulin or removed for dust suppression. (Zone 3)

#### Construction Noise Impact

- No specific observation was identified in the reporting month.

#### Water Quality Impact

- Contractor was reminded to clear stagnant water accumulated after raining. (Zone 3)

#### Chemical and Waste Management

- No specific observation was identified in the reporting month.

#### Land Contamination

- No specific observation was identified in the reporting month.

#### Landscape and Visual Impact

- No specific observation was identified in the reporting month.

#### General Condition

- No specific observation was identified in the reporting month.

#### Permit / Licenses

- No specific observation was identified in the reporting month.



## **9. FUTURE KEY ISSUES**

### **9.1 Construction Programme for the Next Month**

9.1.1 During the coming reporting month, the principal work activities within the site include:

- (1) Irrigation Work at Zone 1 and 2
- (2) Planting Work (Tree / Shrub) at Zone 1 and 2
- (3) Noise Barrier Remaining Installation at Zone 1, 2, 3, 4 and 5
- (4) Construction of Draw pit and Pillar box at Zone 2
- (5) Road surface Maintenance at Zone 3, 4 and 5
- (6) Tree Works (including preservation / felling/ pruning/ transplantation) at Zone 3
- (7) Slope works at Zone 3
- (8) Irrigation Work + Landscaping Works at Zone 4
- (9) Slope Landscaping Works + Irrigation System for Landscaping on Slope at Zone 5

### **9.2 Key Issues for the Coming Month**

9.2.1 Potential environmental impacts arising from the above construction activities are mainly associated with construction dust, construction noise, water quality, waste management and landscape and visual impact.

### **9.3 Monitoring Schedules for the Next Month**

9.3.1 The tentative schedules for environmental monitoring in the coming month are provided in **Appendix E**.

## **10. CONCLUSIONS**

10.1.1 24-hour and 1-hour TSP impact monitoring were carried out in the reporting month, no Action / Limit Level exceedance was recorded during the period.

10.1.2 Day time construction noise monitoring was carried out in the reporting month, no Action / Limit Level exceedance was recorded during the period.

10.1.3 Regular nighttime noise monitoring was carried out on 6, 11, 19 and 25 February 2025, respectively and no exceedance case was recorded between 2300 and 0700 of the next day during the reporting month.

10.1.4 Four site inspections were carried out on 6, 13, 17 and 25 February 2025. Recommendations on mitigation measures on water quality, chemical and waste management and land contamination were given to the Contractor for remediating the deficiencies identified during the site inspections.

10.1.5 One complaint was received in the reporting month. The summaries are listed below:

- A further complaint of CASE no.: 3-8199986833 was received via 1823 (CASE no.: 3-8596770160) on 28<sup>th</sup> January 2025 and referred to EPD (EPD Ref: RN2794-25). Two other further complaints were received via 1823 on 7<sup>th</sup> February 2025 and 12<sup>th</sup> February 2025 respectively. Another complaint was received by EPD from the same complainant on 7<sup>th</sup> February 2025 (EPD Ref: RN3357-25). The complainant concerned about the noise nuisance generated from night-time construction works near Sha Tin Rural Committee Road and Shatin Plaza. The complaint was referred from AECOM to Environmental Team (ET) on 3<sup>rd</sup> February 2025 9:27, 7<sup>th</sup> February 2025 14:56 and 12<sup>th</sup> February 2025 15:04.

## FUGRO TECHNICAL SERVICES LIMITED


Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : [matlab@fugro.com](mailto:matlab@fugro.com)  
Website : [www.fugro.com](http://www.fugro.com)



### Figure 1

### Project General Layout

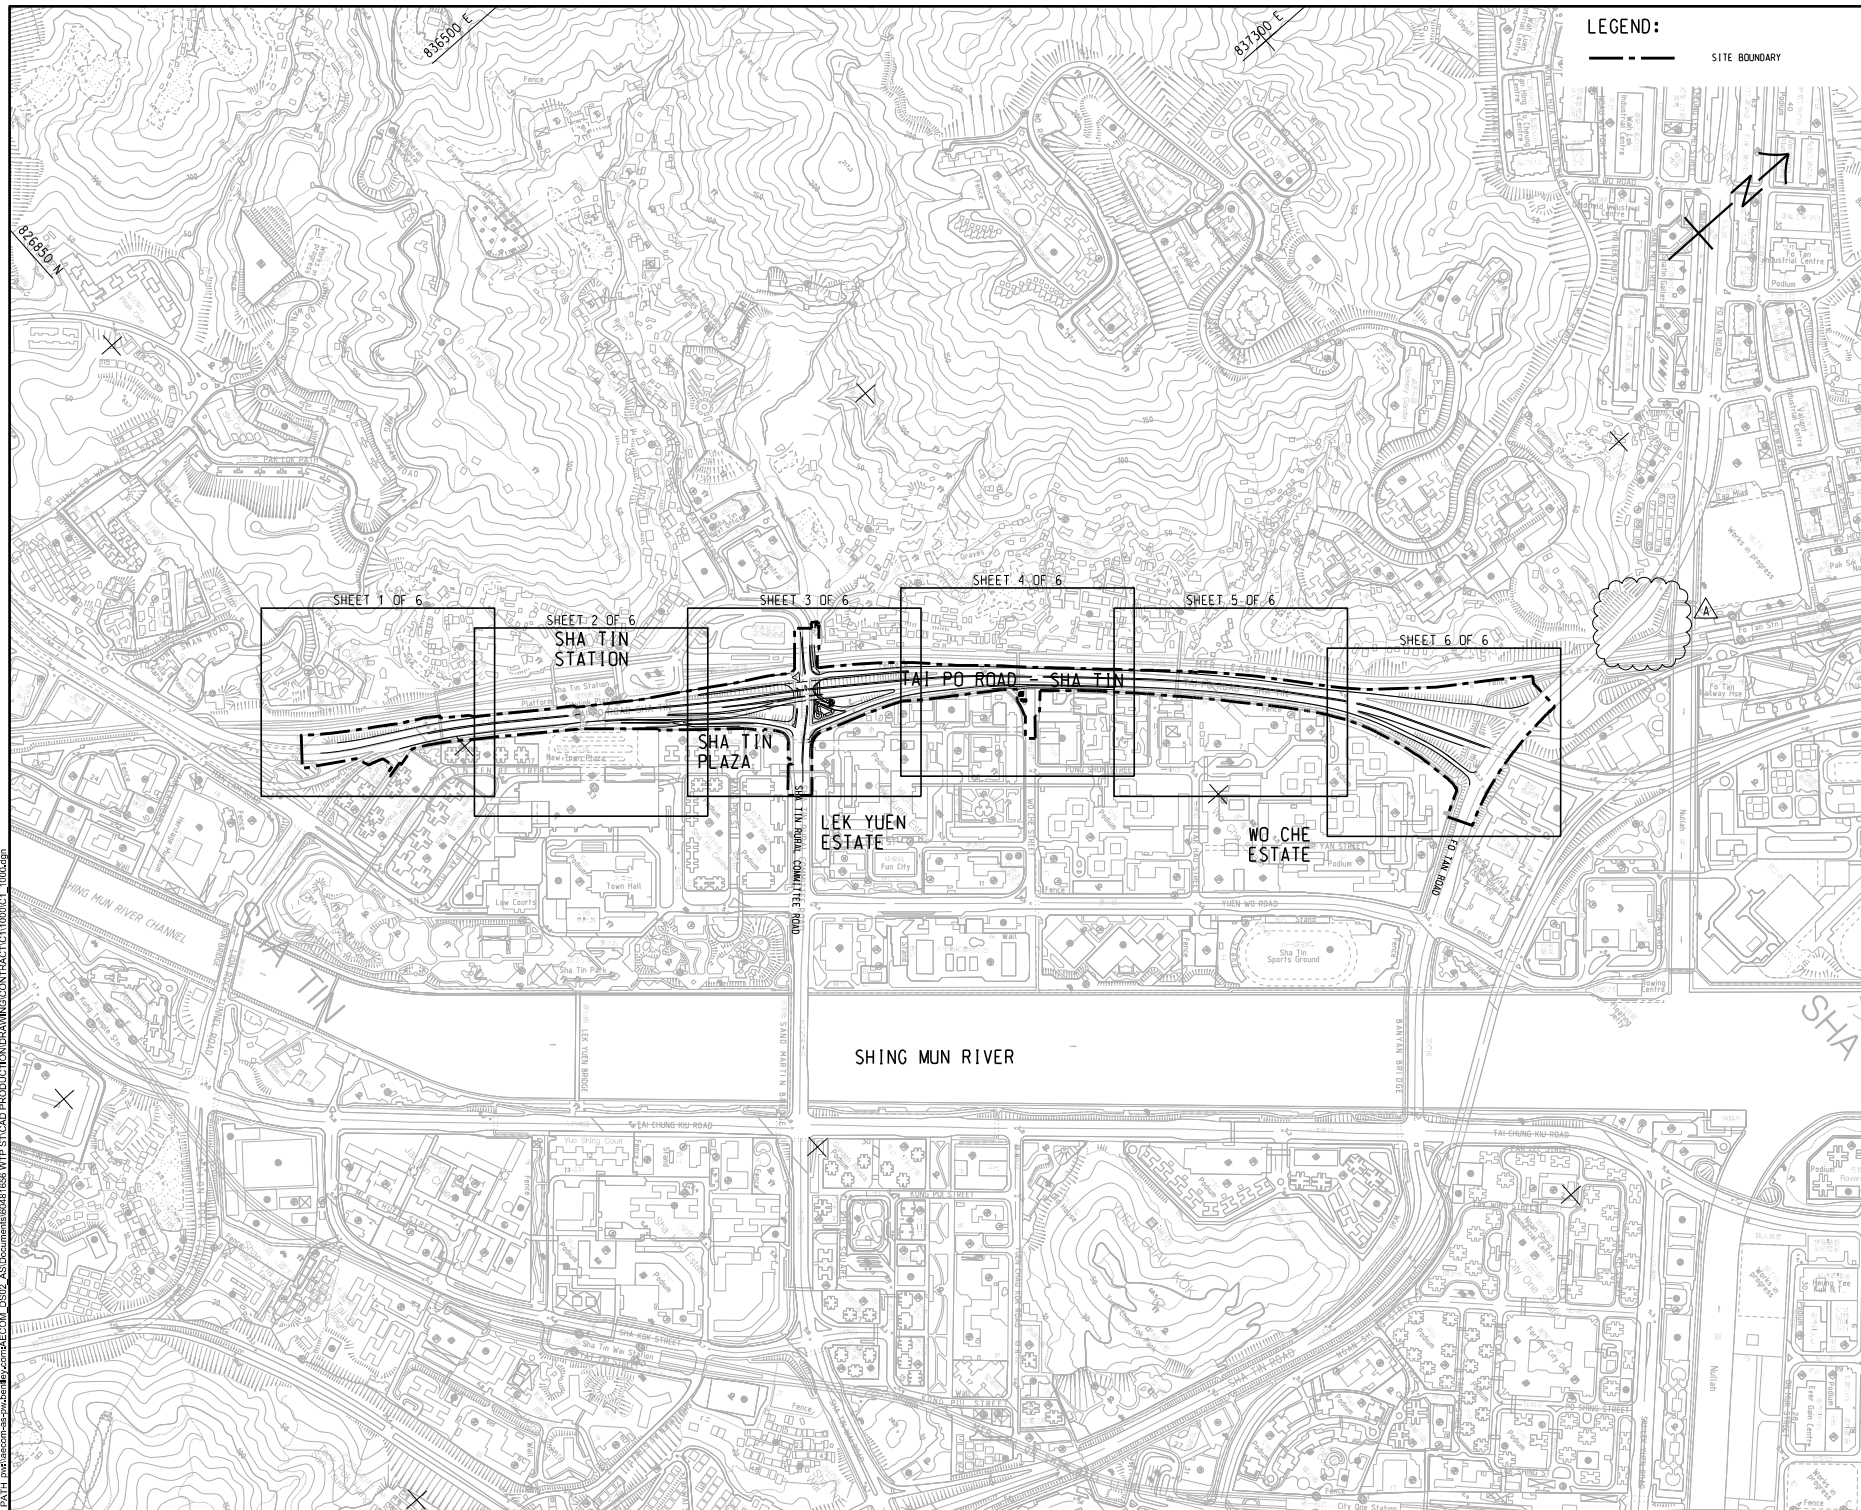

LEGEND:

SITE BOUNDARY

**AECOM**PROJECT  
題目

# ROAD WIDENING AND RETROFITTING NOISE BARRIERS ON TAI PO ROAD (SHA TIN SECTION)

**CLIENT**

CONSULTANT  
工務局顧問公司

AECOM Asia Company Ltd.  
www.aecom.com

**SUB-CONSULTANTS**  
分判工程顧問公司

**ISSUE/REVISION**  
4X/17

|          |            |                      |            |
|----------|------------|----------------------|------------|
|          |            |                      |            |
|          |            |                      |            |
|          |            |                      |            |
|          |            |                      |            |
| A        | FEB, 18    | TENDER ADDENDUM NO.2 | BBC        |
| •        | JAN, 18    | TENDER DRAWING       | BCC        |
| IR<br>條訂 | DATE<br>日期 | DESCRIPTION<br>內容摘要  | CHK.<br>核對 |

STATUS  
EST 1978

**SCALE**

A1 1 : 4000

**KEY PLAN**  
索引图

**DIMENSION UNIT**

METRES

FIGURE 1.1a

CONTRACT NO.

NE/2017/05


SHEET TITLE  
圖紙名稱

KEY PLAN  
FIGURE 1.1a

**SHEET NUMBER**  
100-42-AC-100

60481656/C1/1000A

Project Management In-charge: Approved: CWN  
Designer: FMSD Checked: BCC  
ISO A1 84mm x 84mm  
16/12/18  
PLOT FILE BY: XESB  
DATE: 16/12/18  
PROJECT: PE1 TAI PO ROAD  
DRAWING NO: 60481656/C1/1001  
SHEET: 1 OF 6  
PROJECT: ROAD WIDENING AND RETROFITTING NOISE BARRIERS ON TAI PO ROAD (SHA TIN SECTION)  
DRAWING NO: 60481656/C1/1001  
SHEET: 1 OF 6

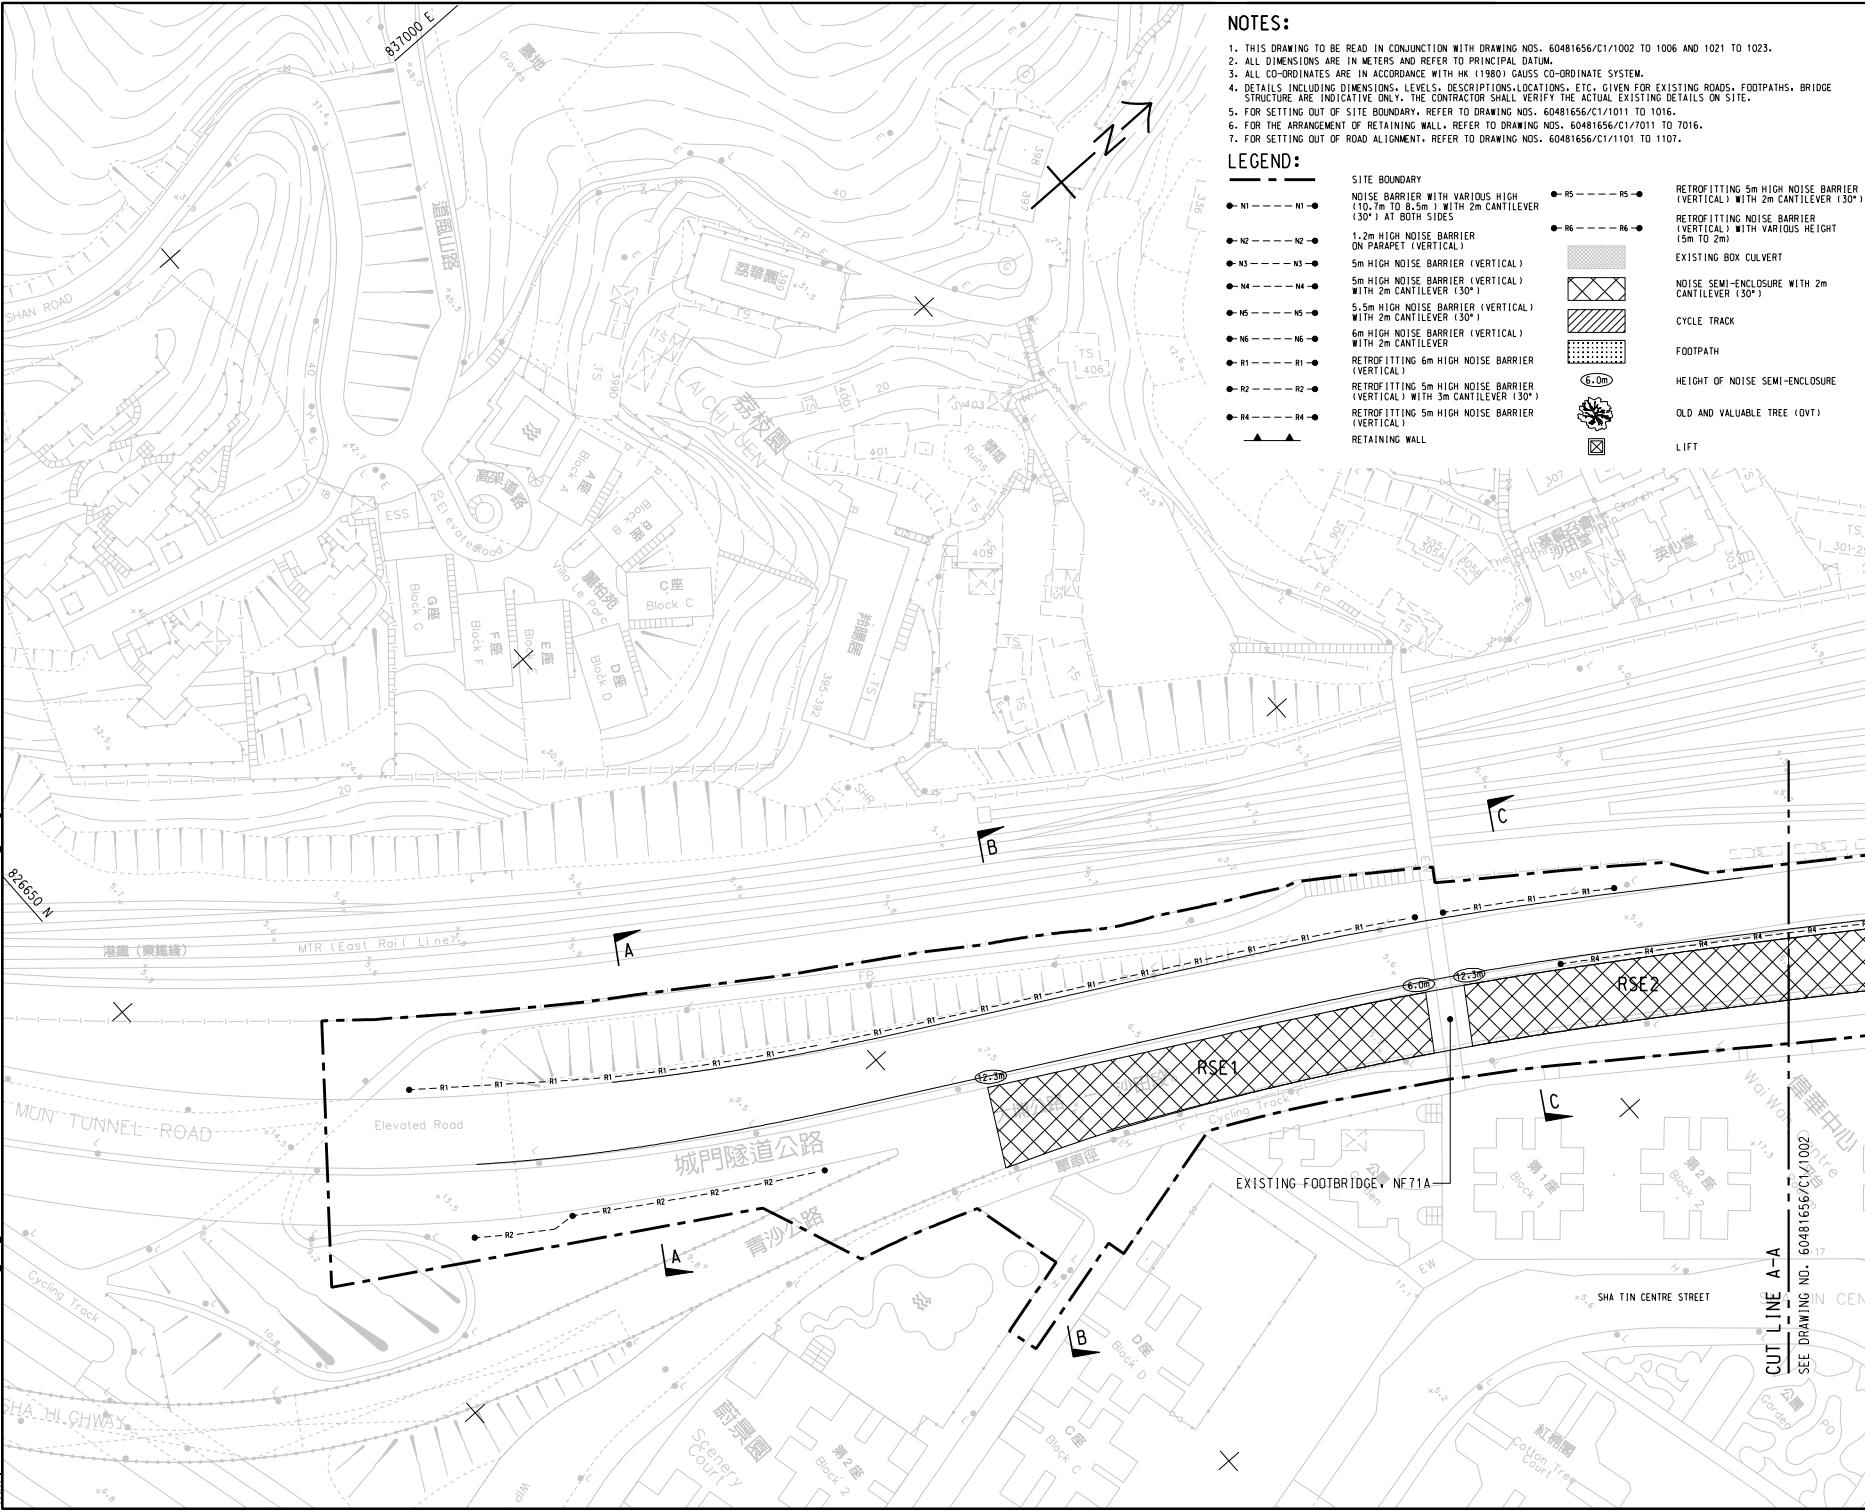


NOTES:

1. THIS DRAWING TO BE READ IN CONJUNCTION WITH DRAWING NOS. 60481656/C1/1002 TO 1006 AND 1021 TO 1023.
2. ALL DIMENSIONS ARE IN METERS AND REFER TO PRINCIPAL DATUM.
3. ALL CO-ORDINATES ARE IN ACCORDANCE WITH HK (1980) GAUSS CO-ORDINATE SYSTEM.
4. DETAILS INCLUDING DIMENSIONS, LEVELS, DESCRIPTIONS, LOCATIONS, ETC. GIVEN FOR EXISTING ROADS, FOOTPATHS, BRIDGE STRUCTURE ARE INDICATIVE ONLY. THE CONTRACTOR SHALL VERIFY THE ACTUAL EXISTING DETAILS ON SITE.
5. FOR SETTING OUT OF SITE BOUNDARY, REFER TO DRAWING NOS. 60481656/C1/1011 TO 1016.
6. FOR THE ARRANGEMENT OF RETAINING WALL, REFER TO DRAWING NOS. 60481656/C1/1011 TO 1016.
7. FOR SETTING OUT OF ROAD ALIGNMENT, REFER TO DRAWING NOS. 60481656/C1/1101 TO 1107.

LEGEND:

- N1 --- N1 ● NOISE BARRIER WITH VARIOUS HIGH (10.7m TO 8.5m) WITH 2m CANTILEVER (30°) AT BOTH SIDES
- N2 --- N2 ● 1.2m HIGH NOISE BARRIER ON PARALLEL VERTICAL
- N3 --- N3 ● 5m HIGH NOISE BARRIER (VERTICAL)
- N4 --- N4 ● 5m HIGH NOISE BARRIER (VERTICAL) WITH 2m CANTILEVER (30°)
- N5 --- N5 ● 5.5m HIGH NOISE BARRIER (VERTICAL) WITH 2m CANTILEVER (30°)
- N6 --- N6 ● 6m HIGH NOISE BARRIER (VERTICAL) WITH 2m CANTILEVER
- R1 --- R1 ● RETROFITTING 6m HIGH NOISE BARRIER (VERTICAL)
- R2 --- R2 ● RETROFITTING 5m HIGH NOISE BARRIER (VERTICAL) WITH 3m CANTILEVER (30°)
- R4 --- R4 ● RETROFITTING 5m HIGH NOISE BARRIER (VERTICAL)
- ▲▲▲ RETAINING WALL
- R5 --- R5 ● RETROFITTING 5m HIGH NOISE BARRIER (VERTICAL) WITH 2m CANTILEVER (30°)
- R6 --- R6 ● RETROFITTING NOISE BARRIER (VERTICAL) WITH VARIOUS HEIGHT (5m TO 2m)
- EXISTING BOX CULVERT
- NOISE SEMI-ENCLOSURE WITH 2m CANTILEVER (30°)
- CYCLE TRACK
- FOOTPATH
- HEIGHT OF NOISE SEMI-ENCLOSURE
- OLD AND VALUABLE TREE (OVT)
- LIFT

**AECOM**  
PROJECT  
ROAD WIDENING AND RETROFITTING NOISE BARRIERS ON TAI PO ROAD (SHA TIN SECTION)  
CLIENT  
土木工務發展局  
Civil Engineering and Development Department  
CONSULTANT  
AECOM  
AECOM Asia Company Ltd.  
www.aecom.com  
SUB-CONSULTANTS  
SALIMAN  
ISSUE/REVISION  
SCALE  
DIMENSION UNIT  
A1 1:500 METRES  
KEY PLAN  
CONTRACT NO.  
NE/2017/05  
SHEET TITLE  
GENERAL LAYOUT PLAN  
FIGURE 1,1 b  
SHEET NUMBER  
60481656/C1/1001

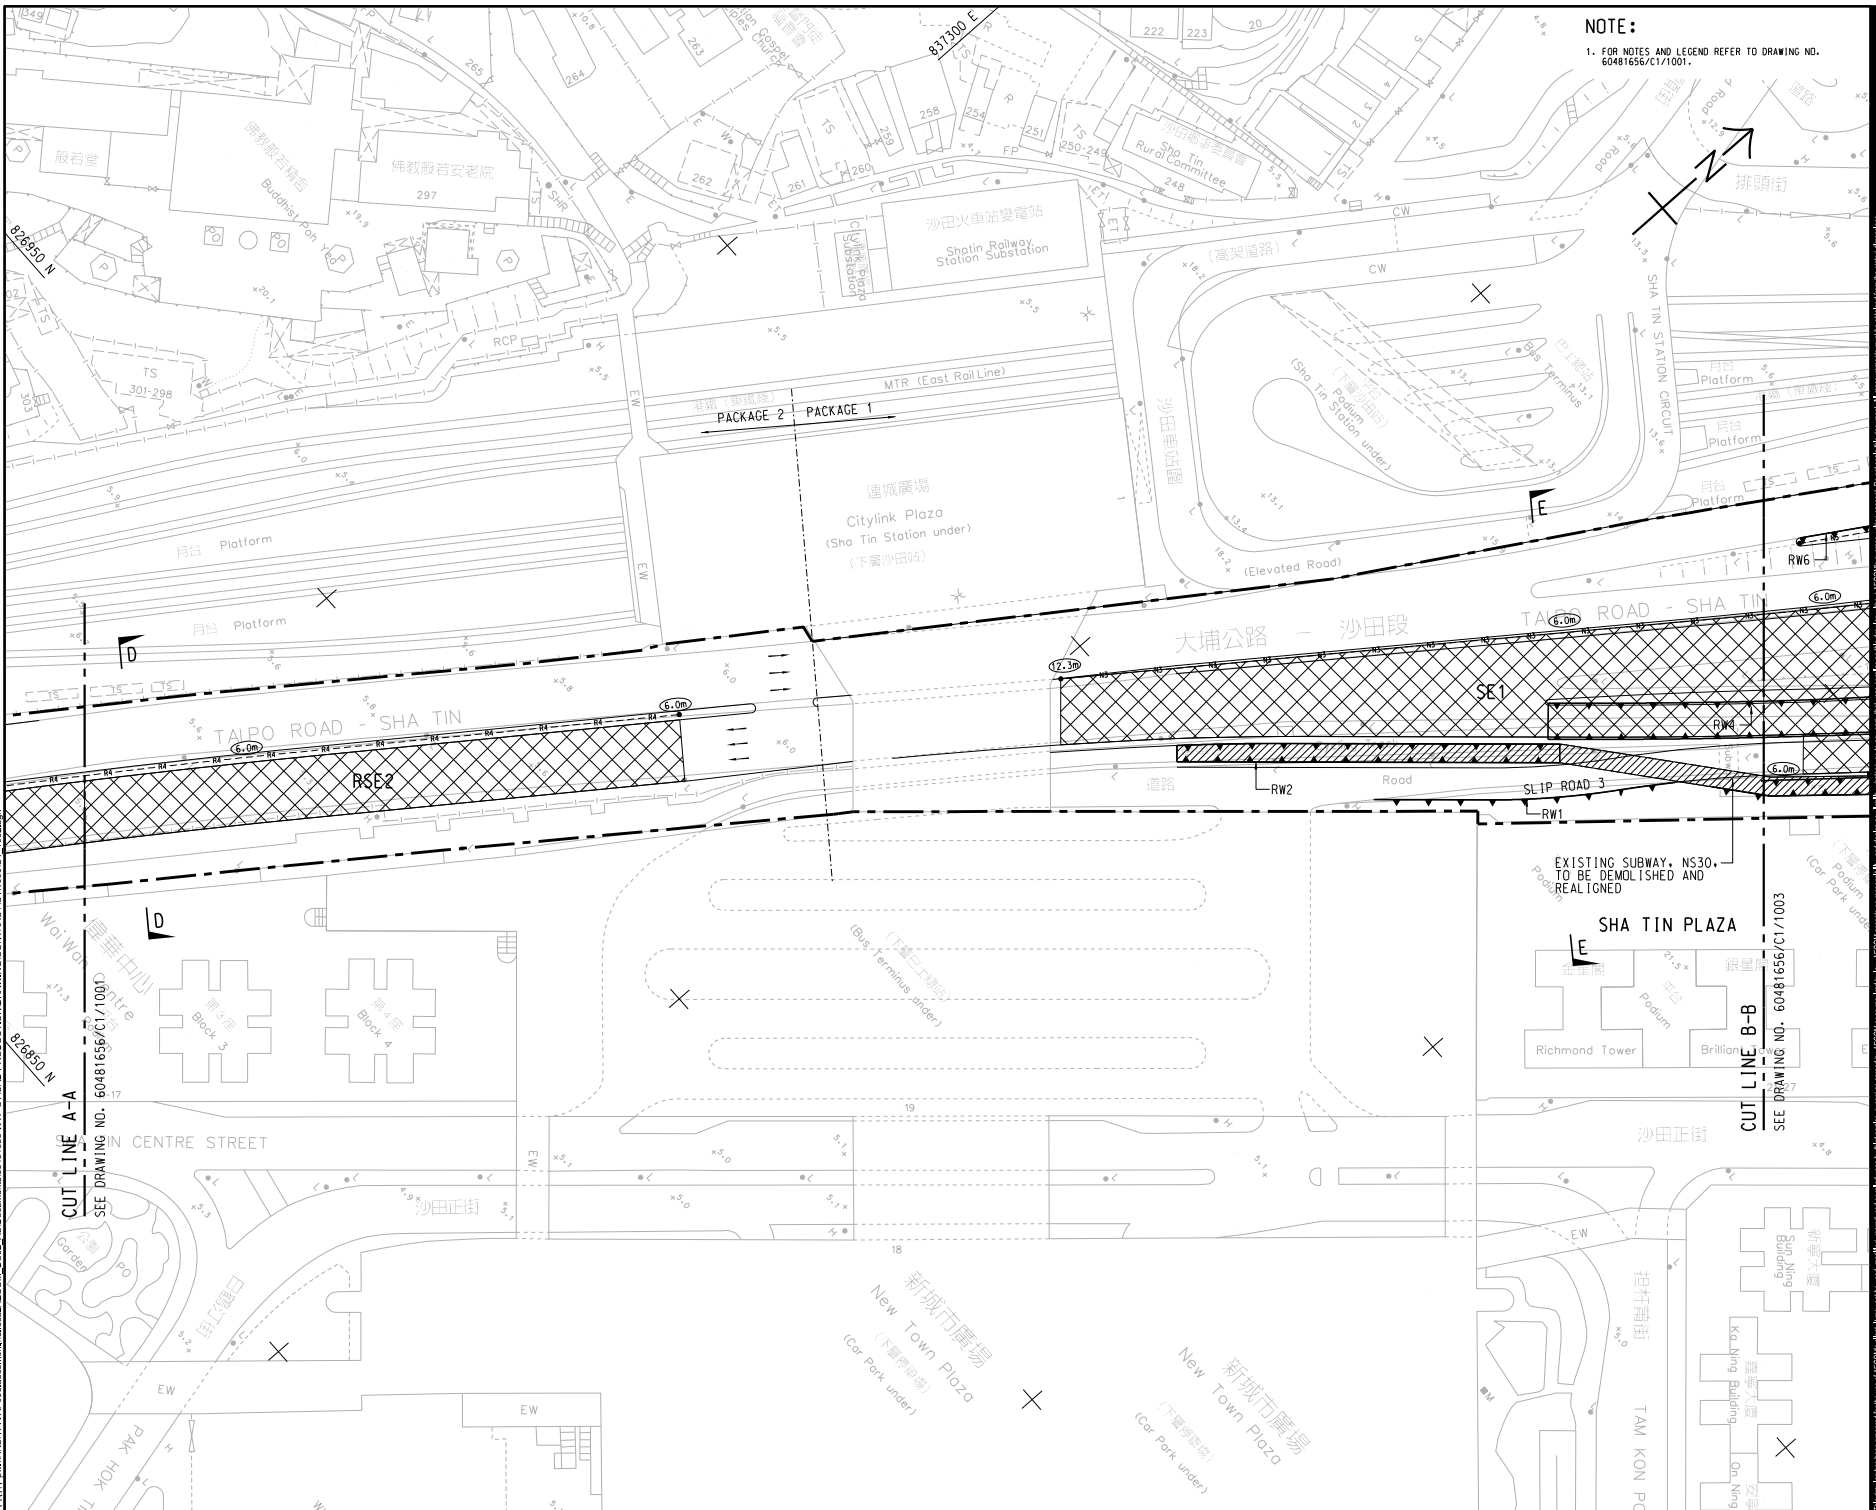

1. FOR NOTES AND LEGEND REFER TO DRAWING NO.  
60481656/C1/1001.

PROJECT  
項目

**CLIENT**  
業主



**SUB-CONSULTANTS**  
分判工程顧問公司


**ISSUE/REVISION**  
4/5/17

[illegible]STATUS  
 地位

---

|                    |                               |
|--------------------|-------------------------------|
| <b>SCALE</b><br>比例 | <b>DIMENSION UNIT</b><br>尺寸單位 |
| A1 1 : 500         | METRES                        |

**KEY PLAN** A1 1:40000

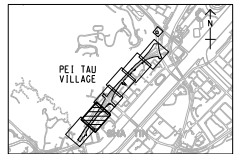

CONTRACT NO.

NE/2017/05

**SHEET TITLE**

## GENERAL LAYOUT PLAN


FIGURE 1.1b

SHEET 2 OF 6

**SHEET NUMBER**

60481656/C1/1002



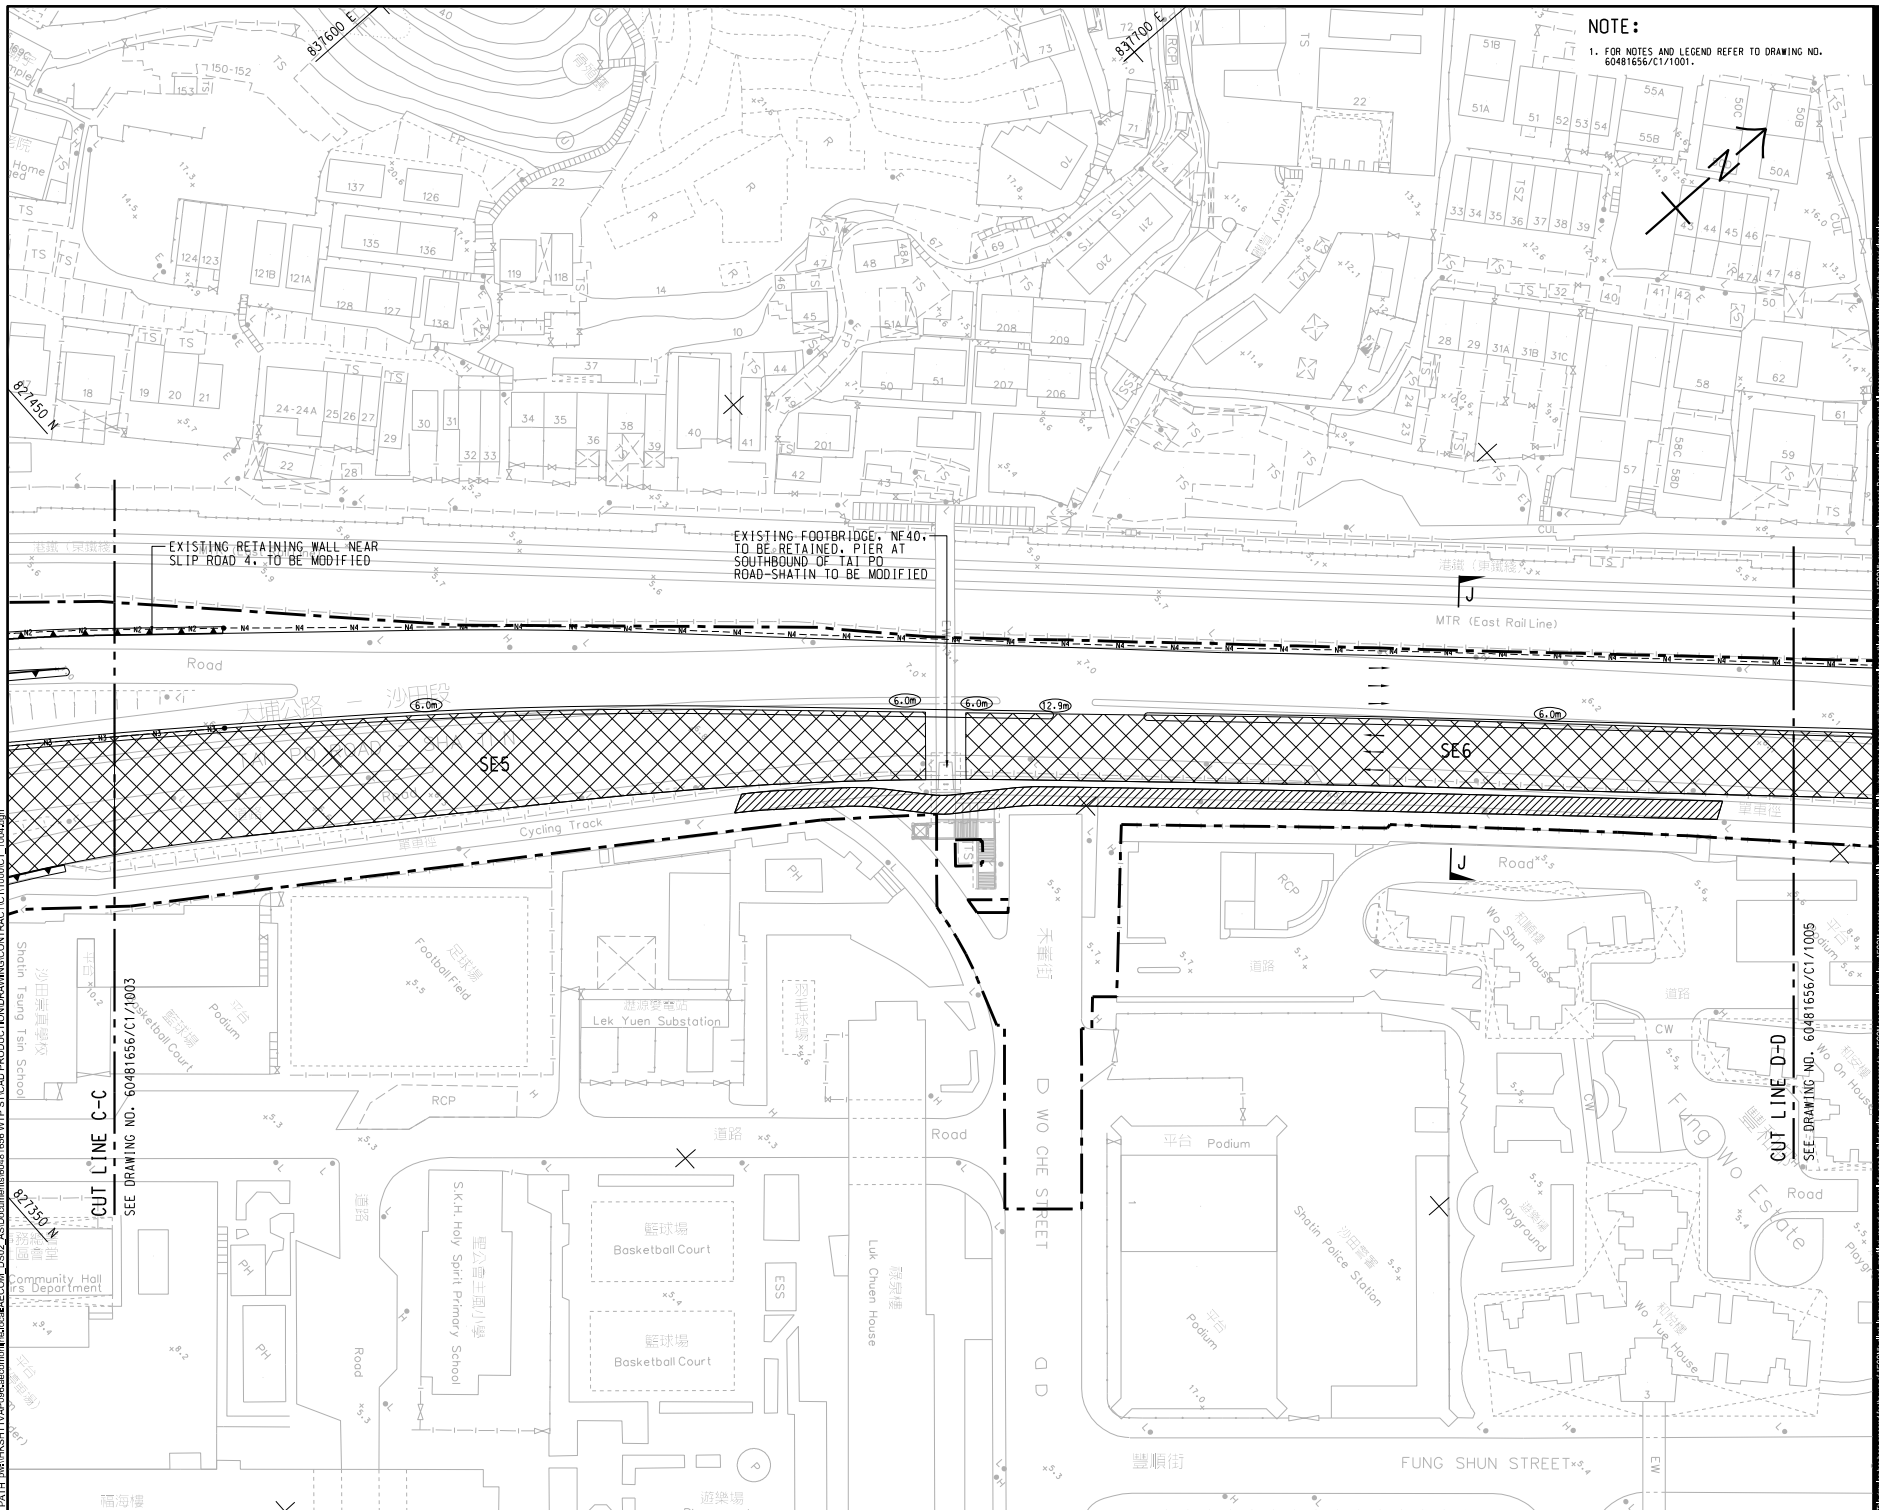

NOTE:

1. FOR NOTES AND LEGEND REFER TO DRAWING NO.  
60481656/C1/1001.



PROJECT

# ROAD WIDENING AND RETROFITTING NOISE BARRIERS ON TAI PO ROAD (SHA TIN SECTION)

**CLIENT**



土木工程拓展署  
Civil Engineering and  
Development Department

CONSULTANT

AECOM Asia Company Ltd.  
www.aecom.com

## SUB-CONSULTANTS

**ISSUE/REVISION**

|          |            |                     |           |
|----------|------------|---------------------|-----------|
|          |            |                     |           |
|          |            |                     |           |
|          |            |                     |           |
|          |            |                     |           |
|          |            |                     |           |
|          |            |                     |           |
|          | JAN. 18    | TENDER DRAWING      | BCC       |
| IR<br>修訂 | DATE<br>日期 | DESCRIPTION<br>內容摘要 | CHK<br>核對 |

STATUS

**SCALE**


A1 1 : 500

**DIMENSION UNIT**

METRES

**KEY PLAN** A1 1:40000

00

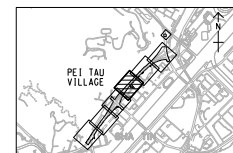

CONTRACT NO

NF/2017/05

SHEET TITLE

## GENERAL LAYOUT PLAN

FIGURE 1.1b

**SHEET NUMBER**

60481656/C1/1004

SHEET 4 OF 6

NOTE:

1. FOR NOTES AND LEGEND REFER TO DRAWING NO.  
60481656/C1/1001.

**AECOM**

## PROJECT

## ROAD WIDENING AND RETROFITTING NOISE BARRIERS ON TAI PO ROAD (SHA TIN SECTION)

**CLIENT**



土木工程拓展署  
Civil Engineering and  
Development Department

CONSULTANT  
工業設計公司

**AECOM Asia Company Ltd.**  
www.aecom.com

**SUB-CONSULTANTS**  
 分包工程顧問公司

苏州工业园区公司

**ISSUE/REVISION**

|    |         |                |     |
|----|---------|----------------|-----|
|    |         |                |     |
|    |         |                |     |
|    |         |                |     |
|    |         |                |     |
|    |         |                |     |
| -  | JAN. 18 | TENDER DRAWING | BCC |
| NR | DATE    | DESCRIPTION    | CHK |

**STATUS**


**SCALE**

**A1 1 : 500**

**DIMENSION UNIT**

METRES

**KEY PLAN** A1 1:40000

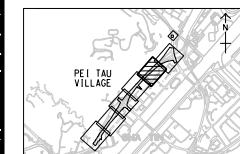**CONTRACT NO.**

NE/2017/05

**SHEET TITLE**

## GENERAL LAYOUT PLAN

FIGURE 1.1b

SHEET 5 OF 6

**SHEET NUMBER**

60481656/C1/1005

PROJECT  
項目

# ROAD WIDENING AND RETROFITTING NOISE BARRIERS ON TAI PO ROAD (SHA TIN SECTION)

**CLIENT**  
業主

CONSULTANT  
工程顧問公司

AECOM Asia Company Ltd.  
www.aecom.com

**SUB-CONSULTANTS**  
分判工程顧問公司

**ISSUE/REVISION**

|          |            |                      |            |
|----------|------------|----------------------|------------|
|          |            |                      |            |
|          |            |                      |            |
|          |            |                      |            |
|          |            |                      |            |
|          |            |                      |            |
| A        | FEB. 18    | TENDER ADDENDUM NO.2 | BCC        |
| -        | JAN. 18    | TENDER DRAWING       | BCC        |
| IR<br>修订 | DATE<br>日期 | DESCRIPTION<br>内容摘要  | CHK.<br>复核 |

STATUS  
地位

---


SCALE  
比例

**DIMENSION UNIT**  
尺寸單位

A1 1 : 500

METRES

**KEY PLAN** A1 1:40000

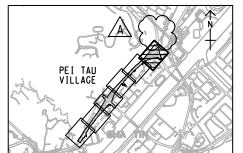

**CONTRACT NO.**  
C-67-10708

NE/2017/05

SHEET TITLE  
圖紙名稱

---

## GENERAL LAYOUT PLAN

FIGURE 1.1b

SHEET 6 OF 6


**SHEET NUMBER**

國成編覽

60481656/C1/1006A

NOTE:

1. FOR NOTES AND LEGEND REFER TO DRAWING NO.  
60481656/C1/1001.

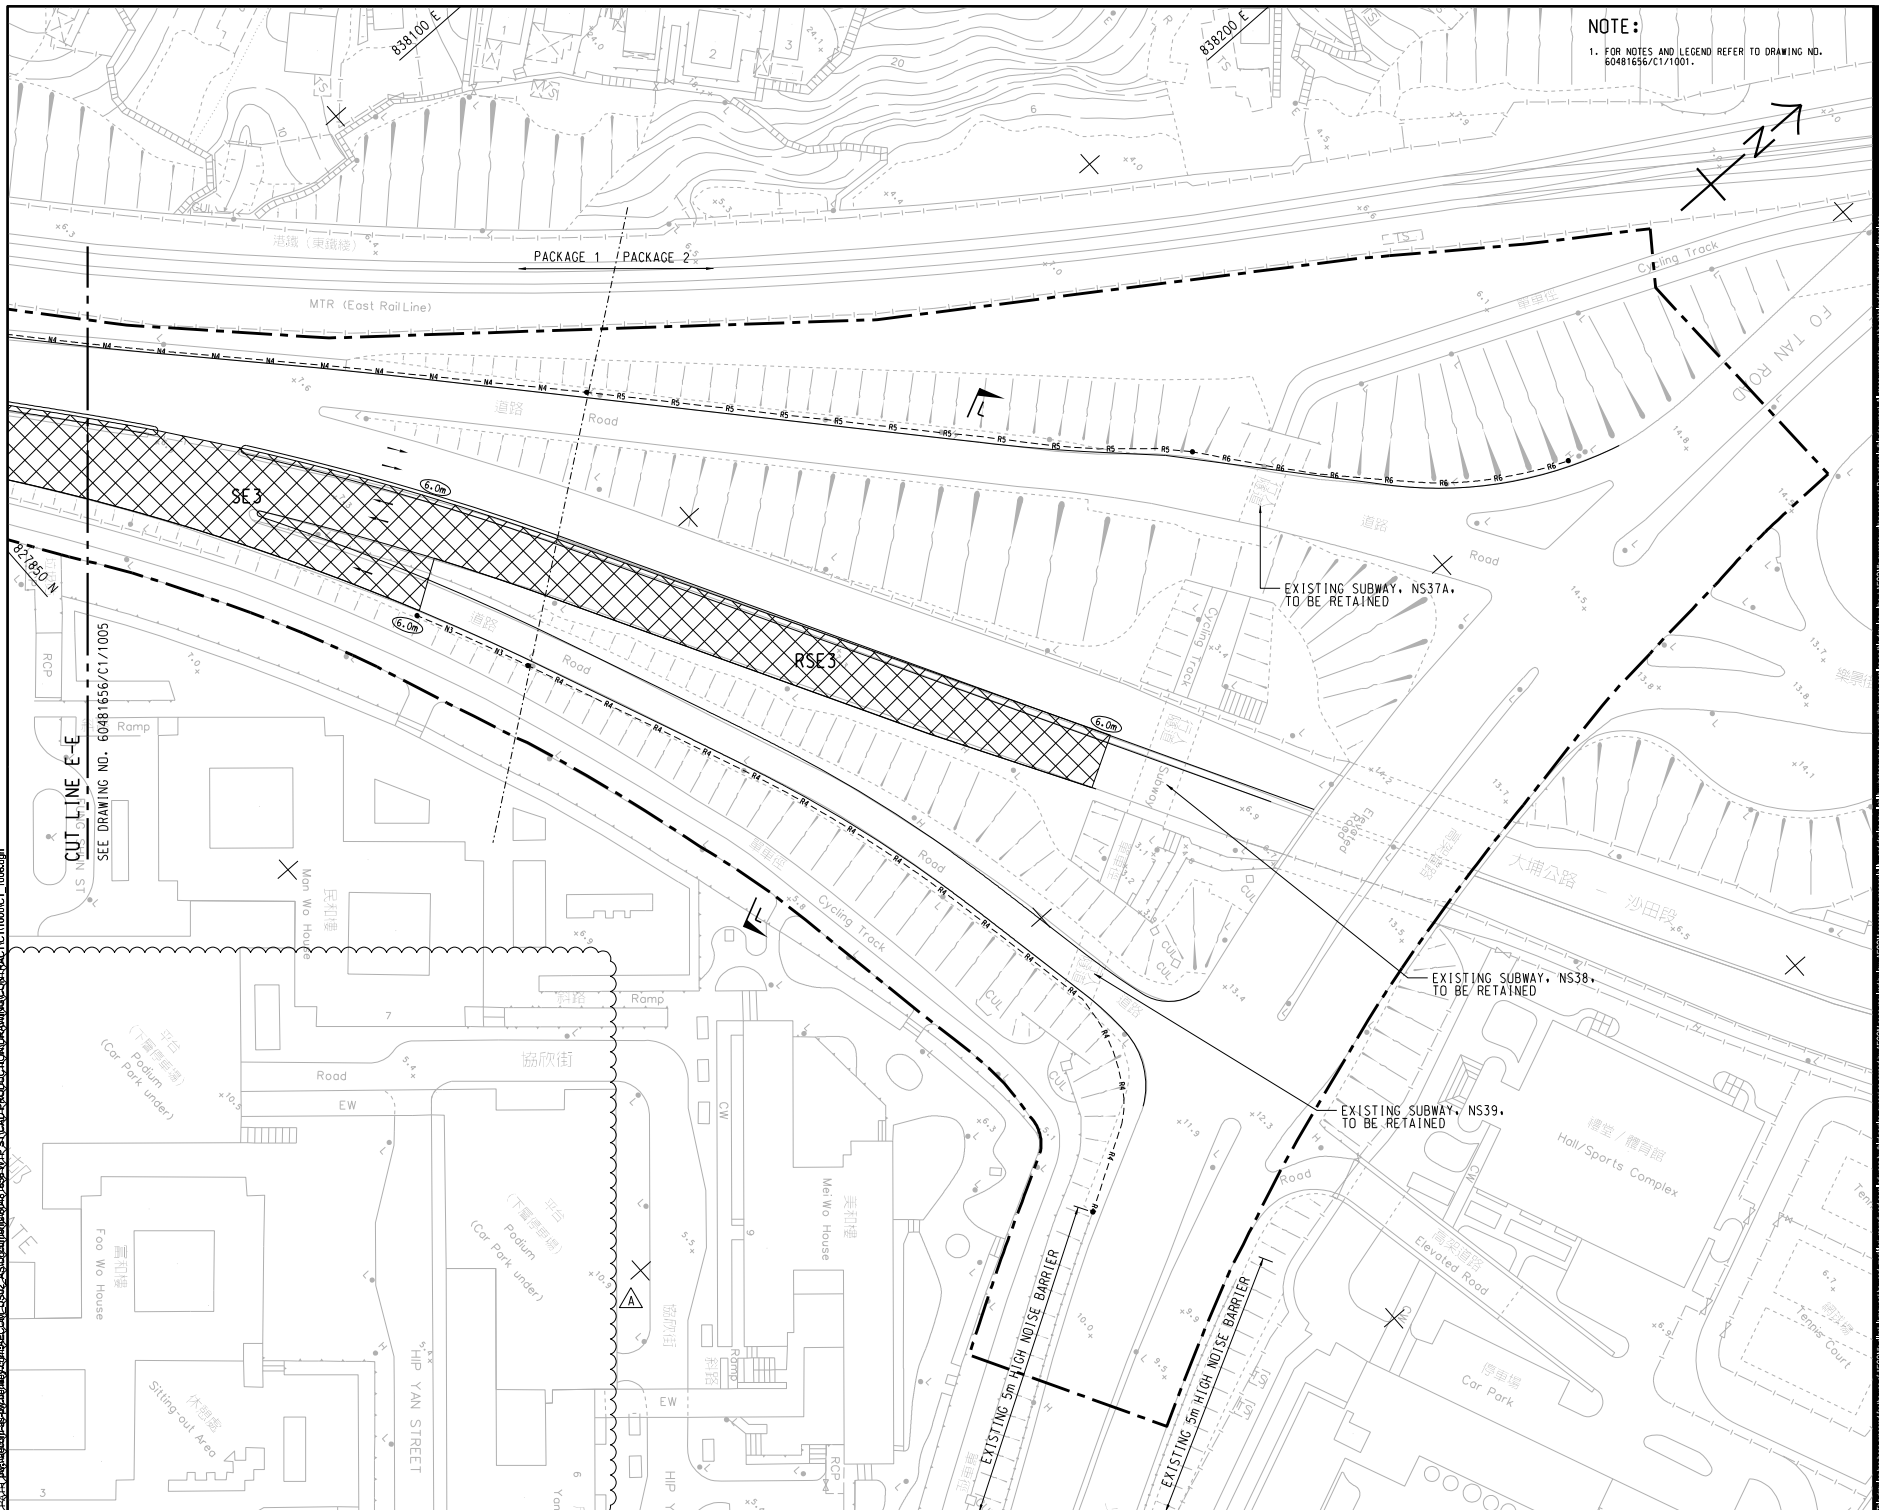

## FUGRO TECHNICAL SERVICES LIMITED

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : [matlab@fugro.com](mailto:matlab@fugro.com)  
Website : [www.fugro.com](http://www.fugro.com)



### Figure 2a

#### Air Monitoring Locations

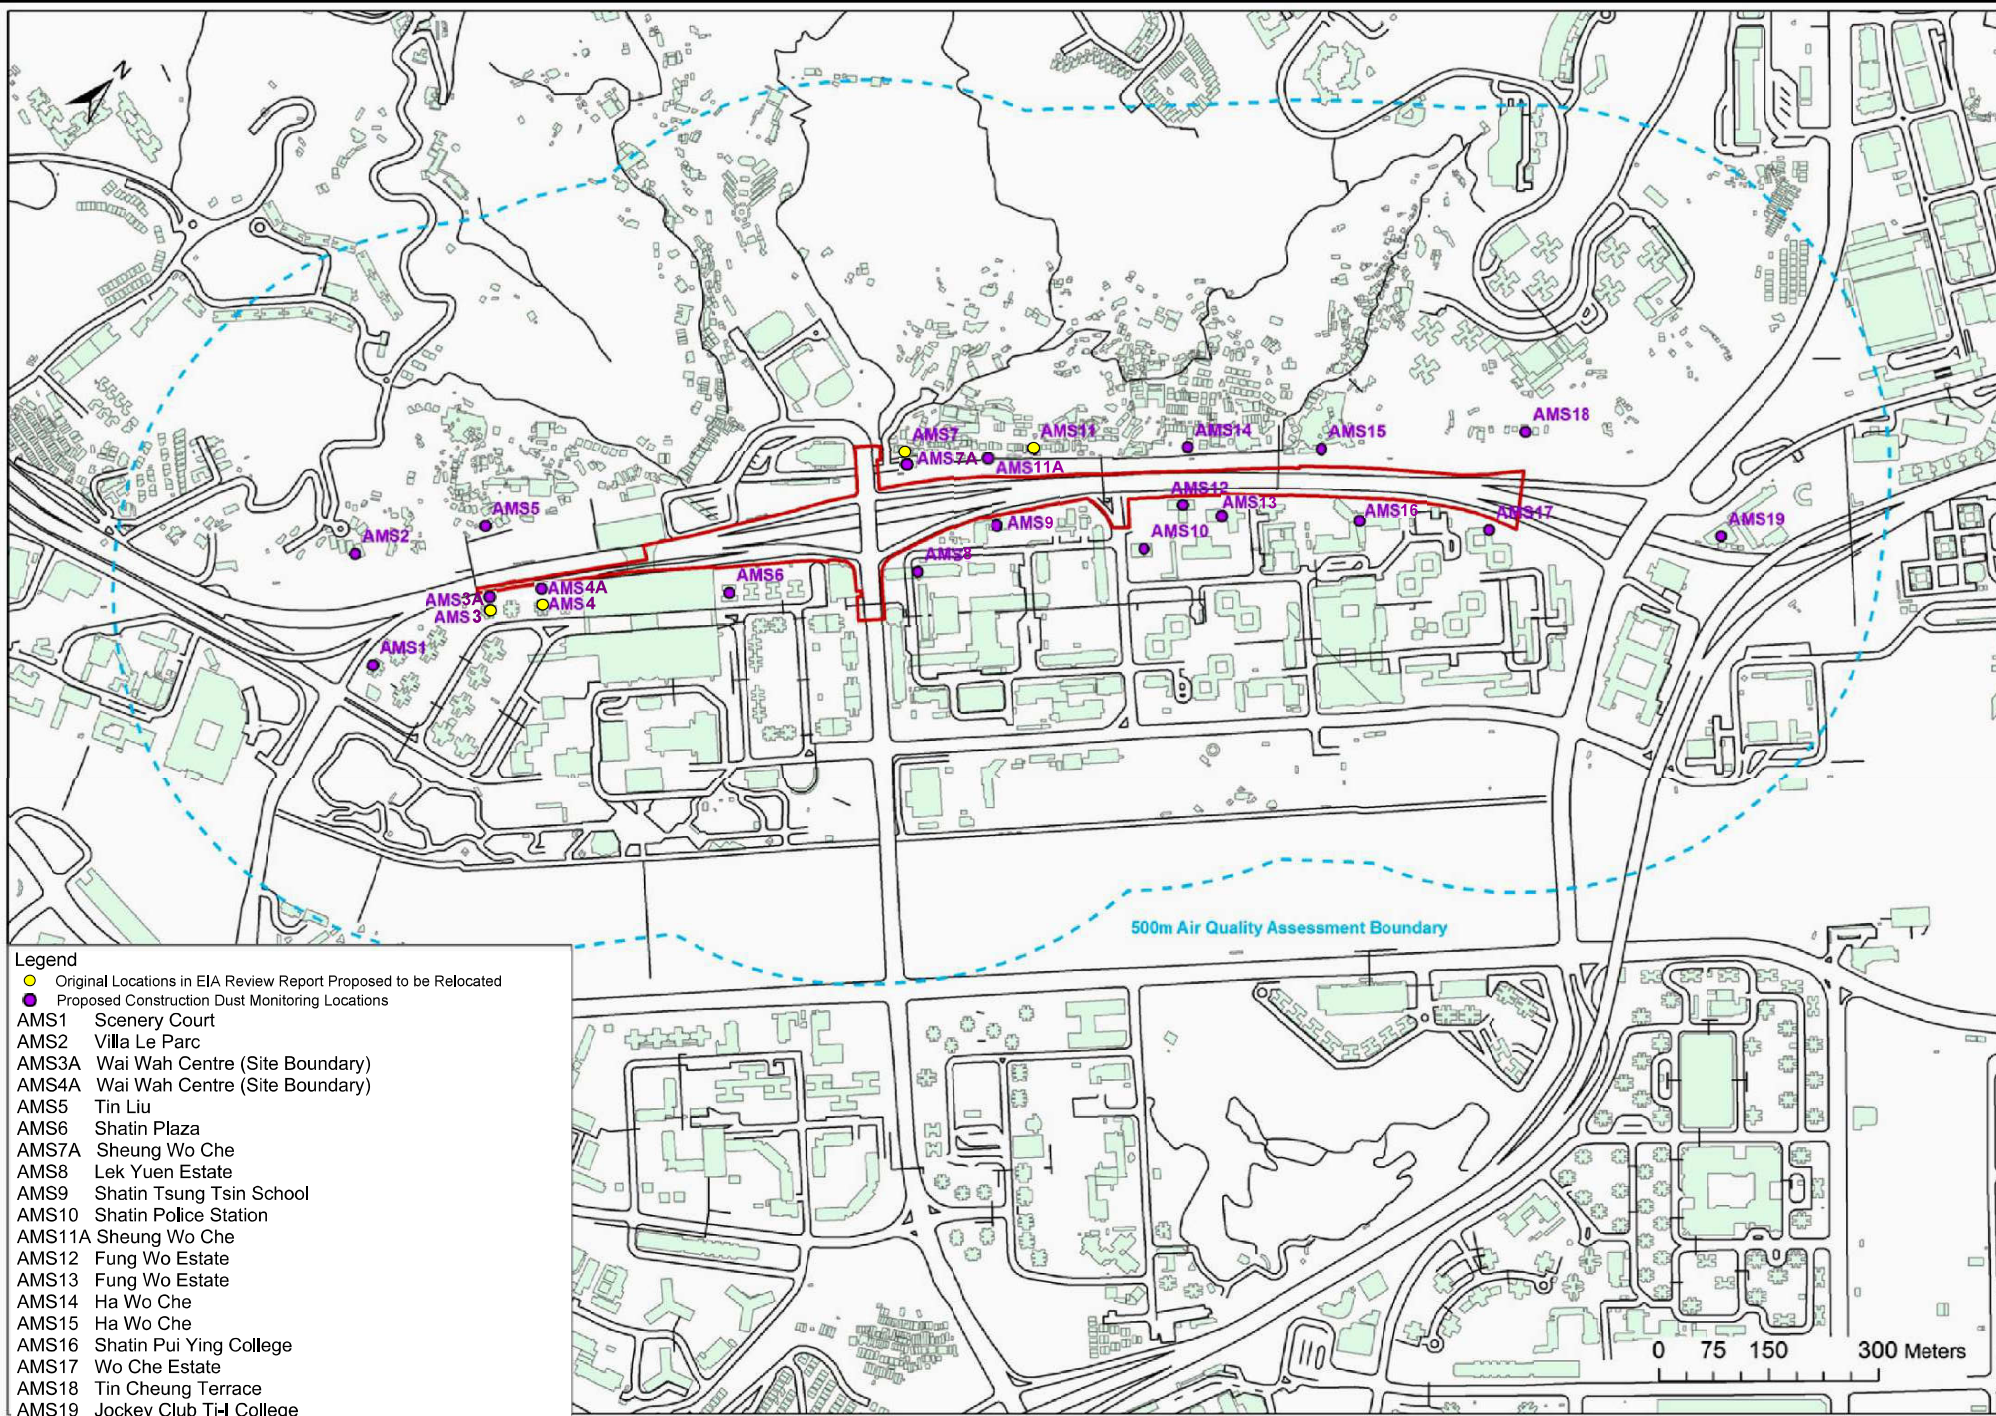


Figure 2a Air Quality Monitoring Locations

## FUGRO TECHNICAL SERVICES LIMITED

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : [matlab@fugro.com](mailto:matlab@fugro.com)  
Website : [www.fugro.com](http://www.fugro.com)



### Figure 2b

#### Noise Monitoring Locations

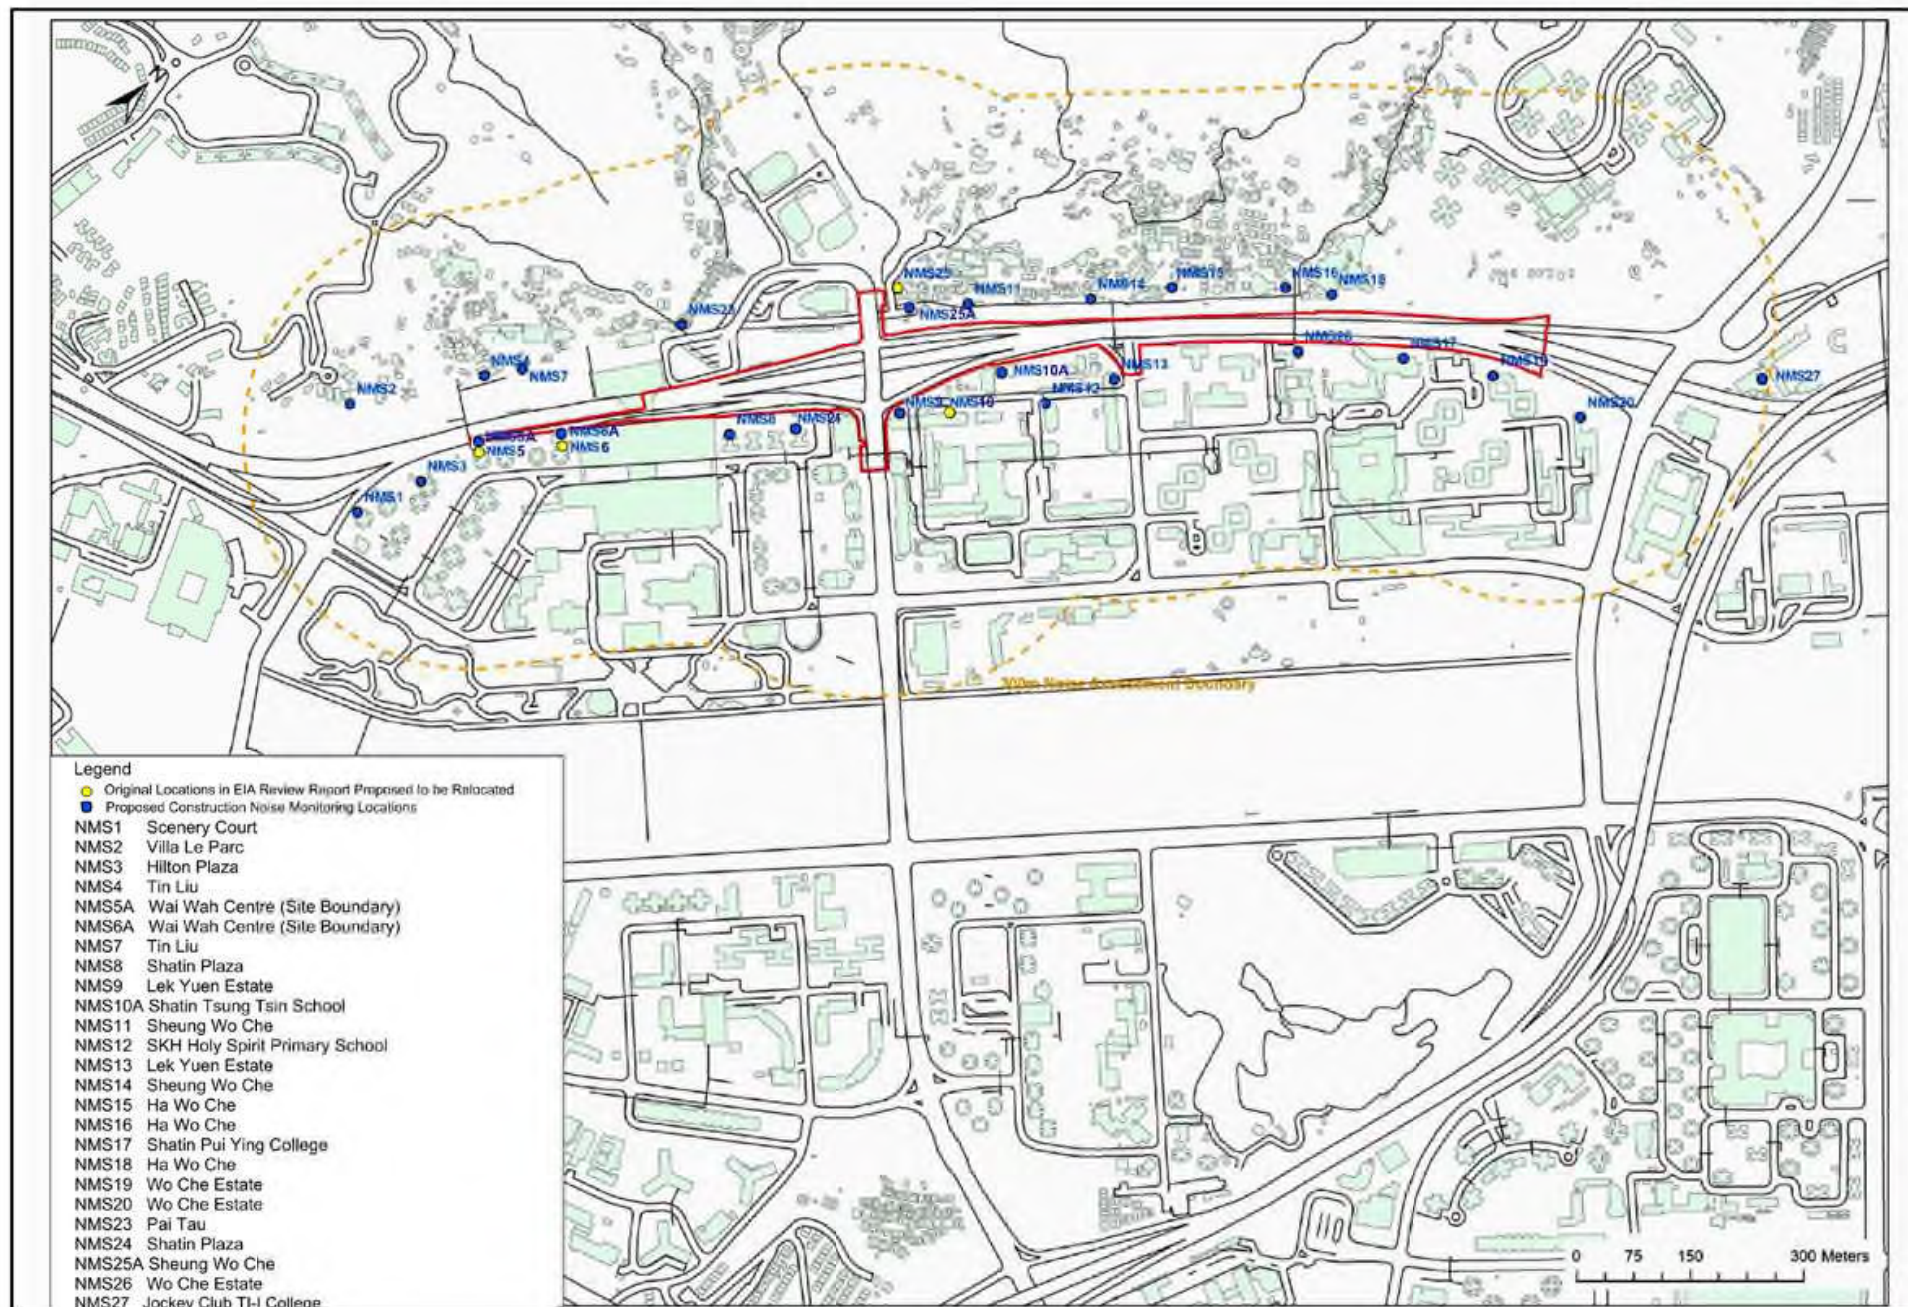


Figure 2b Noise Monitoring Locations

## **FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : [matlab@fugro.com](mailto:matlab@fugro.com)  
Website : [www.fugro.com](http://www.fugro.com)



### **Appendix A**

#### **Construction Programme**

Three Months Rolling

| Activity ID                                               | Activity Name                                                                          | Planned Duration | Start       | Finish    | Total Float | 2024                              |     |     |     |     |     |     |     |     |     |     |     | 2025 |     |     |     |     |     |     |     |     |     |     |     | 2026 |  |  |  |  |
|-----------------------------------------------------------|----------------------------------------------------------------------------------------|------------------|-------------|-----------|-------------|-----------------------------------|-----|-----|-----|-----|-----|-----|-----|-----|-----|-----|-----|------|-----|-----|-----|-----|-----|-----|-----|-----|-----|-----|-----|------|--|--|--|--|
|                                                           |                                                                                        |                  |             |           |             | Jun                               | Jul | Aug | Sep | Oct | Nov | Dec | Jan | Feb | Mar | Apr | May | Jun  | Jul | Aug | Sep | Oct | Nov | Dec | Jan | Feb | Mar | Apr | May |      |  |  |  |  |
| Revised Detailed Works Programme RDWP 15e (dd Feb 2025)   |                                                                                        |                  |             |           |             |                                   |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| PROJECT KEY DATES                                         |                                                                                        |                  |             |           |             | <div><div></div><div></div></div> |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| PROJECT COMPLETION                                        |                                                                                        |                  |             |           |             | <div><div></div><div></div></div> |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| KEY1070                                                   | Planned Completion of Section 1                                                        | 0                |             | 12-Jun-25 | -433        | <div><div></div><div></div></div> |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| KEY1090                                                   | Planned Completion of Section 1A                                                       | 0                |             | 01-Apr-26 | -433        | <div><div></div><div></div></div> |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| KEY1110                                                   | Planned Completion of Section 2                                                        | 0                |             | 12-Jun-25 | -141        | <div><div></div><div></div></div> |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| SUMMARY                                                   |                                                                                        |                  |             |           |             | <div><div></div><div></div></div> |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| SUMMARY PROGRAMME (Zone 1)                                |                                                                                        |                  |             |           |             | <div><div></div><div></div></div> |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Z1SU1030                                                  | Zone 1 Northbound                                                                      | 1715             | 31-Dec-19 A | 01-Apr-25 | -59         | <div><div></div><div></div></div> |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Z1SU1050                                                  | Zone 1 Southbound                                                                      | 1399             | 09-Oct-23 A | 01-Apr-25 | -59         | <div><div></div><div></div></div> |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Z1SU1060                                                  | Zone 1 E&M                                                                             | 213              | 19-Jan-24 A | 12-Jun-25 | -362        | <div><div></div><div></div></div> |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| SUMMARY PROGRAMME (Zone 2)                                |                                                                                        |                  |             |           |             | <div><div></div><div></div></div> |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Z2SU1000                                                  | Zone 2 Northbound                                                                      | 1690             | 19-Feb-19 A | 01-Apr-25 | -59         | <div><div></div><div></div></div> |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Z2SU1050                                                  | Zone 2 Southbound                                                                      | 1584             | 08-Aug-19 A | 01-Apr-25 | -59         | <div><div></div><div></div></div> |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| SUMMARY PROGRAMME (Zone 3)                                |                                                                                        |                  |             |           |             | <div><div></div><div></div></div> |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Z3SU5080                                                  | Zone 3 Southbound (RHS)                                                                | 163              | 02-Jul-24 A | 03-Apr-25 | -298        | <div><div></div><div></div></div> |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Z3SU5090                                                  | Zone 3 Northbound Road, Gantry                                                         | 336              | 20-Sep-23 A | 01-Apr-25 | -295        | <div><div></div><div></div></div> |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Z3SU5100                                                  | Zone 3 Southbound Road, Gantry                                                         | 157              | 02-May-24 A | 01-Apr-25 | -295        | <div><div></div><div></div></div> |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Z3SU5120                                                  | Zone 3 Bridge                                                                          | 1570             | 20-May-19 A | 24-Mar-25 | -49         | <div><div></div><div></div></div> |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Z3SU5130                                                  | Zone 3 E&M                                                                             | 5                | 19-Jan-24 A | 12-Jun-25 | -362        | <div><div></div><div></div></div> |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| SUMMARY PROGRAMME (Zone 4)                                |                                                                                        |                  |             |           |             | <div><div></div><div></div></div> |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Z4SU1005                                                  | Zone 4 Northbound                                                                      | 1714             | 25-Jan-19 A | 01-Apr-25 | -295        | <div><div></div><div></div></div> |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Z4SU1010                                                  | Zone 4 Southbound                                                                      | 1663             | 29-Mar-19 A | 01-Apr-25 | -295        | <div><div></div><div></div></div> |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Z4SU1024                                                  | Zone 4 E&M                                                                             | 238              | 19-Jan-24 A | 12-Jun-25 | -362        | <div><div></div><div></div></div> |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| SUMMARY PROGRAMME (Zone 5)                                |                                                                                        |                  |             |           |             | <div><div></div><div></div></div> |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Z5SU1005                                                  | Zone 5 Northbound                                                                      | 1507             | 10-Oct-19 A | 01-Apr-25 | -295        | <div><div></div><div></div></div> |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Z5SU1010                                                  | Zone 5 Southbound                                                                      | 1711             | 22-Jan-19 A | 01-Apr-25 | -295        | <div><div></div><div></div></div> |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Z5SU1020                                                  | Zone 5 E&M                                                                             | 238              | 19-Jan-24 A | 12-Jun-25 | -362        | <div><div></div><div></div></div> |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Zone 1                                                    |                                                                                        |                  |             |           |             | <div><div></div><div></div></div> |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Northbound                                                |                                                                                        |                  |             |           |             | <div><div></div><div></div></div> |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Northbound Main Road (Tai Po Road)                        |                                                                                        |                  |             |           |             | <div><div></div><div></div></div> |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Road Re-construction                                      |                                                                                        |                  |             |           |             | <div><div></div><div></div></div> |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Z1_1280                                                   | Zone 1_road resurfacing for final handover                                             | 27               | 01-Mar-25*  | 01-Apr-25 | -59         | <div><div></div><div></div></div> |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Southbound                                                |                                                                                        |                  |             |           |             | <div><div></div><div></div></div> |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Southbound Main Road (Tai Po Road)                        |                                                                                        |                  |             |           |             | <div><div></div><div></div></div> |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Road Re-construction                                      |                                                                                        |                  |             |           |             | <div><div></div><div></div></div> |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Z1_1410                                                   | Zone 1_road resurfacing for final handover                                             | 27               | 01-Mar-25*  | 01-Apr-25 | -59         | <div><div></div><div></div></div> |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Lighting and E&M                                          |                                                                                        |                  |             |           |             | <div><div></div><div></div></div> |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Underground work for Road lighting system and TCSS system |                                                                                        |                  |             |           |             | <div><div></div><div></div></div> |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Z1_1640                                                   | Cable laying for TCSS system                                                           | 6                | 01-Mar-25*  | 07-Mar-25 | -63         | <div><div></div><div></div></div> |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Z1_1660                                                   | Cable laying for Road lighting system                                                  | 19               | 14-Mar-25   | 04-Apr-25 | -63         | <div><div></div><div></div></div> |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Aboveground work for Road lighting system and TCSS system |                                                                                        |                  |             |           |             | <div><div></div><div></div></div> |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Z1_1670                                                   | Cable containment work, wiring work and Istallation of field equipments for TCSS syste | 13               | 01-Mar-25*  | 15-Mar-25 | -53         | <div><div></div><div></div></div> |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Z1_1680                                                   | Joint Inspection and T&C for TCSS system                                               | 11               | 17-Mar-25*  | 28-Mar-25 | -53         | <div><div></div><div></div></div> |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Z1_1690                                                   | Joint Inspection and T&C for Road Lighting System                                      | 4                | 09-Jun-25   | 12-Jun-25 | -118        | <div><div></div><div></div></div> |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |

## Three Months Rolling

| Activity ID                                               | Activity Name                                                                          | Planned Duration | Start       | Finish    | Total Float | 2024 |     |     |     |     |     |     |     |     |     |     |     | 2025 |     |     |     |     |     |     |     |     |     |     |     | 2026 |  |  |  |  |
|-----------------------------------------------------------|----------------------------------------------------------------------------------------|------------------|-------------|-----------|-------------|------|-----|-----|-----|-----|-----|-----|-----|-----|-----|-----|-----|------|-----|-----|-----|-----|-----|-----|-----|-----|-----|-----|-----|------|--|--|--|--|
|                                                           |                                                                                        |                  |             |           |             | Jun  | Jul | Aug | Sep | Oct | Nov | Dec | Jan | Feb | Mar | Apr | May | Jun  | Jul | Aug | Sep | Oct | Nov | Dec | Jan | Feb | Mar | Apr | May |      |  |  |  |  |
| Zone 2                                                    |                                                                                        |                  |             |           |             |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Northbound                                                |                                                                                        |                  |             |           |             |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Northbound Main Road (Tai Po Road)                        |                                                                                        |                  |             |           |             |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Road Re-construction                                      |                                                                                        |                  |             |           |             |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Z2_1200                                                   | Zone 2_road resurfacing for final handover                                             | 27               | 01-Mar-25*  | 01-Apr-25 | -59         |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Southbound                                                |                                                                                        |                  |             |           |             |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Southbound Main Road (Tai Po Road)                        |                                                                                        |                  |             |           |             |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Road Re-construction                                      |                                                                                        |                  |             |           |             |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Z2_1260                                                   | Zone 2_road resurfacing for final handover                                             | 27               | 01-Mar-25*  | 01-Apr-25 | -59         |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Lighting and E&M                                          |                                                                                        |                  |             |           |             |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Underground work for Road lighting system and TCSS system |                                                                                        |                  |             |           |             |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Z2_1690                                                   | Cable laying for TCSS system                                                           | 6                | 01-Mar-25*  | 07-Mar-25 | -59         |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Z2_1691                                                   | Cable laying for Road lighting system                                                  | 19               | 14-Mar-25   | 04-Apr-25 | -59         |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Aboveground work for Road lighting system and TCSS system |                                                                                        |                  |             |           |             |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Z2_1702                                                   | Cable containment work, wiring work and Istallation of field equipments for TCSS syste | 13               | 01-Mar-25*  | 15-Mar-25 | -53         |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Z2_1712                                                   | Joint Inspection and T&C for TCSS system                                               | 11               | 17-Mar-25*  | 28-Mar-25 | -53         |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Z2_1722                                                   | Joint Inspection and T&C for Road Lighting System                                      | 4                | 09-Jun-25   | 12-Jun-25 | -118        |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Zone 3                                                    |                                                                                        |                  |             |           |             |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Northbound (New Town Plaza to N263)                       |                                                                                        |                  |             |           |             |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| SR1                                                       |                                                                                        |                  |             |           |             |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| SR1_Road Re-construction                                  |                                                                                        |                  |             |           |             |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Z3_2720                                                   | Zone 3 SR1_road flexible pavement Type III (625mm thk.) / deep inlay Type II & III (1t | 28               | 15-Jul-24 A | 15-Mar-25 | -42         |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Northbound Main Road (Tai Po Road)                        |                                                                                        |                  |             |           |             |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Road Re-construction                                      |                                                                                        |                  |             |           |             |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Z3_2760c                                                  | Zone 3_road resurfacing for final handover                                             | 26               | 01-Mar-25*  | 01-Apr-25 | -295        |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Central barrier (N263 to NF40)                            |                                                                                        |                  |             |           |             |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| C/M_Noise Barrier                                         |                                                                                        |                  |             |           |             |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Z3_2360                                                   | SE2_install noise barrier wall panel PM1 to PM6 (71 sq.m)                              | 5                | 01-Mar-25*  | 06-Mar-25 | -37         |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Southbound (New Town Plaza to N263)                       |                                                                                        |                  |             |           |             |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| S1E6-51P & S1E5-51 & L-Shaped wall                        |                                                                                        |                  |             |           |             |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| S1E6-51P & S1E5-51_UU diversion                           |                                                                                        |                  |             |           |             |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Z3_1557                                                   | Remaining road drainage (ME04 - ME05)                                                  | 21               | 08-Jul-24 A | 28-Feb-25 | -56         |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Z3_3210c                                                  | Sewerage diversion of 825mm sewerage pipe                                              | 27               | 01-Mar-25   | 01-Apr-25 | -56         |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| S1E6-51P & S1E5-51_Sub-Structure                          |                                                                                        |                  |             |           |             |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Z3_1549                                                   | Slope modification works of Feature No. 7SE-A/FR152 and the associated drainage w      | 50               | 01-Mar-25*  | 28-Apr-25 | -82         |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Subway NS30                                               |                                                                                        |                  |             |           |             |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Z3_4690_30                                                | NS30_U-channel construction /backfilling                                               | 13               | 01-Mar-25*  | 15-Mar-25 | -42         |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Z3_4690_40                                                | NS30_RW2_bituminous pavement                                                           | 5                | 01-Mar-25*  | 06-Mar-25 | -34         |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Z3_4690_50                                                | NS30_finishing works                                                                   | 13               | 01-Mar-25*  | 15-Mar-25 | -42         |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Z3_4690_60                                                | NS30_pump house miscellaneous works                                                    | 13               | 29-Jul-24 A | 12-Jun-25 | -178        |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Z3_4690_70                                                | NS30_pump house installation of sump and pump system                                   | 11               | 27-Sep-24 A | 11-Mar-25 | -187        |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Z3_4690_80                                                | NS30_pump house installation of electrical and control system                          | 16               | 06-Mar-25*  | 24-Mar-25 | -187        |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Z3_4690_90                                                | NS30_pump house testing and commissionijng (T&C)                                       | 6                | 26-Mar-25   | 01-Apr-25 | -187        |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Z3_4690_90c                                               | NS30_installation of lighting system                                                   | 13               | 01-Apr-25   | 15-Apr-25 | -187        |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Z3_4690_90c                                               | NS30_installation of electric meter and power energization                             | 7                | 01-Mar-25*  | 08-Mar-25 | -36         |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Z3_4690_90c                                               | NS30_testing and commissionijng (T&C)                                                  | 12               | 16-Apr-25   | 29-Apr-25 | -80         |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |
| Retaining Wall RW2                                        |                                                                                        |                  |             |           |             |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |

Remaining Level of Effort    Actual Work    Critical Remaining Work    summary  
Actual Level of Effort    Remaining Work    Milestone

Revised Detailed Works Programme 15E (Progress Status as  
of 28 February 2025)

Data date : 28-Feb-25

Three Months Rolling

| Activity ID   | Activity Name                                           | Planned Duration                                                                     | Start      | Finish      | Total Float | 2024 |     |     |     |     |     | 2025 |     |     |     |     |     |     |     |     |     |     |     | 2026 |     |     |     |     |     |  |  |  |  |  |
|---------------|---------------------------------------------------------|--------------------------------------------------------------------------------------|------------|-------------|-------------|------|-----|-----|-----|-----|-----|------|-----|-----|-----|-----|-----|-----|-----|-----|-----|-----|-----|------|-----|-----|-----|-----|-----|--|--|--|--|--|
|               |                                                         |                                                                                      |            |             |             | Jun  | Jul | Aug | Sep | Oct | Nov | Dec  | Jan | Feb | Mar | Apr | May | Jun | Jul | Aug | Sep | Oct | Nov | Dec  | Jan | Feb | Mar | Apr | May |  |  |  |  |  |
|               | RW2_UU diversion                                        |                                                                                      | 199        | 09-Jul-24 A | 07-Mar-25   | -35  |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |  |  |  |  |  |
|               | Z3_4690a                                                | RW2_common drawpits (JV) and cable ductings installation (by UU) (cable installation | 6          | 01-Mar-25*  | 07-Mar-25   | -35  |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |  |  |  |  |  |
|               | Z3_4690b                                                | RW2_ducting/cable installation after bitumen pavement (by UU)                        | 23         | 09-Jul-24 A | 04-Mar-25   | -32  |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |  |  |  |  |  |
|               | Retaining Wall RW1                                      |                                                                                      | 21         | 01-Mar-25   | 31-Mar-25   | -48  |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |  |  |  |  |  |
|               | RW1_UU diversion                                        |                                                                                      | 21         | 03-Mar-25   | 31-Mar-25   | -48  |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |  |  |  |  |  |
|               | Z3_5695                                                 | CLP switch over                                                                      | 21         | 03-Mar-25*  | 31-Mar-25   | -48  |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |  |  |  |  |  |
|               | RW1_Noise Barrier                                       |                                                                                      | 10         | 01-Mar-25   | 12-Mar-25   | -42  |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |  |  |  |  |  |
|               | Z3_2240                                                 | SE1-4_install noise barrier roof panel PF37/PG1 to PF54/PG18 (1235 sq.m)             | 10         | 01-Mar-25*  | 12-Mar-25   | -42  |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |  |  |  |  |  |
|               | Type SE1 Noise Semi-Enclosure                           |                                                                                      | 158        | 23-Jul-24 A | 07-Apr-25   | -64  |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |  |  |  |  |  |
|               | SE1_Noise Barrier                                       |                                                                                      | 158        | 23-Jul-24 A | 07-Apr-25   | -64  |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |  |  |  |  |  |
|               | Z3_1950                                                 | SE1-1_install noise barrier wall panel PF1 to PF6 (203 sq.m)                         | 11         | 23-Jul-24 A | 04-Mar-25   | -35  |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |  |  |  |  |  |
|               | Z3_1960                                                 | SE1-1_install noise barrier roof panel PE/F1 to PE/F6 (280 sq.m)                     | 18         | 01-Mar-25*  | 21-Mar-25   | -50  |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |  |  |  |  |  |
|               | Z3_2030                                                 | SE1-2_install noise barrier roof panel PE/F7 to PE/F26 (1487 sq.m)                   | 18         | 01-Mar-25*  | 21-Mar-25   | -50  |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |  |  |  |  |  |
|               | Z3_2060                                                 | SE1-3_erect steel arch beam PE/PF24 to PE/PF36 (17nr)(PMI-063)(NCE-003)              | 39         | 28-Sep-24 A | 17-Mar-25   | -46  |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |  |  |  |  |  |
|               | Z3_2090                                                 | SE1-3_install noise barrier roof panel PE/F27 to PE/F36 (958 sq.m)                   | 18         | 01-Mar-25*  | 21-Mar-25   | -50  |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |  |  |  |  |  |
|               | Z3_2120                                                 | SE1-4_erect steel arch beam PE37/PG1 to PE54/PG18 (18nr)(PMI-063)(NCE-003)           | 7          | 28-Sep-24 A | 17-Mar-25   | -46  |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |  |  |  |  |  |
|               | Z3_2190                                                 | SE1-6_erect steel posts PF55 to PF72 (18nr)(PMI-063)(NCE-003)                        | 23         | 01-Mar-25   | 27-Mar-25   | -55  |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |  |  |  |  |  |
|               | Z3_2200                                                 | SE1-6_erect steel arch beam PE/F55 to PE/F72 (18nr)(PMI-063)(NCE-003)                | 28         | 01-Mar-25   | 02-Apr-25   | -60  |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |  |  |  |  |  |
|               | Z3_2220                                                 | SE1-4_install noise barrier roof panel PE37/PG1 to PE54/PG18 (1235 sq.m)             | 18         | 01-Mar-25*  | 21-Mar-25   | -50  |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |  |  |  |  |  |
|               | Z3_2260                                                 | SE1-5_install noise barrier wall panel PF55 to PF72 (868 sq.m)                       | 32         | 01-Mar-25*  | 07-Apr-25   | -64  |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |  |  |  |  |  |
|               | Z3_2270                                                 | SE1-5_install noise barrier roof panel PE/F55 to PE/F72 (1606 sq.m)                  | 18         | 01-Mar-25*  | 21-Mar-25   | -50  |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |  |  |  |  |  |
|               | Southbound (N263 to NF40)                               |                                                                                      | 235        | 03-Jul-24 A | 27-May-25   | -89  |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |  |  |  |  |  |
|               | Type SE2 Noise Semi-Enclosure                           |                                                                                      | 155        | 16-Aug-24 A | 08-Apr-25   | -65  |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |  |  |  |  |  |
|               | SE2_Noise Barrier                                       |                                                                                      | 155        | 16-Aug-24 A | 08-Apr-25   | -65  |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |  |  |  |  |  |
|               | Z3_2340                                                 | SE2_erect steel posts PN1 to PN6 (6nr)(PMI-063)(NCE-003)                             | 44         | 16-Aug-24 A | 08-Apr-25   | -65  |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |  |  |  |  |  |
|               | Z3_2350                                                 | SE2_erect steel arch beam PM/N1 to PM/N6 (6nr)(PMI-063)(NCE-003)                     | 14         | 01-Mar-25*  | 17-Mar-25   | -302 |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |  |  |  |  |  |
|               | Z3_2355                                                 | SE2_install noise barrier wall panel PM1 to PM6 (291 sq.m)                           | 22         | 01-Mar-25*  | 26-Mar-25   | -54  |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |  |  |  |  |  |
|               | Z3_2370                                                 | SE2_install noise barrier wall panel PN1 to PN6 (291 sq.m)                           | 4          | 19-Mar-25*  | 22-Mar-25   | -302 |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |  |  |  |  |  |
|               | Z3_2380                                                 | SE2_install noise barrier roof panel PM/N1 to PM/N6 (279 sq.m)                       | 10         | 24-Mar-25*  | 03-Apr-25   | -302 |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |  |  |  |  |  |
|               | Type SE5 Noise Semi-Enclosure                           |                                                                                      | 10         | 28-Sep-24 A | 08-Mar-25   | -39  |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |  |  |  |  |  |
|               | SE5_Noise Barrier                                       |                                                                                      | 10         | 28-Sep-24 A | 08-Mar-25   | -39  |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |  |  |  |  |  |
|               | Z3_2520                                                 | SE5-1_install noise barrier roof panel PS/T1 to PS/T15 (1329 sq.m)                   | 10         | 28-Sep-24 A | 08-Mar-25   | -39  |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |  |  |  |  |  |
|               | Z3_2570                                                 | SE5-2_install noise barrier roof panel PS/T16 to PS/T48 (2235 sq.m)                  | 7          | 03-Oct-24 A | 07-Mar-25   | -38  |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |  |  |  |  |  |
|               | NEW Cycle Track                                         |                                                                                      | 242        | 03-Jul-24 A | 16-Apr-25   | -107 |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |  |  |  |  |  |
|               | Z3_4330                                                 | Stage 3C- CT-PM1 Pier, CT U-Shaped Wall, Cycle Track Ramp and Pilar Box              | 61         | 03-Jul-24 A | 11-Apr-25   | -107 |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |  |  |  |  |  |
|               | Z3_4390                                                 | Stage 3D - Removal of Temp Cyde Track                                                | 4          | 12-Apr-25   | 16-Apr-25   | -107 |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |  |  |  |  |  |
|               | Modification Of Existing Retaining Wall SR6             |                                                                                      | 62         | 01-Mar-25   | 27-May-25   | -89  |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |  |  |  |  |  |
|               | SR6 Slip Road                                           |                                                                                      | 62         | 01-Mar-25   | 27-May-25   | -89  |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |  |  |  |  |  |
|               | Sub-Structure                                           |                                                                                      | 35         | 17-Apr-25   | 27-May-25   | -107 |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |  |  |  |  |  |
|               | Z3_17                                                   | Stage 3D - SR6-2A,3A and 6A                                                          | 35         | 17-Apr-25*  | 27-May-25   | -107 |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |  |  |  |  |  |
| Noise Barrier |                                                         | 28                                                                                   | 01-Mar-25  | 02-Apr-25   | -60         |      |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |  |  |  |  |  |
| Z3_25         | SE8-1_erect steel posts PQ1 to PQ14                     | 1                                                                                    | 01-Mar-25* | 01-Mar-25   | -301        |      |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |  |  |  |  |  |
| Z3_26         | SE8-1_erect steel arch beam PQ/R1 to PQ/R14             | 4                                                                                    | 03-Mar-25  | 07-Mar-25   | -301        |      |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |  |  |  |  |  |
| Z3_26         | SE8-1_install noise barrier wall panel PR1 to PR18      | 9                                                                                    | 08-Mar-25  | 19-Mar-25   | -301        |      |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |  |  |  |  |  |
| Z3_26         | SE8-1_install noise barrier roof panel PQ/R1 to PQ/R18  | 11                                                                                   | 20-Mar-25  | 02-Apr-25   | -301        |      |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |  |  |  |  |  |
| Z3_26         | SE8-2_install noise barrier roof panel PQ/R16 to PQ/R32 | 0                                                                                    | 02-Apr-25  | 02-Apr-25   | -60         |      |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |  |  |  |  |  |

Remaining Level of Effort    Actual Work    Critical Remaining Work    summary  
Actual Level of Effort    Remaining Work    ♦    ♦ Milestone

### Three Months Rolling

| Activity ID | Activity Name | Planned Duration | Start | Finish    | Total Float | 2024 |     |     |     |     |     |     |     |     |     |     |     | 2025 |     |     |     |     |     |     |     |     |     |     |     | 2026 |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |    |
|-------------|---------------|------------------|-------|-----------|-------------|------|-----|-----|-----|-----|-----|-----|-----|-----|-----|-----|-----|------|-----|-----|-----|-----|-----|-----|-----|-----|-----|-----|-----|------|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|----|
|             |               |                  |       |           |             | Jun  | Jul | Aug | Sep | Oct | Nov | Dec | Jan | Feb | Mar | Apr | May | Jun  | Jul | Aug | Sep | Oct | Nov | Dec | Jan | Feb | Mar | Apr | May |      |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |    |
| Z3          | SR6 Road      |                  | 25    | 01-Mar-25 | 29-Mar-25   | -54  |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  | </ |

Three Months Rolling

| Activity ID |  | Activity Name | Planned Duration     | Start | Finish | Total Float | 2024      |           |      |     |     |     | 2025 |     |     |     |     |     |     |     |     |     |     |     | 2026 |     |     |     |     |     |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |    |
|-------------|--|---------------|----------------------|-------|--------|-------------|-----------|-----------|------|-----|-----|-----|------|-----|-----|-----|-----|-----|-----|-----|-----|-----|-----|-----|------|-----|-----|-----|-----|-----|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|----|
|             |  |               |                      |       |        |             | Jun       | Jul       | Aug  | Sep | Oct | Nov | Dec  | Jan | Feb | Mar | Apr | May | Jun | Jul | Aug | Sep | Oct | Nov | Dec  | Jan | Feb | Mar | Apr | May |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |    |
|             |  |               | Road Re-construction |       |        | 26          | 01-Mar-25 | 01-Apr-25 | -299 |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  |  | </ |

## FUGRO TECHNICAL SERVICES LIMITED

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : [matlab@fugro.com](mailto:matlab@fugro.com)  
Website : [www.fugro.com](http://www.fugro.com)




### Appendix B

#### Project Organization Chart

FUGRO TECHNICAL SERVICES LIMITED

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com

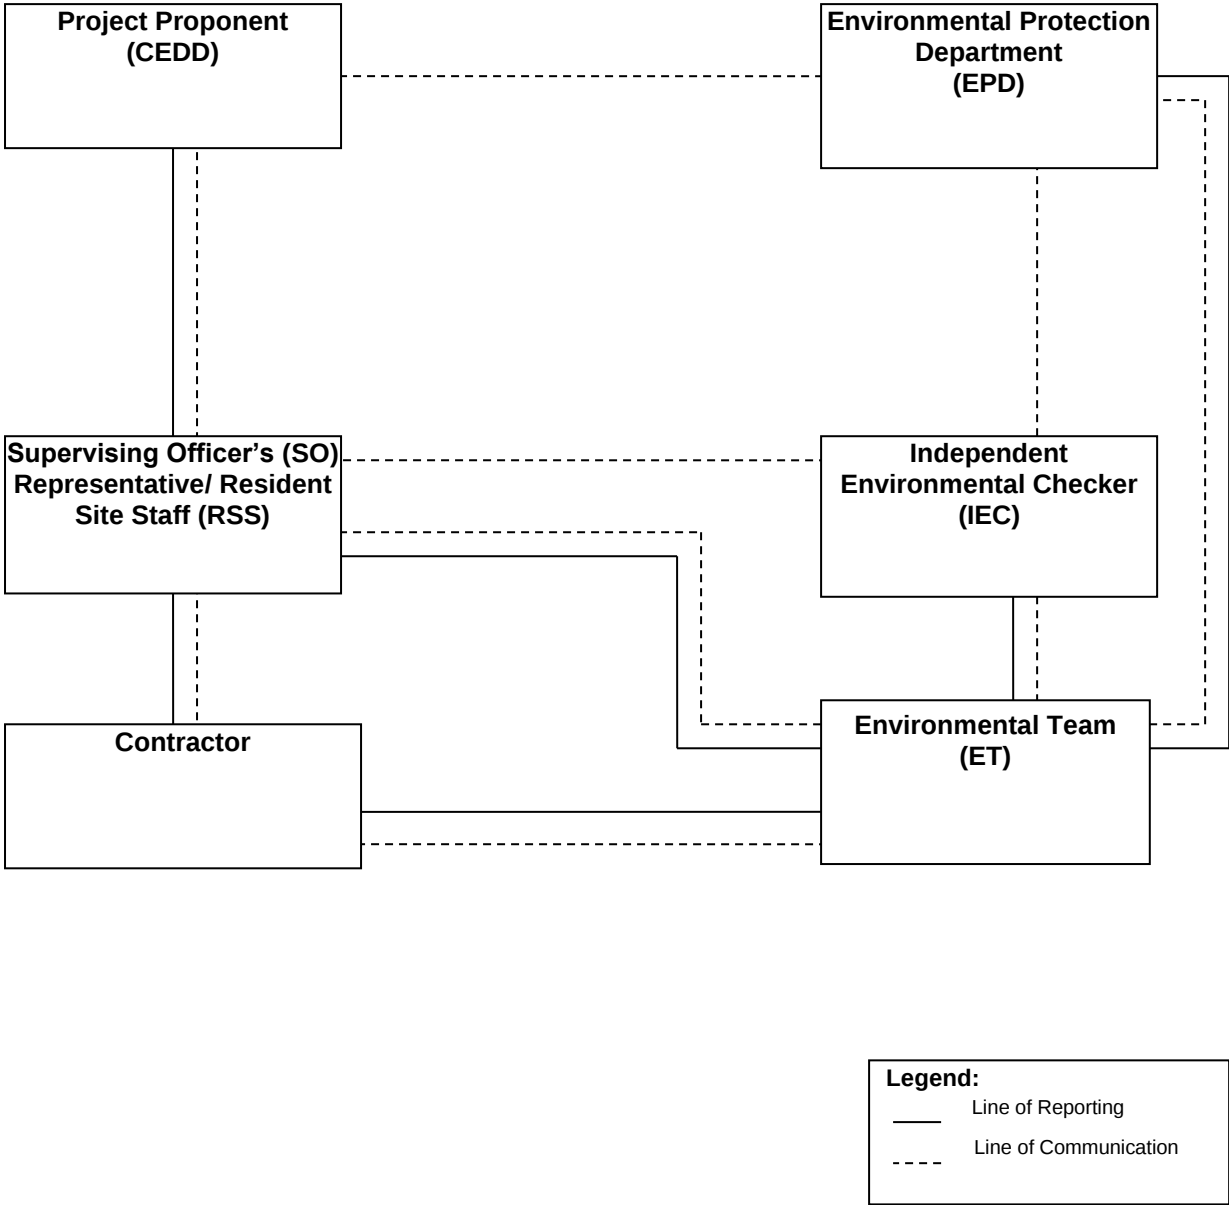

## **FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : [matlab@fugro.com](mailto:matlab@fugro.com)  
Website : [www.fugro.com](http://www.fugro.com)



### **Appendix C**

#### **Action and Limit Levels for Air Quality and Noise**

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com

**Action and Limit Levels for 24-hr TSP and 1-hr TSP**

| Parameter                                 | Monitoring Station | Action Level<br>( $\mu\text{g}/\text{m}^3$ ) | Limit Level<br>( $\mu\text{g}/\text{m}^3$ ) |
|-------------------------------------------|--------------------|----------------------------------------------|---------------------------------------------|
| 24-hr TSP<br>( $\mu\text{g}/\text{m}^3$ ) | AMS5               | 156                                          | 260                                         |
|                                           | AMS7A              | 171                                          |                                             |
|                                           | AMS14              | 174                                          |                                             |
|                                           | AMS15              | 172                                          |                                             |
| 1-hr TSP<br>( $\mu\text{g}/\text{m}^3$ )  | AMS5               | 340                                          | 500                                         |
|                                           | AMS7A              | 344                                          |                                             |
|                                           | AMS14              | 350                                          |                                             |
|                                           | AMS15              | 350                                          |                                             |

**Action and Limit Levels for Construction Noise, Leq (30min), dB(A)**

| Time Period                      | Location                                                                                                                                                                                                                     | Action                                    | Limit    |
|----------------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------|----------|
| 0700-1900 hrs on normal weekdays | NMS1<br>NMS2<br>NMS3<br>NMS4<br>NMS5A<br>NMS6A<br>NMS7<br>NMS8<br>NMS9<br>NMS10A*<br>NMS11<br>NMS12*<br>NMS13<br>NMS14<br>NMS15<br>NMS16<br>NMS17*<br>NMS18<br>NMS19<br>NMS20<br>NMS23<br>NMS24<br>NMS25A<br>NMS26<br>NMS27* | When one documented complaint is received | 75 dB(A) |

\* For NMS 10A, 12, 17 and 27, the Limit Level is reduced to 70 dB(A) for schools and 65 dB(A) during school examination periods.

## **FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : [matlab@fugro.com](mailto:matlab@fugro.com)  
Website : [www.fugro.com](http://www.fugro.com)



### **Appendix D**

#### **Calibration Certificates of Monitoring Equipment**

Report no. : 240029CA242014(2)

Page 1 of 1

**CALIBRATION CERTIFICATE OF DUST METER**

Client : Fugro Technical Services Limited

Project : Calibration Services

**Client Supplied Information**

Details of Unit Under Test, UUT -

Description : Laser Dust Monitor

Manufacturer : SIBATA

Model No. : LD-5R

Serial No. : 882147

Next Calibration Date : 13-Jun-2025

**Laboratory Information**

Details of Reference Equipment -

Description : Reference balance

Equipment ID. : C-065-5

Date of Calibration : 14-Jun-2024

Ambient Temperature : 30 °C

Calibration Location : Calibration Lab. of FTS

Method Used : By direct comparison the weight of dust particle trapped in a filter paper using high volume sampler (TSP method) for a certain period, with the reading of the UUT. They should be placed at the same location and powered on and off at the same time.

**Calibration Results :**

| Reference concentration<br>(mg/m <sup>3</sup> ) | Total count for 1 hour | CPM (Count per minute) |
|-------------------------------------------------|------------------------|------------------------|
| 0.2438                                          | 5981                   | 99.68                  |
| 0.2650                                          | 6102                   | 101.70                 |
| 0.2044                                          | 5646                   | 94.10                  |

**Remarks:**

1. The equipment being used in this calibration is traceable to recognized National Standards.
2. The interpolation equation : Concentration (mg/m<sup>3</sup>) = K x UUT reading (CPM) where K = 0.002414
3. Correlation coefficient (r) : 0.9958

Checked by : 

Date : 12-8-2024

Certified by : 

Date : 15-8-2024

CA-R-297 (22/07/2009)

Leung Kwok Tai (Assistant Manager)


\*\* End of Report \*\*

### Correlation between HVS & Dust Meter

Model: Sibata LD-5R

Serial No: 882147

|                                         |      |       |       |       |        |        |
|-----------------------------------------|------|-------|-------|-------|--------|--------|
| HVS - 24hr TSP $\mu\text{g}/\text{m}^3$ | 0.00 | 24.45 | 65.44 | 92.42 | 155.70 | 201.18 |
| Dust Meter - 24hr CPM                   | 0.0  | 7.6   | 25.6  | 39.7  | 62.5   | 86.3   |

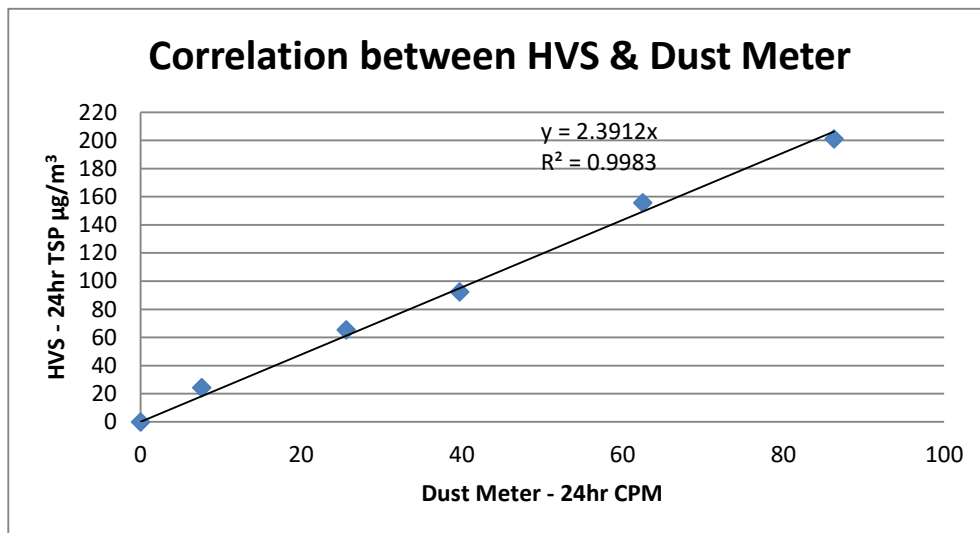

K factor = 2.414

Report no. : 240029CA242014(1)

Page 1 of 1

**CALIBRATION CERTIFICATE OF DUST METER**

Client : Fugro Technical Services Limited

Project : Calibration Services

**Client Supplied Information**

Details of Unit Under Test, UUT -

Description : Laser Dust Monitor

Manufacturer : SIBATA

Model No. : LD-5R

Serial No. : 882149

Next Calibration Date : 13-Jun-2025

**Laboratory Information**

Details of Reference Equipment -

Description : Reference balance

Equipment ID. : C-065-5

Date of Calibration : 14-Jun-2024

Ambient Temperature : 30 °C

Calibration Location : Calibration Lab. of FTS

Method Used : By direct comparison the weight of dust particle trapped in a filter paper using high volume sampler (TSP method) for a certain period, with the reading of the UUT. They should be placed at the same location and powered on and off at the same time.

**Calibration Results :**


| Reference concentration<br>(mg/m <sup>3</sup> ) | Total count for 1 hour | CPM (Count per minute) |
|-------------------------------------------------|------------------------|------------------------|
| 0.2438                                          | 5621                   | 93.68                  |
| 0.2650                                          | 5754                   | 95.90                  |
| 0.2044                                          | 5163                   | 86.05                  |

**Remarks:**

1. The equipment being used in this calibration is traceable to recognized National Standards.
2. The interpolation equation : Concentration (mg/m<sup>3</sup>) = K x UUT reading (CPM) where K = 0.002588
3. Correlation coefficient (r) : 0.9909

Checked by : 

Date : 12-8-2014

Certified by : 

Date : 15-8-2014

CA-R-297 (22/07/2009)

Leung Kwok Tai (Assistant Manager)


**\*\* End of Report \*\***

### Correlation between HVS & Dust Meter

Model: Sibata LD-5R

Serial No: 882149

|                                         |      |       |       |       |        |        |
|-----------------------------------------|------|-------|-------|-------|--------|--------|
| HVS - 24hr TSP $\mu\text{g}/\text{m}^3$ | 0.00 | 14.74 | 42.54 | 96.85 | 150.21 | 209.85 |
| Dust Meter - 24hr CPM                   | 0.0  | 7.2   | 18.5  | 35.9  | 63.7   | 82.6   |

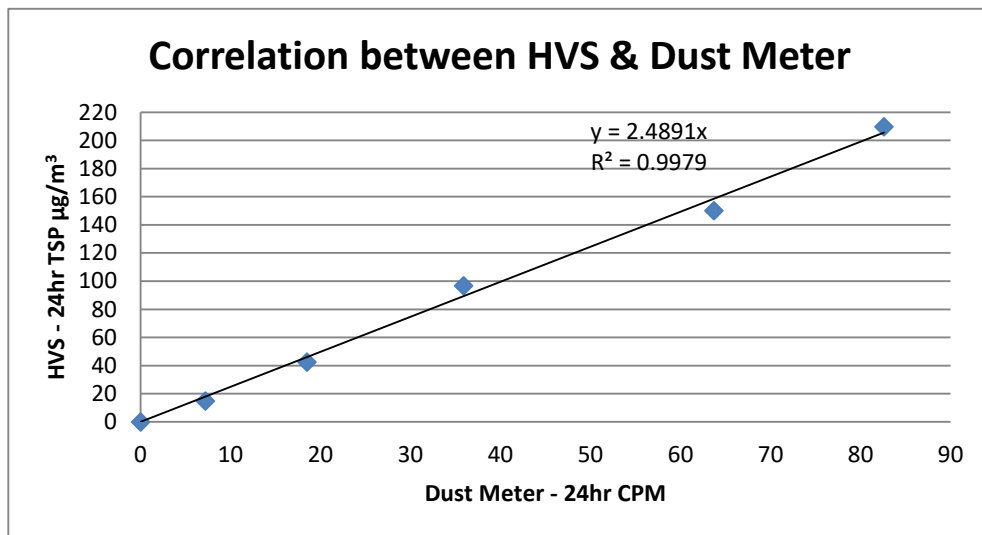

K factor = 2.588

Report no. : 240029CA242014(8)

Page 1 of 1

**CALIBRATION CERTIFICATE OF DUST METER**

Client : Fugro Technical Services Limited

Project : Calibration Services

**Client Supplied Information**

Details of Unit Under Test, UUT -

Description : Laser Dust Monitor

Manufacturer : SIBATA

Model No. : LD-5R

Serial No. : 882185

Next Calibration Date : 13-Jun-2025

**Laboratory Information**

Details of Reference Equipment -

Description : Reference balance

Equipment ID. : C-065-5

Date of Calibration : 14-Jun-2024

Ambient Temperature : 30 °C

Calibration Location : Calibration Lab. of FTS

Method Used : By direct comparison the weight of dust particle trapped in a filter paper using high volume sampler (TSP method) for a certain period, with the reading of the UUT. They should be placed at the same location and powered on and off at the same time.

**Calibration Results :**

| Reference concentration<br>(mg/m <sup>3</sup> ) | Total count for 1 hour | CPM (Count per minute) |
|-------------------------------------------------|------------------------|------------------------|
| 0.2438                                          | 5594                   | 93.23                  |
| 0.2650                                          | 5716                   | 95.27                  |
| 0.2044                                          | 5349                   | 89.15                  |

**Remarks:**

1. The equipment being used in this calibration is traceable to recognized National Standards.
2. The interpolation equation : Concentration (mg/m<sup>3</sup>) = K x UUT reading (CPM) where K = 0.002569
3. Correlation coefficient (r) : 0.9998

Checked by :  Date : 12-8-2024 Certified by :  Date : 15-8-2024  
CA-R-297 (22/07/2009) Leung Kwok Tai (Assistant Manager)


**\*\* End of Report \*\***

### Correlation between HVS & Dust Meter

Model: Sibata LD-5R

Serial No: 882185

|                                         |      |       |       |       |        |        |
|-----------------------------------------|------|-------|-------|-------|--------|--------|
| HVS - 24hr TSP $\mu\text{g}/\text{m}^3$ | 0.00 | 22.74 | 55.01 | 89.48 | 161.34 | 219.27 |
| Dust Meter - 24hr CPM                   | 0.0  | 7.5   | 19.3  | 32.7  | 65.5   | 85.1   |

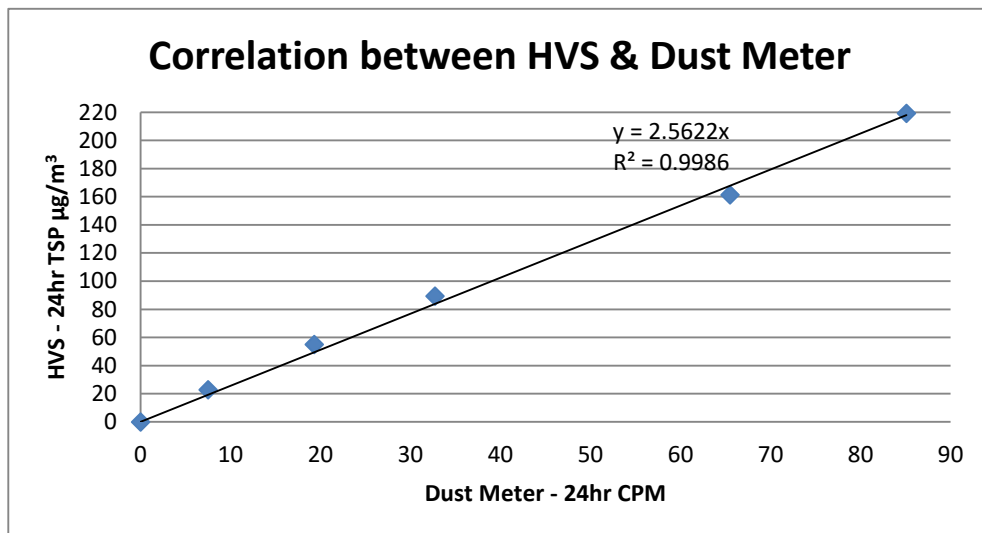

K factor = 2.569

Report no. : 240029CA242014(6)

Page 1 of 1

## **CALIBRATION CERTIFICATE OF DUST METER**

Client : Fugro Technical Services Limited

Project : Calibration Services

### **Client Supplied Information**

Details of Unit Under Test, UUT -

Description : Laser Dust Monitor  
Manufacturer : SIBATA  
Model No. : LD-5R  
Serial No. : 620407  
Next Calibration Date : 13-Jun-2025

### **Laboratory Information**

Details of Reference Equipment -

Description : Reference balance  
Equipment ID. : C-065-5  
Date of Calibration : 14-Jun-2024      Ambient Temperature : 30 °C  
Calibration Location : Calibration Lab. of FTS  
Method Used : By direct comparison the weight of dust particle trapped in a filter paper using high volume sampler (TSP method) for a certain period, with the reading of the UUT. They should be placed at the same location and powered on and off at the same time.

### **Calibration Results :**

| Reference concentration<br>(mg/m <sup>3</sup> ) | Total count for 1 hour | CPM (Count per minute) |
|-------------------------------------------------|------------------------|------------------------|
| 0.2438                                          | 5764                   | 96.07                  |
| 0.2650                                          | 5892                   | 98.20                  |
| 0.2044                                          | 5348                   | 89.13                  |

### **Remarks:**

1. The equipment being used in this calibration is traceable to recognized National Standards.
2. The interpolation equation : Concentration (mg/m<sup>3</sup>) = K x UUT reading (CPM) where K = 0.002517
3. Correlation coefficient (r) : 0.9923

Checked by :  Date : 12-8-2024      Certified by :  Date : 15-8-2024  
CA-R-297 (22/07/2009)      Leung Kwok Tai (Assistant Manager)


\*\* End of Report \*\*

### Correlation between HVS & Dust Meter

Model: Sibata LD-5R

Serial No: 620407

|                                         |      |       |       |       |        |        |
|-----------------------------------------|------|-------|-------|-------|--------|--------|
| HVS - 24hr TSP $\mu\text{g}/\text{m}^3$ | 0.00 | 16.44 | 57.14 | 94.16 | 158.42 | 212.47 |
| Dust Meter - 24hr CPM                   | 0.0  | 8.1   | 21.9  | 39.4  | 63.6   | 83.0   |

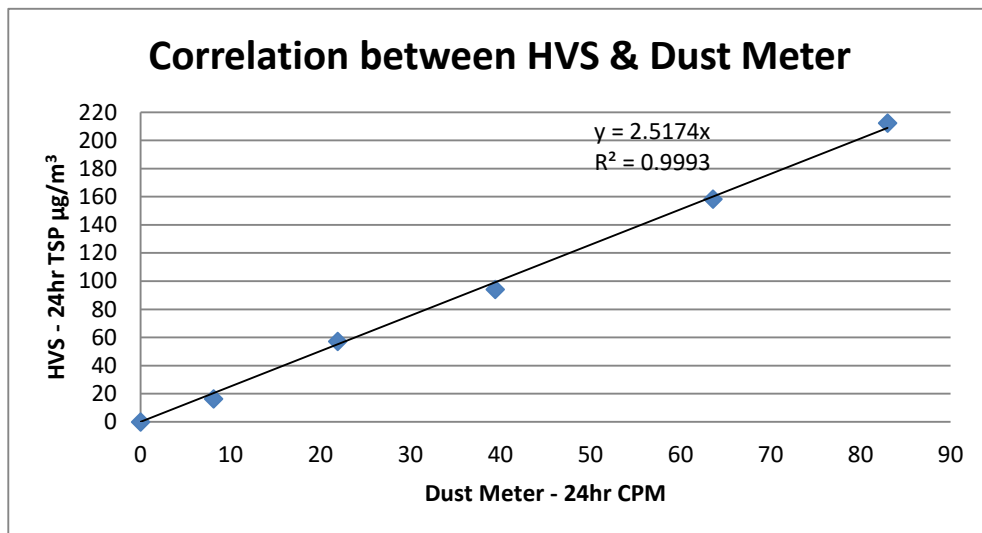

K factor = 2.517

Report no.: 240751CA242908

Page 1 of 1

## **CALIBRATION CERTIFICATE OF SOUND LEVEL METER**

### **Client Supplied Information**

Client : Materialab Consultants Ltd.

Project : Calibration Services

### **Details of Unit Under Test, UUT -**

Description : Sound Level Meter

Manufacturer : Casella

|            | Meter   | Microphone | Preamplifier |
|------------|---------|------------|--------------|
| Model No.  | CEL-63X | CE-251     | CEL-495      |
| Serial No. | 1488269 | 05742      | 003538       |

Equipment ID : N/A

Next Calibration Date : 11-Dec-2025

Specification Limit : EN 61672-1: 2003 Class 1

### **Laboratory Information**

#### **Details of Reference Equipment -**

Description : B &amp; K Acoustic Multifunction Calibrator 4226 (Traditional free field setting)

Equipment ID. : R-108-1

Date of Receipt : 11-Dec-2024

Date of Calibration : 12-Dec-2024

Calibration Location : Calibration Laboratory of FTS      Ambient Temperature : 20±2 °C

Method Used : By direct comparison      Relative Humidity : &lt;80% R.H.

### **Calibration Results :**

| Parameters                     |             | Mean Value (dB) | Specification Limit(dB) |
|--------------------------------|-------------|-----------------|-------------------------|
| A-weighting frequency response | 4000Hz      | 1.1             | 2.6 to -0.6             |
|                                | 2000Hz      | 1.2             | 2.8 to -0.4             |
|                                | 1000Hz      | 0.0             | 1.1 to -1.1             |
|                                | 500Hz       | -3.4            | -1.8 to -4.6            |
|                                | 250Hz       | -8.8            | -7.2 to -10.0           |
|                                | 125Hz       | -16.2           | -14.6 to -17.6          |
|                                | 63Hz        | -26.3           | -24.7 to -27.7          |
| Differential level linearity   | 94dB-104dB  | 0.0             | ± 0.6                   |
|                                | 104dB-114dB | 0.0             | ± 0.6                   |

### **Remarks :**

1. The equipment used in this calibration is traceable to recognized National Standards.
2. The UUT does comply with EN 61672-1: 2003 Class 1 sound level meter for the above measurement.
3. For calibration: Reference SPL are 94, 104 & 114dB, range setting is 20-140dB & time weighting is fast
4. The mean value is the average of four measurements.
5. The expanded uncertainty of calibration results is 0.01 dB with a coverage factor of 1.98 providing a confidence level of approximate 95%.
6. A general inspection of the item has been carried out and found the item is in good working conditions.
7. The result reported on this certificate apply only to the unit under test as received.

Checked by :  Date : 16-12-2024     
 Certified by :  Date : 16-12-2024  
 CA-R-297 (22/07/2009)      Wong Yim Yu (Senior Engineer)

\*\* End of Report \*\*

## **CALIBRATION CERTIFICATE OF SOUND LEVEL METER**

### **Client Supplied Information**

Client : Materialab Consultants Ltd.  
Project : Calibration Services

### **Details of Unit Under Test, UUT -**

Description : Sound Level Meter  
Manufacturer : Casella

|                       | Meter                    | Microphone | Preamplifier |
|-----------------------|--------------------------|------------|--------------|
| Model No.             | CEL-63X                  | CE-251     | CEL-495      |
| Serial No.            | 1488279                  | 02633      | 004065       |
| Equipment ID          | N/A                      |            |              |
| Next Calibration Date | 11-Aug-2025              |            |              |
| Specification Limit   | EN 61672-1: 2003 Class 1 |            |              |

### **Laboratory Information**

#### **Details of Reference Equipment -**

Description : B & K Acoustic Multifunction Calibrator 4226 (Traditional free field setting)  
Equipment ID. : R-108-1  
Date of Receipt : 06-Aug-2024  
Date of Calibration : 12-Aug-2024  
Calibration Location : Calibration Laboratory of FTS      Ambient Temperature :  $20 \pm 2$  °C  
Method Used : By direct comparison      Relative Humidity : <80% RH

### **Calibration Results :**


| Parameters                     |             | Mean Value (dB) | Specification Limit(dB) |
|--------------------------------|-------------|-----------------|-------------------------|
| A-weighting frequency response | 4000Hz      | 0.6             | 2.6 to -0.6             |
|                                | 2000Hz      | 1.1             | 2.8 to -0.4             |
|                                | 1000Hz      | 0.0             | 1.1 to -1.1             |
|                                | 500Hz       | -3.3            | -1.8 to -4.6            |
|                                | 250Hz       | -8.7            | -7.2 to -10.0           |
|                                | 125Hz       | -16.1           | -14.6 to -17.6          |
|                                | 63Hz        | -26.1           | -24.7 to -27.7          |
| Differential level linearity   | 94dB-104dB  | 0.1             | $\pm 0.6$               |
|                                | 104dB-114dB | 0.3             | $\pm 0.6$               |

### **Remarks :**

1. The equipment used in this calibration is traceable to recognized National Standards.
3. For calibration: Reference SPL are 94, 104 & 114dB, range setting is 20-140dB & time weighting is fast
3. The mean value is the average of four measurements.
4. The equipment does comply with EN 61672-1: 2003 Class 1 sound level meter for the above measurement.
5. The values given in this Calibration Certificate only relate to the values at the time of the test and any uncertainties will not include allowance for the equipment long term drift, variations with environment changes, vibration and shock during transportation, overloading, mis-handling or the capability of any other laboratory to repeat the measurement.

Checked by :   
CA-R-297 (22/07/2009)

Date : 14-8-2024

Certified by :   
Leung Kwok Tai (Assistant Manager)

Date : 15-8-2024

**\*\* End of Report \*\***

Report no.: 240751CA241730

Page 1 of 1

## **CALIBRATION CERTIFICATE OF SOUND LEVEL METER**

### **Client Supplied Information**

Client : Materialab Consultants Ltd.

Project : Calibration Services

### **Details of Unit Under Test, UUT -**

Description : Sound Level Meter  
Manufacturer : Casella

|            | Meter    | Microphone | Preamplifier |
|------------|----------|------------|--------------|
| Model No.  | CEL-633A | CE-251     | CEL-495      |
| Serial No. | 1488304  | 00995      | 003341       |

Equipment ID : N-62  
Next Calibration Date : 17-Jul-2025  
Specification Limit : EN 61672-1: 2003 Class 1

### **Laboratory Information**

#### **Details of Reference Equipment -**

Description : B & K Acoustic Multifunction Calibrator 4226 (Traditional free field setting)  
Equipment ID. : R-108-1

Date of Receipt : 15-Jul-2024

Date of Calibration : 18-Jul-2024

Calibration Location : Calibration Laboratory of FTS

Ambient Temperature : 20±2 °C

Method Used : By direct comparison

Relative Humidity : &lt;80% R.H.

### **Calibration Results :**


| Parameters                     |             | Mean Value (dB) | Specification Limit(dB) |
|--------------------------------|-------------|-----------------|-------------------------|
| A-weighting frequency response | 4000Hz      | 1.3             | 2.6 to -0.6             |
|                                | 2000Hz      | 1.3             | 2.8 to -0.4             |
|                                | 1000Hz      | 0.0             | 1.1 to -1.1             |
|                                | 500Hz       | -3.3            | -1.8 to -4.6            |
|                                | 250Hz       | -8.7            | -7.2 to -10.0           |
|                                | 125Hz       | -16.1           | -14.6 to -17.6          |
|                                | 63Hz        | -26.2           | -24.7 to -27.7          |
| Differential level linearity   | 94dB-104dB  | 0.1             | ± 0.6                   |
|                                | 104dB-114dB | 0.0             | ± 0.6                   |

### **Remarks :**

1. The equipment used in this calibration is traceable to recognized National Standards.
2. The mean value is the average of four measurements.
3. For calibration: Reference SPL are 94, 104 & 114dB, range setting is 20-140dB & time weighting is fast
4. The UUT does comply with EN 61672-1: 2003 Class 1 sound level meter for the above measurement.
5. The values given in this Calibration Certificate only relate to unit under test and the values measured at the time of the test. Any uncertainties will not include allowance for the equipment long term drift, variations with environment changes, vibration and shock during transportation, overloading, mis-handling or the capability of any other laboratory to repeat the measurement.

Checked by :   
CA-R-297 (22/07/2009)

Date : 18-7-2024

Certified by :   
Leung Kwok Tai (Assistant Manager)

Date : 19-7-2024

\*\* End of Report \*\*

Report no.: 240751CA242810(2)

Page 1 of 1

## **CALIBRATION CERTIFICATE OF SOUND LEVEL METER**

### **Client Supplied Information**

Client : Materialab Consultants Ltd.

Project : Calibration Services

### **Details of Unit Under Test, UUT -**

Description : Sound Level Meter  
Manufacturer : Casella

|            | Meter    | Microphone | Preamplifier |
|------------|----------|------------|--------------|
| Model No.  | CEL-633A | CE-251     | CEL-495      |
| Serial No. | 1488306  | 03456      | 002850       |

Equipment ID : N/A

Next Calibration Date : 02-Dec-2025

Specification Limit : EN 61672-1: 2003 Class 1

### **Laboratory Information**

#### **Details of Reference Equipment -**

Description : Acoustic Multifunction Calibrator  
Equipment ID. : R-108-1

Date of Receipt : 02-Dec-2024

Date of Calibration : 03-Dec-2024

Calibration Location : Calibration Laboratory of FTS      Ambient Temperature : 20±2 °C

Method Used : By direct comparison      Relative Humidity : &lt;80% R.H.

### **Calibration Results :**

| Parameters                     |             | Mean Value (dB) | Specification Limit(dB) |
|--------------------------------|-------------|-----------------|-------------------------|
| A-weighting frequency response | 4000Hz      | 1.0             | 2.6 to -0.6             |
|                                | 2000Hz      | 1.1             | 2.8 to -0.4             |
|                                | 1000Hz      | 0.0             | 1.1 to -1.1             |
|                                | 500Hz       | -3.2            | -1.8 to -4.6            |
|                                | 250Hz       | -8.6            | -7.2 to -10.0           |
|                                | 125Hz       | -16.1           | -14.6 to -17.6          |
|                                | 63Hz        | -26.1           | -24.7 to -27.7          |
| Differential level linearity   | 94dB-104dB  | 0.2             | ± 0.6                   |
|                                | 104dB-114dB | 0.3             | ± 0.6                   |

### **Remarks :**

1. The equipment used in this calibration is traceable to recognized National Standards.
2. The mean value is the average of four measurements.
3. For calibration: Reference SPL are 94, 104 & 114dB, range setting is 20-140dB & time weighting is fast.
4. The UUT does comply with EN 61672-1: 2003 Class 1 sound level meter for the above measurement.
- 5 The values given in this Calibration Certificate only relate to unit under test and the values measured at the time of the test. Any uncertainties will not include allowance for the equipment long term drift, variations with environment changes, vibration and shock during transportation, overloading, mis-handling or the capability of any other laboratory to repeat the measurement.

Checked by :  Date : 3-12-2024      Certified by :  Date : 3/12-2024  
CA-R-297 (22/07/2009)      Wong Yim Yu (Senior Engineer)

**\*\* End of Report \*\***

Report no.: 240751CA241316

Page 1 of 1

**CALIBRATION CERTIFICATE OF SOUND CALIBRATOR****Client Supplied Information**

Client : Materialab Consultants Ltd.

Project : Calibration Services

Details of Unit Under Test, UUT -

Description : Sound Calibrator  
Manufacturer : Casella (Model CEL-120/1)  
Serial No. : 2092809  
Equipment ID : N/A

Next Calibration Date : 06-Jun-2025

Specification Limit : EN 60942: 2003 Class 1

**Laboratory Information**

Details of Calibration Equipment

Description : Multifunction Acoustic Calibrator  
Equipment ID. : R-108-1

Date of Receipt UUT : 03-Jun-2024

Date of Calibration : 07-Jun-2024

Calibration Location : Calibration Laboratory of FTS Ambient Temperature :  $20 \pm 2$  °C


Method Used : By transfer method Relative Humidity : &lt;80% R.H.

**Calibration Results :**

| Parameters (Setting of UUT) | Mean Value (error of measurement) | Specification Limit(dB) |
|-----------------------------|-----------------------------------|-------------------------|
| 94dB                        | -0.3 dB                           | ±0.4dB                  |
| 114dB                       | -0.2 dB                           |                         |

**Remarks :**

1. The equipment used in this calibration is traceable to recognized National Standards.
2. The mean value is the average of four measurements.
3. The equipment under test does comply with the specification limit.
4. The values given in this Calibration Certificate only relate to the unit-under-test and the values measured at the time of the test. Any uncertainties quoted will not include allowances for the environmental changes, variation and shock during transportation, or the capability of any other laboratory to repeat the measurement.

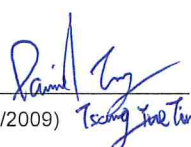Checked by :  Date : 7-6-2024  
CA-R-297 (22/07/2009) Tsing Yim Yu

Certified by :  Date : 12-6-2024  
Wong Yim Yu (Senior Engineer)

\*\* End of Report \*\*

Report no.: 240751CA240680(1)

Page 1 of 1

**CALIBRATION CERTIFICATE OF SOUND CALIBRATOR****Client Supplied Information**

Client : Materialab Consultants Ltd.

Project : Calibration Services

Details of Unit Under Test, UUT -

Description : Sound Calibrator  
Manufacturer : Casella (Model CEL-120/1)  
Serial No. : 2383687  
Equipment ID : N/A

Next Calibration Date : 24-Mar-2025

Specification Limit : EN 60942: 2003 Class 1

**Laboratory Information**

Details of Calibration Equipment -

Description : Reference Sound level meter  
Equipment ID. : R-119-2  
Date of Receipt : 18-Mar-2024  
Date of Calibration : 25-Mar-2024  
Calibration Location : Calibration Laboratory of FTS      Ambient Temperature : 20±2 °C  
Method Used : By direct comparison      Relative Humidity : <80% R.H.

**Calibration Results :**

| Parameters (Setting of UUT) | Mean Value (error of measurement) | Specification Limit(dB) |
|-----------------------------|-----------------------------------|-------------------------|
| 94dB                        | -0.2 dB                           | ±0.4dB                  |
| 114dB                       | 0.0 dB                            |                         |

**Remarks :**

1. The equipment used in this calibration is traceable to recognized National Standards.
2. The mean value is the average of four measurements.
3. The equipment under test does comply with the specification limit.
4. The values given in this Calibration Certificate only relate to the unit-under-test and the values measured at the time of the test. Any uncertainties quoted will not include allowances for the environmental changes, variation and shock during transportation, or the capability of any other laboratory to repeat the measurement.

Checked by :  Date : 26-3-2024      Certified by :  Date : 27-3-2024  
CA-R-297 (22/07/2009)      Leung Kwok Tai (Assistant Manager)

**\*\* End of Report \*\***

Report no.: 240751CA241730(2)

Page 1 of 1

**CALIBRATION CERTIFICATE OF SOUND CALIBRATOR****Client Supplied Information**

Client : Materialab Consultants Ltd.

Project : Calibration Services

Details of Unit Under Test, UUT -

Description : Sound Calibrator  
Manufacturer : Casella (Model CEL-120/1)  
Serial No. : 2383886  
Equipment ID : N/A

Next Calibration Date : 15-Jul-2025

Specification Limit : EN 60942: 2003 Class 1

**Laboratory Information**

Details of Calibration Equipment -

Description : Reference Sound level meter  
Equipment ID. : R-119-3

Date of Receipt : 15-Jul-2024

Date of Calibration : 16-Jul-2024

Calibration Location : Calibration Laboratory of FTS Ambient Temperature : 20±2 °C


Method Used : By direct comparison Relative Humidity : &lt;80% R.H.

**Calibration Results :**

| Parameters (Setting of UUT) | Mean Value (error of measurement) | Specification Limit(dB) |
|-----------------------------|-----------------------------------|-------------------------|
| 94dB                        | -0.2 dB                           | ±0.4dB                  |
| 114dB                       | 0.0 dB                            |                         |

**Remarks :**

1. The equipment used in this calibration is traceable to recognized National Standards.
2. The mean value is the average of four measurements.
3. The equipment under test does comply with the specification limit.
4. The values given in this Calibration Certificate only relate to the unit-under-test and the values measured at the time of the test. Any uncertainties quoted will not include allowances for the environmental changes, variation and shock during transportation, or the capability of any other laboratory to repeat the measurement.

Checked by :  Date : 18-7-2024 Certified by :  Date : 19-7-2024  
CA-R-297 (22/07/2009) Leung Kwok Tai (Assistant Manager)

**\*\* End of Report \*\***

Report no.: 240751CA242384

Page 1 of 1

**CALIBRATION CERTIFICATE OF SOUND CALIBRATOR**

Client : Materialab Consultants Ltd.

Project : Calibration Services

**Client Supplied Information**

Details of Unit Under Test, UUT -

Description : Sound Calibrator  
Manufacturer : Casella (Model CEL-120/1)  
Serial No. : 2383707  
Equipment ID : N/A  
Next Calibration Date : 13-Oct-2025  
Specification Limit : EN 60942: 2003 Class 1

**Laboratory Information**

Details of Calibration Equipment -

Description : Reference Sound level meter  
Equipment ID. : R-119-2  
Date of Receipt : 10-Oct-2024  
Date of Calibration : 14-Oct-2024  
Calibration Location : Calibration Laboratory of FTS      Ambient Temperature :  $20 \pm 2$  °C  
Method Used : By direct comparison      Relative Humidity : < 80 %RH

**Calibration Results :**

| Parameters (Setting of UUT) | Mean Value (error of measurement) | Specification Limit(dB) |
|-----------------------------|-----------------------------------|-------------------------|
| 94dB                        | -0.3 dB                           | ±0.4dB                  |
| 114dB                       | -0.2 dB                           |                         |

**Remarks :**

1. The equipment used in this calibration is traceable to recognized National Standards.
2. The mean value is the average of four measurements.
3. The unit under test complies with the specification limit.
4. The values given in this Calibration Certificate only relate to the unit-under-test and the values measured at the time of the test. Any uncertainties quoted will not include allowances for the environmental changes, variation and shock during transportation, or the capability of any other laboratory to repeat the measurement.

Checked by :   
CA-R-297 (22/07/2009)

Date : 15-10-2024

Certified by : 

Date : 15-10-2024

Wong Yim Yu (Senior Engineer)

\*\* End of Report \*\*

## **FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : [matlab@fugro.com](mailto:matlab@fugro.com)  
Website : [www.fugro.com](http://www.fugro.com)



### **Appendix E**

#### **Environmental Monitoring Schedules, Examination Schedules and Arrangements on Deferral of Class Resumption for All Schools**

|        | Sunday | Monday                                                                                    | Tuesday                                                                                               | Wednesday                                                                                 | Thursday                                                                                              | Friday                                                                                                | Saturday                                                                                              |
|--------|--------|-------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------------------|
| Feb-25 |        |                                                                                           |                                                                                                       |                                                                                           |                                                                                                       |                                                                                                       | 1                                                                                                     |
|        |        |                                                                                           |                                                                                                       |                                                                                           |                                                                                                       |                                                                                                       | AMS5 Tin Liu<br>AMS7A Sheung Wo Che<br>AMS14 Ha Wo Che<br>AMS15 Ha Wo Che                             |
|        |        |                                                                                           |                                                                                                       |                                                                                           |                                                                                                       |                                                                                                       |                                                                                                       |
|        | 2      | 3                                                                                         | 4                                                                                                     | 5                                                                                         | 6                                                                                                     | 7                                                                                                     | 8                                                                                                     |
|        |        |                                                                                           |                                                                                                       |                                                                                           |                                                                                                       | AMS5 Tin Liu<br>AMS7A Sheung Wo Che<br>AMS14 Ha Wo Che<br>AMS15 Ha Wo Che                             |                                                                                                       |
|        |        |                                                                                           |                                                                                                       |                                                                                           |                                                                                                       | NMS 1, NMS 2, NMS 3, NMS 4, NMS 5A, NMS 6A, NMS 7, NMS 15, NMS 16, NMS 18, NMS 23, NMS 27             | NMS 8, NMS 9, NMS 10A, NMS 11, NMS 12, NMS 13, NMS 14, NMS17, NMS 19, NMS 20, NMS 24, NMS 25A, NMS 26 |
|        | 9      | 10                                                                                        | 11                                                                                                    | 12                                                                                        | 13                                                                                                    | 14                                                                                                    | 15                                                                                                    |
|        |        |                                                                                           |                                                                                                       |                                                                                           | AMS5 Tin Liu<br>AMS7A Sheung Wo Che<br>AMS14 Ha Wo Che<br>AMS15 Ha Wo Che                             |                                                                                                       |                                                                                                       |
|        |        |                                                                                           |                                                                                                       |                                                                                           | NMS 1, NMS 2, NMS 3, NMS 4, NMS 5A, NMS 6A, NMS 7, NMS 15, NMS 16, NMS 18, NMS 23, NMS 27             | NMS 8, NMS 9, NMS 10A, NMS 11, NMS 12, NMS 13, NMS 14, NMS17, NMS 19, NMS 20, NMS 24, NMS 25A, NMS 26 |                                                                                                       |
|        | 16     | 17                                                                                        | 18                                                                                                    | 19                                                                                        | 20                                                                                                    | 21                                                                                                    | 22                                                                                                    |
|        |        |                                                                                           |                                                                                                       | AMS5 Tin Liu<br>AMS7A Sheung Wo Che<br>AMS14 Ha Wo Che<br>AMS15 Ha Wo Che                 |                                                                                                       |                                                                                                       |                                                                                                       |
|        |        |                                                                                           |                                                                                                       | NMS 1, NMS 2, NMS 3, NMS 4, NMS 5A, NMS 6A, NMS 7, NMS 15, NMS 16, NMS 18, NMS 23, NMS 27 | NMS 8, NMS 9, NMS 10A, NMS 11, NMS 12, NMS 13, NMS 14, NMS17, NMS 19, NMS 20, NMS 24, NMS 25A, NMS 26 |                                                                                                       |                                                                                                       |
|        | 23     | 24                                                                                        | 25                                                                                                    | 26                                                                                        | 27                                                                                                    | 28                                                                                                    |                                                                                                       |
|        |        | AMS5 Tin Liu<br>AMS7A Sheung Wo Che<br>AMS14 Ha Wo Che<br>AMS15 Ha Wo Che                 |                                                                                                       |                                                                                           |                                                                                                       |                                                                                                       |                                                                                                       |
|        |        | NMS 1, NMS 2, NMS 3, NMS 4, NMS 5A, NMS 6A, NMS 7, NMS 15, NMS 16, NMS 18, NMS 23, NMS 27 | NMS 8, NMS 9, NMS 10A, NMS 11, NMS 12, NMS 13, NMS 14, NMS17, NMS 19, NMS 20, NMS 24, NMS 25A, NMS 26 |                                                                                           |                                                                                                       |                                                                                                       |                                                                                                       |

Remark

- Actual monitoring may be subjected to change due to any safety concern or adverse weather condition.
- The Impact Air Monitoring Stations to be monitored should be selected based on the prevailing wind direction and their proximity to the active construction works.
- According to the Hong Kong Observatory, anticipated wind directions in April 2024 is east.
- According to the Contractor, the anticipated major construction activities in the reporting month includes:
  - Irrigation Work at Zone 1 and 2
  - Planting Work (Tree / Shrub) at Zone 1 and 2
  - Noise Barrier Remaining Installation (downpipe, cladding and defect rectification) at Zone 1, 2, 3, 4 and 5
  - Construction of Draw pit and Pillar box at Zone 2
  - Road surface Maintenance at Zone 3, 4 and 5
  - Tree Works (including preservation / felling/ pruning/ transplantation) at Zone 3
  - Slope works at Zone 3
  - Irrigation Work + Landscaping Works at Zone 4
  - Slope Landscaping Works + Irrigation System for Landscaping on Slope at Zone 5

|        | Sunday                                                                                                                                                                 | Monday | Tuesday                                                                                               | Wednesday                                                                                 | Thursday                                                                                              | Friday                                                                                                | Saturday                                                                                              |
|--------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------|-------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------------------|
| Mar-25 |                                                                                                                                                                        |        |                                                                                                       |                                                                                           |                                                                                                       |                                                                                                       | 1                                                                                                     |
|        |                                                                                                                                                                        |        |                                                                                                       |                                                                                           |                                                                                                       |                                                                                                       |                                                                                                       |
|        |                                                                                                                                                                        |        |                                                                                                       |                                                                                           |                                                                                                       |                                                                                                       |                                                                                                       |
|        | 2                                                                                                                                                                      | 3      | 4                                                                                                     | 5                                                                                         | 6                                                                                                     | 7                                                                                                     | 8                                                                                                     |
|        | AMS5 Tin Liu<br>AMS7A Sheung Wo Che<br>AMS14 Ha Wo Che<br>AMS15 Ha Wo Che<br>NMS 1, NMS 2, NMS 3, NMS 4, NMS 5A, NMS 6A, NMS 7, NMS 15, NMS 16, NMS 18, NMS 23, NMS 27 |        | NMS 8, NMS 9, NMS 10A, NMS 11, NMS 12, NMS 13, NMS 14, NMS17, NMS 19, NMS 20, NMS 24, NMS 25A, NMS 26 |                                                                                           |                                                                                                       |                                                                                                       | AMS5 Tin Liu<br>AMS7A Sheung Wo Che<br>AMS14 Ha Wo Che<br>AMS15 Ha Wo Che                             |
|        | 9                                                                                                                                                                      | 10     | 11                                                                                                    | 12                                                                                        | 13                                                                                                    | 14                                                                                                    | 15                                                                                                    |
|        |                                                                                                                                                                        |        |                                                                                                       |                                                                                           |                                                                                                       | AMS5 Tin Liu<br>AMS7A Sheung Wo Che<br>AMS14 Ha Wo Che<br>AMS15 Ha Wo Che                             |                                                                                                       |
|        |                                                                                                                                                                        |        |                                                                                                       |                                                                                           |                                                                                                       | NMS 1, NMS 2, NMS 3, NMS 4, NMS 5A, NMS 6A, NMS 7, NMS 15, NMS 16, NMS 18, NMS 23, NMS 27             | NMS 8, NMS 9, NMS 10A, NMS 11, NMS 12, NMS 13, NMS 14, NMS17, NMS 19, NMS 20, NMS 24, NMS 25A, NMS 26 |
|        | 16                                                                                                                                                                     | 17     | 18                                                                                                    | 19                                                                                        | 20                                                                                                    | 21                                                                                                    | 22                                                                                                    |
|        |                                                                                                                                                                        |        |                                                                                                       |                                                                                           | AMS5 Tin Liu<br>AMS7A Sheung Wo Che<br>AMS14 Ha Wo Che<br>AMS15 Ha Wo Che                             |                                                                                                       |                                                                                                       |
|        |                                                                                                                                                                        |        |                                                                                                       |                                                                                           | NMS 1, NMS 2, NMS 3, NMS 4, NMS 5A, NMS 6A, NMS 7, NMS 15, NMS 16, NMS 18, NMS 23, NMS 27             | NMS 8, NMS 9, NMS 10A, NMS 11, NMS 12, NMS 13, NMS 14, NMS17, NMS 19, NMS 20, NMS 24, NMS 25A, NMS 26 |                                                                                                       |
|        | 23                                                                                                                                                                     | 24     | 25                                                                                                    | 26                                                                                        | 27                                                                                                    | 28                                                                                                    |                                                                                                       |
|        |                                                                                                                                                                        |        |                                                                                                       | AMS5 Tin Liu<br>AMS7A Sheung Wo Che<br>AMS14 Ha Wo Che<br>AMS15 Ha Wo Che                 |                                                                                                       |                                                                                                       |                                                                                                       |
|        |                                                                                                                                                                        |        |                                                                                                       | NMS 1, NMS 2, NMS 3, NMS 4, NMS 5A, NMS 6A, NMS 7, NMS 15, NMS 16, NMS 18, NMS 23, NMS 27 | NMS 8, NMS 9, NMS 10A, NMS 11, NMS 12, NMS 13, NMS 14, NMS17, NMS 19, NMS 20, NMS 24, NMS 25A, NMS 26 |                                                                                                       |                                                                                                       |
|        | 30                                                                                                                                                                     | 31     |                                                                                                       |                                                                                           |                                                                                                       |                                                                                                       |                                                                                                       |
|        |                                                                                                                                                                        |        |                                                                                                       |                                                                                           |                                                                                                       |                                                                                                       |                                                                                                       |
|        |                                                                                                                                                                        |        |                                                                                                       |                                                                                           |                                                                                                       |                                                                                                       |                                                                                                       |

Remark

- Actual monitoring may be subjected to change due to any safety concern or adverse weather condition.
- The Impact Air Monitoring Stations to be monitored should be selected based on the prevailing wind direction and their proximity to the active construction works.
- According to the Hong Kong Observatory, anticipated wind directions in April 2024 is east.
- According to the Contractor, the anticipated major construction activities in the reporting month includes:
  - Irrigation Work at Zone 1 and 2
  - Planting Work (Tree / Shrub) at Zone 1 and 2
  - Noise Barrier Remaining Installation (downpipe, cladding and defect rectification) at Zone 1, 2, 3, 4 and 5
  - Construction of Draw pit and Pillar box at Zone 2
  - Road surface Maintenance at Zone 3, 4 and 5
  - Tree Works (including preservation / felling/ pruning/ transplantation) at Zone 3
  - Slope works at Zone 3
  - Irrigation Work + Landscaping Works at Zone 4
  - Slope Landscaping Works + Irrigation System for Landscaping on Slope at Zone 5

## FUGRO TECHNICAL SERVICES LIMITED

Room 723 & 725, 7/F, Block B,  
Profit Industrial Building,  
1-15 Kwai Fung Crescent, Kwai Fong,  
Hong Kong

Tel : (852)-24508238  
Fax : (852)-24508032  
Email : mcl@fugro.com



### Project: Road Widening and Retrofitting Noise Barriers on Tai Po Road (Sha Tin Section)

#### Regular Night Time Noise Monitoring Schedule (February 2025)

| Sun | Mon | Tue                                          | Wed                                          | Thu                                         | Fri | Sat |
|-----|-----|----------------------------------------------|----------------------------------------------|---------------------------------------------|-----|-----|
|     |     |                                              |                                              |                                             |     | 1   |
| 2   | 3   | 4                                            | 5                                            | 6<br>Regular night time<br>noise monitoring | 7   | 8   |
| 9   | 10  | 11<br>Regular night time<br>noise monitoring | 12                                           | 13                                          | 14  | 15  |
| 16  | 17  | 18                                           | 19<br>Regular night time<br>noise monitoring | 20                                          | 21  | 22  |
| 23  | 24  | 25<br>Regular night time<br>noise monitoring | 26                                           | 27                                          | 28  |     |

#### Remarks

1. Due to safety concern, 2 staffs will carry out the night time noise monitoring together at all 21 monitoring stations on the same monitoring night of each week.
2. Actual monitoring schedule may be subjected to change due to any safety concern or adverse weather condition.

**FUGRO TECHNICAL SERVICES LIMITED**

Room 723 & 725, 7/F, Block B,  
Profit Industrial Building,  
1-15 Kwai Fung Crescent, Kwai Fong,  
Hong Kong

Tel : (852)-24508238  
Fax : (852)-24508032  
Email : mcl@fugro.com

**Project: Road Widening and Retrofitting Noise Barriers on Tai Po Road (Sha Tin Section)****Tentative Regular Night Time Noise Monitoring Schedule (March 2025)**

| Sun | Mon | Tue                                          | Wed | Thu                                          | Fri | Sat |
|-----|-----|----------------------------------------------|-----|----------------------------------------------|-----|-----|
|     |     |                                              |     |                                              |     | 1   |
| 2   | 3   | 4                                            | 5   | 6<br>Regular night time<br>noise monitoring  | 7   | 8   |
| 9   | 10  | 11<br>Regular night time<br>noise monitoring | 12  | 13                                           | 14  | 15  |
| 16  | 17  | 18                                           | 19  | 20<br>Regular night time<br>noise monitoring | 21  | 22  |
| 23  | 24  | 25<br>Regular night time<br>noise monitoring | 26  | 27                                           | 28  | 29  |
| 30  | 31  |                                              |     |                                              |     |     |

**Remarks**

1. Due to safety concern, 2 staffs will carry out the night time noise monitoring together at all 21 monitoring stations on the same monitoring night of each week.
2. Actual monitoring schedule may be subjected to change due to any safety concern or adverse weather condition.

| 沙田崇真學校<br>2024-2025 年度校曆表 |     |               |               |               |               |               |               |               |                              |
|---------------------------|-----|---------------|---------------|---------------|---------------|---------------|---------------|---------------|------------------------------|
|                           | 周次  | 日             | 一             | 二             | 三             | 四             | 五             | 六             | 假 期 / 事 項                    |
| 二零二四年九月                   | 一   | 1             | ②             | ③             | ④             | ⑤             | ⑥             | 7             | 上學期開始(2/9)小一新生家長座談會(2/9 上午)  |
|                           | 二   | 8             | ⑨             | ⑩             | 11            | 12            | 13            | 14            | 開學周(2/9-10/9)                |
|                           | 三   | 15            | 16            | ⑰             | <del>18</del> | 19            | 20            | 21            | 中秋節翌日(18/9)                  |
|                           | 四   | 22            | 23            | 24            | 25            | 26            | 27            | 28            | 親師座談會(28/9)                  |
|                           | 五   | 29            | <del>30</del> |               |               |               |               |               | 教師專業發展日(30/9)                |
| 十月                        |     |               |               | <del>1</del>  | 2             | 3             | 4             | 5             | 國慶日(1/10)                    |
|                           | 六   | 6             | 7             | 8             | 9             | 10            | <del>11</del> | 12            | 小一滿月慶典(7/10)重陽節假期(11/10)     |
|                           | 七   | 13            | 14            | 15            | 16            | 17            | 18            | 19            | 零功課日(18/10)升中家長座談會(18/10 晚上) |
|                           | 八   | 20            | 21            | 22            | 23            | 24            | 25            | 26            |                              |
|                           | 九   | 27            | 28            | 29            | 30            | 31            |               |               |                              |
| 十一月                       |     |               |               |               |               |               | 1             | 2             | 二至六年級預考周(4/11-12/11)         |
|                           | 十   | 3             | 4             | 5             | 6             | 7             | 8             | 9             | 二至五年級考試(13-14/11，18-19/11)   |
|                           | 十一  | 10            | 11            | ⑫             | ⑬             | ⑭             | ⑮             | 16            | 六年級報分試(13-19/11)             |
|                           | 十二  | 17            | ⑱             | ⑲             | 20            | 21            | 22            | 23            |                              |
|                           | 十三  | 24            | 25            | 26            | 27            | 28            | 29            | 30            |                              |
| 十二月                       | 十四  | 1             | 2             | 3             | 4             | 5             | 6             | 7             | 零功課日(4/12) 升中家長座談會(7/12 上午)  |
|                           | 十五  | 8             | 9             | 10            | 11            | 12            | 13            | 14            | 六年級家長日(14/12)                |
|                           | 十六  | 15            | 16            | 17            | 18            | 19            | ⑳             | 21            | 五年級境外交流（16-19/12）            |
|                           | 十七  | 22            | <del>23</del> | <del>24</del> | <del>25</del> | <del>26</del> | <del>27</del> | <del>28</del> | 一至四年級全方位學習活動日(18-19/12)      |
|                           | 十八  | <del>29</del> | <del>30</del> | <del>31</del> |               |               |               |               | 六年級教育營(18-20/12)聖誕崇拜(20/12)  |
| 二零二五年一月                   |     |               |               | <del>1</del>  | 2             | 3             | 4             |               | 聖誕及新年假期(23/12-1/1)           |
|                           | 十九  | 5             | 6             | 7             | 8             | 9             | 10            | 11            | 一至五年級家長日(11/1)               |
|                           | 二十  | 12            | 13            | 14            | 15            | 16            | 17            | 18            | 專題研習周(20-22/1)               |
|                           | 二十一 | 19            | 20            | 21            | 22            | 23            | 24            | 25            | 跨學科活動日(23/1) 學校旅行日(24/1)     |
|                           | 二十二 | 26            | <del>27</del> | <del>28</del> | <del>29</del> | <del>30</del> | <del>31</del> |               | 農曆新年假期(27/1-9/2)             |

學校假期    教師專業發展日，學生不用上課    及考試日：半天上課  
星期六不用上課

|    | 周次  | 日             | 一             | 二             | 三             | 四             | 五             | 六             | 假 期 / 事 項                                                                                                                                |
|----|-----|---------------|---------------|---------------|---------------|---------------|---------------|---------------|------------------------------------------------------------------------------------------------------------------------------------------|
| 二月 |     |               |               |               |               |               |               | <del>1</del>  | 下學期開始(10/2)<br>陸運會(14/2) 旅行後備日(21/2)<br>六年級預考周(24/2-4/3)<br>一至五年級階段性評估預備周（24/2-4/3）                                                      |
|    | 二十三 | <del>2</del>  | <del>3</del>  | <del>4</del>  | <del>5</del>  | <del>6</del>  | <del>7</del>  | <del>8</del>  |                                                                                                                                          |
|    | 二十四 | <del>9</del>  | 10            | 11            | 12            | 13            | 14            | 15            |                                                                                                                                          |
|    | 二十五 | 16            | 17            | 18            | 19            | 20            | 21            | 22            |                                                                                                                                          |
| 三月 | 二十六 | 23            | 24            | 25            | 26            | 27            | 28            |               | 一至五年級階段性評估(5-6/3，10-11/3)<br>六年級報分試(5-11/3)<br>零功課日(19/3)<br>升中家長座談會(29/3 上午)                                                            |
|    |     |               |               |               |               |               |               | 1             |                                                                                                                                          |
|    | 二十七 | 2             | 3             | ④             | ⑤             | ⑥             | ⑦             | 8             |                                                                                                                                          |
|    | 二十八 | 9             | ⑩             | ⑪             | 12            | 13            | 14            | 15            |                                                                                                                                          |
| 四月 | 二十九 | 16            | 17            | 18            | 19            | 20            | 21            | 22            | 清明節假期(4/4) 升中家長座談會(9/4 下午)<br>一至六年級家長日(12/4) 福音周及復活節崇拜(10-11/4)<br>復活節假期(14-23/4)<br>綜藝晚會綵排(29/4) 綜藝晚會（30/4）<br>(29-30/4 表演生出席，非表演生無須上課) |
|    | 三十  | 23            | 24            | 25            | 26            | 27            | 28            | 29            |                                                                                                                                          |
|    | 三十一 | 30            | 31            |               |               |               |               |               |                                                                                                                                          |
|    |     |               |               | 1             | 2             | 3             | <del>4</del>  | 5             |                                                                                                                                          |
| 五月 | 三十二 | 6             | 7             | 8             | 9             | 10            | ⑪             | 12            | 勞動節假期(1/5) 拍住上辯論賽(3/5)<br>公眾假期(5/5)<br>一至六年級預考周(19-27/5)<br>一至四、六年級考試(28-29/5，2-3/6)<br>五年級報分試(28/5-3/6) 端午節假期(31/5)                     |
|    | 三十三 | 13            | <del>14</del> | <del>15</del> | <del>16</del> | <del>17</del> | <del>18</del> | <del>19</del> |                                                                                                                                          |
|    | 三十四 | <del>20</del> | <del>21</del> | <del>22</del> | <del>23</del> | 24            | 25            | 26            |                                                                                                                                          |
|    | 三十五 | 27            | 28            | ⑳             | 30            |               |               |               |                                                                                                                                          |
| 六月 |     |               |               |               |               | <del>1</del>  | 2             | 3             | 小一新生家長座談會(14/6 上午)<br>升中家長座談會(21/6 上午)<br>半天上課(17,18,23/6-11/7) 畢業禮綵排(25-26/6)<br>畢業禮暨感恩崇拜（27/6）畢業禮補假(30/6)                              |
|    | 三十六 | 4             | <del>5</del>  | 6             | 7             | 8             | 9             | 10            |                                                                                                                                          |
|    | 三十七 | 11            | 12            | 13            | 14            | 15            | 16            | 17            |                                                                                                                                          |
|    | 三十八 | 18            | 19            | 20            | 21            | 22            | 23            | 24            |                                                                                                                                          |
| 七月 | 三十九 | 25            | 26            | ㉑             | ㉒             | ㉓             | ㉔             | <del>31</del> | 香港特區成立紀念日(1/7)<br>小一新生親子活動日(5/7 上午)<br>中學學位分配結果公佈(8/7) 結業禮(11/7)<br>教師專業發展日(15/7) 五年級家長日(12/7 上午)<br>暑假(16/7-31/8)                       |
|    | 四十  | 1             | 2             | 3             | 4             | 5             | 6             | 7             |                                                                                                                                          |
|    | 四十一 | 8             | 9             | 10            | 11            | 12            | 13            | 14            |                                                                                                                                          |
|    | 四十二 | 15            | 16            | ⑰             | ⑱             | 19            | 20            | 21            |                                                                                                                                          |
| 八月 | 四十三 | 22            | ㉓             | ㉔             | ㉕             | ㉖             | ㉗             | 28            | 小一新生家長座談會(16/8 上午)<br>小一適應課程(18-20/8)<br>小五小六銜接課程(18-20/8)                                                                               |
|    | 四十四 | 29            | 30            |               |               |               |               |               |                                                                                                                                          |
|    |     |               |               | <del>1</del>  | ②             | ③             | ④             | 5             |                                                                                                                                          |
|    | 四十五 | 6             | ⑦             | ⑧             | ⑨             | ⑩             | ⑪             | 12            |                                                                                                                                          |
| 九月 | 四十六 | <del>13</del> | ⑭             | 15            | 16            | 17            | 18            | 19            |                                                                                                                                          |
|    | 四十七 | <del>20</del> | 21            | 22            | 23            | 24            | 25            | 26            |                                                                                                                                          |
|    | 四十八 | <del>27</del> | 28            | 29            | 30            | 31            |               |               |                                                                                                                                          |
|    |     |               |               |               |               |               |               |               |                                                                                                                                          |
| 十月 | 四十九 | 3             | 4             | 5             | 6             | 7             | 8             | 9             |                                                                                                                                          |
|    | 五十  | 10            | 11            | 12            | 13            | 14            | 15            | 16            |                                                                                                                                          |
|    | 五十一 | 17            | 18            | 19            | 20            | 21            | 22            | 23            |                                                                                                                                          |
|    | 五十二 | 24            | 25            | 26            | 27            | 28            | 29            | 30            |                                                                                                                                          |

聖公會主風小學 2024-2025 年度上學期校曆表

| 週次 | 月份   | 星 期 |     |     |     |          |    |    | 行 事 要 項                                                                             | 假期日數       |
|----|------|-----|-----|-----|-----|----------|----|----|-------------------------------------------------------------------------------------|------------|
|    |      | 日   | 一   | 二   | 三   | 四        | 五  | 六  |                                                                                     |            |
| ①  | 2024 | 1   | 2*  | 3   | 4   | 5        | 6  | 7  | 2/9 上學期開學日<br><br>17/9 教師專業發展日    17/9 中秋節    18/9 中秋節翌日                            | 1          |
| ②  | 九月   | 8   | 9   | 10  | 11  | 12       | 13 | 14 |                                                                                     |            |
| ③  |      | 15  | 16  | 17* | 18  | 19       | 20 | 21 |                                                                                     |            |
| ④  |      | 22  | 23  | 24  | 25  | 26       | 27 | 28 |                                                                                     |            |
| ⑤  |      | 29  | 30  |     |     |          |    |    |                                                                                     |            |
| ⑥  | 十月   |     |     | 1   | 2   | 3        | 4  | 5  | 1/10 國慶日<br>10/10 旅行日    11/10 重陽節                                                  | 1<br>1     |
| ⑦  |      | 6   | 7   | 8   | 9   | 10*      | 11 | 12 |                                                                                     |            |
| ⑧  |      | 13  | 14  | 15  | 16  | 17       | 18 | 19 |                                                                                     |            |
| ⑨  |      | 20  | 21  | 22  | 23  | 24       | 25 | 26 |                                                                                     |            |
| ⑩  | 十一月  |     |     |     |     |          | 1  | 2  | 6/11 評估前一天學生 11 時 15 分放學<br>7/11－12/11 第一次評估(P.2-P.5)／呈分試(P.6)<br><br>18/11 第十六屆陸運會 |            |
| ⑪  |      | 3   | 4   | 5   | 6*  | 7        | 8  | 9  |                                                                                     |            |
| ⑫  |      | 10  | 11  | 12  | 13  | 14       | 15 | 16 |                                                                                     |            |
| ⑬  |      | 17  | 18* | 19  | 20  | 21       | 22 | 23 |                                                                                     |            |
| ⑭  | 十二月  | 24  | 25  | 26  | 27  | 28       | 29 | 30 | 11/12 上學期家長日及派發成績表(P.2-P.6)<br>12/12 教師專業發展日<br><br>23/12/2024－4/1/2025 聖誕及新年假期     | 6<br>3     |
| ⑮  |      | 1   | 2   | 3   | 4   | 5        | 6  | 7  |                                                                                     |            |
| ⑯  |      | 8   | 9   | 10  | 11* | 12*      | 13 | 14 |                                                                                     |            |
| ⑰  |      | 15  | 16  | 17  | 18  | 19       | 20 | 21 |                                                                                     |            |
| ⑱  | 2025 | 22  | 23  | 24  | 25  | 26       | 27 | 28 | 20/1－22/1 教育營(P.6)<br>27/1－5/2 農曆新年假期                                               | 4<br><br>5 |
| ⑲  |      | 29  | 30  | 31  |     |          |    |    |                                                                                     |            |
| ⑳  |      |     |     |     | 1   | 2        | 3  | 4  |                                                                                     |            |
| ㉑  |      | 5   | 6   | 7   | 8   | 9        | 10 | 11 |                                                                                     |            |
| ㉒  | 二月   | 12  | 13  | 14  | 15  | 16       | 17 | 18 | 3/2 下學期開始<br><br>26/2 評估前一天學生 11 時 15 分放學<br>27/2－4/3 第二次評估／呈分試(P.6)                | 1<br>4     |
| ㉓  |      | 19  | 20* | 21* | 22* | 23       | 24 | 25 |                                                                                     |            |
| ㉔  |      | 26  | 27  | 28  | 29  | 30       | 31 |    |                                                                                     |            |
| ㉕  |      |     |     |     |     |          |    | 1  |                                                                                     |            |
| ㉖  | 二月   | 2   | 3   | 4   | 5   | 6        | 7  | 8  |                                                                                     |            |
| ㉗  |      | 9   | 10  | 11  | 12  | 13       | 14 | 15 |                                                                                     |            |
| ㉘  |      | 16  | 17  | 18  | 19  | 20       | 21 | 22 |                                                                                     |            |
| ㉙  |      | 23  | 24  | 25  | 26* | 27/2-4/3 |    |    |                                                                                     |            |

附註： □代表假期    ★代表特別事宜

# 培英中學2024至2025年度校曆表

|    |   | 日               | 一               | 二               | 三               | 四               | 五               | 六        | 假期及注意事項                                                                                  |
|----|---|-----------------|-----------------|-----------------|-----------------|-----------------|-----------------|----------|------------------------------------------------------------------------------------------|
| 週次 | 八 | (18)            | (19)            | (20)            | (21)            | (22)            | (23)            | (24)     |                                                                                          |
|    | 月 | (25)            | (26)            | (27)            | (28)            | (29)            | (30)            | (31)     | (27/8)領取書籍校服<br>(27-30/8)升中導向課程 (28/8)領取書籍校服                                             |
| 1  | 九 | Sept<br>1       | 2               | 3               | 4               | 5               | 6               | 7        | (2/9)開學禮<br>(3/9)正式上課 (6/9)開學崇拜會                                                         |
| 2  |   | 8               | 9               | 10              | 11              | 12              | 13              | 14       | (9/9)中一至中五開始繳交周記 (12/9)各班拍攝學生相片<br>(9-13/9)學生活動招募周                                       |
| 3  | 月 | 15              | 16              | 17              | (18)            | 19              | 20              | 21       | (18/9)中秋節翌日假期 (20/9)學生會候選內閣論壇                                                            |
| 4  |   | 22              | 23              | 24              | 25              | 26              | 27              | 28       | (23-27/9)學生會選舉                                                                           |
| 5  | 十 | 29              | 30              | Oct<br>(1)      | 2               | 3               | 4               | 5        | (1/10)國慶日假期                                                                              |
| 6  |   | 6               | 7               | 8               | 9               | 10              | (11)            | 12       | (11/10)重陽節假期                                                                             |
| 7  | 月 | 13              | 14              | 15              | 16              | 17              | 18              | 19       | (18/10)學生領袖就職典禮                                                                          |
| 8  |   | 20              | 21 <sup>T</sup> | 22 <sup>T</sup> | 23 <sup>T</sup> | 24 <sup>T</sup> | 25 <sup>T</sup> | 26       | (21/10-25/10)中一至中六級統一測驗                                                                  |
| 9  | 十 | 27              | 28              | 29              | 30              | 31              | Nov<br>1        | 2        |                                                                                          |
| 10 |   | 3               | 4               | 5               | 6               | 7               | 8               | 9        | (4/11-8/11)科技周                                                                           |
| 11 | 一 | 10 <sup>△</sup> | (11)            | 12              | 13              | 14              | 15              | 16       | (10/11)教育主日<br>(10/11)家長教師會第二十七屆會員大會 (11/11)家長教師會會員大會翌日假期                                |
| 12 |   | 17              | 18              | 19              | 20              | 21              | 22              | 23       | (18/11-22/11)敬師周                                                                         |
| 13 | 月 | 24              | 25              | 26              | 27              | 28              | 29              | 30       | (24/11)南區中學巡禮<br>(25/11-29/11)藝術周<br>(30/11)資訊日暨多元學習博覽                                   |
| 14 | 十 | Dec<br>1        | (2)             | 3               | 4               | 5               | 6 <sup>△</sup>  | 7        | (2/12)資訊日翌日假期 (3/12)換冬季校服<br>(4/12)國家憲法日 (6/12)學校旅行                                      |
| 15 | 二 | 8               | 9               | 10              | 11              | 12              | 13              | 14       | (9/12-13/12)體育周<br>(14/12)中西南區小學數學比賽                                                     |
| 16 | 月 | 15              | 16              | 17              | 18 <sup>△</sup> | 19              | (20)            | 21       | (17/12)接種疫苗 (18/12)全方位學習日(1)<br>(18/12)下午聖誕崇拜及慶祝會綵排 (19/12)聖誕崇拜及慶祝會<br>(20/12)教師專業發展日(1) |
| 17 |   | 22              | (23)            | (24)            | (25)            | (26)            | (27)            | (28)     | (23-31/12)中六級補課<br>(23/12-1/1)聖誕及新年假期共10天                                                |
| 18 | 一 | (29)            | (30)            | (31)            | Jan<br>(1)      | 2               | 3               | 4        | (3/1)拍攝畢業照及班相                                                                            |
| 19 |   | 5               | 6 <sup>E</sup>  | 7 <sup>E</sup>  | 8 <sup>E</sup>  | 9 <sup>E</sup>  | 10 <sup>E</sup> | 11       | (6-14/1)中六級畢業試 (6-14/1)中一至中五級上學期期考共7天                                                    |
| 20 |   | 12              | 13 <sup>E</sup> | 14 <sup>E</sup> | 15              | 16              | 17              | 18       | (15-21/1)中一至中六級試後回饋日 (17/1下午)中五級學習概覽講座<br>(22/1-7/3)中六級試後上課                              |
| 21 | 月 | 19              | 20              | 21              | 22              | 23              | 24              | 25       | (22/1-24/1)中一至中五級溫習及補考                                                                   |
| 22 | 二 | 26              | (27)            | (28)            | (29)            | (30)            | (31)            | (1)      | (27/1-8/2)農曆新年假期共13天                                                                     |
| 23 |   | (2)             | (3)             | (4)             | (5)             | (6)             | (7)             | (8)      |                                                                                          |
| 24 |   | 9               | 10              | 11              | 12              | 13              | 14              | 15       | (10/2)下學期開始<br>(10/2-14/2)數學周                                                            |
| 25 | 月 | 16              | 17              | 18              | 19              | 20              | 21              | 22       | (17/2-21/2)福音周 (17/2)中一至中五級開始繳交周記<br>(21/2)佈道會                                           |
| 26 | 三 | 23              | 24              | 25              | 26              | 27 <sup>△</sup> | (28)            | Mar<br>1 | (27/2)第六十四屆陸運會<br>(28/2)陸運會翌日假期                                                          |

( ) - 假期    <sup>E</sup> - 考試    <sup>△</sup> - 特別活動    ● - 教師發展日，學生不用上課

| Sun                                                    | Mon                                                    | Tue | Wed | Thu                                                    | Fri                     | Sat                         |
|--------------------------------------------------------|--------------------------------------------------------|-----|-----|--------------------------------------------------------|-------------------------|-----------------------------|
| 26                                                     | 27                                                     | 28  | 29  | 30                                                     | 31                      | 1                           |
| Chinese New Year Holiday                               |                                                        |     |     |                                                        |                         |                             |
| 2                                                      | 3                                                      | 4   | 5   | 6                                                      | 7                       | 8                           |
| Chinese New Year Holiday                               |                                                        |     |     | F.6 Mock Exam & Activities Suspension for F.6 Students |                         |                             |
|                                                        | Week 21                                                |     |     |                                                        |                         |                             |
| 9                                                      | 10                                                     | 11  | 12  | 13                                                     | 14                      | 15                          |
| F.6 Mock Exam & Activities Suspension for F.6 Students |                                                        |     |     |                                                        |                         |                             |
|                                                        | Week 22                                                |     |     |                                                        | First Term Prize        | Parents' Day (Distribution) |
| 16                                                     | 17                                                     | 18  | 19  | 20                                                     | 21                      | 22                          |
| F.6 Mock Exam & Activities Suspension for F.6 Students |                                                        |     |     |                                                        |                         |                             |
|                                                        | Enhanced Smart Teen Camp (for selected F.2-3 students) |     |     |                                                        |                         |                             |
|                                                        | Week 23                                                |     |     |                                                        |                         |                             |
| 23                                                     | 24                                                     | 25  | 26  | 27                                                     | 28                      | 1                           |
|                                                        | Class Photo-Taking Day                                 |     |     |                                                        | F.6 Farewell Assembly & |                             |
|                                                        | Week 24                                                |     |     |                                                        |                         |                             |

## **FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : [matlab@fugro.com](mailto:matlab@fugro.com)  
Website : [www.fugro.com](http://www.fugro.com)



### **Appendix F**

#### **Air Quality Monitoring Data**

## 1-hour TSP Impact Monitoring Result for NOD 03-2018 Road Widening and Retrofitting Noise Barriers on Tai Po Road (Sha Tin Section)

### AMS5 - Tin Liu

| 1-hour TSP (µg/m³) |            |        |        |        |         |              |             |          |
|--------------------|------------|--------|--------|--------|---------|--------------|-------------|----------|
| Date               | Start Time | 1st hr | 2nd hr | 3rd hr | Average | Action Level | Limit Level | Weather  |
| 1-Feb-25           | 11:05      | 52     | 58     | 54     | 55      | 340          | 500         | Overcast |
| 7-Feb-25           | 11:32      | 52     | 46     | 54     | 51      |              |             | Overcast |
| 13-Feb-25          | 07:44      | 73     | 77     | 73     | 74      |              |             | Overcast |
| 19-Feb-25          | 14:08      | 48     | 50     | 46     | 48      |              |             | Overcast |
| 25-Feb-25          | 10:14      | 62     | 64     | 50     | 59      |              |             | Overcast |
|                    | Average    | 57     |        |        |         |              |             |          |
|                    | Max        | 77     |        |        |         |              |             |          |
|                    | Min        | 46     |        |        |         |              |             |          |

### AMS7A - Sheung Wo Che

| 1-hour TSP (µg/m³) |            |        |        |        |         |              |             |          |
|--------------------|------------|--------|--------|--------|---------|--------------|-------------|----------|
| Date               | Start Time | 1st hr | 2nd hr | 3rd hr | Average | Action Level | Limit Level | Weather  |
| 1-Feb-25           | 09:56      | 56     | 42     | 58     | 52      | 344          | 500         | Overcast |
| 7-Feb-25           | 15:21      | 47     | 51     | 53     | 50      |              |             | Overcast |
| 13-Feb-25          | 08:58      | 77     | 70     | 74     | 74      |              |             | Overcast |
| 19-Feb-25          | 10:59      | 53     | 49     | 44     | 49      |              |             | Overcast |
| 25-Feb-25          | 10:00      | 60     | 65     | 65     | 63      |              |             | Overcast |
|                    | Average    | 58     |        |        |         |              |             |          |
|                    | Max        | 77     |        |        |         |              |             |          |
|                    | Min        | 42     |        |        |         |              |             |          |

### AMS14 - Ha Wo Che


| 1-hour TSP (µg/m³) |            |        |        |        |         |              |             |          |
|--------------------|------------|--------|--------|--------|---------|--------------|-------------|----------|
| Date               | Start Time | 1st hr | 2nd hr | 3rd hr | Average | Action Level | Limit Level | Weather  |
| 1-Feb-25           | 07:41      | 47     | 49     | 43     | 46      | 350          | 500         | Overcast |
| 7-Feb-25           | 13:07      | 56     | 56     | 51     | 54      |              |             | Overcast |
| 13-Feb-25          | 12:14      | 72     | 54     | 70     | 65      |              |             | Overcast |
| 19-Feb-25          | 11:46      | 49     | 41     | 39     | 43      |              |             | Overcast |
| 25-Feb-25          | 16:00      | 58     | 62     | 68     | 63      |              |             | Overcast |
|                    | Average    | 54     |        |        |         |              |             |          |
|                    | Max        | 72     |        |        |         |              |             |          |
|                    | Min        | 39     |        |        |         |              |             |          |

### AMS15 - Ha Wo Che


| 1-hour TSP (µg/m³) |            |        |        |        |         |              |             |          |
|--------------------|------------|--------|--------|--------|---------|--------------|-------------|----------|
| Date               | Start Time | 1st hr | 2nd hr | 3rd hr | Average | Action Level | Limit Level | Weather  |
| 1-Feb-25           | 12:27      | 57     | 59     | 52     | 56      | 350          | 500         | Overcast |
| 7-Feb-25           | 15:53      | 54     | 59     | 61     | 58      |              |             | Overcast |
| 13-Feb-25          | 13:26      | 78     | 68     | 71     | 72      |              |             | Overcast |
| 19-Feb-25          | 12:33      | 54     | 47     | 57     | 53      |              |             | Overcast |
| 25-Feb-25          | 08:34      | 71     | 73     | 64     | 69      |              |             | Overcast |
|                    | Average    | 62     |        |        |         |              |             |          |
|                    | Max        | 78     |        |        |         |              |             |          |
|                    | Min        | 47     |        |        |         |              |             |          |

- Remark
1. Actual monitoring may be subjected to change due to any safety concern or adverse weather condition.
  2. The Impact Air Monitoring Stations to be monitored should be selected based on the prevailing wind direction and their proximity to the active construction work.


### 1-hr TSP Monitoring record for AMS5

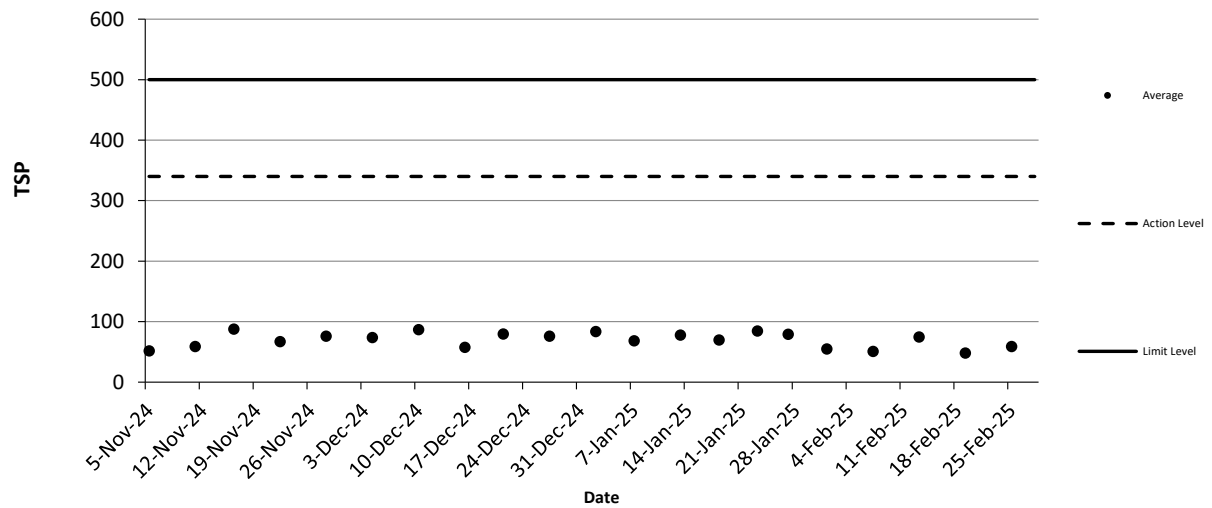


### 1-hr TSP Monitoring record for AMS7A

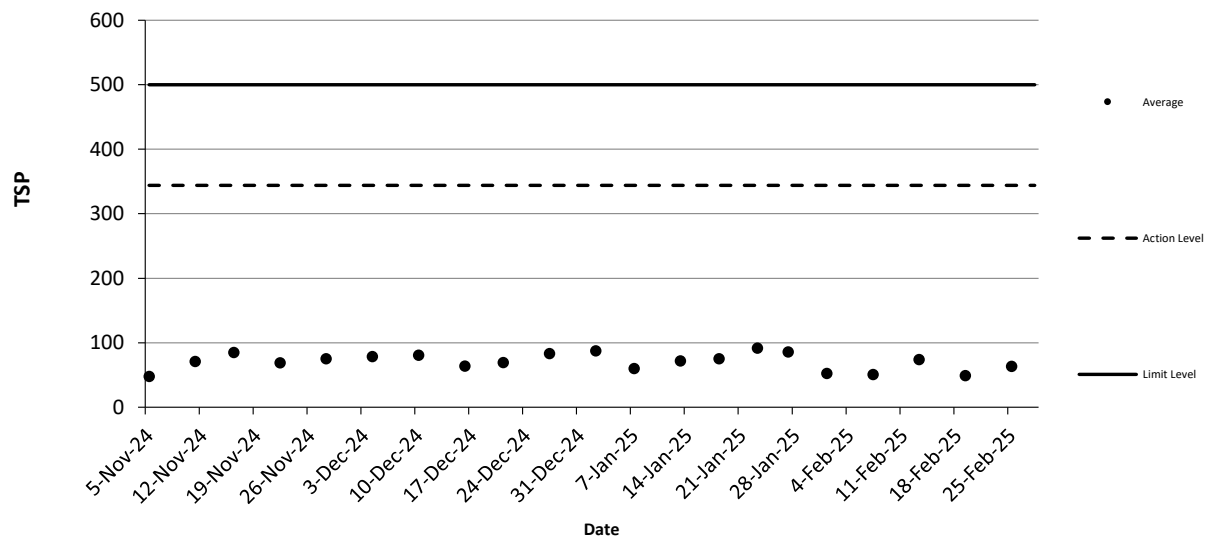

### 1-hr TSP Monitoring record for AMS14

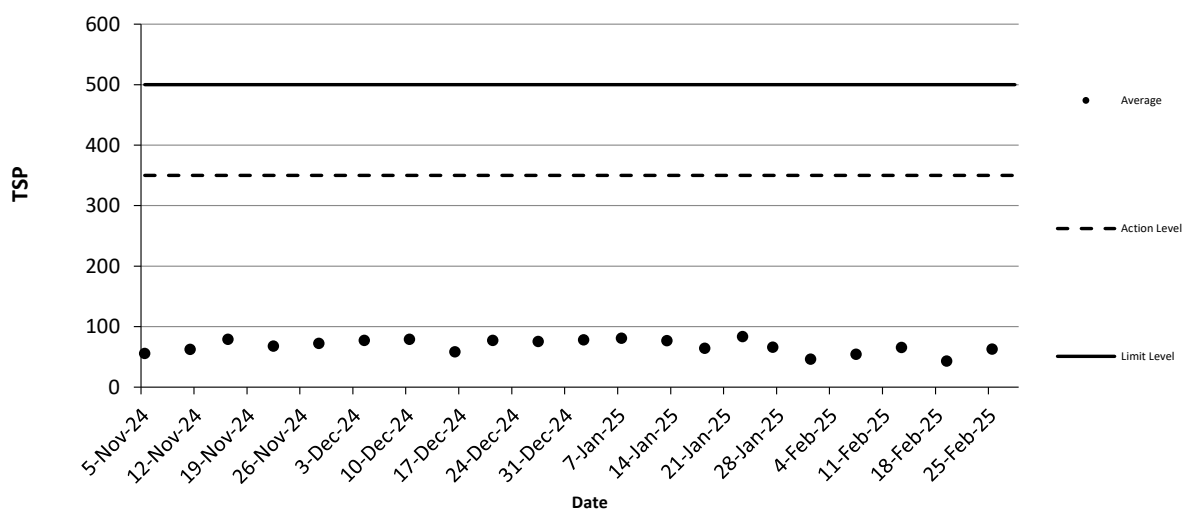

### 1-hr TSP Monitoring record for AMS15

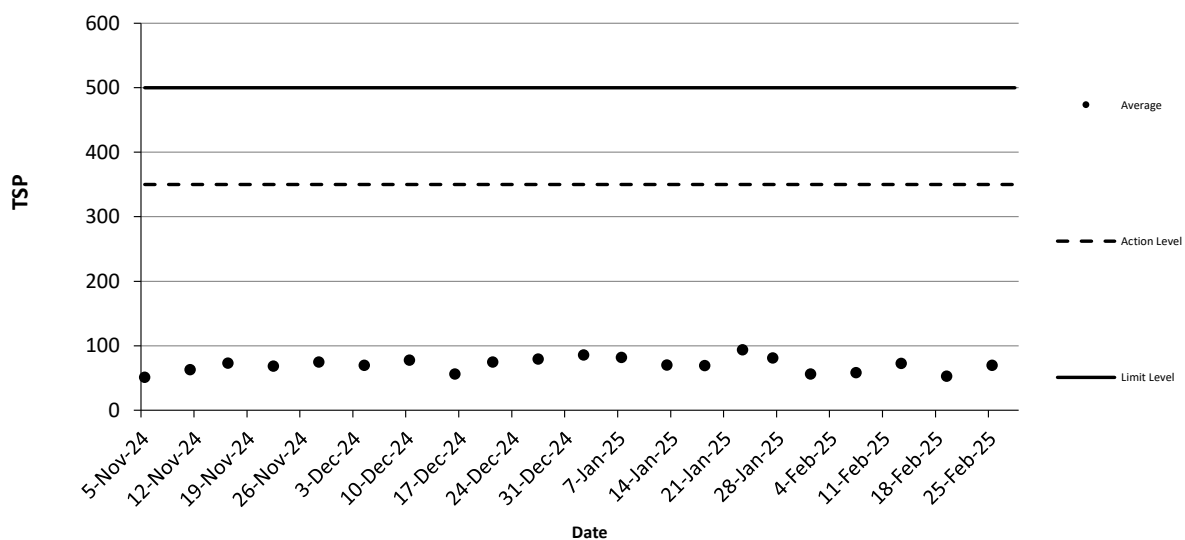

**24-hour TSP Impact Monitoring Result for**  
**NOD 03-2018 Road Widening and Retrofitting Noise Barriers on Tai Po Road (Sha Tin Section)**

**AM55 - Tin Liu**

| Date and Time  | TSP Concentration (µg/m³) |
|----------------|---------------------------|
| 1/2/2025 8:05  | 39                        |
| 1/2/2025 9:05  | 48                        |
| 1/2/2025 10:05 | 46                        |
| 1/2/2025 11:05 | 52                        |
| 1/2/2025 12:05 | 58                        |
| 1/2/2025 13:05 | 54                        |
| 1/2/2025 14:05 | 35                        |
| 1/2/2025 15:05 | 31                        |
| 1/2/2025 16:05 | 35                        |
| 1/2/2025 17:05 | 37                        |
| 1/2/2025 18:05 | 37                        |
| 1/2/2025 19:05 | 39                        |
| 1/2/2025 20:05 | 35                        |
| 1/2/2025 21:05 | 31                        |
| 1/2/2025 22:05 | 37                        |
| 1/2/2025 23:05 | 46                        |
| 2/2/2025 0:05  | 52                        |
| 2/2/2025 1:05  | 56                        |
| 2/2/2025 2:05  | 41                        |
| 2/2/2025 3:05  | 39                        |
| 2/2/2025 4:05  | 52                        |
| 2/2/2025 5:05  | 31                        |
| 2/2/2025 6:05  | 27                        |
| 2/2/2025 7:05  | 29                        |
| Average        | 41                        |
| Action Level   | 156                       |
| Limit Level    | 260                       |

| Date and Time  | TSP Concentration (µg/m³) |
|----------------|---------------------------|
| 7/2/2025 8:32  | 50                        |
| 7/2/2025 9:32  | 39                        |
| 7/2/2025 10:32 | 39                        |
| 7/2/2025 11:32 | 52                        |
| 7/2/2025 12:32 | 46                        |
| 7/2/2025 13:32 | 54                        |
| 7/2/2025 14:32 | 37                        |
| 7/2/2025 15:32 | 39                        |
| 7/2/2025 16:32 | 39                        |
| 7/2/2025 17:32 | 50                        |
| 7/2/2025 18:32 | 39                        |
| 7/2/2025 19:32 | 50                        |
| 7/2/2025 20:32 | 50                        |
| 7/2/2025 21:32 | 41                        |
| 7/2/2025 22:32 | 54                        |
| 7/2/2025 23:32 | 50                        |
| 8/2/2025 0:32  | 46                        |
| 8/2/2025 1:32  | 41                        |
| 8/2/2025 2:32  | 41                        |
| 8/2/2025 3:32  | 44                        |
| 8/2/2025 4:32  | 48                        |
| 8/2/2025 5:32  | 44                        |
| 8/2/2025 6:32  | 41                        |
| 8/2/2025 7:32  | 46                        |
| Average        | 45                        |
| Action Level   | 156                       |
| Limit Level    | 260                       |

| Date and Time   | TSP Concentration (µg/m³) |
|-----------------|---------------------------|
| 13/2/2025 7:44  | 73                        |
| 13/2/2025 8:44  | 77                        |
| 13/2/2025 9:44  | 73                        |
| 13/2/2025 10:44 | 70                        |
| 13/2/2025 11:44 | 70                        |
| 13/2/2025 12:44 | 73                        |
| 13/2/2025 13:44 | 68                        |
| 13/2/2025 14:44 | 64                        |
| 13/2/2025 15:44 | 58                        |
| 13/2/2025 16:44 | 56                        |
| 13/2/2025 17:44 | 58                        |
| 13/2/2025 18:44 | 66                        |
| 13/2/2025 19:44 | 62                        |
| 13/2/2025 20:44 | 68                        |
| 13/2/2025 21:44 | 64                        |
| 13/2/2025 22:44 | 64                        |
| 13/2/2025 23:44 | 62                        |
| 14/2/2025 0:44  | 68                        |
| 14/2/2025 1:44  | 64                        |
| 14/2/2025 2:44  | 58                        |
| 14/2/2025 3:44  | 62                        |
| 14/2/2025 4:44  | 73                        |
| 14/2/2025 5:44  | 56                        |
| 14/2/2025 6:44  | 60                        |
| Average         | 65                        |
| Action Level    | 156                       |
| Limit Level     | 260                       |

| Date and Time   | TSP Concentration (µg/m³) |
|-----------------|---------------------------|
| 19/2/2025 8:08  | 37                        |
| 19/2/2025 9:08  | 29                        |
| 19/2/2025 10:08 | 31                        |
| 19/2/2025 11:08 | 31                        |
| 19/2/2025 12:08 | 39                        |
| 19/2/2025 13:08 | 46                        |
| 19/2/2025 14:08 | 48                        |
| 19/2/2025 15:08 | 50                        |
| 19/2/2025 16:08 | 46                        |
| 19/2/2025 17:08 | 46                        |
| 19/2/2025 18:08 | 41                        |
| 19/2/2025 19:08 | 35                        |
| 19/2/2025 20:08 | 37                        |
| 19/2/2025 21:08 | 33                        |
| 19/2/2025 22:08 | 33                        |
| 19/2/2025 23:08 | 27                        |
| 20/2/2025 0:08  | 31                        |
| 20/2/2025 1:08  | 27                        |
| 20/2/2025 2:08  | 31                        |
| 20/2/2025 3:08  | 27                        |
| 20/2/2025 4:08  | 29                        |
| 20/2/2025 5:08  | 27                        |
| 20/2/2025 6:08  | 29                        |
| 20/2/2025 7:08  | 29                        |
| Average         | 35                        |
| Action Level    | 156                       |
| Limit Level     | 260                       |

| Date and Time   | TSP Concentration (µg/m³) |
|-----------------|---------------------------|
| 25/2/2025 8:14  | 52                        |
| 25/2/2025 9:14  | 50                        |
| 25/2/2025 10:14 | 62                        |
| 25/2/2025 11:14 | 64                        |
| 25/2/2025 12:14 | 50                        |
| 25/2/2025 13:14 | 52                        |
| 25/2/2025 14:14 | 58                        |
| 25/2/2025 15:14 | 52                        |
| 25/2/2025 16:14 | 60                        |
| 25/2/2025 17:14 | 46                        |
| 25/2/2025 18:14 | 41                        |
| 25/2/2025 19:14 | 37                        |
| 25/2/2025 20:14 | 37                        |
| 25/2/2025 21:14 | 50                        |
| 25/2/2025 22:14 | 48                        |
| 25/2/2025 23:14 | 37                        |
| 26/2/2025 0:14  | 33                        |
| 26/2/2025 1:14  | 37                        |
| 26/2/2025 2:14  | 44                        |
| 26/2/2025 3:14  | 46                        |
| 26/2/2025 4:14  | 37                        |
| 26/2/2025 5:14  | 46                        |
| 26/2/2025 6:14  | 50                        |
| 26/2/2025 7:14  | 41                        |
| Average         | 47                        |
| Action Level    | 156                       |
| Limit Level     | 260                       |

- Remark
- Actual monitoring may be subjected to change due to any safety concern or adverse weather condition.
  - The Impact Air Monitoring Stations to be monitored should be selected based on the prevailing wind direction and their proximity to the active construction works.

**24-hour TSP Impact Monitoring Result for  
NOD 03-2018 Road Widening and Retrofitting Noise Barriers on Tai Po Road (Sha Tin Section)**

**AMS7A - Sheung Wo Che**

| Date and Time  | TSP Concentration (µg/m³) |
|----------------|---------------------------|
| 1/2/2025 7:56  | 42                        |
| 1/2/2025 8:56  | 44                        |
| 1/2/2025 9:56  | 56                        |
| 1/2/2025 10:56 | 42                        |
| 1/2/2025 11:56 | 58                        |
| 1/2/2025 12:56 | 49                        |
| 1/2/2025 13:56 | 47                        |
| 1/2/2025 14:56 | 51                        |
| 1/2/2025 15:56 | 49                        |
| 1/2/2025 16:56 | 37                        |
| 1/2/2025 17:56 | 44                        |
| 1/2/2025 18:56 | 35                        |
| 1/2/2025 19:56 | 33                        |
| 1/2/2025 20:56 | 42                        |
| 1/2/2025 21:56 | 33                        |
| 1/2/2025 22:56 | 47                        |
| 1/2/2025 23:56 | 44                        |
| 2/2/2025 0:56  | 40                        |
| 2/2/2025 1:56  | 37                        |
| 2/2/2025 2:56  | 44                        |
| 2/2/2025 3:56  | 47                        |
| 2/2/2025 4:56  | 40                        |
| 2/2/2025 5:56  | 37                        |
| 2/2/2025 6:56  | 40                        |
| Average        | 43                        |
| Action Level   | 171                       |
| Limit Level    | 260                       |

| Date and Time  | TSP Concentration (µg/m³) |
|----------------|---------------------------|
| 7/2/2025 8:21  | 49                        |
| 7/2/2025 9:21  | 53                        |
| 7/2/2025 10:21 | 47                        |
| 7/2/2025 11:21 | 40                        |
| 7/2/2025 12:21 | 49                        |
| 7/2/2025 13:21 | 42                        |
| 7/2/2025 14:21 | 37                        |
| 7/2/2025 15:21 | 47                        |
| 7/2/2025 16:21 | 51                        |
| 7/2/2025 17:21 | 53                        |
| 7/2/2025 18:21 | 40                        |
| 7/2/2025 19:21 | 42                        |
| 7/2/2025 20:21 | 35                        |
| 7/2/2025 21:21 | 47                        |
| 7/2/2025 22:21 | 47                        |
| 7/2/2025 23:21 | 53                        |
| 8/2/2025 0:21  | 37                        |
| 8/2/2025 1:21  | 44                        |
| 8/2/2025 2:21  | 47                        |
| 8/2/2025 3:21  | 44                        |
| 8/2/2025 4:21  | 47                        |
| 8/2/2025 5:21  | 51                        |
| 8/2/2025 6:21  | 42                        |
| 8/2/2025 7:21  | 47                        |
| Average        | 45                        |
| Action Level   | 171                       |
| Limit Level    | 260                       |

| Date and Time   | TSP Concentration (µg/m³) |
|-----------------|---------------------------|
| 13/2/2025 7:58  | 60                        |
| 13/2/2025 8:58  | 77                        |
| 13/2/2025 9:58  | 70                        |
| 13/2/2025 10:58 | 74                        |
| 13/2/2025 11:58 | 72                        |
| 13/2/2025 12:58 | 65                        |
| 13/2/2025 13:58 | 70                        |
| 13/2/2025 14:58 | 60                        |
| 13/2/2025 15:58 | 63                        |
| 13/2/2025 16:58 | 63                        |
| 13/2/2025 17:58 | 67                        |
| 13/2/2025 18:58 | 58                        |
| 13/2/2025 19:58 | 51                        |
| 13/2/2025 20:58 | 49                        |
| 13/2/2025 21:58 | 65                        |
| 13/2/2025 22:58 | 77                        |
| 13/2/2025 23:58 | 60                        |
| 14/2/2025 0:58  | 56                        |
| 14/2/2025 1:58  | 58                        |
| 14/2/2025 2:58  | 63                        |
| 14/2/2025 3:58  | 53                        |
| 14/2/2025 4:58  | 51                        |
| 14/2/2025 5:58  | 56                        |
| 14/2/2025 6:58  | 58                        |
| Average         | 62                        |
| Action Level    | 171                       |
| Limit Level     | 260                       |

| Date and Time   | TSP Concentration (µg/m³) |
|-----------------|---------------------------|
| 19/2/2025 7:59  | 47                        |
| 19/2/2025 8:59  | 30                        |
| 19/2/2025 9:59  | 28                        |
| 19/2/2025 10:59 | 53                        |
| 19/2/2025 11:59 | 49                        |
| 19/2/2025 12:59 | 44                        |
| 19/2/2025 13:59 | 40                        |
| 19/2/2025 14:59 | 30                        |
| 19/2/2025 15:59 | 42                        |
| 19/2/2025 16:59 | 44                        |
| 19/2/2025 17:59 | 35                        |
| 19/2/2025 18:59 | 35                        |
| 19/2/2025 19:59 | 47                        |
| 19/2/2025 20:59 | 42                        |
| 19/2/2025 21:59 | 47                        |
| 19/2/2025 22:59 | 49                        |
| 19/2/2025 23:59 | 37                        |
| 20/2/2025 0:59  | 53                        |
| 20/2/2025 1:59  | 33                        |
| 20/2/2025 2:59  | 35                        |
| 20/2/2025 3:59  | 26                        |
| 20/2/2025 4:59  | 37                        |
| 20/2/2025 5:59  | 33                        |
| 20/2/2025 6:59  | 33                        |
| Average         | 39                        |
| Action Level    | 171                       |
| Limit Level     | 260                       |

| Date and Time   | TSP Concentration (µg/m³) |
|-----------------|---------------------------|
| 25/2/2025 8:00  | 51                        |
| 25/2/2025 9:00  | 49                        |
| 25/2/2025 10:00 | 60                        |
| 25/2/2025 11:00 | 65                        |
| 25/2/2025 12:00 | 65                        |
| 25/2/2025 13:00 | 47                        |
| 25/2/2025 14:00 | 53                        |
| 25/2/2025 15:00 | 47                        |
| 25/2/2025 16:00 | 49                        |
| 25/2/2025 17:00 | 44                        |
| 25/2/2025 18:00 | 49                        |
| 25/2/2025 19:00 | 53                        |
| 25/2/2025 20:00 | 37                        |
| 25/2/2025 21:00 | 42                        |
| 25/2/2025 22:00 | 37                        |
| 25/2/2025 23:00 | 35                        |
| 26/2/2025 0:00  | 42                        |
| 26/2/2025 1:00  | 37                        |
| 26/2/2025 2:00  | 44                        |
| 26/2/2025 3:00  | 35                        |
| 26/2/2025 4:00  | 33                        |
| 26/2/2025 5:00  | 42                        |
| 26/2/2025 6:00  | 49                        |
| 26/2/2025 7:00  | 44                        |
| Average         | 46                        |
| Action Level    | 171                       |
| Limit Level     | 260                       |

- Remark
- Actual monitoring may be subjected to change due to any safety concern or adverse weather condition.
  - The Impact Air Monitoring Stations to be monitored should be selected based on the prevailing wind direction and their proximity to the active construction works.

24-hour TSP Impact Monitoring Result for  
NOD 03-2018 Road Widening and Retrofitting Noise Barriers on Tai Po Road (Sha Tin Section)

AMS14 - Ha Wo Che

| Date and Time  | TSP Concentration (µg/m³) |
|----------------|---------------------------|
| 1/2/2025 7:41  | 47                        |
| 1/2/2025 8:41  | 49                        |
| 1/2/2025 9:41  | 43                        |
| 1/2/2025 10:41 | 37                        |
| 1/2/2025 11:41 | 31                        |
| 1/2/2025 12:41 | 41                        |
| 1/2/2025 13:41 | 39                        |
| 1/2/2025 14:41 | 43                        |
| 1/2/2025 15:41 | 37                        |
| 1/2/2025 16:41 | 31                        |
| 1/2/2025 17:41 | 33                        |
| 1/2/2025 18:41 | 33                        |
| 1/2/2025 19:41 | 35                        |
| 1/2/2025 20:41 | 47                        |
| 1/2/2025 21:41 | 39                        |
| 1/2/2025 22:41 | 41                        |
| 1/2/2025 23:41 | 31                        |
| 2/2/2025 0:41  | 33                        |
| 2/2/2025 1:41  | 37                        |
| 2/2/2025 2:41  | 37                        |
| 2/2/2025 3:41  | 35                        |
| 2/2/2025 4:41  | 41                        |
| 2/2/2025 5:41  | 33                        |
| 2/2/2025 6:41  | 39                        |
| Average        | 38                        |
| Action Level   | 174                       |
| Limit Level    | 260                       |

| Date and Time  | TSP Concentration (µg/m³) |
|----------------|---------------------------|
| 7/2/2025 8:07  | 49                        |
| 7/2/2025 9:07  | 54                        |
| 7/2/2025 10:07 | 47                        |
| 7/2/2025 11:07 | 45                        |
| 7/2/2025 12:07 | 43                        |
| 7/2/2025 13:07 | 56                        |
| 7/2/2025 14:07 | 56                        |
| 7/2/2025 15:07 | 51                        |
| 7/2/2025 16:07 | 43                        |
| 7/2/2025 17:07 | 39                        |
| 7/2/2025 18:07 | 45                        |
| 7/2/2025 19:07 | 41                        |
| 7/2/2025 20:07 | 37                        |
| 7/2/2025 21:07 | 43                        |
| 7/2/2025 22:07 | 51                        |
| 7/2/2025 23:07 | 49                        |
| 8/2/2025 0:07  | 45                        |
| 8/2/2025 1:07  | 51                        |
| 8/2/2025 2:07  | 43                        |
| 8/2/2025 3:07  | 47                        |
| 8/2/2025 4:07  | 56                        |
| 8/2/2025 5:07  | 41                        |
| 8/2/2025 6:07  | 41                        |
| 8/2/2025 7:07  | 49                        |
| Average        | 47                        |
| Action Level   | 174                       |
| Limit Level    | 260                       |

| Date and Time   | TSP Concentration (µg/m³) |
|-----------------|---------------------------|
| 13/2/2025 8:14  | 58                        |
| 13/2/2025 9:14  | 58                        |
| 13/2/2025 10:14 | 54                        |
| 13/2/2025 11:14 | 66                        |
| 13/2/2025 12:14 | 72                        |
| 13/2/2025 13:14 | 54                        |
| 13/2/2025 14:14 | 70                        |
| 13/2/2025 15:14 | 56                        |
| 13/2/2025 16:14 | 60                        |
| 13/2/2025 17:14 | 60                        |
| 13/2/2025 18:14 | 62                        |
| 13/2/2025 19:14 | 64                        |
| 13/2/2025 20:14 | 56                        |
| 13/2/2025 21:14 | 54                        |
| 13/2/2025 22:14 | 49                        |
| 13/2/2025 23:14 | 43                        |
| 14/2/2025 0:14  | 54                        |
| 14/2/2025 1:14  | 51                        |
| 14/2/2025 2:14  | 54                        |
| 14/2/2025 3:14  | 51                        |
| 14/2/2025 4:14  | 47                        |
| 14/2/2025 5:14  | 64                        |
| 14/2/2025 6:14  | 64                        |
| 14/2/2025 7:14  | 58                        |
| Average         | 57                        |
| Action Level    | 174                       |
| Limit Level     | 260                       |

| Date and Time   | TSP Concentration (µg/m³) |
|-----------------|---------------------------|
| 19/2/2025 7:46  | 45                        |
| 19/2/2025 8:46  | 37                        |
| 19/2/2025 9:46  | 39                        |
| 19/2/2025 10:46 | 35                        |
| 19/2/2025 11:46 | 49                        |
| 19/2/2025 12:46 | 41                        |
| 19/2/2025 13:46 | 39                        |
| 19/2/2025 14:46 | 49                        |
| 19/2/2025 15:46 | 39                        |
| 19/2/2025 16:46 | 41                        |
| 19/2/2025 17:46 | 37                        |
| 19/2/2025 18:46 | 41                        |
| 19/2/2025 19:46 | 37                        |
| 19/2/2025 20:46 | 37                        |
| 19/2/2025 21:46 | 35                        |
| 19/2/2025 22:46 | 29                        |
| 19/2/2025 23:46 | 43                        |
| 20/2/2025 0:46  | 41                        |
| 20/2/2025 1:46  | 41                        |
| 20/2/2025 2:46  | 35                        |
| 20/2/2025 3:46  | 33                        |
| 20/2/2025 4:46  | 35                        |
| 20/2/2025 5:46  | 33                        |
| 20/2/2025 6:46  | 29                        |
| Average         | 38                        |
| Action Level    | 174                       |
| Limit Level     | 260                       |

| Date and Time   | TSP Concentration (µg/m³) |
|-----------------|---------------------------|
| 25/2/2025 7:49  | 47                        |
| 25/2/2025 8:49  | 49                        |
| 25/2/2025 9:49  | 54                        |
| 25/2/2025 10:49 | 58                        |
| 25/2/2025 11:49 | 62                        |
| 25/2/2025 12:49 | 62                        |
| 25/2/2025 13:49 | 56                        |
| 25/2/2025 14:49 | 56                        |
| 25/2/2025 15:49 | 58                        |
| 25/2/2025 16:49 | 62                        |
| 25/2/2025 17:49 | 68                        |
| 25/2/2025 18:49 | 56                        |
| 25/2/2025 19:49 | 39                        |
| 25/2/2025 20:49 | 39                        |
| 25/2/2025 21:49 | 47                        |
| 25/2/2025 22:49 | 51                        |
| 25/2/2025 23:49 | 41                        |
| 26/2/2025 0:49  | 43                        |
| 26/2/2025 1:49  | 41                        |
| 26/2/2025 2:49  | 45                        |
| 26/2/2025 3:49  | 47                        |
| 26/2/2025 4:49  | 56                        |
| 26/2/2025 5:49  | 45                        |
| 26/2/2025 6:49  | 51                        |
| Average         | 51                        |
| Action Level    | 174                       |
| Limit Level     | 260                       |

- Remark
1. Actual monitoring may be subjected to change due to any safety concern or adverse weather condition.
  2. The Impact Air Monitoring Stations to be monitored should be selected based on the prevailing wind direction and their proximity to the active construction works.

**24-hour TSP Impact Monitoring Result for**  
**NOD 03-2018 Road Widening and Retrofitting Noise Barriers on Tai Po Road (Sha Tin Section)**

**AMS 15 - Ha Wo Che**

| Date and Time  | TSP Concentration (µg/m³) |
|----------------|---------------------------|
| 1/2/2025 7:27  | 52                        |
| 1/2/2025 8:27  | 59                        |
| 1/2/2025 9:27  | 45                        |
| 1/2/2025 10:27 | 49                        |
| 1/2/2025 11:27 | 52                        |
| 1/2/2025 12:27 | 57                        |
| 1/2/2025 13:27 | 59                        |
| 1/2/2025 14:27 | 52                        |
| 1/2/2025 15:27 | 47                        |
| 1/2/2025 16:27 | 42                        |
| 1/2/2025 17:27 | 38                        |
| 1/2/2025 18:27 | 45                        |
| 1/2/2025 19:27 | 49                        |
| 1/2/2025 20:27 | 40                        |
| 1/2/2025 21:27 | 38                        |
| 1/2/2025 22:27 | 42                        |
| 1/2/2025 23:27 | 38                        |
| 2/2/2025 0:27  | 33                        |
| 2/2/2025 1:27  | 31                        |
| 2/2/2025 2:27  | 40                        |
| 2/2/2025 3:27  | 47                        |
| 2/2/2025 4:27  | 40                        |
| 2/2/2025 5:27  | 47                        |
| 2/2/2025 6:27  | 57                        |
| Average        | 46                        |
| Action Level   | 172                       |
| Limit Level    | 260                       |



| Date and Time  | TSP Concentration (µg/m³) |
|----------------|---------------------------|
| 7/2/2025 7:53  | 59                        |
| 7/2/2025 8:53  | 61                        |
| 7/2/2025 9:53  | 49                        |
| 7/2/2025 10:53 | 49                        |
| 7/2/2025 11:53 | 59                        |
| 7/2/2025 12:53 | 59                        |
| 7/2/2025 13:53 | 47                        |
| 7/2/2025 14:53 | 52                        |
| 7/2/2025 15:53 | 54                        |
| 7/2/2025 16:53 | 59                        |
| 7/2/2025 17:53 | 61                        |
| 7/2/2025 18:53 | 49                        |
| 7/2/2025 19:53 | 57                        |
| 7/2/2025 20:53 | 40                        |
| 7/2/2025 21:53 | 42                        |
| 7/2/2025 22:53 | 54                        |
| 7/2/2025 23:53 | 52                        |
| 8/2/2025 0:53  | 49                        |
| 8/2/2025 1:53  | 52                        |
| 8/2/2025 2:53  | 47                        |
| 8/2/2025 3:53  | 45                        |
| 8/2/2025 4:53  | 47                        |
| 8/2/2025 5:53  | 40                        |
| 8/2/2025 6:53  | 49                        |
| Average        | 51                        |
| Action Level   | 172                       |
| Limit Level    | 260                       |



| Date and Time   | TSP Concentration (µg/m³) |
|-----------------|---------------------------|
| 13/2/2025 8:26  | 75                        |
| 13/2/2025 9:26  | 73                        |
| 13/2/2025 10:26 | 66                        |
| 13/2/2025 11:26 | 71                        |
| 13/2/2025 12:26 | 59                        |
| 13/2/2025 13:26 | 78                        |
| 13/2/2025 14:26 | 68                        |
| 13/2/2025 15:26 | 71                        |
| 13/2/2025 16:26 | 61                        |
| 13/2/2025 17:26 | 64                        |
| 13/2/2025 18:26 | 73                        |
| 13/2/2025 19:26 | 71                        |
| 13/2/2025 20:26 | 68                        |
| 13/2/2025 21:26 | 73                        |
| 13/2/2025 22:26 | 71                        |
| 13/2/2025 23:26 | 71                        |
| 14/2/2025 0:26  | 61                        |
| 14/2/2025 1:26  | 64                        |
| 14/2/2025 2:26  | 71                        |
| 14/2/2025 3:26  | 64                        |
| 14/2/2025 4:26  | 64                        |
| 14/2/2025 5:26  | 59                        |
| 14/2/2025 6:26  | 68                        |
| 14/2/2025 7:26  | 57                        |
| Average         | 67                        |
| Action Level    | 172                       |
| Limit Level     | 260                       |

| Date and Time   | TSP Concentration (µg/m³) |
|-----------------|---------------------------|
| 19/2/2025 7:33  | 54                        |
| 19/2/2025 8:33  | 49                        |
| 19/2/2025 9:33  | 40                        |
| 19/2/2025 10:33 | 38                        |
| 19/2/2025 11:33 | 45                        |
| 19/2/2025 12:33 | 54                        |
| 19/2/2025 13:33 | 47                        |
| 19/2/2025 14:33 | 57                        |
| 19/2/2025 15:33 | 52                        |
| 19/2/2025 16:33 | 40                        |
| 19/2/2025 17:33 | 42                        |
| 19/2/2025 18:33 | 57                        |
| 19/2/2025 19:33 | 33                        |
| 19/2/2025 20:33 | 38                        |
| 19/2/2025 21:33 | 52                        |
| 19/2/2025 22:33 | 35                        |
| 19/2/2025 23:33 | 33                        |
| 20/2/2025 0:33  | 40                        |
| 20/2/2025 1:33  | 42                        |
| 20/2/2025 2:33  | 49                        |
| 20/2/2025 3:33  | 42                        |
| 20/2/2025 4:33  | 40                        |
| 20/2/2025 5:33  | 38                        |
| 20/2/2025 6:33  | 42                        |
| Average         | 44                        |
| Action Level    | 172                       |
| Limit Level     | 260                       |

| Date and Time   | TSP Concentration (µg/m³) |
|-----------------|---------------------------|
| 25/2/2025 7:34  | 66                        |
| 25/2/2025 8:34  | 71                        |
| 25/2/2025 9:34  | 73                        |
| 25/2/2025 10:34 | 64                        |
| 25/2/2025 11:34 | 57                        |
| 25/2/2025 12:34 | 59                        |
| 25/2/2025 13:34 | 73                        |
| 25/2/2025 14:34 | 64                        |
| 25/2/2025 15:34 | 61                        |
| 25/2/2025 16:34 | 71                        |
| 25/2/2025 17:34 | 64                        |
| 25/2/2025 18:34 | 68                        |
| 25/2/2025 19:34 | 73                        |
| 25/2/2025 20:34 | 57                        |
| 25/2/2025 21:34 | 47                        |
| 25/2/2025 22:34 | 45                        |
| 25/2/2025 23:34 | 42                        |
| 26/2/2025 0:34  | 49                        |
| 26/2/2025 1:34  | 40                        |
| 26/2/2025 2:34  | 42                        |
| 26/2/2025 3:34  | 42                        |
| 26/2/2025 4:34  | 47                        |
| 26/2/2025 5:34  | 47                        |
| 26/2/2025 6:34  | 49                        |
| Average         | 57                        |
| Action Level    | 172                       |
| Limit Level     | 260                       |

- Remark
1. Actual monitoring may be subjected to change due to any safety concern or adverse weather condition.
  2. The Impact Air Monitoring Stations to be monitored should be selected based on the prevailing wind direction and their proximity to the active construction works.

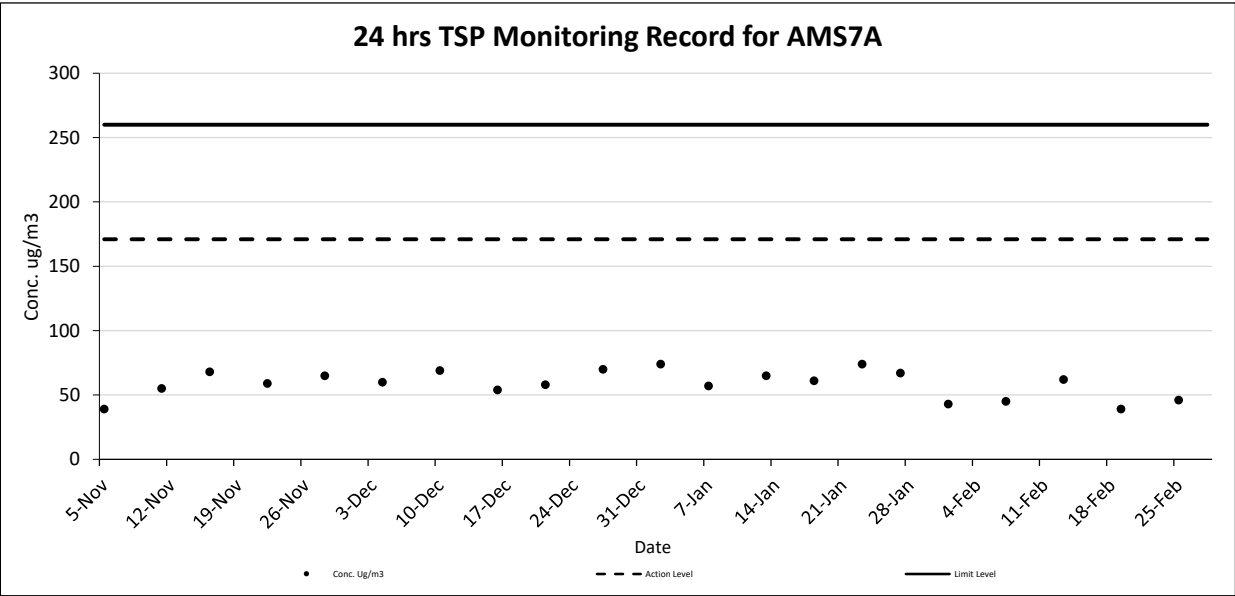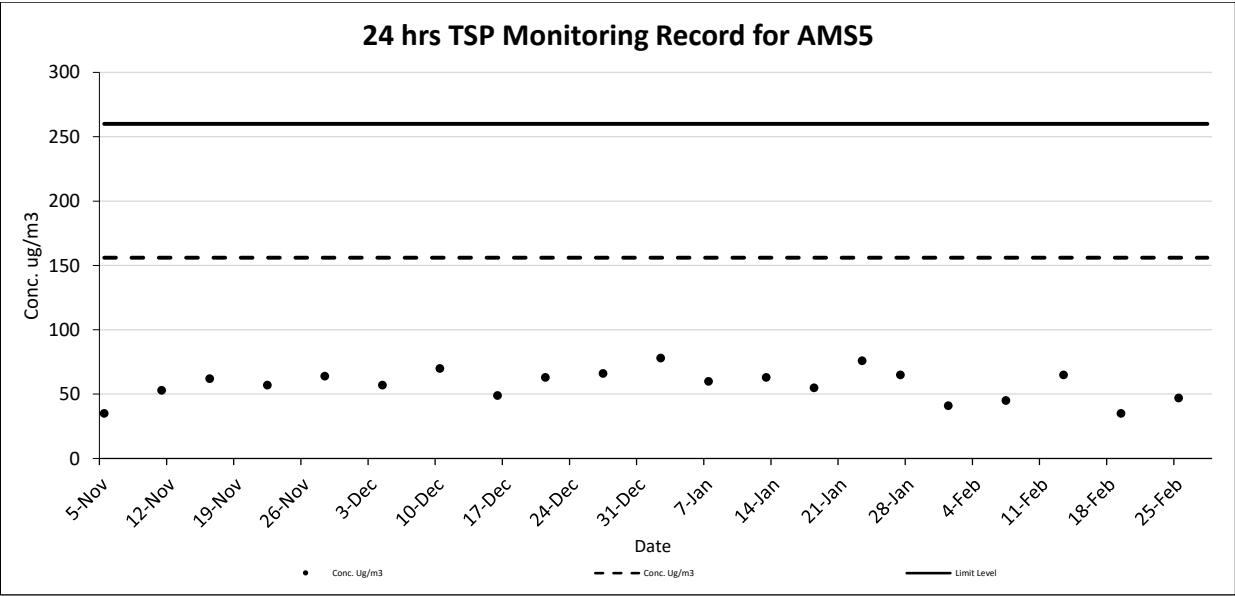

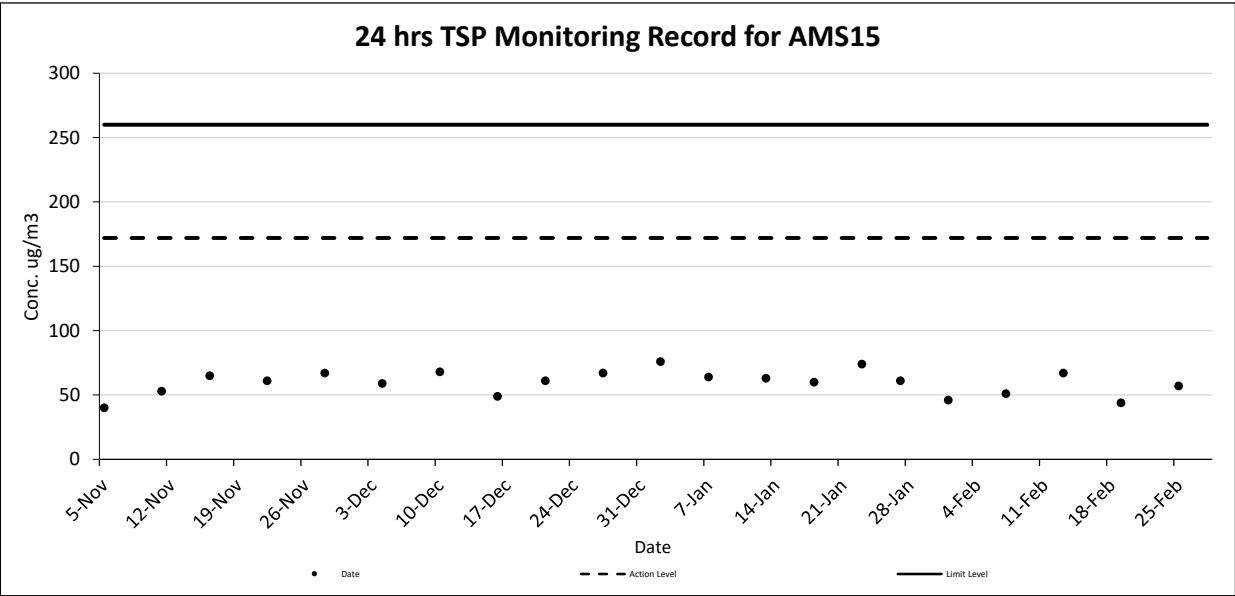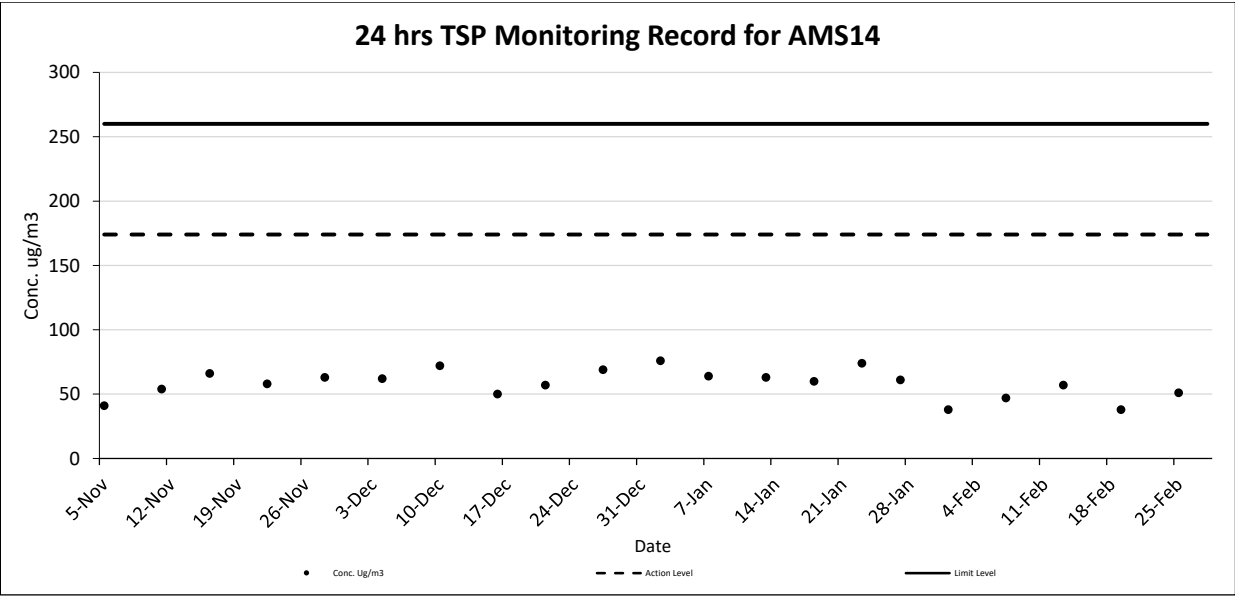

## **FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : [matlab@fugro.com](mailto:matlab@fugro.com)  
Website : [www.fugro.com](http://www.fugro.com)



### **Appendix G**

#### **Noise Monitoring Data**



### NMS 7 Tin Liu

| Date      | Start Time | Measured Noise Level |                 |                 | Limit Level | Construction Noise Level | Weather  | Wind Speed (m/s) |
|-----------|------------|----------------------|-----------------|-----------------|-------------|--------------------------|----------|------------------|
|           |            | L <sub>eq</sub>      | L <sub>90</sub> | L <sub>10</sub> |             |                          |          |                  |
|           |            | Unit: dB(A) 30 Mins  |                 |                 |             |                          |          |                  |
| 7-Feb-25  | 9:56       | 62.2                 | 59.5            | 65.0            | 75          | 62.2                     | Fine     | 0.5              |
| 13-Feb-25 | 9:53       | 62.1                 | 59.5            | 65.0            | 75          | 62.1                     | Overcast | 0.4              |
| 19-Feb-25 | 9:50       | 64.3                 | 61.5            | 67.0            | 75          | 64.3                     | Fine     | 0.4              |
| 25-Feb-25 | 9:55       | 62.4                 | 60.0            | 65.0            | 75          | 62.4                     | Overcast | 0.1              |

### NMS 8 Shatin Plaza

| Date      | Start Time | Measured Noise Level |                 |                 | Limit Level | Construction Noise Level | Weather  | Wind Speed (m/s) |
|-----------|------------|----------------------|-----------------|-----------------|-------------|--------------------------|----------|------------------|
|           |            | L <sub>eq</sub>      | L <sub>90</sub> | L <sub>10</sub> |             |                          |          |                  |
|           |            | Unit: dB(A) 30 Mins  |                 |                 |             |                          |          |                  |
| 8-Feb-25  | 17:57      | 66.6                 | 64.0            | 69.0            | 75          | 66.6                     | Fine     | 0.7              |
| 14-Feb-25 | 17:57      | 64.9                 | 62.5            | 67.0            | 75          | 64.9                     | Overcast | 0.7              |
| 20-Feb-25 | 17:58      | 65.4                 | 62.5            | 67.5            | 75          | 65.4                     | Fine     | 0.4              |
| 26-Feb-25 | 17:30      | 64.2                 | 61.5            | 66.0            | 75          | 64.2                     | Overcast | 0.2              |

### NMS 9 Lek Yuen Estate

| Date      | Start Time | Measured Noise Level |                 |                 | Limit Level | Construction Noise Level | Weather  | Wind Speed (m/s) |
|-----------|------------|----------------------|-----------------|-----------------|-------------|--------------------------|----------|------------------|
|           |            | L <sub>eq</sub>      | L <sub>90</sub> | L <sub>10</sub> |             |                          |          |                  |
|           |            | Unit: dB(A) 30 Mins  |                 |                 |             |                          |          |                  |
| 8-Feb-25  | 8:30       | 67.9                 | 65.0            | 70.5            | 75          | 67.9                     | Fine     | 0.7              |
| 14-Feb-25 | 8:30       | 65.6                 | 63.5            | 68.5            | 75          | 65.6                     | Overcast | 0.4              |
| 20-Feb-25 | 8:30       | 65.5                 | 63.5            | 68.0            | 75          | 65.5                     | Fine     | 0.6              |
| 26-Feb-25 | 8:25       | 68.8                 | 61.5            | 71.5            | 75          | 68.8                     | Overcast | 0.3              |

### NMS 10A Shatin Tsung Tsin School

| Date      | Start Time | Measured Noise Level |                 |                 | Limit Level | Construction Noise Level | Weather  | Wind Speed (m/s) |
|-----------|------------|----------------------|-----------------|-----------------|-------------|--------------------------|----------|------------------|
|           |            | L <sub>eq</sub>      | L <sub>90</sub> | L <sub>10</sub> |             |                          |          |                  |
|           |            | Unit: dB(A) 30 Mins  |                 |                 |             |                          |          |                  |
| 8-Feb-25  | 9:14       | 63.9                 | 61.5            | 66.5            | 70          | 63.9                     | Fine     | 0.7              |
| 14-Feb-25 | 9:10       | 64.5                 | 61.5            | 66.5            | 70          | 64.5                     | Overcast | 0.6              |
| 20-Feb-25 | 9:07       | 63.5                 | 61.0            | 66.0            | 70          | 63.5                     | Fine     | 0.7              |
| 26-Feb-25 | 9:10       | 62.5                 | 60.0            | 64.5            | 70          | 62.5                     | Overcast | 0.5              |

\*Note: The school calendar was provide in Appendix E.

### NMS 11 Sheung Wo Che

NM11 Cheung Wo Oie

| Date      | Start Time | Measured Noise Level |                 |                 | Limit Level | Construction Noise Level | Weather  | Wind Speed (m/s) |
|-----------|------------|----------------------|-----------------|-----------------|-------------|--------------------------|----------|------------------|
|           |            | L <sub>eq</sub>      | L <sub>90</sub> | L <sub>10</sub> |             |                          |          |                  |
|           |            | Unit: dB(A) 30 Mins  |                 |                 |             |                          |          |                  |
| 8-Feb-25  | 15:58      | 65.9                 | 63.0            | 69.0            | 75          | 65.9                     | Fine     | 0.2              |
| 14-Feb-25 | 15:56      | 65.3                 | 63.0            | 69.0            | 75          | 65.3                     | Overcast | 0.3              |
| 20-Feb-25 | 15:55      | 66.0                 | 64.0            | 70.0            | 75          | 66.0                     | Fine     | 0.4              |
| 26-Feb-25 | 15:30      | 67.2                 | 62.0            | 69.0            | 75          | 67.2                     | Overcast | 0.4              |

### NMS 12 SKH Holy Spirit Primary School

| Date      | Start Time | Measured Noise Level |                 |                 | Limit Level | Construction Noise Level | Weather  | Wind Speed (m/s) |
|-----------|------------|----------------------|-----------------|-----------------|-------------|--------------------------|----------|------------------|
|           |            | L <sub>eq</sub>      | L <sub>90</sub> | L <sub>10</sub> |             |                          |          |                  |
|           |            | Unit: dB(A) 30 Mins  |                 |                 |             |                          |          |                  |
| 8-Feb-25  | 9:50       | 61.1                 | 59.5            | 63.0            | 70          | 61.1                     | Fine     | 0.6              |
| 14-Feb-25 | 9:52       | 62.4                 | 58.5            | 64.5            | 70          | 62.4                     | Overcast | 0.4              |
| 20-Feb-25 | 9:52       | 61.6                 | 59.0            | 63.5            | 70          | 61.6                     | Fine     | 0.5              |
| 26-Feb-25 | 9:48       | 62.2                 | 60.0            | 64.0            | 70          | 62.2                     | Overcast | 0.3              |

\*Note: The school calendar was provide in Appendix E.

If measured noise level (L<sub>eq</sub>) > limit level, Corrected noise level (CNL) is calculated as:

$$10 \times \log \left[ \left( 10^{\frac{\text{Measured noise level, } L_{eq}}{10}} \right) - \left( 10^{\frac{\text{Baseline noise level}}{10}} \right) \right]$$

### NMS 13 Lek Yuen Estate

| Date      | Start Time | Measured Noise Level |                 |                 | Limit Level | Construction Noise Level | Weather  | Wind Speed (m/s) |
|-----------|------------|----------------------|-----------------|-----------------|-------------|--------------------------|----------|------------------|
|           |            | L <sub>eq</sub>      | L <sub>90</sub> | L <sub>10</sub> |             |                          |          |                  |
|           |            | Unit: dB(A) 30 Mins  |                 |                 |             |                          |          |                  |
| 8-Feb-25  | 10:36      | 65.6                 | 63.5            | 67.5            | 75          | 65.6                     | Fine     | 0.1              |
| 14-Feb-25 | 10:34      | 65.1                 | 63.0            | 67.5            | 75          | 65.1                     | Overcast | 0.6              |
| 20-Feb-25 | 10:33      | 65.5                 | 63.5            | 68.0            | 75          | 65.5                     | Fine     | 0.2              |
| 26-Feb-25 | 10:23      | 67.7                 | 62.5            | 70.0            | 75          | 67.7                     | Overcast | 0.3              |

### NMS 14 Sheung Wo Che

| Date      | Start Time | Measured Noise Level |                 |                 | Limit Level | Construction Noise Level | Weather  | Wind Speed (m/s) |
|-----------|------------|----------------------|-----------------|-----------------|-------------|--------------------------|----------|------------------|
|           |            | L <sub>eq</sub>      | L <sub>90</sub> | L <sub>10</sub> |             |                          |          |                  |
|           |            | Unit: dB(A) 30 Mins  |                 |                 |             |                          |          |                  |
| 8-Feb-25  | 15:16      | 61.6                 | 59.5            | 64.0            | 75          | 61.6                     | Fine     | 0.1              |
| 14-Feb-25 | 15:15      | 61.9                 | 59.5            | 64.5            | 75          | 61.9                     | Overcast | 0.4              |
| 20-Feb-25 | 15:13      | 61.3                 | 58.5            | 64.0            | 75          | 61.3                     | Fine     | 0.2              |
| 26-Feb-25 | 14:48      | 62.0                 | 55.0            | 63.0            | 75          | 62.0                     | Overcast | 0.2              |

### NMS 15 Ha Wo Che

| Date      | Start Time | Measured Noise Level |                 |                 | Limit Level | Construction Noise Level | Weather  | Wind Speed (m/s) |
|-----------|------------|----------------------|-----------------|-----------------|-------------|--------------------------|----------|------------------|
|           |            | L <sub>eq</sub>      | L <sub>90</sub> | L <sub>10</sub> |             |                          |          |                  |
|           |            | Unit: dB(A) 30 Mins  |                 |                 |             |                          |          |                  |
| 7-Feb-25  | 13:00      | 59.8                 | 57.0            | 62.5            | 75          | 59.8                     | Fine     | 0.1              |
| 13-Feb-25 | 13:00      | 59.8                 | 57.0            | 62.5            | 75          | 59.8                     | Overcast | 0.6              |
| 19-Feb-25 | 13:00      | 59.1                 | 56.5            | 61.5            | 75          | 59.1                     | Fine     | 0.1              |
| 25-Feb-25 | 13:00      | 60.9                 | 58.5            | 63.0            | 75          | 60.9                     | Overcast | 0.3              |

### NMS 16 Ha Wo Che

| Date      | Start Time | Measured Noise Level |                 |                 | Limit Level | Construction Noise Level | Weather  | Wind Speed (m/s) |
|-----------|------------|----------------------|-----------------|-----------------|-------------|--------------------------|----------|------------------|
|           |            | L <sub>eq</sub>      | L <sub>90</sub> | L <sub>10</sub> |             |                          |          |                  |
|           |            | Unit: dB(A) 30 Mins  |                 |                 |             |                          |          |                  |
| 7-Feb-25  | 13:44      | 63.2                 | 60.5            | 65.5            | 75          | 63.2                     | Fine     | 0.3              |
| 13-Feb-25 | 13:45      | 63.2                 | 60.5            | 65.5            | 75          | 63.2                     | Overcast | 0.5              |
| 19-Feb-25 | 13:40      | 62.6                 | 59.5            | 64.5            | 75          | 62.6                     | Fine     | 0.2              |
| 25-Feb-25 | 13:42      | 59.9                 | 58.0            | 62.5            | 75          | 59.9                     | Overcast | 0.2              |

### NMS 17 Shatin Pui Ying College

| Date      | Start Time | Measured Noise Level |                 |                 | Limit Level | Construction Noise Level | Weather  | Wind Speed (m/s) |
|-----------|------------|----------------------|-----------------|-----------------|-------------|--------------------------|----------|------------------|
|           |            | L <sub>eq</sub>      | L <sub>90</sub> | L <sub>10</sub> |             |                          |          |                  |
|           |            | Unit: dB(A) 30 Mins  |                 |                 |             |                          |          |                  |
| 8-Feb-25  | 13:00      | 63.4                 | 61.0            | 66.0            | 70          | 63.4                     | Fine     | 0.6              |
| 14-Feb-25 | 13:00      | 64.8                 | 61.5            | 66.5            | 70          | 64.8                     | Overcast | 0.7              |
| 20-Feb-25 | 13:00      | 62.8                 | 60.5            | 65.5            | 70          | 62.8                     | Fine     | 0.5              |
| 26-Feb-25 | 11:57      | 65.0                 | 61.5            | 66.5            | 70          | 65.0                     | Overcast | 0.3              |

\*Note: The school calendar was provide in Appendix E.

### NMS 18 Ha Wo Che

| Date      | Start Time | Measured Noise Level |                 |                 | Limit Level | Construction Noise Level | Weather  | Wind Speed (m/s) |
|-----------|------------|----------------------|-----------------|-----------------|-------------|--------------------------|----------|------------------|
|           |            | L <sub>eq</sub>      | L <sub>90</sub> | L <sub>10</sub> |             |                          |          |                  |
|           |            | Unit: dB(A) 30 Mins  |                 |                 |             |                          |          |                  |
| 7-Feb-25  | 14:27      | 61.4                 | 59.5            | 63.5            | 75          | 61.4                     | Fine     | 0.3              |
| 13-Feb-25 | 14:28      | 59.4                 | 57.0            | 62.5            | 75          | 59.4                     | Overcast | 0.4              |
| 19-Feb-25 | 14:25      | 61.4                 | 59.0            | 64.0            | 75          | 61.4                     | Fine     | 0.2              |
| 25-Feb-25 | 14:27      | 59.5                 | 57.0            | 61.5            | 75          | 59.5                     | Overcast | 0.5              |

If measured noise level (L<sub>eq</sub>) > limit level, Corrected noise level (CNL) is calculated as:

$$10 \times \log \left[ \left( 10^{\frac{\text{Measured noise level, Leq}}{10}} \right) - \left( 10^{\frac{\text{Baseline noise level}}{10}} \right) \right]$$

### NMS 19 Wo Che Estate

| Date      | Start Time | Measured Noise Level |                 |                 | Limit Level | Construction Noise Level | Weather  | Wind Speed (m/s) |
|-----------|------------|----------------------|-----------------|-----------------|-------------|--------------------------|----------|------------------|
|           |            | L <sub>eq</sub>      | L <sub>90</sub> | L <sub>10</sub> |             |                          |          |                  |
|           |            | Unit: dB(A) 30 Mins  |                 |                 |             |                          |          |                  |
| 8-Feb-25  | 13:39      | 68.7                 | 66.5            | 71.0            | 75          | 68.7                     | Fine     | 0.7              |
| 14-Feb-25 | 13:42      | 68.0                 | 65.0            | 70.5            | 75          | 68.0                     | Overcast | 0.2              |
| 20-Feb-25 | 13:40      | 66.6                 | 63.5            | 69.5            | 75          | 66.6                     | Fine     | 0.5              |
| 26-Feb-25 | 12:35      | 71.0                 | 67.5            | 73.5            | 75          | 71.0                     | Overcast | 0.4              |

### NMS 20 Wo Che Estate

| Date      | Start Time | Measured Noise Level |                 |                 | Limit Level | Construction Noise Level | Weather  | Wind Speed (m/s) |
|-----------|------------|----------------------|-----------------|-----------------|-------------|--------------------------|----------|------------------|
|           |            | L <sub>eq</sub>      | L <sub>90</sub> | L <sub>10</sub> |             |                          |          |                  |
|           |            | Unit: dB(A) 30 Mins  |                 |                 |             |                          |          |                  |
| 8-Feb-25  | 13:26      | 63.9                 | 61.5            | 67.0            | 75          | 63.9                     | Fine     | 0.6              |
| 14-Feb-25 | 13:27      | 61.8                 | 59.5            | 64.5            | 75          | 61.8                     | Overcast | 0.7              |
| 20-Feb-25 | 13:29      | 61.1                 | 58.0            | 63.5            | 75          | 61.1                     | Fine     | 0.5              |
| 26-Feb-25 | 13:25      | 64.0                 | 57.5            | 65.5            | 75          | 64.0                     | Overcast | 0.5              |

### NMS 23 Pai Tau

| Date      | Start Time | Measured Noise Level |                 |                 | Limit Level | Construction Noise Level | Weather  | Wind Speed (m/s) |
|-----------|------------|----------------------|-----------------|-----------------|-------------|--------------------------|----------|------------------|
|           |            | L <sub>eq</sub>      | L <sub>90</sub> | L <sub>10</sub> |             |                          |          |                  |
|           |            | Unit: dB(A) 30 Mins  |                 |                 |             |                          |          |                  |
| 7-Feb-25  | 10:40      | 62.2                 | 60.0            | 64.5            | 75          | 62.2                     | Fine     | 0.6              |
| 13-Feb-25 | 10:44      | 62.8                 | 61.0            | 65.0            | 75          | 62.8                     | Overcast | 0.1              |
| 19-Feb-25 | 10:43      | 63.9                 | 61.0            | 66.5            | 75          | 63.9                     | Fine     | 0.5              |
| 25-Feb-25 | 10:44      | 62.4                 | 60.0            | 65.0            | 75          | 62.4                     | Overcast | 0.2              |

### NMS 24 Shatin Plaza

| Date      | Start Time | Measured Noise Level |                 |                 | Limit Level | Construction Noise Level | Weather  | Wind Speed (m/s) |
|-----------|------------|----------------------|-----------------|-----------------|-------------|--------------------------|----------|------------------|
|           |            | L <sub>eq</sub>      | L <sub>90</sub> | L <sub>10</sub> |             |                          |          |                  |
|           |            | Unit: dB(A) 30 Mins  |                 |                 |             |                          |          |                  |
| 8-Feb-25  | 17:09      | 63.7                 | 60.5            | 65.5            | 75          | 63.7                     | Fine     | 0.7              |
| 14-Feb-25 | 17:07      | 63.9                 | 61.0            | 66.5            | 75          | 63.9                     | Overcast | 0.6              |
| 20-Feb-25 | 17:10      | 64.6                 | 60.0            | 67.5            | 75          | 64.6                     | Fine     | 0.4              |
| 26-Feb-25 | 16:52      | 63.8                 | 61.0            | 65.0            | 75          | 63.8                     | Overcast | 0.4              |

### NMS 25A Sheung Wo Che

| Date      | Start Time | Measured Noise Level |                 |                 | Limit Level | Construction Noise Level | Weather  | Wind Speed (m/s) |
|-----------|------------|----------------------|-----------------|-----------------|-------------|--------------------------|----------|------------------|
|           |            | L <sub>eq</sub>      | L <sub>90</sub> | L <sub>10</sub> |             |                          |          |                  |
|           |            | Unit: dB(A) 30 Mins  |                 |                 |             |                          |          |                  |
| 8-Feb-25  | 16:38      | 64.5                 | 61.5            | 67.5            | 75          | 64.5                     | Fine     | 0.2              |
| 14-Feb-25 | 16:39      | 66.8                 | 63.0            | 69.5            | 75          | 66.8                     | Overcast | 0.6              |
| 20-Feb-25 | 16:36      | 64.9                 | 61.5            | 67.0            | 75          | 64.9                     | Fine     | 0.5              |
| 26-Feb-25 | 16:17      | 65.3                 | 60.0            | 67.0            | 75          | 65.3                     | Overcast | 0.6              |

### NMS 26 Wo Che Estate

| Date      | Start Time | Measured Noise Level |                 |                 | Limit Level | Construction Noise Level | Weather  | Wind Speed (m/s) |
|-----------|------------|----------------------|-----------------|-----------------|-------------|--------------------------|----------|------------------|
|           |            | L <sub>eq</sub>      | L <sub>90</sub> | L <sub>10</sub> |             |                          |          |                  |
|           |            | Unit: dB(A) 30 Mins  |                 |                 |             |                          |          |                  |
| 8-Feb-25  | 11:08      | 68.1                 | 65.5            | 70.0            | 75          | 68.1                     | Fine     | 0.5              |
| 14-Feb-25 | 11:08      | 68.6                 | 65.5            | 70.5            | 75          | 68.6                     | Overcast | 0.1              |
| 20-Feb-25 | 11:12      | 66.4                 | 63.5            | 69.0            | 75          | 66.4                     | Fine     | 0.7              |
| 26-Feb-25 | 11:15      | 69.0                 | 63.5            | 71.0            | 75          | 69.0                     | Overcast | 0.4              |







### NMS 27 Jockey Club Ti-I College







| Date      | Start Time | Measured Noise Level |                 |                 | Limit Level | Construction Noise Level | Weather  | Wind Speed (m/s) |
|-----------|------------|----------------------|-----------------|-----------------|-------------|--------------------------|----------|------------------|
|           |            | L <sub>eq</sub>      | L <sub>90</sub> | L <sub>10</sub> |             |                          |          |                  |
|           |            | Unit: dB(A) 30 Mins  |                 |                 |             |                          |          |                  |
| 7-Feb-25  | 11:35      | 63.2                 | 60.5            | 66.0            | 65          | 63.2                     | Fine     | 0.2              |
| 13-Feb-25 | 11:36      | 63.1                 | 60.0            | 65.5            | 65          | 63.1                     | Overcast | 0.6              |
| 19-Feb-25 | 11:28      | 62.1                 | 60.0            | 65.0            | 65          | 62.1                     | Fine     | 0.3              |
| 25-Feb-25 | 11:30      | 61.9                 | 60.0            | 64.5            | 70          | 61.9                     | Overcast | 0.5              |







\*Note: The school calender was provide in Appendix E.








If measured noise level (L<sub>eq</sub>) > limit level, Corrected noise level (CNL) is calculated as:

$$10 \times \log \left[ \left( 10^{\frac{\text{Measured noise level, } L_{eq}}{10}} \right) - \left( 10^{\frac{\text{Baseline noise level}}{10}} \right) \right]$$

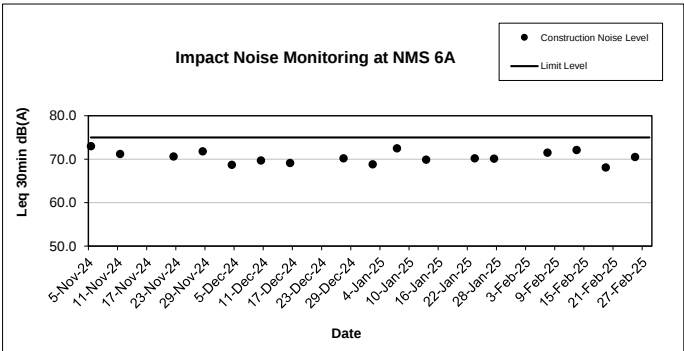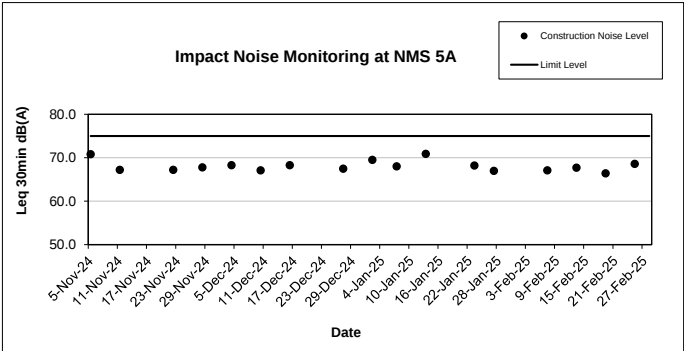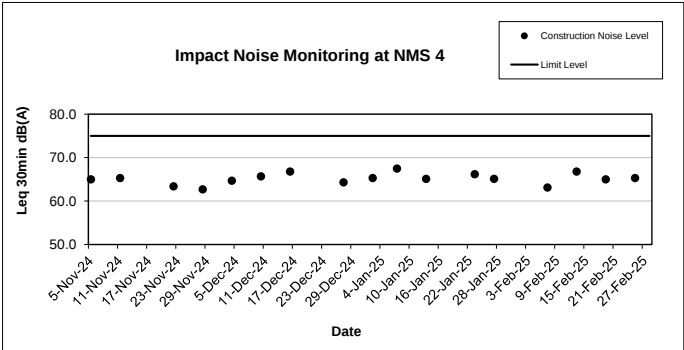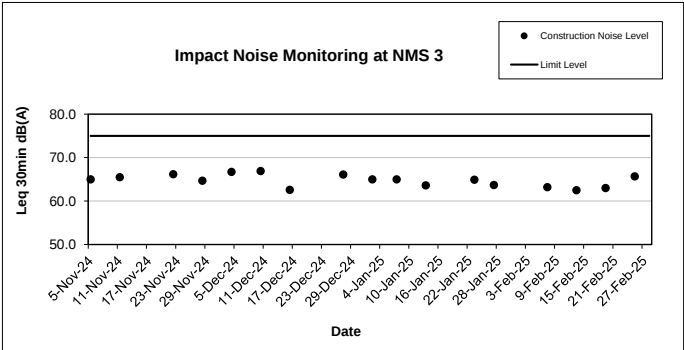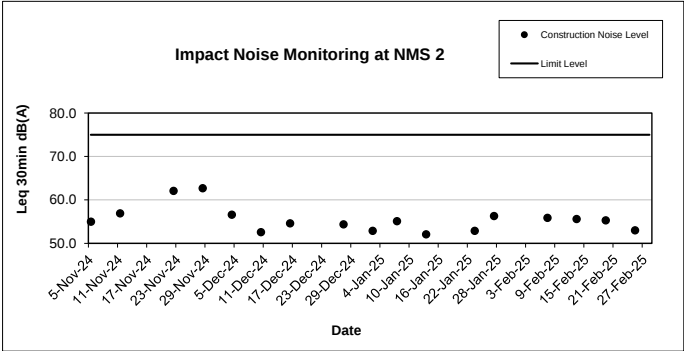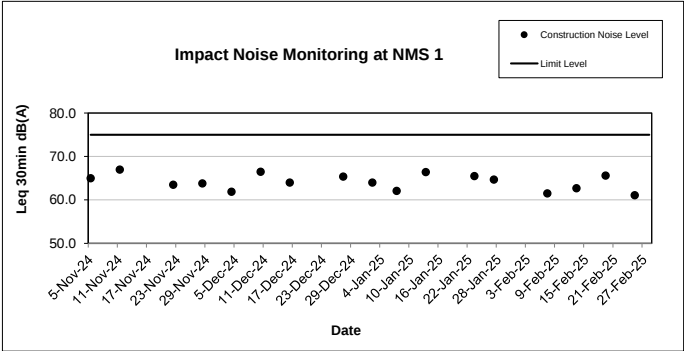

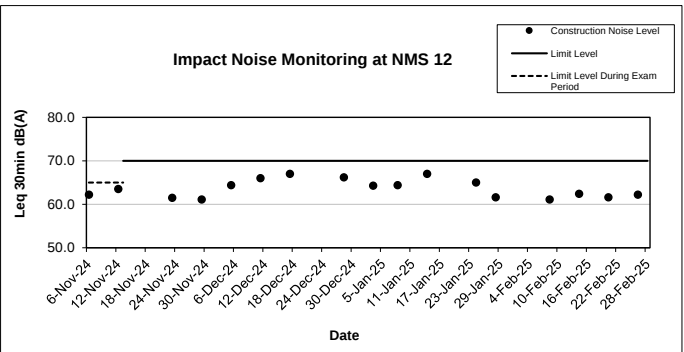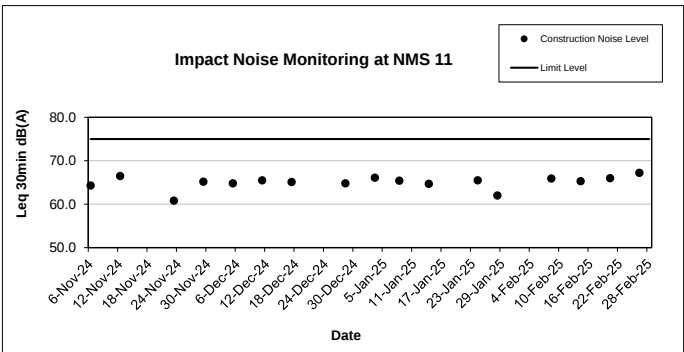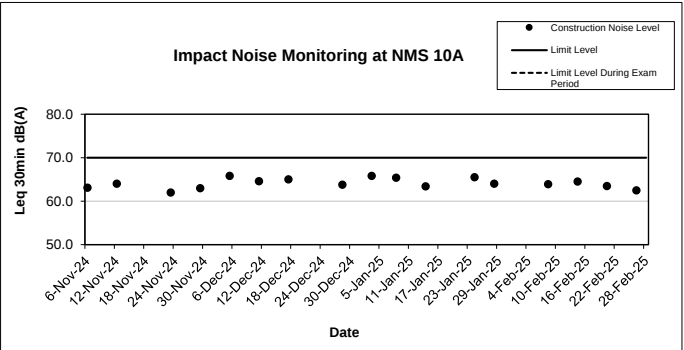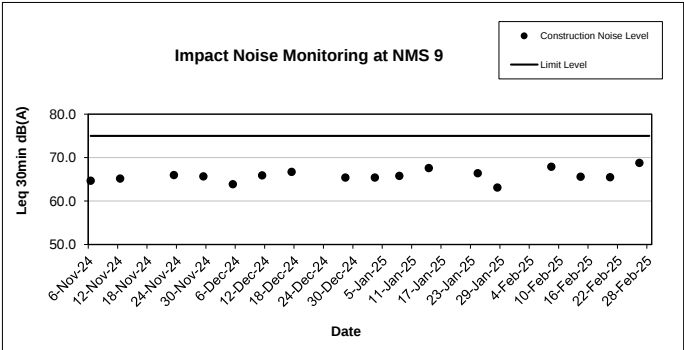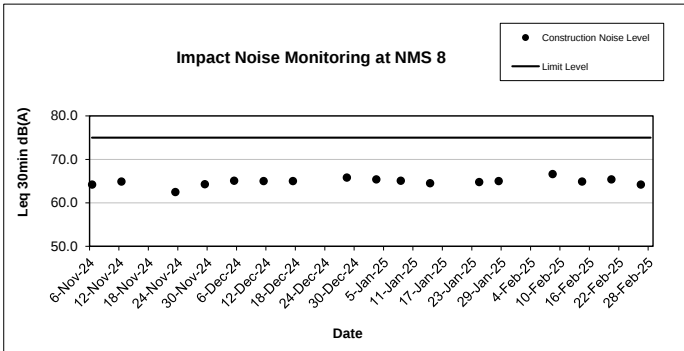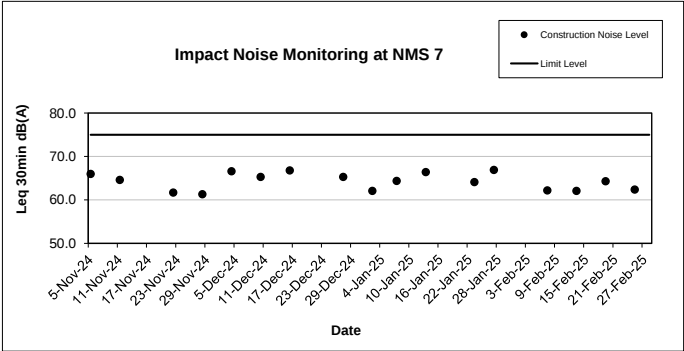

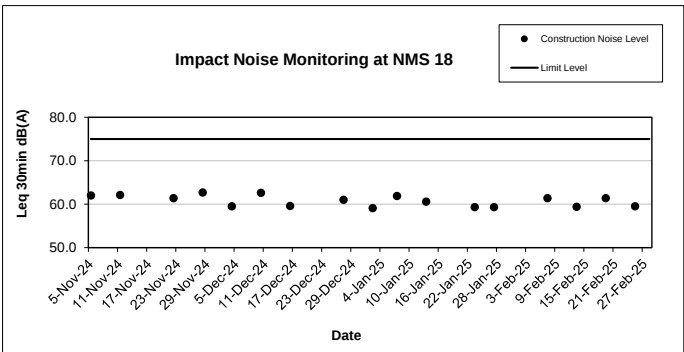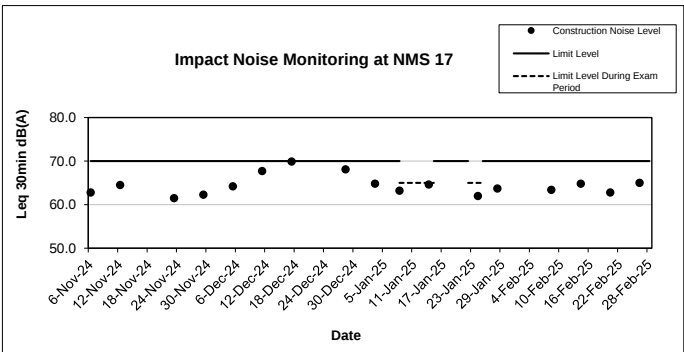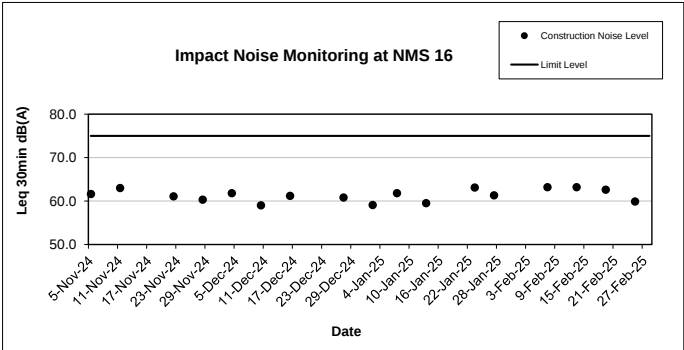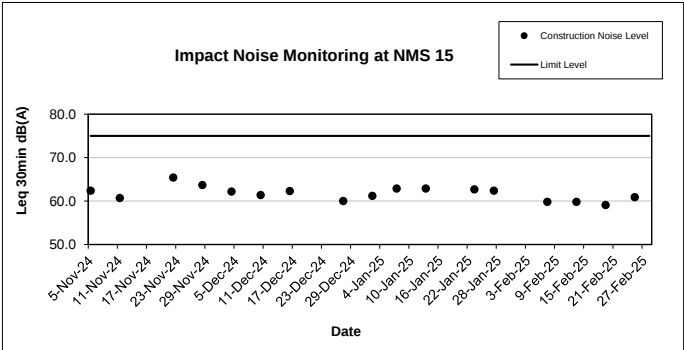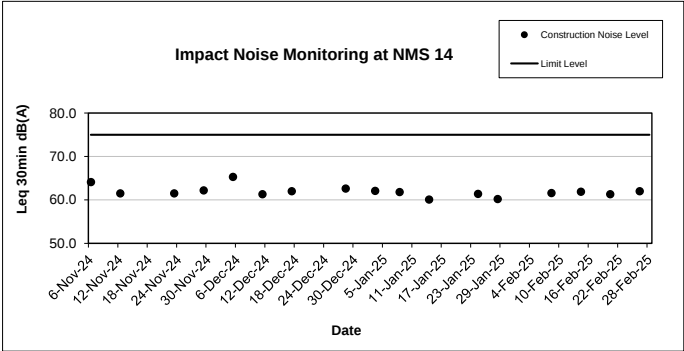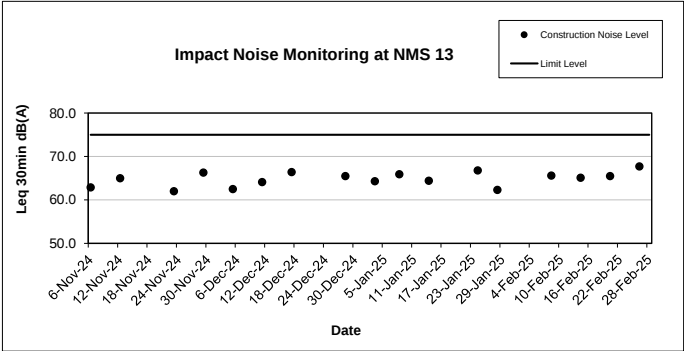

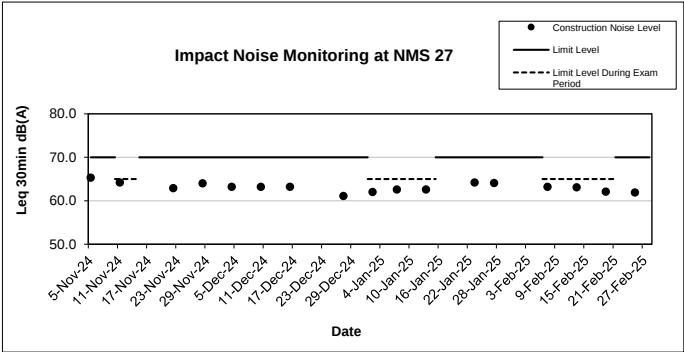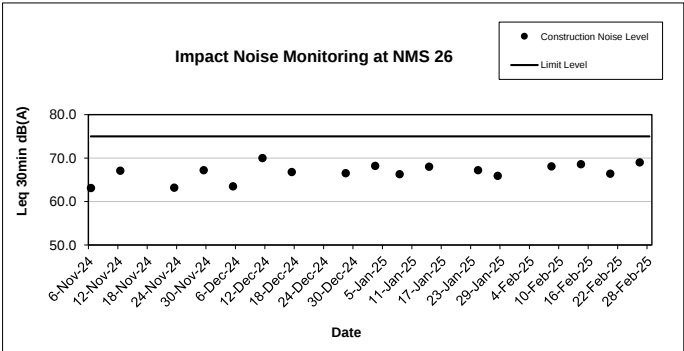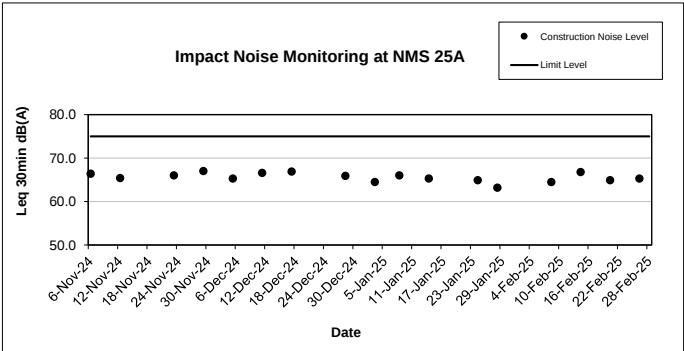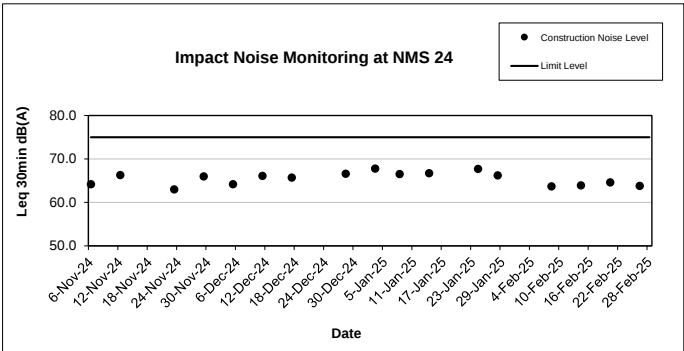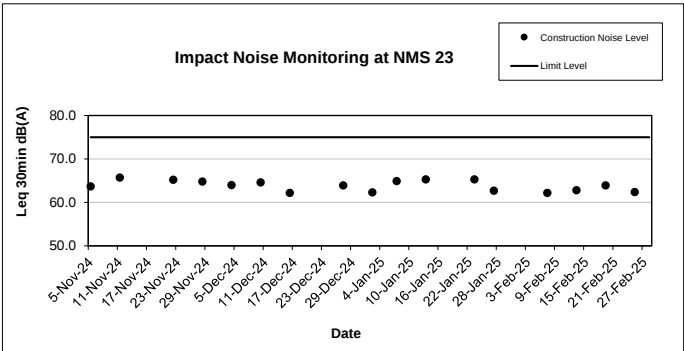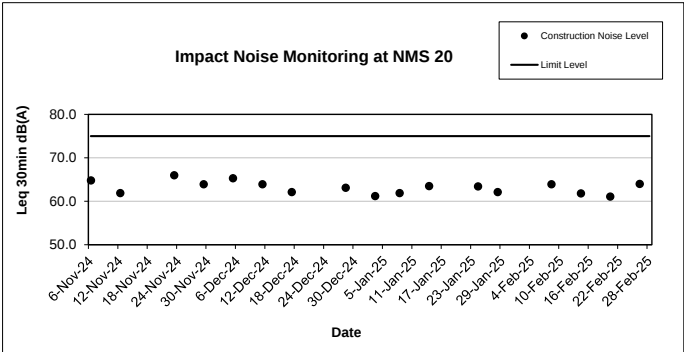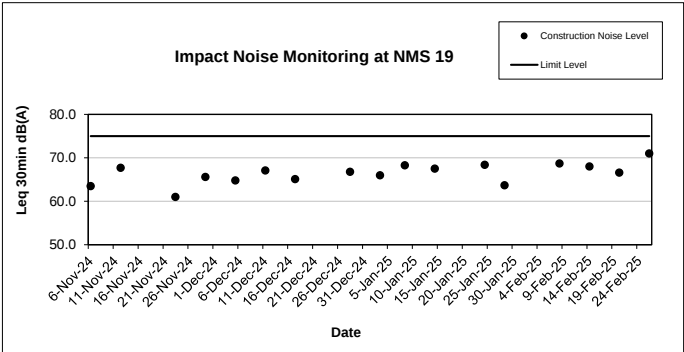

## Night Time Noise Monitoring Result for NOD 03-2018 Road Widening and Retrofitting Noise Barriers on Tai Po Road (Sha Tin Section)

### NMS 1 Scenery Court

| Date      | Start Time | Average Leq (15 min) (dB(A)) | Baseline (dB(A)) | Baseline Range (dB(A)) | Limit Level (dB(A)) | Corrected Noise Level (dB(A)) | Weather  | Wind Speed (m/s) |
|-----------|------------|------------------------------|------------------|------------------------|---------------------|-------------------------------|----------|------------------|
| 7-Feb-25  | 03:51      | 60.3                         | 61.4             | 52.8 - 66.3            | 55                  | Measured Noise Level<Baseline | Overcast | 0.3              |
| 11-Feb-25 | 23:00      | 58.2                         |                  |                        |                     | Measured Noise Level<Baseline | Overcast | 0.5              |
| 19-Feb-25 | 23:41      | 59.9                         |                  |                        |                     | Measured Noise Level<Baseline | Overcast | 0.3              |
| 25-Feb-25 | 23:00      | 56.9                         |                  |                        |                     | Measured Noise Level<Baseline | Overcast | 0.6              |

### NMS 2 Villa Le Parc

| Date      | Start Time | Average Leq (15 min) (dB(A)) | Baseline (dB(A)) | Baseline Range (dB(A)) | Limit Level (dB(A)) | Corrected Noise Level (dB(A))    | Weather  | Wind Speed (m/s) |
|-----------|------------|------------------------------|------------------|------------------------|---------------------|----------------------------------|----------|------------------|
| 6-Feb-25  | 23:10      | 52.6                         | 49.7             | 40.1 - 58.2            | 55                  | Measured Noise Level<Limit Level | Overcast | 0.6              |
| 11-Feb-25 | 23:05      | 51.6                         |                  |                        |                     | Measured Noise Level<Limit Level | Overcast | 0.5              |
| 19-Feb-25 | 23:04      | 52.2                         |                  |                        |                     | Measured Noise Level<Limit Level | Overcast | 0.2              |
| 25-Feb-25 | 23:03      | 52.2                         |                  |                        |                     | Measured Noise Level<Limit Level | Overcast | 0.5              |

### NMS 3 Hilton Plaza

| Date      | Start Time | Average Leq (15 min) (dB(A)) | Baseline (dB(A)) | Baseline Range (dB(A)) | Limit Level (dB(A)) | Corrected Noise Level (dB(A)) | Weather  | Wind Speed (m/s) |
|-----------|------------|------------------------------|------------------|------------------------|---------------------|-------------------------------|----------|------------------|
| 7-Feb-25  | 03:24      | 59.2                         | 70.9             | 60.2 - 78.9            | 55                  | Measured Noise Level<Baseline | Overcast | 0.5              |
| 11-Feb-25 | 23:25      | 58.5                         |                  |                        |                     | Measured Noise Level<Baseline | Overcast | 0.6              |
| 19-Feb-25 | 23:04      | 59.4                         |                  |                        |                     | Measured Noise Level<Baseline | Overcast | 0.4              |
| 25-Feb-25 | 23:28      | 57.5                         |                  |                        |                     | Measured Noise Level<Baseline | Overcast | 0.4              |

### NMS 4 Tin Liu

| Date      | Start Time | Average Leq (15 min) (dB(A)) | Baseline (dB(A)) | Baseline Range (dB(A)) | Limit Level (dB(A)) | Corrected Noise Level (dB(A)) | Weather  | Wind Speed (m/s) |
|-----------|------------|------------------------------|------------------|------------------------|---------------------|-------------------------------|----------|------------------|
| 6-Feb-25  | 23:42      | 57.7                         | 62.6             | 53.1 - 68.1            | 55                  | Measured Noise Level<Baseline | Overcast | 0.4              |
| 11-Feb-25 | 23:32      | 59.0                         |                  |                        |                     | Measured Noise Level<Baseline | Overcast | 0.5              |
| 19-Feb-25 | 23:34      | 57.0                         |                  |                        |                     | Measured Noise Level<Baseline | Overcast | 0.5              |
| 25-Feb-25 | 23:35      | 60.0                         |                  |                        |                     | Measured Noise Level<Baseline | Overcast | 0.5              |

### NMS 5A Wai Wah Centre (Site Boundary)

| Date      | Start Time | Average Leq (15 min) (dB(A)) | Baseline (dB(A)) | Baseline Range (dB(A)) | Limit Level (dB(A)) | Corrected Noise Level (dB(A)) | Weather  | Wind Speed (m/s) |
|-----------|------------|------------------------------|------------------|------------------------|---------------------|-------------------------------|----------|------------------|
| 7-Feb-25  | 02:49      | 61.6                         | 67.9             | 62.0 - 75.2            | 55                  | Measured Noise Level<Baseline | Overcast | 0.3              |
| 11-Feb-25 | 23:49      | 60.8                         |                  |                        |                     | Measured Noise Level<Baseline | Overcast | 0.3              |
| 20-Feb-25 | 02:38      | 61.7                         |                  |                        |                     | Measured Noise Level<Baseline | Overcast | 0.2              |
| 26-Feb-25 | 23:52      | 59.8                         |                  |                        |                     | Measured Noise Level<Baseline | Overcast | 0.3              |

### NMS 6A Wai Wah Centre (Site Boundary)

| Date      | Start Time | Average Leq (15 min) (dB(A)) | Baseline (dB(A)) | Baseline Range (dB(A)) | Limit Level (dB(A)) | Corrected Noise Level (dB(A)) | Weather  | Wind Speed (m/s) |
|-----------|------------|------------------------------|------------------|------------------------|---------------------|-------------------------------|----------|------------------|
| 7-Feb-25  | 02:28      | 69.0                         | 71.5             | 65.0 - 85.9            | 55                  | Measured Noise Level<Baseline | Overcast | 0.6              |
| 12-Feb-25 | 00:15      | 62.9                         |                  |                        |                     | Measured Noise Level<Baseline | Overcast | 0.5              |
| 20-Feb-25 | 02:16      | 70.1                         |                  |                        |                     | Measured Noise Level<Baseline | Overcast | 0.4              |
| 26-Feb-25 | 00:16      | 63.8                         |                  |                        |                     | Measured Noise Level<Baseline | Overcast | 0.2              |

If measured noise level ( $L_{eq}$ ) > limit level, Corrected noise level (CNL) is calculated as:

$$10 \times \log \left[ \left( 10^{\frac{\text{Measured noise level, Leq}}{10}} \right) - \left( 10^{\frac{\text{Baseline noise level}}{10}} \right) \right]$$

### NMS 7 Tin Liu

| Date      | Start Time | Average Leq (15 min) (dB(A)) | Baseline (dB(A)) | Baseline Range (dB(A)) | Limit Level (dB(A)) | Corrected Noise Level (dB(A)) | Weather  | Wind Speed (m/s) |
|-----------|------------|------------------------------|------------------|------------------------|---------------------|-------------------------------|----------|------------------|
| 6-Feb-25  | 00:01      | 56.8                         | 59.0             | 51.4 - 65.5            | 55                  | Measured Noise Level<Baseline | Overcast | 0.7              |
| 11-Feb-25 | 23:51      | 56.8                         |                  |                        |                     | Measured Noise Level<Baseline | Overcast | 0.6              |
| 19-Feb-25 | 23:53      | 56.8                         |                  |                        |                     | Measured Noise Level<Baseline | Overcast | 0.4              |
| 25-Feb-25 | 23:54      | 56.7                         |                  |                        |                     | Measured Noise Level<Baseline | Overcast | 0.4              |

### NMS 8 Shatin Plaza

| Date      | Start Time | Average Leq (15 min) (dB(A)) | Baseline (dB(A)) | Baseline Range (dB(A)) | Limit Level (dB(A)) | Corrected Noise Level (dB(A)) | Weather  | Wind Speed (m/s) |
|-----------|------------|------------------------------|------------------|------------------------|---------------------|-------------------------------|----------|------------------|
| 6-Feb-25  | 23:28      | 63.2                         | 64.4             | 55.6 - 72.8            | 55                  | Measured Noise Level<Baseline | Overcast | 0.6              |
| 12-Feb-25 | 00:40      | 59.0                         |                  |                        |                     | Measured Noise Level<Baseline | Overcast | 0.7              |
| 20-Feb-25 | 01:02      | 57.3                         |                  |                        |                     | Measured Noise Level<Baseline | Overcast | 0.5              |
| 26-Feb-25 | 00:43      | 57.3                         |                  |                        |                     | Measured Noise Level<Baseline | Overcast | 0.6              |

### NMS 9 Lek Yuen Estate

| Date      | Start Time | Average Leq (15 min) (dB(A)) | Baseline (dB(A)) | Baseline Range (dB(A)) | Limit Level (dB(A)) | Corrected Noise Level (dB(A))    | Weather  | Wind Speed (m/s) |
|-----------|------------|------------------------------|------------------|------------------------|---------------------|----------------------------------|----------|------------------|
| 7-Feb-25  | 00:24      | 56.8                         | 53.5             | 39.5 - 63.1            | 55                  | 54.1*                            | Overcast | 0.4              |
| 12-Feb-25 | 01:36      | 53.6                         |                  |                        |                     | Measured Noise Level<Limit Level | Overcast | 0.4              |
| 20-Feb-25 | 00:27      | 56.0                         |                  |                        |                     | 52.4*                            | Overcast | 0.2              |
| 26-Feb-25 | 01:34      | 52.9                         |                  |                        |                     | Measured Noise Level<Limit Level | Overcast | 0.4              |

Note: \*Corrected Noise Level in Leq (15min) dB(A) was/were lower than Limit level: 55 dB(A).

### NMS 11 Sheung Wo Che

| Date      | Start Time | Average Leq (15 min) (dB(A)) | Baseline (dB(A)) | Baseline Range (dB(A)) | Limit Level (dB(A)) | Corrected Noise Level (dB(A))    | Weather  | Wind Speed (m/s) |
|-----------|------------|------------------------------|------------------|------------------------|---------------------|----------------------------------|----------|------------------|
| 6-Feb-25  | 00:52      | 51.6                         | 53.2             | 46.1 - 62.8            | 55                  | Measured Noise Level<Limit Level | Overcast | 0.2              |
| 12-Feb-25 | 00:51      | 53.7                         |                  |                        |                     | Measured Noise Level<Limit Level | Overcast | 0.6              |
| 20-Feb-25 | 00:53      | 52.0                         |                  |                        |                     | Measured Noise Level<Limit Level | Overcast | 0.4              |
| 26-Feb-25 | 00:52      | 53.3                         |                  |                        |                     | Measured Noise Level<Limit Level | Overcast | 0.6              |

If measured noise level ( $L_{eq}$ ) > limit level, Corrected noise level (CNL) is calculated as:

$$10 \times \log \left[ \left( 10^{\frac{\text{Measured noise level, Leq}}{10}} \right) - \left( 10^{\frac{\text{Baseline noise level}}{10}} \right) \right]$$

### NMS 13 Lek Yuen Estate

| Date      | Start Time | Average Leq (15 min) (dB(A)) | Baseline (dB(A)) | Baseline Range (dB(A)) | Limit Level (dB(A)) | Corrected Noise Level (dB(A))    | Weather  | Wind Speed (m/s) |
|-----------|------------|------------------------------|------------------|------------------------|---------------------|----------------------------------|----------|------------------|
| 7-Feb-25  | 00:51      | 55.8                         | 57.3             | 45.4 - 72.5            | 55                  | Measured Noise Level<Baseline    | Overcast | 0.5              |
| 12-Feb-25 | 02:02      | 56.7                         |                  |                        |                     | Measured Noise Level<Baseline    | Overcast | 0.5              |
| 20-Feb-25 | 00:58      | 53.1                         |                  |                        |                     | Measured Noise Level<Limit Level | Overcast | 0.5              |
| 26-Feb-25 | 01:59      | 56.0                         |                  |                        |                     | Measured Noise Level<Baseline    | Overcast | 0.5              |

### NMS 14 Sheung Wo Che

| Date      | Start Time | Average Leq (15 min) (dB(A)) | Baseline (dB(A)) | Baseline Range (dB(A)) | Limit Level (dB(A)) | Corrected Noise Level (dB(A))    | Weather  | Wind Speed (m/s) |
|-----------|------------|------------------------------|------------------|------------------------|---------------------|----------------------------------|----------|------------------|
| 6-Feb-25  | 01:12      | 52.4                         | 54.1             | 46.1 - 62.8            | 55                  | Measured Noise Level<Limit Level | Overcast | 0.4              |
| 12-Feb-25 | 01:09      | 55.1                         |                  |                        |                     | 48.2*                            | Overcast | 0.4              |
| 20-Feb-25 | 01:13      | 53.0                         |                  |                        |                     | Measured Noise Level<Limit Level | Overcast | 0.5              |
| 26-Feb-25 | 01:11      | 55.0                         |                  |                        |                     | Measured Noise Level<Baseline    | Overcast | 0.5              |

Note: \*Corrected Noise Level in Leq (15min) dB(A) was/were lower than Limit level: 55 dB(A).

### NMS 15 Ha Wo Che

| Date      | Start Time | Average Leq (15 min) (dB(A)) | Baseline (dB(A)) | Baseline Range (dB(A)) | Limit Level (dB(A)) | Corrected Noise Level (dB(A))    | Weather  | Wind Speed (m/s) |
|-----------|------------|------------------------------|------------------|------------------------|---------------------|----------------------------------|----------|------------------|
| 6-Feb-25  | 01:33      | 53.7                         | 58.8             | 48.4 - 69.7            | 55                  | Measured Noise Level<Limit Level | Overcast | 0.3              |
| 12-Feb-25 | 01:31      | 54.6                         |                  |                        |                     | Measured Noise Level<Limit Level | Overcast | 0.5              |
| 20-Feb-25 | 01:32      | 54.4                         |                  |                        |                     | Measured Noise Level<Limit Level | Overcast | 0.6              |
| 26-Feb-25 | 01:29      | 55.3                         |                  |                        |                     | Measured Noise Level<Baseline    | Overcast | 0.5              |

### NMS 16 Ha Wo Che

| Date      | Start Time | Average Leq (15 min) (dB(A)) | Baseline (dB(A)) | Baseline Range (dB(A)) | Limit Level (dB(A)) | Corrected Noise Level (dB(A))    | Weather  | Wind Speed (m/s) |
|-----------|------------|------------------------------|------------------|------------------------|---------------------|----------------------------------|----------|------------------|
| 6-Feb-25  | 01:55      | 55.0                         | 60.1             | 51.4 - 69.5            | 55                  | Measured Noise Level<Baseline    | Overcast | 0.2              |
| 12-Feb-25 | 01:52      | 54.6                         |                  |                        |                     | Measured Noise Level<Limit Level | Overcast | 0.6              |
| 20-Feb-25 | 01:49      | 55.6                         |                  |                        |                     | Measured Noise Level<Baseline    | Overcast | 0.3              |
| 26-Feb-25 | 01:48      | 55.1                         |                  |                        |                     | Measured Noise Level<Baseline    | Overcast | 0.4              |

### NMS 18 Ha Wo Che

| Date      | Start Time | Average Leq (15 min) (dB(A)) | Baseline (dB(A)) | Baseline Range (dB(A)) | Limit Level (dB(A)) | Corrected Noise Level (dB(A))    | Weather  | Wind Speed (m/s) |
|-----------|------------|------------------------------|------------------|------------------------|---------------------|----------------------------------|----------|------------------|
| 6-Feb-25  | 02:15      | 52.9                         | 63.2             | 56.0 - 72.1            | 55                  | Measured Noise Level<Limit Level | Overcast | 0.2              |
| 12-Feb-25 | 02:11      | 53.5                         |                  |                        |                     | Measured Noise Level<Limit Level | Overcast | 0.4              |
| 20-Feb-25 | 02:10      | 52.2                         |                  |                        |                     | Measured Noise Level<Limit Level | Overcast | 0.2              |
| 26-Feb-25 | 02:09      | 53.7                         |                  |                        |                     | Measured Noise Level<Limit Level | Overcast | 0.6              |

If measured noise level ( $L_{eq}$ ) > limit level, Corrected noise level (CNL) is calculated as:

$$10 \times \log \left[ \left( 10^{\frac{\text{Measured noise level, Leq}}{10}} \right) - \left( 10^{\frac{\text{Baseline noise level}}{10}} \right) \right]$$

### NMS 19 Wo Che Estate

| Date      | Start Time | Average Leq (15 min) (dB(A)) | Baseline (dB(A)) | Baseline Range (dB(A)) | Limit Level (dB(A)) | Corrected Noise Level (dB(A))    | Weather  | Wind Speed (m/s) |
|-----------|------------|------------------------------|------------------|------------------------|---------------------|----------------------------------|----------|------------------|
| 7-Feb-25  | 01:19      | 52.8                         | 61.7             | 53.8 - 72.8            | 55                  | Measured Noise Level<Limit Level | Overcast | 0.4              |
| 12-Feb-25 | 02:29      | 54.5                         |                  |                        |                     | Measured Noise Level<Limit Level | Overcast | 0.5              |
| 20-Feb-25 | 01:26      | 52.8                         |                  |                        |                     | Measured Noise Level<Limit Level | Overcast | 0.4              |
| 26-Feb-25 | 02:23      | 53.5                         |                  |                        |                     | Measured Noise Level<Limit Level | Overcast | 0.5              |

### NMS 20 Wo Che Estate

| Date      | Start Time | Average Leq (15 min) (dB(A)) | Baseline (dB(A)) | Baseline Range (dB(A)) | Limit Level (dB(A)) | Corrected Noise Level (dB(A))    | Weather  | Wind Speed (m/s) |
|-----------|------------|------------------------------|------------------|------------------------|---------------------|----------------------------------|----------|------------------|
| 7-Feb-25  | 01:45      | 50.3                         | 57.7             | 48.6 - 71.7            | 55                  | Measured Noise Level<Limit Level | Overcast | 0.2              |
| 12-Feb-25 | 02:57      | 53.3                         |                  |                        |                     | Measured Noise Level<Limit Level | Overcast | 0.4              |
| 20-Feb-25 | 01:47      | 50.8                         |                  |                        |                     | Measured Noise Level<Limit Level | Overcast | 0.4              |
| 26-Feb-25 | 02:49      | 53.5                         |                  |                        |                     | Measured Noise Level<Limit Level | Overcast | 0.3              |

### NMS 23 Pai Tau

| Date      | Start Time | Average Leq (15 min) (dB(A)) | Baseline (dB(A)) | Baseline Range (dB(A)) | Limit Level (dB(A)) | Corrected Noise Level (dB(A)) | Weather  | Wind Speed (m/s) |
|-----------|------------|------------------------------|------------------|------------------------|---------------------|-------------------------------|----------|------------------|
| 6-Feb-25  | 00:21      | 57.9                         | 59.9             | 47.8 - 69.8            | 55                  | Measured Noise Level<Baseline | Overcast | 0.5              |
| 12-Feb-25 | 00:12      | 55.1                         |                  |                        |                     | Measured Noise Level<Baseline | Overcast | 0.4              |
| 20-Feb-25 | 00:11      | 56.8                         |                  |                        |                     | Measured Noise Level<Baseline | Overcast | 0.2              |
| 26-Feb-25 | 00:12      | 56.2                         |                  |                        |                     | Measured Noise Level<Baseline | Overcast | 0.5              |

### NMS 24 Shatin Plaza

| Date      | Start Time | Average Leq (15 min) (dB(A)) | Baseline (dB(A)) | Baseline Range (dB(A)) | Limit Level (dB(A)) | Corrected Noise Level (dB(A))    | Weather  | Wind Speed (m/s) |
|-----------|------------|------------------------------|------------------|------------------------|---------------------|----------------------------------|----------|------------------|
| 6-Feb-25  | 23:48      | 59.5                         | 58.0             | 50.2 - 66.7            | 55                  | 54.2*                            | Overcast | 0.2              |
| 12-Feb-25 | 01:08      | 55.8                         |                  |                        |                     | Measured Noise Level<Baseline    | Overcast | 0.6              |
| 20-Feb-25 | 01:26      | 58.3                         |                  |                        |                     | 46.5*                            | Overcast | 0.4              |
| 26-Feb-25 | 01:08      | 53.1                         |                  |                        |                     | Measured Noise Level<Limit Level | Overcast | 0.4              |

Note: \*Corrected Noise Level in Leq (15min) dB(A) was/were lower than Limit level: 55 dB(A).

### NMS 25A Sheung Wo Che









| Date      | Start Time | Average Leq (15 min) (dB(A)) | Baseline (dB(A)) | Baseline Range (dB(A)) | Limit Level (dB(A)) | Corrected Noise Level (dB(A))    | Weather  | Wind Speed (m/s) |
|-----------|------------|------------------------------|------------------|------------------------|---------------------|----------------------------------|----------|------------------|
| 6-Feb-25  | 00:35      | 54.2                         | 59.7             | 50.3 - 68.4            | 55                  | Measured Noise Level<Limit Level | Overcast | 0.4              |
| 12-Feb-25 | 00:33      | 57.6                         |                  |                        |                     | Measured Noise Level<Baseline    | Overcast | 0.5              |
| 20-Feb-25 | 00:30      | 54.4                         |                  |                        |                     | Measured Noise Level<Limit Level | Overcast | 0.2              |
| 26-Feb-25 | 00:32      | 56.8                         |                  |                        |                     | Measured Noise Level<Baseline    | Overcast | 0.4              |









### NMS 26 Wo Che Estate






| Date      | Start Time | Average Leq (15 min) (dB(A)) | Baseline (dB(A)) | Baseline Range (dB(A)) | Limit Level (dB(A)) | Corrected Noise Level (dB(A)) | Weather  | Wind Speed (m/s) |
|-----------|------------|------------------------------|------------------|------------------------|---------------------|-------------------------------|----------|------------------|
| 6-Feb-25  | 02:32      | 58.1                         | 61.2             | 45.7 - 70.1            | 55                  | Measured Noise Level<Baseline | Overcast | 0.4              |
| 12-Feb-25 | 02:37      | 59.8                         |                  |                        |                     | Measured Noise Level<Baseline | Overcast | 0.5              |
| 20-Feb-25 | 02:53      | 59.3                         |                  |                        |                     | Measured Noise Level<Baseline | Overcast | 0.5              |
| 26-Feb-25 | 02:39      | 57.3                         |                  |                        |                     | Measured Noise Level<Baseline | Overcast | 0.4              |

If measured noise level ( $L_{eq}$ ) > limit level, Corrected noise level (CNL) is calculated as:

$$10 \times \log \left[ \left( 10^{\frac{\text{Measured noise level, Leq}}{10}} \right) - \left( 10^{\frac{\text{Baseline noise level}}{10}} \right) \right]$$

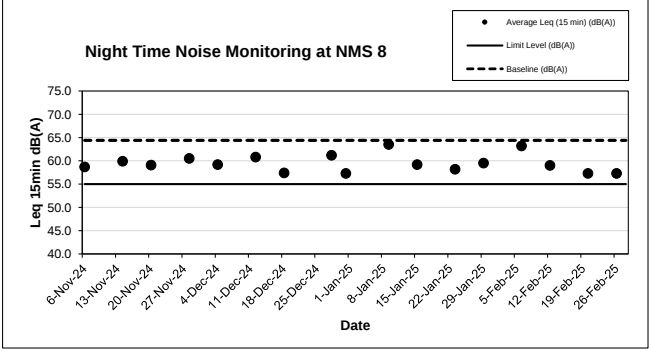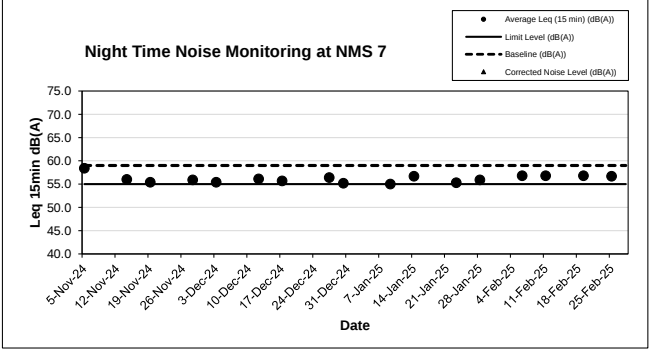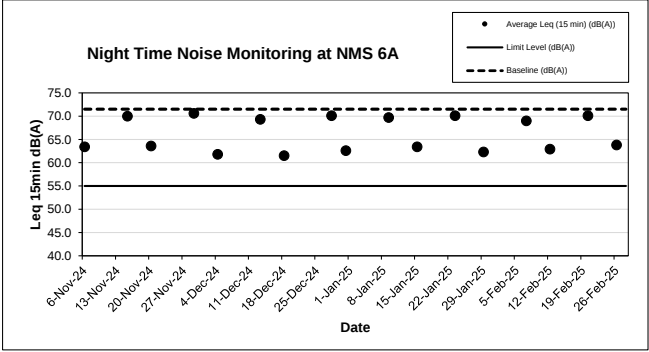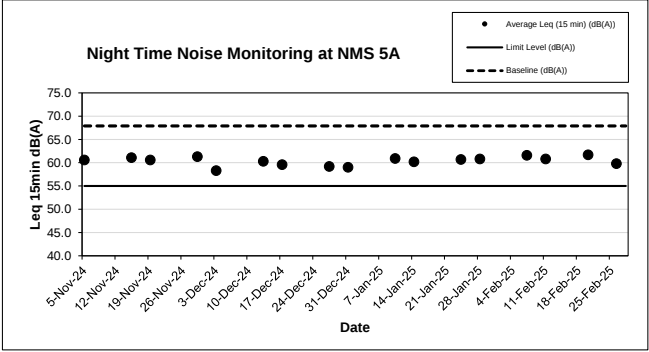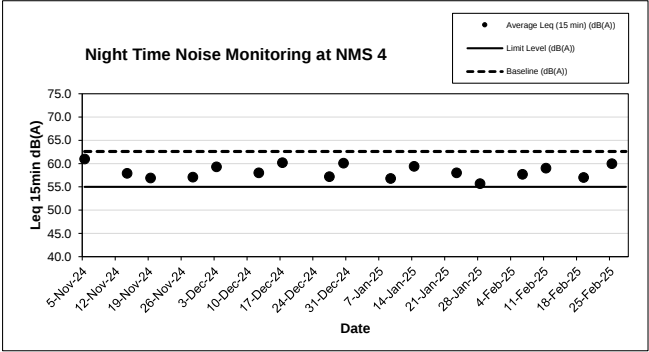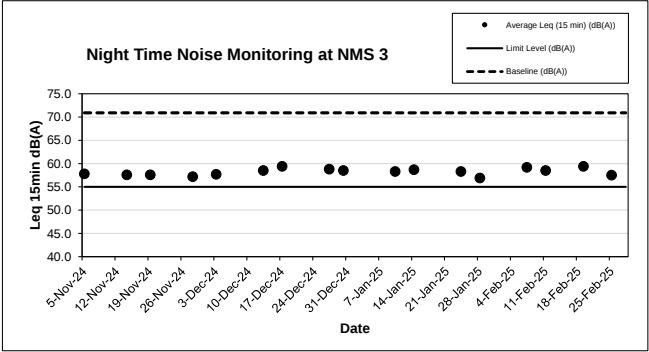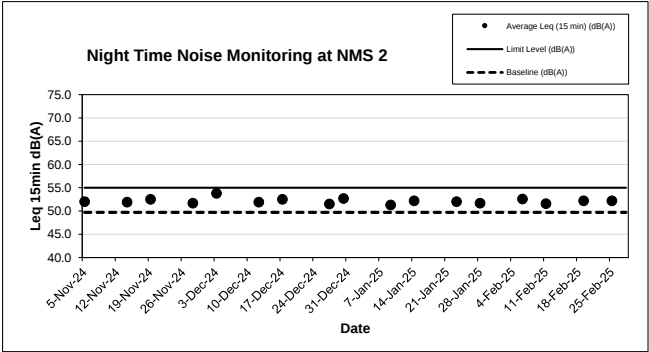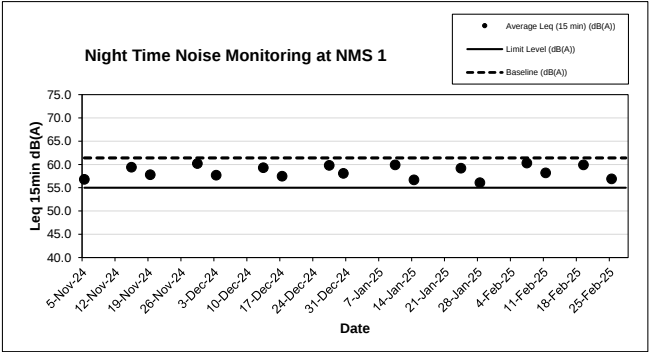

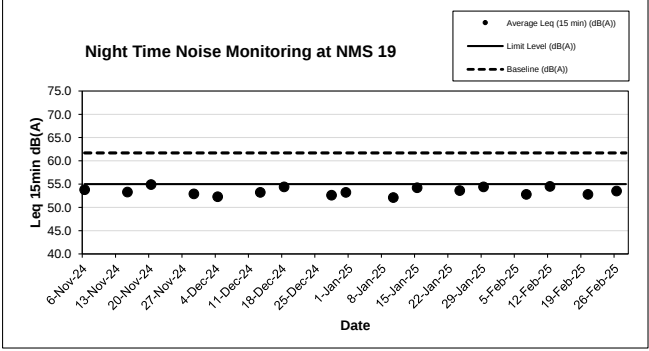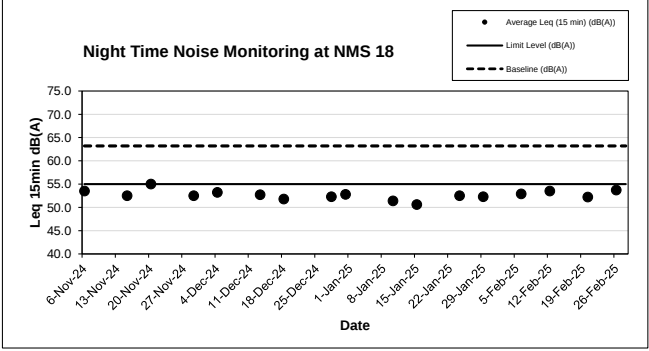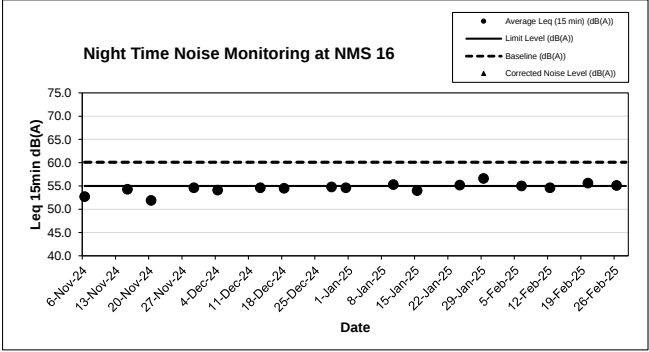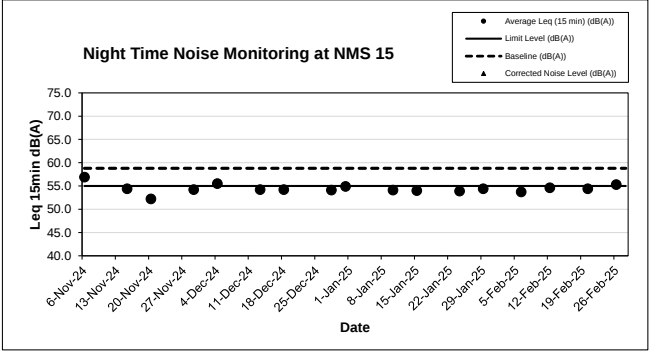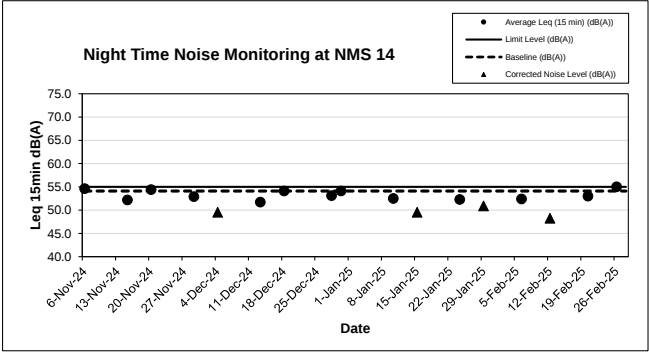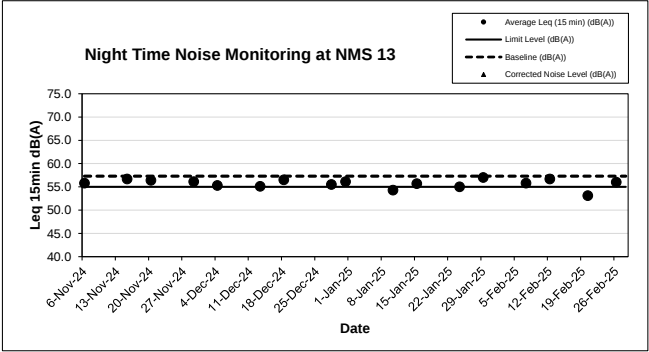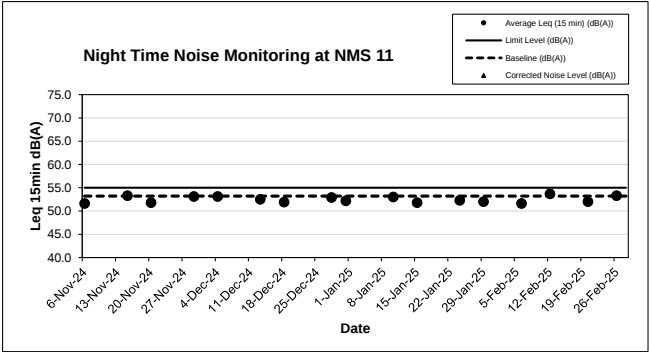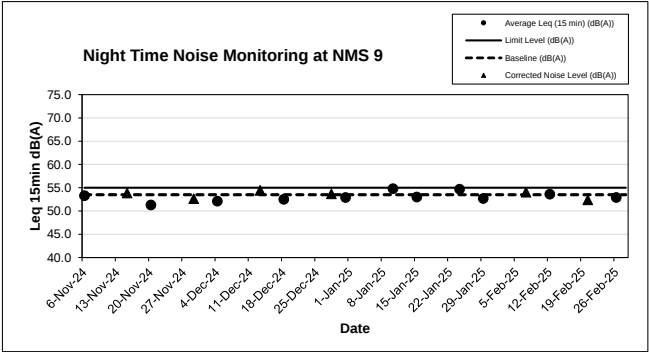

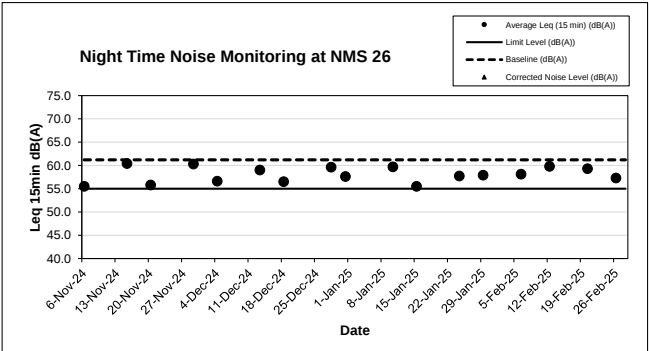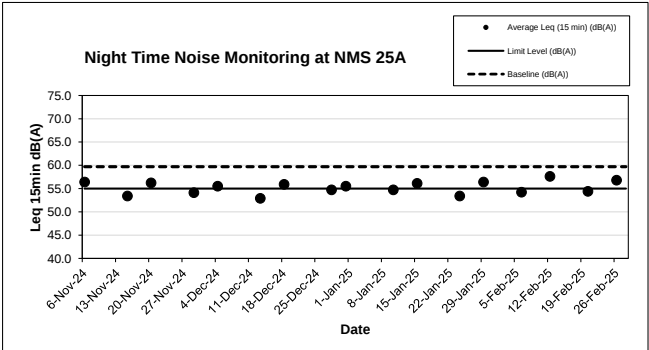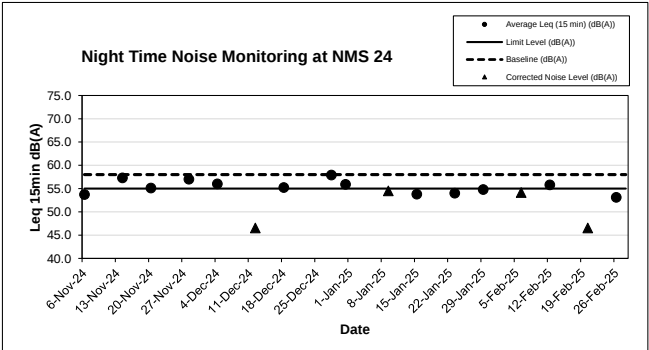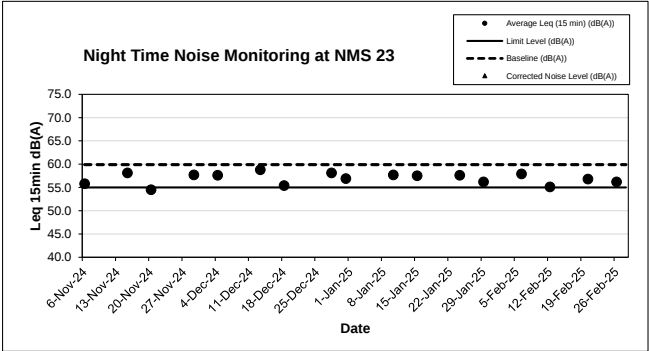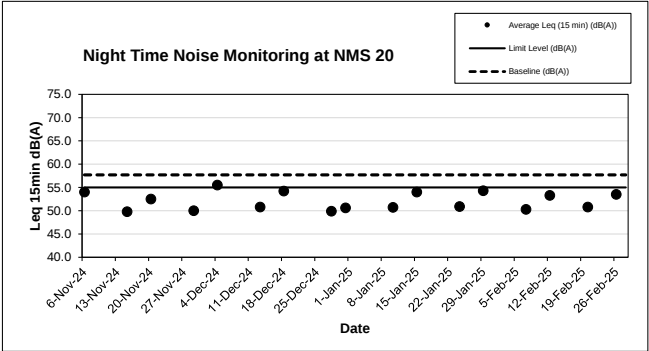

## **FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : [matlab@fugro.com](mailto:matlab@fugro.com)  
Website : [www.fugro.com](http://www.fugro.com)



### **Appendix H**

#### **Events and Action Plan**

# FUGRO TECHNICAL SERVICES LIMITED

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



## Event and Action Plan for Construction Dust Monitoring

| EVENT                                             | ACTION                                                                                                                                                                                                                                                                                                                                                                                                                                                 |                                                                                                                                                                                                                                                                                                                                                                                                  |                                                                                                                                                                                                               |                                                                                                                                                                                                                                                                                                |
|---------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
|                                                   | ET Leader                                                                                                                                                                                                                                                                                                                                                                                                                                              | IEC                                                                                                                                                                                                                                                                                                                                                                                              | SO                                                                                                                                                                                                            | Contractor                                                                                                                                                                                                                                                                                     |
| Action Level                                      |                                                                                                                                                                                                                                                                                                                                                                                                                                                        |                                                                                                                                                                                                                                                                                                                                                                                                  |                                                                                                                                                                                                               |                                                                                                                                                                                                                                                                                                |
| 1. Exceedance for one sample                      | <ol style="list-style-type: none"> <li>1. Identify the source.</li> <li>2. Inform the IEC and the SO.</li> <li>3. Repeat measurement to confirm findings.</li> <li>4. Increase monitoring frequency to daily.</li> </ol>                                                                                                                                                                                                                               | <ol style="list-style-type: none"> <li>1. Check monitoring data submitted by the ET Leader.</li> <li>2. Check Contractor's working method.</li> </ol>                                                                                                                                                                                                                                            | <ol style="list-style-type: none"> <li>1. Notify Contractor.</li> </ol>                                                                                                                                       | <ol style="list-style-type: none"> <li>1. Rectify any unacceptable practice.</li> <li>2. Amend working methods if appropriate.</li> </ol>                                                                                                                                                      |
| 2. Exceedance for two or more consecutive samples | <ol style="list-style-type: none"> <li>1. Identify the source.</li> <li>2. Inform the IEC and the SO.</li> <li>3. Repeat measurement to confirm findings.</li> <li>4. Increase monitoring frequency to daily.</li> <li>5. Discuss with the IEC and the Contractor on remedial actions required.</li> <li>6. If exceedance continues, arrange meeting with the IEC and the SO.</li> <li>7. If exceedance stops, cease additional monitoring.</li> </ol> | <ol style="list-style-type: none"> <li>1. Check monitoring data submitted by the ET Leader.</li> <li>2. Check the Contractor's working method.</li> <li>3. Discuss with the ET Leader and the Contractor on possible remedial measures.</li> <li>4. Advise the SO on the effectiveness of the proposed remedial measures.</li> <li>5. Supervisor implementation of remedial measures.</li> </ol> | <ol style="list-style-type: none"> <li>1. Confirm receipt of notification of failure in writing.</li> <li>2. Notify the Contractor.</li> <li>3. Ensure remedial measures properly implemented.</li> </ol>     | <ol style="list-style-type: none"> <li>1. Submit proposals for remedial actions to IEC within 3 working days of notification.</li> <li>2. Implement the agreed proposals.</li> <li>3. Amend proposal if appropriate.</li> </ol>                                                                |
| Limit Level                                       |                                                                                                                                                                                                                                                                                                                                                                                                                                                        |                                                                                                                                                                                                                                                                                                                                                                                                  |                                                                                                                                                                                                               |                                                                                                                                                                                                                                                                                                |
| 1. Exceedance for one sample                      | <ol style="list-style-type: none"> <li>1. Identify the source.</li> <li>2. Inform the SO and the EPD.</li> <li>3. Repeat measurement to confirm findings.</li> <li>4. Increase monitoring frequency to daily.</li> <li>5. Assess effectiveness of Contractor's remedial actions and keep the IEC, the EPD and the SO informed of the results.</li> </ol>                                                                                               | <ol style="list-style-type: none"> <li>1. Check monitoring data submitted by the ET Leader.</li> <li>2. Check Contractor's working method.</li> <li>3. Discuss with the ET Leader and the Contractor on possible remedial measures.</li> <li>4. Advise the SO on the effectiveness of the proposed remedial measures.</li> <li>5. Supervisor implementation of remedial measures.</li> </ol>     | <ol style="list-style-type: none"> <li>1. Confirm receipt of notification of failure in writing.</li> <li>2. Notify the Contractor.</li> <li>3. Ensure remedial measures are properly implemented.</li> </ol> | <ol style="list-style-type: none"> <li>1. Take immediate action to avoid further exceedance.</li> <li>2. Submit proposals for remedial actions to IEC within 3 working days of notification.</li> <li>3. Implement the agreed proposals.</li> <li>4. Amend proposal if appropriate.</li> </ol> |
| 2.                                                | 1. Notify the IEC, the SO                                                                                                                                                                                                                                                                                                                                                                                                                              | 1. Discuss amongst                                                                                                                                                                                                                                                                                                                                                                               | 1. Confirm                                                                                                                                                                                                    | 1. Take immediate                                                                                                                                                                                                                                                                              |

# FUGRO TECHNICAL SERVICES LIMITED

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| EVENT                                          | ACTION                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       |                                                                                                                                                                                                                                                                                                                    |                                                                                                                                                                                                                                                                                                                                                                                                                                                                   |                                                                                                                                                                                                                                                                                                                                                                                                |
|------------------------------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
|                                                | ET Leader                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                    | IEC                                                                                                                                                                                                                                                                                                                | SO                                                                                                                                                                                                                                                                                                                                                                                                                                                                | Contractor                                                                                                                                                                                                                                                                                                                                                                                     |
| Exceedance for two or more consecutive samples | <p>and the EPD and the Contractor.</p> <ol style="list-style-type: none"> <li>Identify the source.</li> <li>Repeat measurement to confirm findings.</li> <li>Increase monitoring frequency to daily.</li> <li>Carry out analysis of the Contractor's working procedures to determine possible mitigation to be implemented.</li> <li>Arrange meeting with the IEC and the SO to discuss the remedial actions to be taken.</li> <li>Assess effectiveness of Contractor's remedial actions and keep the IEC, the EPD and the SO informed of the results.</li> <li>If exceedance stops, cease additional monitoring.</li> </ol> | <p>the SO, ET Leader and the Contractor on the potential remedial actions.</p> <ol style="list-style-type: none"> <li>Review the Contractor's remedial actions whenever necessary to assure their effectiveness and advise the SO accordingly.</li> <li>Supervisor implementation of remedial measures.</li> </ol> | <p>receipt of notification of failure in writing.</p> <ol style="list-style-type: none"> <li>Notify the Contractor.</li> <li>In consultation with the Contractor on the remedial measures to be implemented.</li> <li>Ensure remedial measures are properly implemented.</li> <li>If exceedance continues, consider what activity of the work is responsible and instruct the Contractor to stop that activity of work until the exceedance is abated.</li> </ol> | <p>action to avoid further exceedance.</p> <ol style="list-style-type: none"> <li>Submit proposals for remedial actions to IEC within 3 working days of notification.</li> <li>Implement the agreed proposals.</li> <li>Resubmit proposals if problem still not under control.</li> <li>Stop the relevant activity of works as determined by the SO until the exceedance is abated.</li> </ol> |

## FUGRO TECHNICAL SERVICES LIMITED

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



### Event and Action Plan for Noise Impact

| EVENT        | ACTION                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                           |                                                                                                                                                                                                                                                                                                                                                      |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  |                                                                                                                                                                                                                                                                                                                                                                                                                              |
|--------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
|              | ET Leader                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        | IEC                                                                                                                                                                                                                                                                                                                                                  | SO                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               | Contractor                                                                                                                                                                                                                                                                                                                                                                                                                   |
| Action Level | <ol style="list-style-type: none"> <li>1. Notify the IEC and the Contractor.</li> <li>2. Carry out investigation.</li> <li>3. Report the results of investigation to the IEC.</li> <li>4. Discuss with the Contractor and formulate remedial measures.</li> <li>5. Increase monitoring frequency to check mitigation effectiveness.</li> </ol>                                                                                                                                                                                                                                                                                                   | <ol style="list-style-type: none"> <li>1. Review the analysed results submitted by the ET.</li> <li>2. Review the proposed remedial measures by the Contractor and advise the SO accordingly.</li> <li>3. Supervise the implementation of remedial measures.</li> </ol>                                                                              | <ol style="list-style-type: none"> <li>1. Confirm receipt of notification of failure in writing.</li> <li>2. Notify the Contractor.</li> <li>3. Require the Contractor to propose remedial measures for the analysed noise problem.</li> <li>4. Ensure remedial measures are properly implemented.</li> </ol>                                                                                                                                                                                    | <ol style="list-style-type: none"> <li>1. Submit noise mitigation proposals to IEC.</li> <li>2. Implement noise mitigation proposals.</li> </ol>                                                                                                                                                                                                                                                                             |
| Limit Level  | <ol style="list-style-type: none"> <li>1. Notify the IEC, the SO and the Contractor.</li> <li>2. Identify the source.</li> <li>3. Repeat measurement to confirm findings.</li> <li>4. Increase monitoring frequency.</li> <li>5. Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented.</li> <li>6. Inform the IEC, the SO and the EPD the causes &amp; actions taken for the exceedance.</li> <li>7. Assess effectiveness if the Contractor's remedial actions and keep the IEC and the SO informed of the results.</li> <li>8. If exceedance stops, cease additional monitoring.</li> </ol> | <ol style="list-style-type: none"> <li>1. Discuss amongst the SO, the ET Leader and the Contractor on the potential remedial actions.</li> <li>2. Review the Contractor's remedial actions whenever necessary to assure their effectiveness and advise the SO accordingly.</li> <li>3. Supervise the implementation of remedial measures.</li> </ol> | <ol style="list-style-type: none"> <li>1. Confirm receipt of notification of failure in writing.</li> <li>2. Notify the Contractor.</li> <li>3. Require the Contractor to propose remedial measures for the analysed noise problem.</li> <li>4. Ensure remedial measures are properly implemented.</li> <li>5. If exceedance continues, consider what activities of the work is responsible and instruct the Contractor to stop that activity of work until the exceedance is abated.</li> </ol> | <ol style="list-style-type: none"> <li>1. Take immediate action to avoid further exceedance.</li> <li>2. Submit proposals for remedial actions to IEC within 3 working days of notification.</li> <li>3. Implement the agreed proposals</li> <li>4. Resubmit proposals if problem still not under control</li> <li>5. Stop the relevant activity of works as determined by the SO until the exceedance is abated.</li> </ol> |

## FUGRO TECHNICAL SERVICES LIMITED

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



### Event and Action Plan for Landscape and Visual Impact

| Event                          | Action                                                                                                                                                                                                                                                                                                                                                                      |                                                                                                                                         |                                                                                                                                              |
|--------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------|
|                                | ET                                                                                                                                                                                                                                                                                                                                                                          | SO                                                                                                                                      | Contractor                                                                                                                                   |
| Non-conformity on one occasion | <ol style="list-style-type: none"><li>1. Identify Source;</li><li>2. Inform the Contractor and the SO;</li><li>3. Discuss remedial actions with the SO and the Contractor; and</li><li>4. Monitor remedial actions until rectification has been completed</li></ol>                                                                                                         | <ol style="list-style-type: none"><li>1. Notify Contractor; and</li><li>2. Ensure remedial measures are properly implemented.</li></ol> | <ol style="list-style-type: none"><li>1. Amend working methods;</li><li>2. Rectify damage and undertake any necessary replacement.</li></ol> |
| Repeated Non-conformity        | <ol style="list-style-type: none"><li>1. Identify Source;</li><li>2. Inform the Contractor and the SO;</li><li>3. Increase monitoring frequency;</li><li>4. Discuss remedial actions with the SO and the Contractor;</li><li>5. Monitor remedial actions until rectification has been completed; and</li><li>6. If exceedance stops, cease additional monitoring.</li></ol> | <ol style="list-style-type: none"><li>1. Notify Contractor; and</li><li>2. Ensure remedial measures are properly implemented.</li></ol> | <ol style="list-style-type: none"><li>1. Amend working methods;</li><li>2. Rectify damage and undertake any necessary replacement.</li></ol> |

## **FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : [matlab@fugro.com](mailto:matlab@fugro.com)  
Website : [www.fugro.com](http://www.fugro.com)



### **Appendix I**

#### **Waste Flow Table**

# FUGRO TECHNICAL SERVICES LIMITED

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com

## Waste Flow Table for Year 2018

| Monthly Ending | Actual Quantities of Inert C&D Materials Generated Monthly |                                     |                        |                          |                         |               | Actual Quantities of Non-inert C&D Wastes Generated Monthly |                            |                       |                |                              |
|----------------|------------------------------------------------------------|-------------------------------------|------------------------|--------------------------|-------------------------|---------------|-------------------------------------------------------------|----------------------------|-----------------------|----------------|------------------------------|
|                | Total Quantity Generated (Inert C&D)                       | Hard Rock and Large Broken Concrete | Reused in the Contract | Reused in other Projects | Disposed as Public Fill | Imported Fill | Metals                                                      | Paper/ cardboard packaging | Plastics (see Note 2) | Chemical Waste | Others, e.g., general refuse |
|                | (in '000Ton)                                               | (in '000kg)                         | (in '000Ton)           | (in '000Ton)             | (in '000Ton)            | (in '000Ton)  | (in '000 kg)                                                | (in '000kg)                | (in '000kg)           | (in '000kg)    | (in '000Ton)                 |
| 2018 Jan       | 0.000                                                      | 0.000                               | 0.000                  | 0.000                    | 0.000                   | 0.000         | 0.000                                                       | 0.000                      | 0.000                 | 0.000          | 0.000                        |
| 2018 Feb       | 0.000                                                      | 0.000                               | 0.000                  | 0.000                    | 0.000                   | 0.000         | 0.000                                                       | 0.000                      | 0.000                 | 0.000          | 0.000                        |
| 2018 Mar       | 0.000                                                      | 0.000                               | 0.000                  | 0.000                    | 0.000                   | 0.000         | 0.000                                                       | 0.000                      | 0.000                 | 0.000          | 0.000                        |
| 2018 Apr       | 0.000                                                      | 0.000                               | 0.000                  | 0.000                    | 0.000                   | 0.000         | 0.000                                                       | 0.000                      | 0.000                 | 0.000          | 0.000                        |
| 2018 May       | 0.000                                                      | 0.000                               | 0.000                  | 0.000                    | 0.000                   | 0.000         | 0.000                                                       | 0.000                      | 0.000                 | 0.000          | 0.000                        |
| 2018 Jun       | 0.000                                                      | 0.000                               | 0.000                  | 0.000                    | 0.000                   | 0.000         | 0.000                                                       | 0.000                      | 0.000                 | 0.000          | 0.000                        |
| Sub-Total      | 0.000                                                      | 0.000                               | 0.000                  | 0.000                    | 0.000                   | 0.000         | 0.000                                                       | 0.000                      | 0.000                 | 0.000          | 0.000                        |
| 2018 Jul       | 0.000                                                      | 0.000                               | 0.000                  | 0.000                    | 0.000                   | 0.000         | 0.000                                                       | 0.000                      | 0.000                 | 0.000          | 0.000                        |
| 2018 Aug       | 0.000                                                      | 0.000                               | 0.000                  | 0.000                    | 0.000                   | 0.000         | 0.000                                                       | 0.000                      | 0.000                 | 0.000          | 0.000                        |
| 2018 Sep       | 0.000                                                      | 0.000                               | 0.000                  | 0.000                    | 0.000                   | 0.000         | 0.000                                                       | 0.000                      | 0.000                 | 0.000          | 0.000                        |
| 2018 Oct       | 0.000                                                      | 0.000                               | 0.000                  | 0.000                    | 0.000                   | 0.000         | 0.000                                                       | 0.000                      | 0.000                 | 0.000          | 0.013                        |
| 2018 Nov       | 0.000                                                      | 0.000                               | 0.000                  | 0.000                    | 0.000                   | 0.000         | 0.000                                                       | 0.000                      | 0.000                 | 0.000          | 0.004                        |
| 2018 Dec       | 0.001                                                      | 0.000                               | 0.000                  | 0.000                    | 0.001                   | 0.000         | 0.000                                                       | 0.000                      | 0.000                 | 0.000          | 0.001                        |
| Total          | 0.001                                                      | 0.000                               | 0.000                  | 0.000                    | 0.001                   | 0.000         | 0.000                                                       | 0.000                      | 0.000                 | 0.000          | 0.018                        |

Note:

- 1) The waste flow table shall also include C&D materials that are specified in the Contract to be imported for use at the Site.
- 2) Plastics refer to plastic bottles/containers, plastic sheets/foam from packaging materials.
- 3) The Contractor shall also submit the latest forecast of the total amount of C&D materials expected to be generated from the Works, together with a breakdown of the nature where the total amount of C&D materials expected to be generated from the Works is equal to or exceeding 50,000 m<sup>3</sup>.

## FUGRO TECHNICAL SERVICES LIMITED

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com

### Waste Flow Table for Year 2019

| Monthly Ending | Actual Quantities of Inert C&D Materials Generated Monthly |                                     |                        |                          |                         |               | Actual Quantities of Non-inert C&D Wastes Generated Monthly |                            |                       |                |                              |
|----------------|------------------------------------------------------------|-------------------------------------|------------------------|--------------------------|-------------------------|---------------|-------------------------------------------------------------|----------------------------|-----------------------|----------------|------------------------------|
|                | Total Quantity Generated (Inert C&D)                       | Hard Rock and Large Broken Concrete | Reused in the Contract | Reused in other Projects | Disposed as Public Fill | Imported Fill | Metals                                                      | Paper/ cardboard packaging | Plastics (see Note 2) | Chemical Waste | Others, e.g., general refuse |
|                | (in '000Ton)                                               | (in '000kg)                         | (in '000Ton)           | (in '000Ton)             | (in '000Ton)            | (in '000Ton)  | (in '000 kg)                                                | (in '000kg)                | (in '000kg)           | (in '000kg)    | (in '000Ton)                 |
| 2019 Jan       | 0.000                                                      | 0.000                               | 0.000                  | 0.000                    | 0.000                   | 0.000         | 0.000                                                       | 0.000                      | 0.000                 | 0.000          | 0.021                        |
| 2019 Feb       | 0.000                                                      | 0.000                               | 0.000                  | 0.000                    | 0.000                   | 0.000         | 0.000                                                       | 0.000                      | 0.000                 | 0.000          | 0.049                        |
| 2019 Mar       | 0.000                                                      | 0.000                               | 0.000                  | 0.000                    | 0.000                   | 0.000         | 0.000                                                       | 0.000                      | 0.000                 | 0.000          | 0.048                        |
| 2019 Apr       | 0.100                                                      | 0.000                               | 0.000                  | 0.000                    | 0.100                   | 0.000         | 0.000                                                       | 0.000                      | 0.000                 | 0.000          | 0.089                        |
| 2019 May       | 0.150                                                      | 0.000                               | 0.000                  | 0.000                    | 0.150                   | 0.000         | 0.000                                                       | 0.000                      | 0.000                 | 0.000          | 0.175                        |
| 2019 Jun       | 0.000                                                      | 0.000                               | 0.000                  | 0.000                    | 0.000                   | 0.000         | 0.000                                                       | 0.000                      | 0.000                 | 0.000          | 0.082                        |
| Sub-Total      | 0.250                                                      | 0.000                               | 0.000                  | 0.000                    | 0.250                   | 0.000         | 0.000                                                       | 0.000                      | 0.000                 | 0.000          | 0.464                        |
| 2019 Jul       | 0.141                                                      | 0.000                               | 0.000                  | 0.000                    | 0.141                   | 0.000         | 0.000                                                       | 0.000                      | 0.000                 | 0.000          | 0.069                        |
| 2019 Aug       | 0.431                                                      | 0.000                               | 0.221                  | 0.000                    | 0.210                   | 0.000         | 0.000                                                       | 0.000                      | 0.000                 | 0.000          | 0.154                        |
| 2019 Sep       | 0.712                                                      | 0.000                               | 0.223                  | 0.000                    | 0.489                   | 0.297         | 0.000                                                       | 0.000                      | 0.000                 | 0.000          | 0.046                        |
| 2019 Oct       | 0.663                                                      | 0.000                               | 0.306                  | 0.000                    | 0.357                   | 1.085         | 0.001                                                       | 0.027                      | 0.009                 | 0.000          | 0.027                        |
| 2019 Nov       | 1.154                                                      | 0.000                               | 0.143                  | 0.000                    | 1.011                   | 0.428         | 0.000                                                       | 0.019                      | 0.000                 | 0.000          | 0.095                        |
| 2019 Dec       | 0.849                                                      | 0.000                               | 0.023                  | 0.000                    | 0.826                   | 0.074         | 0.000                                                       | 0.014                      | 0.001                 | 0.000          | 0.034                        |
| Total          | 4.200                                                      | 0.000                               | 0.916                  | 0.000                    | 3.284                   | 1.884         | 0.001                                                       | 0.060                      | 0.010                 | 0.000          | 0.889                        |

Note:

- 1) The waste flow table shall also include C&D materials that are specified in the Contract to be imported for use at the Site.
- 2) Plastics refer to plastic bottles/containers, plastic sheets/foam from packaging materials.
- 3) The Contractor shall also submit the latest forecast of the total amount of C&D materials expected to be generated from the Works, together with a breakdown of the nature where the total amount of C&D materials expected to be generated from the Works is equal to or exceeding 50,000 m<sup>3</sup>.

## FUGRO TECHNICAL SERVICES LIMITED

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com

### Waste Flow Table for Year 2020

| Monthly Ending | Actual Quantities of Inert C&D Materials Generated Monthly |                                     |                        |                          |                         |               | Actual Quantities of Non-inert C&D Wastes Generated Monthly |                            |                       |                |                              |
|----------------|------------------------------------------------------------|-------------------------------------|------------------------|--------------------------|-------------------------|---------------|-------------------------------------------------------------|----------------------------|-----------------------|----------------|------------------------------|
|                | Total Quantity Generated (Inert C&D)                       | Hard Rock and Large Broken Concrete | Reused in the Contract | Reused in other Projects | Disposed as Public Fill | Imported Fill | Metals                                                      | Paper/ cardboard packaging | Plastics (see Note 2) | Chemical Waste | Others, e.g., general refuse |
|                | (in '000Ton)                                               | (in '000kg)                         | (in '000Ton)           | (in '000Ton)             | (in '000Ton)            | (in '000Ton)  | (in '000 kg)                                                | (in '000kg)                | (in '000kg)           | (in '000kg)    | (in '000Ton)                 |
| 2020 Jan       | 0.584                                                      | 0.000                               | 0.027                  | 0.000                    | 0.557                   | 0.040         | 0.001                                                       | 0.030                      | 0.001                 | 0.000          | 0.039                        |
| 2020 Feb       | 1.072                                                      | 0.000                               | 0.042                  | 0.000                    | 1.030                   | 0.000         | 0.001                                                       | 0.026                      | 0.003                 | 0.000          | 0.013                        |
| 2020 Mar       | 0.422                                                      | 0.000                               | 0.006                  | 0.000                    | 0.416                   | 0.062         | 0.000                                                       | 0.000                      | 0.000                 | 0.000          | 0.054                        |
| 2020 Apr       | 0.450                                                      | 0.000                               | 0.000                  | 0.000                    | 0.450                   | 0.000         | 0.002                                                       | 0.085                      | 0.003                 | 0.000          | 0.025                        |
| 2020 May       | 1.144                                                      | 0.000                               | 0.000                  | 0.000                    | 1.144                   | 0.319         | 0.001                                                       | 0.021                      | 0.005                 | 0.000          | 0.027                        |
| 2020 Jun       | 3.660                                                      | 0.000                               | 0.000                  | 0.000                    | 3.660                   | 0.077         | 0.001                                                       | 0.027                      | 0.004                 | 0.000          | 0.048                        |
| Sub-Total      | 7.332                                                      | 0.000                               | 0.075                  | 0.000                    | 7.257                   | 0.498         | 0.006                                                       | 0.189                      | 0.016                 | 0.000          | 0.206                        |
| 2020 Jul       | 2.008                                                      | 0.000                               | 0.014                  | 0.000                    | 1.994                   | 0.000         | 0.002                                                       | 0.047                      | 0.006                 | 0.000          | 0.067                        |
| 2020 Aug       | 2.215                                                      | 0.000                               | 0.018                  | 0.000                    | 2.197                   | 0.000         | 0.001                                                       | 0.040                      | 0.006                 | 0.000          | 0.014                        |
| 2020 Sep       | 4.305                                                      | 0.000                               | 0.000                  | 0.000                    | 4.305                   | 0.000         | 0.002                                                       | 0.042                      | 0.009                 | 0.000          | 0.044                        |
| 2020 Oct       | 3.073                                                      | 0.000                               | 0.002                  | 0.000                    | 3.071                   | 0.000         | 0.001                                                       | 0.019                      | 0.005                 | 0.000          | 0.029                        |
| 2020 Nov       | 1.670                                                      | 0.000                               | 0.000                  | 0.000                    | 1.670                   | 0.000         | 0.001                                                       | 0.030                      | 0.006                 | 0.000          | 0.036                        |
| 2020 Dec       | 3.498                                                      | 0.000                               | 0.000                  | 0.000                    | 3.498                   | 0.000         | 24.751                                                      | 0.036                      | 0.006                 | 0.000          | 0.042                        |
| Total          | 24.101                                                     | 0.000                               | 0.109                  | 0.000                    | 23.992                  | 0.498         | 24.764                                                      | 0.403                      | 0.054                 | 0.000          | 0.438                        |

Note:

- 1) The waste flow table shall also include C&D materials that are specified in the Contract to be imported for use at the Site.
- 2) Plastics refer to plastic bottles/containers, plastic sheets/foam from packaging materials.
- 3) The Contractor shall also submit the latest forecast of the total amount of C&D materials expected to be generated from the Works, together with a breakdown of the nature where the total amount of C&D materials expected to be generated from the Works is equal to or exceeding 50,000 m<sup>3</sup>.

# FUGRO TECHNICAL SERVICES LIMITED

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com

## Waste Flow Table for Year 2021

| Monthly Ending | Actual Quantities of Inert C&D Materials Generated Monthly |                                     |                        |                          |                         |               | Actual Quantities of Non-inert C&D Wastes Generated Monthly |                            |                       |                |                              |
|----------------|------------------------------------------------------------|-------------------------------------|------------------------|--------------------------|-------------------------|---------------|-------------------------------------------------------------|----------------------------|-----------------------|----------------|------------------------------|
|                | Total Quantity Generated (Inert C&D)                       | Hard Rock and Large Broken Concrete | Reused in the Contract | Reused in other Projects | Disposed as Public Fill | Imported Fill | Metals                                                      | Paper/ cardboard packaging | Plastics (see Note 2) | Chemical Waste | Others, e.g., general refuse |
|                | (in '000Ton)                                               | (in '000kg)                         | (in '000Ton)           | (in '000Ton)             | (in '000Ton)            | (in '000Ton)  | (in '000 kg)                                                | (in '000kg)                | (in '000kg)           | (in '000kg)    | (in '000Ton)                 |
| 2021 Jan       | 3.196                                                      | 0.000                               | 0.000                  | 0.000                    | 3.196                   | 0.000         | 0.001                                                       | 0.048                      | 0.855                 | 0.000          | 0.053                        |
| 2021 Feb       | 3.877                                                      | 0.000                               | 0.000                  | 0.000                    | 3.877                   | 0.032         | 0.000                                                       | 0.010                      | 1.642                 | 0.000          | 0.013                        |
| 2021 Mar       | 7.348                                                      | 0.000                               | 0.000                  | 0.000                    | 7.348                   | 0.000         | 0.001                                                       | 0.215                      | 0.004                 | 0.000          | 0.050                        |
| 2021 Apr       | 3.302                                                      | 0.000                               | 0.000                  | 0.000                    | 3.302                   | 0.100         | 0.002                                                       | 0.013                      | 0.004                 | 0.000          | 0.050                        |
| 2021 May       | 2.315                                                      | 0.000                               | 0.150                  | 0.000                    | 2.165                   | 0.024         | 0.001                                                       | 0.008                      | 0.005                 | 0.000          | 0.106                        |
| 2021 Jun       | 1.809                                                      | 0.000                               | 0.307                  | 0.000                    | 1.502                   | 0.059         | 0.000                                                       | 0.000                      | 0.000                 | 0.000          | 0.029                        |
| Sub-Total      | 21.847                                                     | 0.000                               | 0.457                  | 0.000                    | 21.390                  | 0.215         | 0.005                                                       | 0.294                      | 2.510                 | 0.000          | 0.301                        |
| 2021 Jul       | 2.693                                                      | 0.000                               | 0.019                  | 0.000                    | 2.674                   | 0.262         | 0.003                                                       | 0.011                      | 0.007                 | 0.000          | 0.119                        |
| 2021 Aug       | 3.088                                                      | 0.000                               | 0.000                  | 0.000                    | 3.088                   | 0.095         | 0.002                                                       | 0.007                      | 0.011                 | 0.000          | 0.071                        |
| 2021 Sep       | 1.698                                                      | 0.000                               | 0.000                  | 0.000                    | 1.698                   | 0.000         | 0.001                                                       | 0.004                      | 0.003                 | 0.000          | 0.049                        |
| 2021 Oct       | 1.500                                                      | 0.000                               | 0.000                  | 0.000                    | 1.500                   | 0.279         | 0.002                                                       | 0.003                      | 0.005                 | 0.000          | 0.021                        |
| 2021 Nov       | 3.258                                                      | 0.000                               | 0.000                  | 0.000                    | 3.258                   | 0.015         | 0.002                                                       | 0.009                      | 0.007                 | 0.000          | 0.070                        |
| 2021 Dec       | 1.935                                                      | 0.000                               | 0.000                  | 0.000                    | 1.935                   | 0.000         | 0.002                                                       | 0.003                      | 0.002                 | 0.000          | 0.035                        |
| Total          | 36.019                                                     | 0.000                               | 0.476                  | 0.000                    | 35.543                  | 0.866         | 0.017                                                       | 0.331                      | 2.545                 | 0.000          | 0.666                        |

Note:

- 1) The waste flow table shall also include C&D materials that are specified in the Contract to be imported for use at the Site.
- 2) Plastics refer to plastic bottles/containers, plastic sheets/foam from packaging materials.
- 3) The Contractor shall also submit the latest forecast of the total amount of C&D materials expected to be generated from the Works, together with a breakdown of the nature where the total amount of C&D materials expected to be generated from the Works is equal to or exceeding 50,000 m<sup>3</sup>.

## FUGRO TECHNICAL SERVICES LIMITED

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com

### Waste Flow Table for Year 2022

| Monthly Ending | Actual Quantities of Inert C&D Materials Generated Monthly |                                     |                        |                          |                         |               | Actual Quantities of Non-inert C&D Wastes Generated Monthly |                            |                       |                |                              |
|----------------|------------------------------------------------------------|-------------------------------------|------------------------|--------------------------|-------------------------|---------------|-------------------------------------------------------------|----------------------------|-----------------------|----------------|------------------------------|
|                | Total Quantity Generated (Inert C&D)                       | Hard Rock and Large Broken Concrete | Reused in the Contract | Reused in other Projects | Disposed as Public Fill | Imported Fill | Metals                                                      | Paper/ cardboard packaging | Plastics (see Note 2) | Chemical Waste | Others, e.g., general refuse |
|                | (in '000Ton)                                               | (in '000kg)                         | (in '000Ton)           | (in '000Ton)             | (in '000Ton)            | (in '000Ton)  | (in '000 kg)                                                | (in '000kg)                | (in '000kg)           | (in '000kg)    | (in '000Ton)                 |
| 2022 Jan       | 1.815                                                      | 0.000                               | 0.064                  | 0.000                    | 1.751                   | 0.097         | 20.640                                                      | 0.000                      | 0.000                 | 0.000          | 0.410                        |
| 2022 Feb       | 2.401                                                      | 0.000                               | 0.045                  | 0.000                    | 2.356                   | 0.000         | 0.002                                                       | 0.004                      | 0.004                 | 0.000          | 0.014                        |
| 2022 Mar       | 3.039                                                      | 0.000                               | 0.000                  | 0.000                    | 3.039                   | 0.037         | 0.000                                                       | 0.000                      | 0.000                 | 0.000          | 0.026                        |
| 2022 Apr       | 6.023                                                      | 0.000                               | 0.000                  | 0.000                    | 6.023                   | 0.030         | 0.001                                                       | 0.419                      | 0.005                 | 0.000          | 0.064                        |
| 2022 May       | 10.291                                                     | 0.000                               | 0.000                  | 0.000                    | 10.291                  | 0.159         | 0.001                                                       | 0.011                      | 0.003                 | 0.000          | 0.042                        |
| 2022 Jun       | 5.469                                                      | 0.000                               | 0.000                  | 0.000                    | 5.469                   | 0.187         | 0.000                                                       | 0.000                      | 0.000                 | 0.000          | 0.074                        |
| Sub-Total      | 29.038                                                     | 0.000                               | 0.109                  | 0.000                    | 28.929                  | 0.510         | 20.644                                                      | 0.434                      | 0.012                 | 0.000          | 0.630                        |
| 2022 Jul       | 3.136                                                      | 0.000                               | 0.000                  | 0.000                    | 3.136                   | 0.476         | 0.001                                                       | 0.013                      | 0.003                 | 0.000          | 0.141                        |
| 2022 Aug       | 4.111                                                      | 0.000                               | 0.000                  | 0.000                    | 4.111                   | 0.431         | 6.871                                                       | 0.373                      | 0.010                 | 0.000          | 0.088                        |
| 2022 Sep       | 7.15                                                       | 0.000                               | 0.000                  | 0.000                    | 7.150                   | 0.634         | 13.280                                                      | 0.000                      | 0.000                 | 0.000          | 0.062                        |
| 2022 Oct       | 8.33                                                       | 0.000                               | 0.000                  | 0.000                    | 8.330                   | 1.896         | 0.001                                                       | 0.008                      | 0.003                 | 0.000          | 0.070                        |
| 2022 Nov       | 5.581                                                      | 0.000                               | 0.000                  | 0.000                    | 5.581                   | 1.174         | 0.001                                                       | 0.008                      | 0.006                 | 0.000          | 0.074                        |
| 2022 Dec       | 6.787                                                      | 0.000                               | 0.000                  | 0.000                    | 6.787                   | 1.134         | 0.001                                                       | 0.003                      | 0.001                 | 0.000          | 0.080                        |
| Total          | 64.133                                                     | 0.000                               | 0.109                  | 0.000                    | 64.024                  | 6.255         | 40.799                                                      | 0.839                      | 0.035                 | 0.000          | 1.145                        |

Note:

- 1) The waste flow table shall also include C&D materials that are specified in the Contract to be imported for use at the Site.
- 2) Plastics refer to plastic bottles/containers, plastic sheets/foam from packaging materials.
- 3) The Contractor shall also submit the latest forecast of the total amount of C&D materials expected to be generated from the Works, together with a breakdown of the nature where the total amount of C&D materials expected to be generated from the Works is equal to or exceeding 50,000 m<sup>3</sup>.

# FUGRO TECHNICAL SERVICES LIMITED

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com

## Waste Flow Table for Year 2023

| Monthly Ending | Actual Quantities of Inert C&D Materials Generated Monthly |                                     |                        |                          |                         |               | Actual Quantities of Non-inert C&D Wastes Generated Monthly |                            |                       |                |                              |
|----------------|------------------------------------------------------------|-------------------------------------|------------------------|--------------------------|-------------------------|---------------|-------------------------------------------------------------|----------------------------|-----------------------|----------------|------------------------------|
|                | Total Quantity Generated (Inert C&D)                       | Hard Rock and Large Broken Concrete | Reused in the Contract | Reused in other Projects | Disposed as Public Fill | Imported Fill | Metals                                                      | Paper/ cardboard packaging | Plastics (see Note 2) | Chemical Waste | Others, e.g., general refuse |
|                | (in '000Ton)                                               | (in '000kg)                         | (in '000Ton)           | (in '000Ton)             | (in '000Ton)            | (in '000Ton)  | (in '000 kg)                                                | (in '000kg)                | (in '000kg)           | (in '000kg)    | (in '000Ton)                 |
| 2023 Jan       | 4.592                                                      | 0.000                               | 0.000                  | 0.000                    | 4.592                   | 0.322         | 0.000                                                       | 0.002*                     | 0.002                 | 0.000          | 0.067                        |
| 2023 Feb       | 6.448                                                      | 0.000                               | 0.000                  | 0.000                    | 6.448                   | 0.500         | 0.001                                                       | 0.281                      | 0.003                 | 0.000          | 0.055                        |
| 2023 Mar       | 8.344                                                      | 0.000                               | 0.000                  | 0.000                    | 8.344                   | 0.579         | 0.001                                                       | 0.338                      | 0.050                 | 0.000          | 1.390                        |
| 2023 Apr       | 5.538                                                      | 0.000                               | 0.000                  | 0.000                    | 5.538                   | 1.625         | 0.001                                                       | 0.220                      | 0.005                 | 0.000          | 0.935                        |
| 2023 May       | 6.803                                                      | 0.000                               | 0.000                  | 0.000                    | 6.803                   | 1.544         | 0.001                                                       | 0.000                      | 0.002                 | 0.000          | 0.073                        |
| 2023 Jun       | 8.089                                                      | 0.000                               | 0.000                  | 0.000                    | 8.089                   | 0.142         | 0.002                                                       | 0.183                      | 0.002                 | 0.000          | 0.192                        |
| Sub-Total      | 39.814                                                     | 0.000                               | 0.000                  | 0.000                    | 39.814                  | 4.712         | 0.006                                                       | 1.022                      | 0.064                 | 0.000          | 2.712                        |
| 2023 Jul       | 9.764                                                      | 0.000                               | 0.000                  | 0.000                    | 9.764                   | 0.041         | 0.001                                                       | 0.200                      | 0.004                 | 0.000          | 0.144                        |
| 2023 Aug       | 8.484                                                      | 0.000                               | 0.000                  | 0.000                    | 8.484                   | 0.246         | 0.001                                                       | 0.173                      | 0.007                 | 0.000          | 0.139                        |
| 2023 Sep       | 5.913                                                      | 0.000                               | 0.000                  | 0.000                    | 5.913                   | 0.010         | 0.001                                                       | 0.002                      | 0.005                 | 0.000          | 0.120                        |
| 2023 Oct       | 10.667                                                     | 0.000                               | 0.000                  | 0.000                    | 10.667                  | 0.000         | 0.000                                                       | 0.177                      | 0.000                 | 0.000          | 0.139                        |
| 2023 Nov       | 11.660                                                     | 0.000                               | 0.000                  | 0.000                    | 11.660                  | 0.000         | 0.001                                                       | 0.014                      | 0.009                 | 0.000          | 0.102                        |
| 2023 Dec       | 12.737                                                     | 0.000                               | 0.000                  | 0.000                    | 12.737                  | 0.000         | 0.000                                                       | 0.000                      | 0.000                 | 0.000          | 0.115                        |
| Total          | 99.039                                                     | 0.000                               | 0.000                  | 0.000                    | 99.039                  | 5.009         | 0.010                                                       | 1.574                      | 0.089                 | 0.000          | 3.356                        |

Note:

- 1) The waste flow table shall also include C&D materials that are specified in the Contract to be imported for use at the Site.
- 2) Plastics refer to plastic bottles/containers, plastic sheets/foam from packaging materials.
- 3) The Contractor shall also submit the latest forecast of the total amount of C&D materials expected to be generated from the Works, together with a breakdown of the nature where the total amount of C&D materials expected to be generated from the Works is equal to or exceeding 50,000 m3.

# FUGRO TECHNICAL SERVICES LIMITED

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com

## Waste Flow Table for Year 2024

| Monthly Ending | Actual Quantities of Inert C&D Materials Generated Monthly |                                     |                        |                          |                         |               | Actual Quantities of Non-inert C&D Wastes Generated Monthly |                            |                       |                |                              |
|----------------|------------------------------------------------------------|-------------------------------------|------------------------|--------------------------|-------------------------|---------------|-------------------------------------------------------------|----------------------------|-----------------------|----------------|------------------------------|
|                | Total Quantity Generated (Inert C&D)                       | Hard Rock and Large Broken Concrete | Reused in the Contract | Reused in other Projects | Disposed as Public Fill | Imported Fill | Metals                                                      | Paper/ cardboard packaging | Plastics (see Note 2) | Chemical Waste | Others, e.g., general refuse |
|                | (in '000Ton)                                               | (in '000kg)                         | (in '000Ton)           | (in '000Ton)             | (in '000Ton)            | (in '000Ton)  | (in '000 kg)                                                | (in '000kg)                | (in '000kg)           | (in '000kg)    | (in '000Ton)                 |
| 2024 Jan       | 7.467                                                      | 0.000                               | 0.000                  | 0.000                    | 7.467                   | 0.368         | 0.002                                                       | 0.203                      | 0.009                 | 0.000          | 0.071                        |
| 2024 Feb       | 10.629                                                     | 0.000                               | 0.000                  | 0.000                    | 10.629                  | 0.388         | 0.001                                                       | 0.227                      | 0.006                 | 0.000          | 0.099                        |
| 2024 Mar       | 6.250                                                      | 0.000                               | 0.000                  | 0.000                    | 6.250                   | 0.647         | 0.000                                                       | 0.000                      | 0.000                 | 0.000          | 0.585                        |
| 2024 Apr       | 9.962                                                      | 0.000                               | 0.000                  | 0.000                    | 9.962                   | 0.000         | 0.000                                                       | 0.000                      | 0.000                 | 0.000          | 0.135                        |
| 2024 May       | 5.083                                                      | 0.000                               | 0.000                  | 0.000                    | 5.083                   | 0.000         | 0.000                                                       | 0.155                      | 0.000                 | 0.000          | 0.163                        |
| 2024 Jun       | 4.247                                                      | 0.000                               | 0.000                  | 0.000                    | 4.247                   | 0.000         | 0.003                                                       | 0.171                      | 0.006                 | 0.000          | 0.198                        |
| Sub-Total      | 43.638                                                     | 0.000                               | 0.000                  | 0.000                    | 43.638                  | 1.403         | 0.006                                                       | 0.756                      | 0.021                 | 0.000          | 1.250*                       |
| 2024 Jul       | 1.911                                                      | 0.000                               | 0.000                  | 0.000                    | 1.911                   | 0.000         | 0.000                                                       | 0.000                      | 0.000                 | 0.000          | 0.110                        |
| 2024 Aug       | 0.864                                                      | 0.000                               | 0.000                  | 0.000                    | 0.864                   | 0.000         | 0.001                                                       | 0.231                      | 0.004                 | 0.000          | 0.088                        |
| 2024 Sep       | 0.056                                                      | 0.000                               | 0.000                  | 0.000                    | 0.056                   | 0.000         | 0.000                                                       | 0.180                      | 0.000                 | 0.000          | 0.055                        |
| 2024 Oct       | 0.434                                                      | 0.000                               | 0.000                  | 0.000                    | 0.434                   | 0.231         | 0.000                                                       | 0.000                      | 0.000                 | 0.000          | 0.090                        |
| 2024 Nov       | 0.255                                                      | 0.000                               | 0.000                  | 0.000                    | 0.255                   | 0.056         | 0.000                                                       | 0.000                      | 0.000                 | 0.000          | 0.051                        |
| 2024 Dec       | 1.485                                                      | 0.000                               | 0.000                  | 0.000                    | 1.485                   | 0.000         | 0.000                                                       | 0.136                      | 0.000                 | 0.000          | 0.153                        |
| Total          | 48.643                                                     | 0.000                               | 0.000                  | 0.000                    | 48.643                  | 1.690         | 0.007                                                       | 1.303                      | 0.025                 | 0.000          | 1.796*                       |

Note:

- 1) The waste flow table shall also include C&D materials that are specified in the Contract to be imported for use at the Site.
- 2) Plastics refer to plastic bottles/containers, plastic sheets/foam from packaging materials.
- 3) The Contractor shall also submit the latest forecast of the total amount of C&D materials expected to be generated from the Works, together with a breakdown of the nature where the total amount of C&D materials expected to be generated from the Works is equal to or exceeding 50,000 m3.
- 4) \*The figures were rounded off to 3 decimal places.

# FUGRO TECHNICAL SERVICES LIMITED

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com

## Waste Flow Table for Year 2025

| Monthly Ending | Actual Quantities of Inert C&D Materials Generated Monthly |                                     |                        |                          |                         |               | Actual Quantities of Non-inert C&D Wastes Generated Monthly |                            |                       |                |                              |
|----------------|------------------------------------------------------------|-------------------------------------|------------------------|--------------------------|-------------------------|---------------|-------------------------------------------------------------|----------------------------|-----------------------|----------------|------------------------------|
|                | Total Quantity Generated (Inert C&D)                       | Hard Rock and Large Broken Concrete | Reused in the Contract | Reused in other Projects | Disposed as Public Fill | Imported Fill | Metals                                                      | Paper/ cardboard packaging | Plastics (see Note 2) | Chemical Waste | Others, e.g., general refuse |
|                | (in '000Ton)                                               | (in '000kg)                         | (in '000Ton)           | (in '000Ton)             | (in '000Ton)            | (in '000Ton)  | (in '000 kg)                                                | (in '000kg)                | (in '000kg)           | (in '000kg)    | (in '000Ton)                 |
| 2025 Jan       | 0.045                                                      | 0.000                               | 0.000                  | 0.000                    | 0.045                   | 0.000         | 0.000                                                       | 0.401                      | 0.000                 | 0.000          | 0.126                        |
| 2025 Feb       | 0.035                                                      | 0.000                               | 0.000                  | 0.000                    | 0.035                   | 0.000         | 0.000                                                       | 0.906                      | 0.000                 | 0.000          | 0.031                        |
| 2025 Mar       |                                                            |                                     |                        |                          |                         |               |                                                             |                            |                       |                |                              |
| 2025 Apr       |                                                            |                                     |                        |                          |                         |               |                                                             |                            |                       |                |                              |
| 2025 May       |                                                            |                                     |                        |                          |                         |               |                                                             |                            |                       |                |                              |
| 2025 Jun       |                                                            |                                     |                        |                          |                         |               |                                                             |                            |                       |                |                              |
| Sub-Total      | 0.080                                                      | 0.000                               | 0.000                  | 0.000                    | 0.080                   | 0.000         | 0.000                                                       | 1.307                      | 0.000                 | 0.000          | 0.157                        |
| 2025 Jul       |                                                            |                                     |                        |                          |                         |               |                                                             |                            |                       |                |                              |
| 2025 Aug       |                                                            |                                     |                        |                          |                         |               |                                                             |                            |                       |                |                              |
| 2025 Sep       |                                                            |                                     |                        |                          |                         |               |                                                             |                            |                       |                |                              |
| 2025 Oct       |                                                            |                                     |                        |                          |                         |               |                                                             |                            |                       |                |                              |
| 2025 Nov       |                                                            |                                     |                        |                          |                         |               |                                                             |                            |                       |                |                              |
| 2025 Dec       |                                                            |                                     |                        |                          |                         |               |                                                             |                            |                       |                |                              |
| Total          | 0.080                                                      | 0.000                               | 0.000                  | 0.000                    | 0.080                   | 0.000         | 0.000                                                       | 1.307                      | 0.000                 | 0.000          | 0.157                        |

Note:

- 1) The waste flow table shall also include C&D materials that are specified in the Contract to be imported for use at the Site.
- 2) Plastics refer to plastic bottles/containers, plastic sheets/foam from packaging materials.
- 3) The Contractor shall also submit the latest forecast of the total amount of C&D materials expected to be generated from the Works, together with a breakdown of the nature where the total amount of C&D materials expected to be generated from the Works is equal to or exceeding 50,000 m3.
- 4) \*The figures were rounded off to 3 decimal places.

## **FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : [matlab@fugro.com](mailto:matlab@fugro.com)  
Website : [www.fugro.com](http://www.fugro.com)



### **Appendix J**

#### **Environmental Mitigation Implementation Schedule (EMIS)**

# FUGRO TECHNICAL SERVICES LIMITED

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| EIA Review Ref                                  | Location                                         | Environmental Protection Measures/                                                                                                                                                                                                                                                                                                                           | Implementation Agent | Implementation Status in Construction Phase |
|-------------------------------------------------|--------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------|---------------------------------------------|
| Noise Measures                                  |                                                  |                                                                                                                                                                                                                                                                                                                                                              |                      |                                             |
| 3.10.2, 3.10.3, 3.10.14, 3.10.15 and Table 3.10 | Within the boundaries of all construction sites. | • Scheduling the construction activities carefully according to the actual site work situation, avoid of concurrent activities and construction works fronting the affected schools, to minimize the total noise generated (max as 102dB (A).                                                                                                                | Contractor           | Implemented                                 |
|                                                 |                                                  | • PME is recommended to operate in sub-grouping, and different sub-groups shall not be operated concurrently within any half hour period                                                                                                                                                                                                                     | Contractor           | Implemented                                 |
|                                                 |                                                  | • The construction activities should be carried out in the daytime hours (0700 – 1900). Construction Noise Permit (CNP) for construction activities is required during evening or night time hours.                                                                                                                                                          | Contractor           | Implemented                                 |
|                                                 |                                                  | • Construction work programme should be considered before actual construction work is undertaken, and noise mitigation measures should be implemented to minimize the potential construction noise impact. Selection and optimization of construction programmes, avoidance and reduction of parallel operation of noisy PME during noise sensitive periods. | Contractor           | Implemented                                 |
|                                                 |                                                  | • Use of well-maintained and regularly-serviced plant during the works.                                                                                                                                                                                                                                                                                      | Contractor           | Implemented                                 |
|                                                 |                                                  | • Plant operating on intermittent basis should be turned off or throttled down when not in active use.                                                                                                                                                                                                                                                       | Contractor           | Implemented                                 |
|                                                 |                                                  | • Plant that is known to emit noise strongly in one direction should be orientated to face away from the NSRs.                                                                                                                                                                                                                                               | Contractor           | Not Applicable                              |
|                                                 |                                                  | • Silencers, mufflers and enclosures for plant should be used where possible and maintained adequately throughout the works.                                                                                                                                                                                                                                 | Contractor           | Implemented                                 |
|                                                 |                                                  | • Fixed plants should be sited away from NSRs where possible.                                                                                                                                                                                                                                                                                                | Contractor           | Not Applicable                              |
|                                                 |                                                  | • Stockpiles of excavated materials and other structures such as site buildings should be used effectively to screen noise from the works.                                                                                                                                                                                                                   | Contractor           | Not Applicable                              |
| 3.10.4, 3.10.5 and Table 3.3                    |                                                  | • The use of particular plant with equipment quieter than those specified in the GW-TM are recommended to reduce the noise levels generated by the plant.                                                                                                                                                                                                    | Contractor           | Implemented                                 |
|                                                 |                                                  | • Other type of quiet PME are allowed to use for their needs based on the actual construction conditions and programmes                                                                                                                                                                                                                                      | Contractor           | Implemented                                 |
| 3.10.6 to 3.10.9                                |                                                  | • Temporary noise barriers provide noise attenuation by screening NSRs from stationary and mobile plants from direct line-of-sight in shadow zone.                                                                                                                                                                                                           | Contractor           | Implemented                                 |
|                                                 |                                                  | • The use of 3m high moveable barriers with skid footing and a small cantilevered upper portion should be adopted. The barrier material shall have a surface mass of not less than 14kg/m <sup>2</sup> on skid footing with 25mm thick internal sound absorptive lining to achieve the maximum screening effect.                                             | Contractor           | Not Applicable                              |
|                                                 |                                                  | • These temporary noise barriers should be located immediately adjacent to working area.                                                                                                                                                                                                                                                                     | Contractor           | Implemented                                 |

## FUGRO TECHNICAL SERVICES LIMITED

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| EIA Review Ref       | Location                                         | Environmental Protection Measures/                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                            | Implementation Agent | Implementation Status in Construction Phase |
|----------------------|--------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------|---------------------------------------------|
|                      |                                                  | • The temporary noise barriers should be located along the working area to make sure the construction plant could be screened during all kinds of construction activities as far as practicable.                                                                                                                                                                                                                                                                                                                                                                                              | Contractor           | Not Applicable                              |
|                      |                                                  | • Noise jacket/muffler shall be used to cover the noisy part of the engine or at the engine exhaust of particular mobile plants respectively when temporary noise barriers are not practicable or noise reduction achieved is insufficient.                                                                                                                                                                                                                                                                                                                                                   | Contractor           | Implemented                                 |
|                      |                                                  | • For the stationary plant bored pile oscillator, temporary noise barriers of sufficient height with skid footing and small cantilevered upper portion should be provided.                                                                                                                                                                                                                                                                                                                                                                                                                    | Contractor           | Not Applicable                              |
|                      |                                                  | • Barrier material of surface density of at least 14 kg/m <sup>2</sup> is recommended in order to achieve the necessary screening effect.                                                                                                                                                                                                                                                                                                                                                                                                                                                     | Contractor           | Not Applicable                              |
| 3.10.10              |                                                  | • Full noise enclosures should cover the PME or fixed plants such as air compressor.                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                          | Contractor           | Implemented                                 |
| 3.10.3               |                                                  | • Silencers, mufflers and enclosures for plant should be used where possible and maintained adequately throughout the works;                                                                                                                                                                                                                                                                                                                                                                                                                                                                  | Contractor           | Not Applicable                              |
|                      |                                                  | • Where possible fixed plants should be sited away from NSRs; and                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             | Contractor           | Not Applicable                              |
|                      |                                                  | • Stockpiles of excavated materials and other structures such as site buildings should be used effectively to screen noise from the works.                                                                                                                                                                                                                                                                                                                                                                                                                                                    | Contractor           | Not Applicable                              |
| Air Quality Measures |                                                  |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               |                      |                                             |
| 4.12.1 and 4.12.2    | Within the boundaries of all construction sites. | • The Contractor shall notify any specific construction works as stated in the Air Pollution Control (Construction Dust) Regulation to the Authority before the commencement of such work. Dust mitigation measures stipulated in the Air Pollution Control (Construction Dust) Regulation should be implemented to control dust emissions from all construction work sites.                                                                                                                                                                                                                  | Contractor           | Implemented                                 |
|                      |                                                  | • The Contractor shall undertake at all times to prevent dust nuisance as a result of his activities. Dust suppression measures such as the water spraying are necessary and should be installed to ensure that the air quality at the boundary of the site and at any sensitive receivers complies with the Hong Kong Air Quality Objectives.                                                                                                                                                                                                                                                | Contractor           | Partially Implemented                       |
|                      |                                                  | • The Contractor shall apply for a license or permit under the requirements of the relevant legislation (e.g. Air Pollution Control Ordinance and its subsidiary regulations) wherever applicable.                                                                                                                                                                                                                                                                                                                                                                                            | Contractor           | Implemented                                 |
|                      |                                                  | • Watering of unpaved areas, access roads, construction areas and dusty stockpiles shall be undertaken at least eight times daily during dry and windy weather. Watering of the haul road shall be undertaken four to eight times daily during dry or windy weather. Water sprays may be either fixed or mobile to follow individual areas to be wetted as and when required. Application of suitable wetting agents, such as dust suppression chemicals, shall be used in addition to water, especially during the dry season (October to December). It is also suggested that watering with | Contractor           | Implemented                                 |

## FUGRO TECHNICAL SERVICES LIMITED

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| EIA Review Ref | Location | Environmental Protection Measures/                                                                                                                                                                                                                                                                                                                          | Implementation Agent | Implementation Status in Construction Phase |
|----------------|----------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------|---------------------------------------------|
|                |          | complete coverage of active construction area eight times a day.                                                                                                                                                                                                                                                                                            |                      |                                             |
|                |          | • Effective water sprays shall be used during the delivery and handling of all raw sand and aggregate, and other similar materials, wet dust is likely to be created and to dampen all stored materials during dry and windy weather.                                                                                                                       | Contractor           | Implemented                                 |
|                |          | • Stockpiles of sand, aggregate or any other dusty materials greater than 20m <sup>3</sup> shall be enclosed on three sides, with walls extending above the pile and 1 meter beyond the front of the pile.                                                                                                                                                  | Contractor           | Partially Implemented                       |
|                |          | • Suitable chemical wetting agent such as dust suppression chemical shall be used on completed cuts and fills to reduce wind erosion.                                                                                                                                                                                                                       | Contractor           | Not Applicable                              |
|                |          | • Areas within the construction site where there is a regular movement of vehicles shall have a paved surface and be kept clear of loose surface material.                                                                                                                                                                                                  | Contractor           | Implemented                                 |
|                |          | • The Contractor shall restrict all motorized vehicles within the construction site, excluding those on public roads, to maximum speed of 20 km per hour and confine haulage and delivery vehicles to designated roadways inside the Site.                                                                                                                  | Contractor           | Implemented                                 |
|                |          | • Construction working areas should be restricted to a minimum practicable size.                                                                                                                                                                                                                                                                            | Contractor           | Implemented                                 |
|                |          | • The Contractor shall ensure that no earth, rock or debris is deposited on public or private rights of way as result of his activities, including any deposits arising from the movement of plant or vehicles.                                                                                                                                             | Contractor           | Implemented                                 |
|                |          | • The Contractor shall provide a wheel washing facility at the exits from work areas to the satisfaction of the Engineer and to the requirements of the Commissioner of Police. Water in wheel washing facilities and sediment shall be changed and removed respectively at least once a month.                                                             | Contractor           | Implemented                                 |
|                |          | • The Contractor shall submit details of the wheel washing facilities, which shall be usable prior to any earthworks excavation activity on the construction site. The Contractor shall also provide a hard-surfaced road between any washing facility and the public road.                                                                                 | Contractor           | Implemented                                 |
|                |          | • In the event of any spoil or debris from construction works being deposited on adjacent land, or streams, or any slit being washed down to any area, then all such spoil, debris or material and silt shall be immediately removed and the affected land and areas restored to their natural state by the Contractor to the satisfaction of the Engineer. | Contractor           | Implemented                                 |
|                |          | • If spoil cannot be immediately transported out of the Site, stockpiles should be stored in sheltered areas.                                                                                                                                                                                                                                               | Contractor           | Implemented                                 |
|                |          | • Plant and vehicles shall be inspected annually to ensure that they are operating efficiently and that exhaust emissions are not causing a nuisance. All site vehicle exhausts should be directed vertically upwards or directed away from ground.                                                                                                         | Contractor           | Implemented                                 |
| 4.12.1,        |          | • Construction dust monitoring shall be carried out at representative monitoring locations during the                                                                                                                                                                                                                                                       | Contractor           | Implemented                                 |

# FUGRO TECHNICAL SERVICES LIMITED

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| EIA Review Ref                | Location                                         | Environmental Protection Measures/                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                     | Implementation Agent | Implementation Status in Construction Phase |
|-------------------------------|--------------------------------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------|---------------------------------------------|
| 4.13.1 and Table 8.2          |                                                  | construction period.                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   |                      |                                             |
|                               |                                                  | • Path for complaints and handling procedures should be set up and implement.                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                          | Contractor           | Implemented                                 |
| NA                            |                                                  | • Dark smoke emission shall be control in accordance with the Air Pollution Control (Smoke) Regulation and ETWB TCW 19/2005.                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                           | Contractor           | Implemented                                 |
|                               |                                                  | • Plant and equipment should be well maintained to prevent dark smoke emission.                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        | Contractor           | Implemented                                 |
|                               |                                                  | • Only approved or exempted Non-road Mobile Machineries (NRMMS) including regulated machines and non-road vehicles with proper labels are allowed to be used in specified activities on-site.                                                                                                                                                                                                                                                                                                                                                                                                                                                                          | Contractor           | Implemented                                 |
| <u>Water Quality Measures</u> |                                                  |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        |                      |                                             |
| 5.7                           | Within the boundaries of all construction sites. | • Silt-laden surface run-off should be prevented from directly entering the sensitive receivers during the construction works. The mitigation measures described below for the construction phase are in accordance with ProPECC PN 1/94:                                                                                                                                                                                                                                                                                                                                                                                                                              | Contractor           | Implemented                                 |
|                               |                                                  | • Construction works should be programmed so as to minimise excavation during the wet season (April to September). If this is not possible then measures should be taken to minimise the areas exposed by covering temporary exposed slopes with tarpaulins or similar material, the protection of temporary road surfaces with gravel or crushed stone and the early reinstatement of final surfaces with hydro seed grass/shrub mixture. This latter measure would have the added benefit of reducing the windblown dust during the dry season. Where temporary covering of slopes is required this should be carried out before the onset of the rainfall or storm. | Contractor           | Implemented                                 |
|                               |                                                  | • Existing and newly constructed open manholes should be covered and sealed to prevent run off and water borne debris entering the drainage network without having previously passed through a sediment trap.                                                                                                                                                                                                                                                                                                                                                                                                                                                          | Contractor           | Implemented                                 |
|                               |                                                  | • Stock piles of construction materials, sand and gravel or excavated material should be covered with tarpaulins prior to rainstorms. The washing of material from the stockpiles directly into the storm drains should be prevented by passing the run off through a sediment trap.                                                                                                                                                                                                                                                                                                                                                                                   | Contractor           | Implemented                                 |
|                               |                                                  | • The surface water from the site should be discharged into storm water drain after passing through sand and silt traps designed to accommodate the maximum discharge from the site. Within the site channels, bunds or sandbags should be used to direct run off into the traps. Storm water from outwit the site should be prevented from washing over the site by the construction of interceptor channels at the site boundary. Both perimeter channels and the sedimentation traps should be constructed prior to the commencement of site formation and earthworks.                                                                                              | Contractor           | Implemented                                 |
|                               |                                                  | • The efficiency of the interceptor channels, traps and sedimentation chambers should be maintained by regular cleaning of accumulated silt and sand. Particular attention should be paid to                                                                                                                                                                                                                                                                                                                                                                                                                                                                           | Contractor           | Implemented                                 |

## FUGRO TECHNICAL SERVICES LIMITED

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| EIA Review Ref | Location | Environmental Protection Measures/                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                            | Implementation Agent | Implementation Status in Construction Phase |
|----------------|----------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------|---------------------------------------------|
|                |          | maintenance following heavy rainfall and immediately after the issue of heavy rainfall warning by the Hong Kong Observatory.                                                                                                                                                                                                                                                                                                                                                                                                                  |                      |                                             |
|                |          | • The ingress of rainwater into trenches should be minimised by the construction of bunds to prevent water flowing into the trench and covering by tarpaulins to prevent direct entry. The lengths of excavated trenches should be minimised and backfilled at the earliest opportunity. Water pumped from the trenches should be discharged to the storm water drains following passage through a suitable silt trap.                                                                                                                        | Contractor           | Implemented                                 |
|                |          | • Any ground water seeping into any trenches or foundation works should be passed through a silt trap prior to discharge to the storm water drains.                                                                                                                                                                                                                                                                                                                                                                                           | Contractor           | Implemented                                 |
|                |          | • The water used for the washing down of mixing drums used for onsite batching of concrete and delivery lorries for off-site batched concrete should be recycled whenever possible. Wastewater generated from the washing which is discharged should be passed through a silt trap before discharge to the storm water system.                                                                                                                                                                                                                | Contractor           | Not Applicable                              |
|                |          | • The wastewater from the washing of the wheels and subframe of vehicles returning from the site onto public roads will contain suspended solids and debris. A washing bay should be provided at the exit from the site and should, where practicable, incorporate water recirculation. Water from the washing bay which is discharged to the storm water system should first be passed through a silt trap which also includes an oil/grease removal weir.                                                                                   | Contractor           | Implemented                                 |
|                |          | • Plant maintenance areas should be paved to prevent waste oils soaking into the ground. Where possible the area should be undercover to minimise the formation of runoff and any runoff from the paved area passed through an oil trap before being discharged to the storm drains. Fuel storage tanks should be surrounded by bunds with a capacity of at least 150% of the storage capacity. The bunded areas should be able to be drained of rain water through the petrol interceptor and accumulated rain removed at regular intervals. | Contractor           | Implemented                                 |
|                |          | • Waste oils from the site should be collected and stored for recycling or disposal in accordance with the Waste Disposal Ordinance and absorbent cloths and granules should be available for the cleanup of spillages.                                                                                                                                                                                                                                                                                                                       | Contractor           | Implemented                                 |
|                |          | • Sewage from toilets and kitchens should be discharged directly into a foul sewer. If it is not possible to locate the site offices within easy access of a foul sewer a septic tank and soakaway should be constructed before the offices are occupied. Chemical toilets should be emptied on a daily basis and the contents taken to a foul sewer or the Sha Tin Sewage Treatment Works for disposal. Wastewater collected from canteen kitchens should be discharged to the foul sewers via grease traps                                  | Contractor           | Implemented                                 |

# FUGRO TECHNICAL SERVICES LIMITED

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| EIA Review Ref                                  | Location                                                                   | Environmental Protection Measures/                                                                                                                                                                                                                                                                               | Implementation Agent | Implementation Status in Construction Phase |
|-------------------------------------------------|----------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------|---------------------------------------------|
|                                                 |                                                                            | which provide a minimum of 20 minutes retention during peak flow. All discharges into foul sewers and storm sewers should have to be complied with TM standards under WPCO.                                                                                                                                      |                      |                                             |
|                                                 |                                                                            | • Run off from roofed surfaces of site facilities should be collected and diverted to a storm water drain. Passage through a silt trap is only required if the water is diverted via open channels which might accumulate solids during non-rainy periods or which intercept surface run off from unpaved areas. | Contractor           | Not Applicable                              |
|                                                 |                                                                            | • Discharges from the site shall be required to meet the terms and conditions of a valid WPCO Water Pollution Control Ordinance (WPCO).                                                                                                                                                                          | Contractor           | Implemented                                 |
| Section 12.6 of the Approved EIA Report         |                                                                            | • Regular site inspection of the construction works shall be carried out to determine compliance with the recommended mitigation measures. Inspection should be included:                                                                                                                                        |                      |                                             |
|                                                 |                                                                            | (i) The functioning of onsite surface water collection channels and sediment traps.                                                                                                                                                                                                                              | Contractor           | Implemented                                 |
|                                                 |                                                                            | (ii) The functioning of interception channels at the boundary of the works areas                                                                                                                                                                                                                                 | Contractor           | Implemented                                 |
|                                                 |                                                                            | (iii) The covering of stockpiles of fill and construction materials and the routing of any run off through the sediment traps.                                                                                                                                                                                   | Contractor           | Implemented                                 |
|                                                 |                                                                            | (iv) The pumping procedures for emptying trenches and other excavations and the use of silt traps prior to the discharge of the water to the storm water system.                                                                                                                                                 | Contractor           | Implemented                                 |
|                                                 |                                                                            | (v) The use of washwater for hosing down concrete mixing and delivery vehicles and other vehicles leaving the site and the routine of excess water from the facility through sediment traps.                                                                                                                     | Contractor           | Implemented                                 |
|                                                 |                                                                            | (vi) The operation of the plant maintenance areas to control small spillages and the correct management of the fuel storage bunded area.                                                                                                                                                                         | Contractor           | Implemented                                 |
|                                                 |                                                                            | (vii) The connection of the site office wastewater discharge to an existing foul sewer if appropriate or the operation of the kitchen wastewater grease trap and the regular emptying of the chemical toilets                                                                                                    | Contractor           | Implemented                                 |
|                                                 | (viii)The operation of the roof rain water collection and drainage system. | Contractor                                                                                                                                                                                                                                                                                                       | Implemented          |                                             |
| <u>Landscape and Visual Mitigation Measures</u> |                                                                            |                                                                                                                                                                                                                                                                                                                  |                      |                                             |
| Table 6.5                                       | During construction within the Project Boundary.                           | Construction Phase                                                                                                                                                                                                                                                                                               |                      |                                             |
|                                                 |                                                                            | • Existing trees shall be preserved as much as possible. Detailed tree preservation and transplanting proposals shall be submitted to relevant government departments for approval in accordance with DEVB TC (W) No. 7/2015.                                                                                    | Contractor           | Implemented                                 |
|                                                 |                                                                            | • Topsoil will be conserved as far as possible during the road improvement works and utilized during the replanting operations. The stock piling height of the topsoil will not be more than 2m.                                                                                                                 | Contractor           | Implemented                                 |
|                                                 |                                                                            | • Old and valuable trees (OVTs) identified in the Project Boundary shall be protected in                                                                                                                                                                                                                         | Contractor           | Implemented                                 |

# FUGRO TECHNICAL SERVICES LIMITED

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| EIA Review Ref            | Location                                         | Environmental Protection Measures/                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        | Implementation Agent | Implementation Status in Construction Phase |
|---------------------------|--------------------------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------|---------------------------------------------|
|                           |                                                  | accordance with ETWB TCW no. 29/2004.                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                     |                      |                                             |
|                           |                                                  | • Night-time lighting glare shall be properly managed and control during construction so as to minimize any adverse visual impact on adjacent VSRs.                                                                                                                                                                                                                                                                                                                                                                                       | Contractor           | Implemented                                 |
|                           |                                                  | • Decorative screen hoarding with design compatible with the surrounding landscape setting shall be erected along the southern boundary of Tai Po Road to mitigate any potential adverse impact on adjacent Pedestrian and Cyclists on Footpath/Bicycle Track.                                                                                                                                                                                                                                                                            | Contractor           | Not Applicable                              |
|                           | Operation Phase                                  |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                           |                      |                                             |
|                           | During construction within the Project Boundary. | • Compensatory planting shall be provided within and outside the project boundary where possible. Detailed compensatory planting proposal will be prepared in accordance with DEVB TC (W) No. 7/2015.                                                                                                                                                                                                                                                                                                                                     | Contractor           | Not Applicable                              |
|                           |                                                  | • Planting shall be undertaken at the earliest practical time in the construction period. The planting proposal shall aim to strengthen the existing tree species and supplement the existing tree planting to provide an effective screen to ameliorate any potential landscape and visual impacts. The proposed species to be utilized for road improvement works shall be agreed with LCSD and future maintenance authorities. All the proposed species for compensatory planting shall be suitable for roadside streetscape planting. | Contractor           | Not Applicable                              |
|                           |                                                  | • Provision of visually pleasing noise barriers and enclosures design shall be proposed. The design of these structures aims to minimize any potential visual impact and visually integrate the proposed structures into the adjacent landscape context. This should be achieved through the use of form, color, tones, materials and planting materials.                                                                                                                                                                                 | Contractor           | Not Applicable                              |
|                           |                                                  | • Aesthetically pleasing hard landscape treatment of the carriageway and roadside furniture shall be proposed, including development of chromatic themes in the architectural treatment of engineering structures, and the consideration of landscape lighting and special landscape features.                                                                                                                                                                                                                                            | Contractor           | Not Applicable                              |
|                           |                                                  | • Shrubs and climbers planting are proposed on the facade of Noise Enclosures and Barriers to mitigate any adverse impact on adjacent VSRs in area where space for tree planting is not feasible.                                                                                                                                                                                                                                                                                                                                         | Contractor           | Not Applicable                              |
| Waste Management Measures |                                                  |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                           |                      |                                             |
| 7.6.2 to 7.6.4            | Within the boundaries of all construction sites. | • In accordance with ETWB TC (W) No. 19/2005 - Environmental Management on Construction Sites", the Contractor shall prepare and implement a Waste Management Plan (WMP) as part of the Environmental Management Plan (EMP). The EMP shall describes the arrangements for avoidance, reuse, recovery, recycling, storage, collection, treatment and disposal of different categories of waste to be generated from the construction activities. Such a management plan                                                                    | Contractor           | Implemented                                 |

## FUGRO TECHNICAL SERVICES LIMITED

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| EIA Review Ref | Location                                                                                                                                                  | Environmental Protection Measures/                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                           | Implementation Agent | Implementation Status in Construction Phase |
|----------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------|---------------------------------------------|
| 7.6.5 to 7.6.6 |                                                                                                                                                           | should incorporate site specific factors, such as the designation of areas for segregation and temporary storage of reusable and recyclable materials. The EMP should be submitted to the Engineer for approval.                                                                                                                                                                                                                                                                                                                                                                                                             |                      |                                             |
|                |                                                                                                                                                           | • The Contractor should implement the waste management practices in the EMP throughout the construction stage of the Project. The EMP should be reviewed regularly and updated by the Contractor.                                                                                                                                                                                                                                                                                                                                                                                                                            | Contractor           | Implemented                                 |
|                |                                                                                                                                                           | • Recommendations of good site practices and waste reduction measures should be stated in order to achieve avoidance and minimization of waste generation in the hierarchy.                                                                                                                                                                                                                                                                                                                                                                                                                                                  | Contractor           | Implemented                                 |
|                |                                                                                                                                                           | • Environmental Management Plan (EMP) and trip-ticket system shall be implemented for monitoring management of waste.                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        | Contractor           | Implemented                                 |
|                |                                                                                                                                                           | • Specific measures targeting the mitigation of impacts in works areas and the transportation of spoil off-site should be provided to minimize the potential impacts to the surrounding environment.                                                                                                                                                                                                                                                                                                                                                                                                                         | Contractor           | Implemented                                 |
| 7.6.7          | Within the boundaries of                                                                                                                                  | • To facilitate adoption of the best-practice philosophy, training shall be provided to all personnel working on site. The training shall promote the concept of general site cleanliness and clearly explain the appropriate waste management procedures defined in the EMP. Overall, the training should encourage all workers to reduce, reuse and recycle wastes.                                                                                                                                                                                                                                                        | Contractor           | Implemented                                 |
| 7.6.8 to 7.6.9 | all construction sites as well as transportation routes to designed areas for off-site disposal of materials/Prior to and during construction activities. | • The contractor's environmental performance shall be monitored and controlled through the weekly environmental walks. The items after the environmental walks shall include:                                                                                                                                                                                                                                                                                                                                                                                                                                                |                      |                                             |
|                |                                                                                                                                                           | • A review of the EMP in particular the suitability of the environmental measures on nuisance abatement and waste management adopted by the contractor;                                                                                                                                                                                                                                                                                                                                                                                                                                                                      | Contractor           | Implemented                                 |
|                |                                                                                                                                                           | • The environmental performance of the contractor and his sub-contractors;                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   | Contractor           | Implemented                                 |
|                |                                                                                                                                                           | • The effectiveness of the environmental measures on nuisance abatement and waste management implemented on the site, and any complaints received; and                                                                                                                                                                                                                                                                                                                                                                                                                                                                       | Contractor           | Implemented                                 |
|                |                                                                                                                                                           | • The promptness of rectification or improvement actions of the Contractor on the defects and deficiencies identified during inspections of the site.                                                                                                                                                                                                                                                                                                                                                                                                                                                                        | Contractor           | Implemented                                 |
|                |                                                                                                                                                           | • Waste shall only be disposed of at licensed sites and the WMP should include procedures to ensure that illegal disposal of wastes does not occur. Only waste haulers authorized to collect the specific category of waste concerned should be employed and a trip ticket system shall be implemented for offsite disposal of inert C&D materials and non-inert C&D materials at public fill reception facilities and landfills, respectively. Appropriate measures should be employed to minimize windblown litter and dust during transportation by either covering trucks or transporting wastes in enclosed containers. | Contractor           | Implemented                                 |

## FUGRO TECHNICAL SERVICES LIMITED

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| EIA Review Ref   | Location | Environmental Protection Measures/                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                     | Implementation Agent | Implementation Status in Construction Phase |
|------------------|----------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------|---------------------------------------------|
| 7.6.10           |          | • Work site(s) shall be arranged and managed to facilitate the proper management of wastes and materials. The WMP shall include plans indicating specific areas designated for the storage of particular types of waste, reusable and recyclable materials as well as areas and management proposals for any stockpiling areas. Waste storage areas should be well maintained and cleaned regularly. Specific provisions for different types of material are outlined below. In general, these areas should be designed to avoid cross contamination of materials as well as pollution of the surrounding environment. | Contractor           | Implemented                                 |
| 7.6.11 to 7.6.14 |          | • In order to minimize the impact resulting from collection and transportation of C&D material for off-site disposal, the excavated fill materials should be reused on site as backfill material as far as possible.                                                                                                                                                                                                                                                                                                                                                                                                   | Contractor           | Implemented                                 |
|                  |          | • Careful design, planning and good site management should be maintained in order to minimise over ordering and generation of surplus materials such as concrete, mortars and cement grouts. The design of formwork should maximise the use of standard wooden panels so that high reuse levels can be achieved. Alternatives such as steel formwork or plastic facing should be considered to increase the potential for reuse.                                                                                                                                                                                       | Contractor           | Implemented                                 |
|                  |          | • C&D materials should be segregated on site into different waste and material types. The Contractor should clearly demonstrate in the EMP how he intends to maximise the reuse of C&D material on-site. Where reuse of materials on site is not feasible, the Contractor should explore opportunities for recycling materials off-site, and inert C&D materials shall be reused on site as much as possible.                                                                                                                                                                                                          | Contractor           | Implemented                                 |
|                  |          | • Paving bricks arising from existing pavement should be recycled on site as much as possible.                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                         | Contractor           | Not Applicable                              |
|                  |          | • Existing marginal roadside barriers comprise pre-cast units should be reused in the following widening works as much as possible,                                                                                                                                                                                                                                                                                                                                                                                                                                                                                    | Contractor           | Not Applicable                              |
|                  |          | • Existing bridge parapets comprise aluminum post and railings, which have a recyclable value and should be sold for reconditioning or reused for scrap metal as much as possible                                                                                                                                                                                                                                                                                                                                                                                                                                      | Contractor           | Not Applicable                              |
|                  |          | • Any stockpile should be sited away from existing watercourses and suitably covered to prevent wind erosion and impacts on air and water quality.                                                                                                                                                                                                                                                                                                                                                                                                                                                                     | Contractor           | Not Applicable                              |
| 7.6.15 to 7.6.17 |          | • Chemical waste shall be handled in accordance with the Code of Practice on the Packaging, Handling and Storage of Chemical Wastes as follows. Containers used for the storage of chemical wastes should:                                                                                                                                                                                                                                                                                                                                                                                                             |                      |                                             |
|                  |          | • be suitable for the substance they are holding, resistant to corrosion, maintained in a good condition, and securely closed;                                                                                                                                                                                                                                                                                                                                                                                                                                                                                         | Contractor           | Implemented                                 |
|                  |          | • have a capacity of less than 450L unless the specifications have been approved by the EPD; and                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       | Contractor           | Implemented                                 |

## FUGRO TECHNICAL SERVICES LIMITED

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| EIA Review Ref   | Location | Environmental Protection Measures/                                                                                                                                                                                                                                                                                                                                                                                                                                                                     | Implementation Agent | Implementation Status in Construction Phase |
|------------------|----------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------|---------------------------------------------|
|                  |          | <ul style="list-style-type: none"> <li>display a label in English and Chinese in accordance with instructions prescribed in Schedule 2 of the Waste Disposal (Chemical Waste) (General) Regulation (Cap. 354C).</li> </ul>                                                                                                                                                                                                                                                                             | Contractor           | Implemented                                 |
|                  |          | The storage area for chemical wastes should:                                                                                                                                                                                                                                                                                                                                                                                                                                                           |                      |                                             |
|                  |          | <ul style="list-style-type: none"> <li>be clearly labelled and used solely for the storage of chemical waste;</li> </ul>                                                                                                                                                                                                                                                                                                                                                                               | Contractor           | Implemented                                 |
|                  |          | <ul style="list-style-type: none"> <li>be enclosed on at least 3 sides;</li> </ul>                                                                                                                                                                                                                                                                                                                                                                                                                     | Contractor           | Partially Implemented                       |
|                  |          | <ul style="list-style-type: none"> <li>have an impermeable floor and bunding, of capacity to accommodate 110% of the volume of the largest container or 20% by volume of the chemical waste stored in that area, whichever is the greatest;</li> </ul>                                                                                                                                                                                                                                                 | Contractor           | Implemented                                 |
|                  |          | <ul style="list-style-type: none"> <li>have adequate ventilation;</li> </ul>                                                                                                                                                                                                                                                                                                                                                                                                                           | Contractor           | Implemented                                 |
|                  |          | <ul style="list-style-type: none"> <li>be covered to prevent rainfall entering (water collected within the bund must be tested and disposed as chemical waste if necessary); and</li> </ul>                                                                                                                                                                                                                                                                                                            | Contractor           | Implemented                                 |
|                  |          | <ul style="list-style-type: none"> <li>be arranged so that incompatible materials are adequately separated.</li> </ul>                                                                                                                                                                                                                                                                                                                                                                                 | Contractor           | Implemented                                 |
|                  |          | The Contractor shall register with EPD as a Chemical Waste Producer. Waste oils and other chemical wastes as defined in the Waste Disposal (Chemical Waste) (General) Regulation will require disposal by appropriate means and could require pre-notification to EPD prior to disposal. Appropriate means include disposal:                                                                                                                                                                           |                      |                                             |
|                  |          | <ul style="list-style-type: none"> <li>via a licensed waste collector; and</li> </ul>                                                                                                                                                                                                                                                                                                                                                                                                                  | Contractor           | Implemented                                 |
| 7.6.18 to 7.6.20 |          | <ul style="list-style-type: none"> <li>to a facility licensed to receive chemical waste, such as the Chemical Waste Treatment Facility which also offers a chemical waste collection service and can supply the necessary storage containers; or</li> </ul>                                                                                                                                                                                                                                            | Contractor           | Implemented                                 |
|                  |          | <ul style="list-style-type: none"> <li>to a reuser of the waste, under approval from EPD.</li> </ul>                                                                                                                                                                                                                                                                                                                                                                                                   | Contractor           | Not Applicable                              |
|                  |          | <ul style="list-style-type: none"> <li>General refuse generated on-site should be stored in enclosed bins or compaction units separate from construction and chemical wastes. A reputable waste collector should be employed by the Contractor to remove general refuse from the site, separately from construction and chemical wastes, on a daily or every second day basis to minimize odour, pest and litter impacts. The burning of refuse on construction sites is prohibited by law.</li> </ul> | Contractor           | Implemented                                 |
| 7.7.1            |          | <ul style="list-style-type: none"> <li>Separate labelled bins should be provided if feasible.</li> </ul>                                                                                                                                                                                                                                                                                                                                                                                               | Contractor           | Implemented                                 |
|                  |          | <ul style="list-style-type: none"> <li>Office waste can be reduced through recycling of paper if volume is large enough to warrant collection. Participation in a local collection scheme should be considered if one is available.</li> </ul>                                                                                                                                                                                                                                                         | Contractor           | Implemented                                 |
|                  |          | <ul style="list-style-type: none"> <li>All wastes produced during the construction of the Project shall be handled, stored, and disposed of in accordance with good waste management practices and relevant regulations and requirements.</li> </ul>                                                                                                                                                                                                                                                   | Contractor           | Implemented                                 |

## FUGRO TECHNICAL SERVICES LIMITED

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| EIA Review Ref | Location                                         | Environmental Protection Measures/                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               | Implementation Agent | Implementation Status in Construction Phase |
|----------------|--------------------------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------|---------------------------------------------|
|                |                                                  | • The mitigation measures recommended in the EIA/EIA review report should form a basis of the WMP to be developed by the Contractor in the construction phase of the Project.                                                                                                                                                                                                                                                                                                                                                                                                                                                    | Contractor           | Implemented                                 |
| EP 1.5         |                                                  | <u>General Condition</u>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                         |                      |                                             |
| N.A            | During construction within the Project Boundary. | • The Permit Holder shall display conspicuously a copy of this Permit on the Project site(s) at all vehicular site entrance/exits or at a convenient location for public information at all times. The Permit Holder shall ensure that the most updated information about the Permit, including any amended Permit, is displayed at such locations. If the Permit Holder surrenders a part or the whole of the Permit, the notice he sends to the Director shall also be displayed at the same locations as the original Permit. The suspended, varied or cancelled Permit shall be removed from display at the Project site(s). | Contractor           | Implemented                                 |

Implementation status: Implemented / Partially Implemented / Not Implemented / Not Observed / Not Applicable

## **FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : [matlab@fugro.com](mailto:matlab@fugro.com)  
Website : [www.fugro.com](http://www.fugro.com)



### **Appendix K**

#### **Weather and Meteorological Conditions during Reporting Month**

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Date          | Mean Pressure (hPa) | Air Temperature  |               |                  | Mean Relative Humidity (%) | Total Rainfall (mm) |
|---------------|---------------------|------------------|---------------|------------------|----------------------------|---------------------|
|               |                     | Maximum (deg. C) | Mean (deg. C) | Minimum (deg. C) |                            |                     |
| February 2025 |                     |                  |               |                  |                            |                     |
| 1             | 1013.1              | 21.9             | 19.5          | 17.2             | 86                         | 1.7                 |
| 2             | 1014.3              | 20.1             | 18.5          | 17.5             | 86                         | Trace               |
| 3             | 1019.6              | 17.8             | 15.8          | 13.1             | 74                         | 0.1                 |
| 4             | 1022.2              | 18.6             | 14.7          | 12.2             | 61                         | -                   |
| 5             | 1019.4              | 18.5             | 15.7          | 13.6             | 65                         | -                   |
| 6             | 1017.9              | 20.1             | 17.4          | 15.9             | 57                         | -                   |
| 7             | 1021.4              | 17.7             | 15.5          | 12.7             | 63                         | -                   |
| 8             | 1024.6              | 17.2             | 14.0          | 11.5             | 43                         | -                   |
| 9             | 1024.0              | 17.4             | 14.5          | 11.8             | 46                         | -                   |
| 10            | 1021.7              | 19.1             | 15.9          | 12.8             | 63                         | -                   |
| 11            | 1019.1              | 19.9             | 17.6          | 15.2             | 71                         | Trace               |
| 12            | 1017.2              | 20.3             | 18.8          | 17.2             | 93                         | 23.8                |
| 13            | 1018.9              | 19.6             | 18.1          | 16.9             | 79                         | Trace               |
| 14            | 1017.9              | 18.2             | 16.8          | 15.5             | 87                         | 0.2                 |
| 15            | 1015.6              | 22.3             | 18.5          | 16.7             | 83                         | Trace               |
| 16            | 1016.9              | 25.1             | 21.0          | 17.8             | 81                         | -                   |
| 17            | 1020.6              | 21.9             | 18.9          | 17.3             | 70                         | -                   |
| 18            | 1021.7              | 20.4             | 18.0          | 16.7             | 71                         | -                   |
| 19            | 1021.9              | 18.7             | 17.2          | 16.1             | 75                         | -                   |
| 20            | 1021.2              | 19.8             | 17.7          | 16.6             | 79                         | -                   |
| 21            | 1022.4              | 19.4             | 17.1          | 16.3             | 82                         | Trace               |
| 22            | 1023.2              | 18.1             | 16.6          | 15.5             | 80                         | Trace               |
| 23            | 1026.0              | 18.8             | 16.8          | 15.4             | 73                         | Trace               |
| 24            | 1028.2              | 19.5             | 15.4          | 13.0             | 67                         | -                   |
| 25            | 1026.2              | 19.6             | 16.9          | 14.4             | 70                         | Trace               |
| 26            | 1022.9              | 20.7             | 17.8          | 16.1             | 76                         | 0.3                 |
| 27            | 1019.0              | 22.2             | 18.7          | 16.1             | 76                         | -                   |
| 28            | 1017.3              | 25.4             | 21.3          | 18.1             | 77                         | -                   |

Remark: Trace means rainfall less than 0.05 mm

Source: Hong Kong Observatory

## **FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : [matlab@fugro.com](mailto:matlab@fugro.com)  
Website : [www.fugro.com](http://www.fugro.com)



### **Appendix L**

#### **Cumulative statistics on Environmental Complaints, Notifications of Summons and Successful Prosecutions**

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com

**Environmental Complaints Log**

| Reference No. | Date of Complaint Received | Received From                 | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                    | Date of Reply |
|---------------|----------------------------|-------------------------------|-------------|---------------------|-----------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| COM-2019-005  | 02/02/2019                 | EPD                           | CCZJV       | Noise               | 13/02/2019            | According to the photo taken from the complainant, the complaint was related to the project. Although the tree felling works were covered by the valid CNP (GW-RN0783-18), Contractor was reminded to strictly follow and fully comply with the CNP conditions and the mitigation measures stipulated in the EM&A Manual when construction activities are operating during restricted hour. Contractor was recommended to increase the frequency of using the electrical chain saw instead of the diesel chain saw for reducing the noise impact. Environmental Team conducted additional ad-hoc noise monitoring on 19:00 14 <sup>th</sup> February 2019 to 07:00 15 <sup>th</sup> February 2019 for evaluate the effectiveness on the proposed mitigation measures. No project-related noise exceedance case on 14-15 Feb 2019 Contractor's night tree-felling and removal works. The proposed mitigation measures were effective for noise impact. | 20/02/2019    |
| COM-2019-006  | 22/02/2019                 | Project Hotline of NE/2017/05 | CCZJV       | Noise               | 26/02/2019            | According to the location of complainant from Kwai Wo House, the complaint was related to the project. Although the tree felling works were covered by the valid CNP (GW-RN0783-18), Contractor was reminded to strictly follow and fully comply with the CNP conditions and the mitigation measures stipulated in the EM&A Manual when construction activities are operating during restricted hour. An extended barrier at the top acts as a cantilever shape was recommended to modify the existing semi-enclosure installed in the cherry picker Also, three sides with top as a semi-enclosure to be used and those tree felling activities should be inside the semi-enclosure in the ground slope. The main contractor had been recommended to review their works program and methods of tree felling as to minimize the night time tree felling activities.                                                                                   | 04/03/2019    |
| COM-2019-0010 | 28/03/2019                 | Project Hotline of NE/2017/05 | CCZJV       | Noise               | 28/03/2019            | The complaint case should be related to the MTR night time maintenance works. Main Contractor used portable phones and head-set only for communication, and none of loudspeakers were allowed to be used. Main Contractor handled of tree debris                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                      | 04/04/2019    |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From        | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                            | Date of Reply |
|---------------|----------------------------|----------------------|-------------|---------------------|-----------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
|               |                            |                      |             |                     |                       | into the lorry skip in care when loading. Besides, a layer of soft material (soil/tree debris) was observed leaving inside the skip of the grab lorry to reduce the loading noise. Contractor was reminded to strictly follow and fully comply with the CNP (GW-RN0132-19) conditions and the mitigation measures stipulated in the EM&A Manual when construction activities are operating during restricted hour.                                                                                                                                                                                                                                                                                                                                                                                                                                                                            |               |
| COM-2019-0033 | 26/07/2019                 | Police visit on-site | CCZJV       | Noise               | 26/07/2019            | The complaint is related to the project. The Main Contractor comply with CNP No.: GW-RN0443-19 allowable construction site and within the site boundary to carry out night work on tree felling and the clearance of felled tree debris during the restricted hour. Contractor was reminded to strictly follow and fully comply with the CNP (GW-RN0443-19) conditions and the mitigation measures stipulated in the EM&A Manual when construction activities are operating during restricted hour. Contractor was recommended to increase the frequency of using the electrical chain saw instead of the diesel chain saw for reducing the noise impact. Contractor was reminded to reschedule of tree felling arrangement that most of the fell branches and trunks were temporary laid on slope and arranged to cut smaller on Day Time to minimize the noise nuisance to the nearby NSRs. | 30/07/2019    |
| COM-2019-0045 | 30/08/2019                 | 1823                 | CCZJV       | Noise               | 30/08/2019            | The complaint is related to the project. Contractor was reminded to strictly follow and fully comply with the CNP (GW-RN0443-19) conditions and the mitigation measures stipulated in the EM&A Manual when construction activities are operating during restricted hour. Contractor should strictly follow the use of acoustic enclosure as in condition 3.d.5. of the CNP during the operation of breaker, hand-held, mass $\leq 10\text{kg}$ (CNP023) shall only be operated inside the acoustic enclosure composed of four side-panels and one top-panel, so that no part of such equipment is visible from any nearby noise sensitive receiver. The panels shall be made of minimum 10mm thick plywood or 1mm thick steel outer skin and minimum 50mm thick sound                                                                                                                         | 19/09/2019    |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From                         | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               | Date of Reply |
|---------------|----------------------------|---------------------------------------|-------------|---------------------|-----------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
|               |                            |                                       |             |                     |                       | absorbing lining, or equivalent construction. Contractor was reminded to use portable phones and head-set only for communication, and none of loudspeakers is allowed for night work activities.                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                 |               |
| COM-2019-0056 | 09/10/2019                 | Project Hotline of NE/2017/05 and EPD | CCZJV       | Noise               | 19/10/2019            | The complaint of the construction noise especially the breaker noise is project related. Due to the concern of road safety, the Contractor conducted the emergency road repair works under an Emergency Excavation Permit (EXP) of Plan ID: EO13123 issued by Highways Department (HyD). The main contractor's PR / hotline staff was reminded to enhance communication with sufficient information provided for replying any enquiry / complaint in the future. The main contractor was also reminded that noise mitigation measures should be provided as far as practicable subject to the emergency situation. For construction works covered by the CNP issued by EPD, the main contractor should fully comply with the conditions as stipulated and provided all noise mitigation measures as required under the conditions of the CNP. For works subject to the emergency situation, noise mitigation measures such as noise barrier, enclosure etc. should be provided as far as practicable to minimise the noise nuisance to the NSRs. | 04/11/2019    |
| COM-2019-0057 | 09/10/2019                 | EPD                                   | CCZJV       | Noise               | 18/10/2019            | The complaint of the generator noise nuisance is related to the project. The concerned portable generator is supplying electric power for the Variable Message Sign (VMS) showing the speed limit in 50 km/hr. It is switched on and off manually by manpower, and would only be operated between daytime 07:00-19:00. No construction noise permit (CNP) should be required as the portable generator is not operating in restricted hours. The main contractor was reminded to strictly follow the use of their proposed semi-enclosure as the mitigation measures for the portable generator and the generator operates in daytime 07:00-19:00 only.                                                                                                                                                                                                                                                                                                                                                                                          | 21/10/2019    |

# FUGRO TECHNICAL SERVICES LIMITED

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From               | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                     | Date of Reply |
|---------------|----------------------------|-----------------------------|-------------|---------------------|-----------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| COM-2019-0066 | 06/11/2019                 | EPD                         | CCZJV       | Noise               | 07/11/2019            | The complaint of the emergency road repair work is related to the project. The works on on 5 <sup>th</sup> November 2019 between 22:00 and 06:00 the next day at southbound slow lane of Tai Po Road outside Wai Wah Centre, including breaking operation. The main contractor should inform the EPD in advance of any emergency opening works of the Project in future to facilitate the effective handling of noise complaint that may arise.                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        | 12/11/2019    |
| COM-2020-0083 | 29/02/2020                 | Project email of NE/2017/05 | CCZJV       | Noise and Dust      | 29/02/2020            | <p>The complaint of the dust and noise nuisance near Wai Wah Centre during both the day and night works was at zone 2. The construction works at zone 2 was the mini-piling operation during the day time was same as the complaint. Thus, the complaint in daytime is related to the project. Furthermore, loading and unloading works was carried in night time.</p> <p>Contractor was reminded to enhance the water spray frequency on the construction site for mitigation measures on dust control. Also, Contractor should provide green tarpaulin curtain and additional acoustic Sound Proof Canvas as a secondary layer at the bottom of the mini-pile drilling machine to secure the total enclose condition to minimize the visual and noise impacts to nearby NSRs.</p> <p>ET checked the regular impact air and noise monitoring data between day time and night-time regular noise monitoring data, no exceedance case was found on both regular impact air and noise monitoring measurement.</p> <p>The main contractor should carry out further review the effectiveness of the enclosure or noise barrier with their mitigation measure and propose alternative noise mitigation measures to enhance the noise reduction on similar day works or night works in restricted hours.</p> | 19/03/2020    |
| COM-2020-0089 | 24/03/2020                 | Project hotline             | CCZJV       | Noise               | 24/03/2020            | A resident of Wai Wah Centre complained that noise generated from construction activities at night disturbing the nearby resident. According to the Contractor's information, loading/unloading, steel bar cutting, steel plate grinding and asphalt compaction were carried out in the early hours of 24 <sup>th</sup>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                | 07/04/2020    |

# FUGRO TECHNICAL SERVICES LIMITED

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From   | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                         | Date of Reply |
|---------------|----------------------------|-----------------|-------------|---------------------|-----------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
|               |                            |                 |             |                     |                       | Mar 2020. The night work activities were within the site boundary. Also, 4 sides with top cover acoustic enclosure for the portable generator was used during the night work. Furthermore, mitigation measures listed in the CNP were implemented for PME and works activities. Three sides with top cover enclosure and additional acoustic comprised with 50 mm sound absorbing lining were used for night works activities. ET analysed that the complaint noise source should not be project-related construction noise.                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               |               |
| COM-2020-0090 | 27/03/2020                 | Project hotline | CCZJV       | Noise               | 27/03/2020            | Both complaint cases were concerning about the noise nuisance generated from the construction work activities at night time disturbing the nearby Wai Wah Centre residence. According to the Main Contractor, similar nature of major construction works carried out between 03:00 a.m. and 04:00 a.m. on 27 <sup>th</sup> & 28 <sup>th</sup> March 2020 was the asphalt compaction for the road surface remedial works at zone 2 south lane adjacent to Wai Wah Centre. The Main Contractor complied with CNP No.: GW-RN0002-20 that is within the allowable construction site location and within the site boundary to carry out night work on loading and unloading works. ET conduct regular night-time noise monitoring at all monitoring stations between 23:00 26 <sup>th</sup> March 2020 to 04:00 27 <sup>th</sup> March 2020, and between 23:00 2 <sup>nd</sup> April 2020 to 04:00 3 <sup>rd</sup> April respectively. No exceedance cases were found on both ET regular night-time noise monitoring measurement. ET did not remark on-site any noise related to construction works at above noise monitoring nights for which the results were lower than baseline noise level. Hence, ET analysed that the dominant noise source should be road traffic noise but not the project-related construction noise. | 04/05/2020    |
| COM-2020-0091 | 28/03/2020                 | Project hotline | CCZJV       | Noise               | 28/03/2020            |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                            |               |
| COM-2020-0093 | 06/04/2020                 | Project hotline | CCZJV       | Noise               | 06/04/2020            | The complaint case on 6 <sup>th</sup> Apr was received by project hotline. The major construction works between (10:00pm – 11:00pm) on 6 <sup>th</sup> April 2020 was TTA implementation works and asphalt removal works for the road surface remedial work at zone 2 adjacent to Wai Wah Centre. The Main Contractor complied with                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        | 28/04/2020    |

# FUGRO TECHNICAL SERVICES LIMITED

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From   | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   | Date of Reply |
|---------------|----------------------------|-----------------|-------------|---------------------|-----------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
|               |                            |                 |             |                     |                       | CNP No.: GW-RN0152-20 that is within the allowable construction site location and within the site boundary to carry out night work on loading and unloading works. The five noise monitoring stations close to the concerned works area are NMS3, NMS4, NMS5A, NMS6A & NMS7, and NMS5A & NMS6A locate nearest to Wai Wah Centre. The night time noise monitoring results measured at NMS3, 4 & 6A were all lower than that of measured in the baseline, two exceedance case were found at NMS 5A especially NMS 5A & NMS 6A monitoring stations where locate at the Wai Wah Centre. The corrected noise level measured at NMS 7 is lower than the night time limit 55dB (A). Therefore, there was no exceedance cases were found on ET regular night-time noise monitoring measurement. ET analyzed that the dominant noise source should be road traffic noise but not the project-related construction noise.                                                                                                                                                                                                                                                                                                                      |               |
| COM-2020-0096 | 20/04/2020                 | Project hotline | CCZJV       | Noise               | 20/04/2020            | A continues complaint were received on 20 Apr and 21 Apr 2020. A resident of Wai Wah Centre filed three complaints about the noise nuisance generated by the nearby construction activities during daytime. Two complaints were made through project hotline on 20 <sup>th</sup> Apr 2020 at 10:57 a.m. and 21 <sup>st</sup> Apr 2020 at 9:03 a.m., while the other one was through project email on 20 <sup>th</sup> Apr 2020 at 12:43 p.m. The noise source(s) of the concerned nuisance during complaint period should be mini piling works, which is opposite to Wai Wah Centre. According to the contractor's work schedule, major day work activity was mini-piling operation since early Feb 2020 at zone 2 in central median at non-restricted hours, from Mondays to Saturdays between 0800 and 1800 not including General Holidays. The mini piling operation on 20 <sup>th</sup> & 21 <sup>st</sup> Apr 2020 was carried out at non restricted hours. The limited level of noise generated by the construction of the Project during the non-restricted daytime hours will be 75 dB (A) for dwelling. The mini piling operation on 20 <sup>th</sup> and 21 <sup>st</sup> Apr 2020 was carried out at non restricted hours | 19/05/2020    |
| COM-2020-0097 | 20/04/2020                 | Project Email   | CCZJV       | Noise               | 20/04/2020            |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                      |               |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From   | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                      | Date of Reply |
|---------------|----------------------------|-----------------|-------------|---------------------|-----------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| COM-2020-0098 | 21/04/2020                 | Project hotline | CCZJV       | Noise               | 21/04/2020            | with green tarpaulin curtain and sound proof canvas. The noise level of NMS 5A and NMS 6A on 22 <sup>nd</sup> Apr 2020 were 73.5 dB (A) and 72.6 dB (A) respectively. No noise exceedance was occurred at NMS 5A and NMS 6A. The construction activity on 22 <sup>nd</sup> Apr 2020 was similar to 20 <sup>th</sup> and 21 <sup>st</sup> Apr 2020. Therefore, ET's day-time monitoring result on 22 <sup>nd</sup> April 2020 at NMS5A and NMS6A can act as a reference for impact noise from the similar mini-piling operation on 20 <sup>th</sup> and 21 <sup>st</sup> April 2020. ET analyzed that the dominant noise source should be road traffic noise but not the project-related construction noise.                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             |               |
| COM-2020-0099 | 21/04/2020                 | Project hotline | CCZJV       | Noise               | 21/04/2020            | The complaint cases on 21 <sup>st</sup> Apr 2020 was received by project hotline from Police. According to the complainant who is the local resident at Wai Wah Centre, the noise source(s) of the concerned nuisance during night works was at zone 2 is opposite to Wai Wah Centre. The major construction works was road surface remedial work since 15 <sup>th</sup> April 2020 conducted at restricted hours along zone 2 south boundary adjacent to Wai Wah Centre. The Main Contractor complied with CNP No.: GW-RN0152-20 that is within the allowable construction site location and within the site boundary to carry out night work on road surface remedial works. Environmental Team (ET) conduct a regular night-time noise monitoring at all monitoring stations between 23:00 23 <sup>rd</sup> April 2020 to 04:00 24 <sup>th</sup> April 2020. The five noise monitoring stations close to the concerned works area are NMS3, NMS4, NMS5A, NMS6A & NMS7, and NMS5A & NMS6A locate nearest to Wai Wah Centre. There were no exceedance on the night time noise monitoring, especially measured at NMS 5A & NMS 6A where locate at the Wai Wah Centre, the measured result at NMS 5A & 6A were all lower than that of measured in the baseline. Therefore, no exceedance cases were found on ET regular night-time noise monitoring measurement. ET analyzed that the dominant noise source should be road traffic noise but not the project-related construction noise. | 05/05/2020    |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From   | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                | Date of Reply |
|---------------|----------------------------|-----------------|-------------|---------------------|-----------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| COM-2020-0100 | 23/04/2020                 | Project hotline | CCZJV       | Noise               | 23/04/2020            | The complaint was received via project hotline on 23 <sup>rd</sup> April 2020 at 10:45 a.m. A resident of Wai Wah Centre complained that noise generated from operation of the two piling machines disturbing her daughter's study for DSE examination, and demanding limitation on operation hours of the machines only at two separate periods between 12 noon and 1p.m and 3 p.m. to 6 p.m. According to the Main Contractor, the major construction works at day time (08:00-18:00) on 23 <sup>rd</sup> April 2020 was mini-piling operation at Zone 2 Central Median of Tai Po Road near Wai Wah Centre. According to the photo records of day-time site condition on 23 <sup>rd</sup> April 2020 provided by Main Contractor, the green tarpaulin curtain was provided for the mini-pile drilling machines so that the bottom part of the mini-pile drilling machine was blocked from view of nearby NSR (e.g. residents at Wai Wah Centre) and an additional layer of sound proof canvas was installed at lower level to mitigate the noise from mini-pile drilling operation. The day-time noise monitoring results measured at NMS3, 4, 5A, 6A and 7 were all lower than the limit level, especially NMS 5A & NMS 6A monitoring stations where locate at the Wai Wah Centre. The monitoring results show no noise exceedance occurred at both locations. Thus, ET day-time monitoring result on 22 <sup>nd</sup> April 2020 at NMS5 & NMS6 can be act as a reference for impact noise from the similar mini-piling operation activities on 23 <sup>rd</sup> April 2020. Therefore, there was no exceedance cases were found in ET regular day-time noise monitoring measurement. ET analyzed that the dominant noise source should be road traffic noise but not the project-related construction noise. | 11/05/2020    |
| COM-2020-0101 | 28/04/2020                 | 1823            | CCZJV       | Noise               | 28/04/2020            | The complainant on via ICC1823 on 28 <sup>th</sup> April 2020 complained about the noise and odor nuisance generated from the night-time asphalt laying construction works at Shatin Rural Committee Road (Zone 3) area. Although the main contractor no work at zone 3, but the major night-time construction works was road surface remedial work which was related to the                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                      | 15/05/2020    |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                          | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
|               |                            |               |             |                     |                       | complainant concerned. The major construction works was road surface remedial work since 15 <sup>th</sup> April 2020 at approved restricted hours along zone 2 south boundary adjacent to Wai Wah Centre. Also, Tai Po Road is the main strategic route, implementation of temporary traffic diversion at day time due to loading and unloading material or plant work or road surface remedial work is not feasible. The lorry had been used in TTA implementation & road opening, portable generator and electric handheld breaker had been used in asphalt removal work, dump truck with grab had been used for loading and unloading of asphalt or rubble, vibratory compactor had been used in asphalt compaction for road surface remedial works on 27 <sup>th</sup> April 2020. The Main Contractor complied with CNP No.: GW-RN0152-20 that allowed PME used in Group C or Group F. According to the Main Contractor, advance "Notice to Affected Residents" had been issued and distributed on 26 <sup>th</sup> March 2020 in accordance with the CNP advice that prior notification should be given to nearby residents. Besides, the road re-surfacing work would be carried out at approximately 14 night-time works between 2 <sup>nd</sup> and 28 <sup>th</sup> April 2020 listed in the distributed notices. No exceedance cases were found on ET regular night-time noise monitoring measurement at all noise monitoring stations, especially measured at NMS 5A & NMS 6A where locate close to the works area (Wai Wah Centre in Zone 2), the measured result at NMS 5A & 6A were all lower than that of measured in the baseline. ET analyzed that the dominant noise source should be road traffic noise but not the project-related construction noise. |               |
| COM-2020-0151 | 10/11/2020                 | EPD           | CCZJV       | Water               | 10/11/2020            | The complainant on 10 <sup>th</sup> November 2020 complained about water discharge onto the traffic lanes of Northbound towards Sha Tin Section of Tai Po Highway. According to the Main Contractor, there is one active site access located at Zone 1 (R1) near Pai Tau, site access no. is N02. Restricted opening hours of the site access Zone 1 (R1) is between 10:00 to 16:00.                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        | 27/11/2020    |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
|               |                            |               |             |                     |                       | The operation which might be related to the complaint was water flow from water-filled barriers before the opening of site access and no water spilling onto the traffic lanes from the access area of Zone 1 (R1). The released water was directed towards to the work areas facing Zone 1 (R1) and no water was flowed towards the high-speed road or traffic lanes. ET conducted ad-hoc site inspection on 17 <sup>th</sup> November 2020. ET had no particular findings related to the complaint and conducted trial to open the bottom of the water barrier valve for testing and checking on the water flow to the construction site at Zone 1. Contractor performed well on environmental preventive measures for soil or silt leakage protection as impervious sheet with sand bags had been provided at the site boundary of Zone 3. ET analyzed that released water was directed towards to the work areas facing Zone 1 (R1) and no water was flowed towards the high-speed road or traffic lanes.                                                                                                                                    |               |
| COM-2020-0152 | 20/11/2020                 | 1823          | CCZJV       | Noise               | 20/11/2020            | <p>The complainant on via ICC1823 on 20<sup>th</sup> November 2020 complained about the noise generated from the night-time asphalt laying construction works between Sha Tin Station and nearby Wo Che Estate. Although the main contractor no work at zone 5, but the major night-time construction works was road surface remedial work which was related to the complainant concerned. According to the Main Contractor, the major construction works was road surface remedial work since 19<sup>th</sup> November 2020 conducted at restricted hours along zone 3 to zone 4 north bound of Tai Po Road Sha Tin section. 3.20</p> <p>No exceedance cases were found on ET regular night-time noise monitoring measurement (Appendix F) at all noise monitoring stations. Contractor placed acoustic enclosure "SilentCUBE" with four sides and a top cover at asphalt removal works to mitigate. The Main Contractor was reminded to pay attention to CNP other condition 3.d.3, the electric hand-held breaker shall only be used for carrying out construction work between 22:00 – 23:30 hours. It is prohibited to use the electric</p> | 07/12/2020    |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                 | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
|               |                            |               |             |                     |                       | hand-held breaker beyond the CNP condition 3.d.3 stated that the using limitation on 23:30. The Main Contractor was reminded to re-arrange their proposed night-time construction activities to fulfill the complainant expectation that noise emitting work should be paused during 00:00 to 06:00 sleeping time.                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                 |               |
| COM-2020-153  | 26/11/2020                 | EPD           | CCZJV       | Water               | 24/11/2020            | According to EPD Mr. Bryan Kwok, EPD carried out a site inspection on 24 November 2020, revealing that muddy effluent was discharged from an outfall at Fo Tan near Jockey Club Ti-I College while construction work of the abovementioned project site at Zone 5 opposite to Wo Che Estate was in progress. EPD team inspected the condition of waste water treatment facilities on site (slope F133) and observed that the water in the first and second sedimentation tanks was muddy; muddy water was observed at the outlet level of the WetSep (waste water treatment plant) though there was no discharge and piling works at the time. EPD team reminded the Main Contractor that effluent does not complied with the discharge license standard should NOT be allowed to discharge. The waste water treatment system should be improved and maintained to ensure the effluent discharge standard. EPD team requested in both works area of Slope F133 and Slope F163 the Main Contractor to locate the network of drainage, connecting manhole(s) and downstream manhole, check if any presence of muddy materials and clear-out. The main contractor was reminded to strictly follow and fully comply with the water discharge license (WT00032446-2018) conditions and the mitigation measures stipulated in the EM&A Manual for effluent discharge on the wastewater treatment system. | 23/12/2020    |
| COM-2020-154  | 27/11/2020                 | 1823          | CCZJV       | Noise               | 30/11/2020            | The complaint was received via ICC1823 on 27 <sup>th</sup> November 2020, the complainant expressed concern of construction noise nuisances near Wo Che Estate at around 01:14 am on 27 <sup>th</sup> November 2020. According to the Main Contractor, there were no construction works near Wo Che Estate (Zone 5) on 26 <sup>th</sup> 27 November 2020. The major construction works were works                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  | 14/12/2020    |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                            | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
|               |                            |               |             |                     |                       | related to removal of central median (at night-time) under the approved road closure with CNP no.GW-RN0799-20. According to Main Contractor EO Kimberly, she sent prior notification to the EPD on 20 <sup>th</sup> November 2020 through logging in the webpage of EPD before the commencement of the construction work in relation to the CNP GW-RN0799-20 (conditions 3.d.11 and 4.d.8). The Main Contractor provided photo records showing that mitigation measures of the movable acoustic enclosure "SilentCUBE" with four sides and a top cover were implemented for night work on removal of existing central median: drill hole with percussive drill for temporary steel module spiral installation, drill hole at existing central median with concrete corer and asphalt compaction with portable roller. Main Contractor was reminded to strictly follow and fully comply with the CNP No.: GW-RN0799-20 conditions. 5.11 The Main Contractor was reminded to re-arrange their proposed night-time construction activities to fulfill the complainant expectation that noise emitting work should be paused during 00:00 to 06:00 sleeping time. |               |
| COM-2020-155  | 26/11/2020                 | 1823          | CCZJV       | Dust                | 30/11/2020            | According to the complainant, the dust nuisance concerned at day time was at the slip road to Fo Tan Road near Lok King Street near Zone 5 works area. According to the Main Contractor, the major day time construction works at Zone 5 works area in November were mini-piling works and slope works of soil replacement. Regular movement of vehicle for transportation was also carried out on site. Thus, the complaint was considered to be related to the project. ET conducted regular day-time air quality monitoring in November 2020 and on the 3 <sup>rd</sup> December 2020 at selected air monitoring stations AMS6, 8, 11A & 13 and AMS5, 4A, 7A & 12 respectively. The two air quality monitoring stations closed to the works area at zone 5 (where the complainant concerned of dust nuisance) were AMS12 and AM13; and AMS13 locate nearest to Zone 5. The ET regular air quality results measured at AMS13 and AM12                                                                                                                                                                                                                       | 05/01/2021    |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : [matlab@fugro.com](mailto:matlab@fugro.com)  
Website : [www.fugro.com](http://www.fugro.com)



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
|               |                            |               |             |                     |                       | in November 2020 and on the 3 <sup>rd</sup> December 2020 show that there was no exceedance case found in air quality monitoring measurement and the results were all below the action level. The Main Contractor was reminded to enhance the mitigation measures in dust control such as increase the water spray frequency at the construction site to suppress dust emission. The Main Contractor proposed to properly maintain the coverings on exposed slopes and keep them in good condition for minimizing dust impact. The Main Contractor proposed to frequently spraying of haul road especially at area where active movement of vehicles and pave the haul road where necessary to reduce dust impact.                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        |               |
| COM-2020-157  | 07/12/2020                 | STDC          | CCZJV       | Dust                | 07/12/2020            | According to the complainant, the dust nuisance concerned at day time was generated from the construction works area of the Tai Po Road Widening project at Zone 5. According to the Main Contractor, major day time construction works of mini-piling and soil replacement at slopes were carried out at Zone 5 works area in December 2020. There was also regular movement of vehicle for transportation within the works area. Thus, the complaint was considered to be related to the project. ET conducted regular day-time air quality monitoring (Appendix C) on the 3 <sup>rd</sup> , 9 <sup>th</sup> & 15 <sup>th</sup> December 2020 respectively which was close to the date of complaint, at selected air monitoring stations AMS5, AMS4A, AMS7A & AMS12. ET regular day-time air quality monitoring measurement results at air quality monitoring stations AMS12, closest to Zone 5. The ET regular air quality results measured at AM12 on 3 <sup>rd</sup> , 9 <sup>th</sup> & 15 <sup>th</sup> December 2020 show that there was no exceedance case was found in air quality monitoring measurement and the results were all below the action level. The Main Contractor was reminded to reduce the travelling speed of transportation vehicles on site and plan the schedule of delivery transport in order to reduce dust impact. The Main Contractor proposed to continue in maintaining the coverings on exposed slopes in good condition for minimizing dust impact. | 29/12/2020    |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                           | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
|               |                            |               |             |                     |                       | The Main Contractor proposed to increase water spraying at area where active movements of vehicle transportation occur.                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                      |               |
| COM-2020-161  | 18/12/2020                 | EPD           | CCZJV       | Noise               | 18/12/2020            | <p>The complaint was received via email notification by EPD on 18<sup>th</sup> December 2020, the complainant expressed concern of construction noise nuisances near Wo Che Estate during night-time on 7<sup>th</sup> &amp; 8<sup>th</sup> December 2020. According to the Main Contractor, the major construction works was removal of central median works since 7<sup>th</sup> &amp; 8<sup>th</sup> December 2020 conducted at restricted hours along Zone 4 central median of Tai Po Road Sha Tin section. Thus, the complaint is considered to be related to the project. 3.4 According to the Main Contractor, portable generator with hand-held breaker had been used for breaking of asphalt (on existing central median edge); lorry with crane, portable generator and concrete corer had been used for remove (lifting) the existing central median and coring of central median joint; dump truck with grab had been used for loading and unloading of rubble; portable roller had been used in asphalt compaction; lorry with crane, percussive and hand-held drill and portable generator had been used for installation of temporary steel module between 00:30 to 04:30 am on 7<sup>th</sup> December 2020. The Main Contractor complied with CNP No.: GW-RN0799-20 that allowed the usage of PMEs. The noise emanated from the concrete corer for drilling hole at existing central median and portable roller for asphalt compaction might cause a noise nuisance. To further alleviate the noise nuisance, the Contractor placed acoustic enclosure "SilentCUBE" with four sides and a top cover at removal of existing central median and asphalt compaction works to mitigate as shown in the site condition photo record. No exceedance cases were found on ET regular night-time noise monitoring measurement (Appendix F) at all noise monitoring stations, especially measured at six noise monitoring stations mentioned in above section 3.15 where locate close to the works area (Sha Tin station to nearby Fung Wo Estate in Zone 4), the measured result at NMS16, NMS18</p> | 05/01/2021    |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
|               |                            |               |             |                     |                       | and NMS26 were lower than that of measured in the baseline. Besides, the measured result after correction of baseline at NMS13, NMS14 and NMS15 were lower than that of the limit level. The Main Contractor was reminded to re-arrange their proposed night-time construction activities especially in quiet construction works to minimize the noise nuisance to nearby residences. The Main Contractor was reminded to re-arrange their proposed night-time construction activities to fulfill the complainant expectation that noise emitting work should be paused during night sleeping time.                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       |               |
| COM-2020-167  | 22/02/2021                 | 1823          | CCZJV       | Dust                | 22/02/2021            | A complainant who did not wish to disclose his identity called 1823 hotline on 22 <sup>nd</sup> February 2021 regarding the dust nuisance at slip road to Fo Tan Road. A repetitive case with reference no. 3-6566315922 was referred to the Main Contractor of the captioned Project and ET on 23 <sup>rd</sup> February 2021. According to the complainant, the dust nuisance concerned at day time was at the slip road to Fo Tan Road near Zone 5 works area. According to the Main Contractor, the major day time construction works at Zone 5 works area in February 2021 was mini-piling works. Regular movement of vehicle for transportation was also carried out on site. Thus, the complaint was considered to be related to the project. The Main Contractor was reminded to reduce the travelling speed of transportation vehicles on site and plan the schedule of delivery transport in order to minimize the dust impact. The Main Contractor proposed to reduce the exposed surface by providing covers or paving (e.g. with cement grout) to the newly excavated slope. | 05/03/2021    |
| COM-2020-168  | 20/02/2021                 | 1823          | CCZJV       | Noise               | 23/02/2021            | The complaint was received via 1823 on 20 <sup>th</sup> February 2021 01:00 am concerning about the night-time construction works near Sha Tin Police Station at 19 <sup>^</sup> 20 February 2021. According to the Main Contractor, there was night-time construction works near Sha Tin Police Station (Zone 3 & 4) on 19 <sup>^</sup> 20 February 2021. The major construction works were lane shifting works conducted on 19 <sup>^</sup> 20 February 2021 at night-time under                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        | 08/03/2021    |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                              | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
|               |                            |               |             |                     |                       | approved road closure setup with in-force Construction Noise Permit (CNP) no.GW-RN0798-020. According to the Main Contractor, since Tai Po Road is the main strategic route, implementation of temporary traffic diversion at day time due to loading and unloading material or plant work or road surface remedial work is not feasible. The concerned night work could only be conducted during off-peak period at night time under temporary traffic diversion to avoid causing traffic congestion. According to the Main Contractor, no concurrent operation of Power Mechanical Equipment (PME) and idling were switched off during the loading and unloading of materials and rubble by manual handling of road surface remedial works. Environmental Team (ET) conduct a regular night-time noise monitoring at all monitoring stations between 23:00 25 <sup>th</sup> February to 03:00 26 <sup>th</sup> February 2021. 3.13 The five noise monitoring stations close to the complaint receiving area of Zone 3 & 4 are NMS13, NMS14, NMS15, NMS16 & NMS26. No exceedance cases were found on ET regular night-time noise monitoring measurement at all noise monitoring stations, especially measured at five noise monitoring stations where locate close to the works area (near Sha Tin Police Station in Zone 3&4), the measured result at NMS15, NMS16 and NMS26 were lower than that of measured in the baseline. Besides, the measured result after correction of baseline at NMS13 and NMS14 were lower than that of the limit level in 55 dB(A). The Main Contractor was reminded to strictly follow and fully comply with the CNP (GW-RN0798-20) conditions and the mitigation measures stipulated in the EM&A Manual when construction activities are operating during the restricted hour. |               |
| COM-2021-0170 | 03/03/2021                 | 1823          | CCZJV       | Dust and Noise      | 04/03/2021            | The complaint on 3rd March 2021 at 1:25 pm complained about the noise, dust nuisance generated and insufficient dust mitigation works during the night-time construction works near King Wo House and Wo Che Estate area. A repetitive case with reference no. 3-6638500887 was referred to the Main Contractor                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                 | 25/03/2021    |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                         | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
|               |                            |               |             |                     |                       | and ET of the captioned project on 4th March 2021. According to the Main Contractor, there was night time road works at King Wo House and Wo Che Estate (Zone 4 & 5) on 3rd March 2021. Thus, the complaint considered to be related to the project. According to ET investigation, the Main Contractor complied with the CNP No.: GW-RN0798-020, with the permission of using Powered Mechanical Equipment (PMEs). No exceedance cases were found on ET regular night-time noise monitoring measurement (Appendix G). The Main Contractor was reminded to close all the doors of the acoustic enclosure, included the "SilentCUBE" for hand-held breaker and metallic enclosure. Consider the dust nuisance, no exceedance cases were found on ET regular air quality monitoring measurement (Appendix F). According to the Main Contractor, vapour was emitted from the bottom of the miller, when the milled asphalt falling from the drop point of the conveyor belt to the dump truck container, fugitive dust was generated. The Main Contractor was reminded to enhance the water spray frequency and keep the road surface wet before milling as the mitigation measures on fugitive dust control. |               |
| COM-2021-0172 | 03/03/2021                 | 1823          | CCZJV       | Noise               | 08/03/2021            | The second complaint was received on 3rd March 2021 at 1:40 pm complained about the noise nuisance generated during the night-time construction works near Shatin Pui Ying College area. A repetitive case with reference no. 3-6638578830 was referred to the Main Contractor and ET on 8th March 2021. According to the main contractor, there was a night-construction activity near Shatin Pui Ying College and Wo Che Estate (Zone 4 & 5). Thus, the complaint considered to be related to the project. According to ET investigation, the Main Contractor complied with the CNP No.: GW-RN0798-020, with the allowed usage of PMEs. No exceedance cases were found on ET regular night-time noise monitoring measurement (Appendix G). The Main Contractor was reminded to strictly follow and fully comply with the CNP No.: GW-RN0798-20 conditions and the mitigation measures                                                                                                                                                                                                                                                                                                                    | 25/03/2021    |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                          | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
|               |                            |               |             |                     |                       | stipulated in the EM&A Manual when construction activities were operated during the restricted hour. The contractor was also reminded to use a movable noise barrier/blanket to block the line of sight from the engine or noise emission part to the nearby NSRs when using PMEs.                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                          |               |
| COM-2021-0193 | 09/05/2021                 | 1823          | CCZJV       | Noise               | 17/05/2021            | <p>The complaint was first received on 6<sup>th</sup> May 2021 at 9:27 a.m. via FEHD email. The complaint was then referred to 1823 case: 3-6727963845 on 9<sup>th</sup> May 2021 at 2:52 p.m. A follow-up complaint was received on 11<sup>th</sup> May 2021 at 8:20 a.m. The two complaints were referred from 1823 to CEDD on 14<sup>th</sup> May 2021 at 6:26 p.m. The complaint cases was referred from AECOM to ET on 17<sup>th</sup> May 2021 at 11:46 a.m. According to the Main Contractor, the major construction works at daytime (08:00-18:00) between 6<sup>th</sup> to 11<sup>th</sup> May 2021 near Mei Wo House were soil replacement works (involved excavation, loading and unloading of materials and pour the no fine concrete) at the works area 1 (between Wo Che Estate King Wo House and Shatin Pui Ying school) and demolition of existing central divider works (involved breaking, loading and unloading of materials) at the work area 2 (opposite to Wo Che Estate Man Wo House). The ET regular daytime noise monitoring measurement results of NMS16, NMS17, NMS18, NMS19, NMS20 &amp; NMS26 on 6<sup>th</sup>, 7<sup>th</sup>, 12<sup>th</sup> and 13<sup>th</sup> May 2021, no exceedance case found. The noise monitoring results were lower than the noise limit of 75 dB(A) <math>L_{eq}</math> (30 minutes) at the facade of dwellings and 70 dB(A) <math>L_{eq}</math> (30 minutes) at the facades of schools (65 dB (A) during examinations). The Main Contractor installed an acoustic blanket, enclosed at the breaker to minimize the noise impacts to nearby NSRs. The Main Contractor was reminded to maintain the newly implemented noise mitigation measure during breaking works. The Main Contractor was reminded to provide additional mitigation measures to minimize the noise nuisance to the NSRs (similar to night-time construction works) during the construction works, for example moveable noise barrier or blanket to block</p> | 27/05/2021    |

# FUGRO TECHNICAL SERVICES LIMITED

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No.                   | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   | Date of Reply |
|---------------------------------|----------------------------|---------------|-------------|---------------------|-----------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
|                                 |                            |               |             |                     |                       | the line of sight from the engine and noise emission parts to the nearby NSRs.                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       |               |
| COM-2021-0200 and COM-2021-0202 | 07/06/2021                 | 1823          | CCZJV       | Noise               | 08/06/2021            | <p>Ms. So, a resident of Wo Che Estate, Mei Wo House complained about the noise generated from the daytime construction work located outside Mei Wo House, the tunnel entrance (direction towards Fo Tan). Until 7<sup>th</sup> June 2021, total six complaints were received via 1823 (case: 3-6727963845) from the same complainant. According to the Main Contractor's daytime working schedule from 12<sup>th</sup> May to 7<sup>th</sup> June 2021 at zone 5 were soil replacement works (involved excavation, loading and unloading of materials, pour the no fine concrete and formation of haul road) and demolition of existing central divider works (involved loading and unloading of materials, minor breaking and corning operation). According to CEDD, a reply was sent to Ms. So on 27<sup>th</sup> May 2021. The Resident Site Staff (RSS) of AECOM contacted the complainant on 7<sup>th</sup> June 2021 night to explain the detail of upcoming construction work and associated noise mitigation measures to minimize the construction noise arising from the concerned construction work. The complainant was also informed that she could contact the RSS directly if she had any further enquiry in future. ET conducted regular daytime noise monitoring at NMS16-20 and NMS26 monitoring stations on 6<sup>th</sup>, 7<sup>th</sup>, 12<sup>th</sup>, 13<sup>th</sup>, 17<sup>th</sup>, 18<sup>th</sup>, 24<sup>th</sup>, 25<sup>th</sup> of May and 4<sup>th</sup>, 5<sup>th</sup>, 10<sup>th</sup>, 11<sup>th</sup> of June 2021. No exceedance case was found and the noise monitoring results were lower than the noise limit of 75 dB(A) <math>L_{eq}</math> (30 minutes) at the facade of dwellings and 70 dB(A) <math>L_{eq}</math> (30 minutes) at the facades of schools (65 dB (A) during examinations). ET reminded the Main Contractor to implement additional mitigation measures to minimize the noise nuisance generated from daytime construction works to the nearby Noise Sensitive Receivers (NSRs). The Main Contractor agreed to install an acoustic blanket, enclosed at the breaker to minimize the noise impact generated from the demolition of central divider works. The Main Contractor was reminded to maintain the noise</p> | 22/06/2021    |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                         | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
|               |                            |               |             |                     |                       | mitigation measure during the breaking works. The Main Contractor was reminded to provide additional mitigation measures during the construction works to minimize the noise nuisance to the NSRs (similar to nighttime construction works), for example, a temporary moveable noise barrier to lower the noise impact and an acoustic blanket to block the line of sight from the engine and noise emission parts to the nearby NSRs. The Main Contractor was also reminded to display the project hotline number 5613-3367 on-site for public enquiry.                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   |               |
| EN-2021-0094  | 26/07/2021                 | EPD           | CCZJV       | Air (Odour)         | 27/07/2021            | <p>A resident of Paris Park Villa complained about the poor air quality around his living area between 19th and 26th July 2021. He suspected that the odour nuisance may be generated from the construction site's diesel machineries. The complaint was received by the EPD's Regional Office (North) on 26<sup>th</sup> July 2021 with reference no.: RN17367-21.</p> <p>According to the Main Contractor's daytime working schedule between 19th July and 26th July 2021 involved: (1) Zone 4 and 5 North boundary, the construction activities involved the formation of temporary access, backfilling works for noise barrier stem wall, loading and unloading works. Excavations were mainly performed in areas EX1 and EX2. (2) Zone 4 and 5 South boundaries, the construction activities involved the noise barrier foundation works and the formation of temporary access. Excavations were mainly performed in areas EX3 and EX4. While rebar fixing and formwork erection were also carried out in EX3 area. For area TW1 in Zone 5 South boundary, tree works were performed. There were no work activities carried out at night-time, Sunday and under the hosting of typhoon signals.</p> <p>According to AECOM's Resident Engineer and the Main Contractor, no particular malpractice was observed during the construction activities at Zone 4 and 5 between 19th and 26th July 2021. According to the Main Contractor, only machineries with valid NRMM labels and regular maintenance are being used on-site. The Main Contractor sent the Ultra-Low Sulphur Diesel</p> | 13/08/2021    |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
|               |                            |               |             |                     |                       | <p>(ULSD) sample for laboratory testing since Feb 2019. There is no exceedance of the Sulphur content of more than 0.005% by weight in the past and the latest sample collected on 7<sup>th</sup> July (Cap. 311I Air Pollution Control (Fuel Restriction) Regulations). No particular finding on odour nuisance was found by the ET's staff when performing air monitoring in AMS 14 Ha Wo Che (close to 73A Ha Wo Che) on 21st and 22nd July 2021. ET also inspected the construction site on 29th July 2021 (between 9:00 to 10:15 a.m., weekly environmental inspection). There was no particular observation on odour nuisance or diesel smell generated from the Non-Road Mobile Machineries (NRMMS) and construction activities in the North and South boundary at Zone 4 and 5. No dark smoke was observed from the excavator, power generator, piling and pre-drilling machines under operation. ET inspected the area around Paris Park Villa and Ha Wo Che on 29th July 2021 between 10:30 a.m. to 11:30 a.m. There was no particular finding on odour nuisance in AMS14 Ha Wo Che (close to 73A Ha Wo Che).</p> <p>ET reminded the Main Contractor to strictly implement the air pollution control measures and minimize the air pollution impact generated from the construction work activities. The Main Contractor also is reminded that only approved or exempted NRMMS include regulated machines and non-road vehicles with proper labels are allowed to be used in specific activities on-site. The NRMMS should be well maintained. The Main Contractor was also be reminded that odour emissions from construction sites need to be controlled. Potential emission includes particulate matter, diesel and hazardous chemicals need to be considered for their odour impact. Use of ULSD should be maintained and dark smoke emission should be prevented in accordance with the Air Pollution Control (Smoke) Regulation and ETWB TCW 19/2005. The Main Contractor was also be reminded to display the project hotline number 5613-3367 on-site for public enquiry.</p> |               |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No.                  | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             | Date of Reply |
|--------------------------------|----------------------------|---------------|-------------|---------------------|-----------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| DSD Ref: MS 8/0/CE28 15/0 pt.6 | 01/09/21                   | DSD           | CCZJV       | Water               | 02/09/21              | <p>Drainage Services Department (DSD) issued a notice (Ref: MS 8/0/CE2815/0 pt.6) to the Engineer's Representative (AECOM) after their morning inspection on 1st September 2021 concerning the improperly treated water being discharged from the construction site near Fung Wo Estate of the Project to nearby public stormwater drainage system, and of the consequence of contaminating the watercourse at Shing Mun River. The letter of concern was referred to Environmental Team (ET) on 2nd September 2021 at 3:24 p.m. for investigation.</p> <p>According to the Main Contractor and AECOM, the major construction work at Zone 5 south boundary was mini-piling works (at the end of August). Two piling machines were operating either individually or simultaneously. There are approximate 130 nos. of pile planned to be installed, and mini-piling works are scheduled to be finished in January 2022. Originally, one WetSep (TW-WS1) and two sedimentation tanks (ST1 and ST2) were provided for handling the wastewater generated from the piling works and site surface runoff at the zone 5 south boundary. According to the information report and photo records provided by the Main Contractor, the sedimentation tanks (ST1 and ST2) were filled with muddy water and silt on 1st September 2021.</p> <p>ET inspected the area at Zone 5 south boundary on 2nd, 9th, 16th and 29th September 2021. Observation, reminders and follow-up action were proposed and monitored by the ET on handling the wastewater generated from piling works and site surface run-off. Moreover, EPIs from EPD conducted the site inspection on 9th and 29th September 2021. The two inspection conducted by the EPIs focused on reviewing the general site condition, wastewater treatment facilities set-up, mitigation measures for preventing muddy water formation, handling the wastewater and surface run-off. Observation, recommendations and reminders proposed by the EPIs and ET are grouped and shown in Appendix M.</p> | 20/10/2021    |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                      | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
|               |                            |               |             |                     |                       | <p>Rectification have been reported by the Main Contractor according to the observation and recommendation from ET and EPIs on 8th, 17th, 27th September and 6th October 2021. During the 2nd joint site inspection, EPIs agreed the pilling works can be restarted. However, EPIs reminded that the 2nd pilling machine can only be operated until the 2nd WetSep is functioned properly and the effluent quality is acceptable. EPIs mentioned that follow-up inspection expected to be conducted in early or mid-October, focus on inspecting the wastewater treatment efficiency for pilling works, paving of the soil surface, mitigation measures for handling the surface run-off. EPIs also mentioned that surprise inspection may be conducted in the future. According to the AECOM, the pilling work was restarted on 30th September 2021.</p> <p>According to this incident, the Main Contractor was reminded by ET to analyze and review the efficiency of the wastewater treatment system according to the construction activities regularly. The Contractor should provide regular maintenance, water quality testing and related checklist for ET and IEC review during the site inspection. The Main Contractor and related Sub-Contractor was reminded by ET and AECOM that the discharge of effluent needs to fulfil the requirement stated in the Water Discharge License (No. WT00032446 – 2018). AECOM and ET requested the Main Contractor to update the Temporary Drainage Management Plan according to the latest work activities. ET also requested the Main Contractor to update the description of the wastewater mitigation measures inside the Environmental Management Plan (EMP) and Environmental Management Report (EMR) and strictly implement to prevent similar case happen in the future.</p> <p>A follow-up site inspection was conducted by the EPIs at Zone 5 south boundary on 26th October 2021. The EPIs reviewed the site condition, treatment efficiency of the temporary wastewater treatment facilities, mitigation measures to prevent muddy water</p> |               |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No.           | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             | Date of Reply |
|-------------------------|----------------------------|---------------|-------------|---------------------|-----------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
|                         |                            |               |             |                     |                       | generated from soil surface, discharge points and gullies condition. EPIs commented on the mitigation measure around the discharge point near WetSep TW-WS1. The bunding next to the manhole should be rectified to prevent the inflow of muddy water. EPIs reminded that mitigation measures (such as sandbags and bunding) should be provided for enclosing the area near the piling machine. It is for directing the muddy water into the temporary wastewater treatment system. EPIs also reminded regular maintenance of the temporary wastewater treatment system is needed to ensure the effluent's water quality fulfill the standard of the Water Discharge License.                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  |               |
| EPD ref.:<br>RN25674-21 | 28/10/21                   | EPD           | CCZJV       | Noise               | 05/11/21              | <p>A complaint was received by the EPD Regional Office (North) on 28<sup>th</sup> October 2021. The complainant concerned about the night-time noise nuisance near Man Wo House, Wo Che Estate from 2:00 to 5:00 a.m. on 25<sup>th</sup> 26<sup>th</sup>, 26<sup>th</sup> 27<sup>th</sup> and 27<sup>th</sup> 28<sup>th</sup> October 2021 (total 3 nights). The complaint was referred from EPD to (ET on 5<sup>th</sup> November 2021 at 3:35 p.m.</p> <p>The construction work activities were allowed under the in-force CNP no.: GW-RN0600-21 Road Enclosure for General Night Works that was issued by the EPD. According to Main Contractor, the construction work activities were carried out during the permitted hours (00:00-05:00) on 25<sup>th</sup> 26<sup>th</sup> and 27<sup>th</sup> 28<sup>th</sup> October 2021 near Man Wo House (at Zone 4 and 5, NB and SB) and there was no night works on the 26<sup>th</sup> 27<sup>th</sup> October 2021. The construction activities were carried out within the allowable location and within the site boundary listed in the CNP. The night-time construction works included Temporary Traffic Arrangement (TTA) implementation, unloading of fill materials, loading and unloading of the lamppost, precast concrete blocks and generator and site clearance. The Main Contractor reported that no night-time construction work was carried out on 26<sup>th</sup> 27<sup>th</sup> October 2021 at Zone 4 and 5.</p> <p>ET checked the Main Contractor has complied with CNP No.: GW-RN0600-21. The Main Contractor was reminded to strictly</p> | 16/11/2021    |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
|               |                            |               |             |                     |                       | follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers. The Main Contractor was also be reminded to shut down the PMEs' engines when they are not in use. Moreover, only mobile phones and walkie talkies with headphones can be used for communication, and no whistles, horns and loudspeakers can be used during night work activities. The Main Contractor was reminded to pay attention to CNP conditions 3.d.1, 3.d.5, 3.d.13, 4.d.3 and 4.d.4 for using PMEs to carry out loading and unloading activities in the future.                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               |               |
| COM-2021-0257 | 05/11/21                   | 1823          | CCZJV       | Noise               | 08/11/21              | <p>This complaint was received by 1823 (ref: CASE#3-6960147702) on 5<sup>th</sup> November 2021 at 02:05 a.m. The complainant, Mr Sung concerned about the night-time noise nuisance from concreting near Scenery Court and Tsing Sha Highway. The complaint was referred from AECOM to ET on 8<sup>th</sup> November 2021 at 9:34 a.m.</p> <p>The construction work activities were allowed under the in-force Construction Noise Permit (CNP) no.: GW-RN0642-21 Road Closure for Sheet Piles Removal and Road Re-construction Works that issued by the EPD. According to Main Contractor, the construction work activities were carried out during the permitted hours (23:00-05:00) on 4<sup>th</sup> November 2021 near Scenery Court and Hilton Plaza (Zone 1). The construction activities were carried out within the allowable location and within the site boundary listed in the CNP. The night-time construction works included Temporary Traffic Arrangement (TTA) implementation, preparation works for concreting, concreting, cleaning works after concreting and site clearance.</p> <p>ET conducted a regular night-time noise monitoring at all the monitoring stations between 11:00 p.m. to 03:00 a.m. on 4<sup>th</sup> November 2021 and at NMS1, NMS2, NMS3, NMS4, NMS5A,</p> | 23/11/2021    |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No.           | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        | Date of Reply |
|-------------------------|----------------------------|---------------|-------------|---------------------|-----------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
|                         |                            |               |             |                     |                       | <p>NMS6A and NMS7 in Zone 1 and 2 which were close to Scenery Court near Tsing Sha Highway. No exceedance case was found during the regular night-time noise impact monitoring measurement.</p> <p>ET checked that the Main Contractor had complied with the conditions in CNP No.: GW-RN0642-21. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers. The Main Contractor was reminded to shut down the PME's engines when they are not in use. Moreover, only mobile phones and walkie talkies with headphones can be used for communication, and no whistles, horns and loudspeakers can be used during night work activities. The Main Contractor was also be reminded to pay attention to CNP conditions 3.d.1, 3.d.3, 3.d.4 3.d.5, 3.d.7, 3.d.11, 3.d.13, 4.d.6 and 4.d.7 for using PMEs and carry out similar night-time construction work activities in the future.</p> |               |
| EPD ref.:<br>RN25674-21 | 17/11/21                   | EPD           | CCZJV       | Noise               | 19/11/21              | <p>This complaint was received by the EPD Regional Office (North) on 17<sup>th</sup> November 2021. The complainant concerned about the night-time noise nuisance near Wai Wah Centre from 2:30 to 3:30 a.m. on 17<sup>th</sup> November 2021. The complaint was referred from EPD to ET on 19<sup>th</sup> November 2021 at 5:56 p.m.</p> <p>The construction work activities were allowed under the in-force Construction Noise Permit (CNP) no.: GW-RN0600-21 Road Closure for General Night Works that issued by the EPD. According to the Main Contractor, the construction work activities were carried out during the permitted hours (22:00-05:00) on 16<sup>th</sup> and 17<sup>th</sup> November 2021 near Wai Wah Centre (Zone 2). The construction activities were carried out within the allowable location and within the site boundary listed in the CNP. The night-time construction works included Temporary Traffic</p>                                                                                                                                                                                                                                                                 | 08/12/2021    |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                      | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
|               |                            |               |             |                     |                       | <p>Arrangement (TTA) implementation, unloading and handling of asphalt during pavement, asphalt compaction, loading and unloading of materials and site clearance. ET conducted a regular night-time noise monitoring at all the monitoring stations between 11:00 p.m. to 03:00 a.m. on 18<sup>th</sup> 19<sup>th</sup> November 2021 and at NMS1, NMS2, NMS3, NMS4, NMS5A, NMS6A and NMS7 at Zone 1 and 2 which were close to Wai Wah Centre. No exceedance case was found during the regular night-time noise impact monitoring measurement.</p> <p>ET checked that the Main Contractor had complied with the conditions in CNP No.: GW-RN0600-21 about the allowable location, constriction time period, PMEs type and groups and mitigation measures. While prior notification was sent to EPD on 12<sup>th</sup> November 2021 and Notice to Affected Residents – PN162 have been issued to nearby NSRs on 27<sup>th</sup> October 2021. The Main Contractor was reminded to pay attention to CNP conditions and minimize the noise nuisance to the nearby NSRs when carry out similar night-time construction work activities in the future.</p> |               |
| COM-2021-0262 | 20/11/21                   | 1823          | CCZJV       | Noise               | 23/11/21              | <p>This complaint was received by 1823 (ref: CASE#3-6981794553) on 20<sup>th</sup> November 2021 at 3:35 a.m. The complainant, Mr Sung concerned about the night-time noise nuisance from road surfacing works near Hilton Plaza. The complaint was referred from AECOM to ET on 23<sup>rd</sup> November 2021 at 1:56 p.m.</p> <p>The construction work activities were allowed under the in-force Construction Noise Permit (CNP) no.: GW-RN0600-21 Road Closure for General Night Works that issued by the EPD. According to the Main Contractor, the construction work activities were carried out during the permitted hours (22:00-05:00) on 19<sup>th</sup> 20<sup>th</sup> November 2021 near Hilton Plaza (Zone 1 and 2). The construction activities were carried out within the allowable location and within the site boundary listed in the CNP. The night-time construction works included Temporary Traffic</p>                                                                                                                                                                                                                          | 08/12/2021    |

# FUGRO TECHNICAL SERVICES LIMITED

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                     | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
|               |                            |               |             |                     |                       | Arrangement (TTA) implementation, asphalt removal, unloading and handling of asphalt during pavement, asphalt compaction, loading and unloading of materials and site clearance. ET checked that the Main Contractor had complied with the conditions in CNP No.: GW-RN0600-21 about the allowable location, constriction time period, PMEs type and groups and mitigation measures. While prior notification was sent to EPD on 12 <sup>th</sup> November 2021 and Notice to Affected Residents – PN162 have been issued to nearby NSRs on 27 <sup>th</sup> October 2021. The Main Contractor was reminded to pay attention to CNP conditions and minimize the noise nuisance to the nearby NSRs.                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                     |               |
| COM-2021-0263 | 26/11/21                   | 1823          | CCZJV       | Noise               | 30/11/21              | This complaint was received by 1823 (ref: CASE#3-6991122920) on 26 <sup>th</sup> November 2021 at 11:31 a.m. The complainant, Mr Chan concerned about the night-time noise nuisance generated from road surfacing works at Tai Po Road and near Shing Mun Tunnel Road (Zone 1 and 2). The construction work activities were allowed under the in-force CNP no.: GW-RN0600-21 Road Closure for General Night Works that issued by the EPD. The night-time construction works included TTA implementation, asphalt milling, mobilization in and out of construction site, asphalt paving, compaction of asphalt pavement, loading and unloading of fill materials, and site clearance. ET checked that the Main Contractor had complied with the conditions in CNP No.: GW-RN0600-21 about the allowable location, constriction time period, PMEs type and groups and mitigation measures. While prior notification was sent to EPD on 19 <sup>th</sup> November 2021 and Notice to Affected Residents – PN162 have been issued to nearby NSRs on 27 <sup>th</sup> October 2021. The Main Contractor was reminded to pay attention to CNP conditions and minimize the noise nuisance to the nearby NSRs. | 17/12/2021    |
| COM-2021-0264 | 24/11/21                   | 1823          | CCZJV       | Noise               | 30/11/21              | This complaint was received by 1823 (ref: CASE#3-6989137345) on 25 <sup>th</sup> November 2021 at 30 <sup>th</sup> November 2021 at 9:28 a.m. The complainant, Ms Sun concerned about the recent                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       | 23/12/2021    |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
|               |                            |               |             |                     |                       | <p>noise nuisance from the night-time construction work activities near Sha Tin Station.</p> <p>The construction work activities were allowed under the in-force CNP no.: GW-RN0600-21 Road Closure for General Night Works. According to the Main Contractor, the construction work activities were carried out during the permitted hours (22:00-05:00) on 23<sup>rd</sup> November 2021 near Sha Tin Station (at Zone 2). The construction activities were carried out within the allowable location and within the site boundary listed in the CNP. The night-time construction works included Temporary Traffic TTA implementation, asphalt milling, asphalt paving, compaction of asphalt pavement, loading and unloading of materials, and site clearance.</p> <p>ET checked that the Main Contractor had complied with the conditions in CNP No.: GW-RN0600-21 about the allowable location, construction time period, PMEs type and groups and mitigation measures. While prior notification was sent to EPD on 19<sup>th</sup> November 2021 and Notice to Affected Residents – PN162 have been issued to nearby NSRs on 27<sup>th</sup> October 2021. The Main Contractor was reminded to pay attention to CNP conditions and minimize the noise nuisance to the nearby NSRs when carry out similar night-time construction work activities in the future.</p> |               |
| COM-2021-0265 | 01/12/21                   | 1823          | CCZJV       | Noise               | 01/12/21              | <p>This complaint was received by 1823 (ref: CASE#3-6997727629) on 1<sup>st</sup> December 2021 at 11:50 a.m. The complainant concerned about the night-time noise nuisance generated near Sha Tin Station.</p> <p>The construction work activities were allowed under the in-force CNP no.: GW-RN0600-21 Road Closure for General Night Works. According to the Main Contractor, the construction work activities were carried out during the permitted hours (22:00-05:00) on 30th November ^ 1st December 2021 near Sha Tin Station (at Zone 2). The construction activities were carried out within the allowable location and within the site boundary listed</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                    | 30/12/2021    |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No.           | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                           | Date of Reply |
|-------------------------|----------------------------|---------------|-------------|---------------------|-----------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
|                         |                            |               |             |                     |                       | <p>in the CNP. The night-time construction works included TTA implementation, asphalt milling, asphalt paving, compaction of asphalt pavement, painting of road marking, loading and unloading of materials, and site clearance.</p> <p>ET checked that the Main Contractor had complied with the conditions in CNP No.: GW-RN0600-21 about the allowable location, constriction time period, PMEs type and groups and mitigation measures. While prior notification was sent to EPD on 19<sup>th</sup> November 2021 and Notice to Affected Residents – PN162 and 165 have been issued to nearby NSRs on 27<sup>th</sup> October and 29<sup>th</sup> November 2021. The Main Contractor was reminded to pay attention to CNP conditions and minimize the noise nuisance to the nearby NSRs when carry out similar night-time construction work activities in the future.</p>                                                                                                                                                                                                                                                                                                                                |               |
| EPD ref.:<br>RN29574-21 | 07/12/21                   | EPD           | CCZJV       | Noise               | 07/12/21              | <p>This complaint was received by the EPD Regional Office (North) on 7<sup>th</sup> December 2021. The complainant concerned about the night-time noise nuisance generated from the operation of PMEs near Lek Yuen Estate, Kwai Wo House on 7th December 2021 at 2:00-3:00 a.m.</p> <p>The construction work activities were allowed under the in-force CNP no.: GW-RN0600-21 Road Closure for General Night Works. According to the Main Contractor, the construction work activities were carried out during the permitted hours (22:00-05:00) on 6<sup>th</sup> December 2021 near Kwai Wo House (at Zone 3). The construction activities were carried out within the allowable location and within the site boundary listed in the CNP. The night-time construction works included TTA implementation, lifting of steel truss of overhead height restriction gantry, installation of overhead height restriction gantry, and site clearance.</p> <p>ET checked that the Main Contractor had complied with the conditions in CNP No.: GW-RN0600-21 about the allowable location, constriction time period, PMEs type and groups and mitigation measures. While prior notification was sent to EPD on</p> | 24/12/2021    |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
|               |                            |               |             |                     |                       | 19 <sup>th</sup> November 2021 and Notice to Affected Residents – PN165 have been issued to nearby NSRs on 29 <sup>th</sup> November 2021. The Main Contractor was reminded to pay attention to CNP conditions and minimize the noise nuisance to the nearby NSRs when carry out similar night-time construction work activities in the future.                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                     |               |
| COM-2021-0272 | 16/12/21                   | 1823          | CCZJV       | Noise               | 16/12/21              | <p>A complaint was received by 1823 (ref: CASE # 3-7020268390) on 16<sup>th</sup> December 2021 at 12:27 a.m. The complainant concerned about the night-time noise nuisance generated from the Tai Po Road (Sha Tin Section) construction site (near Wai Wah Centre, Block 3) in recent days.</p> <p>The construction work activities were allowed under the in-force CNP no.: GW-RN0600-21 Road Closure for General Night Works that issued by the EPD. According to the Main Contractor, the construction work activities were carried out during the permitted hours (22:00-05:00) between 13<sup>th</sup> and 16<sup>th</sup> December 2021 (at Zone 2). The night-time construction works included TTA implementation, asphalt removal and cutting works, loading and unloading of materials, lifting steel plate and site clearance.</p> <p>ET checked that the Main Contractor had complied with the conditions in CNP No.: GW-RN0600-21 about the allowable location, constriction time period, PMEs type and groups and mitigation measures. While prior notification was sent to EPD on 10<sup>th</sup> December 2021 and Notice to Affected Residents – PN165 have been issued to nearby NSRs on 29<sup>th</sup> November 2021. The Main Contractor was reminded to pay attention to CNP conditions and minimize the noise nuisance to the nearby NSRs when carry out similar night-time construction work activities in the future.</p> | 16/01/2022    |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : [matlab@fugro.com](mailto:matlab@fugro.com)  
Website : [www.fugro.com](http://www.fugro.com)



| Reference No.                   | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                    | Date of Reply |
|---------------------------------|----------------------------|---------------|-------------|---------------------|-----------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| COM-2021-0193 and COM-2021-0202 | 21/12/21                   | 1823          | CCZJV       | Noise               | 23/12/21              | <p>Three complaints were received by 1823 from the same complainant (ref: CASE # 3-6727963845 via email) on 21<sup>st</sup> December 2021 at 8:35 a.m., 22<sup>nd</sup> December 2021 at 9:18 a.m. and 5:06 p.m. The complainant, Ms. So concerned about the recent day-time noise nuisance generated from day-time construction works from the Tai Po Road (Sha Tin Section) construction site (near Mei Wo House, Wo Che Estate).</p> <p>According to the Main Contractor, the construction works were carried out at day-time (08:00-18:00) between 15<sup>th</sup> and 22<sup>nd</sup> December 2021 near Mei Wo House (at Zone 5). The construction work activities included formwork erection, formwork removal, rebar fixing, and concreting works.</p> <p>ET carried out regular day-time noise monitoring on 20<sup>th</sup> and 21<sup>st</sup> December 2021 at NMS 16-20 and NMS 26, no exceedance case was found. All the noise monitoring results at the above-mentioned stations were lower than the noise limit of 75 dB(A) Leq (30 minutes) at the facade of dwellings and 70 dB(A) Leq (30 minutes) for school.</p> <p>To minimize the noise impact generated from day-time construction works, the Main Contractor reported that they have implemented an additional noise mitigation measure (with temporary noise barriers) for the Mei Wo House, NSR. During the ET weekly environmental inspection on 13<sup>th</sup> January 2022, the noise barriers were observed as properly installed. Most of the sight from the nearby NSRs for the noise works and PMEs were blocked by the implemented noise barrier. There is no particular observation about the noise impact generated from the construction activities during the site inspection. ET reminded the Main Contractor to ensure the additional noise barriers were applied properly next to the PMEs and noisy work. The contractor should minimize the noise impact generated from the daily construction works activities as much as possible.</p> | 09/02/2022    |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                          | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| COM-2021-0275 | 29/12/21                   | 1823          | CCZJV       | Noise               | 30/12/21              | <p>Two complaints were received by 1823 (ref: CASE # 3-7043757669 via voice mail) on 29<sup>th</sup> December 2021 at 12:07 a.m. and (ref: CASE # 3-7046572787 via email) on 29<sup>th</sup> December 2021 at 1:07 a.m. and 1:18 a.m. (repeat email). The complainant, Mr. Sung concerned about the night-time noise nuisance generated from the Tai Po Road (Sha Tin Section) construction site (near Hilton Plaza) on 23<sup>rd</sup> December 2021 at 12:30 a.m. and 29<sup>th</sup> December 2021 at 12:00 a.m.</p> <p>According to Main Contractor, there were night-time construction works carried out at Tai Po Road and near Hilton Plaza (Zone 1 and 2) on 22<sup>nd</sup> ^ 23<sup>rd</sup> and 28<sup>th</sup> ^ 29<sup>th</sup> December 2021. The works included TTA implementation, pavement breaking along existing profile barriers, excavation (handling of rubble), remove steel plate from the trench, pipe laying inside the trench, reinstate steel plate to cover trench, removal of rubble, plant demobilization, and site clearance on 22<sup>nd</sup> ^ 23<sup>rd</sup> December 2021. Moreover, TTA implementation, dismantling of access tower, noise barrier steel post delivery, plant mobilization, pavement breaking along existing profile barriers, erection of noise barrier steel post, removal of existing profile barriers, and site clearance were carried out on 28<sup>th</sup> ^ 29<sup>th</sup> December 2021.</p> <p>ET checked that the Main Contractor did not comply with the conditions listed in CNP No.: GW-RN0600-21 and GW-RN0916-21 during the construction work activities on 22<sup>nd</sup> ^ 23<sup>rd</sup> and 28<sup>th</sup> ^ 29<sup>th</sup> December 2021 with unauthorized PME being used on-site. Enhance measures and supervision was urged by ET to the Main Contractor to prevent similar incident from happening again. The Main Contractor reported that enhancement measures, included altering the works schedule, enhance supervision and control system are applied currently.</p> <p>The Main Contractor was reminded again by ET to strictly follow and fully comply with the requirement listed in the CNP. Only allowable PMEs listed in the CNP can be used to carry out construction works. Mitigation measures should also be applied</p> | 26/01/2022    |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No.          | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                         | Date of Reply |
|------------------------|----------------------------|---------------|-------------|---------------------|-----------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
|                        |                            |               |             |                     |                       | according to CNP condition 3.d., 4.d and EM&A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers.                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  |               |
| EPD ref.:<br>RN1596-22 | 17/01/22                   | EPD           | CCZJV       | Noise and Dust      | 18/01/22              | <p>The complaint was received by EPD Regional Office (North) (ref: RN1596-22) on 17<sup>th</sup> January 2022. The complainant who lived near Mei Wo House, Wo Che Estate concerned about the night-time noise and dust nuisance generated from the nearby road. The construction work activities were allowed under the in-force CNP no.: GW-RN0916-21 Road Closure for General Night Works that issued by the EPD. According to the Main Contractor, the construction work activities were carried out during the permitted hours (23:00-05:00) on 13<sup>th</sup> and 14<sup>th</sup> January 2022 (at Zone 5), and these construction activities were carried out within the allowable location listed in the CNP (Zone I). The night-time construction works on 13<sup>th</sup> and 14<sup>th</sup> January 2022 included TTA implementation, Loading and Unloading of rubble, Lifting Operation, and Site Clearance. For 14<sup>th</sup> and 15<sup>th</sup> January 2022, night-time works included TTA implementation, Loading and Unloading of rubble, Lifting operation, Plant mobilization, and Site Clearance.</p> <p>ET checked that the Main Contractor had complied with the conditions in CNP No.: GW-RN0916-21 about the allowable location, construction time period, PMEs type and groups and mitigation measures. While prior notification was sent to EPD on 7<sup>th</sup> December 2021 and Notice to Affected Residents – PN162 and 165 have been issued to nearby NSRs on 28<sup>th</sup> December 2021. The Main Contractor was reminded to pay attention to CNP conditions and minimize the noise nuisance to the nearby NSRs when carry out similar night-time construction work activities in the future.</p> | 26/01/2022    |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| COM-2022-0313 | 08/06/22                   | 1823          | CCZJV       | Noise               | 15/06/22              | <p>A complaint was received via 1823 (ref: CASE#3-7246071575) on 8<sup>th</sup> June 2022. The complainant who is concerned about the noise nuisance generated from night-time construction works near Wo Che Estate.</p> <p>The construction work activities were allowed under the in-force Construction Noise Permit (CNP) no.: GW-RN0185-22 Road Closure for General Night Works that issued by the EPD. According to the Main Contractor, the construction works activities were carried out during the permitted hours (23:00-05:00) on 7<sup>th</sup> June 2022. (At Zone 5). The construction activities were carried out within the allowable location (Zone I) and within the site boundary listed in the CNP. The night-time construction works on 7<sup>th</sup> June 2022 included Temporary Traffic Arrangement (TTA) implementation, Erection of noise barrier panels and site clearance.</p> <p>ET checked that the Main Contractor had complied with the conditions listed in CNP No.: GW-RN0185-22. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers.</p> | 06/07/22      |
| COM-2022-320  | 01/08/22                   | 1823          | CCZJV       | Dust & Noise        | 02/08/22              | <p>A complaint was received by 1823 (ref: CASE#3-7318357344) on 25<sup>th</sup> July 2022. The complainant who is concerned about the dust and noise nuisance generated from construction works near Shatin Plaza. According to the Main Contractor, there were construction activities near Shatin Plaza (Zone 3) on 25<sup>th</sup> July 2022. Thus, this complaint considered to be related to the project. According to ET investigation, no exceedance cases were found on ET regular day-time noise monitoring. The Main</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       | 17/08/22      |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
|               |                            |               |             |                     |                       | Contractor was reminded to provide noise mitigation measures for the PMEs and noisy works to ensure the noise impact generated from the site is minimized. Consider the dust nuisance, no exceedance cases were found on ET regular air quality monitoring. The Main Contractor was reminded to provided dust suppression mitigation measures for the exposed area.                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                      |               |
| COM-2022-326  | 05/08/22                   | 1823          | CCZJV       | Noise               | 15/08/22              | <p>A complaint was received by 1823 (ref: CASE#3-7328538008) on 5th August 2022. The complainant who is concerned about the noise nuisance generated from night-time construction works along Tai Po Road between 3 to 4 a.m.</p> <p>The construction work activities were allowed under the in-force Construction Noise Permit (CNP) no.: GW-RN0476-22 Road Closure for General Night Works that issued by the EPD. According to the Main Contractor, the construction works activities were carried out during the permitted hours (23:00-04:45). The construction activities were carried out within the allowable location (Zone I, II &amp; III) and within the site boundary listed in the CNP.</p> <p>ET checked that the Main Contractor had complied with the conditions listed in CNP No.: GW-RN0476-22. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers.</p> <p>ET carried out regular night-time noise monitoring on 4th ^</p> | 16/09/22      |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                     | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
|               |                            |               |             |                     |                       | 5th August 2022, no exceedance case was found.                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                         |               |
| COM-2022-327  | 05/08/22                   | 1823          | CCZJV       | Noise               | 16/08/22              | <p>A complaint was received by 1823 (ref: CASE#3-7333891394) on 5th August 2022. The complainant who is concerned about the noise nuisance generated from night-time construction works near Lucky Plaza.</p> <p>The construction work activities were allowed under the in-force Construction Noise Permit (CNP) no.: GW-RN0476-22 Road Closure for General Night Works that issued by the EPD. According to the Main Contractor, the construction works activities were carried out during the permitted hours (23:00-04:45). The construction activities were carried out within the allowable location (Zone II) and within the site boundary listed in the CNP.</p> <p>ET checked that the Main Contractor had complied with the conditions listed in CNP No.: GW-RN0476-22. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers.</p> <p>ET carried out regular night-time noise monitoring on 4th ^ 5th August 2022, no exceedance case was found.</p> | 16/09/22      |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                    | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| COM-2022-346  | 28/10/22                   | 1823          | CCZJV       | Noise               | 31/10/22              | <p>A complaint was received by the EPD (EPD ref.: RN23746-22) on 28th October 2022. The complainant who is concerned about the noise nuisance generated from night-time construction works near King Wo House.</p> <p>The construction work activities were allowed under the in-force Construction Noise Permit (CNP) no.: GW-RN0848-22 Road Closure for General Night Works that issued by the EPD. According to the Main Contractor, the construction works activities were carried out during the permitted hours. The construction activities were carried out within the allowable location (Zone I) and within the site boundary listed in the CNP.</p> <p>ET checked that the Main Contractor had complied with the conditions listed in CNP No.: GW-RN0848-22. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers.</p> <p>ET carried out regular night-time noise monitoring on 27th ^ 28th October 2022 at NMS 26, no exceedance case was found. All the noise monitoring results at the above-mentioned station were lower than the limit level (55 dB(A)).</p> | 20/11/22      |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| COM-2022-348  | 4/11/22                    | 1823          | CCZJV       | Noise               | 4/11/22               | <p>A complaint was received by 1823 (CASE#3-7460684431) on 4<sup>th</sup> November 2022. The complainant who is concerned about the noise nuisance generated from night-time construction works near Sha Tin Plaza.</p> <p>The construction work activities were allowed under the in-force Construction Noise Permit (CNP) no.: GW-RN0848-22 Road Closure for General Night Works that issued by the EPD. According to the Main Contractor, the construction works activities were carried out during the permitted hours. The construction activities were carried out within the allowable location (Zone II) and within the site boundary listed in the CNP.</p> <p>ET checked that the Main Contractor had complied with the conditions listed in CNP No.: GW-RN0848-22. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers.</p> | 4/1/23        |
| COM-2022-349  | 8/11/22                    | EPD           | CCZJV       | Noise               | 10/11/22              | <p>A complaint was received by the EPD (EPD ref.: RN23746-22) on 8th November 2022. The complainant who is concerned about the noise nuisance generated from night-time construction works near King Wo House.</p> <p>The construction work activities were allowed under the in-force Construction Noise Permit (CNP) no.: GW-RN0848-22 Road Closure for General Night Works that issued by the EPD. According to the Main Contractor, the construction works activities were carried out during the</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        | 20/11/22      |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                          | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
|               |                            |               |             |                     |                       | permitted hours. The construction activities were carried out within the allowable location (Zone I) and within the site boundary listed in the CNP.<br>ET checked that the Main Contractor had complied with the conditions listed in CNP No.: GW-RN0848-22. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers.                                                                                                                                                                                    |               |
| COM-2022-350  | 10/11/22                   | 1823          | CCZJV       | Water               | 10/11/22              | A complaint was received by the 1823 (CASE#3-7469563820) on 10th November 2022. The complainant who is concerned about muddy water discharged from the construction site to the carriageway near New Town Plaza. According to the Resident Engineer, site personnel discovered the freshwater hose pipe was burst at Site Access N09 at 1:30 p.m. Water spilt in the works area and overflow to the carriageway. The watermain valve was closed by the contractor at 1:45 p.m. and completed replaced the damaged hoses pipe at around 3:00 p.m. According to the Resident Engineer, no muddy water and mud were deposited on the carriageway around the site Access N09.<br>ET checked that the case was a burst of freshwater hose and there was no untreated muddy water discharge was found from the construction site. | 29/11/22      |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No.                 | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       | Date of Reply |
|-------------------------------|----------------------------|---------------|-------------|---------------------|-----------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| COM-2022-351,<br>COM-2022-352 | 13/11/22                   | EPD           | CCZJV       | Noise               | 14/11/22              | <p>Two complaint was received by the EPD (EPD ref.: RN25243-22, RN25259-22) on 13th November 2022. The complainants who are concerned about the noise nuisance generated from night-time construction works near Tai Po Road next to Sha Tin MTR Station.</p> <p>The construction work activities were allowed under the in-force Construction Noise Permit (CNP) no.: GW-RN0848-22 Road Closure for General Night Works that issued by the EPD. According to the Main Contractor, the construction works activities were carried out during the permitted hours. The construction activities were carried out within the allowable location (Zone II &amp; III) and within the site boundary listed in the CNP.</p> <p>ET carried out regular night-time noise monitoring on 10th ^ 11th November 2022 at NMS5A, NMS6A, NMS8, NMS9 and NMS24, no exceedance case was found. All the noise monitoring results at the above-mentioned station were lower than the limit level (55 dB(A)).</p> <p>ET checked that the Main Contractor had complied with the conditions listed in CNP No.: GW-RN0848-22. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers.</p> | 6/12/22       |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| COM-2022-353  | 17/11/22                   | 1823          | CCZJV       | Noise               | 17/11/22              | <p>A complaint was received by 1823 (CASE#3-7478880132) on 17th November 2022. The complainants who are concerned about the noise nuisance generated from night-time construction works near Sha Tin Rural Committee Road.</p> <p>The construction work activities were allowed under the in-force Construction Noise Permit (CNP) no.: GW-RN0848-22 Road Closure for General Night Works that issued by the EPD. According to the Main Contractor, the construction works activities were carried out during the permitted hours. The construction activities were carried out within the allowable location (Zone II) and within the site boundary listed in the CNP.</p> <p>ET carried out regular night-time noise monitoring on 15th ^ 16th November 2022 at NMS8, NMS9, NMS24 and NMS25A, no exceedance case was found. All the noise monitoring results at the above-mentioned station were lower than the limit level (55 dB(A)).</p> <p>ET checked that the Main Contractor had complied with the conditions listed in CNP No.: GW-RN0848-22. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers.</p> | 13/12/22      |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| COM-2022-354  | 17/11/22                   | EPD           | CCZJV       | Noise               | 26/11/22              | <p>A complaint was received from EPD (EPD ref: RN25860-22) on 17th November 2022. The complainants who are concerned about the noise nuisance generated from night-time construction works near Wo Che Estate (between Man Wo House and Mei Wo House).</p> <p>The construction work activities were allowed under the in-force Construction Noise Permit (CNP) no.: GW-RN0848-22 Road Closure for General Night Works that issued by the EPD. According to the Main Contractor, the construction works activities were carried out during the permitted hours. The construction activities were carried out within the allowable location (Zone I) and within the site boundary listed in the CNP.</p> <p>ET carried out regular night-time noise monitoring on 15th ^ 16th November 2022 at NMS19, and NMS20, no exceedance case was found. All the noise monitoring results at the above-mentioned station were lower than the limit level (55 dB(A)).</p> <p>ET checked that the Main Contractor had complied with the conditions listed in CNP No.: GW-RN0848-22. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers.</p> | 4/1/23        |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No.                                  | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                          | Date of Reply |
|------------------------------------------------|----------------------------|---------------|-------------|---------------------|-----------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| COM-2022-356,<br>COM-2022-357,<br>COM-2022-358 | 29/11/22                   | 1823          | CCZJV       | Noise               | 29/11/22              | <p>Three complaints were received by 1823 (CASE#3-7495426348, CASE#3-7495543588, CASE#3-7495866890) on 29th November 2022. The complainants who are concerned about the noise nuisance generated from night-time construction works near Tai Po Road.</p> <p>The construction work activities were allowed under the in-force Construction Noise Permit (CNP) no.: GW-RN0848-22 Road Closure for General Night Works that issued by the EPD. According to the Main Contractor, the construction works activities were carried out during the permitted hours. The construction activities were carried out within the allowable location (Zone I) and within the site boundary listed in the CNP.</p> <p>ET checked that the Main Contractor did not comply with the conditions 3.d.19 and 4.d.9 listed in CNP No.: GW-RN0848-22.</p> <p>To discuss the enhancement measures, enhance supervision and control system, an ad-hoc meeting was carried out on 13 December 2022 with the CEDD, ER, IEC, Contractor and ET.</p> <p>A presentation for enhancement measures and enhance supervision was carried out by the contractor on 16 December 2022 with the ER and ET.</p> <p>According to the Main Contractor, to prevent further submission delay, the notification will be notified to the EPD within two consecutive weeks on the Friday of previous working week.</p> | 4/1/22        |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                 | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| COM-2022-359  | 14/12/22                   | 1823          | CCZJV       | Noise               | 14/12/22              | <p>A complaint was received by 1823 (CASE#3-7516169709) on 14th December 2022. The complainant who is concerned about the noise nuisance generated from night-time construction works near Tai Po Road next to the Shatin Plaza.</p> <p>The construction work activities were allowed under the in-force Construction Noise Permit (CNP) no.: GW-RN0848-22 Road Closure for General Night Works that issued by the EPD. According to the Main Contractor, the construction works activities were carried out during the permitted hours. The construction activities were carried out within the allowable location (Zone II) and within the site boundary listed in the CNP.</p> <p>ET carried out regular night-time noise monitoring on 13th ^ 14th December 2022 at NMS8, and NMS24, no exceedance case was found. All the noise monitoring results at the above-mentioned station were lower than the limit level (55 dB(A)).</p> <p>ET checked that the Main Contractor had complied with the conditions listed in CNP No.: GW-RN0848-22. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers.</p> | 4/1/22        |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| COM-2022-364  | 20/12/22                   | 1823          | CCZJV       | Noise               | 20/12/22              | <p>A complaint was received by 1823 (CASE#3-7523479466) on 20th December 2022. The complainant who is concerned about the noise nuisance generated from night-time construction works near Tai Po Road next to the Citylink Plaza on 2 December 2022 at 2:00 a.m.</p> <p>The construction work activities were allowed under the in-force Construction Noise Permit (CNP) no.: GW-RN0848-22 Road Closure for General Night Works that issued by the EPD. According to the Main Contractor, the construction works activities were carried out during the permitted hours. The construction activities were carried out within the allowable location (Zone II) and within the site boundary listed in the CNP.</p> <p>ET checked that the Main Contractor had complied with the conditions listed in CNP No.: GW-RN0848-22. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers.</p> | 16/02/23      |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                              | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| COM-2023-376  | 18/01/23                   | 1823          | CCZJV       | Noise               | 18/1/23               | <p>A complaint was received by 1823 (CASE#3-7559583506) on 18th January 2023. The complainant who is concerned about the noise nuisance generated from day time construction works near Tai Po Road.</p> <p>The complainant is concerned about the noise nuisance generated from the day-time construction works activities near Tai Po Road at Zone 5 on 18th January 2023 at 7:00 a.m. to 8:00 a.m.</p> <p>According to Main Contractor and AECOM's information, there was no construction work undertaken near the concerned area from 7:00 a.m. to 8:00 a.m.</p> <p>ET checked that the complaint received on 18th January 2023 is non-project related.</p> | 16/2/23       |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : [matlab@fugro.com](mailto:matlab@fugro.com)  
Website : [www.fugro.com](http://www.fugro.com)



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                    | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| COM-2023-382  | 31/01/23                   | EPD           | CCZJV       | Noise               | 1/2/23                | <p>A complaint was received from the EPD (EPD ref.: RN2643-23) on 2nd February 2023. The complainant is concerned about the noise nuisance generated by the night-time construction works activities near Tai Po Road near the Fo Tan Road from 1:00 a.m. to 3:00 a.m. on 31st January 2023.</p> <p>ET checked that the Main Contractor had complied with the conditions listed in CNP No.: GW-RN1176-22. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers.</p> <p>The Main Contractor was reminded to unload the material at a lower level into the dump truck to ensure the noise generated is as low as possible.</p> | 16/2/23       |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                     | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| COM-2023-383  | 01/02/23                   | EPD           | CCZJV       | Noise               | 1/2/23                | <p>A complaint was received from EPD (EPD ref.: RN2721-23) on 1st February 2023. The complainant is concerned about the noise nuisance generated by the night-time construction works activities near Tai Po Road next to Wo Shun House and Fung Wo Estate from 12:00 a.m. to 2:00 a.m. on 1st February 2023.</p> <p>According to Main Contractor, the night-time construction works included plant mobilization, loading and unloading construction material and loading and unloading C&amp;D waste material were carried out between 31st January and 1st February 2023.</p> <p>ET checked that the Main Contractor had complied with the conditions listed in CNP No.: GW-RN1176-22. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers.</p> <p>ET carried out regular night-time noise monitoring on 31st January ^ 1st February 2023 at NMS26, no exceedance case was found. All the noise monitoring results at the above-mentioned station were lower than the limit level (55 dB(A)).</p> <p>The Main Contractor was reminded to unload the material at a lower level into the dump truck to ensure the noise generated is as low as possible.</p> | 16/2/23       |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| COM-2023-384  | 6/2/23                     | 1823          | CCZJV       | Wastewater          | 6/2/23                | <p>A complaint was received by the 1823 (CASE#3-7578244130) on 6th February 2023. The complainant who is concerned about wastewater discharged from the construction site to the Tai Po Rad carriageway on 4th February 2023.</p> <p>According to the Main Contractor, the water was from emptying the water barriers and flowed outside the site without washing dirt and mud.</p> <p>ET checked that no untreated wastewater was discharge to the carriageway.</p> <p>The main contractor is reminded to provide more training to the frontline staff to ensure no more water will be direct discharge from the construction site.</p> <p>The main contractor is reminded that surface run-off should be prevented from directly entering the sensitive receivers during the construction works.</p> <p>The main contractor is reminded that the wastewater generated on-site should be collected and treated to meet the requirements of the discharge license before being discharged.</p> | 27/2/23       |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| COM-2023-385  | 14/2/23                    | 1823          | CCZJV       | Noise               | 14/2/23               | <p>A complaint was received by 1823 (CASE#3-7591662478) on 14th February 2023. The complainant is concerned about the noise nuisance generated by the night-time construction works activities near Tai Po Road next to Wo Che Estate.</p> <p>According to the Main Contractor, the night-time construction works included TTA implementation, loading and unloading, pouring non-fine concrete and asphalt paving were carried out between 13th and 14th February 2023.</p> <p>ET checked that the Main Contractor had complied with the conditions listed in CNP No.: GW-RN1176-22. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers.</p> <p>According to AECOM, the acoustic barrier was not fully used during the whole process of road paving. The Main Contractor was reminded to use the acoustic barrier for blocking the power generating part of the PME to ensure the noise can be minimized.</p> | 3/3/23        |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From               | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                     | Date of Reply |
|---------------|----------------------------|-----------------------------|-------------|---------------------|-----------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| COM-2023-386  | 20/2/23                    | Contract Hotline Phone Call | CCZJV       | Noise               | 21/2/23               | <p>A complaint was received by Contract Hotline Phone Call (COM-2023-0386) on 20th February 2023. The complainant is concerned about the noise nuisance generated by the night-time construction works activities near Tai Po Road next to Wo Che Street between 17th and 18th February 2023 from 0:00 to 04:00 a.m.</p> <p>According to the Main Contractor, the night-time construction works included TTA implementation, loading and unloading and site clearance were carried out between 17th and 18th February 2023.</p> <p>ET checked that the Main Contractor had complied with the conditions listed in CNP No.: GW-RN1176-22. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers.</p> <p>The Main Contractor was reminded to be slow and careful when carrying out loading and unloading to avoid remarkable noise nuisance.</p> | 17/3/2023     |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| COM-2023-387  | 24/2/23                    | 1823          | CCZJV       | Noise               | 25/2/23               | <p>A complaint was received by 1823 (CASE#3-7605775385) on 24th February 2023. The complainant is concerned about the noise nuisance generated by the night-time construction works activities near Tai Po Road next to Wo Che Estate.</p> <p>According to the Main Contractor, the night-time construction works included TTA implementation, loading and unloading, pouring non-fine concrete and asphalt paving were carried out between 20th and 24th February 2023.</p> <p>ET checked that the Main Contractor had complied with the conditions listed in CNP No.: GW-RN1176-22. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers.</p> <p>ET carried out regular night-time noise monitoring on 23rd ^ 24th February 2023 at NMS19, and NMS20, no exceedance case was found. All the noise monitoring results at the above-mentioned station were lower than the limit level (55 dB(A)).</p> | 17/3/2023     |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                            | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| COM-2023-388  | 25/2/23                    | 1823          | CCZJV       | Noise               | 25/2/23               | <p>A complaint was received by 1823 (CASE#3-7608102288) on 25th February 2023. The complainant is concerned about the noise nuisance generated by the night-time construction works activities near Tai Po Road on 25th February 2023 from 4 a.m. to 5 a.m.</p> <p>According to the Main Contractor, the night-time construction works included plant mobilization and site clearance were carried out on 25th February 2023.</p> <p>ET checked that the Main Contractor had complied with the conditions listed in CNP No.: GW-RN1176-22. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers.</p> | 17/3/2023     |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No.        | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       | Date of Reply |
|----------------------|----------------------------|---------------|-------------|---------------------|-----------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| COM-2023-392 and 393 | 2/3/2023                   | CEDD          | CCZJV       | Noise               | 3/3/2023              | <p>Two complaints were received from CEDD (COM-2023-392 and 393) on 2nd March 2023. The complainants are concerned about the noise nuisance generated by the night-time construction works activities near Tai Po Road next to Man Wo House.</p> <p>According to the Main Contractor, the night-time construction works included TTA implementation, loading and unloading, noise barrier installation, asphalt milling, asphalt paving and site clearance were carried out on 2nd March 2023.</p> <p>According to the Main Contractor, the road miller, asphalt paver and road roller were used behind acoustic barriers when road paving works was carrying out. Also, the internal sound absorbing lining was installed for those engine compartments.</p> <p>According to the Main Contractor, the soft padding material was padded on the ground when loading and unloading the steel rebars.</p> <p>ET checked that the Main Contractor had complied with the conditions listed in CNP No.: GW-RN1176-22. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers.</p> <p>The Main Contractor was reminded to use the allowable PMEs listed in CNP condition 3.d for performing night-time construction works. Mitigation measures need to be applied according to the requirement in conditions 3.d and</p> | 17/3/2023     |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                           | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
|               |                            |               |             |                     |                       | <p>4.d.<br/>The Main Contractor was also be reminded to pay attention to CNP conditions 3a, 3.d.1, 3.d.5, 3.d.6, 3.d.7 and 3.d.14 for using PME's and need to provide related noise mitigation measures when carrying out similar night-time construction work activities in the future.</p> |               |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : [matlab@fugro.com](mailto:matlab@fugro.com)  
Website : [www.fugro.com](http://www.fugro.com)



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| COM-2023-394  | 9/3/2023                   | EPD           | CCZJV       | Noise               | 10/3/2023             | <p>A complaint was received from EPD (EPD ref.: RN6366-23) on 9th March 2023. The complainant is concerned about the noise nuisance generated by the night-time construction works activities near Tai Po Road from 1 a.m. to 4 a.m.</p> <p>According to the Main Contractor, the night-time construction works included TTA implementation and loading and unloading were carried out on 9th March 2023.</p> <p>ET checked that the Main Contractor had complied with the conditions listed in CNP No.: GW-RN1176-22. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers.</p> <p>The Main Contractor was reminded to be slow and careful when carrying out loading and unloading to avoid remarkable noise nuisance.</p> <p>The Main Contractor was reminded to use the allowable PME's listed in CNP condition 3.d for performing night-time construction works. Mitigation measures need to be applied according to the requirement in conditions 3.d and 4.d.</p> <p>The Main Contractor was also be reminded to pay attention to CNP conditions 3a, 3.d.1, 3.d.5, 3.d.6, 3.d.7 and 3.d.14 for using PME's and need to provide related noise mitigation measures when carrying out similar night-time construction work activities in the future.</p> | 17/3/2023     |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                      | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| COM-2023-395  | 14/3/2023                  | EPD           | CCZJV       | Noise               | 15/3/2023             | <p>A complaint was received from EPD (EPD ref.: RN6778-23) on 14th March 2023. The complainant is concerned about the noise nuisance generated by the night-time construction works activities near Tai Po Road on 14th March 2023 from 2 a.m. to 3 a.m.</p> <p>According to the Main Contractor, the night-time construction works included loading and unloading were carried out on 14th March 2023 from 2 a.m. to 3 a.m.</p> <p>ET checked that the Main Contractor had complied with the conditions listed in CNP No.: GW-RN1176-22. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers.</p> <p>The Main Contractor was reminded to be slow and careful when carrying out loading and unloading to avoid remarkable noise nuisance.</p> <p>The Main Contractor was reminded to use the allowable PME's listed in CNP condition 3.d for performing night-time construction works. Mitigation measures need to be applied according to the requirement in conditions 3.d and 4.d.</p> <p>The Main Contractor was also be reminded to pay attention to CNP conditions 3a, 3.d.1, 3.d.5, 3.d.6, 3.d.7 and 3.d.14 for using PME's and need to provide related noise mitigation measures when carrying out similar night-time construction work activities in the future.</p> | 24/3/2023     |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : [matlab@fugro.com](mailto:matlab@fugro.com)  
Website : [www.fugro.com](http://www.fugro.com)



| Reference No. | Date of Complaint Received | Received From    | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  | Date of Reply |
|---------------|----------------------------|------------------|-------------|---------------------|-----------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| COM-2023-402  | 18/3/2023                  | Contract Hotline | CCZJV       | Noise               | 20/3/2023             | <p>A complaint was received by contract hotline (COM-2023-402) on 18th March 2023. The complainant is concerned about the noise nuisance generated by placing traffic cones on Tai Po Road during night-time construction activities on 18th March 2023.</p> <p>According to the Main Contractor, all workers were briefed before the works started. The workers were reminded the traffic cones must be put on the ground, rather than throwing.</p> <p>ET checked that the Main Contractor had complied with the conditions listed in CNP No.: GW-RN1176-22. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers.</p> <p>The Main Contractor was reminded to place the traffic cones slowly and carefully to minimize the noise nuisance generated.</p> <p>The Main Contractor was reminded to use the allowable PME's listed in CNP condition 3.d for performing night-time construction works. Mitigation measures need to be applied according to the requirement in conditions 3.d and 4.d.</p> <p>The Main Contractor was also be reminded to pay attention to CNP conditions 3a, 3.d.1, 3.d.5, 3.d.6, 3.d.7 and 3.d.14 for using PME's and need to provide related noise mitigation measures when carrying out similar night-time construction work activities in the future.</p> |               |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                    | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| COM-2023-403  | 18/3/2023                  | 1823          | CCZJV       | Noise               | 20/3/2023             | <p>Two complaints were received by 1823 (CASE#3-7637259453 &amp; #3-7637259880) on 18th March 2023. The complainant is concerned about the noise nuisance generated by the night-time construction works activities near Tai Po Road on 18th March 2023.</p> <p>According to the Main Contractor, no Power Mechanical Equipment was included in the relevant complainant cases on 18th March 2023.</p> <p>Referring to the complainant's video, the noise was generated when the frontline workers threw the materials from a height to the ground. In addition, the contractor's mitigation measure is not enough to minimize the noise generated. The Main Contractor was reminded to provide more training for frontline workers to ensure that they work with minimum noise.</p> <p>According to the Main Contractor, a night-work foreman was arranged to keep close monitoring the noisy work and ensure the compliance of CNP at night.</p> <p>The Main Contractor was reminded to unload all the construction materials slowly and carefully to minimize the noise generated.</p> <p>ET checked that the Main Contractor had complied with the conditions listed in CNP No.: GW-RN1176-22. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers.</p> | 18/4/2023     |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                      | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
|               |                            |               |             |                     |                       | <p>The Main Contractor was reminded to use the allowable PME's listed in CNP condition 3.d for performing night-time construction works. Mitigation measures need to be applied according to the requirement in conditions 3.d and 4.d.</p> <p>The Main Contractor was also be reminded to pay attention to CNP conditions 3a, 3.d.1, 3.d.5, 3.d.6, 3.d.7 and 3.d.14 for using PME's and need to provide related noise mitigation measures when carrying out similar night-time construction work activities in the future.</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                         |               |
| COM-2023-404  | 18/3/2023                  | 1823          | CCZJV       | Wastewater          | 20/3/2023             | <p>A complaint was received by 1823 (CASE#3-7637522160) on 18th March 2023. The complainant is concerned about the wastewater leaking from the STRCR to the below carriageway.</p> <p>The complainant who is concerned about the wastewater leaking into the carriageway surface from STRCR on 18th March 2023.</p> <p>ET checked that the complaint was considered to be related to the project.</p> <p>According to the Main Contractor, the dripping was caused by the concrete curing work above the STRCR structure.</p> <p>According to the Main Contractor, the drip source reparation work was conducted on 20th March and completed on 26th March 2023. No more drip source was observed.</p> <p>During the site inspection, ET checked the main contractor had used the tarpaulin sheet as the mitigation measure of the concrete curing work.</p> <p>The Main Contractor was reminded to periodic inspection the site situation to ensure the mitigations are effective.</p> <p>The Main Contractor was reminded that the run-off should</p> | 10/5/2023     |

## FUGRO TECHNICAL SERVICES LIMITED

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                              | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
|               |                            |               |             |                     |                       | be prevented from directly entering the sensitive receivers during the construction works.<br>The Main Contractor was reminded that all wastewater generated on-site should be collected and treated to meet the requirements of the discharge license before being discharged. |               |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| COM-2023-406  | 23/3/2023                  | 1823          | CCZJV       | Wastewater          | 24/3/2023             | <p>A complaint was received by 1823 (CASE#3-7616071795) on 23rd March 2023. The complainant is concerned about the wastewater leaking to the drainage system. The complainant who is concerned the wastewater discharged to the drainage system on the carriageway road.</p> <p>ET checked that the complaint was considered to be related to the project.</p> <p>According to the Main Contractor, the water was the result of the excessive curing water seeped underneath the STRCR flyover. The dripping ceased shortly. Due to the small quantity and short time, the dripping did not constitute a continuous flow.</p> <p>According to the Main Contractor, the drip source was repaired on 26 March 2023. No more drip source was observed.</p> <p>During the site inspection, ET checked the main contractor had used the tarpaulin sheet as the mitigation measure of the concrete curing work.</p> <p>ET checked no wastewater was discharged at the concerned area after the reparation work.</p> <p>The Main Contractor was reminded that the run-off should be prevented from directly entering the sensitive receivers during the construction works.</p> <p>The Main Contractor was reminded that all wastewater generated on-site should be collected and treated to meet the requirements of the discharge license before being discharged.</p> | 10/5/2023     |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| COM-2023-411  | 18/4/2023                  | 1823          | CCZJV       | Noise               | 21/4/2023             | <p>A complaint was received by 1823 (CASE#3-7677865059) on 18th April 2023. The complainant who is concerned about the noise nuisance generated from night-time construction works near Tai Po Road.</p> <p>ET checked that the Main Contractor had complied with the conditions listed in CNP No.: GW-RN0292-23. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction work should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers.</p> <p>The Main Contractor was reminded to use the allowable PMEs listed in CNP condition 3.d for performing night-time construction works. Mitigation measures need to be applied according to the requirement in conditions 3.d and 4.d.</p> <p>The Main Contractor was also be reminded to pay attention to CNP conditions 3a, 3.d.1, 3.d.5, 3.d.6, 3.d.7 and 3.d.14 for using PMEs and need to provide related noise mitigation measures when carrying out similar night-time construction work activities in the future.</p> | 26/4/2023     |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                           | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| COM-2023-412  | 28/4/2023                  | EPD           | CCZJV       | Noise               | 28/4/2023             | <p>The construction work activities were allowed under the in-force Construction Noise Permit (CNP) no.: GW-RN0292-23 Road Closure for General Night Works issued by the EPD. According to the Main Contractor, the construction works activities were carried out during the permitted hours. The construction activities were carried out within the allowable location (Zone I) and within the site boundary listed in the CNP.</p> <p>According to the Main Contractor, the night-time construction works included TTA implementation, Loading &amp; unloading, Asphalt Milling, Asphalt Paving and Concreting were carried out between 20th and 25th April 2023.</p> <p>According to the Main Contractor, no construction works were carried out between 23rd and 24th April 2023.</p> <p>According to AECOM information, only housekeeping was carried out on 23rd ^ 24th April 2023. No major construction work was recorded on Sunday.</p> <p>The Environmental Officer reported that a prior notification was sent to EPD on 13th April 2023 at 02:08 p.m. and 20th April 2023 at 01:48 p.m. While "Notice to Affected Residents – PN240" was sent to the Sha Tin District Council, Local Residents, Private Development and Others on 29th March 2023.</p> <p>ET carried out regular night-time noise monitoring on 20th ^ 21st April 2023 at NMS16, NMS18, NMS19, NMS20 and NMS26, no exceedance case was found. All the noise monitoring results at the above-mentioned station were lower than the limit level (55 dB(A)).</p> <p>ET checked that the Main Contractor had complied with the conditions listed in CNP No.: GW-RN0292-23. The</p> | 8/5/2023      |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : [matlab@fugro.com](mailto:matlab@fugro.com)  
Website : [www.fugro.com](http://www.fugro.com)



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
|               |                            |               |             |                     |                       | <p>Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction work should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers.</p> <p>The Main Contractor was reminded to use the allowable PME's listed in CNP condition 3.d for performing night-time construction works. Mitigation measures need to be applied according to the requirement in conditions 3.d and 4.d.</p> <p>The Main Contractor was also be reminded to pay attention to CNP conditions 3a, 3.d.1, 3.d.5, 3.d.6, 3.d.7 and 3.d.14 for using PME's and need to provide related noise mitigation measures when carrying out similar night-time construction work activities in the future.</p> |               |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| COM-2023-502  | 12/5/2023                  | 1823          | CCZJV       | Noise               | 19/5/2023             | <p>A complaint was received by 1823 (CASE#3-7709231017) on 12th May 2023. The complainant who is concerned about the noise nuisance generated from night-time construction works near Tai Po Road.</p> <p>ET carried out regular night-time noise monitoring on 9th ^ 10th May 2023 at NMS9 and NMS13, no exceedance case was found. All the noise monitoring results at the above-mentioned station were lower than the limit level (55 dB(A)).</p> <p>ET checked that the Main Contractor had complied with the conditions listed in CNP No.: GW-RN0292-23. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers.</p> <p>The Main Contractor was reminded to use the allowable PMEs listed in CNP condition 3.d for performing night-time construction works. Mitigation measures need to be applied according to the requirement in conditions 3.d and 4.d.</p> <p>The Main Contractor was also be reminded to pay attention to CNP conditions 3a, 3.d.1, 3.d.5, 3.d.6, 3.d.7 and 3.d.14 for using PMEs and need to provide related noise mitigation measures when carrying out similar night-time construction work activities in the future.</p> | 9/6/2023      |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                 | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| COM-2023-503  | 19/5/2023                  | 1823          | CCZJV       | Noise               | 22/5/2023             | <p>A complaint was received by 1823 (CASE#3-7722776885) on 19th May 2023. The complainant who is concerned about the noise nuisance generated from night-time construction works near Tai Po Road.</p> <p>According to the Main Contractor, additional temporary noise barriers will be provided as an enhancement noise mitigation measure.</p> <p>ET checked that the Main Contractor had complied with the conditions listed in CNP No.: GW-RN0514-23. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers.</p> <p>The Main Contractor was reminded to use the allowable PMEs listed in CNP condition 3.d for performing night-time construction works. Mitigation measures need to be applied according to the requirement in conditions 3.d and 4.d.</p> <p>The Main Contractor was also be reminded to pay attention to CNP conditions 3a, 3.d.1, 3.d.5, 3.d.6 and 3.d.7 for using PMEs and need to provide related noise mitigation measures when carrying out similar night-time construction work activities in the future.</p> | 9/6/2023      |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| COM-2023-504  | 14/5/2023                  | EPD           | CCZJV       | Noise               | 23/5/2023             | <p>A complaint was received from EPD (EPD ref.: RN12170-23) on 14th May 2023. The complainant is concerned about the noise nuisance generated by the night-time construction works activities near Lek Yuen Estate after 7:00 p.m.</p> <p>According to the Main Contractor and AECOM information, no construction works were carried out between 19:00 and 22:00. Also, no construction works were carried out at Zone 3 on 12th ^13th May 2023.</p> <p>ET checked that the Main Contractor had complied with the conditions listed in CNP No.: GW-RN0292-23 and CNP no. GW-RN0227-23. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers.</p> <p>The Main Contractor was reminded to use the allowable PME's listed in CNP condition 3.d for performing night-time construction works. Mitigation measures need to be applied according to the requirement in conditions 3.d and 4.d.</p> <p>The Main Contractor was also be reminded to pay attention to CNP conditions 3a, 3.d.1, 3.d.5, 3.d.6, 3.d.7 and 3.d.14 for using PME's and need to provide related noise mitigation measures when carrying out similar night-time construction work activities in the future.</p> | 5/6/2023      |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| COM-2023-510  | 30/6/2023                  | 1823          | CCZJV       | Noise               | 30/6/2023             | <p>A complaint was received by 1823 (CASE#3-7780620261) on 30th June 2023. The complainant is concerned about the noise nuisance generated by the night-time construction works activities near Wai Wah Centre. According to the Main Contractor, all crane lorry and dump truck drivers were briefed to load all material at the lower level to minimize noise generation.</p> <p>ET carried out regular night-time noise monitoring on 29th ^ 30th June 2023 at NMS5A, NMS6A and NMS8, no exceedance case was found. All the noise monitoring results at the above-mentioned station were lower than the limit level (55 dB(A)).</p> <p>ET checked that the Main Contractor had complied with the conditions listed in CNP No.: GW-RN0627-23. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers.</p> <p>The Main Contractor was reminded to use the allowable PMEs listed in CNP condition 3.d for performing night-time construction works. Mitigation measures need to be applied according to the requirement in conditions 3.d and 4.d.</p> <p>The Main Contractor was also be reminded to pay attention to CNP conditions 3a, 3.d.1, 3.d.5, 3.d.6, 3.d.7 and 3.d.14 for using PMEs and need to provide related noise mitigation measures when carrying out similar night-time construction work activities in the future.</p> | 4/7/2023      |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No.          | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                         | Date of Reply |
|------------------------|----------------------------|---------------|-------------|---------------------|-----------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| CASE# 3-77827444<br>54 | 3/7/2023                   | 1823          | CCZJV       | Noise               | 3/7/2023              | <p>A complaint was received by 1823 (CASE# 3-7782744454) on 3rd July 2023. The complainant who is concerned about the noise nuisance generated from night-time construction works near Jockey Club Ti-I College. Due to the distance of the concerned area is far from the construction site, the complaint was considered to be non-project related.</p> <p>ET carried out regular night-time noise monitoring on 29th ^ 30th June 2023 at NMS19, no exceedance case was found. All the noise monitoring results at the above-mentioned station were lower than the limit level (55 dB(A)).</p> <p>ET checked that the Main Contractor had complied with the conditions listed in CNP No.: GW-RN0627-23. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers.</p> <p>The Main Contractor was reminded to use the allowable PMEs listed in CNP condition 3.d for performing night-time construction works. Mitigation measures need to be applied according to the requirement in conditions 3.d and 4.d.</p> <p>The Main Contractor was also be reminded to pay attention to CNP conditions 3a, 3.d.1, 3.d.5, 3.d.6, 3.d.7 and 3.d.14 for using PMEs and need to provide related noise mitigation measures when carrying out similar night-time construction work activities in the future.</p> | 12/7/2023     |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No.        | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                | Date of Reply |
|----------------------|----------------------------|---------------|-------------|---------------------|-----------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| EPD ref. RN1489 7-23 | 7/7/2023                   | EPD           | CCZJV       | Noise               | 7/7/2023              | <p>A complaint was received by EPD (EPD ref. RN14897-23) on 7th July 2023. The complainant who is concerned about the noise nuisance generated from night-time construction works near Scenery Court.</p> <p>According to the Main Contractor, no construction activities were carried out near Scenery Court. The nearest activities were carried out near Wai Wah Centre. Due to the certain distance between the working area and the concerned area, this complaint was considered to be non-project related.</p> <p>ET checked that the Main Contractor had complied with the conditions listed in CNP No.: GW-RN0292-23. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers.</p> <p>The Main Contractor was reminded to use the allowable PME's listed in CNP condition 3.d for performing night-time construction works. Mitigation measures need to be applied according to the requirement in conditions 3.d and 4.d.</p> <p>The Main Contractor was also be reminded to pay attention to CNP conditions 3a, 3.d.1, 3.d.5, 3.d.6, 3.d.7 and 3.d.14 for using PME's and need to provide related noise mitigation measures when carrying out similar night-time construction work activities in the future.</p> | 12/7/2023     |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No.               | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                          | Date of Reply |
|-----------------------------|----------------------------|---------------|-------------|---------------------|-----------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| EPD ref.:<br>RN1692<br>0-23 | 19/7/2023                  | EPD           | CCZJV       | Muddy Water         | 19/7/2023             | <p>A complaint was received by EPD (EPD ref.: RN16920-23) on 19th July 2023. The complainant who is concerned about the untreated muddy water discharged from the construction site to the Shing Mun River.</p> <p>According to the government's info-map, the drainage network of the concerned water outfall is distributed along the Wo Che Street and construction site area Zone 4 is also covered in the network.</p> <p>According to the Main Contractor, all the work activities were operated with suitable water treatment facilities and no water discharged between 11th July 2023 14th July 2023.</p> <p>According to AECOM photo records on 12th July 2023, a small amount of muddy water leakage through the sandbag bunding into the manhole at Zone 4 was observed. However, the leakage is not sufficient to form the muddy water discharge at Shing Mun River.</p> <p>The Main Contractor was reminded to periodic inspection the site situation to ensure all the mitigation measures are effective.</p> <p>The Main Contractor was reminded that the run-off should be prevented from directly entering the sensitive receivers during the construction works.</p> <p>The Main Contractor was reminded that all wastewater generated on-site should be collected and treated to meet the requirements of the discharge license before being discharged.</p> <p>ET checked that there is no sufficient evidence to prove that the complaint is related to the project.</p> <p>complaint was received by 1823 (CASE#3-7677865059) on 26th July 2023.</p> | 26/7/2023     |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No.      | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                 | Date of Reply |
|--------------------|----------------------------|---------------|-------------|---------------------|-----------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| CASE#3-7677865 059 | 26/7/2023                  | 1823          | CCZJV       | Noise               | 26/7/2023             | <p>A complaint was received by 1823 (CASE#3-7677865059) on 26th July 2023. The complainant who is concerned about the noise nuisance generated from night-time construction works near Sui Wo Court.</p> <p>According to the Main Contractor, the hand-held breaker was used inside the acoustic enclosure.</p> <p>According to the Main Contractor and AECOM, acoustic barriers were set up in the direction of Wo Che Estate during the construction activities. However, due to the safety reason, the noise barriers cannot set up in the direction of Sui Wo Court.</p> <p>According to the Main Contractor, refreshment training will be provided to the frontline supervisory staff about the CNP requirements to ensure all the construction activities fulfil all the conditions in the CNP.</p> <p>ET checked that the Main Contractor had complied with the conditions listed in CNP No.: GW-RN0627-23. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers.</p> <p>The Main Contractor was reminded to use the allowable PMEs listed in CNP condition 3.d for performing night-time construction works. Mitigation measures need to be applied according to the requirement in conditions 3.d and 4.d.</p> <p>The Main Contractor was also be reminded to pay attention to CNP conditions 3a, 3.d.1, 3.d.5, 3.d.6, 3.d.7</p> | 1/8/2023      |

## FUGRO TECHNICAL SERVICES LIMITED

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
|               |                            |               |             |                     |                       | and 3.d.14 for using PME's and need to provide related noise mitigation measures when carrying out similar night-time construction work activities in the future. |               |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No.     | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       | Date of Reply |
|-------------------|----------------------------|---------------|-------------|---------------------|-----------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| CASE#3-7875615750 | 31/8/2023                  | 1823          | CCZJV       | Muddy Water         | 4/9/2023              | <p>A complaint was received by 1823 (CASE#3-7875615750) on 31st August 2023. The complainant who is concerned about the muddy water flooded out of the construction site. According to the Main Contractor, the muddy water overflow was the result of the frequent rainstorms that occurred.</p> <p>ET checked that the complaint was considered to be related to the project.</p> <p>The Main Contractor was reminded to provide a site channel, bunds or sandbags as a direct runoff into the sediment traps to prevent muddy water directly discharged to the public area.</p> <p>The Main Contractor was reminded to periodic inspections of the site to determine compliance with the functioning of onsite surface water collection channels and sediment traps.</p> <p>The Main Contractor was reminded to review all the capacity of sedimentation tanks on the site to see if they are enough to handle the heavy rain situation.</p> <p>The Main Contractor was reminded that all wastewater generated on-site should be collected and treated to meet the requirements of the discharge license before being discharged.</p> | 25/9/2023     |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No.     | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             | Date of Reply |
|-------------------|----------------------------|---------------|-------------|---------------------|-----------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| CASE#3-7878953633 | 4/9/2023                   | 1823          | CCZJV       | Muddy Water         | 4/9/2023              | <p>A complaint was received by 1823 (CASE#3-7878953633) on 4th September 2023. The complainant is concerned about the muddy water flowing out of the construction site near Tai Po Road.</p> <p>According to the Main Contractor, the muddy water overflow was the result of the frequent rainstorms that occurred.</p> <p>ET checked that the complaint was considered to be related to the project.</p> <p>The Main Contractor was reminded to provide a site channel, bunds or sandbags as a direct runoff into the sediment traps to prevent muddy water directly discharged to the public area.</p> <p>The Main Contractor was reminded to periodic inspections of the site to determine compliance with the functioning of onsite surface water collection channels and sediment traps.</p> <p>The Main Contractor was reminded to review all the capacity of sedimentation tanks on the site to see if they are enough to handle the heavy rain situation.</p> <p>The Main Contractor was reminded that all wastewater generated on-site should be collected and treated to meet the requirements of the discharge license before being discharged.</p> | 27/9/2023     |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No.     | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               | Date of Reply |
|-------------------|----------------------------|---------------|-------------|---------------------|-----------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| CASE#3-7905970144 | 18/9/2023                  | 1823          | CCZJV       | Noise               | 18/9/2023             | <p>A complaint was received by 1823 (CASE#3-7905970144) on 18th September 2023. The complainant who is concerned about the noise nuisance generated from night-time construction works near Tai Po Road.</p> <p>According to the video provided by the complainant, an excavator was moving at Zone 3. No movable acoustic barriers were set up next to the excavator is observed in the video.</p> <p>According to the Main Contractor, the carriageways were not isolated at that moment. For safety reasons, the acoustic barriers could not be used on the carriageways. In addition, a safety distance must be maintained for the excavator during mobilization. There also cannot be provided acoustic barriers on the other side of the excavator.</p> <p>According to the Main Contractor, the movable acoustic barriers were provided when the excavator conducted loading works.</p> <p>ET checked that the Main Contractor had complied with the conditions listed in CNP No.: GW-RN0627-23. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers.</p> <p>The Main Contractor was reminded to use the allowable PMEs listed in CNP condition 3.d for performing night-time construction works. Mitigation measures need to be applied according to the requirement in conditions 3.d and</p> | 26/10/2023    |

## FUGRO TECHNICAL SERVICES LIMITED

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                           | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
|               |                            |               |             |                     |                       | <p>4.d.<br/>The Main Contractor was also be reminded to pay attention to CNP conditions 3a, 3.d.1, 3.d.5, 3.d.6, 3.d.7 and 3.d.14 for using PME's and need to provide related noise mitigation measures when carrying out similar night-time construction work activities in the future.</p> |               |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No.      | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       | Date of Reply |
|--------------------|----------------------------|---------------|-------------|---------------------|-----------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| CASE#3-7940848 250 | 13/10/2023                 | 1823          | CCZJV       | Noise               | 16/10/2023            | <ul style="list-style-type: none"><li>• A complaint was received by 1823 (CASE#3-7940848250) on 13th October 2023. The complainant who is concerned about the noise nuisance generated from night-time construction works near Tai Po Road.</li><li>• According to the Main Contractor, an acoustic enclosure was used during the asphalt-breaking activity. Also, acoustic noise barriers were provided for the asphalt paver and roller.</li><li>• ET checked that the Main Contractor had complied with the conditions listed in CNP No.: GW-RN0894-23 and GW-RN0970-23. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers.</li><li>• The Main Contractor was reminded to use the allowable PMEs listed in CNP condition 3.d for performing night-time construction works. Mitigation measures need to be applied according to the requirement in conditions 3.d and 4.d.</li><li>• The Main Contractor was also be reminded to pay attention to CNP conditions 3a, 3.d.1, 3.d.5, 3.d.6, 3.d.7 and 3.d.14 for using PMEs and need to provide related noise mitigation measures when carrying out similar night-time construction work activities in the future.</li></ul> | 26/10/2023    |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No.     | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       | Date of Reply |
|-------------------|----------------------------|---------------|-------------|---------------------|-----------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| CASE#3-7940837468 | 13/10/2023                 | 1823          | CCZJV       | Noise               | 18/10/2023            | <ul style="list-style-type: none"><li>• A complaint was received by 1823 (CASE#3-7940837468) on 13th October 2023. The complainant who is concerned about the noise nuisance generated from night-time construction works near Tai Po Road.</li><li>• According to the Main Contractor, an acoustic enclosure was used during the asphalt-breaking activity. Also, acoustic noise barriers were provided for the asphalt paver and roller.</li><li>• ET checked that the Main Contractor had complied with the conditions listed in CNP No.: GW-RN0894-23 and GW-RN0970-23. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers.</li><li>• The Main Contractor was reminded to use the allowable PMEs listed in CNP condition 3.d for performing night-time construction works. Mitigation measures need to be applied according to the requirement in conditions 3.d and 4.d.</li><li>• The Main Contractor was also be reminded to pay attention to CNP conditions 3a, 3.d.1, 3.d.5, 3.d.6, 3.d.7 and 3.d.14 for using PMEs and need to provide related noise mitigation measures when carrying out similar night-time construction work activities in the future.</li></ul> | 3/11/2023     |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No.     | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                           | Date of Reply |
|-------------------|----------------------------|---------------|-------------|---------------------|-----------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| CASE#3-7947581414 | 18/10/2023                 | 1823          | CCZJV       | Noise               | 20/10/2023            | <ul style="list-style-type: none"><li>• A complaint was received by 1823 (CASE#3-7947581414) on 18th October 2023. The complainant who is concerned about the noise nuisance generated from night-time construction works near Tai Po Road.</li><li>• According to the Main Contractor, asphalt paver was used behind the acoustic barriers when road paving works was carrying out. Also, internal sound absorbing lining was installed for the asphalt paver and road roller.</li><li>• ET checked that the Main Contractor had complied with the conditions listed in CNP No.: GW-RN0970-23. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers.</li><li>• The Main Contractor was reminded to use the allowable PMEs listed in CNP condition 3.d for performing night-time construction works. Mitigation measures need to be applied according to the requirement in conditions 3.d and 4.d.</li><li>• The Main Contractor was also be reminded to pay attention to CNP conditions 3a, 3.d.1, 3.d.5, 3.d.6, 3.d.7 and 3.d.14 for using PMEs and need to provide related noise mitigation measures when carrying out similar night-time construction work activities in the future.</li></ul> | 3/11/2023     |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No.     | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   | Date of Reply |
|-------------------|----------------------------|---------------|-------------|---------------------|-----------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| CASE#3-7954061301 | 20/10/2023                 | 1823          | CCZJV       | Noise               | 24/10/2023            | <ul style="list-style-type: none"><li>• A complaint was received by 1823 (CASE#3-7954061301) on 20th October 2023. The complainant who is concerned about the noise nuisance generated from night-time construction works near Tai Po Road.</li><li>• According to the complainant's video, no acoustic barrier was set up next to the excavator which did not comply with the requirement listed in the CNP.</li><li>• ET checked that the Main Contractor did not fully comply with the conditions listed in CNP No.: GW-RN0894-23.</li><li>• To discuss the enhancement measures, enhance supervision and control system, an ad-hoc meeting was held on 31st October 2022 with the CEDD, ER, IEC, Contractor, and ET.</li><li>• According to the Main Contractor, to prevent further non-complying with the CNP, a CNP briefing was provided to the frontline workers before nighttime work to ensure all requirements listed in the CNP are implemented.</li><li>• According to the Main Contractor, additional temporary noise barriers were provided on the noise barrier pole to minimize the noise nuisance generated from the site.</li><li>• The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible</li></ul> | 14/11/2023    |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                            | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
|               |                            |               |             |                     |                       | <p>to minimize the noise nuisance to the sensitive receivers.</p> <ul style="list-style-type: none"><li>• The Main Contractor was reminded to use the allowable PMEs listed in CNP condition 3.d for performing night-time construction works. Mitigation measures need to be applied according to the requirement in conditions 3.d and 4.d.</li><li>• The Main Contractor was also be reminded to pay attention to CNP conditions 3a, 3.d.1, 3.d.5, 3.d.6, 3.d.7 and 3.d.14 for using PMEs and need to provide related noise mitigation measures when carrying out similar night-time construction work activities in the future.</li></ul> |               |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No.               | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                         | Date of Reply |
|-----------------------------|----------------------------|---------------|-------------|---------------------|-----------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| EPD ref.:<br>RN2452<br>2-23 | 13/10/2023                 | EPD           | CCZJV       | Noise               | 27/10/2023            | <ul style="list-style-type: none"><li>• A complaint was received by EPD (EPD ref.: RN24522-23) on 13th October 2023. The complainant who is concerned about the noise nuisance generated from night-time construction works near Tai Po Road.</li><li>• According to the Main Contractor, an acoustic enclosure was used during the asphalt-breaking activity. Also, acoustic noise barriers were provided for the asphalt paver and roller.</li><li>• ET checked that the Main Contractor had complied with the conditions listed in CNP No.: GW-RN0970-23. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers.</li><li>• ET carried out regular night-time noise monitoring on 10th ^ 11th October 2023 at NMS8, NMS13, NMS24 and NMS25A, no exceedance case was found. All the noise monitoring results at the above-mentioned station were lower than the limit level (55 dB(A)).</li></ul> | 3/11/2023     |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No.     | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                 | Date of Reply |
|-------------------|----------------------------|---------------|-------------|---------------------|-----------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| CASE#3-7965710201 | 25/10/2023                 | 1823          | CCZJV       | Noise               | 1/11/2023             | <ul style="list-style-type: none"><li>• A complaint was received by 1823 (CASE#3-7965710201) on 1st November 2023. The complainant who is concerned about the noise nuisance generated from night-time construction works near Tai Po Road.</li><li>• According to the Main Contractor, the nighttime construction works activities between 25th October and 1st November 2023 at Zone 3 and 4 included TTA implementation, soil excavation, demolition of concrete slab and road reinstatement.</li><li>• According to the Main Contractor, acoustic barriers were used during soil excavation, asphalt milling, paving and demolition of concrete slab.</li><li>• ET checked that the Main Contractor had complied with the conditions listed in CNP No.: GW-RN0970-23. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers.</li></ul> | 20/12/2023    |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No.       | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                    | Date of Reply |
|---------------------|----------------------------|---------------|-------------|---------------------|-----------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| CASE: 3-7971500 925 | 5/11/2023                  | 1823          | CCZJV       | Noise               | 5/11/2023             | <ul style="list-style-type: none"><li>• A complaint was received by 1823 (CASE: 3-7971500925) on 5th November 2023. The complainant who is concerned about the noise nuisance generated from night-time construction works near Tai Po Road.</li><li>• According to the Main Contractor, the nighttime construction works activities between 4th and 5th November 2023 at Zone 5 included TTA implementation and concreting.</li><li>• According to the Main Contractor, acoustic barriers were used during concreting work.</li><li>• ET checked that the Main Contractor had complied with the conditions listed in CNP No.: GW-RN0970-23. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers.</li></ul> | 20/12/2023    |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No.               | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  | Date of Reply |
|-----------------------------|----------------------------|---------------|-------------|---------------------|-----------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| EPD ref.:<br>RN2664<br>3-23 | 8/11/2023                  | EPD           | CCZJV       | Noise               | 8/11/2023             | <ul style="list-style-type: none"><li>• A complaint was received by EPD (EPD ref.: RN26643-23) on 8th November 2023. The complainant who is concerned about the noise nuisance generated from night-time construction works near Tai Po Road.</li><li>• According to the Main Contractor, the nighttime construction works activities between 7th and 8th November 2023 at Zone 5 included Sheet piling, TTA implementation, material loading and unloading and concreting.</li><li>• According to the Main Contractor, acoustic barriers were used during sheet piling and concreting activity.</li><li>• ET checked that the Main Contractor had complied with the conditions listed in CNP No.: GW-RN1126-23 and CNP No.: GW-RN0970-23. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers.</li></ul> | 15/11/2023    |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : [matlab@fugro.com](mailto:matlab@fugro.com)  
Website : [www.fugro.com](http://www.fugro.com)



| Reference No.              | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                | Date of Reply |
|----------------------------|----------------------------|---------------|-------------|---------------------|-----------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| 1823<br>Case: 3-7979040785 | 9/11/2023                  | 1823          | CCZJV       | Noise               | 9/11/2023             | <ul style="list-style-type: none"><li>• A complaint was received by 1823 (1823 Case: 3-7979040785) on 9th November 2023. The complainant who is concerned about the noise nuisance generated from night-time construction works near Tai Po Road.</li><li>• According to the Main Contractor, the nighttime construction works activities on 9th November 2023 at Zone 3 included rebar fixing and cutting of sheet piles.</li><li>• According to the Main Contractor, the workers were briefed before they started the works. Briefing details included handing steel rebar or metal materials must be lightly to reduce noise as practical as possible.</li><li>• The Main Contractor is reminded to provided acoustic barriers for nighttime work to minimize the noise nuisance as much as possible.</li><li>• ET checked that the Main Contractor had complied with the conditions listed in CNP No.: GW-RN1126-23. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers.</li></ul> | 20/12/2023    |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No.               | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                     | Date of Reply |
|-----------------------------|----------------------------|---------------|-------------|---------------------|-----------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| EPD ref.:<br>RN2682<br>0-23 | 20/10/2023                 | 1823          | CCZJV       | Noise               | 9/11/2023             | <ul style="list-style-type: none"><li>• A complaint was received by EPD (EPD ref.: RN26820-23) on 9th November 2023. The complainant who is concerned about the noise nuisance generated from night-time construction works near Tai Po Road on 20th October 2023.</li><li>• According to the complainant's video from 1823 (CASE#3-7954061301), no acoustic barrier was set up next to the excavator which did not comply with the requirement listed in the CNP.</li><li>• According to the Main Contractor, the nighttime construction works activities on 20th October 2023 at Zone 5 included Sheet Piling.</li><li>• ET checked that the Main Contractor did not fully comply with the conditions listed in CNP No.: GW-RN0894-23.</li><li>• According to the Main Contractor, to prevent further non-complying with the CNP, a CNP briefing was provided to the frontline workers before nighttime work to ensure all requirements listed in the CNP are implemented.</li></ul> | 17/11/2023    |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No.       | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                | Date of Reply |
|---------------------|----------------------------|---------------|-------------|---------------------|-----------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| CASE: 3-7979906 619 | 7/11/2023                  | 1823          | CCZJV       | Noise               | 16/11/2023            | <ul style="list-style-type: none"><li>• A complaint was received by 1823 (CASE: 3-7979906619) on 16th November 2023. The complainant who is concerned about the noise nuisance generated from night-time construction works near Tai Po Road on 7th November 2023.</li><li>• According to the complainant's video, the excavator was carrying out sheet piling work with a vibratory pile driving hammer on 7th November 2023. An acoustic barrier was set up near the excavator, but the barrier did not effectively screen the excavator and the piling area.</li><li>• ET checked that the Main Contractor did not fully comply with the conditions listed in CNP No.: GW-RN1126-23.</li><li>• According to the Main Contractor, sheet piling works would be rescheduled to be conducted on daytime.</li></ul> | 12/11/2023    |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No.       | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               | Date of Reply |
|---------------------|----------------------------|---------------|-------------|---------------------|-----------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| CASE: 3-7979872 320 | 9/11/2023                  | 1823          | CCZJV       | Noise               | 20/11/2023            | <ul style="list-style-type: none"><li>• A complaint was received by 1823 (CASE: 3-7979872320) on 20th November 2023. The complainant who is concerned about the noise nuisance generated from night-time construction works near Tai Po Road.</li><li>• According to the complainant's video, the excavator was carrying out sheet piling work on 9th November 2023. An acoustic barrier was screened in front of the piling work area.</li><li>• As the contractor did not provide adequate noise barriers to shield the excavator, it failed to effectively block the visible from noise sensitive receiver.</li><li>• ET checked that the Main Contractor did not fully comply with the conditions listed in CNP No.: GW-RN1126-23.</li></ul> | 12/11/2023    |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No.      | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                          | Date of Reply |
|--------------------|----------------------------|---------------|-------------|---------------------|-----------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| CASE#3-7956862 047 | 25/10/2023                 | 1823          | CCZJV       | Noise               | 30/11/2023            | <ul style="list-style-type: none"><li>• A complaint was received by 1823 (CASE#3-7956862047) on 30th November 2023. The complainant who is concerned about the noise nuisance generated from night-time construction works near Tai Po Road on 25 October 2023.</li><li>• According to the Main Contractor, the nighttime construction works activities between 25th October and at Zone 3 and 4 included TTA implementation, soil excavation, demolition of concrete slab and road reinstatement.</li><li>• ET checked that the Main Contractor had complied with the conditions listed in CNP No.: GW-RN0970-23. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers.</li></ul> | 20/12/2023    |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No.     | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                         | Date of Reply |
|-------------------|----------------------------|---------------|-------------|---------------------|-----------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| CASE#3-8042743395 | 28/12/2023                 | 1823          | CCZJV       | Noise               | 4/1/2024              | <ul style="list-style-type: none"><li>A complaint was received by 1823 (CASE#3-8042743395) on 29th December 2023. The complainant who is concerned about the noise nuisance generated from night-time construction works near Tai Po Road. According to the noise complaint, the complainant is concerned the noise nuisance on 27th ^28th December 2023. According to the Main Contractor, the nighttime construction works activities between 28th and 29th December 2023 at Zone 4 included road reinstatement. According to the Main Contractor, acoustic barriers were used during road reinstatement. ET checked that the Main Contractor had complied with the conditions listed in CNP No.: GW-RN0970-23. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers.</li></ul> | 17/1/2024     |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No.    | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               | Date of Reply |
|------------------|----------------------------|---------------|-------------|---------------------|-----------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| CASE#3-804373317 | 2/1/2024                   | 1823          | CCZJV       | Noise               | 2/1/2024              | <ul style="list-style-type: none"><li>One complaint was received by 1823 (CASE#3-804373317) on 2<sup>nd</sup> January 2024. The complainant who is concerned about the noise nuisance generated from night-time construction works near Tai Po Road. According to the noise complaint, the complainant is concerned the noise nuisance on 27<sup>th</sup> ^28<sup>th</sup> December 2023. According to the Main Contractor, the nighttime construction works activities between 28<sup>th</sup> and 29<sup>th</sup> December 2023 at Zone 4 included road reinstatement. According to the Main Contractor, acoustic barriers were used during road reinstatement. ET checked that the Main Contractor had complied with the conditions listed in CNP No.: GW-RN0970-23. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers.</li></ul> | 17/1/2024     |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No.     | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             | Date of Reply |
|-------------------|----------------------------|---------------|-------------|---------------------|-----------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| CASE#3-8027848066 | 2/1/2024                   | 1823          | CCZJV       | Noise               | 2/1/2024              | <ul style="list-style-type: none"><li>One complaint was received by 1823 (CASE#3-8027848066) on 2<sup>nd</sup> January 2024. The complainant is concerned about the noise nuisance generated from night-time construction works near Tai Po Road. According to the noise complaint, the complainant is concerned the noise nuisance on 28<sup>th</sup> ^ 29<sup>th</sup> December 2023. According to the Main Contractor, the nighttime construction works activities between 28<sup>th</sup> and 29<sup>th</sup> December 2023 at Zone 4 included road reinstatement. According to the Main Contractor, acoustic barriers were used during road reinstatement. ET checked that the Main Contractor had complied with the conditions listed in CNP No.: GW-RN0970-23. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers.</li></ul> | 17/1/2024     |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No.     | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                 | Date of Reply |
|-------------------|----------------------------|---------------|-------------|---------------------|-----------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| CASE#3-8115454475 | 27/2/2024                  | 1823          | CCZJV       | Noise               | 28/2/2024             | <ul style="list-style-type: none"><li>One complaint was received by 1823 (CASE#3-8115454475) on 27th February 2024. The complainant who is concerned about the noise nuisance generated from night-time construction works near Sha Tin Rural Committee Road. ET checked that the Main Contractor had complied with the conditions listed in CNP No.: GW-RN0079-24. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers. ET carried out regular night-time noise monitoring on 22nd ^ 23rd February 2024 at NMS8 and NMS24, no exceedance case was found. All the noise monitoring results at the above-mentioned station were lower than the limit level (55 dB(A)). The Main Contractor was reminded to use the allowable PMEs listed in CNP condition 3.d for performing night-time construction works. Mitigation measures need to be applied according to the requirement in conditions 3.d and 4.d. The Main Contractor was also reminded to pay attention to CNP conditions 3a and 3.d for using PMEs and need to provide related noise</li></ul> | 11/4/2024     |

## FUGRO TECHNICAL SERVICES LIMITED

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                   | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|------------------------------------------------------------------------------------------------------|---------------|
|               |                            |               |             |                     |                       | mitigation measures when carrying out similar night-time construction work activities in the future. |               |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No.      | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   | Date of Reply |
|--------------------|----------------------------|---------------|-------------|---------------------|-----------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| EPD ref. RN6229-24 | 4/3/2024                   | EPD           | CCZJV       | Noise               | 5/3/2024              | <ul style="list-style-type: none"><li>A complaint was received by EPD (EPD ref. RN6229-24) on 4th March 2024. The complainant who is concerned about the noise nuisance generated from night-time construction works near New Town Plaza from 25th February 2024 to 1st March 2024.</li></ul> ET checked that the Main Contractor submitted the advance notification to EPD (ref.: GW-RN0172-24-002) was less than 48 hours. The Main Contractor was suspected of violating the conditions of CNP no.: GW-RN0172- 24.<br>ET checked that the Main Contractor had complied with the conditions listed in CNP No.: GW-RN0079-24 but had not fully complied with the conditions listed in CNP No.: GW-RN0172-24.<br>The Main Contractor was reminded to use the allowable PMEs listed in CNP condition 3.d for performing night-time construction works. Mitigation measures need to be applied according to the requirement in conditions 3.d and 4.d.<br>The Main Contractor was also be reminded to pay attention to CNP conditions 3a and 3.d for using PMEs and need to provide related noise mitigation measures when carrying out similar night-time construction work activities in the future. | 22/3/2024     |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No.     | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                 | Date of Reply |
|-------------------|----------------------------|---------------|-------------|---------------------|-----------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| CASE#3-8115454475 | 10/3/2024                  | 1823          | CCZJV       | Noise               | 10/3/2024             | <ul style="list-style-type: none"><li>A further complaint was received via 1823 (CASE#3-8115454475) on 10th March 2024. The complainant is concerned about the noise nuisance generated from night-time construction works near Sha Tin Rural Committee Road on 9th ^ 10th March 2024.</li></ul> <p>The contractor failed to implement noise mitigation measures that could obstruct the line of sight from the road roller to the sensitive receiver.</p> <p>ET checked that the Main Contractor had complied with the conditions listed in CNP No.: GW-RN0115-24, but not fully complied with the conditions listed in CNP No.: GW-RN0172-24.</p> <p>The Main Contractor was reminded to use the allowable PMEs listed in CNP condition 3.d for performing night-time construction works. Mitigation measures need to be applied according to the requirement in conditions 3.d and 4.d.</p> <p>The Main Contractor was also be reminded to pay attention to CNP conditions 3a and 3.d for using PMEs and need to provide related noise mitigation measures when carrying out similar night-time construction work activities in the future.</p> | 11/4/2024     |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No.          | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                 | Date of Reply |
|------------------------|----------------------------|---------------|-------------|---------------------|-----------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| EPD ref.:<br>RN7536-24 | 15/3/2024                  | EPD           | CCZJV       | Noise               | 15/3/2024             | <ul style="list-style-type: none"><li>A complaint was received by EPD (EPD ref.: RN7536-24) on 15th March 2024. The complainant is concerned about the noise nuisance generated from night-time construction works near Wo Che Estate.</li></ul> ET checked that the Main Contractor had complied with the conditions listed in CNP No.: GW-RN0172-24.<br>ET carried out regular night-time noise monitoring on 12th ^ 13th March 2024 at NMS13, NMS19 and NMS26, no exceedance case was found. All the noise monitoring results at the above-mentioned station were lower than the limit level (55 dB(A)).<br>The Main Contractor was reminded to use the allowable PMEs listed in CNP condition 3.d for performing night-time construction works. Mitigation measures need to be applied according to the requirement in conditions 3.d and 4.d.<br>The Main Contractor was also be reminded to pay attention to CNP conditions 3a and 3.d for using PMEs and need to provide related noise mitigation measures when carrying out similar night-time construction work activities in the future. | 27/3/2024     |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No.     | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   | Date of Reply |
|-------------------|----------------------------|---------------|-------------|---------------------|-----------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| CASE#3-8138907298 | 10/4/2024                  | 1823          | CCZJV       | Noise               | 17/4/2024             | <ul style="list-style-type: none"><li>A complaint was received via 1823 (CASE#3-8138907298) on 10th April 2024. The complainant who is concerned about the noise nuisance generated from night-time construction works near Tai Po Road.<br/>ET checked that the Main Contractor had complied with the conditions listed in CNP No.: GW-RN0236-24.<br/>ET carried out regular night-time noise monitoring on 9th ^ 10th April 2024 at NMS13 and NMS26, no exceedance case was found. All the noise monitoring results at the above-mentioned station were lower than the limit level (55 dB(A)).<br/>The Main Contractor was reminded to use the allowable PMEs listed in CNP condition 3.d for performing night-time construction works. Mitigation measures need to be applied according to the requirement in conditions 3.d and 4.d.<br/>The Main Contractor was also be reminded to pay attention to CNP conditions 3.a and 3.d for using PMEs and need to provide related noise mitigation measures when carrying out similar night-time construction work activities in the future.</li></ul> | 13/5/2024     |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No.     | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   | Date of Reply |
|-------------------|----------------------------|---------------|-------------|---------------------|-----------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| CASE#3-8179141354 | 16/4/2024                  | 1823          | CCZJV       | Noise               | 24/4/2024             | <ul style="list-style-type: none"><li>A complaint was received via 1823 (CASE#3-8179141354) on 16th April 2024. The complainant is concerned about the nuisance generated by breaking works near Wo Che Estate. ET checked that the Main Contractor had complied with the conditions listed in CNP No.: GW-RN0236-24. ET carried out regular night-time noise monitoring on 5th ^ 6th April 2024 and 9th ^ 10th April 2024 at NMS19 and NMS20, no exceedance case was found. All the noise monitoring results at the above-mentioned station were lower than the limit level (55 dB(A)). The Main Contractor was reminded to use the allowable PMEs listed in CNP condition 3.d for performing night-time construction works. Mitigation measures need to be applied according to the requirement in conditions 3.d and 4.d. The Main Contractor was also be reminded to pay attention to CNP conditions 3.a and 3.d for using PMEs and need to provide related noise mitigation measures when carrying out similar night-time construction work activities in the future.</li></ul> | 9/5/2024      |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No.     | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                            | Date of Reply |
|-------------------|----------------------------|---------------|-------------|---------------------|-----------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| CASE#3-8199986833 | 1 May 2024,<br>28 May 2024 | 1823          | CCZJV       | Noise               | 17 May 2024           | <ul style="list-style-type: none"><li>A complaint was received by 1823 (CASE#3-8199986833) on 1 May 2024 and a further complaint was received by 1823 on 28 May 2024. The complainant concerned about the noise nuisance generated from night-time construction works near Sha Tin Rural Committee Road. According to the Main Contractor, SilentCUBE® noise enclosure and movable noise barrier made of SilentUP® panels were provided during demolition of crossroad drain. ET checked that there is no evidence that the Main Contractor had violated the conditions listed in CNP No.: GW-RN0236-24 and GW-RN0398-24. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNPs and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers. The Main Contractor was reminded to pay attention to the Site Area described in CNP No.: GW-RN0236-24 and GW-RN0398-24. The Main Contractor was advised to preserve time for movement of PMEs before the end of the time period of work allowed by CNP No.: GW-RN0236-24. The Main Contractor was reminded to strictly follow condition 3.d.7 of CNP No.: GW-RN0236-24 and condition 3.d.4 of CNP No.: GW-RN0398-24, that</li></ul> | 19 June 2024  |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                            | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
|               |                            |               |             |                     |                       | <p>the listed PME's shall only be used inside acoustic enclosure. The Main Contractor was also reminded to strictly follow 3.d.14 of CNP No.: GW-RN0236-24 and condition 3.d.7 of CNP No.: GW-RN0398-24, about the noise controlling measures that shall be equipped on road miller, mini road miller, asphalt paver, road roller and vibratory roller.</p> <p>The Main Contractor was also be reminded to pay attention to CNP No.: GW-RN0236-24 and CNP No.: GW-RN0398-24 conditions 3.a and 3.d for using PME's and need to provide related noise mitigation measures when carrying out similar night-time construction work activities in the future.</p> |               |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : [matlab@fugro.com](mailto:matlab@fugro.com)  
Website : [www.fugro.com](http://www.fugro.com)



| Reference No.     | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                | Date of Reply |
|-------------------|----------------------------|---------------|-------------|---------------------|-----------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| CASE#3-8216435684 | 13 May 2024                | 1823          | CCZJV       | Noise               | 21 May 2024           | <ul style="list-style-type: none"><li>A complaint was received via 1823 (CASE#3-8216435684) on 13 May 2024. The complainant concerned about the noise nuisance generated from night-time construction works near Tai Po Road (near Shatin Plaza). According to the photo record provided by the Main Contractor, SilentCUBE® noise enclosure and movable acoustic noise barriers (made of SilentUP® panels) were provided during road re-surfacing work. ET checked that there was no evidence that the Main Contractor had violated the conditions listed in CNP No.: GW-RN0382-24 and GW-RN0443-24. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNPs and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers. The Main Contractor was reminded to use the allowable PMEs listed in CNP condition 3.d for performing night-time construction works. Mitigation measures need to be applied according to the requirement in conditions 3.d and 4.d. The Main Contractor was also be reminded to pay attention to CNP conditions 3.a and 3.d for using PMEs and need to provide related noise mitigation measures when carrying out similar night-time construction work activities in the future.</li></ul> | 10 July 2024  |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No.       | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  | Date of Reply |
|---------------------|----------------------------|---------------|-------------|---------------------|-----------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| EPD ref. RN13640-24 | 15 May 2024                | EPD           | CCZJV       | Noise               | 21 May 2024           | <ul style="list-style-type: none"><li>A complaint was received by EPD (EPD ref. RN13640-24) on 15 May 2024. The complainant concerned about the noise nuisance generated from night-time construction works near Tai Po Road - Sha Tin section (near Shatin Plaza). According to the Main Contractor, SilentCUBE® noise enclosure was provided during demolition of crossroad drain. ET checked that the Main Contractor had complied with the conditions listed in CNP No.: GW-RN0382-24 and GW-RN0398-24. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNPs and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers. The Main Contractor was also be reminded to pay attention to CNP conditions 3.a and 3.d for using PMEs and need to provide related noise mitigation measures when carrying out similar night-time construction work activities in the future.</li></ul> | 27 May 2024   |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No.       | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                         | Date of Reply |
|---------------------|----------------------------|---------------|-------------|---------------------|-----------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| EPD ref. RN14240-24 | 20 May 2024                | EPD           | CCZJV       | Noise               | 24 May 2024           | <ul style="list-style-type: none"><li>A complaint was received by EPD (EPD ref. RN14240-24) on 20 May 2024. The complainant concerned about the noise nuisance generated from night-time construction works near Tai Po Road - Sha Tin section (near Kwai Wo House, Lek Yuen Estate).<br/>According to the Main Contractor, road miller was used between 22:30 of 20th May 2024 and 00:00 of 21st May 2024, which complied with CNP No. GW-RN0382-24 (condition 3.d.2: road miller shall only be used between 22:30 and 02:30 on the next day for not more than 1.5 hours).<br/>According to the Main Contractor, movable noise barrier was provided during road reinstatement.<br/>ET checked that the Main Contractor had complied with the conditions listed in CNP No.: GW-RN0382-24.<br/>The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNPs and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers.<br/>The Main Contractor was also be reminded to pay attention to CNP conditions 3.a and 3.d for using PME's and need to provide related noise mitigation measures when carrying out similar night-time construction work activities in the future.</li></ul> | 29 May 2024   |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No.                          | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        | Date of Reply |
|----------------------------------------|----------------------------|---------------|-------------|---------------------|-----------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| CASE#3-8236311799, EPD ref. RN14445-24 | 23 May 2024, 30 May 2024   | 1823, EPD     | CCZJV       | Noise               | 27 May 2024           | <ul style="list-style-type: none"><li>A complaint was received by 1823 (CASE#3-8236311799) and EPD (EPD ref. RN14445-24) on 23 May 2024 and 30 May 2024 from the same complainant respectively. The complainant concerned about the noise nuisance generated from night-time construction works near Tai Po Road - Sha Tin section (near Shatin Plaza). According to the Main Contractor, road miller was used between 00:00 and 01:20 of 23rd May 2024, which complied with CNP No. GW-RN0382-24 (condition 3.d.2: road miller shall only be used between 22:30 and 02:30 on the next day for not more than 1.5 hours). According to the photo record provided by the Main Contractor, movable noise barrier and SilentCUBE© noise enclosure was provided during road reinstatement. ET checked that the Main Contractor had complied with the conditions listed in CNP No.: GW-RN0382-24. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNPs and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers. The main contractor was reminded to pay attention to CNP condition 3.d.2 for the time limitation of using hand-held breaker, road miller, mini road</li></ul> | 5 June 2024   |

## FUGRO TECHNICAL SERVICES LIMITED

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : [matlab@fugro.com](mailto:matlab@fugro.com)  
Website : [www.fugro.com](http://www.fugro.com)



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                              | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
|               |                            |               |             |                     |                       | <p>millar, concrete saw and vibratory hammer mounted tracked excavator for night time construction works.</p> <p>The Main Contractor was reminded to use the allowable PME's listed in CNP condition 3.d for performing night-time construction works. Mitigation measures need to be applied according to the requirement in conditions 3.d and 4.d.</p> <p>The Main Contractor was also be reminded to pay attention to CNP conditions 3.a and 3.d for using PME's and need to provide related noise mitigation measures when carrying out similar night-time construction work activities in the future.</p> |               |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No.     | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                          | Date of Reply |
|-------------------|----------------------------|---------------|-------------|---------------------|-----------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| CASE#3-8238385380 | 24 May 2024                | 1823          | CCZJV       | Noise               | 28 May 2024           | <ul style="list-style-type: none"><li>A complaint was received via 1823 (CASE#3-8238385380) on 24 May 2024. The complainant concerned about the noise nuisance generated from night-time construction works near Tai Po Road - Sha Tin section (near Kwai Wo House, Lek Yuen Estate).<br/>According to the Main Contractor, road miller was used between 22:30 of 24th May 2024 and 00:00 of 25th May 2024, which complied with CNP No. GW-RN0382-24 (condition 3.d.2: road miller shall only be used between 22:30 and 02:30 on the next day for not more than 1.5 hours).<br/>According to the photo record provided by the Main Contractor, movable noise barrier was provided during road reinstatement.<br/>ET checked that the Main Contractor had complied with the conditions listed in CNP No.: GW-RN0382-24.<br/>The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers.<br/>The Main Contractor was reminded to use the allowable PMEs listed in CNP condition 3.d for performing night-time construction works. Mitigation measures need to be applied according to the requirement in conditions 3.d and 4.d.</li></ul> | 12 June 2024  |

## FUGRO TECHNICAL SERVICES LIMITED

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                          | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
|               |                            |               |             |                     |                       | The Main Contractor was also reminded to pay attention to CNP conditions 3.a and 3.d for using PME's and need to provide related noise mitigation measures when carrying out similar night-time construction work activities in the future. |               |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No.     | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                | Date of Reply |
|-------------------|----------------------------|---------------|-------------|---------------------|-----------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| CASE#3-8252037796 | 6 June 2024                | 1823          | CCZJV       | Noise               | 11 June 2024          | <ul style="list-style-type: none"><li>A complaint was received via 1823 (CASE#3-8252037796) on 6 June 2024. The complainant concerned about the noise nuisance generated from night-time construction works at Tai Po Road – Sha Tin section (near Hilton Plaza). According to the photo record provided by the Main Contractor, movable noise barrier was provided for road surface reinstatement works during the nighttime construction. ET checked that there was no evidence that the Main Contractor had violated the conditions listed in CNP No.: GW-RN0487-24. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers. The Main Contractor was reminded to use the allowable PME's listed in CNP condition 3.d for performing night-time construction works. Mitigation measures need to be applied according to the requirement in conditions 3.d and 4.d. The Main Contractor was also reminded to pay attention to CNP conditions 3.a and 3.d for using PME's and need to provide related noise mitigation measures when carrying out similar night-time construction work activities in the future.</li></ul> | 30 July 2024  |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No.                           | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                     | Date of Reply |
|-----------------------------------------|----------------------------|---------------|-------------|---------------------|-----------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| CASE#3-8115454 475, EPD Ref RN1517 3-24 | 4 June 2024                | 1823, EPD     | CCZJV       | Noise               | 7 June 2024           | <ul style="list-style-type: none"><li>A further complaint was received via 1823 (CASE#3-8115454475) on 4 June 2024 and referred to EPD (EPD Ref: RN15173-24) on 7th June 2024. The complainant concerned about the noise nuisance generated from night-time construction works near Sha Tin Rural Committee Road and Lek Yuen Estate. According to the photo record provided by the Main Contractor, movable noise barrier was provided during road reinstatement. ET checked that there was no evidence that the Main Contractor had violated the conditions listed in CNP No.: GW-RN0382-24. The Main Contractor was reminded that the concrete structures under the bridge of Sha Tin Rural Committee Road was not equivalent to the required noise mitigation measures stated in CNP No.: GW-RN0382-24 Condition 3.d.14 (installation of sound baffles on the exterior of the engine compartments to prevent direct line of sight). The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNPs and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers. The Main Contractor was reminded to use the allowable PMEs listed in CNP condition 3.d for performing night-time construction works.</li></ul> | 26 June 2024  |

## FUGRO TECHNICAL SERVICES LIMITED

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                            | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
|               |                            |               |             |                     |                       | Mitigation measures need to be applied according to the requirement in conditions 3.d and 4.d. The Main Contractor was also be reminded to pay attention to CNP conditions 3.a and 3.d for using PME's and need to provide related noise mitigation measures when carrying out similar night-time construction work activities in the future. |               |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No.     | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  | Date of Reply |
|-------------------|----------------------------|---------------|-------------|---------------------|-----------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| CASE#3-8264422231 | 12 June 2024               | 1823          | CCZJV       | Noise               | 18 June 2024          | <ul style="list-style-type: none"><li>A complaint was received via 1823 (CASE#3-8264422231) on 12 June 2024. The complainant concerned about the noise nuisance generated from night-time construction works near Tai Po Road - Sha Tin section (near Sha Tin Plaza). According to the photo record provided by the Contractor, movable noise barrier was provided during road reinstatement. ET checked that there was no evidence that the Main Contractor had violated the conditions listed in CNP No.: GW-RN0487-24. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers. The Main Contractor was reminded to use the allowable PME's listed in CNP condition 3.d for performing night-time construction works. Mitigation measures need to be applied according to the requirement in conditions 3.d and 4.d. The Main Contractor was also reminded to pay attention to CNP conditions 3.a and 3.d for using PME's and need to provide related noise mitigation measures when carrying out similar night-time construction work activities in the future.</li></ul> | 31 July 2024  |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No.     | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             | Date of Reply  |
|-------------------|----------------------------|---------------|-------------|---------------------|-----------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------|
| CASE#3-8291722902 | 26 June 2024               | 1823          | CCZJV       | Noise               | 4 July 2024           | <ul style="list-style-type: none"><li>A complaint was received via 1823 (CASE#3-8291722902) on 26 June 2024. The complainant concerned about the noise nuisance generated from night-time construction works at Tai Po Road – Sha Tin section (near Wo Che Estate). According to the photo record provided by the Main Contractor, soundproof cloth was provided to enclose the work platform on cherry picker for carrying out installation work of noise barriers. ET checked that there was no evidence that the Main Contractor had violated the conditions listed in CNP No.: GW-RN0487-24. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNPs and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers. The Main Contractor was reminded to use the allowable PME's listed in CNP condition 3.d for performing night-time construction works. Mitigation measures need to be applied according to the requirement in conditions 3.d and 4.d. The Main Contractor was also be reminded to pay attention to CNP conditions 3.a and 3.d for using PME's and need to provide related noise mitigation measures when carrying out similar night-time construction work activities in the future.</li></ul> | 16 August 2024 |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No.     | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                    | Date of Reply    |
|-------------------|----------------------------|---------------|-------------|---------------------|-----------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------|
| CASE#3-8295356365 | 3 July 2024                | 1823          | CCZJV       | Noise               | 5 July 2024           | <ul style="list-style-type: none"><li>A complaint was received via 1823 (CASE#3-8295356365) on 3<sup>rd</sup> July 2024. The complainant concerned about the noise nuisance generated from night-time construction works near Tai Po Road - Sha Tin section (Scenery Court). Base on the current information provided, ET checked that there was no evidence that the Main Contractor had violated the conditions listed in CNP No.: GW-RN0566-24. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers.</li></ul> <p>ET carried out regular night-time noise monitoring on 2<sup>nd</sup> and 3<sup>rd</sup> July 2024 at NMS1 and NMS3, no exceedance case was found. All the noise monitoring results at the above-mentioned station were lower than the baseline level.</p> <p>The main contractor was reminded to pay attention to CNP condition 3.d.2 for the time limitation of using hand-held breaker, road miller, mini road miller, concrete saw and vibratory hammer mounted tracked excavator for nighttime construction works.</p> <p>The Main Contractor was reminded to use the allowable PMEs listed in CNP condition 3.d for performing night-time construction works.</p> | 2 September 2024 |

## FUGRO TECHNICAL SERVICES LIMITED

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                         | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
|               |                            |               |             |                     |                       | Mitigation measures need to be applied according to the requirement in conditions 3.d and 4.d. The Main Contractor was also reminded to pay attention to CNP conditions 3.a and 3.d for using PME's and need to provide related noise mitigation measures when carrying out similar night-time construction work activities in the future. |               |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No.     | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   | Date of Reply     |
|-------------------|----------------------------|---------------|-------------|---------------------|-----------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|
| CASE#3-8295905942 | 3 July 2024                | 1823          | CCZJV       | Noise               | 8 July 2024           | <ul style="list-style-type: none"><li>A complaint was received via 1823 (CASE no.: #3-8295905942) on 5th July 2024 and a further complaint was received via 1823 on 16th July 2024. The complainant concerned about the noise nuisance generated from night-time construction works near Tai Po Road – Sha Tin section (Wai Wah Centre).<br/>Base on the current information provided, ET checked that there was no evidence that the Main Contractor had violated the conditions listed in CNP No.: GW-RN0566-24. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers.<br/>ET carried out regular night-time noise monitoring on 2nd and 3rd July 2024 at NMS5A and NMS6A, no exceedance case was found. All the noise monitoring results at the above-mentioned station were lower than the baseline level.<br/>The Main contractor was reminded to pay attention to CNP condition 3.d.2 for the time limitation of using road miller for nighttime construction works. The Main Contractor was reminded to ensure that movable noise barrier was provided throughout the whole process of construction works.<br/>The Main Contractor was reminded to use the</li></ul> | 12 September 2024 |

## FUGRO TECHNICAL SERVICES LIMITED

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : [matlab@fugro.com](mailto:matlab@fugro.com)  
Website : [www.fugro.com](http://www.fugro.com)



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                   | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
|               |                            |               |             |                     |                       | allowable PME's listed in CNP condition 3.d for performing night-time construction works. Mitigation measures need to be applied according to the requirement in conditions 3.d and 4.d. The Main Contractor was also reminded to pay attention to CNP conditions 3.a and 3.d for using PME's and need to provide related noise mitigation measures when carrying out similar night-time construction work activities in the future. |               |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No.                            | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                              | Date of Reply  |
|------------------------------------------|----------------------------|---------------|-------------|---------------------|-----------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------|
| CASE#3-8356999 115, EPD Ref. RN2164 7-24 | 12 August 2024             | 1823, EPD     | CCZJV       | Noise               | 13 August 2024        | <ul style="list-style-type: none"><li>A complaint was received by 1823 (CASE#3-8356999115) on 12<sup>th</sup> August 2024 and was referred to EPD (EPD ref. RN21647-24) on 13<sup>th</sup> August 2024. The complainant concerned about the noise nuisance generated from night-time construction works near Tai Po Road - Sha Tin section (near Hilton Plaza). Although the work area was surrounded by permanent noise barrier, the Main Contractor was advised to carry out extra mitigation measures (moveable noise barrier, acoustic enclosure, sound baffles). Moveable noise barrier should be ensured to be provided throughout the time of road surface reinstatement work. ET checked that there is no evidence showing that the Main Contractor had violated the conditions listed in CNP No.: GW-RN0787-24. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNPs and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers. The Main contractor was reminded to pay attention to CNP condition 3.d.2 for the time limitation of using road miller for night-time construction works. The Main Contractor was reminded to ensure that movable noise barrier was provided throughout the period of carrying out road surface reinstatement</li></ul> | 30 August 2024 |

## FUGRO TECHNICAL SERVICES LIMITED

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                              | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
|               |                            |               |             |                     |                       | <p>works.</p> <p>The Main Contractor was reminded to use the allowable PME's listed in CNP condition 3.d for performing night-time construction works. Mitigation measures need to be applied according to the requirement in conditions 3.d and 4.d.</p> <p>The Main Contractor was also be reminded to pay attention to CNP conditions 3.a and 3.d for using PME's and need to provide related noise mitigation measures when carrying out similar night-time construction work activities in the future.</p> |               |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No.     | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       | Date of Reply   |
|-------------------|----------------------------|---------------|-------------|---------------------|-----------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------|
| CASE#3-8199986833 | 19 November 2024           | 1823          | CCZJV       | Noise               | 20 November 2024      | <ul style="list-style-type: none"><li>A further complaint was received via 1823 (CASE no.: #3-8199986833) on 19<sup>th</sup> November 2024. The complainant concerned about the noise nuisance generated from night-time construction works near Tai Po Road – Sha Tin section. The complaint was referred from AECOM to Environmental Team (ET) on 20<sup>th</sup> November 2024 08:47. Base on the current information provided, ET checked that there was no evidence that the Main Contractor had violated the conditions listed in CNP No.: GW-RN1103-24. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers. The Main Contractor was reminded to use the allowable PME's listed in CNP condition 3.d for performing night-time construction works. Mitigation measures need to be applied according to the requirement in conditions 3.d and 4.d. The Main Contractor was also reminded to pay attention to CNP conditions 3.a and 3.d for using PME's and need to provide related noise mitigation measures when carrying out similar night-time construction work activities in the future.</li></ul> | 4 December 2024 |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No.     | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  | Date of Reply   |
|-------------------|----------------------------|---------------|-------------|---------------------|-----------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------|
| CASE#3-8512842194 | 24 November 2024           | 1823          | CCZJV       | Noise               | 26 November 2024      | <ul style="list-style-type: none"><li>A complaint was received via 1823 (CASE no.: #3-8512842194) on 24<sup>th</sup> November 2024. The complainant concerned about the noise nuisance generated from night-time construction works near Tai Po Road – Sha Tin section. The complaint was referred from AECOM to Environmental Team (ET) on 26<sup>th</sup> November 2024 10:35. Base on the current information provided, ET checked that there was no evidence that the Main Contractor had violated the conditions listed in CNP No.: GW-RN1188-24. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers. The Main Contractor was reminded to use the allowable PMEs listed in CNP condition 3.d for performing night-time construction works. Mitigation measures need to be applied according to the requirement in conditions 3.d and 4.d.</li></ul> | 5 December 2024 |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No.     | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                      | Date of Reply   |
|-------------------|----------------------------|---------------|-------------|---------------------|-----------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------|
| CASE#3-8513905127 | 26 November 2024           | 1823          | CCZJV       | Noise               | 27 November 2024      | <ul style="list-style-type: none"><li>A complaint was received via 1823 (CASE no.: 3-8513905127) on 26th November 2024. The complainant concerned about the noise nuisance generated from night-time construction works near Lucky Plaza. The complaint was referred from AECOM to Environmental Team (ET) on 27th November 2024 13:39. Base on the current information provided, ET checked that there was no evidence that the Main Contractor had violated the conditions listed in CNP No.: GW-RN1103-24. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers. The Main Contractor was reminded to use the allowable PME's listed in CNP condition 3.d for performing night-time construction works. Mitigation measures need to be applied according to the requirement in conditions 3.d and 4.d. The Main Contractor was also reminded to pay attention to CNP conditions 3.a and 3.d for using PME's and need to provide related noise mitigation measures when carrying out similar night-time construction work activities in the future.</li></ul> | 9 December 2024 |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No.     | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                          | Date of Reply  |
|-------------------|----------------------------|---------------|-------------|---------------------|-----------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------|
| CASE#3-8518908091 | 29 November 2024           | 1823          | CCZJV       | Noise               | 2 December 2024       | <ul style="list-style-type: none"><li>A complaint was received via 1823 (CASE no.: 3-8518908091) on 29th November 2024. The complainant concerned about the noise nuisance generated from night-time construction works near Sha Tin Rural Committee Road and Lucky Plaza. The complaint was referred from AECOM to Environmental Team (ET) on 2nd December 2024 14:36.</li></ul> <p>Base on the current information provided, ET checked that there was no evidence that the Main Contractor had violated the conditions listed in CNP No.: GW-RN1103-24. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers.</p> <p>ET carried out regular night-time noise monitoring on 28th ^ 29th November 2024 at NMS9 and NMS24, no exceedance case was found. All the noise monitoring results at the above-mentioned station were lower than the baseline level.</p> <p>The Main Contractor was reminded to use the allowable PMEs listed in CNP condition 3.d for performing night-time construction works. Mitigation measures need to be applied according to the requirement in conditions 3.d and 4.d.</p> <p>The Main Contractor was also reminded to ensure</p> | 7 January 2025 |

## FUGRO TECHNICAL SERVICES LIMITED

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                 | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|----------------------------------------------------------------------------------------------------|---------------|
|               |                            |               |             |                     |                       | the implementation of effective noise mitigation measures throughout the nighttime working period. |               |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No.                                           | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  | Date of Reply     |
|---------------------------------------------------------|----------------------------|---------------|-------------|---------------------|-----------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|
| CASE#3-8356999<br>115,<br>EPD<br>Ref:<br>RN2164<br>7-24 | 20<br>December<br>2024     | 1823,<br>EPD  | CCZJV       | Noise               | 21 December<br>2024   | <ul style="list-style-type: none"><li>A further complaint of complaint case (CASE no.: 3-8356999115, EPD Ref: RN21647-24) was referred from EPD (EPD Ref: RN35496-24) on 20th December 2024. The complainant concerned about the noise nuisance generated from night-time construction works at Tai Po Road (Sha Tin Section). The complaint was referred from AECOM to Environmental Team (ET) on 21st December 2024 12:42.<br/>Base on the current information provided, ET checked that there was no evidence showing that the Main Contractor had violated the conditions listed in CNP No.: GW-RN1275-24. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers.<br/>The Main Contractor was reminded to use the allowable PME's listed in CNP condition 3.d for performing night-time construction works. Mitigation measures need to be applied according to the requirement in conditions 3.d and 4.d. The Main Contractor was also reminded to ensure the implementation of effective noise mitigation measures throughout the nighttime working period.</li></ul> | 8 January<br>2025 |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No.                         | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                           | Date of Reply   |
|---------------------------------------|----------------------------|---------------|-------------|---------------------|-----------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------|
| CASE#3-8486720914, EPD Ref RN30827-24 | 6 November 2025            | 1823, EPD     | CCZJV       | Noise               | 3 January 2025        | <ul style="list-style-type: none"><li>A complaint was received via 1823 (CASE no.: 3-8486720914) on 5th November 2024 and referred to EPD (EPD Ref: RN30827-24) on 6th November 2024. The complainant concerned about the noise nuisance generated from night-time construction works near Sha Tin Rural Committee Road. The complaint was referred from AECOM to Environmental Team (ET) on 3rd January 2025 11:39.</li></ul> <p>Base on the current information provided, ET checked that there was no evidence showing the Main Contractor had violated the conditions listed in CNP No.: GW-RN1103-24. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers.</p> <p>The Main Contractor was reminded to use the allowable PME's listed in CNP condition 3.d for performing night-time construction works. Mitigation measures need to be applied according to the requirement in conditions 3.d and 4.d. The Main Contractor was advised to stop the nighttime construction works earlier and ready for moving the PME's away when the limit of permitted hours stated in the CNP (i.e. 05:00) was reached.</p> | 24 January 2025 |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No.                                  | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                      | Date of Reply   |
|------------------------------------------------|----------------------------|---------------|-------------|---------------------|-----------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------|
| CASE#3-8568604<br>810,<br>EPD Ref<br>RN0740-25 | 7 January 2025             | 1823,<br>EPD  | CCZJV       | Noise               | 10 January 2025       | <ul style="list-style-type: none"><li>A complaint was received via 1823 (CASE no.: 3-8568604810) on 7th January 2025 and referred to EPD (EPD Ref: RN0740-25). The complainant concerned about the noise nuisance generated from night-time construction works near Sha Tin Rural Committee Road. The complaint was referred from AECOM to Environmental Team (ET) on 10th January 2025 17:15.</li></ul> <p>Base on the current information provided, ET checked that there was no evidence showing the Main Contractor had violated the conditions listed in CNP No.: GW-RN1275-24. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers.</p> <p>The Main Contractor was reminded to use the allowable PME's listed in CNP condition 3.d for performing night-time construction works. Mitigation measures need to be applied according to the requirement in conditions 3.d and 4.d. The Main Contractor was advised to provide movable noise barriers on both sides of the PME's when carrying out road reinstatement works, in order to minimize the noise impact caused by the works.</p> | 27 January 2025 |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                    | Date of Reply    |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------|
| 3-8512842194  | 11 January 2025            | 1823          | CCZJV       | Noise               | 14 January 2025       | <ul style="list-style-type: none"><li>A complaint was received via 1823 (CASE no.: 3-8512842194) on 11th January 2025. The complainant concerned about the noise nuisance generated from night-time construction works near Shatin Plaza. The complaint was referred from AECOM to Environmental Team (ET) on 14th January 2025 15:16.</li></ul> <p>Base on the current information provided, ET checked that there was no evidence showing the Main Contractor had violated the conditions listed in CNP No.: GW-RN1275-24. The Main Contractor was reminded to strictly follow and fully comply with the requirement listed in the CNP and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hour. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers.</p> <p>ET carried out regular night-time noise monitoring on 9th ^ 10th January 2025 at NMS8 and NMS24, no exceedance case was found. The noise monitoring results at NMS8 was lower than the baseline level while the noise monitoring results at NMS24 was lower than the limit level after correction.</p> <p>The Main Contractor was reminded to use the allowable PME's listed in CNP condition 3.d for performing night-time construction works. Mitigation measures need to be applied according to the requirement in conditions 3.d and 4.d.</p> | 12 February 2025 |

## FUGRO TECHNICAL SERVICES LIMITED

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                    | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|---------------------------------------------------------------------------------------------------------------------------------------|---------------|
|               |                            |               |             |                     |                       | The Main Contractor was advised to ensure that no gaps were left on the noise enclosure in order to minimize the noise impact caused. |               |

# FUGRO TECHNICAL SERVICES LIMITED

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



| Reference No.                    | Date of Complaint Received                            | Received From | Received By | Nature of Complaint | Date of Investigation                                 | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   | Date of Reply |
|----------------------------------|-------------------------------------------------------|---------------|-------------|---------------------|-------------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
| 3-8199986833, EPD Ref: RN2794-25 | 28 January 2025, 7 February 2025 and 12 February 2025 | 1823, EPD     | CCZJV       | Noise               | 3 February 2025, 7 February 2025 and 12 February 2025 | <ul style="list-style-type: none"> <li>A further complaint of CASE no.: 3-8199986833 was received via 1823 (CASE no.: 3-8596770160) on 28<sup>th</sup> January 2025 and referred to EPD (EPD Ref: RN2794-25). Two other further complaints were received via 1823 on 7<sup>th</sup> February 2025 and 12<sup>th</sup> February 2025 respectively. Another complaint was received by EPD from the same complainant on 7<sup>th</sup> February 2025 (EPD Ref: RN3357-25). The complainant concerned about the noise nuisance generated from night-time construction works near Sha Tin Rural Committee Road and Shatin Plaza. The complaint was referred from AECOM to Environmental Team (ET) on 3<sup>rd</sup> February 2025 9:27, 7<sup>th</sup> February 2025 14:56 and 12<sup>th</sup> February 2025 15:04. Base on the current information provided, ET checked that there was no evidence showing the Main Contractor had violated the conditions listed in CNPs No.: GW-RN1275-24 and GW-RN1508-24. The Main Contractor was reminded to strictly follow and fully comply with the requirements listed in the CNPs and the mitigation measures stipulated in the EM&amp;A Manual when carrying out construction activities during the restricted hours. All construction works should be carried out as quickly as possible to minimize the noise nuisance to the sensitive receivers. ET carried out regular night-time noise monitoring at NMS9 and NMS24 on 6 ^ 7</li> </ul> | 6 March 2025  |

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : [matlab@fugro.com](mailto:matlab@fugro.com)  
Website : [www.fugro.com](http://www.fugro.com)



| Reference No. | Date of Complaint Received | Received From | Received By | Nature of Complaint | Date of Investigation | Investigation summary & Conclusion                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                | Date of Reply |
|---------------|----------------------------|---------------|-------------|---------------------|-----------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|
|               |                            |               |             |                     |                       | <p>February 2025, and NMS8 and NMS24 on 11 ^ 12 February 2025, no exceedance case was found. The noise monitoring results at NMS9 and NMS24 during 6 ^ 7 February 2025 were lower than the limit level after correction while the noise monitoring results at NMS8 and NMS24 on 12 February 2025 were lower than the baseline level.</p> <p>The Main Contractor was reminded to use the allowable PME's listed in CNPs condition 3.d for performing night-time construction works. Mitigation measures need to be applied according to the requirements in conditions 3.d and 4.d.</p> <p>The Main Contractor was advised to provide movable noise barriers on both sides of the PME's when carrying out road reinstatement works, in order to minimize the noise impact caused by the works.</p> |               |

## FUGRO TECHNICAL SERVICES LIMITED

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com



### Cumulative Statistics on Complaints

| Environmental Parameters | Cumulative No. Brought Forward | No. of Complaints This Month | Cumulative Project-to-Date |
|--------------------------|--------------------------------|------------------------------|----------------------------|
| Air                      | 7                              | 0                            | 7                          |
| Noise                    | 123                            | 1                            | 124                        |
| Water                    | 10                             | 0                            | 10                         |
| Waste                    | 0                              | 0                            | 0                          |
| <b>Total</b>             | <b>140*</b>                    | <b>1</b>                     | <b>141*</b>                |

\*The 1<sup>st</sup> complaint in March 2021, Jan 2022 and July 2022 were included both the air and noise parameters, hence the total no. of complaints is deducted by 2.

### Cumulative Statistics on Notification of Summons and Successful Prosecutions

| Environmental Parameters | Cumulative No. Brought Forward | No. of Notification of Summons and Prosecutions This Month | Cumulative Project-to-Date |
|--------------------------|--------------------------------|------------------------------------------------------------|----------------------------|
| Air                      | 0                              | 0                                                          | 0                          |
| Noise                    | 1                              | 0                                                          | 1                          |
| Water                    | 0                              | 0                                                          | 0                          |
| Waste                    | 0                              | 0                                                          | 0                          |
| <b>Total</b>             | <b>1</b>                       | <b>0</b>                                                   | <b>1</b>                   |

## **FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : [matlab@fugro.com](mailto:matlab@fugro.com)  
Website : [www.fugro.com](http://www.fugro.com)



### **Appendix M**

#### **Summary of Site Audit in the Reporting Month**

**FUGRO TECHNICAL SERVICES LIMITED**

Fugro Development Centre,  
5 Lok Yi Street, Tai Lam,  
Tuen Mun, N.T.,  
Hong Kong.

Tel : +852 2450 8233  
Fax : +852 2450 6138  
E-mail : matlab@fugro.com  
Website : www.fugro.com

**Summary of Site Audit in the Reporting Month**

| Parameter                     | Date                                                           | Observations and Reminders                                                                                 | Follow-up Action Taken                   |
|-------------------------------|----------------------------------------------------------------|------------------------------------------------------------------------------------------------------------|------------------------------------------|
| Air Quality                   | 6 February 2025                                                | <b>Observation 1:</b><br>Mini-stockpiles should be covered properly. (Zone 3)                              | Stockpile was covered. (Zone 3, SB)      |
|                               | 17 February 2025                                               | <b>Reminder 1:</b><br>Stockpile should be covered with tarpaulin for dust suppression. (Zone 3)            | Stockpile was covered. (Zone 3, SB)      |
|                               | 25 February 2025                                               | <b>Reminder 1:</b><br>Stockpile should be covered with tarpaulin or removed for dust suppression. (Zone 3) | Stockpile was covered. (Zone 3, SB)      |
| Noise                         | No specific observation was identified in the reporting month. |                                                                                                            |                                          |
| Water Quality                 | 13 February 2025                                               | <b>Reminder 1:</b><br>Contractor was reminded to clear stagnant water accumulated after raining. (Zone 3)  | Stagnant water was cleared. (Zone 3, SB) |
| Chemical and Waste Management | No specific observation was identified in the reporting month. |                                                                                                            |                                          |
| Land Contamination            | No specific observation was identified in the reporting month. |                                                                                                            |                                          |
| Landscape and Visual Impact   | No specific observation was identified in the reporting month. |                                                                                                            |                                          |
| General Condition             | No specific observation was identified in the reporting month. |                                                                                                            |                                          |
| Permit / Licenses             | No specific observation was identified in the reporting month. |                                                                                                            |                                          |