Citybus Group Limited

Citybus Permanent Headquarters and Bus Maintenance Depot in Chai Wan

Monthly Environmental Monitoring and Audit Report December 2003

Second Issue

Citybus Group Limited

Citybus Permanent Headquarters and Bus Maintenance Depot in Chai Wan

Environmental Monitoring and Audit

Monthly Environmental Monitoring and Audit Report – December 2003

January 2004

Ove Arup & Partners Hong Kong Ltd

Level 5, Festival Walk, 80 Tat Chee Avenue, Kowloon Tong, Kowloon, Hong Kong Tel +852 2528 3031 Fax +852 2268 3950 www.arup.com

Job number 23420

IEC Approval Form

Project Name	Citybus Permanent Headquarters and Bus Maintenance
	Donat in Chai Wan

Depot in Chai Wan

Environmental Permit No EP-107/2001

Project Proponent Citybus Group Limited

Environmental Team Ove Arup & Partners

Independent Environmental Checker Westwood Hong & Associates

Report Name Monthly EM&A Report December 2003

This document is prepared to prove that the above said report is prepared by the Environmental Team and certified by the Independent Environmental Checker

Signature of ET Leader Signature



Job tille		Citybus Perm	as Permanent Headquarters and		Job number
		Bus Maintenance Depot in Chai Wan			23420
Document	title	Environment	ental Monitoring and Audit		File reference
Document	ref	23420-34			
Revision	Date	Filename	G:\cnv\project\23420\repor	ts\Monthly\2003-12\34 - De	c 03.doc
First Issue	09/01/04	Description	First Issue to Client, IEC and EPD		
			Prepared by	Checked by	Approved by
		Name	Angus Choi	Fredrick Leong	Sam Tsoi
		Signature			
Second	12/01/04	Filename	G:\env\project\23420\repor	ts\Monthly\2003-12\34 - De	c 03 2nd.doc
Issue		Description	Second Issue to Client, IEC and EPD		
			Prepared by	Checked by	Approved by
		Name	Angus Choi	Fredrick Leong	Sam Tsoi
		Signature	Chy.	Link	Su.
		Filename			
		Description		·	
			Prepared by	Checked by	Approved by
		Name			
		Signature			
		Filename		<u>,l</u>	
		Description			
			Prepared by	Checked by	Approved by
		Name			
		Signature			
		.i		Issue Document Veri	fication with Document

©Ove Arup Partnership Ltd F8.5 QA Rev 1/00 1 October 2000

CONTENTS

		Page
EXECU	TIVE SUMMARY	1
1.	INTRODUCTION	2
1.1	Purpose of the Report	2
1.2	Site Description	2
1.3	Organisation and Personnel	4
2.	ENVIRONMENTAL STATUS	6
2.1	Construction Programme	6
2.2	Construction Activities of the Month	6
2.3	Environmental Sensitive Receivers	6
3.	SUMMARY OF EM&A REQUIREMENTS	8
3.1	Construction Noise Monitoring	8
3.2	Air Quality Monitoring	9
3.3	Performance Limits and Event-Action Plans	10
3.4	Site Inspection and Environmental Complaint Handling	14
4.	CONSTRUCTION NOISE MONITORING	17
4.1	Monitoring Equipment	17
4.2	Methodology	17
4.3	Results and Observations	18
5.	AIR QUALITY MONITORING	20
5.1	Monitoring Equipment	20
5.2	Methodology	20
5.3	Results and Observations	22
6.	SITE AUDIT, ENVIRONMENTAL COMPLAINTS, ENVIRONMENTAL LICENSE AND NON-COMPLIANCE RECORDS	25
6 1	AND NON-COMPLIANCE RECORDS Audit Results	25 25
6.1 6.2	Summary of Waste Disposal	25 26
6.3	Complaint Record	26 26
6.4	Non-compliances	26 26
U. T	140H compliances	20
7.	REFERENCES	27

TABLES

Table 2-1	Identified sensitive receivers
Table 3-1	Construction noise monitoring parameters and frequency requirements
Table 3-2	Noise impact monitoring locations
Table 3-3	TSP monitoring parameters and frequency
Table 3-4	Air quality monitoring location
Table 3-5	Action and Limit levels for construction noise
Table 3-6	Event-action plan for construction noise
Table 3-7	Action and Limit levels for air quality
Table 3-8	Action and Limit levels for 24-hour TSP
Table 3-9	Action and Limit levels for 1-hour TSP
Table 3-10a	Event-action plan for air quality (Action Level)
Table 3-10b	Event-action plan for air quality (Limit Level)
Table 4-1	Equipment list for construction noise monitoring
Table 4-2	Daytime noise monitoring results for December 2003
Table 5-1	Equipment list for TSP monitoring
Table 5-2	24-hour TSP monitoring results for December 2003
Table 5-3	1-hour TSP monitoring average results for December 2003
Table 6-1	Summary of environmental complaints

FIGURES

Figure 1-1	Site location plan of Citybus permanent headquarters and bus maintenance depot in Chai Wan
Figure 2-1	Locations of construction site and environmental sensitive receivers
Figure 3-1	Noise monitoring in progress
Figure 3-2	Flow chart of the complaint response procedure
Figure 4-1	Daytime noise monitoring results for December 2003
Figure 5-1	24-hour TSP monitoring results for December 2003
Figure 5-2	1-hour TSP monitoring results for December 2003
Figure 6-1	Dust generated from earth breaking operation.

APPENDICES

APPENDIX A

EM&A Schedules for December 2003 and January 2004

APPENDIX B

Detailed Noise Monitoring Results

APPENDIX C

Calibration Certificate of HVS

APPENDIX D

Detailed Air Quality (24-hour TSP) Monitoring Results

APPENDIX E

Detailed Air Quality (1-hour TSP) Monitoring Results

ABBREVIATIONS AND ACRONYMS

A/L Levels Action and Limited Levels
AQO Air Quality Objectives

Arup Ove Arup & Partners Hong Kong Limited

ASR Area Sensitive Rating

B&K Brüel & Kjær

CNP Construction Noise Permit

CR Contractor

DA-TM Technical Memorandum on Noise from Construction Work in

Designated Areas

EA Environmental Auditor

EM&A Environmental Monitoring and Audit EPD Environmental Protection Department ER Engineer / Engineer's Representative

ET Environmental Team

GW-TM Technical Memorandum on Noise from Construction Work other than

Percussive Piling

HKSAR Hong Kong Special Administrative Region

HOKLAS The Hong Kong Laboratory Accreditation Scheme

HVS High Volume Sampler

IC(E) Independent Environmental Checker

IEC International Electrotechnical Commission Publications

IVE - CW Institution of Vocational Education (Chai Wan)

K Degrees Kelvin

LCP Ling Chan + Partners Limited

NAMAS National Measurement Accreditation Service

NSR Noise Sensitive Receiver

PSPS Private Sector Participation Schemes

SR Sensitive Receiver

TSP Total Suspended Particulates

EXECUTIVE SUMMARY

This is the twenty-fifth monthly EM&A report presenting the site inspection findings, and the progress on air quality and noise impact monitoring for December 2003.

Daytime (0700 – 1900 hours) noise monitoring was conducted at 4 locations. The highest noise level was 67.5 dB(A) recorded at Hong Kong IVE Chan Wan on 4 December 2003 and the lowest was 63.0 dB(A) recorded at Heng Fa Chuen on 10 December 2003 and Tsui Wan Estate on 6 December respectively. There were no exceedances on the A/L Levels during the monitoring period.

The highest average 1-hour TSP was 236.3 $\mu g/m^3$ recorded at the Hong Kong IVE Chai Wan on 18 December 2003 and the lowest average 1-hour TSP was 180.5 $\mu g/m^3$ recorded at the Hong Kong IVE Chai Wan on 16 December 2003. There were no exceedances on the A/L Levels during the monitoring period.

The highest 24-hour TSP level was $133.6 \,\mu\text{g/m}^3$ recorded at the Hong Kong IVE Chai Wan on 29 December 2003 and the lowest 24-hour TSP was $86.1 \,\mu\text{g/m}^3$ recorded at the Hong Kong IVE Chai Wan on 11 December 2003. There were no exceedances on the A/L Levels during the monitoring period.

Site inspections were carried out weekly in December 2003. The findings are summarised as follows:

- Working area of earth breaking was not sprayed with water.
- No significant noise impact was identified.
- No significant water quality impact was identified.
- No significant waste impact was identified.

The major construction activity carried out by the Contractor in December 2003 was the internal fitting out and external decoration of the maintenance depot.

A total of 129 loads of non-inert material were disposed of at SENT Landfill in December 2003. The total quantity of the disposed non-inert material was 3,096 tonnes in December 2003.

1. INTRODUCTION

Ove Arup & Partners Hong Kong Limited (Arup) was appointed by Citybus Group Limited as the Environmental Team (ET) for Citybus Permanent Headquarters and Bus Depot in Chai Wan (hereafter called the "Project"). Environmental parameters including air quality and construction noise were selected for impact monitoring. The construction activities of the Project have commenced in December 2001 and is expected to last for about 24 months.

1.1 Purpose of the Report

The purpose of the EM&A report is to present the monitoring and audit results for the environmental issues including air quality, noise, and waste management due to the captioned construction project on a monthly basis. This is the twenty-fifth monthly EM&A report to summarise the EM&A requirements, the environmental status, equipment, monitoring methodology, monitoring locations, periods, frequencies, results and any observations from the noise and air measurements in December 2003.

1.2 Site Description

The construction site is surrounded by Road 20/4, Road 20/6 and Shing Tai Road as shown in Figure 1-1. The total site area is approximately 1 hectare. The Project consists of five storeys with the bus depot located on G/F to 3/F for bus parking and maintenance, and depot office on 4/F to 5/F.

Legend: Monitoring, Stations (抽摩 SOIL DEADT 货物袋即獲 . CARGO HANDLING BASIN

Figure 1-1 Site location plan of Citybus permanent headquarters and bus maintenance depot in Chai Wan

1.3 Organisation and Personnel

The primary responsibilities and duties of the respective parties in this EM&A programme are described in the following sub-sections:

1.3.1 Project Manager

The entire construction of the Project is managed by *Citybus Group Limited* as the Project Manager. The Project Manager is supported by an Engineer's Representative (ER) and an Environmental Team (ET) to ensure that the environmental quality will comply with the project requirements.

1.3.2 Engineer's Representative

The Engineer is *Ling Chan* + *Partners Limited (LCP)*. The Engineer's Representative is responsible for:

- Supervising the Contractor (CR) activities and ensuring that the requirements in the Environmental Management Plan^[1] are fully complied with;
- Informing the CR when action is required to reduce impacts in accordance with the Event and Action Plans; and
- Adhering to the procedures for carrying out complaint investigation in accordance with Environmental Management Plan.

1.3.3 Environmental Team

Ove Arup & Partners Hong Kong Limited (Arup), has been appointed by Citybus to take up the role of the Environmental Team (ET), and ET is responsible for:

- Sampling, analysis and statistical evaluation of monitoring parameters with reference to the EIA study recommendations and requirements with respect of noise, dust and water quality.
- Conducting environmental site surveillance.
- Auditing the compliance with environmental protection and pollution prevention and control regulations.
- Monitoring the implementation of environmental mitigation measures.
- Monitoring the compliance with the environmental protection clauses/specifications in the Contract.
- Reviewing construction programme and providing comment as necessary.
- Reviewing construction methodology and providing comment as necessary.
- Conducting complaint investigation, evaluation and identification of corrective measures.
- Auditing of the EMS and recommending and implementing any changes as appropriate.
- Liasing with the Independent Environmental Checker (IC((E)) on all environmental performance matters.

- Advising the Contractor on environmental improvement, awareness, enhancement matter, etc. on site.
- Submitting the designated EM&A reports timely to the ER, the IC(E) and the EPD as appropriate.

1.3.4 Contractors

The site formation works are undertaken by *Vibro (HK) Limited* and construction of superstructure are undertaken by *W. Hing Construction Co. Ltd*, the Contractors (CR). In this EM&A programme, the CR is responsible for:

- Submitting the proposals on mitigation measures in cases of exceedance of Action and Limit levels and in accordance with the Event and Action Plans;
- Implementing measures to reduce impact where Action and Limit levels are exceeded; and
- Adhering the procedures for carrying out complaint investigation in accordance with the Environmental Management Plan.

2. ENVIRONMENTAL STATUS

2.1 Construction Programme

The construction has been commenced in December 2001, and is anticipated to be completed in 30 months. The construction programme is given in the Monthly EM&A Report – December 2001^[2].

2.2 Construction Activities of the Month

The major construction activity carried out by the CR in December 2003 was the internal fitting out and external decoration of the maintenance depot.

2.3 Environmental Sensitive Receivers

Several residential buildings and an educational institution close to the site have been identified as environmental sensitive receivers in the EIA Report. The identified sensitive receivers are summarised in Table 2-1 and shown in Figure 2-1.

Table 2-1 Identified sensitive receivers

Sensitive Receivers No.	Description	
N1	Heng Fa Chuen	
N2	Staff Quarters of Chai Wan IVE	
N3/A1	Hong Kong IVE Chai Wan	
N4	Tsui Wan Estate	

Heng Fa Chuen, Block 50 Legend: Noise Monitoring N1) Stations 、抽寒 BOIL DEFOT Air Monitoring Stations Staff Quarters of Chai Wan IVE Site Area of Proposed Headquarters Hong Kong Institute of Vocational Education and Bus Maintenance Depot (Chai Wan) Tsui Wan Estate, Tsui Sau House

Figure 2-1 Locations of construction site and environmental sensitive receivers

3. SUMMARY OF EM&A REQUIREMENTS

Construction noise and air quality were significant environmental impacts identified for the construction period of the project. In accordance with the Environmental Management Plan, air quality and noise impact monitoring shall be performed by the ET at all specified monitoring locations during the construction stage.

3.1 Construction Noise Monitoring

3.1.1 Monitoring Parameters

Construction noise monitoring shall be measured in terms of the A-weighted equivalent continuous sound pressure level ($L_{\rm eq}$). $L_{\rm 10}$ and $L_{\rm 90}$ will also be recorded as supplementary reference information for data auditing.

3.1.2 Monitoring Frequency

Construction noise measurements were required to be taken on a weekly basis according to the Environmental Management Plan. The monitoring time periods, monitoring parameters and frequency are specified in Table 3-1. The monitoring schedules for December 2003 and January 2004 are attached in Appendix A.

Table 3-1 Construction noise monitoring parameters and frequency requirements

Time Period (when construction activity is found)	Parameters	Monitoring Frequency	No. of measurements for each monitoring
Between 0700-1900 hours on normal weekdays	L _{eq} (30 min)		1
Between 1900-2300 hours on normal weekdays		Once per week	
Between 2300-0700 hours of next day	L _{eq(5 min)} *		3 (consecutive)
Between 0700-1900 hours on holidays			

Remarks: The Leq(5 min) will only be measured if construction activities are conducted on general holidays and between the period of 1900 and 0700 hours during normal weekdays.

3.1.3 Monitoring Locations

A total of 4 monitoring locations were specified. They are given in Table 3-2. The measurements were taken at 1m from the building facade and maintained at a height 1.2m above floor. Three photos showing the noise monitoring work in action are given in Figure 3-1.

Table 3-2 Noise impact monitoring locations

NSR No.	Location	Monitoring Point
N1	Heng Fa Chuen	Block 50
N2	Staff Quarters of IVE Chai Wan	Roof-top (Block C,D)
N3	Hong Kong IVE Chai Wan	Roof-top
N4	Tsui Wan Estate	Tsui Sau House

Figure 3-1 Noise monitoring in progress







3.2 Air Quality Monitoring

3.2.1 Monitoring Parameters

Air monitoring shall be measured in terms of the TSP levels for both 24-hour and 1-hour periods.

3.2.2 Monitoring Frequency

24-hour TSP and 1-hour TSP levels shall be monitored during the course of construction according to the Environmental Management Plan. The monitoring parameters and frequencies are specified in Table 3-3. The monitoring schedules for December 2003 and January 2004 are attached in Appendix A.

Table 3-3 TSP monitoring parameters and frequency

Parameters	Monitoring Frequency	Time Period	No. of measurement for each monitoring
24-hour TSP	Once every six days	0000 - 2400	1
1-hour TSP	Three times per every six days	0700 - 1900	1

3.2.3 Monitoring Locations

One monitoring location was specified for air quality impact and it is presented in Table 3-4.

Table 3-4 Air quality monitoring location

ASR No.	Location	Monitoring Point
A1	Hong Kong IVE Chai Wan	Roof-top

3.3 Performance Limits and Event-Action Plans

The monitoring results were checked against appropriate standards and requirements. A two-tier system performance limits has been established in Environmental Management Plan. The "Action Level" and the "Limit Level" are established according to the EPD requirements. Corresponding actions will be taken by ET, ER and CR in accordance with the Event-Action Plans if the monitoring results exceed the performance limits.

3.3.1 Construction Noise Impact

The Action and Limit (A/L) levels for the construction noise have been established in accordance with the Generic EM&A Manual and they are tabulated in Table 3-5.

Table 3-5 Action and Limit levels for construction noise

Time Period	Action Level	Limit Level dB(A)
0700 - 1900 hours on weekdays		75*
0700 - 2300 hours on General Holidays; & 1900 - 2300 hours on all other days	When one documented complaint is received	60/65/70**
2300 - 0700 hours of next day		45/50/55**

Remarks:

Note: If works are to be carried out during restricted hours, the conditions stipulated in the construction noise permit issued by the Noise Control Authority have to be followed

^{*} reduced to 70dB(A) for schools and 65dB(A) during school examination periods.

^{**} to be selected based on Area Sensitivity Rating

Table 3-6 details the actions required to be carried out by different parties in the case of an exceedance of performance limits being detected.

Table 3-6 Event-action plan for construction noise

Event	Ac	tion	
LVCIR	ET or ER	Contractor	
Action Level	 Notify Contractor Analyse investigation Require Contractor to propose measures for the analysed noise problem Increase monitoring frequency to check mitigation effectiveness 	 Submit noise mitigation proposals to ET / ER Implement noise mitigation proposals 	
Limit Level	Notify Contractor Notify EPD Require Contractor to implement mitigation measures, increase monitoring frequency to check mitigation effectiveness	Implement mitigation measures Prove to ET / ER effectiveness of measures applied	

3.3.2 Air Quality

The A/L levels for air quality have been established in the Environmental Management Plan and they are tabulated in Table 3-7

Table 3-7 Action and Limit levels for air quality

Parameters	Action Level	Limit Level
24 Hour TCD Lovel in unim3	• For baseline level ≤ 200 µg/m³, Action Level = (baseline level plus 30% + Limit Level)/2	240
24 Hour TSP Level in μg/m ³	 For baseline level > 200 μg/m³, Action Level = Limit Level 	260
1 Hour TSP Level in μg/m ³	 For baseline level < 384μg/m³, Action Level = (baseline level plus 30% + Limit Level)/2 	500
	 For baseline level > 384 μg/m³, Action Level = Limit Level 	

In accordance with the Baseline Monitoring Report^[3], the Action and Limit levels for 24-hour TSP and 1-hour TSP at monitoring location A1 were established and they are tabulated in Table 3-8 and Table 3-9 respectively.

Table 3-8 Action and Limit levels for 24-hour TSP

ASR No.	Monitoring Location	24-hour TSP Level in mg/m³		
	Worldoning Location	Action Level	Limit Level	
A1	Hong Kong IVE Chai Wan	220.8	260.0	

Table 3-9 Action and Limit levels for 1-hour TSP

ASR No.	Monitoring Location	1-hour TSP Level in mg/m3		
ASIC NO.	Worldoning Location	Action Level	Limit Level	
A1	Hong Kong IVE Chai Wan	303.2	500.0	

Table 3-10 details the actions required to be carried out by different parties in case of an exceedance of performance limits being detected.

Table 3-10a Event-action plan for air quality (Action Level)

Table 3-10a	Event-action plan for all quality (Action Level)				
Event		Action			
270110	ET	ER	Contractor		
Action Level					
Exceedance for one sample	Identify source Inform ER Repeat measurement to confirm finding Increase monitoring frequency to daily	Notify Contractor Check monitoring data and Contractor's working methods	Rectify any unacceptable practice Amend working methods if appropriate		
Exceedance for two or more consecutive samples	 Identify source Inform ER Repeat measurement to confirm findings Increase monitoring frequency to daily Discuss with ER for remedial actions required If exceedance continues, arrange meeting with ER If exceedance stops, cease additional monitoring 	Confirm receipt of notification of failure in writing Notify Contractor Check monitoring data and Contractor's working methods Discuss with Environmental Supervisor and Contractor on potential remedial actions Ensure remedial actions properly implemented	Submit proposals for remedial actions to ER within 3 working days of notification Implement the agreed proposals Amend proposal if appropriate		

Table 3-10b Event-action plan for air quality (Limit Level)

Table 3-10b	Event-action plan for air quality (Limit Level)				
Event					
LVCIII	ET	ER	Contractor		
Limit Level					
Exceedance for one sample	Identify source Inform ER and EPD Repeat measurement to confirm finding Increase monitoring frequency to daily Assess effectiveness of Contractor's remedial actions and keep EPD and ER informed of the results	Confirm receipt of notification of failure in writing Notify Contractor Check monitoring data and Contractor's working methods Discuss with Environmental Supervisor and Contractor on potential remedial actions Ensure remedial actions properly implemented	Take immediate action to avoid further exceedance Submit proposals for remedial actions to ER within 3 working days of notification Implement the agreed proposals Amend proposal if appropriate		
2. Exceedance for two or more consecutive samples	 Identify source Inform ER and EPD the causes & actions taken for the exceedances Repeat measurement to confirm findings Increase monitoring frequency to daily Investigate the causes of exceedance Arrange meeting with EPD and ER to discuss the remedial actions to be taken Assess effectiveness of Contractor's remedial actions and keep EPD and ER informed of the results If exceedance stops, cease additional monitoring 	1. Confirm receipt of notification of failure in writing 2. Notify Contractor 3. Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented 4. Discuss amongst Environmental Team Leader and the Contractor potential remedial actions 5. Review Contractor's remedial actions whenever necessary to assure their effectiveness 6. If exceedance continues, consider what portion of the works is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated	Take immediate action to avoid further exceedance Submit proposals for remedial actions to ER within 3 working days of notification Implement the agreed proposals Resubmit proposals if problem still not under control Stop the relevant portion of works as determined by the ER until the exceedance is abated		

3.4 Site Inspection and Environmental Complaint Handling

3.4.1 Site Inspection Frequency and Areas Covered

Regular site inspections were carried out on a weekly basis. The areas of inspection covered different environmental impacts, such as air, noise, water and waste, and their pollution controls and mitigation measures for both within and outside the site area.

Ad hoc site inspections were carried out if significant environmental non-compliance is identified. Inspections may also be carried out subsequent to receipt of any environmental complaints, or as part of the investigation work, as specified in the Event-Action Plans.

3.4.2 Site Inspection Procedures

- a) The Environmental Auditor (EA) will be advised by the CR and/or ER of all information on any environmental related aspects.
- b) The EA will conduct discussion with the CR and/or ER to sort out and forecast any potential environmental impacts.
- c) The EA will conduct a site walk with the CR and/or ER, particularly in the areas with extensive construction works.
- d) The EA will conduct inspection for the main environmental facilities and measures such as the wheel washing facilities located at the site exits, water spraying truck, temporary noise barrier, and the internal noise-reducing measures of the heavy equipment etc, to ensure that these environmental facilities operate normally and effectively.
- e) The EA will fill up a site inspection checklist during the site inspection for recording of any special observations.
- f) The EA will conduct post-discussion with the CR and/or ER for the establishment of additional/special measures if any non-conformance is found. The completion date for such additional measures will be confirmed during the post-discussion.
- g) The EA will propose a reasonable timeframe together with the CR and/or ER, for the preparation of the proposal for the remediation of environmental noncompliance.
- h) The completed site inspection checklist will be signed by the EA, the CR and/or ER, for reference and for taking actions in accordance with the agreed procedures, reporting systems and time frame.


3.4.3 Environmental Complaints

In accordance with the Environmental Management Plan^[1], environmental complaints will be referred to the ET for initiation of the complaint investigation procedures. The ET will undertake the following procedures upon receipt of the complaints:

- a) The ET will record the details of the complaint and the date of receipt onto the complaint database, and inform ER immediately.
- b) The ET will perform compliant investigation to determine its validity, and to assess whether the source of the problem is due to work activities.
- c) The ER will instruct the CR to identify mitigation measures in consultation with the ET, if the compliant is valid and due to works.
- d) The ET will liaise with the CR on their mitigation measure proposals and implementation, if required.
- e) The ET will conduct review of the CR's response on the identified mitigation measures, and of the updated situation.
- f) The ET will submit interim report to EPD if the complaint is received via EPD. The interim report will clearly state the status of the complaint investigation and the follow-up action within the time frame assigned by EPD.
- g) The ET will undertake additional monitoring and audit to verify the situation if necessary, and ensure that any valid reason for complaint does not recur.
- h) The ET will report on the investigation results and the subsequent actions to the source of complaint for responding to the complainant (If the source of complaint is via EPD, the results will be reported within the time frame assigned by EPD).
- i) The ET will record the details of the complaint, investigation, subsequent actions and results in the monthly EM&A reports.

During the complaint investigation work undertaken by the ET, the CR and ER shall cooperate with the ET in providing all the necessary information and assistance for completion of the investigation. If mitigation measures are identified as necessary in the investigation, the CR shall promptly carry out the required mitigation to the satisfaction of ET. The ER shall ensure that such identified measures have been carried out by the CR.

A flow chart of the complaint response procedures is shown in Figure 3-2 for reference.

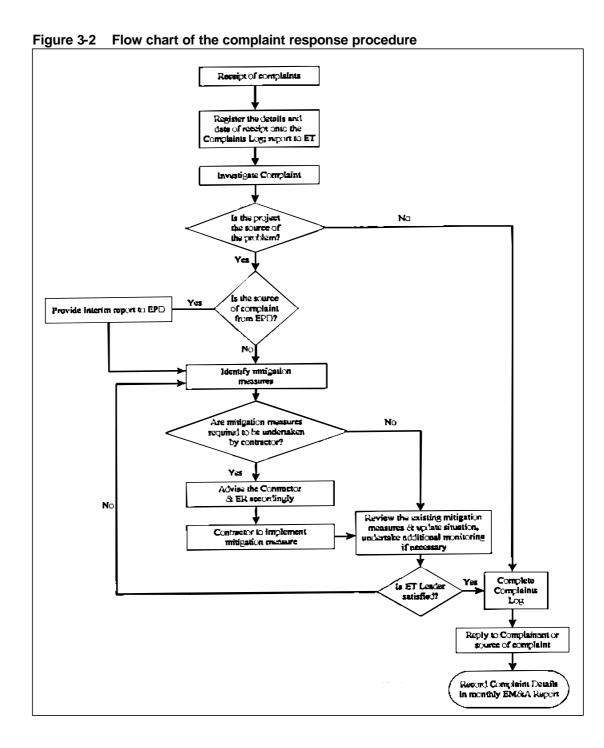

4. CONSTRUCTION NOISE MONITORING

4.1 Monitoring Equipment

An integrated sound level meter was used for the noise monitoring. The sound level meter complies with the International Electrotechnical Commission Publications (IEC) 651:1979 (Type 1) and 804:1985 (Type 1) specifications. An acoustical calibrator in compliance with IEC 942:1988 (Type 1) was used to calibrate the sound level meter before and after each set of measurements to confirm that the data drift was less than 1dB(A). The detailed descriptions of the noise measurement equipment are listed in Table 4-1.

Table 4-1 Equipment list for construction noise monitoring

Equipment	Manufacturer & Model No.	Precision Grade	Qty.
Integrated sound level meter	Brüel & Kjær 2231	- IEC 651 Type 1 - IEC 804 Type 1	1
½ " free-field microphone	Brüel & Kjær 4188		1
Windshield	Brüel & Kjær UA0237		1
Acoustical calibrator	Brüel & Kjær 4230	IEC 942 Type 1	1
Acoustical calibrator	Brüel & Kjær 4226	- 1EC 742 Type T	1
LCD wind speed indicator	Kestrel Vane Anemometer		1

4.2 Methodology

4.2.1 Field Measurement

- The sound level meter and the battery were checked to ensure that they were in proper condition.
- The sound level meter was set on a tripod at 1.2m above ground and at least 1m from the exterior of the building façade.
- Before conducting the measurement, the sound level meter was calibrated by an acoustical calibrator.
- The measurement parameter was set to A-weighted sound pressure level. The time weighting was set in fast response and the time period of measurement at 30 minutes.
- The wind speed was checked during noise monitoring to ensure the steady wind speed did not exceed 5m/s, or wind with gusts did not exceed 10m/s.
- Any abnormal conditions that generated intrusive noise during the measurement were recorded on the field record sheet.
- After each measurement, the equivalent continuous sound pressure level (L_{eq}), L_{10} and L_{90} were recorded on the field record sheet.

• The sound level meter was re-calibrated by the acoustical calibrator to confirm that there was no significant drift of reading.

4.2.2 Equipment Maintenance and Calibration

The sound level meter complies with the standards of IEC 651 (Fast, Slow, Impulse rms detector tests) and IEC 804 (L_{eq} functions). The acoustical calibrator model no. 4230 is in compliance with IEC 942. Both equipment are calibrated annually in-house using Brüel & Kjær (B&K) calibrator model no. 4226.

The B&K calibrator model no. 4226 is annually calibrated by the National Physical Laboratory in Teddington, London, which is accredited by National Measurement Accreditation Service (NAMAS). All in-house calibrations that are undertaken can be traced back to the National Physical Laboratory. The calibration certificates of the equipment are given in the monthly EM&A report of August 2003 (Report No.: 23420-28)^[4].

4.3 Results and Observations

Noise monitoring was carried out twice per week. The construction noise monitoring results in December 2003 are tabulated in Table 4-2. The detailed noise monitoring results are attached in Appendix B. All noise monitoring results complied with the Limit Level.


The principal noise sources were mainly from other activities such as idling vehicles, through traffic and school activities not associated with the construction of the Project. A graphical presentation of noise monitoring results is given in Figure 4-1.

Table 4-2 Daytime noise monitoring results for December 2003

Date of	Monitoring	Monitoring Results, dB(A) (30 min)			
Monitoring	Parameters	N1	N2	N3	N4
	L _{eq}	63.5	64.5	67.5	63.5
04/12/03 (Thu)	L ₁₀	66.0	67.5	69.0	65.5
	L ₉₀	60.5	61.5	65.0	60.5
	L_{eq}	63.8	64.8	66.0	63.0
06/12/03 (Sat)	L ₁₀	65.0	68.0	68.0	65.5
	L ₉₀	60.0	61.5	63.5	60.5
	L_{eq}	63.0	65.0	66.5	64.5
10/12/03 (Wed)	L ₁₀	66.5	67.5	69.5	66.0
	L ₉₀	61.0	62.0	63.0	60.0
	L_{eq}	63.5	65.9	66.5	65.5
13/12/03 (Sat)	L ₁₀	65.5	69.5	69.0	69.0
	L ₉₀	60.5	60.5	63.0	61.0

Date of	Monitoring	Monitoring Results, dB(A) (30 n			nin)	
Monitoring	Parameters	N1	N2	N3	N4	
	L _{eq}	65.5	65.0	66.8	64.0	
16/12/03 (Tue)	L ₁₀	69.5	68.0	69.5	66.8	
	L ₉₀	62.0	62.0	61.5	60.0	
	L _{eq}	66.0	65.0	66.5	64.0	
18/12/03 (Thu)	L ₁₀	68.5	68.5	68.5	69.0	
	L ₉₀	63.5	62.0	62.5	61.5	
	L _{eq}	64.0	65.5	66.8	64.0	
22/12/03 (Mon)	L ₁₀	66.5	67.5	69.5	68.5	
	L ₉₀	61.0	62.0	62.0	60.0	
	L _{eq}	64.5	65.0	66.8	63.8	
27/12/03 (Sat)	L ₁₀	66.0	68.5	68.5	65.8	
	L ₉₀	61.0	62.0	62.0	60.5	
	L _{eq}	64.2	65.0	66.2	63.5	
30/12/03 (Tue)	L ₁₀	68.0	69.5	69.5	66.0	
	L ₉₀	61.0	62.0	62.5	61.0	

Figure 4-1 Daytime noise monitoring results for December 2003

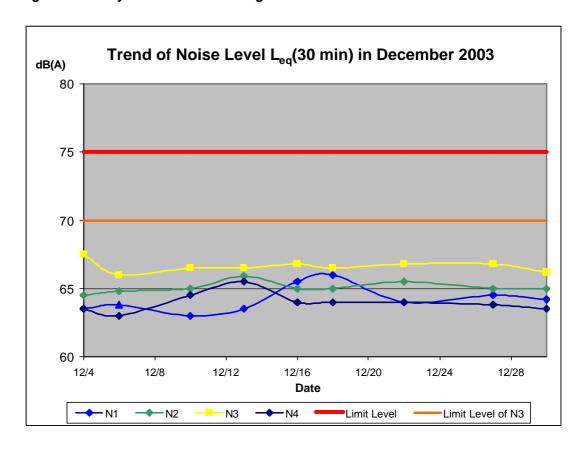

5. AIR QUALITY MONITORING

Air quality was measured in terms of 24-hour and 1-hour levels of TSP to assess the impacts of construction dust. The 24-hour and 1-hour TSP levels were measured according to the standard high volume sampling method and laser scanning method respectively. All relevant data including temperature, pressure, weather conditions, start and stop time of the sampler, and other special phenomena and work progress of the monitoring locations were also recorded.

5.1 Monitoring Equipment

The high volume sampling (HVS) method complies with the USEPA ambient air reference method standard for primary and secondary ambient particulate matter (40 CFR_{50-B})^[5].

HVS in compliance with the specifications of 40 CFR_{50-B} were used for carrying out the 24-hour TSP. A photometric aerosol monitor was used for 1-hour TSP monitoring. The details of the HVS, photometric aerosol monitor and the calibration kit used are listed in Table 5-1.

Table 5-1 Equipment list for TSP monitoring

Equipment	Manufacturer & Model No.	Measurement Parameter	Qty.
High Volume Sampler	TE-5170		1
Fibreglass Filter	G810	24-hour TSP	
HVS Calibration Kit	GMW-2535		1
Photometric Aerosol Monitor	MIE personalDataRAM	1-hour TSP	1
Hand Held Barometer	Cole-Parmer EB833	Pa, Temperature	1

5.2 Methodology

5.2.1 24-hour TSP Monitoring

- The HVS was set up at a fixed monitoring location under the following conditions:
 - the filter of HVS was at least 1.3m above ground;
 - it was separated from any obstacle by at least twice the height of the obstacle protruding above the sampler;
 - there were no furnaces or incineration flues operating near the sampler;
 - it has unrestricted airflow 270° around the sampler; and
 - the wire fence and gate did not cause obstruction to the air flow.

- The flow rate of the HVS was set within the range of $1.1\text{m}^3/\text{min}$ and $1.7\text{m}^3/\text{min}$, (39CFM 60CFM) as specified in $40 \text{ CFR}_{50\text{-}B}$.
- The power supply was checked to ensure the HVS worked properly
- The HVS was switched on and allowed to operate for 5 minutes before placing any filter on the supporting screen.
- The filter holding frame was removed by loosening the four wing nuts and allowing the brass bolts and washers to swing down out of the way.
- The fibreglass filter (G810) for TSP sampling was prepared by a HOKLAS accredited laboratory for weighing before and after sampling. Before weighing, the filter was equilibrated in a conditioned environment of:
 - temperature between 25°C and 30°C and not vary by more than 3°C; and
 - relative humidity <50% and not vary by more than 5%.
- The pre-weighted, conditioned and numbered fibreglass filter was centred, with rougher side up, on the supporting screen. The filter was aligned so that the gasket of the frame formed an airtight seal on the outer edges of the filter.
- The filter holding frame was placed onto the filter and then tightened with the brass bolts and washers with sufficient pressure to avoid air leakage from the edges.
- Any dirt accumulation from around the filter holder was wiped out and then the shelter lid closed and secured with the aluminium strip.
- A piece of flow record chart was inserted onto the flow rate recorder and placed under the chart guide clip and the time index clip so that it would rotate freely without binding. Set the time by rotating the drive hub clockwise until the correct time on chart was aligned with time index pointer.
- The flow recorder pen was checked to ensure it was inking by pressing on the chart with sufficient pressure to make a visible trace.
- The timer was programmed and the start time was recorded on specified field record sheet. Other information such as the filter identification number, the weather and site conditions were also recorded.

5.2.2 1-hour TSP Monitoring

- The MIE monitor was switched on by pressing the ON/OFF button. The NEXT button was pressed to select Run or Ready mode.
- The NEXT button was pressed subsequently to check the following settings:
 - i. data logging function: on
- ii. log period: 5 minutes
- iii. tag number: storage
- iv. analogue output: 0-4.000mg/m³
- v. calibration factor:1.0
- vi. averaging time: 10s
- vii. battery charge: ≥50%
- viii. remaining memory: >10%

- The monitoring was started by pressing ENTER. The real-time concentration was displayed as CONC and the time-averaged concentration was displayed as TWA.
- The monitoring was stopped by pressing EXIT and ENTER buttons.
- The date and start time, weather, site condition and the downloaded monitoring results were recorded on a specific field record sheet.

5.2.3 Maintenance and Calibration

The HVS and their accessories were frequently checked and maintained in accordance with the manufacturer's operation & maintenance manual. Maintenance includes the checking of the supporting screen and the gasket, and routine replacement of motor carbon brushes for the blower motor. The power cords and power supply were checked each time before sampling to ensure proper operation.

The HVS are calibrated at 2-month intervals using GMW-2535 Calibration Kit. The calibration certificate of the HVS is attached in Appendix C.

The calibration kit will be re-calibrated by the manufacturer after one year of use. The calibration certificate of the Calibration Orifice is given in the Monthly EM&A Report -April 2003^[6].

The MIE monitor and its accessories are frequently checked and maintained in accordance with the manufacturer's operation & maintenance manual to ensure proper operation. Maintenance includes the checking of batteries, zero and sensitive adjustment and filter replacement.

The MIE monitor is returned to the manufacturer for calibration bi-annually. The calibration certificate of the MIE monitor is attached in the monthly EM&A report of November 2003 (Report No.: 23420-32)^[4].

5.3 Results and Observations

Tables 5-2 and 5-3 summarise the 24-hour TSP and 1-hour TSP monitoring results respectively. The detailed 24-hour TSP monitoring results are provided in Appendix D and the 1-hour TSP monitoring results are provided in Appendix E.

Graphical presentations of 24-hour TSP and 1-hour TSP are given in Figure 5-1 and Figure 5-2 respectively.

Table 5-2 24-hour TSP monitoring results for December 2003

Date of Monitoring	24-hour TSP Monitoring Results (µg/m³)		
Date of Monitoring	Weather	Result	
05/12/03 (Fri)	Sunny	114.5	
11/12/03 (Thu)	Sunny	86.1	
17/12/03 (Wed)	Sunny	96.7	
23/12/03 (Tue)	Sunny	121.2	
29/12/03 (Mon)	Sunny	133.6	

Figure 5-1 24-hour TSP monitoring results for December 2003


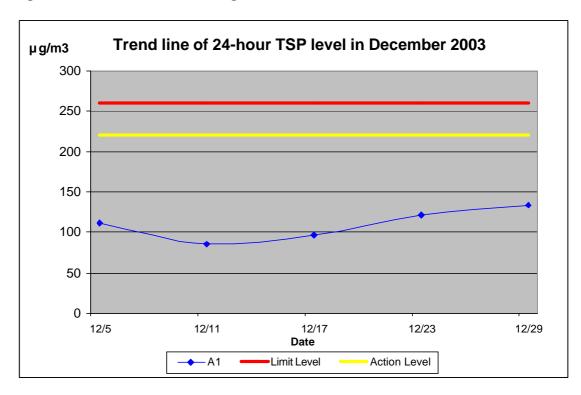


Table 5-3 1-hour TSP monitoring average results for December 2003

Date of Monitoring	1-hour TSP Monito	oring Results (µg/m³)
Date of Monitoring	Weather	Averaged Result
04/12/03 (Thu)	Sunny	192.3
06/12/03 (Sat)	Sunny	213.2
16/12/03 (Mon)	Sunny	180.5
18/12/03 (Thu)	Sunny	236.3
27/12/03 (Sat)	Sunny	180.7

Figure 5-2 1-hour TSP monitoring results for December 2003

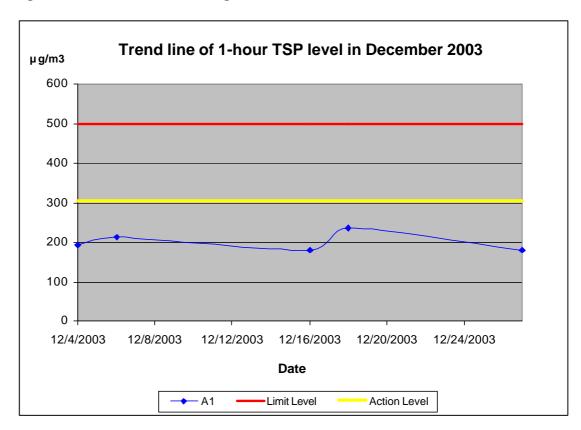

6. SITE AUDIT, ENVIRONMENTAL COMPLAINTS, ENVIRONMENTAL LICENSE AND NON-COMPLIANCE RECORDS

6.1 Audit Results

Four site audits were conducted weekly in December 2003. The major construction activity on site was the internal fitting out and external decoration of the maintenance depot. The audit findings are summarised as follows:

Air Quality

• Working area of earth breaking was not sprayed with water.

Noise

• No significant noise impact was identified.

Water Quality

• No significant water quality impact was identified.

Chemical / Waste Management

• No significant chemical / waste management impact was identified.

Figure 6-1 Dust generated from earth breaking operation.



6.2 Summary of Waste Disposal

A total of 129 loads of non-inert material were disposed of at SENT Landfill in December 2003. The total quantity of the disposed non-inert material was 3,096 tonnes in December 2003.

6.3 Complaint Record

No complaint on environmental issues was received in December 2003. The summary of environmental complaints since the commencement is presented in Table 6-1.

Table 6-1 Summary of environmental complaints

No. of Complaints received this month	No. of Outstanding Complaints	Total Complaints Received since the commencement of the Project
0	0	0

6.4 Non-compliances

There was no non-compliance recorded for December 2003.

7. REFERENCES

- [1] Environmental Management Plan for Proposed Headquarters and Bus Maintenance Depot in Chai Wan. Ref: R0474-3.01. CH2M HILL (China) Limited.
- [2] Citybus Permanent Headquarters and Bus Maintenance Depot in Chai Wan Monthly EM&A Report December 2001, Ove Arup & Partners Hong Kong Limited.
- [3] Environmental Baseline Monitoring Report Citybus Chai Wan Permanent Depot Environmental Team Services. Ove Arup & Partners Hong Kong Limited.
- [4] Citybus Permanent Headquarters and Bus Maintenance Depot in Chai Wan Monthly EM&A Report August 2003, Ove Arup & Partners Hong Kong Limited.
- [5] Title 40 of the Code of Federal Regulations, Chapter 1, Part 50 National Primary and Secondary Ambient Air Quality Standards, Appendix B Reference Method for the Determination of Suspended Particulate Matter in the Atmosphere (High-volume Method), Environmental Protection Agency, US.
- [6] Citybus Permanent Headquarters and Bus Maintenance Depot in Chai Wan Monthly EM&A Report April 2003, Ove Arup & Partners Hong Kong Limited.
- [7] Citybus Permanent Headquarters and Bus Maintenance Depot in Chai Wan Monthly EM&A Report November 2003, Ove Arup & Partners Hong Kong Limited.

This page left blank intentionally

APPENDIX A

EM&A Schedules for December 2003 and January 2004

Environmental Monitoring and Audit Schedule - December 2003

Note 1: L30 denotes L_{eq(30 min)}

Note 2: TSP denotes Total Suspended Particulate

	Dec-2003										
Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday					
	1	2	3	4	5	6					
				L30 monitoring 3 x 1-hr TSP monitoring	24-hr TSP monitoring	L30 monitoring 3 x 1-hr TSP monitoring					
7	8	9	L30 monitoring	24-hr TSP monitoring	12	L30 monitoring					
14	(+ Cal. HVS)	L30 monitoring 3 x 1-hr TSP monitoring	24-hr TSP monitoring	L30 monitoring 3 x 1-hr TSP monitoring	19	20					
21	L30 monitoring	23 24-hr TSP monitoring	24	25	26	L30 monitoring 3 x 1-hr TSP monitoring					
28	24-hr TSP monitoring	L30 monitoring	31								

Tentative Environmental Monitoring and Audit Schedule - January 2004

Note 1: L30 denotes L_{eq(30 min)}

Note 2: TSP denotes Total Suspended Particulate

			Jan-2004			
Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
				1,	2	24-hr TSP monitoring L30 monitoring 3 x 1-hr TSP monitoring
4	5	6	7	8 L30 monitoring	9 L30 monitoring 3 x 1-hr TSP monitoring	10 24-hr TSP monitoring
	L30 monitoring	13	14	15	16	17
	19	20	21	22	23	24
25	26	27	28	29	30	31

APPENDIX B

Detailed Noise Monitoring Results

Details of Noise Impact Monitoring

		NSR	Time p	eriods	Weather	No	ise Level dB	(A)	Influencing factors/
Month	Date	No.	Start	Finish	condition	Leq	L ₁₀	L ₉₀	Site condition
Dec-03	4-Dec-03	N1	7:40	8:10	Sunny	63.5	66.0	60.5	Traffic Noise
Dec-03	4-Dec-03	N2	8:30	9:00	Sunny	64.5	67.5	61.5	Normal Operation
Dec-03	4-Dec-03	N3	11:00	11:30	Sunny	67.5	69.0	65.0	Normal Operation
Dec-03	4-Dec-03	N4	10:00	10:30	Sunny	63.5	65.5	60.5	Traffic Noise
Dec-03	6-Dec-03	N1	7:45	8:15	Sunny	63.8	65.0	60.0	Traffic Noise
Dec-03	6-Dec-03	N2	8:35	9:05	Sunny	64.8	68.0	61.5	Normal Operation
Dec-03	6-Dec-03	N3	11:00	11:30	Sunny	66.0	68.0	63.5	Normal Operation
Dec-03	6-Dec-03	N4	10:05	10:35	Sunny	63.0	65.5	60.5	Traffic Noise
Dec-03	10-Dec-03	N1	7:40	8:10	Sunny	63.0	66.5	61.0	Traffic Noise
Dec-03	10-Dec-03	N2	8:30	9:00	Sunny	65.0	67.5	62.0	Normal Operation
Dec-03	10-Dec-03	N3	11:00	11:30	Sunny	66.5	69.5	63.0	Normal Operation
Dec-03	10-Dec-03	N4	10:00	10:30	Sunny	64.5	66.0	60.0	Traffic Noise
Dec-03	13-Dec-03	N1	7:40	8:10	Sunny	63.5	65.5	60.5	Traffic Noise
Dec-03	13-Dec-03	N2	8:30	9:00	Sunny	65.9	69.5	60.5	Normal Operation
Dec-03	13-Dec-03	N3	11:00	11:30	Sunny	66.5	69.0	63.0	Normal Operation
Dec-03	13-Dec-03	N4	10:10	10:40	Sunny	65.5	69.0	61.0	Traffic Noise
Dec-03	16-Dec-03	N1	7:50	8:20	Sunny	65.5	69.5	62.0	Traffic Noise
Dec-03	16-Dec-03	N2	8:45	9:15	Sunny	65.0	68.0	62.0	Normal Operation
Dec-03	16-Dec-03	N3	11:00	11:30	Sunny	66.8	69.5	61.5	Normal Operation
Dec-03	16-Dec-03	N4	10:05	10:35	Sunny	64.0	66.8	60.0	Traffic Noise
Dec-03	18-Dec-03	N1	7:45	8:15	Sunny	66.0	68.5	63.5	Traffic Noise
Dec-03	18-Dec-03	N2	8:35	9:05	Sunny	65.0	68.5	62.0	Normal Operation
Dec-03	18-Dec-03	N3	11:00	11:30	Sunny	66.5	68.5	62.5	Normal Operation
Dec-03	18-Dec-03	N4	10:05	10:35	Sunny	64.0	69.0	61.5	Traffic Noise
Dec-03	22-Dec-03	N1	7:35	8:05	Sunny	64.0	66.5	61.0	Traffic Noise
Dec-03	22-Dec-03	N2	8:20	8:50	Sunny	65.5	67.5	62.0	Normal Operation
Dec-03	22-Dec-03	N3	11:00	11:30	Sunny	66.8	69.5	62.0	Normal Operation
Dec-03	22-Dec-03	N4	9:40	10:10	Sunny	64.0	68.5	60.0	Traffic Noise
Dec-03	27-Dec-03	N1	7:35	8:05	Sunny	64.5	66.0	61.0	Traffic Noise
Dec-03	27-Dec-03	N2	8:30	9:00	Sunny	65.0	68.5	62.0	Normal Operation
Dec-03	27-Dec-03	N3	11:00	11:30	Sunny	66.8	68.5	62.0	Normal Operation
Dec-03	27-Dec-03	N4	9:30	10:00	Sunny	63.8	65.8	60.5	Traffic Noise
Dec-03	30-Dec-03	N1	7:40	8:10	Sunny	64.2	68.0	61.0	Traffic Noise
Dec-03	30-Dec-03	N2	8:50	9:20	Sunny	65.0	69.5	62.0	Normal Operation
Dec-03	30-Dec-03	N3	11:00	11:30	Sunny	66.2	69.5	62.5	Normal Operation
Dec-03	30-Dec-03	N4	10:20	10:50	Sunny	63.5	66.0	61.0	Traffic Noise

APPENDIX C

Calibration Certificate of HVS

Ove Arup Partners (Hong Kong) Limited

High Volume Air Sampler Calibration Worksheet

Calibration date

13-Dec-03

11-Feb-04

Barometric pressure

765 mm Hq

Next Calibration date

Roof floor, Educational Building,

Tempature (°C)

18 °C

Sampler location

IVE Chai Wan

Graseby GMW 2310

Tempature (K)

291 K

Sampler model Sampler serial number

0508

 P_{std} Tstd

760 mm Hg 298 K

Calibrator model

Calibrator serial number

GMW-2535 1378

Slope of the standard curve, m.

2.000011

Intercept of the standard curve, b,

-0.08159

Resistance Plate No.	Manometer Reading (inch H₂O)	Flow Recorder Reading (CFM)	Calculated Q _{std} (m³/min)	Continuous Flow Recorder Reading IC (CFM)	
5	3.50	38.00	0.99	38.58	
7	5.80	45.00	1.26	45.69	
10	7.50	50.00	1.43	50.76	
13	10.50	58.00	1.69	58.89	
18	13.50	67.00	1.91	68.02	

Calibration Curve

80.00	
70.00	
60.00	
50.00	
40.00	
30.00	
20.00	
10.00	
0.00	4 materia m
0.00	0.50

1.50

y = 31.9559x + 5.8827

2.00

 $R^2 = 0.9916$

Linear Regression

Sampler slope (m):

31.9559

Sampler intercept (b):

5.8827

Correlation coefficient (R²): 0.9916

Correlation coefficient is greater than 0.9900 and the calibration result is accepted.

1.00

Performed by:

Date:

2.50

Checked by:

Date:

APPENDIX D

Detailed Air Quality (24hour TSP) Monitoring Results

Details of 24-Hour TSP Monitoring

		Receptor	Weather	Site	Filter Wo	eight (g)	TSP	Flow Rate (m³/min)				Sampling	Total	24-hour TSP		
Month	Date	No.	condition	condition	Initial	Final	weight (g)	Initial	Final	Rate (m³/min)	Start	Finish	Time (mins.)	vol. (m³)	Level (µg/m³)	Remarks
Dec-03	5-Dec-03	A1	Sunny	Normal Operation	2.8611	3.0505	0.1894	1.1750	1.1562	1.1656	2927.91	2952.23	1459.20	1700.84	111.4	
	11-Dec-03	A1	Sunny	Normal Operation	2.8534	3.0100	0.1566	1.2531	1.2510	1.2521	2952.23	2976.43	1452.00	1817.98	86.1	
	17-Dec-03	1	Sunny	Normal Operation	2.8330	2.9728	0.1398	1.0868	1.0868	1.0868	2976.43	2998.61	1330.80	1446.31	96.7	
	23-Dec-03		,	Normal Operation		3.0215	0.1897	1.0868	1.0868	1.0868	3028.44	3052.44	1440.00	1564.99	121.2	
	29-Dec-03			Normal Operation		3.0860	0.2028	1.0868	1.0868	1.0868	3052.42	3075.70	1396.80	1518.04	133.6	

APPENDIX E

Detailed Air Quality (1-hour TSP) Monitoring Results

Details of 1-Hour TSP Monitoring

		Receptor		Time p	eriods	Weather	Site	Temp.	Pressure	1-hour TSP	
Month	Date	No.	Set No.	Start	Finish	condition	condition	(°C)	(mmHg)	Level (µg/m²)	Average
Dec-03	4-Dec-03	A1	1	8:44	9:44	Sunny	Normal Operation	18.0	765.0	184.8	
Dec-03	4-Dec-03	A1	2	9:44	10:44	Sunny	Normal Operation	18.0	765.0	190.5	192.3
Dec-03	4-Dec-03	A1	3	10:44	11:44	Sunny	Normal Operation	18.0	765.0	201.6	
Dec-03	6-Dec-03	A1	1	8:30	9:30	Sunny	Normal Operation	19.0	766.0	212.7	
Dec-03	6-Dec-03	A1	2	9:30	10:30	Sunny	Normal Operation	19.0	766.0	216.2	213.2
Dec-03	6-Dec-03	A1	3	10:30	11:30	Sunny	Normal Operation	19.0	766.0	210.8	
Dec-03	16-Dec-03	A1	1	9:00	10:00	Sunny	Normal Operation	17.0	765.0	173.0	
Dec-03	16-Dec-03	A1	2	10:00	11:00	Sunny	Normal Operation	17.0	765.0	177.3	180.5
Dec-03	16-Dec-03	A1	3	11:00	12:00	Sunny	Normal Operation	17.0	765.0	191.1	
Dec-03	18-Dec-03	A1	1	8:42	9:42	Sunny	Normal Operation	16.0	765.0	237.0	
Dec-03	18-Dec-03	A1	2	9:42	10:42	Sunny	Normal Operation	16.0	765.0	235.3	236.3
Dec-03	18-Dec-03	A1	3	10:42	11:42	Sunny	Normal Operation	16.0	765.0	236.5	
Dec-03	27-Dec-03	A1	1	8:37	9:37	Sunny	Normal Operation	15.0	765.0	174.0	
Dec-03	27-Dec-03	A1	2	9:37	10:37	Sunny	Normal Operation	15.0	765.0	175.3	180.7
Dec-03	27-Dec-03	A1	3	10:37	11:37	Sunny	Normal Operation	15.0	765.0	192.9	