



Contract No. AL G513

Expansion of Wo Hop Shek Crematorium

Monthly EM&A Report No.27 (Period from 01 May to 31 May 2022)

Document No.

ASCL	/	2018028	/	0027	/	A
Publisher		Project Code		Sequential No.		Revision
						Index

	Prepared by:	Reviewed by:	Certified by:
Name	Joe HO	Tandy TSE	Kevin LI
Position	Environmental Team	Environmental Team	Environmental Team
FOSITION	Member	Member	Leader
Signature	J.	liky	
Date:	13/06/2022	13/06/2022	13/06/2022





1.1. REVISION HISTORY

Rev.	DESCRIPTION OF MODIFICATION	DATE
Α	First Issue for Comments	14 June 2022





CONTENTS

Exe	cutive Sumi	nary1		
1.	Basic Project Information			
2.	Monitoring Results9			
3.	Waste	Waste		
4.	Ecological	Monitoring		
5.	Landscape	And Visual Impacts		
6.	-	of Monitoring Exceedance, Complaints, Notification of Summons and Prosecutions 19		
7.	EM&A Site	Inspection		
8.	Future Key	7 Issues		
9.	Conclusion	ns and Recommendations24		
Ap	pendix A	Master Programme		
Ap	pendix B	Work Area for the Contract No. AL G513		
Ap	pendix C	Summary of Implementation Status of Environmental Mitigation		
Ap	pendix D	Impact Monitoring Schedule of the Reporting Month		
Ap	pendix E	Event/Action Plan for Dust Exceedance		
Ap	pendix F	Dust Monitoring Equipment Calibration Certificate		
Ap	pendix G	The Certification of Laboratory with HOKLAS Accredited Analytical Tests		
Ap	pendix H	Location Plan of Air Quality Monitoring Station		
Ap	pendix I	Dust Monitoring Data		
Ap	pendix J	Waste Flow Table		
Ap	pendix K	Site Inspection Proforma		
Ap	pendix L	Statistics on Complaint, Notifications of Summons and Successful Prosecutions		
Ap	pendix M	Impact Monitoring Schedule of Next Reporting Month		
Ap	pendix N	Transportation Routes to/from the site		
Ap	pendix 0	Lab Report		





EXECUTIVE SUMMARY

INTRODUCTION

- A1. The Project, Expansion of Wo Hop Shek Crematorium, is a Designated Project under the Environmental Impact Assessment Ordinance (Cap. 499) (EIAO) and is currently governed by an Environmental Permit (EP No. EP 329/2009) for the construction and operation of the Project.
- A2. In accordance with the Environmental Monitoring and Audit (EM&A) Manual for the Project, EM&A works for air quality monitoring and waste management should be carried out by Environmental Team (ET), Acuity Sustainability Consulting Limited (ASCL), during the construction phase of the Project.
- A3. This is the 27th Monthly EM&A Report, prepared by ASCL, for the Project summarizing the monitoring results and audit findings of the EM&A programme at and around Wo Hop Shek Crematorium during the reporting period from 01 May 2022 to 31 May 2022.
- A4. The EM&A programme for this contract has covered environmental monitoring on construction dust level at selected NSRs and Contractor's environmental performance auditing in the aspects of construction dust, construction noise, water quality, waste management, Landscape and Visual and Ecology.

SUMMARY OF MAIN WORKS UNDERTAKEN & KEY MITIGATION MEASURES IMPLEMENTED

- A5. Key activities carried out in this reporting period for the Project included the following:
 - External Work Soft landscape works
 - 1. Excavation work to planter
 - 2. Soiling
 - 3. Planting/transplanting (T48/T49)
- A6. The major environmental impacts brought by the above construction works include:
 - Construction noise generation from fitting out and pedestrian pavement activities
 - Wastewater generation from pedestrian pavement activities
 - Waste generation from fitting out and pedestrian pavement activities
- A7. The key environmental mitigation measures implemented for the Project in this reporting period associated with the above construction works include:
 - Reducing noise from equipment and machinery on-site by enclosing the construction site with plastic barrier and moving equipment and machinery inside the constructed building
 - Treatment of wastewater from pedestrian pavement activities through sedimentation tank, wastewater would be reused on-site and not be discharged
 - Sorting and storage of general refuse and construction waste





SUMMARY OF EXCEEDANCE & INVESTIGATION & FOLLOW-UP

- A8. No project-related exceedance in air quality monitoring, including 24-hour TSP and 1-hour TSP of the Action Level was recorded during the reporting period.
- A9. Weekly site inspections of the construction work by ET were carried out on 03, 11, 17, 25 and 31 May 2022 to audit the mitigation measures implementation status. The Observations were recorded in the site inspection checklists and provided to the contractors together with the appropriate follow-up actions where necessary.

COMPLAINT HANDLING AND PROSECUTION

- A10.No project-related environmental complaint was received during the reporting period.
- A11. Neither notifications of summons nor prosecution was received for the Project.

REPORTING CHANGE

A12. There was no change to be reported that may affect the on-going EM&A programme.

SUMMARY OF UPCOMING KEY ISSUES AND KEY MITIGATION MEASURES

- A13.Key activities anticipated in the next reporting period for the Project will include the following:
 - External Work Soft landscape works
 - 1. Excavation work to planter
 - 2. Soiling
 - 3. Planting/transplanting (T48/T49)
- A14. The major environmental impacts brought by the above construction works will include:
 - Construction noise generation from excavation and transplanting activities
 - Wastewater generation from excavation and transplanting activities
 - Waste generation from excavation and transplanting activities
- A15. The key environmental mitigation measures for the Project in the coming reporting period associated with the above construction works will include:
 - Reducing noise from equipment and machinery on-site by enclosing the construction site with plastic barrier and moving equipment and machinery inside the constructed building
 - Treatment of wastewater from excavation and transplanting activities through sedimentation tank, wastewater would be reused on-site and not be discharged
 - Sorting and storage of general refuse and construction waste





1. BASIC PROJECT INFORMATION

1.1. BACKGROUND

The Food and Environmental Hygiene Department (FEHD) is responsible for the operation of public crematorium in Hong Kong including the Cremators at Wo Hop Shek Crematorium pursuant to Environmental Permit No. EP-329/2009. The existing Wo Hop Shek Crematorium (WHSC) was re-provisioned in February 2013. It comprises six body cremators, one bone cremator and three service halls. At the design stage, areas had already been reserved for the addition of two body cremators and one service hall. In order to cope with increasing demand for cremation sessions, Expansion of Wo Hop Shek Crematorium (the Project) is being taken forward in this juncture. This Project shall provide two new cremators at WHSC and one service hall for commissioning. Architectural Services Department (ArchSD) acts as the works agent for FEHD, is responsible for the project management of the project.

The Project consists of three construction phases. Phase I of the project was substantially completed in October 2012 while Phase II of the project was substantially completed in November 2013. The Project has been re-initiated as Phase III and Shing Hing Construction Co. Ltd. (the Contractor) has been awarded the construction contract for the Project with contract no. AL G513.

The scope of the Project comprises provision of:

- Two new body cremators;
- One new multi-purpose service hall;
- A full range of ancillary facilities; and
- Addition, alteration and modification works that are necessary for the additional cremators and service hall.

1.2. THE REPORTING SCOPE


This is the 27th Monthly EM&A Report for the Project which summarizes the key findings of the EM&A programme during the reporting period from 01 May to 31 May 2022.

1.3. PROJECT ORGANIZATION

The Project Organization structure for Construction Phase is presented in Figure 1.1.





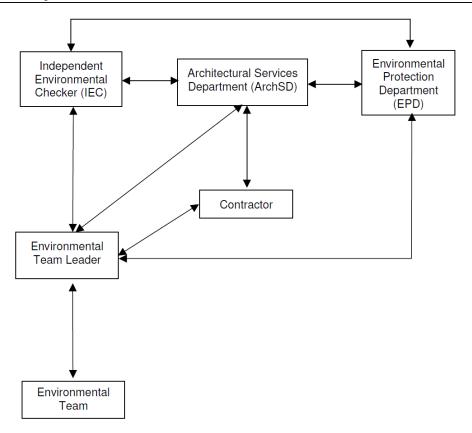

← Line of Communication

Figure 1.1 Project Organization Chart

Contact details of the key personnel are presented in **Table 1.1** below:

Table 1.1 Contact Details of Key Personnel

Party	Position	Name	Telephone no.
Shing Hing Construction Co Ltd	Site Agent	M.Y. Wong	2807-4665
Acuity Sustainability Consulting Limited	Environmental Team Leader	Kevin Li	2698-6833
Ove Arup & Partners Hong Kong Ltd	Independent Environmental Checker (IEC)	Franki Chiu	2268-3207





1.4. SUMMARY OF CONSTRUCTION WORKS

Details of the major construction activities undertaken in this reporting period are shown in **Table 1.2** below. The construction programme is presented in **Appendix A**.

Table 1.2 Summary of the Construction Activities Undertaken during the Reporting Month







1.5. SUMMARY OF ENVIRONMENTAL STATUS

Environmental permit (EP) conditions under the EIAO, submission status under the EP and implementation status of mitigation measures had been reviewed and implemented on schedule. The status of required submissions under the EP (EP-329/2009) as of the reporting period for the Project are summarised in **Table 1.3**. The Condition 2.4 under the EP (EP-329/2009) was conducted not in this stage of the project.

Table 1.3 Summary of Status of Required Submission for EP-329/2009 for the Project

EP/FEP Condition (EP-329/2009)	Submission	Submission date
Condition 1.12	Notification of Commencement Date of Construction of the Project	14 Mar 2020
Condition 2.3	Inception Report	13 Mar 2019
Condition 2.5	Landscape Plan with Tree Preservation Proposal	14 Feb 2018
Condition 5.2a	Baseline Monitoring Report	21 Jan 2020
Condition 5.2b	Alternative Air Quality Monitoring Station	05 Oct 2019
Condition 5.4	Monthly EM&A Report (May 2022)	14 June 2022

A summary of the valid permits, licences, and /or notifications on environmental protection for this Project is presented in **Table 1.4**.





Table 1.4 Summary of the Status of Valid Environmental Licence, Notification, Permit and Documentations

Permit/ Licences/ Notification	Reference	Validity Period	Remarks
Environmental Permit	EP-329/2009	Throughout the Contract	-
Notification of Construction Works under the Air Pollution Control (Construction Dust) Regulation (Form NA)	Ref. Number: 455614	Throughout the Contract	-
Wastewater Discharge Licence	WT00034798-2019	10 Oct 2020 – 31 Oct 2024	-
Chemical Waste Producer Registration	5213-632-S4245-01	Throughout the Contract	-
Construction Noise Permit (24 hours)	GW-RN0983-21	13 Jan 2022 – 12 Jul 2022	-
Billing Account for Disposal of Construction Waste	7032841	Throughout the Contract	-

The status for all environmental aspects is presented in **Table 1.5**.





Table 1.5 Summary of Status for Key Environmental Aspects under the Updated EM&A Manual

Parameters	Status
Dust	
Baseline Monitoring	The baseline dust monitoring result has been reported in Baseline Monitoring Report and submitted to EPD under EP Condition 5.2a.
Impact Monitoring	On-going
Waste Management	
Mitigation Measures in Waste Monitoring Plan	On-going
Environmental Audit	
Site Inspection covering Measures of Air Quality, Noise, Water Quality, Waste, Ecological Quality, Landscape and Visual	On-going

Other than the EM&A work by ET, environmental briefings, trainings and regular environmental management meetings were conducted, in order to enhance environmental awareness and closely monitor the environmental performance of the contractors.

The EM&A programme has been implemented in accordance with the recommendations presented in the approved EIA Report and the Updated EM&A Manual. A summary of implementation status of the environmental mitigation measures for the construction phase of the Project during the reporting period is provided in **Appendix C**.





2. Monitoring Results

2.1. Monitoring Parameters

The impact monitoring had been carried out in accordance with section 2.6 of the approved EM&A Manual to determine the 1-hour and 24-hour total suspended particulates (TSP) levels at the monitoring locations in the reporting month.

The sampling frequency of at least once in every 6 days, shall be strictly observed at the monitoring stations for 24-hour TSP monitoring. For 1-hour TSP monitoring, the sampling frequency of at least 3 times in every 6 days should be undertaken when the highest dust impact occurs.

General meteorological conditions (wind speed, direction and precipitation) and notes regarding any significant adjacent dust producing sources had also been recorded throughout the impact monitoring period.

2.2. MONITORING EQUIPMENT

1-hour TSP levels and 24-hour TSP had been measured with direct reading dust meter and High Volume Samplers respectively. It has been demonstrated its capability in achieving comparable results with high volume sampling method as set out in the Title 40 of the Code of Federal Regulations, Chapter 1 (Part 50).

The 1-hour TSP meter was calibrated by the manufacturer prior to purchasing. Zero response of the instrument was checked before and after each monitoring event. Operation of the 1-hour TSP meter followed manufacturer's Operation and Service Manual. The 24-hour TSP meter was calibrated against firmware 80570-8100-V1.0.4, annually. Operation of the 24-hour TSP meter followed manufacturer's Operation and Service Manual. Valid calibration certificate of dust monitoring equipment is attached in **Appendix F**.

A summary of the equipment that was deployed for the 24- hour averaged monitoring is shown in **Table 2.1**. The TSP monitoring was conducted as per the schedule presented in **Appendix D**.

The equipment used for 1-hour TSP and 24-hour TSP measurement and calibration are summarised in **Table 2.1**.





Table 2.1 Construction Dust Monitoring Equipment

Monitoring Parameter	Monitoring Equipment	Serial Number	Date of Calibration
1-hour TSP	LD-5R Digital Dust Indicator	761173	01 Jul 2021
1-hour TSP	LD-5R Digital Dust Indicator	761174	01 Jul 2021
24-hour TSP	TE-5170X High Volume Sampler	1049	31 Mar, 14 Apr & 29 Apr 2022
24-hour TSP	TE-5170X High Volume Sampler	1050	31 Mar, 14 Apr & 29 Apr 2022
Monitoring Parameter	Monitoring Equipment	Serial Number	Date of Calibration
24-hour TSP	TE-5028A Calibration Kit	3702	03 Aug 2022

2.3. Monitoring Methodology and QA/QC results

The 1-hour TSP monitor, portable dust meters (Sibata Digital Dust Indicator Model LD-5R) was used for the impact monitoring. The 1-hour TSP meters provides a real time 1-hour TSP measurement based on 90° light scattering. Three 1-hour TSP level were logged per every six days.

The 24-hour TSP monitor, High Volume Samplers (Tisch TE-5170X High Volume Air Sampler) were used for the impact monitoring. The 24-hour TSP monitoring consists of the following:

- The HVS was set at the monitoring location, with electricity supply connected and secured;
- HVS was calibrated before commencing the 1st measurement;
- The filter paper was weight and provided by HOKLAS lab (Acumen Laboratory and Testing Limited and ALS Technichem (HK) Pty Ltd) before and after the sampling. Certificate of HOKLAS accredited laboratory can be referred to **Appendix G**;
- The airflow over time during sampling process was recorded by the HVS.

HVSs was free-standing with no obstruction. The following criteria were considered in the installation of the HVS:

- Appropriate support to secure the samples against gusty wind needed to be provided the monitoring station;
- A minimum of 2m separation from walls, parapets and penthouses was required for rooftop samplers;
- No furnace or incinerator flues was nearby;





- Airflow around the sampler was unrestricted; and
- Permission could be obtained to set up the samplers and gain access to the monitoring station.

Preparation of Filter Papers

- Glass fiber filters were labelled and sufficient filters that were clean and without pinholes were selected;
- ◆ All filters were equilibrated in the conditioning environment for 24 hours before weighing. The conditioning environment temperature was around 25°C and not varied by more than ±3°C; the relative humidity (RH)was 40%; and
- Acumen Laboratory and Testing Limited and ALS Technichem (HK) Pty Limited, as HOKLAS accredited laboratory, implemented comprehensive quality assurance and quality control programmes on the filters.

Field Monitoring

- The power supply was checked to ensure that the HVS was working properly;
- The filter holder and area surrounding the filter were cleaned;
- The filter holder was removed by loosening the foul bolts and a new filter, with stamped number upward, on a supporting screen was aligned carefully;
- The filter was properly aligned on the screen so that the gasket formed an airtight seal on the outer edges of the filter;
- The swing bolts were fastened to hold the filter holder down to the frame. The pressure applied should be sufficient to avoid air leakage at the edges;
- The shelter lid was closed and secured with an aluminum strip;
- The HVS was warmed- up for about 5 minutes to establish run- temperature conditions;
- A new flow rate record sheet was inserted into the flow recorder;
- The flow rates of the HVS was checked and adjusted to between 1.13-1.19 m³min⁻¹, which was within the range specified in the EM&A Manual (i.e. 0.6- 1.7 m³min⁻¹);
- The programmable timer was set for a sampling period of 24 hours ±hour, and the starting time, weather condition and filter number were recorded;
- The initial elapsed time was recorded;
- At the end of sampling, the sampled filter was removed carefully and folded in half so that only surfaces with collected particulate matter were in contact;





- The filter paper was placed in a clean plastic envelope and sealed; all monitoring information was recorded on a standard data sheet and
- The filters were sent to (Acumen Laboratory and Testing Ltd and ALS Technichem (HK) Pty Ltd) for analysis.

Maintenance and Calibration

- The HVS and their accessories were maintained in a good working condition. For example, motor brushes were replaced routinely and electrical wiring was checked to ensure a continuous power supply; and
- The flow rate of each HVS with mass flow controller was calibrated using an orifice calibrator, Initial calibrations of the dust monitoring equipment were conducted upon installation and prior to commissioning. Five-point calibration was carried out for HVS using TE-5025 Calibration Kit. HVS is calibrated bimonthly. The calibration records for the HVS is given in **Appendix F**.

Wind Data Monitoring

• The wind speed has been recorded from Hong Kong Observatory- Tai Po Kau meteorological station, along with portable wind speed meter stand by as back up if malfunction occurred or data was not recorded from HKO.

2.4. Monitoring Locations

Due to the disagreement of occupants in establishment of air quality monitoring station at their private permits, both of the original proposed dust monitoring locations were rejected. Two alternative air monitoring stations Fung Kai Liu Yun Sum Memorial School and Fanling Government School had been proposed by ET and approved by IEC. Two designated air monitoring locations were identified and agreed with IEC and EPD. Details of air monitoring stations are described in **Table 2.2**. The location plan of air quality monitoring stations is shown in **Appendix H**.

Table 2.2 Location of the Dust Monitoring Stations

Air Quality Monitoring Station	Dust Monitoring Station
A10	Fung Kai Liu Yun Sum Memorial School
A20	Fanling Government School

2.5. MONITORING DATE, TIME, FREQUENCY AND DURATION

A summary of impact monitoring duration, sampling parameter and frequency is presented in **Table 2.3**.





Table 2.3 Summary of Impact Monitoring Programme

Impact Monitoring	Duration	Sampling Parameter	Frequency
Dust	1-hour continuous measurement	1-hour TSP	3 times per six days
Dust	24-hour continuous sampling	24-hour TSP	Once per six days

Result Summary

According to our field observations, the major dust source identified at the designated air quality monitoring station in the reporting month are summarised in **Table 2.4**.

Table 2.4 Observation at Dust Monitoring Station

Monitoring Station	Major Dust Source
A10	Nearby traffic
A20	Nearby traffic

Air quality impact monitoring for the reporting month was carried out on 05, 11, 17, 23 and 28 May 2022 at A10 and A20.

The results for 1-hour TSP and 24-hour TSP are summarized in **Table 2.5** and **Table 2.6**. The measurement data and details of influencing factors such as weather conditions and site observation are presented in **Appendix I**.

 Table 2.5
 Summary of 1-hour TSP Monitoring Results

Monitoring Location	Range(μg/m³) Action Level(μg/m³)		Limit Level(µg/m³)	
A10	Pending	290	500	
A20	Pending	291	500	





Table 2.6 Summary of 24-hour TSP Monitoring Results

Monitoring Location	Range(μg/m³) Action Level(μg/m³)		Limit Level(μg/m³)	
A10	2 - 45	169	260	
A20	4 - 42	167	260	





3. WASTE

3.1. WASTE RECORD OF REPORTING MONTH

The waste generated from this Project includes inert construction and demolition (C&D) materials, and non-inert C&D materials. Non-inert C&D materials are made up of general refuse, vegetative wastes, and recyclable wastes such as plastics and paper/cardboard packaging waste. Steel materials generated from the project are also grouped into non-inert C&D materials as the materials were not disposed of with other inert C&D materials. With reference to relevant handling records and trip tickets of this Project, the quantities of different types of waste generated in the reporting month are summarised in **Table 3.1**. Details of cumulative waste management data are presented as a waste flow table in **Appendix J**.

Table 3.1 Quantities of Waste Generated from the Project during May 2022

		Actual Quantities of Inert C&D Materials Generated Monthly				Actual Quantities of C&D Wastes Generated Monthly					
Reporting Month	Total Quantity Generated	Hard Rock and Large Broken Concrete	Reused in the Contract	Reused in other Projects	Disposed as Public Fill	Imported Fill	Metals	Paper / cardboard packaging	Plastics (see Note)	Chemical Waste	Others, e.g. general refuse
	(in ,000kg)	(in ,000kg)	(in ,000kg)	(in ,000kg)	(in ,000kg)	(in ,000kg)	(in ,000kg)	(in ,000kg)	(in ,000kg)	(in ,000kg)	(in ,000kg)
May 2022	82.71	0	0	0	56.56	0	0	0	0	0	26.15

Notes:

(1) Plastics refer to plastic bottles / containers, plastic sheets / foam from packaging material





3.2. MITIGATION MEASURES TO WASTE PRODUCTION

Mitigation measures adopted for reducing waste production are summarized in **Table 3.2**.

Table 3.2 Mitigation measures adopted for waste reduction

	able 5.2 Miligation measures adopted for waste reduction	
Types of Waste	Mitigation Measures	
Non-inert C&D Wastes	1. On-site segregation was adopted to wastes to enhance the reuse and recycling of non-inert C&D wastes. Separated containers are provided for temporary storage of different types of non-inert wastes, including the deployment of three-colour recycle bins for paper, aluminium cans, and plastic bottle recycling. Three-colour recycle bins Enclosed rubbish bin for general waste Skip for non-inert C&D waste 2. Careful design and planning with good site management to minimize over ordering and generation of waste materials.	
	16	





Types of Waste	Mitigation Measures	
	3. Reuse non-inert C&D materials when possible to reduce the amount of C&D waste.	
In out COD Works	1. No excavated material was stored at material storage area and construction site in the reporting month.	
Inert C&D Wastes	2. Surplus excavated materials were delivered to public fill reception facilities.	
	Unused chemicals or chemicals with remaining functional capacity were reused as far as practicable.	
Chemical Wastes	Chemical with remaining functional capacity was stored in a designated area and reused on-site.	





4. ECOLOGICAL MONITORING

The ecological monitoring was completed in August 2010 by China-Hong Kong Ecology Consultants Co. who was employed by Allied Environmental Consultants Ltd to conduct tree monitoring and advice on tree maintenance during construction period of "Provision of Cremators at Wo Hop Shek Crematorium" starting from September 2009.

5. LANDSCAPE AND VISUAL IMPACTS

No deficiency was observed during landscape and visual impact inspection carried out on 11 and 25 May 2022.





6. Summary of Monitoring Exceedance, Complaints, Notification of Summons and Prosecutions

The Environmental Complaint Handling Procedure is shown in below Figure 6.1:

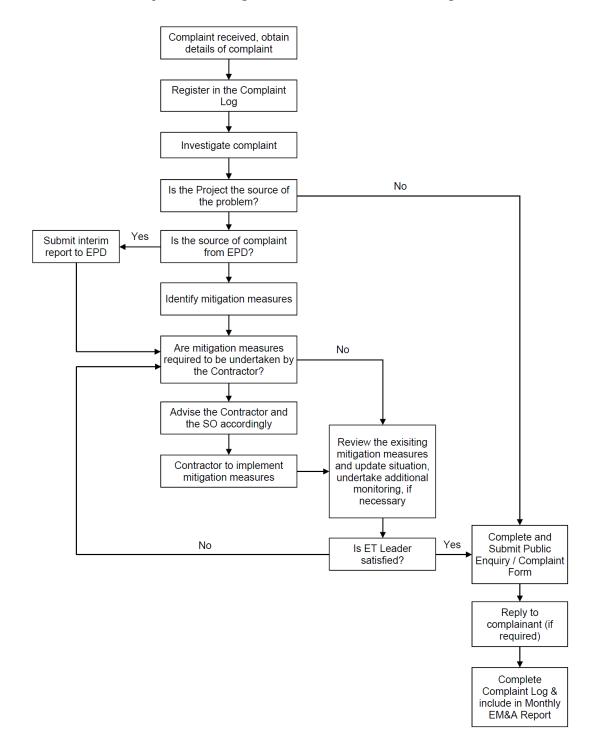


Figure 6.1 Environmental Complaint Handling Procedures

Contract No. AL G513 Expansion of Wo Hop Shek Crematorium Monthly EM&A Report No.27





Air quality monitoring was conducted in the reporting period and no project-related exceedance of the Action Level was recorded during the reporting period.

No notification of summons and prosecution was received in the reporting period.

Statistics on complaints and regulatory compliance are summarized in **Appendix L**.





7. EM&A SITE INSPECTION

Site inspections were carried out on a weekly basis to monitor the implementation of proper environmental pollution control and mitigation measures under the Contract. In the reporting period, site inspections were carried out on 03, 11, 17, 25 and 31 May 2022 at the site portions list in **Table 7.1** below.

Table 7.1 Summaries of Site Inspection Record

Date	Inspected Site Portion	Time
03 May 2022	Wo Hop Shek Crematorium	09:30 - 10:00 AM
11 May 2022	Wo Hop Shek Crematorium	13:30 - 14:00 PM
17 May 2022	Wo Hop Shek Crematorium	15:00 – 15:30 PM
25 May 2022	Wo Hop Shek Crematorium	15:00 – 15:30 PM
31 May 2022	Wo Hop Shek Crematorium	11:00 - 11:30 AM

Environmental deficiencies were observed during weekly site inspection. Key observations during the site inspections and during the reporting period are summarized in **Table 7.2**.

According to the EIA Study Report, Environmental Permit, contract documents and EM&A Manual, the mitigation measures detailed in the documents are implemented as much as practical during the reporting period. An updated Implementation Status of Environmental Mitigation Measures (EMIS) is provided in **Appendix C**.

According to the Environmental Permit (EP) clause 3.6, route 2 and route 5 shall not be used as transportation routes during construction, which was attached in **Appendix N**. The measures implemented to comply with the EP's requirement are listed as follows:

- 1. Induction training including the proper transportation routes use
- 2. Posting extracts of the transportation route to/from the site outside the entrance
- 3. Toolbox training provided to the drivers entering the site

Measure no.2 of the above was observed during the site inspections.

In order to comply with the requirement of the EP clause 3.5, the implementation of all landscaping and visual mitigation measures in accordance with the landscape plan approved was audited in the reporting period. The detailed status of the implementation is provided in the section 5 in **Appendix K** of each site inspection.

Bi-weekly checking for the transplanted tree was conducted during the site inspections. No major observation was found related to the landscaping and visual.

Site inspection proforma of the reporting period is provided in **Appendix K**.





Table 7.2 Site Observations

Date	Environmental Observations	Follow-up Status
03 May 2022 (Site inspection)	Observation(s) Nil Reminder(s) 1. Dusty material should be removed by impervious sheeting.	Nil
11 May 2022 (Site inspection)	Observation(s) Nil Reminder(s) 1. Dusty material should be removed by impervious sheeting.	Nil
17 May 2022 (Site inspection)	Observation(s) Nil Reminder(s) Nil	Nil
25 May 2022 (Site inspection)	Observation(s) Nil Reminder(s) Nil	Nil
31 May 2022 (Site inspection)	Observation(s) Nil Reminder(s) 1. Dusty material should be removed by impervious sheeting.	Nil





8. FUTURE KEY ISSUES

Works to be undertaken in the next reporting month are:

- External Work Soft landscape works
 - 1. Excavation work to planter
 - 2. Soiling
 - 3. Planting/transplanting (T48/T49)

The major environmental impacts brought by the above construction works will include:

- Construction noise generation from excavation and transplanting activities
- Wastewater generation from excavation and transplanting activities
- Waste generation from excavation and transplanting activities

The key environmental mitigation measures for the Project in the coming reporting period associated with the above construction works will include:

- Reducing noise from equipment and machinery on-site by enclosing the construction site with plastic barrier and moving equipment and machinery inside the constructed building
- Treatment of wastewater from excavation and transplanting activities through sedimentation tank, wastewater would be reused on-site and not be discharged
- Sorting and storage of general refuse and construction waste

The impact monitoring schedule for the next reporting month to be shown at **Appendix M**.





9. CONCLUSIONS AND RECOMMENDATIONS

This is the 27^{th} Monthly EM&A Report for the Project which summarizes the key findings of the EM&A programme during the reporting period from 01 May to 31 May 2022, in accordance with the EM&A Manual and the requirement under EP – 329/2009.

Air quality monitoring was conducted in the reporting period and no project-related exceedance of the Action Level was recorded during the reporting period.

Weekly environmental site inspection was conducted during the reporting period. No observation was observed during site inspection. The environmental performance of the project was therefore considered satisfactory.

No environmental complaint was received in the reporting period.

No notification of summons or prosecution was received since commencement of the Contract.

The ET will keep track on the construction works to confirm compliance of environmental requirements and the proper implementation of all necessary mitigation measures.


Contract No. AL G513 Expansion of Wo Hop Shek Crematorium Monthly EM&A Report No.27






APPENDIX A: MASTER PROGRAMME




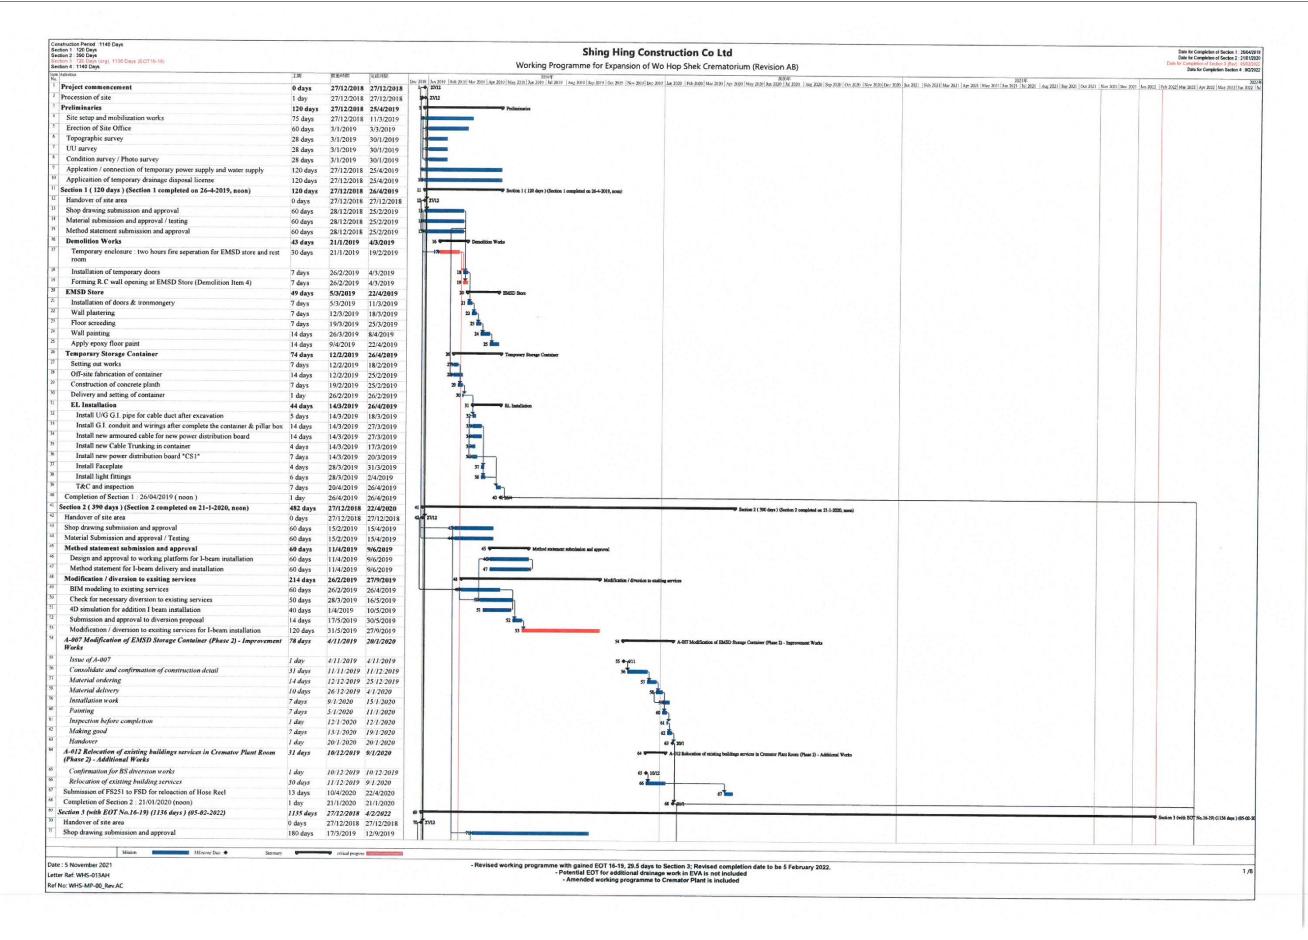


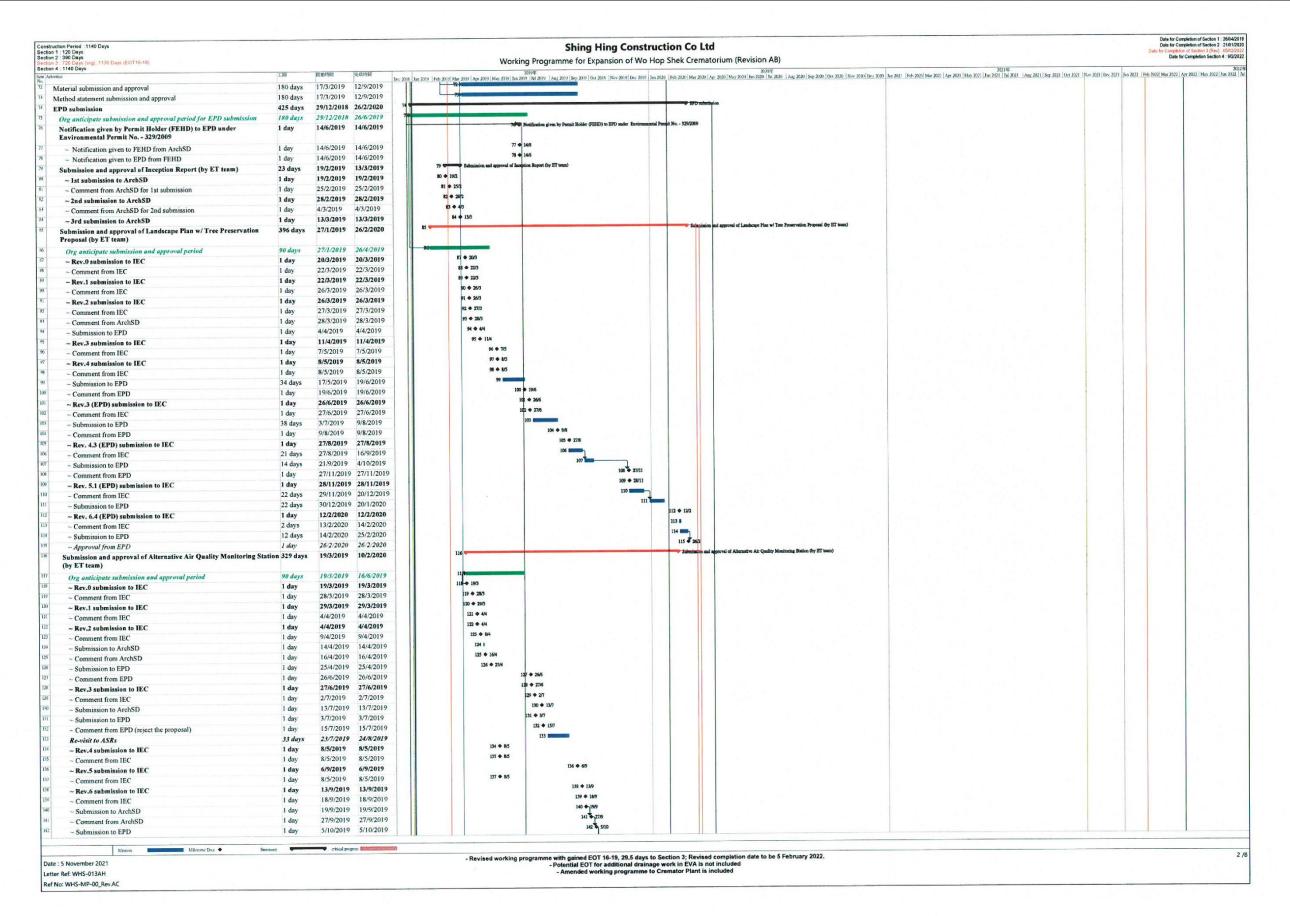






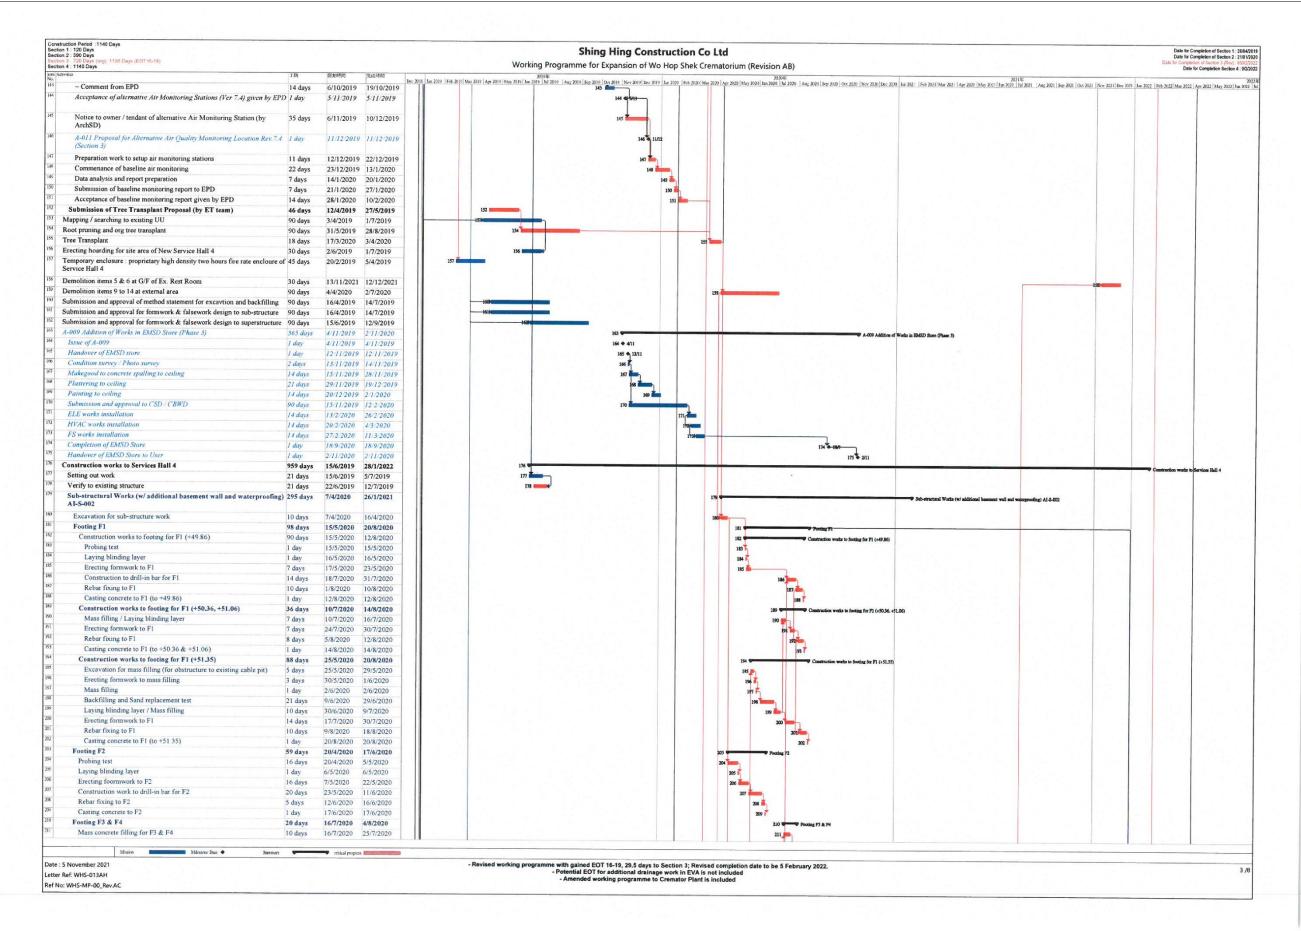


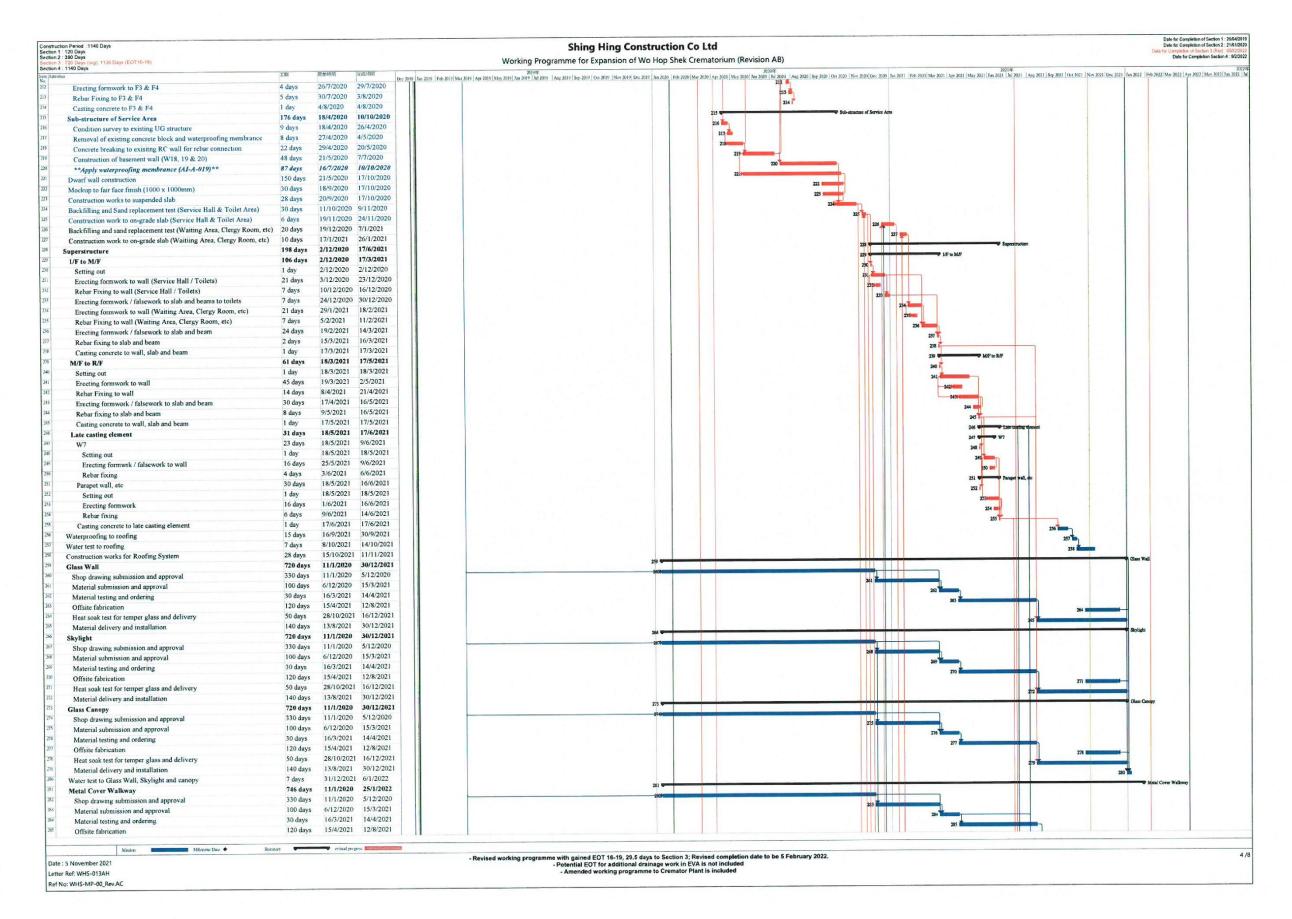






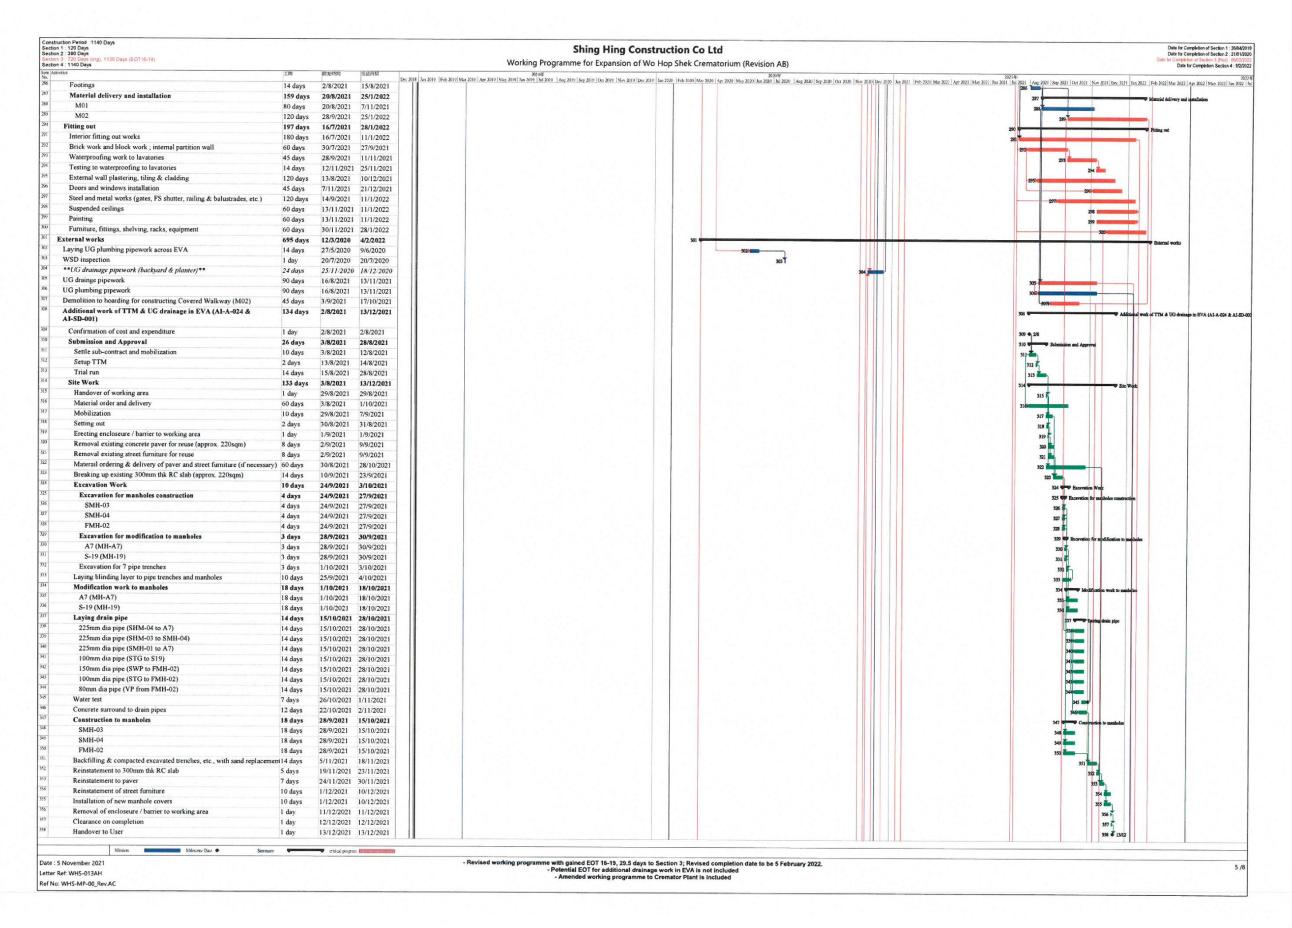


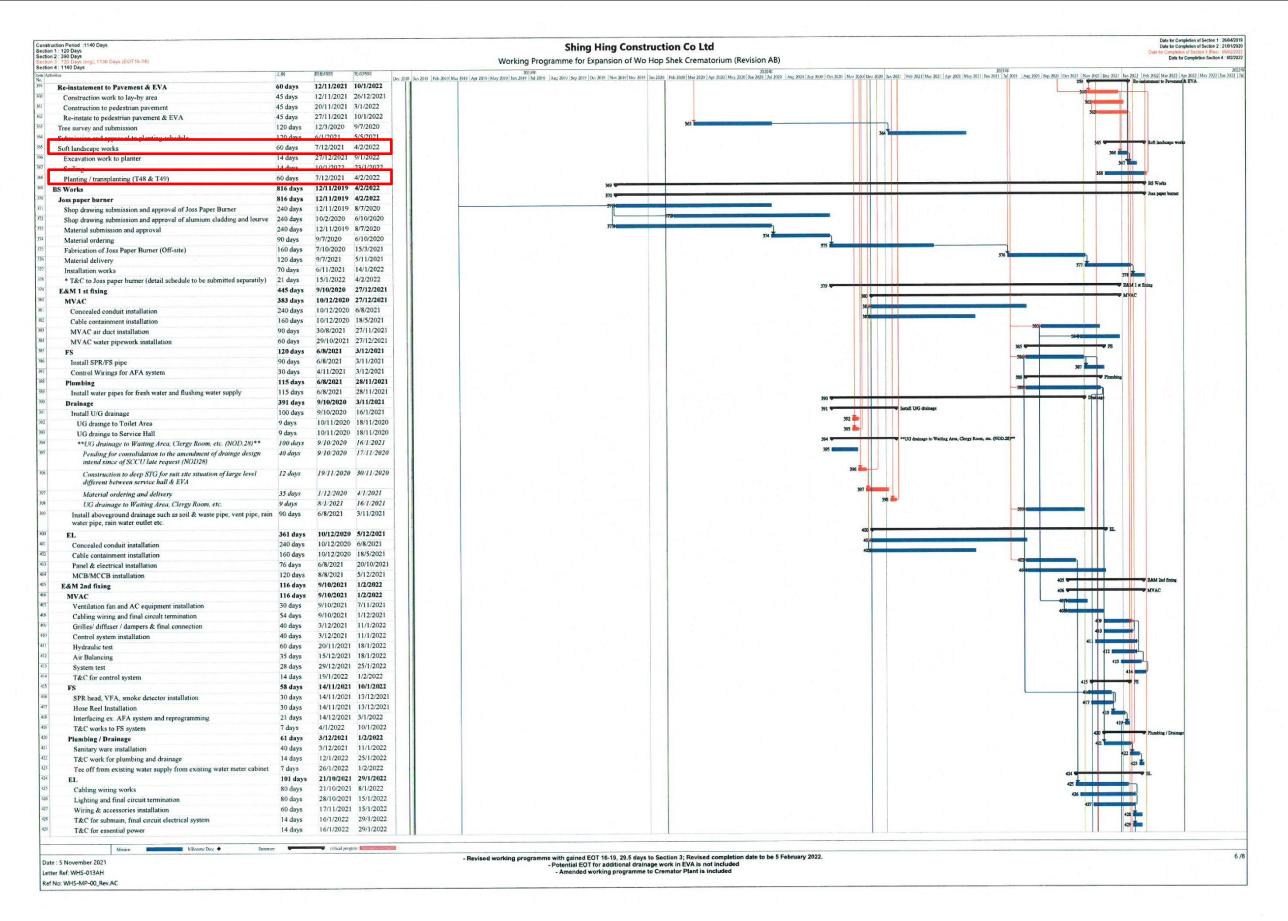





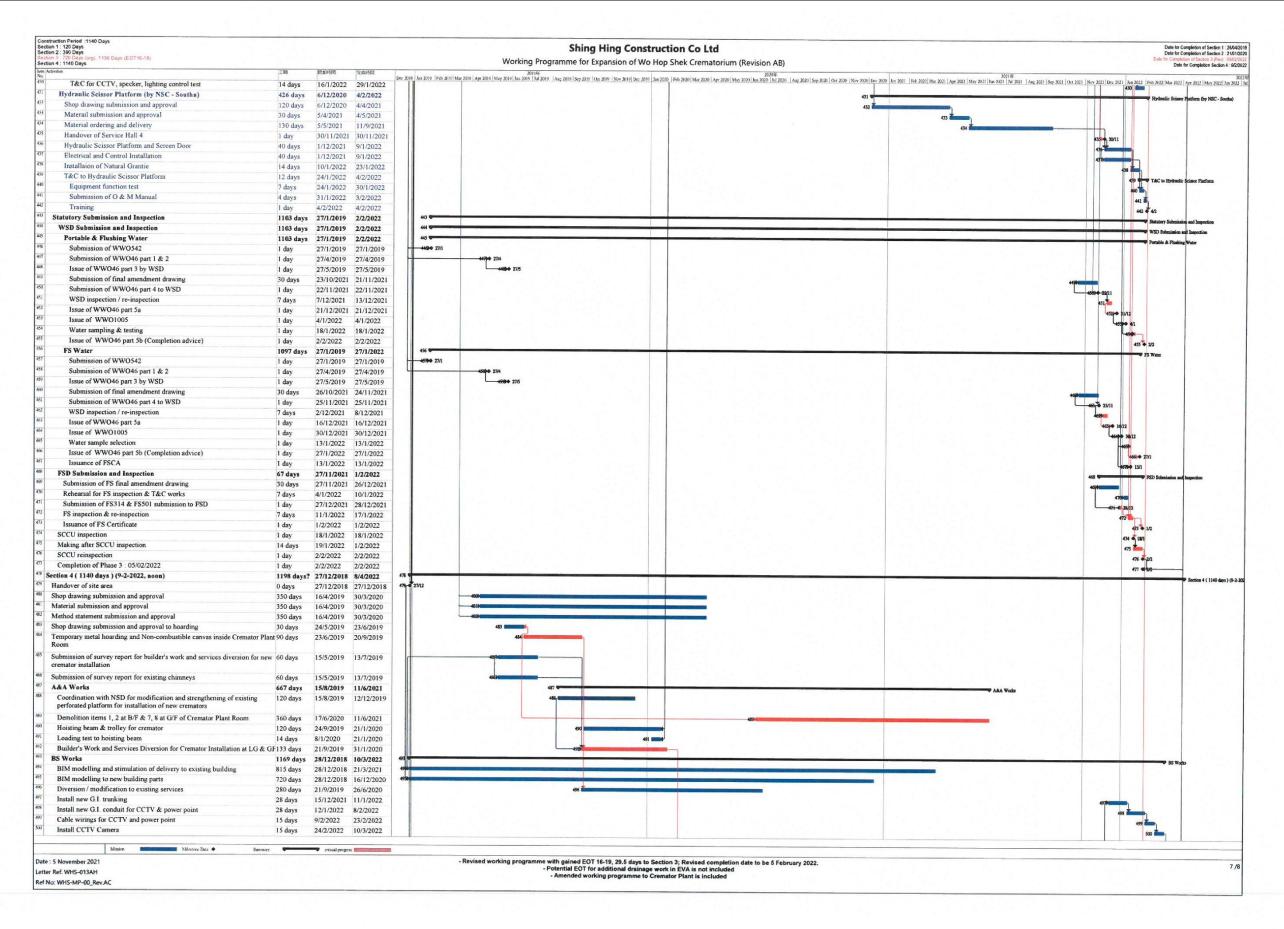

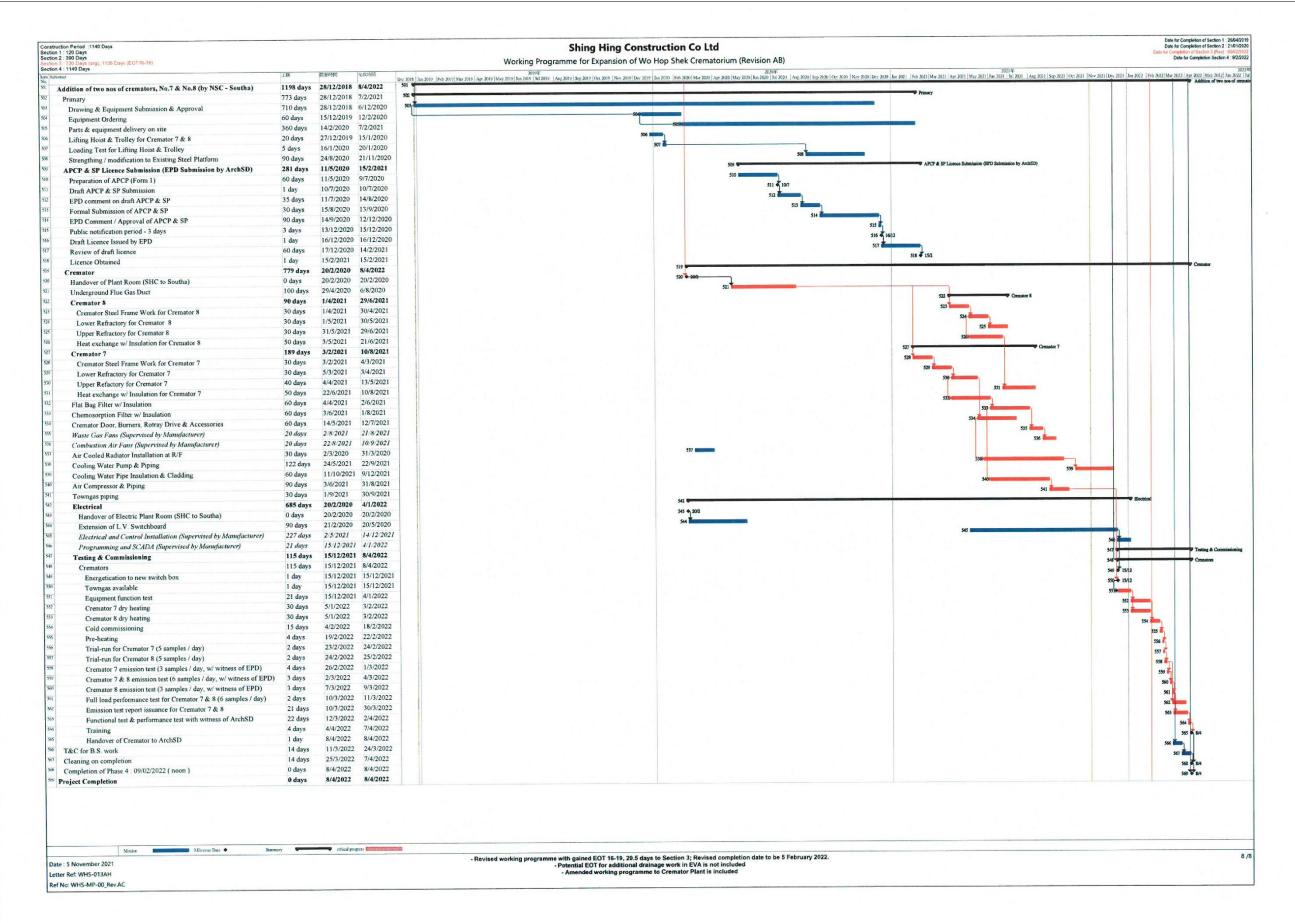






APPENDIX B: WORK AREA FOR THE CONTRACT NO. AL G513





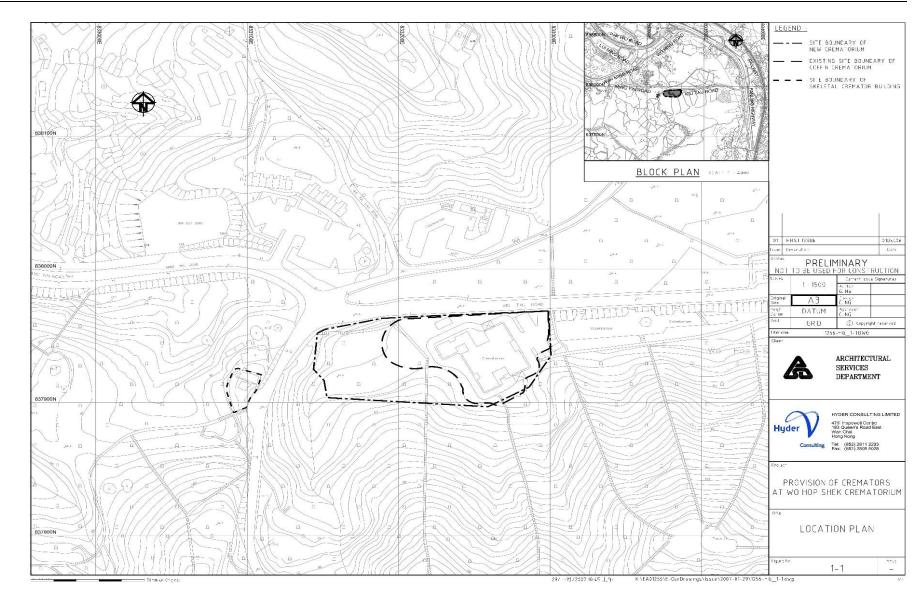





APPENDIX C: SUMMARY OF IMPLEMENTATION STATUS OF Environmental Mitigation





EIA Ref	EM&A Ref.	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stage	Relevant Legislation and Guidelines	Implementation Status
Air (Cons	truction	Phase)					
S.3.3.5		Under the Air Pollution Control (Specified Process) Regulation, an incinerator (including cremator) with an installed capacity exceeding 0.5 tonnes per hour, is classified as a specified process, and requires a Specified Process license to operate. FEHD shall apply for a specified licence under the APCO.	New Cremators in the New Crematorium / prior to operation	FEHD	Construction Phase	APCO	NA
S.3.9		Asbestos Investigation:	Incense burner,	Arch SD,	Construction Phase	APCO	NA
S.3.9.2		■ The incense burner, coffin and skeletal crematorium shall be thoroughly investigated prior to any demolition work commencing to ascertain the presence of any ACM. A registered asbestos consultant shall carry outan asbestos investigation report (AIR).	coffin and skeletal crematorium / Prior to any demolition	Registered Asbestos Consultant, Registered Asbestos		AIR and AAP	
S.3.9.3		■ If any ACM are identified in the existing crematorium, an asbestos abatement plan shall be submitted to EPD prior to any asbestos abatement works.	work commencing	Contractor			
S.3.9.4		The following precautionary and mitigation measures shall be implemented during the removal of ACM:					
		■ Enclosure of the work area.					
		■ Containment and sealing for the asbestos containing waste.					
		■ Provision of personal decontamination facility.					
		■ Use of personal respiratory/protection equipment.					
		Use of vacuum cleaner equipped with high-efficiency air particulate (HEPA) filter for cleaning up the work area.					
		■ Carrying out air quality monitoring during the asbestos abatement works.					





		ny EMAN Report No.27					
EIA Ref	EM&A Ref.	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stage	Relevant Legislation and Guidelines	Implementation Status
S.3.9.5		The following qualified personnel shall be appointed to carry out the asbestos abatement works:					NA
		■ Registered asbestos contractor for carrying out the asbestos removal works.					
		Registered asbestos supervisor for supervising the asbestos abatement works.					
		Registered asbestos laboratory for monitoring the air quality during the asbestos abatement works.					
		Registered asbestos consultant for supervising and certifying theasbestos abatement works.					
S.3.9.7 -		Other Site Management:					NA
S.3.9.9							
S.3.9.7		The asbestos materials in each building/premises must be abated before other contractors/trades are allowed to work in the building/premises.					NA
S.3.9.8		Tight security measures shall be taken at the asbestos abatement works site to prevent any disturbance to ACM that may result from the stealing of valuable items on site such as electrical cable and copper pipes. It is recommended that priority shall be given for the abatement of all friable ACM.					NA
S.3.9.9		As different contractors may be working on-site at the same time, the following measures should be considered:					NA
		■ If there is a sensitive receptor around the area, conduct environmentalair monitoring at this off-site receptor.					
		Submit to EPD a completion report, including photos and air monitoring results, immediately after completion of asbestos abatement work for every work zone.					
S.3.9.9		As different contractors may be working on-site at the same time, the following measures should be considered:					NA
		■ If there is a sensitive receptor around the area, conduct environmentalair monitoring at this off-site receptor.					
		Submit to EPD a completion report, including photos and air monitoring results, immediately after completion of asbestos abatement work for every work zone.					





EIA Ref	EM&A Ref.	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stage	Relevant Legislation and Guidelines	Implementation Status
S.3.10.1 - S.3.10.2		The contractor has a responsibility to notify EPD for undertaking any 'notifiable' works prior to the commencement of such works. In addition, the contractor is also required to fulfil specific dust control requirements given in the APCO Regulation's Schedule for specific jobs.	Prior to 'notifiable' works including Construction of the foundation of a building and construction of the superstructure of a building	Contractor	Construction Phase	Air Pollution Control (Construction Dust) Regulation APCO	Implemented
-	S.2.9.1 - S.2.9.3	Good site management / practices to avoid / minimise incidences of dust emissions: Site Boundary and Entrance Vehicle washing facilities including a high pressure water jet shall be provided at every discernible or designated vehicle exit point. The area at which vehicle washing takes place and the section of the road between the washing facilities and the exit point shall be paved with concrete, bituminous or hardcore material. Access Haul Roads and Unpaved Areas Each and every main haul road shall be paved with concrete, bituminous hardcore materials or metal plates, and kept clear of dusty materials. Or Unpaved haul roads and areas shall be sprayed with water so as to keep the entire road surface wet.	Project Site / Construction and Demolition	Contractor	Construction Phase	Air Pollution Control (Construction Dust) Regulation APCO	Implemented





EIA Ref	EM&A Ref.	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stage	Relevant Legislation and Guidelines	Implementation Status
		Excavated Materials					
		■ Any stockpile of dusty material shall be either: (a) covered entirely by impervious sheeting. (b) placed in an area sheltered on the top and the three sides. or (c) sprayed with water or a dust suppression chemical so as to maintain the entire surface wet. Exposed Earth					
		Exposed earth shall be properly treated by compaction, hydroseeding, vegetation planting or seating with latex, vinyl, bitumen within six monthsafter the last construction activity on the site or part of the site where the exposed earth lies.					
		Loading, Unloading or Transfer of Dusty Materials					
		All dusty materials shall be sprayed with water immediately prior to any loading or transfer operation so as to keep the dusty material wet.					
		Debris Handling					
		Any debris shall be covered entirely by impervious sheeting or stored ina debris collection area sheltered on the top and the three sides.					
		■ Before debris is dumped into a chute, water shall be sprayed so that itremains wet when it is dumped.					
		Transport of Dusty Materials					
		■ Vehicles used for transporting dusty materials/spoils shall be covered with tarpaulin or similar material. The cover shall extend over the edges of the sides and tailboards.					
		Site Clearance					
		■ The working area for the uprooting of trees, shrubs, or vegetation or the removal of boulders, pole, pillars shall be sprayed with water immediately before, during and immediately after the operation so as to maintain theentire surface wet.					
		■ All demolished items shall be covered by impervious sheeting or placed in a spot with shelters on top and three sides within a day of the demolition.					
		■ Workers at all levels should be co-operative to avoid dust generation and dispersion to the surrounding environment.					





EIA Ref	EM&A Ref.	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stage	Relevant Legislation and Guidelines	Implementation Status
Air (EM&	A for Co	nstruction Phase					
S.11.2.4 - S.11.2.5	S.2.5 - S.2.6	Conduct baseline and regular 1-hr and 24-hr TSP monitoring at 2 measurement locations at a 6-day frequency	A22a and A22b / Baseline monitoring prior to construction works / Regular monitoring throughout construction period	Contractor	Construction Phase	EIAO	Implemented
Noise (Co	nstructi	ion Phase)	1 1	•			1
S.4.4.9 - S.4.4.10	S.3.2.1 - S.3.2.2	 Good Site Practice and Noise Management: Only well-maintained plant shall be operated on site and the plant shall be regularly serviced during the construction works. Plant used intermittently shall be turned off or throttled down when notin active use. Plant that is known to emit noise strongly in one direction shall be orientedto face away from NSRs. Silencers, mufflers and enclosures for plant shall be used where possible and maintained adequately throughout the works. Mobile plant shall be sited away from NSRs. Stockpiles of excavated materials and other structures such as site buildings shall be used effectively to screen noise from the works. PME shall be well maintained and use properly on site to minimise the any excessive noise generated. 	Work site / Construction phase	Contractor	Construction Phase	GW-TM & NCO	Implemented





EIA Ref	EM&A Ref.	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stage	Relevant Legislation and Guidelines	Implementation Status
Land Con	taminat	ion (Construction Phase)					
S.5.7.2		Remedial Action Plan: If large amounts of contaminated soil (say 500m³) are found following further site investigation after the decommissioning of the crematorium, remediation options such as bioremediation for organics should be considered. Although disposal of smallamount of contaminated soil to landfills might be considered as an economic and acceptable option for remediation, it should be considered as the last resort if all remediation options including reuse are considered to be inappropriate or infeasible.	All areas requiring remedial works in Project site	Contractor	Construction Phase	Waste Disposal Ordinance (Cap.354) Waste Disposal (Chemical Waste) Regulations Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes	NA
S.5.7.3		 If disposal to landfills is chosen as the remediation measure, the criteria set primarily of Toxicity Characteristic Leaching Procedure (TCLP) limits, as stated in Annex E in the GN) should be met. At least three soil samples should be taken from the most contaminated area(s) and tested for TCLP for a full suite of parameters (16 metals) asstated in Table E1 in Annex E in the GN. If the testing result shows that any of the TCLP limits cannot be met, the soil shall be treated by cement stabilization and further tested for TCLP prior to landfill disposal or treated as chemical waste and disposed of at the Chemical Waste Treatment Centre (CWTC). 				CAP ProPECC Note PN3/94 Dutch A, B, C Classificati-on system WPCO Technical Memorandum on Standards for Effluents	
S.5.7.4		All soil treated as a chemical waste, shall be collected by a registered chemical waste contractor and the Waste Disposal (Chemical Waste) Regulations under the Waste Disposal Ordinance (Cap.354) shall be observed. Reference shall be made to the Registration of Chemical Waste Producers and Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes, issued by EPD.				Discharged into Drainage and Sewerage Systems, Inland and Coastal Waters (TM)	NA





EIA Ref	EM&A Ref.	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stage	Relevant Legislation and Guidelines	Implementation Status
S.5.7.6		Confirmatory Soil Sampling					NA
		 In order to confirm the extent of the soil contamination and if the contaminated soil should be removed or treated, confirmatory soil sampling shall be carried out during the remediation works. This shall consist of five to six samples in each location where soil contamination is identified from SI works. The locations will be to the north, south, east and west of the location where contaminated soil is found. Two locations should also be above and below the location (in terms of elevation) where contaminated soil is found. If analytical results exceed the Dutch B Levels or other agreed remedialtarget suggested in a supplementary CAR, the 					
		contaminated area shall be extended and further confirmatory sampling shall be carried out until no further contamination is encountered.					
S.5.8	S.4	Further Site Investigation	Areas that are currently in use	Contractor	Construction Phase	Interim CAR and RAP	NA
S.5.8.1	S.4.1 - S.4.7	Further site investigations in areas that are currently in use and cannot be accessed are required. These areas include the transformer room, dangerous goods stores, day tank room, fuel pump room, sunken fuel pipe and cremator.	and cannot be accessed, including the transformer room, dangerous			ProPECC Note PN3/94 Guidance Notes for Investigation and Remediation of	
S.5.8.2		The demolition contractor shall carry out further site investigations, after the decommissioning of the existing crematorium and skeletal cremator building.	goods stores, day tank room, fuel pump			Contaminated Sites of Petrol Filling Stations, Boatyards	
S.5.8.3		Potential contaminants in the soils have been identified in CAP and the parameters to be analysed for soils at different locations are summarised in Table 5-3 in S.5.8.3.	room, sunken fuel pipe and cremator.			and Car	





		ny Estati Report No.27					
EIA Ref	EM&A Ref.	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stage	Relevant Legislation and Guidelines	Implementation Status
S.5.8.4		Sampling and analysis plans for these investigations shall be prepared and submitted to EPD for approval prior to any of these investigation works. Supplementary CAR and RAP shall be prepared to describe the results and findings of these site investigations and, if necessary, any remedial works.	After the decommissioni ng of the existing crematorium and skeletal cremator building.			Repair / DismantlingWorkshop s	
Land Con	taminat	ion (EM&A)					1
S.11.2.9	S.4.1	Further Site Investigation:	After	Contractor	Construction Phase	Interim CAR & RAP	NA
S.11.2.15	S.4.7	 Conduct further site investigation for Petroleum hydrocarbons and PAH in soil samples. Conduct further site investigation for PCBs in soil samples. Conduct further site investigation for PAH, Dioxins and Metals (Cr, Co, Ni, Cu, Zn, As, Mo, Cd, Sn, Ba, Hg, Pb) in soil samples. 	decommissioni ng, prior to construction: Existing crematorium:				
			Dangerous goods store, Daily tank room, fuel pump room and				
			sunken fuel pipe				
			Skeletal Cremator				
			Building: Dangerous				
			goods store Existing				
			crematorium: Transformer				
			room Cremators				
			(residual inside the cremator,				
			flue and				





EIA Ref Ref.	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stage	Relevant Legislation and Guidelines	Implementation Status
		chimneys				
	nt (Construction Phase)					
S.6.7.24	Good Site Practice: Obtain the necessary waste disposal permits from the appropriate authorities, if they are required, in accordance with the Waste Disposal Ordinance (Cap. 354), Waste Disposal (Chemical Waste) (General) Regulation and the Land (Miscellaneous Provision) Ordinance (Cap. 28). Obtain a billing account with EPD for disposal of construction waste. A Waste Management Plan (WMP), incorporated in an Environmental Management Plan (EMP) shall be prepared and submitted to the Engineer/Supervising Officer for approval. Reference shall be made to Environment, Transport and Works Bureau Technical Circular (Works) (ETWB TCW) 19/2005. Nomination of an approved person to be responsible for good site practice, arrangements for collection and effective disposal to an appropriate facility of all wastes generated at the site. Use of a waste haulier, authorised or licensed to collect specific category of waste. A trip-ticket system shall be included as one of the contractual requirements and implemented by the Environmental Team to monitor the disposal of C&D and solid wastes at public filling facilities and landfills, and to control fly tipping. Reference shall be made to ETWB TCW No. 31/2004. Training of site personnel in proper waste management and chemicalwaste handling procedures. Separation of chemical wastes for special handling and appropriate treatment at a licensed facility. Routine cleaning and maintenance programme for drainage systems, sumps and oil interceptors. Provision of sufficient waste disposal points and regular collection for disposal. Adoption of appropriate measures to minimise windblown litter and dustduring transportation of waste, such as covering trucks or transporting wastes in enclosed containers.	Project site/ design, construction and demolition stages	Contractor	Construction Phase	Waste Disposal Ordinance (Cap. 354) Waste Disposal (Chemical Waste) (General) Regulation Waste Disposal (Charges for Disposal of Construction Waste) Regulation	Implemented





EIA Ref	EM&A	Environmental Protection Measures / Mitigation Measures	Location /	Implementation	Implementation	Relevant Legislation	Implementation
EIA KEI	Ref.	Environmental Frotection Measures / Mitigation Measures	Timing	Agent	Stage	and Guidelines	Status
		generated, recycled and disposed of (including the disposal sites).					
S.6.7.25		 Waste Reduction Measures: Segregation and storage of different types of waste in different containers, skips or stockpiles to enhance reuse or recycling of materials and their proper disposal. Encourage collection of aluminium cans, plastic bottles and packaging material (e.g. carton boxes) and office paper by individual collectors. Separate labelled bins shall be provided to help segregate this waste from other general refuse generated by the work force. Any unused chemicals or those with remaining functional capacity shallbe recycled as far as practicable. Reuse C&D materials when possible to reduce the amount of C&D material/waste. Wood, steel and other metals shall be separated for reuse and / or recycling Prior to disposal of C&D waste to minimise the quantity of waste to be disposed of to landfill. Minimise the potential for damage or contamination of construction material by having proper storage and site practices. Plan and stock construction materials carefully to minimise the amount of waste generated. 	Project site / construction and demolition stages	Contractor	Construction Phase	WBTC No. 32/1992 WBTC No. 19/2005	Implemented





	The second secon								
EIA Ref	EM&A Ref.	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stage	Relevant Legislation and Guidelines	Implementation Status		
S.6.7.4		Excavated Material Rock and soil generated from excavation shall be reused for site formation and excavated material from foundation work reused for landscaping as far as practicable to avoid disposal off-site.	Project site / construction and demolition stages	Contractor	Construction Phase	WBTC No. 12/2000	Implemented		
S.6.7.5	S.5.3.5	Construction and Demolition Material	Project site /	ArchSD /	Construction Phase	WBTC No. 2/93	Implemented		
S.6.7.7	- S.5.3.9	Reuse of the public fill and C&D waste shall be practiced on site as faras practicable.	construction and demolition	Contractor		The Land			
		 The handling of C&D materials is governed by WBTC No. 2/93. Inert C&D material (public fill) shall be directed to an approved public filling area or reclamation site, where it has the benefit of offsetting the need for removal of materials from borrow areas for reclamation purposes and helps to reduce the pressure on landfill sites. Individuals or companies who deliver public fill to public filling 	stages			(Miscellaneous Provision) Ordinance WBTC No. 19/2005			
		 areas require dumping licences. Careful design, planning and good site management can minimise over- ordering and generation of waste materials such as concrete, mortar and cement grouts. The design of formwork shall maximise 							
		the use of standard wooden or metal panels so that high reuse levels can be achieved. Alternatives such as. steel formwork, plastic fencing and reusable site office structures shall be considered to increase the potential for reuse and minimise C&D waste generation.							
		■ The contractor shall use as much as possible of the C&D material on- site. Proper segregation of waste types on site will increase the feasibility of certain components of the waste stream by recycling contractors.							





EIA Ref	EM&A Ref.	Environmental	Protection Me	asures / Mitigati	on Measures	Location / Timing	Implementation Agent	Implementation Stage	Relevant Legislation and Guidelines	Implementation Status
S.6.11.1 - S.6.11.5	S.5.3.1 0 - S.5.3.1 4			ntamination Investi		Cremators, Flues Chimneys and surrounding areas / After	Contractor ProPECC PN 3/94	Construction Phase	·	NA
		Crematorium, the shall be carried	After decommissioning but prior to demolition of the Existing Crematorium, the following further contamination investigations shall be carried out to confirm the quality and quantity of ash waste and building structures requiring treatment and disposal.						APCO	
		Location	Investigatio n Parameter	Investigatio n Period	Responsible Party	crematorium.				
		Cremators / flue / chimney and surround ing areas	Asbestos (building structures)	After decommissionin g but prior to demolition of the Existing	The Contractor					
		Cremators / flue / chimney and surrounding areas	Dioxins, heavy metals, PAH (ash waste)	Crematorium						
		Prior to any demolition work commencing, these areas suspected to contain asbestos containing material (ACM) shall be further inspected by aregistered asbestos consultant to determine the presence of any ACM. These areas shall be thoroughly investigated and the additional findings submitted as supplementary information to the Asbestos Investigation Report.								
		 information to the Asbestos Investigation Report. Samples shall be analysed for the presence and type of asbestos according to the Laboratory's HOKLAS accredited testing procedures. If the findings of the investigation indicate ACM materials present on the premises an Asbestos Abatement Plan must be prepared prior to commencement of demolition works. 								





EIA Ref	EM&A Ref.	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stage	Relevant Legislation and Guidelines	Implementation Status
		■ It is not currently possible to conduct inspection and sampling within the cremators, chimney and flues to assess the levels of contamination due to the operation of the crematorium. It is recommended that samples shall be collected from the potential areas of contamination for testing of dioxin, heavy metal and PAH after decommissioning and prior to the demolition of the Existing Crematorium.					
S.6.9.6 - S.6.9.7	S.5.3.1 5 - S.5.3.1 7	 Asbestos Containing Material Asbestos wastes shall be handled in accordance with the Code of Practice on the Handling, Transportation and Disposal of Asbestos Waste issued by the Environment and Food Bureau. Production, collection and disposal of Asbestos waste will follow the 'trip-ticket' system. The registered asbestos contractor shall appoint a licensed asbestos waste collector to collect the packaged asbestos waste and deliver it to the designated landfill for disposal. Notification has to be given to EPD for its disposal. EPD will normally require ten working days notice of the intention to dispose of any quantity of asbestos waste. After processing the notification, EPD will issue specific instructions and directions for disposal of the waste. The waste producer or agent must strictly follow these directions. 	Cremator room in Existing Crematorium / before demolition and after decommission	Contractor	Construction Phase	COP on Handling, Transportation and Disposal of Asbestos Waste under the Waste Disposal (Chemical Waste) (General) Regulation.	NA
		Dioxin Contaminated Materials (DCM) / Heavy Metal Contaminated Materials (HMCM) / Polyaromatic Hydrocarbon Contaminated Materials (PAHCM) from Demolition of the Existing Crematorium Proposed Contamination Classifications for Ash Waste with DCM / HMCM / PAHCM.	Cremator room in Existing Crematorium / before demolition and after decommission	Contractor	Construction Phase	ProPECC PN 3/94 APCO	NA





EIA Ref	EM&A	Environmental Protecti	ion Measures / M	litigation Measures		Implementation	Implementation		Implementation
	Ref.				Timing	Agent	Stage	and Guidelines	Status
		Classification of Contamination	Dioxin Level in ash waste	Heavy Metal Level / Polyaromatic Hydrocarbon in Ash Waste					
		Low Contaminated DCM/HMCM/PAHCM	<1 ppb TEQ	< Dutch "B" List					
		Moderately/Severely Contaminated HMCM/PAHCM	<1 ppb TEQ	> Dutch "B" List					
		Moderately Contaminated DCM	> 1 and < 10 ppb TEQ	Any Level					
		Severely contaminated DCM	>10 ppbTEQ	Any Level					
S.6.9.9	S.5.3.1 9	Demolition, Handling, Treats DCM / HMCM / PAHCM fron			Cremator room in Existing Crematorium / demolition	Contractor	Construction Phase	ProPECC PN 3/94 APCO	NA
		■ Where the ash waste cont PAHCM, the contractor sh during demolition. Genera followed. The ash waste co	all avoid ash waste all dust suppression	becoming airborne measures shall be					
S.6.9.10 - S.6.9.14	S.5.3.2 0 - S.5.3.2 4	Demolition, Handling, Treats Severely Contaminated DCM Contaminated HMCM / PAH Crematorium Site preparation procedures:	I and Moderately / S CM from Demolition	Severely	Cremator room in Existing Crematorium / demolition	Contractor	Construction Phase	Waste Disposal (Chemical Waste) (General) Regulation ProPECC PN 3/94	NA
		■ Except the cremators/flue items shallbe removed as decontamination activities	far as practicable to s.	avoid obstructing the				APCO	
		Preliminary site decontan using High Efficiency Part							
		A chamber with three layer	ers of polythene she	ets shall enclose the					





EIA Ref	EM&A Ref.	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stage	Relevant Legislation and Guidelines	Implementation Status
		top portion of the chimney above the roof.					
		■ A 3-chamber decontamination unit shall be constructed at the entrance to the cremators/flues/chimney for entry and exit from the work area. It shall comprise a dirty room, a shower room and a clean room of at least 1m x 1m base with 3 layers of fire retardant polythene sheet.					
		Workers shall carry out decontamination procedures before leaving thework area.					
		All workers shall wear full protective equipment, disposable protective overall, nitrile gloves, rubber boots, and full-face positive pressure respirator.					
		■ Warning signs in both Chinese and English shall be put up in conspicuous areas.					
		Site preparation procedures specific to severely contaminated DCM:					
		■ The walls, floor and ceiling of the cremator room shall be lined with 3-layers of fire retardant polythene sheets.					
		■ Air movers shall be installed at the cremator room, and at the bottom of the chimney to exhaust air from the work area. A stand by air mover shall also be installed with each of the air movers. Sufficient air movement shall be maintained to give a minimum of 6 air changes per hour to the work area.					
		New pre-filters and HEPA filters shall be used on the air movers.					
		■ Before commencement of the decommissioning work a smoke test with non-toxic smoke shall be carried out to ensure the air tightness of the containment.					
		Demolition and handling procedures:					
		■ The cremators/flue/chimney shall be removed from top down.					
		Scrubbing and HEPA vacuuming shall be used to remove any ash or residues attached to the cremators, flue, chimney and other building structures.					
		■ Wastes generated from the contaminant or decontamination unit including the workers protection clothing shall be disposed of at landfill site.					
		After completion of removal, all surfaces shall be decontaminated by HEPA vacuum.					
		■ If any contaminated wastewater needs to be discharged out of the					





EIA Ref	EM&A Ref.	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stage	Relevant Legislation and Guidelines	Implementation Status
		site, it shall be properly treated to WPCO requirements with prior agreements with EPDon discharge standards.					
		Demolition and handling procedures specific to severely contaminated DCM:					
		■ The contaminated detached sections of the building structures shall be wrapped with 2 layers of fire retardant polythene sheets. A third layer shallbe wrapped and secured with duct tape. Wet wiping shall be used to decontaminate the outer layer.					
		■ After completion of removal and decontamination, spray the innermost layer of the fire retardant polythene sheet with PVA. Upon drying, peel off and dispose of at landfill site. Repeat for the other 2 layers disposing the final layer as contaminated wastes.					
		Treatment and disposal procedures:					
		■ Immobilise the ash waste by mixing with cement in the correct ratio as determined by pilot mixing and TCLP test.					
		■ Place material in polythene lined steel drums for disposal at landfill. The drums should clearly be marked with "DANGEROUS CHEMICAL WASTE" in English and Chinese. Prior agreement of the disposal criteria must be obtained from EPD and the landfill operator.					
		■ If the landfill disposal criteria cannot be met, disposal at the CWTC in TsingYi shall be considered.					
S.6.9.1	S.5.3.2	Chemical Waste	Project site /	Contractor	Construction Phase	Code of Practice on the	Implemented
S.6.9.2	5	■ Should any chemical waste be generated, the Contractor must registerwith the EPD as chemical waste producer.	demolition			Packaging, Labelling and Storage of	
	S.5.3.7	 All the chemical waste shall be handled according to the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes. The chemical waste shall be stored and collected by an approved contractor for disposalat a licensed facility in accordance with the Waste Disposal (Chemical Waste) (General) Regulation. Principles of reuse and recycle chemical waste on site as far as 				Chemical Wastes Waste Disposal (Chemical Waste) (General) Regulation.	
		practicable shall be adopted by the Contractor.					





EIA Ref	EM&A Ref.	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stage	Relevant Legislation and Guidelines	Implementation Status
S.6.9.3	S.5.3.2	Containers used for the storage of chemical waste shall:					
	8	■ Be suitable for the substance they are holding, resistant to corrosion, maintained in good condition, and securely closed.					
		■ Have a capacity of less than 450 litres unless the specifications have been approved by the EPD.					
		Display a label in English and Chinese in accordance with instructions prescribed in Schedule 2 of the Waste Disposal (Chemical Waste) (General) Regulation.					
S.6.9.4	S.5.3.2	The storage area for chemical waste shall:					
	9	■ Be clearly labelled and used solely for the storage of chemical waste.					
		■ Be enclosed on at least 3 sides.					
		■ Have an impermeable floor and bunding, of capacity to accommodate 110% of the volume of the largest container or 20% by volume of the chemical waste stored in that area, whichever is the greatest.					
		■ Have adequate ventilation.					
		■ Be covered to prevent rainfall entering (water collected within the bundmust be tested and disposed as chemical waste if necessary).					
		Be properly arranged so that incompatible materials are adequately separated.					
S.6.9.25	S.5.3.3	Disposal of chemical waste shall be:					
	0	■ Via a licensed waste collector.					
		■ A facility licensed to receive chemical waste, such as the Chemical Waste Treatment Facility at Tsing Yi, which offers a chemical waste collection service and can supply the necessary storage containers. or					
		■ A waste recycling plant approved by EPD.					





EIA Ref	EM&A Ref.	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stage	Relevant Legislation and Guidelines	Implementation Status
S.6.7.27	S.5.3.3	General Refuse	Project site /	Contractor	Construction Phase		Implemented
S.6.7.28	1 - S5.3.3 2	■ General refuse shall be stored in enclosed bins or compaction units separate from C&D and chemical wastes. A reputable waste collector shall be employed by the contractor to remove general refuse from the site, separately from C&D and chemical wastes, on a daily or every second day basis to minimise odour, pest and litter impacts.	construction and demolition stages				
		Individual collectors often recover aluminium cans from the waste stream if they are segregated or easily accessible. Therefore, separately labelled bins for their deposit shall be provided if feasible. Similarly, plastic bottles and carton package material generated on site shall be separated for recycling as far as possible. Site office waste shall be reduced through recycling of paper if volumes are large enough to warrant collection. Participation in a local collection scheme shall be considered if one is available.					
		ent (EM&A)	Ι				
S.11.2.17	S.5.3.1 0	Supplementary site investigations shall be conducted for asbestos in building structures and for dioxins, heavy metals and PAH in ash/particular matter samples.	Cremators / flue / chimney and surrounding area. After decommissioni ng but prior to demolition	Contractor	Construction Phase	ProPECC PN 2/97 and 3/94 AIR, AMP/AAP to be submitted under APCO Future Supplementary Investigation Site Plan	NA
Landscap	e and V	isual (Construction Phase)					
S.7.9.2 MC 1	S.6.3.1	 Site offices and construction yards: Site offices shall have olive green roof and façade coating or colour matches with existing environment. Site offices and the construction yard shall be decommissioned after construction. 	All site offices / Design and construction phases	ArchSD's Contractor	Construction Phase		Implemented
S.7.9.2 MC 2	S.6.3.1	Height of site offices: The height of site offices, including the rooftop shall not exceed 10m. Building services equipment such as antennas may exceed 10m and shall be coated in black.	All site offices / Design and construction phases	ArchSD's Contractor	Construction Phase		Implemented





EIA Ref	EM&A Ref.	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stage	Relevant Legislation and Guidelines	Implementation Status
S.7.9.2 MC 3	S.6.3.1	Hoarding and screening: Where practical the site offices areas, construction yards and storage areas shall be screened using colour in harmony with the surrounding environment around the peripheries of the works area until the completion of relevant construction phases.	All site offices and construction yard areas / Design and construction phases	ArchSD's Contractor	Construction Phase		Implemented
S.7.9.2 MC 4	S.6.3.1	 Construction plant and building material: Shall be orderly and carefully stored in order to appear neat and avoid visibility from outside where practical. Excess materials shall be removed from site as soon as practical. All construction plants shall be removed from site upon completion of construction works. 	Works site / Design and construction phases	ArchSD's Contractor	Construction Phase		Implemented
S.7.9.2 MC 5	S.6.3.1	Construction light: To be oriented away from the viewing location of VSRs. All lighting facing sensitive receiver shall have frosted diffusers and reflective covers.	All construction lights / Design and construction phases	ArchSD's Contractor	Construction Phase		Implemented
S.7.9.2 MC 6	S.6.3.1	Silting trap: ■ Silting traps shall be installed to minimise silting to streams.	Streams / Construction phase	Contractor	Construction Phase		NA
S.7.9.3 MT 1	S.6.3.1	Compensation for losses: The tree compensation to tree loss ratio shall be at least 1:1 in term of quantity.	Within the Wo Hop Shek Crematorium	ArchSD's Contractor	Construction Phase	ETWB TCW No. 2/2004 ETWB TCW No. 3/2006	NA
S.7.9.3 MT 2	S.6.3.1	Where practical, trees that require removal shall be transplanted on Site.	Work site / Design and construction phases	ArchSD's Contractor	Construction Phase	ETWB TCW No. 2/2004 ETWB TCW No. 3/2006	Implemented





EIA Ref	EM&A Ref.	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stage	Relevant Legislation and Guidelines	Implementation Status
S.7.9.3 MT 3	S.6.3.1	 Amenity planting: Planting works shall be carried out under the supervision of a specialist landscape sub-contractor. The rooftop of the cremation plant room shall be planted with lawn. Open spaces shall be included Project. Screen planting such as planting a roll of trees along the site boundary butting Kiu Tau Road shall be carried out. New trees, shrubs and groundcover shall be carefully selected and designed to homogenize with the environment. 	As shown on mitigation measure plans / All phases	ArchSD's & FEHD's Contractor	Construction Phase	ETWB 2/2004	NA
S.7.9.3 MT 4	S.6.3.1	Woodland mix planting: Woodland mix, comprising of tree seedlings and shrubs, shall be planted within the Wo Hop Shek Cemetery to enhance the ecological value and compensatory of tree loss.	Within the Wo Hop Shek Cemetery / All phases	ArchSD's Contractor	Construction Phase	ETWB TCW No. 2/2004ETWB TCW No. 3/2006	NA
S.7.9.3 MT 5	S.6.3.1	Preservation: No tree shall be transplanted or felled without prior approval by relevant Government departments. All trees that are marked for retention shall be fenced off with a 1.2mhigh fence around the dripline of trees or larger area as far as feasible. Transplant preparation works shall be carried as soon as possible after commencement of construction. Over-pruning such as hard pruning of tree crown, pollarding or topping shall be avoided. Rootball and crown pruning shall be carried out over at least 3 months. Existing shrub and ground cover planting areas that will not be	Work site / All phases	ArchSD's Contractor	Construction Phase	ETWB TCW No. 2/2004 ETWB TCW No.	Implemented
		removed shall be maintained in good condition and enhanced where practical.					
S.7.9.4 MB 1	S.6.3.1	The 10m height headroom cremation plant room shall be half sunken to reduce the visual impact to pedestrians.	Cremation plant room / Design phase	ArchSD's Contractor	Construction Phase		NA
S.7.9.4 MB 2	S.6.3.1	The chimney shall be designed to have sculptural outlook and articulated.	Chimney / Design phase	ArchSD's Contractor	Construction Phase		NA
S.7.9.4 MB 3:	S.6.3.1	The chimney stacks shall be designed to locate at the least conspicuous location of the site to VSRs.	Chimney / Design phase	ArchSD's Contractor	Construction Phase		NA





EIA Ref	EM&A Ref.	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stage	Relevant Legislation and Guidelines	Implementation Status
Landscap	e and V	isual (EM&A)					
S.11.2.23 - S.11.2.24		Details of the inspection frequency and parameters will be outlined in the EM&A Manual.	Work site / Construction	Contractor	Construction Phase		NA
Water Ou	iality (C	onstruction Phase)					
	S.7.2.2		Work site /	Contractor	Construction Phase	ProPECC PN 1-	Implemented
S.8.7.4		■ Wastewater shall be properly treated to meet the discharge standards set out in the relevant Water Pollution Control Ordinance (WPCO) discharge licence. No direct discharge of site runoff into the two streams shall be allowed.	Construction			94 & WPCO	
		Provision of perimeter channels to intercept storm runoff from outside the Site. These shall be constructed in advance of site formation works and earthworks.					
		Sand/silt removal facilities such as sand traps, silt traps and sediment basins should be provided to remove sand/silt particles from runoff to meet the requirements of the Technical Memorandum standard under the WPCO.					
		 Works shall be carefully programmed to minimise soil excavation works during rainy seasons. Exposed soil surface shall be protected by paving as soon as possible to reduce the potential of soil erosion. 					
		■ Temporary access roads shall be protected by crushed gravel and exposed slope surfaces shall be protected when rainstorms are likely to occur.					
		■ Trench excavation shall be avoided in the wet season as far as practicable, and if necessary, these trenches shall be excavated and backfilled in short sections.					
		Open stockpiles of construction materials on Site shall be covered with tarpaulin or similar fabric during rainstorms.					
		■ Sand and silt in the wash water from the wheel from the wheel washing facility shall be settled out and removed before discharging into the storm drain.					
		Oil receptor shall be provided in the drainage system and regularly emptied to prevent the release of oil and grease into the storm drainage system after accidental spillage.					





EIA Ref	EM&A Ref.	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stage	Relevant Legislation and Guidelines	Implementation Status
S.8.7.5	S.7.2.3	General Construction Activities	Work site /	Contractor	Construction Phase	ProPECC PN 1-	Implemented
		■ Debris and rubbish generated on Site shall be collected, handled and disposed of properly to avoid them entering the two streams.	Construction phase			94 & WPCO	
		■ All fuel tanks and storage areas shall be provided with locks and be sited on sealed areas, within bunds of a capacity equal to 110% of the storage capacity of the largest tank.					
		■ Open storm water drains and culverts near the works area shall be covered to block the entrance of large debris and refuse.					
S.8.7.6	S.7.2.4	Sewage from On-site Workforce:	Work site /	Contractor	Construction Phase	WPCO	Implemented
		■ Portable chemical toilets shall handle the sewage from construction work force if the existing toilets in the Site are not adequate. Licensed contractors who shall be responsible for appropriate disposal and maintenance of these facilities shall provide appropriate and adequate portable toilets.	Construction phase				
		■ Sheet piling shall be provided at suitable location around the basement excavation to reduce the effect of lowering the water table from any dewatering process. Any discharge of groundwater pumped out from any dewatering process of the construction works shall be treated to comply with the standards set in the relevant discharge licence prior discharge. No discharge of the groundwater shall be allowed into the two streams.					
		ction Phase)	1	1			
S.9.8.3 -	S.8.3.1		Work site	Arch SD /	Construction Phase	ETWB Technical	Implemented
		Layout of the Project shall be carefully designed to avoid or minimise thearea of habitat loss and the numbers to trees to be felled.	particularly semi- natural woodland /	Contractor		Circular No. 3/2006	
		■ All trees shall be preserved as far as possible, especially species of conservation concern. Recommendations to be provided in the Tree Survey Report to mitigate impacts on trees shall be followed.	Design and construction phases.				
		■ Disturbance of individuals of the shrub / tree Transplantation of the two shrub / tree species of conservation concern, namely <i>Aquilaria sinensis</i> and <i>Cibotium barometz</i> , shall be avoided. Where loss of these species would be unavoidable, it is recommended to transplant them to same habitats with similar conditions. Following transplantation, regular monitoring of these trees shall be conducted by a suitable qualified botanist / horticulturist over a 12-					





EIA Ref	EM&A Ref.	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stage	Relevant Legislation and Guidelines	Implementation Status
		month period.					
		Transplantation of any affected trees to grassland / scrubland within theWo Hop Shek Cemetery.					
		■ Compensatory planting of the felled trees shall follow the Technical Circular No. 3/2006 issued by ETWB.					
S.9.8.15 - S.9.8.16	S.8.3.1	Mitigation to construction runoff through general good site practice:	Work site / Construction phase	Contractor	Construction Phase	ETWB Technical Circular (Works) No. 5/2005.	Implemented
		■ Temporary access to the work sites shall be carefully planned and located to minimise disturbance caused to the streams and nearby habitats.					
		Use of less or smaller construction plant may be specified to reduce disturbance to the streams and nearby habitats.					
		■ Temporary sewage system shall be designed and installed to collect wastewater and prevent it from entering the streams and nearby habitats.					
		■ The Site inside or in the proximity of the streams and nearby habitats shall be temporarily isolated, such as by placing of sandbags or silt curtains with lead edge at bottom and properly supported props, to prevent adverse impacts on these areas.					
		Natural bottom and existing flow in the streams shall be preserved as muchas possible to avoid disturbance to the stream habitats.					
		■ Proper locations well away from the streams and nearby habitats for temporary storage of materials (e.g. equipment, filling materials, chemicals and fuel) and temporary stockpile of construction debris and spoil shall be identified before commencement of the works.					
		■ Stockpiling of construction materials, if necessary, shall be properly covered and located away from the streams and nearby habitats.					
		■ Construction debris and spoil shall be covered up and/or properly disposed of as soon as possible to avoid being washed into the streams and nearby habitats by rain.					
		■ Construction effluent, site runoff and sewage shall be properly collected and/or treated.					





EIA Ref	EM&A Ref.	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stage	Relevant Legislation and Guidelines	Implementation Status
		■ Proper locations for discharge outlets of wastewater treatment facilities well away from the streams and nearby habitats shall be identified.					
		■ Vehicles and other plant shall be carefully maintained and properly used to minimise the chance for accidental spillage.					
		Any spillages that do occur shall be quickly identified and appropriately cleaned up before they can contaminate streams or groundwater.					
		■ Temporary geo-textile silt fences around earth moving works shall beerected to trap any sediments being washed away and prevent them from entering surrounding areas.					
		■ Silt traps shall be installed at points where drainage from the Site enters temporary sewage system.					
		■ Exposed soil or other loose materials shall be covered with tarpaulins to prevent erosion, and then seeded and covered with a biodegradable geo- textile blanket for erosion control purposes.					
S.9.8.18		Mitigation to protect the groundwater:	Work site /	Contractor	Construction Phase		NA
		■ Basement formation or any construction activities likely to pump out a large quantity of groundwater shall be protected with sheet-piling at suitable locations around the basement footprint, or by any like method.	Construction phase				
		■ No groundwater shall be pumped back to the two stream courses to protect the natural integrity of the stream habitat and the associated organism.					
S.9.8.20	S.8.3.1	Mitigation for noise and other disturbance on ecological integrity:	Work site /	Contractor	Construction Phase		Implemented
		■ Use of sturdy 1.8 metres protective fencing shall be located at the edge of the tree canopy but not around the trunk.	Construction phase				
		■ Works beneath the tree canopy shall be avoided: If encroachment under the canopy area is unavoidable, adequate protections shall be provided to ensure no damage of any part of the tree would occur due to the encroachment.					
		■ An approved Landscape Contractor shall implement any tree transplanting and planting works. Quality control of the work shall be undertaken by a qualified Landscape Architect through site inspections and approval of works.					





EIA Ref	EM&A Ref.	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stage	Relevant Legislation and Guidelines	Implementation Status
		Construction works shall be restricted to works area which are clearly defined.					
		Woodland or other habitats that would be affected by the constructionworks shall be well-defined and minimised.					
		Human inference to habitats beyond the site boundary and habitats proposed to be retained shall be avoided by providing temporary barricades.					
		Works area shall be reinstated immediately after completion of the construction.					
		■ Waste and other garbage generated during the construction of the proposed development shall be dumped properly.					
		■ Uncontrolled fire shall be strictly prohibited. Appropriate fire control measures shall be provided in order to protect nearby habitats.					
Ecology (EM&A)						
	S.8.2.1	Audit/Inspection:	Work site /	Contractor	Construction Phase		Implemented
& S.11.2.29		Regular site audit / inspection shall be conducted at least once a week to inspect the implementation of the recommended mitigation measures (details to be outlined in the EM&A Manual).	Construction phase				
S.11.2.32	S.8.2.2	Monitoring on Transplantation:	Work site /	Contractor	Construction Phase		Implemented
S.11.2.33	- S.8.2.4	■ Trees requiring transplantation or protection shall be identified based on the information illustrated in the Tree Survey Report.	Construction phase				
		■ Regular monitoring after transplantation of Aquilaria sinensis and Cibotium barometz individuals shall be conducted to check on the health and conditions of the plants. Monitoring shall cover the 12-month period following transplantation. The monitoring shall be conducted by a suitably qualified botanist / horticulturist at least twice a month for the first four months after transplantation, and once a month for the remaining eight months.					





APPENDIX D: IMPACT MONITORING SCHEDULE OF THE REPORTING MONTH





Impact Monitoring Schedule for Expansion of Wo Hop Shek Crematorium May-22 Mon Tue Wed Thur Sat Fri Air monitoring for A10, A20 for 1-hr TSP and 24-hr TSP Weekly ET site inspection and audit Monitoring Time: 0900-1630 Air monitoring for A10, A20 for 1-hr TSP and 24-hr TSP Monitoring Time: 0900-1630 Weekly ET site inspection and audit Air monitoring for A10, A20 for 1-hr TSP and 24-hr TSP Monitoring Time: 0900-1630 Weekly ET site inspection and audit Air monitoring for A10, A20 for 1-hr Air monitoring for A10, A20 for 1-hr TSP and 24-hr TSP TSP and 24-hr TSP Weekly ET site inspection and audit Monitoring Time: Monitoring Time: 0900-1630 0900-1630 Weekly ET site inspection and audit

2. Advance notification of the changes will be given to all relevant parties at lease 48 hours prior to implementation.

^{*}Remarks: 1. This impact monitoring schedule is subject to change due to adverse weather conditions or other rationales.





APPENDIX E: EVENT/ACTION PLAN FOR DUST EXCEEDANCE





Frant	Action					
Event	ET	IEC	AR	Contractor		
Action Level						
Exceedance for one sample Exceedance for two or more consecutive samples	 Identify source, investigate the causes of complaint and propose remedial measures; Inform IEC and AR; Repeat measurement to confirm finding; Increase monitoring frequency to daily. Identify source; Inform IEC and AR; Advise the AR on the effectiveness of the proposed remedial measures; Repeat measurements to confirm findings; Increase monitoring frequency to daily; Discuss with IEC and Contractor on remedial actions required; If exceedance continues, arrange meeting with IEC and AR; 	 Check monitoring data submitted by ET; Check Contractor's working method. Check monitoring data submitted by ET; Check Contractor's working method; Discuss with ET and Contractor on possible remedial measures; Advise the ET on the effectiveness of the proposed remedial measures; Supervise Implementation of remedial measures. 	 Confirm receipt of notification of exceedance in writing; Notify Contractor; Ensure remedial measures properly implemented. 	 Rectify any unacceptable practice; Amend working methods if appropriate. Submit proposals for remedial to AR within three working days of notification; Implement the agreed proposals; Amend proposal if appropriate. 		





Event	Action						
Event	ET	IEC	AR	Contractor			
	8. If exceedance stops, cease additional monitoring.						
Limit Level							
1. Exceedance for one sample	 Identify source, investigate the causes of exceedance and propose remedial measures; Inform IEC, AR, Contractor and EPD; Repeat measurement to confirm finding; Increase monitoring frequency to daily; Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and AR informed of the results. 	 Check monitoring data submitted by ET; Check Contractor's working method; Discuss with ET and Contractor on possible remedial measures; Advise the AR on the effectiveness of the proposed remedial measures; Supervise implementation of remedial measures. 	 Confirm receipt of notification of exceedance in writing; Notify Contractor; Ensure remedial measures properly implemented. 	 Take immediate action to avoid further exceedance; Submit proposals for remedial actions to IEC within three working days of notification; Implement the agreed proposals; Amend proposal if appropriate. 			
2. Exceedance for two or more consecutive samples	 Notify IEC, AR, Contractor and EPD; Identify source; Repeat measurement to confirm findings; Increase monitoring frequency to daily; Carry out analysis of Contractor's working 	 Discuss amongst AR, ET, and Contractor on the potential remedial actions; Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the AR accordingly; 	 Confirm receipt of notification of exceedance in writing; Notify Contractor; In consultation with the IEC, agree with the Contractor on the remedial measures to be implemented; 	 Take immediate action to avoid further exceedance; Submit proposals for remedial actions to IEC within three working days of notification; Implement the agreed proposals; 			





Event	Action					
Event	ET	IEC	AR	Contractor		
possible manufacture implements. 6. Arrange mand AR to remedial ataken; 7. Assess efficing Contractor actions and AR in results; 8. If exceeda	mitigation to be	Supervise the implementation of remedial measures.	 4. Ensure remedial measures properly implemented; 5. If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated. 	 4. Resubmit proposals if problem still not under control; 5. Stop the relevant portion of works as determined by the AR until the exceedance is abated. 		





APPENDIX F: DUST MONITORING EQUIPMENT CALIBRATION CERTIFICATE







Pstd = 760 mm Hg

Checked by:

For subsequent calculation of sampler flow: (1.21*m+b)/[Sqrt(298/Tav)(Pav/760)]

Acuity Sustainability

Consulting Limited
Unit C, 11/F, Ford Glory Plaza, No. 37-39 Wing Hong Street
Cheung Sha Wan, Kowloon, H.K.
Tel.: (852) 2698 6833 Fax.: (852) 2333 1316

	HIVOL SAMPLER	CALIB	RATION	DATA SHEE	T (TSP)	
	III. OL DIMI DER		Information		- ()	
Location:	Fung Kai Liu Yun Sum Memorial School	Site ID:	A10	Date:	29-Apr-2022	
Serial No:	1049 I	Model:	TE-5170X	Operator:	Casey Lau	
		Ambie	nt Conditio	n		
Corrected Pre	essure (mm Hg):	758.4			303.1	
		Calibr	ation Orifi	ce		
Model:	8		E-5028A	Slope:	1.03041	
Serial No.:			3702	Intercept:	-0.00231	
Calibration I	Due Date:	3	-Aug-22	Corr. Coeff:	0.99975	
Plate or	In,H2O		, X-Axis	I, CFM	IC, Y-Axis	
Plate or	In,H2O		A PARTICIPATION OF THE PARTICI	I, CFM	IC, Y-Axis	
Test #	(in)		n3/min)	(chart)	(corrected)	
1	1.25		1.077	40.2	39.82	
2	1.85		1.310	41.2	40.81	
3	2.64		1.564	42.3	41.90	
4	3.14 4.10		1.706	42.9 43.8	42.49	
5	4.10		1.949	43.0	43.38	
Sampler Calibtat	tion Relationship (Qa on x-axis,	IC on y-ax	is)			
m=	4.1224	b=	35.4103	_	Corr. Coeff= 0.9994	
Samı	pler set point(SSP)	41	CFM	<u>-</u>		
IC = I[Sqrt(Pa/Ps Qstd = standard f IC = corrected ch I = actual chart r m = calibrator Q b = calibrator Q	Now rate nart response esponse Istd slope		lculations m = sampler sli b = sampler int I = chart respoi Tav = average te Pav = average pri	rercept nse emperature		

The copyright of this document is owned by Acuity Sustainability Consulting Limited. It may not be reproduced except with prior written approval from the Company.

Date:

29-Apr-2022







Acuity Sustainability

Consulting Limited
Unit C, 11/F, Ford Glory Plaza, No. 37-39 Wing Hong Street
Cheung Sha Wan, Kowloon, H.K.
Tel.: (852) 2698 6833 Fax.: (852) 2333 1316

HIVOL SAMPLER CALIBRATION DATA SHEET (TSP) Site Information

		DITT	IIII OI MA CIO			
Location:	Fung Kai Liu Yun Sum Memorial School	Site ID:	A10	Date:	17-Ma	y-2022
Serial No:	1049	Model:	TE-5170X	Operator:	Case	y Lau
		Ambie	ent Conditio	on		
Corrected Pr	essure (mm Hg):	760.0	Temperature		299	9.2
		Calibi	ration Orifi	ce		
Model:		_	ΓE-5028A	Slope:	1.03	041
Serial No.:			3702	Intercept:	-0.00	0231
Calibration	Due Date:	3	3-Aug-22	Corr. Coeff:	0.99	975
					l	
	T	T	bration Dat	T		
Plate or	In,H20		a, X-Axis	I, CFM		Y-Axis
Test #	(in)	(m3/min)	(chart)		ected)
1	0.95		0.946	38.6	38.	
2	1.67 2.43		1.254	40.5 42.1	40.	
3	2.43	1.512		42.1	42.	V. 110.000
5	3.87	1.649 1.908		42.9	44.	K000,990.
sampler Calibta	ation Relationship (Qa on x-a	dis, IC on y-a	axis)			
m=	6.3688	b=	32.4377		Corr. Coeff=	0.9992
Sam	npler set point(SSP)	40	CFM	_		
		C	alculations			
Qstd = 1/m[Sqr	t(H2O(Pa/Pstd)(Tstd/Ta))-b]		m = sampler s	lope		
C = I[Sqrt(Pa/P	'std)(Tstd/Ta)]		b = sampler intercept			
	d 61 a waka		I = chart respo			
Qstd = standard C = corrected of	chart response		Tav = average t Pav = average p			
= actual chart	335 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1		rav – average i	oressure		
m = calibrator						
= calibrator (Qstd intercept					
	perature during calibration (d					
	ssure during calibration (mm I	Hg)				
rstd = 298 deg						
Pstd = 760 mm	AND THE PARTY OF THE PARTY.					
	t calculation of sampler flow: qrt(298/Tav)(Pav/760)]					
	à.l					
Checked by:	. (_	Date:	17-Ma	y-2022







Acuity Sustainability Consulting Limited

Unit C, 11/F, Ford Glory Plaza, No. 37-39 Wing Hong Street Cheung Sha Wan, Kowloon, H.K. Tel.: (852) 2698 6833 Fax.: (852) 2333 1316

HIVOL SAMPLER CALIBRATION DATA SHEET (TSP)

Site Information							
Location:	Fanling Government School	Site ID:	A20	Date:	29-Apr-2022		
Serial No:	1050	Model:	TE-5170X	Operator:	Casey Lau		

Ambient Condition Corrected Pressure (mm Hg): 758.4 Temperature (deg K): 303.1 Calibration Orifice

Carroration Offfice							
Model:	TE-5028A	Slope:	1.03041				
Serial No.:	3702	Intercept:	-0.00231				
Calibration Due Date:	3-Aug-22	Corr. Coeff:	0.99975				

Calibration Data IC, Y-Axis Plate or In,H20 Qa, X-Axis I, CFM (m3/min) Test # (corrected) (in) (chart) 0.96 0.944 38.23 1.119 1.35 39.4 39.03 3 2.16 1.415 40.6 40.21 1.775 41.50 4 3.40 41.9 1.932 42.10

4.03 Sampler Calibtation Relationship (Qa on x-axis, IC on y-axis) 3.8671 Corr. Coeff= 0.9992 Sampler set point(SSP) 40 CFM Calculations Qstd = 1/m[Sqrt(H2O(Pa/Pstd)(Tstd/Ta))-b]m = sampler slope IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]b = sampler intercept I = chart response Ostd = standard flow rate Tay = average temperature IC = corrected chart response Pav = average pressure I = actual chart response m = calibrator Qstd slope

$$\begin{split} b &= \text{calibrator Qstd intercept} \\ Ta &= \text{actual temperature during calibration (deg K)} \\ Pa &= \text{actual pressure during calibration (mm Hg)} \\ Tstd &= 298 \text{ deg K} \\ Pstd &= 760 \text{ mm Hg} \\ For subsequent calculation of sampler flow:} \end{split}$$

(1.21*m+b)/[Sqrt(298/Tav)(Pav/760)]

Checked by: _____ Date: _____ 29-Apr-2022







Acuity Sustainability

Consulting Limited
Unit C, 11/F, Ford Glory Plaza, No. 37-39 Wing Hong Street
Cheung Sha Wan, Kowloon, H.K.
Tel.: (852) 2698 6833 Fax.: (852) 2333 1316

	HIVOL SAMPLER	CALIE	BRATION :	DATA SHEE	T (TSP)	
		Site	Information	ı		
Location:	Fanling Government School	Site ID:	A20	Date:	17 - May	-2022
Serial No:	1050	Model:	TE-5170X	Operator:	Casey	Lau
		Ambie	nt Conditio	n		
Corrected Pres	sure (mm Hg):	760.0	Temperature	(deg K):	299	.2
		Calibi	ation Orifi	ce		
Model:			E-5028A	Slope:	1.030	41
Serial No.:			3702	Intercept:	-0.002	231
Calibration Du	e Date:		3-Aug-22	Corr. Coeff:	0.999	975
		•				
		Cali	bration Data	a		
Plate or	In,H2O	Q	a, X-Axis	I, CFM	IC, Y	-Axis
Test #	(in)	(m3/min)	(chart)	(corre	
1	1.12		1.027	36.8	36.7	20000
2	1.98		1.365	40.1	40.0	
3	2.34		1.484	41.3	41.2	
<u>4</u> 5	3.60 4.60		2.080	44.2 46.7	44.1 46.6	
m=	9.2299	b=	27.3456	_	Corr. Coeff=	0.9991
Sample	er set point(SSP)	39	CFM	-		
IC = I[Sqrt(Pa/Psto Qstd = standard fl IC = corrected cha I = actual chart res m = calibrator Qs b = calibrator Qs Ta = actual tempe Pa = actual pressu Tstd = 298 deg K Pstd = 760 mm Hg For subsequent ca	ow rate int response sponse td slope d intercept rature during calibration (d ire during calibration (mm H	eg K)	alculations m = sampler si b = sampler in I = chart respo Tav = average t Pav = average p	tercept nse emperature		
Checked by: _	8.		_	Date:	17-May	-2022







RECALIBRATION DUE DATE:

August 3, 2022

Certificate of Calibration

Calibration Certification Information

Cal. Date: August 3, 2021

Rootsmeter S/N: 438320

Ta: 295

°K

Operator: Jim Tisch

1000

Pa: 750.57

mm Hg

Calibration Model #: TE-5028A

Calibrator S/N: 3702

Run	Vol. Init (m3)			ΔTime (min)	ΔP (mm Hg)	ΔH (in H2O)	
1	1	2	1	1.3170	4.1	1.50	
2	3	4	1	1.0350	6.7	2.50	
3	5	6	1	0.9420	8.0	3.00	
4	7	8	1	0.8650	9.3	3.50	
5	9	10	1	0.6540	16.2	6.00	

Data Tabulation									
Vstd	Qstd	$\sqrt{\Delta H(\frac{Pa}{Pstd})(\frac{Tstd}{Ta})}$		Qa	√∆H(Ta/Pa)				
(m3)	(x-axis)	(y-axis)	Va	(x-axis)	(y-axis)				
0.9922	0.7534	1.2233	0.9945	0.7552	0.7678				
0.9887	0.9553	1.5793	0.9911	0.9576	0.9913				
0.9870	1.0478	1.7300	0.9893	1.0503	1.0859				
0.9853	1.1390	1.8686	0.9876	1.1417	1.1729				
0.9761	1.4925	2.4466	0.9784	1.4960	1.5356				
	m=	1.64554		m=	1.03041				
QSTD	b=	-0.00368	QA	b=	-0.00231				
	r=	0.99975	-	r=	0.99975				

Calculation	ns
Vstd= ΔVol((Pa-ΔP)/Pstd)(Tstd/Ta)	Va= ΔVol((Pa-ΔP)/Pa)
Qstd= Vstd/∆Time	Qa= Va/∆Time
For subsequent flow rat	te calculations:
$Qstd = \frac{1}{m} \left(\sqrt{\Delta H \left(\frac{Pa}{Pstd} \right) \left(\frac{Tstd}{Ta} \right)} \right) - b$	$Qa = 1/m \left(\left(\sqrt{\Delta H \left(Ta/Pa \right)} \right) - b \right)$

	Standard Conditions
Tstd:	298.15 °K
Pstd:	760 mm Hg
•	Key
ΔH: calibrator	manometer reading (in H2O)
ΔP: rootsmete	er manometer reading (mm Hg)
Ta: actual abs	olute temperature (°K)
Pa: actual bar	ometric pressure (mm Hg)
b: intercept	
m: slope	

RECALIBRATION

US EPA recommends annual recalibration per 1998 40 Code of Federal Regulations Part 50 to 51, Appendix B to Part 50, Reference Method for the Determination of Suspended Particulate Matter in the Atmosphere, 9.2.17, page 30.

Fisch Environmental, Inc. 145 South Miami Avenue village of Cleves, OH 45002 www.tisch-env.com

TOLL FREE: (877)263-7610 FAX: (513)467-9009











Website: www.acuityhk.com



Unit C, 11/F, Ford Glory Plaza, Nos. 37-39 Wing Hong Street, Cheung Sha Wan, Kowloon,

Tel. : (852) 2698 6853 Fox.: (852) 2698 9383

Sibata LD-5R K-Factor Verification Test by Total Suspended Particulates HVS Test Report

Verification Test Date: 27-Jun-21 to 1-Jul-21

Next Verification Test Date: 1-Jul-22
Unit-under-Test- Model No. Sibata LD-5R
Unit-under-Test Serial No. 761173
Our Report Refrence No. RPT-21-HVS-0003

Standard Equipment Information								
Verification Equipment Type		Tish HVS						
Vernication Equipment Type		HVS	Calibrator					
Standard Equipment Model No.		TE-517(X	TE-5028					
Equipment serial no.	MFC	1049	1050					
Last Calibration Date		17-Jun 21	24-Sep-20					
Next Calibration Date		17-Aug 21	24-Sep-21					

Verification	Date		Time		K-Factur	Counts/ Minute (R)	Total Counts	Dust Concentration (ug/m3), (C)	
Test No.		Start-tim 2	End-ume	Elapsed ime (in min)	K-Factor (K-C/R)	x-axis	(1C)	اک No.	y axis
1	27/6/2021	125,4.37	1257.37	180.00	0.00119	27.90	2652	R210872/1	33.33
2	27/6/2021	1'.58 44	1261.44	180.00	0.00050	61.70	1539	R210872/2	59.26
3	27/6/2021	1 262.31	1265.31	1°5.00	0.00097	10.00	1983	R210872/3	9.72
4	1/7/2021	1. 65.8 1	1268.84	180.00	0 00093	78.30	2313	R210887/1	73.15
5	1/7/2021	12(9.10	1272.10	180.00	0.00096	14.40	1407	R210887/2	13.89
6	1/7/2021	1272.50	1275.50	1.50.00	0.00084	28.50	1299	R210887/3	24.07
					0.00098				

K-Factor to be inputted in LD-5R (corrected 1 decimal point):

1.0

By Linear Regression of y on x:

slope, mh= 0.9280 intercept,ch= 1.4222

Corr lation Coemicion R= 0.9917

Verification Test Result: Strong Correlation, Results were accepted.


* If the Correlation Coefficient, R is <0.5. Checking and

Re-verification are required

Verified By:

Technical Manager

Date: 20-07-2021

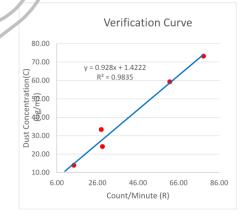











Website: www.acuityhk.com



Unit C. 11/F, Ford Glory Plaza, Nos. 37-39 Wing Hong Street, Cheung Sha Wan, Kowloon.



Sibata LD-5R K-Factor Verification Test by Total Suspended Particulates HVS Test Report

Verification Test Date: 27-Jun-21 to 1-Jul-21

Next Verification Test Date: 1-Jul-22
Unit-under-Test- Model No. Sibata LD-5R
Unit-under-Test Serial No. 761174
Our Report Refrence No. RPT-21-HVS-0004

Standard Equipment Information		
Verification Equipment Type	Tisch's TSF	Tish HVS
Vernication Equipment Type	HVS	Calibrator
Standard Equipment Model No.	TE-517 JX	TE-5028
Equipment serial no.	MFC 104)	1050
Last Calibration Date	17-Jur -21	24-Sep-20
Next Calibration Date	17-Au _{ -21	24-Sep-21

Verification Test No.	ost No. Date			K-Factor	Counts/ Minute (R)	Total Counts	iSP Sample	Dust Concentration (ug/m3), (C)	
rest No.		Start-tim.e	Fd-ume	Elapsed Time (in min)	K-Factor ("=C/R)	x-axis	(IC)	is no.	y axis
1	27/6/2021	17 54 57	1257.37	180.00	0.00098	34.00	6120	R210872/1	33.33
2	27/6/2021	1 258 .44	1261.44	180.00	0.00035	62.33	11220	R210872/2	59.26
3	27/6/2021	262 31	1265.31	150.00	0.00122	8.00	1440	R210872/3	9.72
4	1/7/2021	1265.24	1268.84	180.00	0.00100	73.33	13200	R210887/1	73.15
5	1/7/2021	1259.10	1272.10	180.00	0.00116	12.00	2160	R210887/2	13.89
6	1/7/2021	127∠ 50	1275.50	180.00	0.00103	23.33	4200	R210887/3	24.07
					0.00106				

K-Factor to be inputted in LD-5R (corrected 1 decimal point):

By Linear Regression of y on x:

slope, mh= 0.9476 intercept,ch= 1.9320

*Correlation Coemciant R= 0.9989

Vernication Test Result: Strong Correlation, Results were accepted.


* If the Correlation Coefficient, R is <0.5. Checking and

Re-verification are required

Verified By:

Technical Manager

Date: 20-07-2021

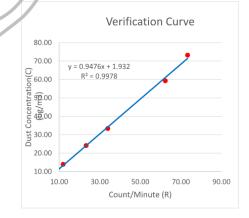





APPENDIX G: THE CERTIFICATION OF LABORATORY CERTIFICATE







Hong Kong Accreditation Service 香港認可處

Certificate of Accreditation

認可證書

This is to certify that 特此證明

ALS TECHNICHEM (HK) PTY LIMITED

11/F, Chung Shun Knitting Centre, 1-3 Wing Yip Street, Kwai Chung, New Territories, Hong Kong 香港新界葵涌永業街1-3號忠信針織中心11樓

is accredited by the Hong Kong Accreditation Service (HKAS) to ISO/IEC 17025:2017 for performing specific laboratory activities as listed in the scope of accreditation within the test category of 獲香港認可處根據ISO/IEC 17025:2017認可 進行戰於認可範圍內下逃測試類別中的指定實驗所活動

Environmental Testing

環境測試

This accreditation to ISO/IEC 17025:2017 demonstrates technical competence for a defined scope and the implementation of a management system relevant to laboratory operation (see joint IAF-ILAC-ISO Communiqué). 此項 ISO/IEC 17025:2017 的認可資格證明此實驗所具備指定範疇內所須的技術能力並

實施一套與實驗所運作相關的營理體系 (見國際認可論項、國際實驗所認可合作組織及國際標準化組織的聯合公報)。

The common seal of HKAS is affixed hereto by the authority of the HKAS Executive 現經香港認可處執行機關授權在此蓋上香港認可處的印章

SHUM Wai-leung, Executive Administrator

執行幹事 沈偉良 Issue Date: 28 February 2020

簽發日期:二零二零年二月二十八日

Registration Number : HOKLAS 066 註冊號碼:

Date of First Registration: 15 September 1995 首次註冊日期:一九九五年九月十五日

This certificate is issued subject to the terms and conditions laid down by HKAS 本館會接賴香港認可處訂立的條款及條件發出

L001934







Hong Kong Accreditation Service 香港認可處

Certificate of Accreditation

認可證書

This is to certify that 特此體明

ACUMEN LABORATORY AND TESTING LIMITED

浩科檢測中心有限公司

Flat/Rm D, 12/F, Ford Glory Plaza, Nos. 37-39 Wing Hong Street, Cheung Sha Wan, Kowloon, Hong Kong

香港九龍長沙灣永康街37-39號福源廣場12樓D室

is accredited by the Hong Kong Accreditation Service (HKAS) to ISO/IEC 17025:2017 for performing specific laboratory activities as listed in the scope of accreditation within the test category of 獲香港認可處根據ISO/IEC 17025:2017認可 進行戰於認可範圍內下逃測試預別中的指定實驗所活動

Environmental Testing

環境測試

This accreditation to ISO/IEC 17025:2017 demonstrates technical competence for a defined scope and the implementation of a management system relevant to laboratory operation (see joint IAF-ILAC-ISO Communiqué).

此项 ISO/IEC 17025:2017 的認可資格證明此實驗所具備指定顧晴內所須的技術能力並 實施一套與實驗所運作相關的管理體系 (見國際認可論增、國際實驗所認可合作組織及國際標準化組織的聯合公報)。

The common seal of HKAS is affixed hereto by the authority of the HKAS Executive 現經香港認可處執行機關授權在此蓋上香港認可處的印章

SHUM Wai-leung, Executive Administrator

執行幹事 沈偉良

Issue Date: 15 November 2021

簽發日期:二零二一年十一月十五日

Registration Number : HOKLAS 241

Date of First Registration: 16 July 2014 首次註冊日期:二零一四年七月十六日

This certificate is issued subject to the terms and conditions laid down by HKAS 本體書房開香港器可盡訂立的維教及條件發出

L002316






APPENDIX H: LOCATION PLAN OF AIR QUALITY MONITORING STATION





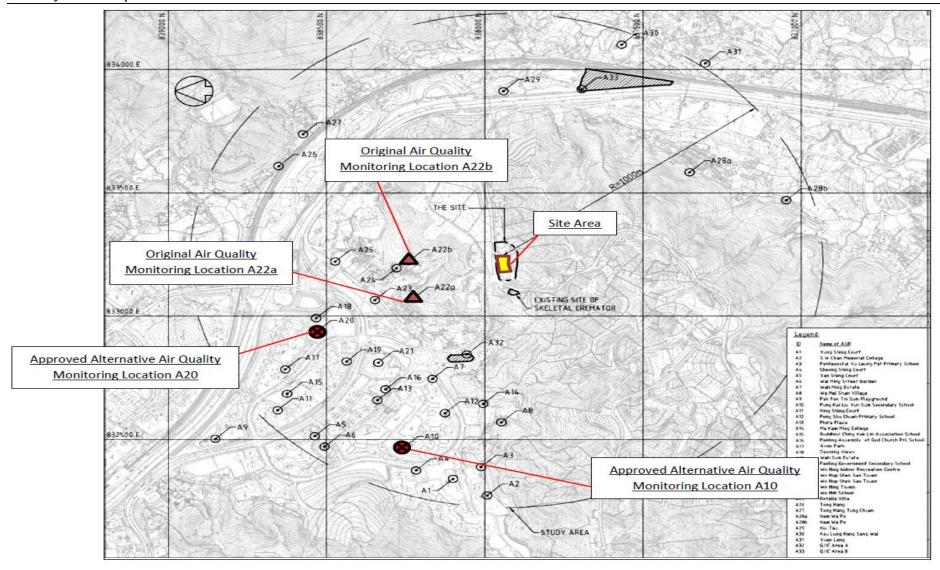





APPENDIX I: AIR QUALITY MONITORING DATA






The Summary of 1-hour TSP Concentration ($\mu g/m^3$) at A10

Date	Weather	Sampling Time (1)	Sampling Time (2)	Sampling Time (3)	Reading (1) μg/m³	Reading (2) μg/m³	Reading (3) μg/m³	Average μg/m³
05/05/2022	Fine	9:09	10:09	11:09	53	56	51	53
11/05/2022	Rainy	9:16	10:16	11:16	33	33	37	34
17/05/2022	Sunny	9:13	10:13	11:13	50	57	52	51
23/05/2022	Cloudy	9:00	10:00	11:00	52	59	58	56
28/05/2022	Cloudy	9:03	10:03	11:03	54	53	51	53

Average 1-hour TSP: 50

Max.: 59 **Min.:** 33

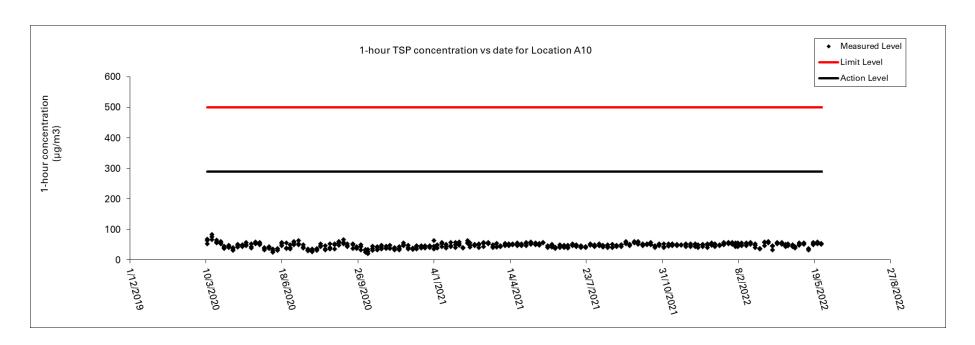






The Summary of 1-hour TSP Concentration ($\mu g/m^3$) at A20

Date	Weather	Sampling Time (1)	Sampling Time (2)	Sampling Time (3)	Reading (1) μg/m³	Reading (2) μg/m³	Reading (3) μg/m³	Average μg/m³
05/05/2022	Fine	9:33	10:33	11:33	56	59	52	56
11/05/2022	Rainy	9:40	10:40	11:40	24	40	38	34
17/05/2022	Sunny	9:35	10:35	11:35	58	56	51	55
23/05/2022	Cloudy	9:30	10:30	11:30	57	59	56	57
28/05/2022	Cloudy	9:28	10:28	11:28	55	53	58	55

Average 1-hour TSP:

51 59

Max.: 59 Min.: 24

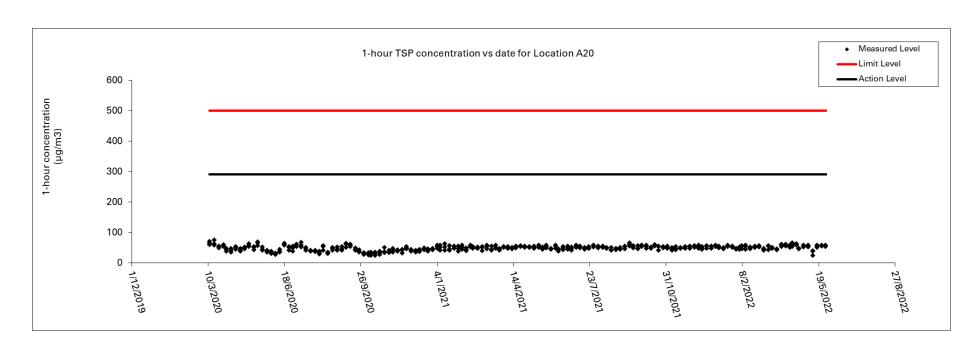






Date of Calibration:	29-Apr-22	Slope =	4.1224
Calibration due date:	12-May-22	Intercept =	35.4103
Date of Calibration:	17-May-22	Slope =	6.3688
Calibration due date:	30-May-22	Intercept =	32.4377

										Calibrati	on due date.	30-141	ay-22	mtercept –	32.43//
Start Date	Weather	E	lapse Tin	1e	Ch	art Readi	ng	Avg Air Temp	Avg Atmospheric Pressure	Flow Rate	Standard Air Volume	Filter W	eight (g)	Particulate weight	Conc.
	Condition	Initial	Final	Actual (min)	Min	Max	Avg	(°C)	(mm Hg)	(m³/min)	(m³)	Initial	Final	(g)	(μg/m³)
05/05/2022	Fine	8794.6	8818.6	1440.0	40	42	41.0	27.8	759.7	1.31	1880	2.7841	2.8025	0.0184	10
11/05/2022	Rainy	8818.6	8842.6	1440.0	38	38	38.0	25.3	755.8	0.57	825	2.8049	2.8062	0.0013	2
17/05/2022	Sunny	8843.2	8867.2	1440.0	38	40	39.0	26.2	760.0	0.85	1227	2.7456	2.7836	0.0380	31
23/05/2022	Cloudy	8867.2	8891.2	1440.0	40	40	40.0	25.1	755.5	1.05	1518	2.7682	2.8266	0.0584	38
28/05/2022	Cloudy	8891.2	8915.2	1440.0	40	41	40.5	31.2	753.9	1.06	1521	2.7118	2.7809	0.0691	45

Min: 2 Max: 45 Avg: 25

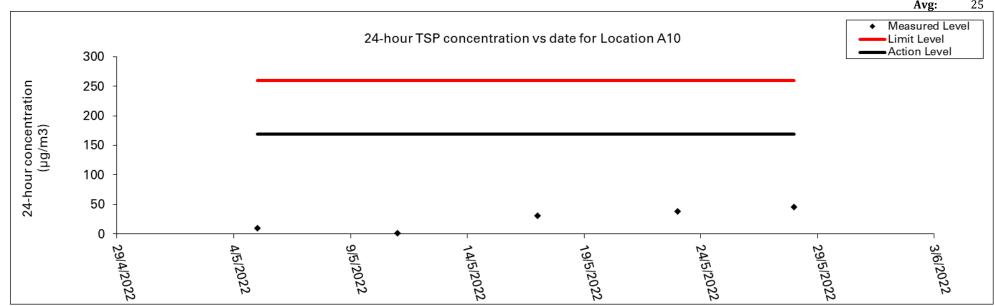



29-Apr-22

12-May-22

Date of Calibration:

Calibration due date:



Slope =


Intercept =

3.8671

34.6576

										Date of	Calibration:	17-M	ay-22	Slope =	9.2299
										Calibrati	on due date:	30-M	ay-22	Intercept =	27.3456
Start Date	Weather Condition	Е	lapse Tim	ie	Ch	ıart Readi	ng	Avg Air Temp	Avg Atmospheric Pressure	Flow Rate	Standard Air Volume	Filter W	eight (g)	Particulate weight	Conc.
	Condition	Initial	Final	Actual (min)	Min	Max	Avg	(°C)	(mm Hg)	(m³/min)	(m³)	Initial	Final	(g)	(μg/m³)
05/05/2022	Fine	9086.4	9110.4	1440.0	39	40	39.5	27.8	759.7	1.20	1729	2.7554	2.7656	0.0102	6
11/05/2022	Rainy	9110.4	9134.4	1440.0	39	39	39.0	25.3	755.8	1.06	1529	2.8001	2.8067	0.0066	4
17/05/2022	Sunny	9134.8	9158.8	1440.0	39	41	40.0	26.2	760.0	1.36	1959	2.7436	2.8265	0.0829	42
23/05/2022	Cloudy	9158.8	9182.8	1440.0	39	39	39.0	25.1	755.5	1.06	1529	2.7430	2.7722	0.0292	19
28/05/2022	Cloudy	9182.8	9206.8	1440.0	39	40	39.5	31.2	753.9	1.07	1536	2.7435	2.7985	0.0550	36

Min: 4 Max: 42 Avg: 21

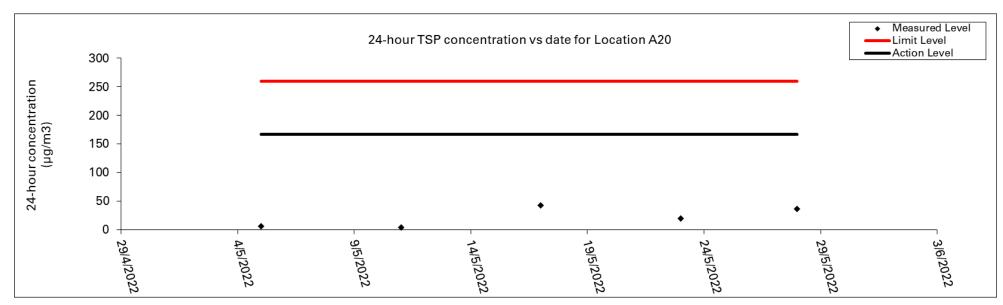







Wind direction data for 05, 11, 17, 23 and 28 May 2022

A. 05/05/2022:

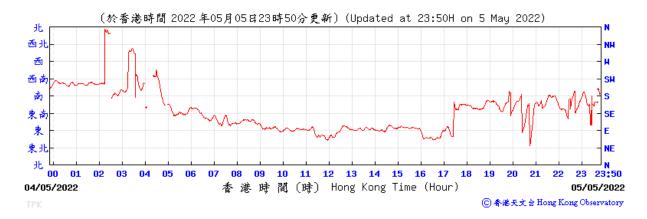


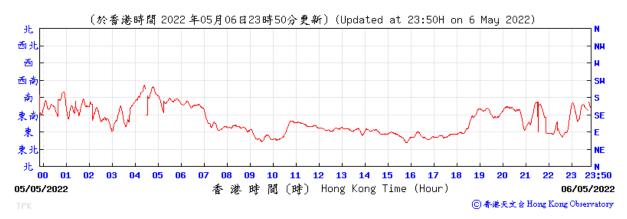






B. 11/05/2022:

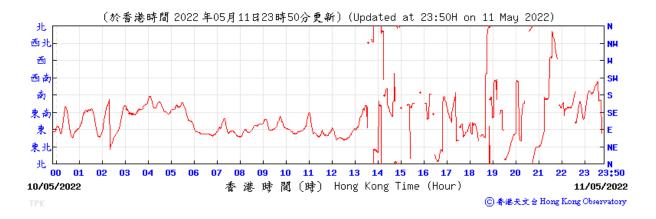

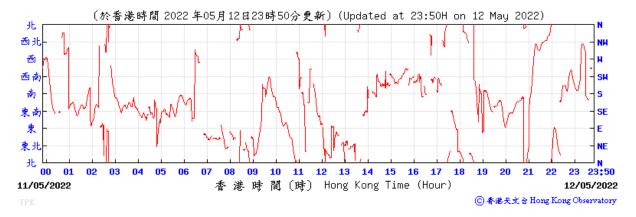






C. 17/05/2022:




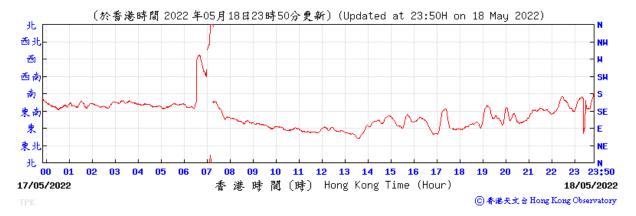






D. 23/05/2022:

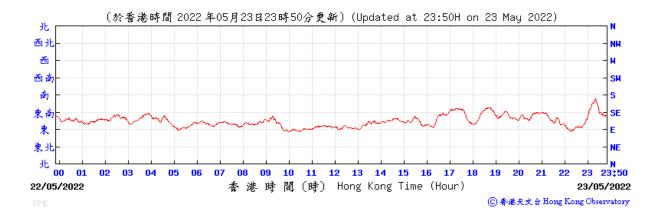

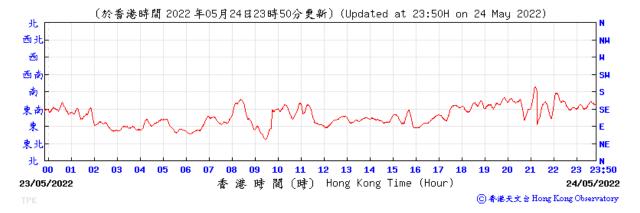






E. 28/05/2022:



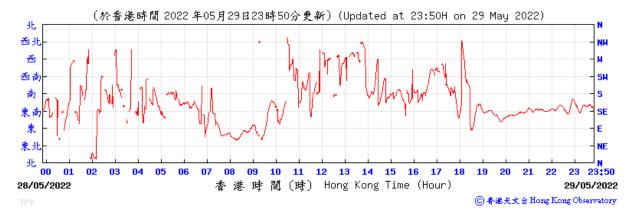





Wind speed data for 05, 11, 17, 23 and 28 May 2022

A. 05/05/2022:









B. 11/05/2022:









C. 17/05/2022:










D. 23/05/2022:



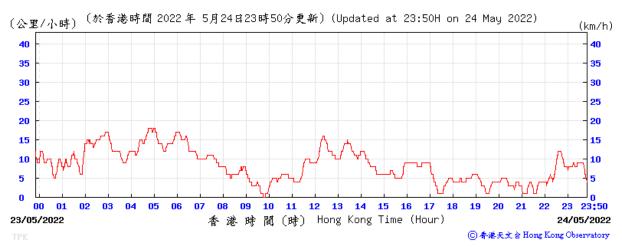






E. 28/05/2022



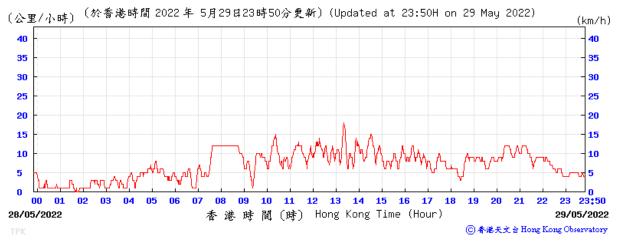





APPENDIX J: WASTE FLOW TABLE





		Actual Qua	ntities of Ine	rt C&D Mateı	rials Generat	ed Monthly	Actual	Quantities of	C&D Wastes	Generated M	Ionthly
Reporting Month	Total Quantity Generated	Hard Rock and Large Broken Concrete	Reused in the Contract	Reused in other Projects	Disposed as Public Fill	Imported Fill	Metals	Paper / cardboard packaging	Plastics (see Note)	Chemical Waste	Others, e.g. general refuse
	(in ,000kg)	(in ,000kg)	(in ,000kg)	(in ,000kg)	(in ,000kg)	(in ,000kg)	(in,000kg)	(in ,000kg)	(in ,000kg)	(in ,000kg)	(in ,000kg)
March 2020	1.35	0	0	0	1.35	0	0	0	0	0	0
April 2020	1472.9	0	614.00	0	855.61	0	0	0	0	0	3.29
May 2020	213.75	0	0	0	205.94	0	0	0	0	0	7.81
June 2020	1.86	0	0	0	0	0	0	0	0	0	1.86
July 2020	4.95	0	0	0	0	0	0	0	0	0	4.95
August 2020	308.99	0	0	0	306.38	0	0	0	0	0	2.61
September 2020	31.11	0	0	0	22.38	0	0	0	0	0	8.73
October 2020	18.08	0	0	0	14.33	0	0	0	0	0	3.75
November 2020	1.42	0	0	0	0	0	0	0	0	0	1.42
December 2020	16.99	0	0	0	14.88	0	0	0	0	0	2.11





	•	Actual Qua	ntities of Ine	rt C&D Mate	rials Generat	ed Monthly	Actual	Quantities of	C&D Wastes	Generated M	Ionthly
Reporting Month	Total Quantity Generated	Hard Rock and Large Broken Concrete	Reused in the Contract	Reused in other Projects	Disposed as Public Fill	Imported Fill	Metals	Paper / cardboard packaging	Plastics (see Note)	Chemical Waste	Others, e.g. general refuse
	(in ,000kg)	(in ,000kg)	(in ,000kg)	(in ,000kg)	(in ,000kg)	(in ,000kg)	(in,000kg)	(in ,000kg)	(in ,000kg)	(in ,000kg)	(in ,000kg)
January 2021	25.87	0	0	0	22.12	0	0	0	0	0	3.75
February 2021	2.00	0	0	0	0	0	0	0	0	0	2.00
March 2021	3.79	0	0	0	0	0	0	0	0	0	3.79
April 2021	7.40	0	0	0	0	0	0	0	0	0	7.40
May 2021	8.30	0	0	0	0	0	0	0	0	0	8.30
June 2021	11.12	0	0	0	0	0	0	0	0	0	11.12
July 2021	19.70	0	0	0	7.73	0	0	0	0	0	11.97
August 2021	20.29	0	0	0	14.95	0	0	0	0	0	5.34
September 2021	219.20	0	0	0	214.71	0	0	0	0	0	4.49
October 2021	23.59	0	0	0	14.62	0	0	0	0	0	8.97
November 2021	59.40	0	0	0	52.88	0	0	0	0	0	6.52
December 2021	14.85	0	0	0	0	0	0	0	0	0	14.85





		Actual Qua	ntities of Ine	rt C&D Matei	ials Generat	ed Monthly	Actual	Quantities of	f C&D Wastes	Generated M	Ionthly
Reporting Month	Total Quantity Generated	Hard Rock and Large Broken Concrete	Reused in the Contract	Reused in other Projects	Disposed as Public Fill	Imported Fill	Metals	Paper / cardboard packaging	Plastics (see Note)	Chemical Waste	Others, e.g. general refuse
	(in ,000kg)	(in ,000kg)	(in ,000kg)	(in ,000kg)	(in ,000kg)	(in ,000kg)	(in ,000kg)	(in ,000kg)	(in ,000kg)	(in ,000kg)	(in ,000kg)
January 2022	64.95	0	0	0	54.69	0	0	0	0	0	10.26
February 2022	6.09	0	0	0	0	0	0	0	0	0	6.09
March 2022	13.87	0	0	0	0	0	0	0	0	0	13.87
April 2022	6.08	0	0	0	0	0	0	0	0	0	6.08
May 2022	82.71	0	0	0	56.56	0	0	0	0	0	26.15

Remarks: The major excavation works were conducted in April and May 2020, approximately 1675.55 tonnes of inert excavated materials were generated. 614 tonnes of excavated materials were stored in the material storage area for the subsequent backfilling. Due the limited space and the construction of basement and other substructure works, the remaining 1061.55 tonnes of excavated material were delivered to public fill reception facilities. Some minor excavation works may be conducted in the later work processes.





Waste to Landfill (May 2022)	:
------------------------------	---

Facility	Date of transaction	Vehicle No.	Account No.	Chit No.	Time-in	Time-out	Waste depth (meter)	Weight- in (tonne)	Weight- out (tonne)	Net weight (tonne)
NENT	06/05/22	LA5*81	7032841	24458052	8:48	9:16	1.18	18.12	15.8	2.32
NENT	06/05/22	KP2*32	7032841	24458051	14:00	14:20	1.12	17.83	16.48	1.35
NENT	06/05/22	KP2*32	7032841	24458055	15:38	16:02	1	18.45	16.45	2
NENT	11/05/22	SD5*96	7032841	24458056	9:38	10:00	1.36	19.6	15.96	3.64
NENT	11/05/22	SD5*96	7032841	24458057	11:11	11:44	1.27	18.69	15.91	2.78
NENT	14/05/22	SD5*96	7032841	24458058	14:14	14:56	1.43	18.93	15.92	3.01
NENT	14/05/22	SD5*96	7032841	24458059	15:59	16:27	1.11	20.75	15.91	4.84
NENT	16/05/22	LA5*81	7032841	24458061	8:51	9:19	0.9	17.83	15.76	2.07
NENT	23/05/22	LA5*81	7032841	24458062	9:14	9:34	1.07	18.26	15.92	2.34
NENT	31/05/22	NP7*6	7032841	24458063	10:53	11:12	0.97	17.02	15.22	1.8
								Grand	Total:	26.15


Waste to Public Fill (May 2022):


Facility	Date of transaction	Vehicle No.	Account No.	Chit No.	Time-in	Time-out	Waste depth (meter)	Weight- in (tonne)	Weight- out (tonne)	Net weight (tonne)
TM38FB	05/05/22	SD5*96	7032841	24458047	9:21	9:30	0	23.93	15.76	8.17
TM38FB	05/05/22	SD5*96	7032841	24458048	11:04	11:12	0	23.68	15.72	7.96
TM38FB	05/05/22	SD5*96	7032841	24458049	14:10	14:25	0	23.77	15.68	8.09
TM38FB	06/05/22	SD5*96	7032841	24458050	13:15	13:23	0	23.92	15.82	8.1
TM38FB	06/05/22	NJ2*68	7032841	24458053	14:50	15:01	0	23.55	15.68	7.87
TM38FB	06/05/22	SD5*96	7032841	24458054	15:04	15:13	0	24.04	15.78	8.26
TM38FB	14/05/22	SD5*96	7032841	24458060	17:52	18:01	0	24.01	15.9	8.11
								Grand	Total:	56.56

The copyright of this document is owned by Acuity Sustainability Consulting Limited. It may not be reproduced except with prior written approval from the Company.





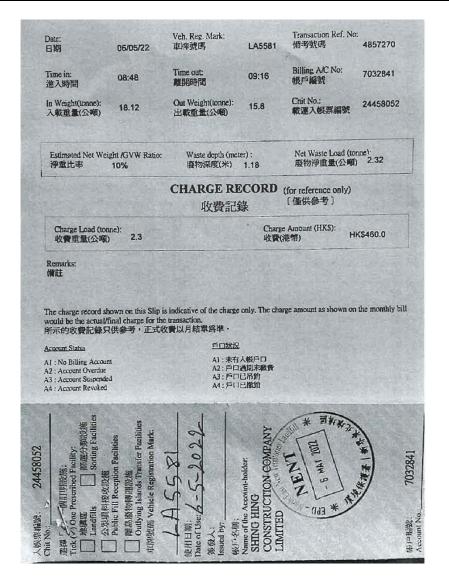

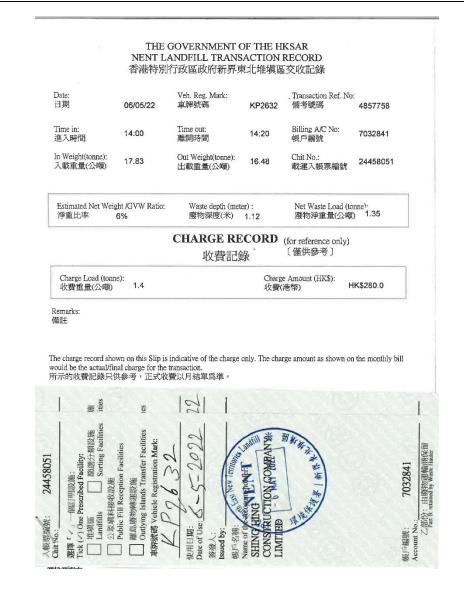





THE GOVERNMENT OF THE HKSAR NENT LANDFILL TRANSACTION RECORD 香港特別行政區政府新界東北堆填區交收記錄 Veh. Reg. Mark: Transaction Ref. No: 日期 車牌號碼 備考號碼 06/05/22 KP2632 4857909 Time in: Time out: Billing A/C No: 15:38 7032841 16:02 進入時間 離開時間 帳戶編號 In Weight(tonne): Out Weight(tonne): 18.45 16.45 24458055 入載重量(公噸) 出載重量(公噸) 載運入帳票編號 Estimated Net Weight /GVW Ratio: Waste depth (meter): Net Waste Load (tonne). 淨重比率 廢物淨重量(公噸) 廢物深度(米) 1 CHARGE RECORD (for reference only) [僅供參考] 收費記錄 Charge Load (tonne): Charge Amount (HK\$): HK\$400.0 收費重量(公噸) 收費(港幣) Remarks: 備註 The charge record shown on this Slip is indicative of the charge only. The charge amount as shown on the monthly bill would be the actual/final charge for the transaction. 所示的收費記錄只供參考,正式收費以月結單為準。 d Name of the Account-holder: SHING HING CONSTRUCTION COMPANY LIMITED 24458055 7032841 MAX 田 離島廢物 運輸商副本

THE GOVERNMENT OF THE HKSAR NENT LANDFILL TRANSACTION RECORD 香港特別行政區政府新界東北堆填區交收記錄

Date: 日期	11/05/22	Veh. Reg. Mark: 車牌號碼	SD5196	Transaction Ref. No: 備考號碼	4861221
Time in: 進入時間	09:38	Time out: 離開時間	10:00	Billing A/C No: 帳戶編號	7032841
In Weight(tonne): 入載重量(公噸)	19.6	Out Weight(tonne): 出載重量(公噸)	15.96	Chit No.; 載運入帳票編號	24458056
Estimated Net Weig 淨重比率	ght /GVW Ratio: 16%	Waste depth (mete 廢物深度(米)	er): 1.36	Net Waste Load (tor 廢物淨重量(公噸)	

CHARGE RECORD (for reference only)

收費記錄

〔僅供參考〕

Charge Load (tonne): Charge Amount (HK\$): HK\$720.0 收費重量(公噸) 收費(港幣)

Remarks: 備註

Account Status

A1: No Billing Account

The charge record shown on this Slip is indicative of the charge only. The charge amount as shown on the monthly bill would be the actual/final charge for the transaction.

Al:未有入帳戶口

所示的收費記錄只供參考,正式收費以月結單爲準。

A2 A3	A1: Account Overdue A3: Account Suspended A4: Account Revoked				43: 年刊 42: 戶口已 64: 日 44: 日 44				
入艇票編號: 24458056 Chit No.:	選獎 「シュー高音用影能: Tok (イ) One Prescribed Facility: 推奨區 「Andfills Soring Sacilities 「Andfills Soring Sacilities 「Ac来源本技術仏影能		使用日期: -05_2822	26 26 26 26 27 27 27 27 27 27 27 27 27 27 27 27 27	Name of the Account-holder: SHING HING CONSTRUCTION COMPANY LIMITED	* Walling Sandill	是有一个人,但是一个人,	版戶編號: 7032841	乙部份: 由發物運輸商保留 Part B: retained by Waste Hauler





THE GOVERNMENT OF THE HKSAR NENT LANDFILL TRANSACTION RECORD 香港特別行政區政府新界東北堆填區交收記錄

Date: 日期	11/05/22	Veh. Reg. Mark: 車牌號碼	SD5196	Transaction Ref. No: 備考號碼	4861373
Time in: 進入時間	11:11	Time out: 離開時間	11:44	Billing A/C No: 帳戶編號	7032841
In Weight(tonne): 入載重量(公噸)	18.69	Out Weight(tonne): 出載重量(公噸)	15.91	Chit No.: 載運入帳票編號	24458057

Estimated Net Weight /GVW Ratio: Waste depth (meter): Net Waste Load (tonne). 淨重比率 廢物淨重量(公噸) 2.78 12% 廢物深度(米) 1.27

CHARGE RECORD (for reference only)

收費記錄

[僅供參考]

Charge Load (tonne): Charge Amount (HK\$): HK\$560.0 收費重量(公噸) 收費(港幣)


Remarks: 備註

運輸商副本

The charge record shown on this Slip is indicative of the charge only. The charge amount as shown on the monthly bill would be the actual/final charge for the transaction. 所示的收費記錄只供參考,正式收費以月結單爲準。





Enquiry phone: 26746505

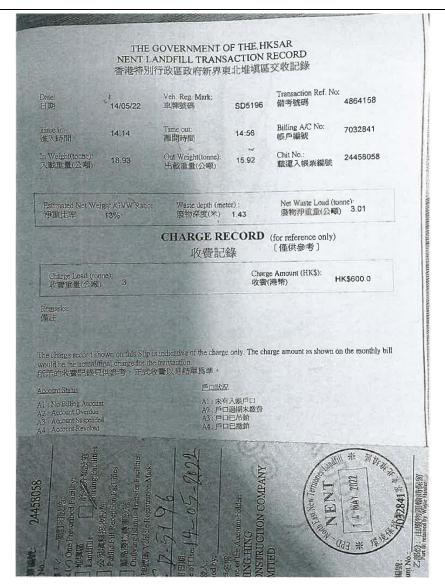





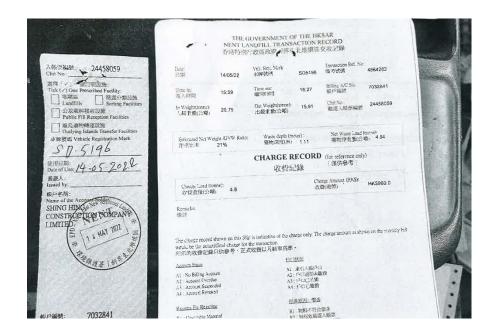

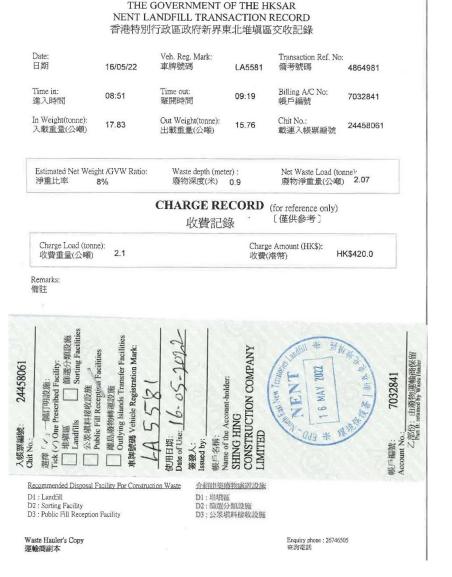



收費(港幣)



HK\$360.0

THE GOVERNMENT OF THE HKSAR NENT LANDFILL TRANSACTION RECORD 香港特別行政區政府新界東北堆填區交收記錄

Date: Veh. Reg. Mark: Transaction Ref. No: 日期 23/05/22 車牌號碼 LA5581 備考號碼 4871073 Time in: Billing A/C No: Time out: 09:14 09:34 7032841 進入時間 離開時間 帳戶編號 In Weight(tonne): Out Weight(tonne): Chit No.: 24458062 18.26 入載重量(公噸) 出載重量(公噸) 載運入帳票編號

Waste depth (meter): Estimated Net Weight /GVW Ratio: Net Waste Load (tonne). 廢物淨重量(公順) 2.34 淨重比率 廢物深度(米) 1.07

CHARGE RECORD (for reference only) [僅供參考]

收費記錄

Charge Amount (HK\$):

HK\$460.0 收費(港幣)

Remarks:

Charge Load (tonne):

收費重量(公噸)

The charge record shown on this Slip is indicative of the charge only. The charge amount as shown on the monthly bill would be the actual/final charge for the transaction. 所示的收費記錄只供參考,正式收費以月結單爲準。

戶口狀況 A1: No Billing Account Al: 未有入帳戶口 A2 : Account Overdue A2: 戶口過期未繳費 A3: 戶口已吊鎖 A3: Account Suspended A4: Account Revoked A4: 戶口已撤銷





The charge record shown on this Slip is indicative of the charge only. The charge amount as shown on the monthly bill

The copyright of this document is owned by Acuity Sustainability Consulting Limited. It may not be reproduced except with prior written approval from the Company.

Charge Load (tonne):


would be the actual/final charge for the transaction.

收費重量(公噸)

Remarks: 備註






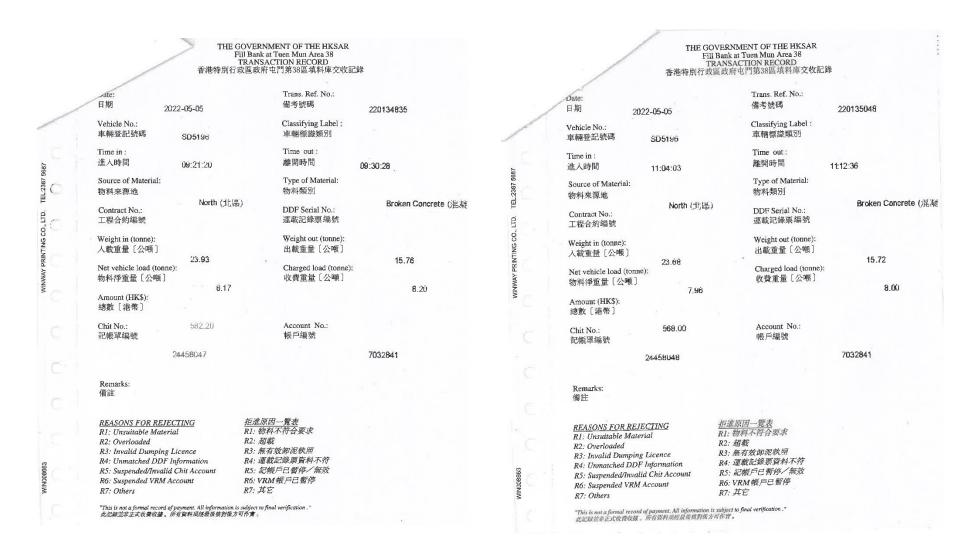








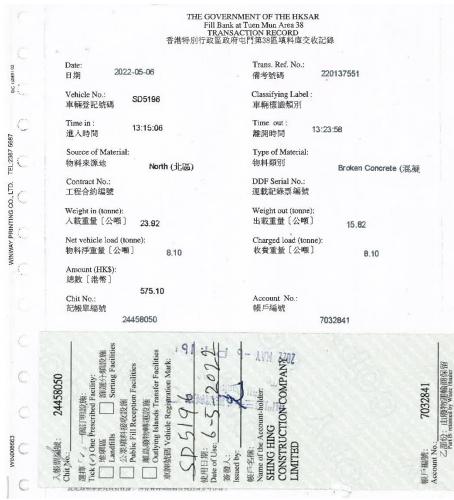






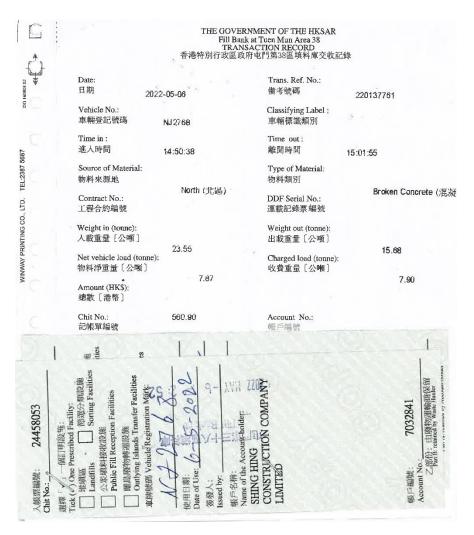

人般票編號: 24458054 thit No.: 電響「✓」一個計明設施: Tick (✓) One Prescribed Eacility:	Fi T	OVERNMENT OF THE HKSAR II Bank at Tuen Mun Area 38 RANSACTION RECORD (區政府屯門第38區填料庫交收記	- 公錄
一 推塡區 一 篩選分類設施	1	Trans. Ref. No.:	
Landfills Sorting Facilities	-06	備考號碼	220137800
□ 公眾填料接收設施	Loc		220137800
Public Fill Reception Facilities		Classifying Label:	
能島廢物轉運設施 San Facilities	5196	車輛標識類別	
Outlying Islands Transfer Facilities		Time out:	
車牌號碼 Vehicle Registration Mark:	14:50	離開時間	15:13:48
CD 196	11.000		10.10.40
00311		Type of Material:	
用日期: / 0 2 2	The state of	物料類別	
Date of Use:	North (北陽)	DDF Serial No.:	Broken Concrete (混凝
簽發人:		運載記錄票編號	
ssued by:			
帳戶名稱:		Weight out (tonne):	
Name of the Account-holder:	2	出載重量〔公噸〕	
SHING HING	.04	Charged load (tonne):	15.78
CONSTRUCTION COMPANY		收費重量〔公噸〕	
LIMITED	8,26	MAZZ (A M)	8.30
			5.50
C E			
70 20-	3.30	Account No.:	
0 8 - 37	3.30	帳戶編號	
زب		1507 976 376	
9	14		7032841
0			
帳戶編號: 7032841			
Account No.:	-	<u>拒進原因一覽表</u>	
乙部份:由廢物運輸商保留 Part B: retained by Waste Hauler		R1: 物料不符合要求 R2: 超載	
R3: Invalid Dumping Licen	ar u	K2: 超戦 R3: 無有效卸泥執照	
R4: Unmatched DDF Infor		R4: 運載記錄票資料不符	2
R5: Suspended/Invalid Chit		R5: 記帳戶已暫停/無效	
R6: Suspended VRM Accou		R6: VRM帳戶已暫停	
R7: Others		R7: 其它	
"This is not a formal record of payme	mt All information in	whice to final verification "	
此記録並非正式收費收據。所有資	and the first and the state of	Monte	





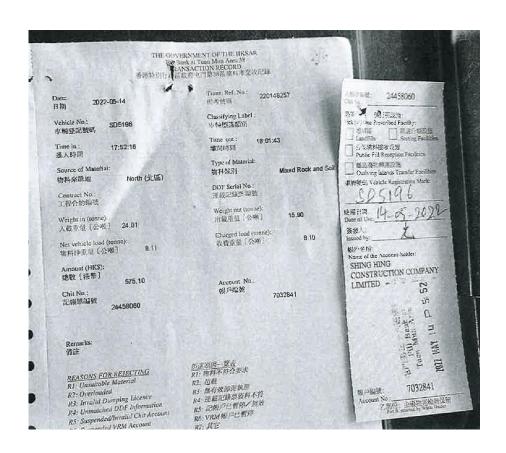

Contract No. AL G513 Expansion of Wo Hop Shek Crematorium Monthly EM&A Report No.27





APPENDIX K: SITE INSPECTION PROFORMA





Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

Contract no. AL G513 Expansion of Wo Hop Shek Crematorium

WEEKLY ENVIRONMENTAL INSPECTION CHECKLIST

Inspe	ction Date: 3/5/2022	Inspected by	/:	ET:	John	Kung	AR	F-L. Hung
Inspec	ction Time: 09-30		Contra	ictor:	M.Y.	Wong)	IEC:	
Weatl	ner					J		
Condi	tion Sunny	□ Overcast	□ Drizzle		☐ Raii	n	☐ Storm	☐ Hazy
Temp	erature 23.7 °C		Humidity		☐ Hig	h	✓ Moder	ate
Wind	□ Calm □ Light	□ Breeze	☐ Strong					
	Environmental Mitigation Measures			N/A*	N/O*	Yes*	No*	Photo/Remarks
1.00	Air (Construction Phase)							- AND
1.01	Vehicle washing facilities (including a high p	oressure water jet) were	provided at	П	П			
	every discernible or designated vehicle exit po	oint.				<u> </u>		
1.02	Road between the washing facilities and the	e exit point is paved w	rith concrete,	П	П	\square		
	bituminous or hardcore material.					7_		
	Every main haul road is paved with concret-	e, bituminous hardcore	materials or			/		
1.03	metal plates, and kept clear of dusty materials.	Or unpaved haul roads	and areas are			P		
	sprayed with water to keep the entire road sur	face wet.						355-10
	Stockpile of dusty material including demolish	ned items is either:						
	a) covered entirely by impervious sheeting, o	r		_			_	
1.04	b) placed in an area sheltered on the top and t	he three sides, or				Ø		
	c) sprayed with water or a dust suppression of	chemical so as to mainta	ain the entire					
	surface wet.							
	Exposed earth is properly treated by compaction	n, hydroseeding, vegeta	tion planting	_	_	_	_	
1.05	or seating with latex, vinyl, bitumen within s	ix months after the last	construction					6
	activity on the site or part of the site where the	exposed earth lies.						
1.06	Water is sprayed to all dusty materials before	oading or transfer opera	ation.					
1.07	Any debris is covered entirely by impervious		in a debris					
	collection area sheltered on the top and the thr	ee sides.						
1.08	Water is sprayed to debris before it is dumped	into a chute.				Ø		
	White Control day and in the	-:1 1 .:AL	4				-	
1.09	Vehicles for transporting dusty materials/sp					Ø		
	similar material. The cover extends over the ed					/		
1.10	Water is sprayed immediately to the working a vegetation or the removal of boulders, pole,							
1.10		pinars before, during a	and after the	П	Ц			
	Workers at all levels are co-operative to avoid	dust generation and dis-	pergion to the					
1.11	surrounding environment.	aust generation and disp	Assort to the			Ó		
2.00								
2.00	Noise (Construction Phase)							



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks		
2.01	Only well-maintained plant is operated on site and the plant should be regularly							
	serviced during the construction works							
2.02	Plant used intermittently is turned off or throttled down when not in active use.			P				
2.03	Plant that emits noise strongly in one direction is oriented to face away from NSRs.			Ø				
2.04	Silencers, mufflers and enclosures for plant are applied where possible and maintained adequately throughout the works			9				
2.05	Where possible, mobile plant is sited away from NSRs			P				
2.06	PME is well maintained and used properly on site to minimise any excessive noise generated.			Ø				
2.07	Stockpiles of excavated materials and other structures such as site buildings should be used effectively to screen noise from the works.			otag				
3.00	Land Contamination (Construction Phase)							
	N/A to the Phase III development							
4.00	Waste Management (Construction Phase)	15						
4.01	The necessary waste disposal permits from the appropriate authorities are obtained, in accordance with the Waste Disposal Ordinance (Cap. 354), Waste Disposal (Chemical Waste) (General) Regulation and the Land (Miscellaneous Provision) Ordinance (Cap. 28).			Ø				
4.02	A billing account with EPD for disposal of construction waste is obtained.			Д				
4.03	A Waste Management Plan (WMP), incorporated in an Environmental Management Plan (EMP) is prepared and submitted to the Engineer/Supervising Officer for approval. Reference is made to Environment, Transport and Works Bureau Technical Circular (Works) (ETWB TCW) 19/2005.			Ø				
4.04	An approved person to be responsible for good site practice is nominated, including arrangements for collection and effective disposal to an appropriate facility of all wastes generated at the site.			Ø				
4.05	Is authorised or licensed waste hauler used to collect specific category of waste?			Ø				
4.06	A trip-ticket system is included as one of the contractual requirements and implemented by the Environmental Team to monitor the disposal of C&D and solid wastes at public filling facilities and landfills, and to control fly tipping. Reference is made to ETWB TCW No. 31/2004.			Ø				
4.07	Training of site personnel in proper waste management and chemical waste handling procedures.			ď				



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks	
4.08	Is routine cleaning and maintenance programme for drainage systems, sumps and			Q′			
	oil interceptors conducted?			/		18	
4.09	Are sufficient waste disposal points and regular collection for disposal provided?			\(\righta\)			
	Are appropriate measures to minimise windblown litter and dust during)			
4.10	transportation of waste, such as covering trucks or transporting wastes in enclosed			\square			
	containers adopted?			,			
4.11	Is recording system for the amount of wastes generated, recycled and disposed of						
4.11	(including the disposal sites) implemented?		Ш		ш		
	Segregation and storage of different types of waste in different containers, skips			_/			
4.12	or stockpiles to enhance reuse or recycling of materials and their proper disposal.		Ш	\square	Ш		
	Encourage collection of aluminium cans, plastic bottles and packaging material						
	(e.g. carton boxes) and office paper by individual collectors. Separately labelled						
4.13				Ø			
	bins are provided to help segregate this waste from other general refuse generated						
	by the work force.						
4.14	Are C&D materials reused when possible to reduce the amount of C&D			M	П		
4.74	material/waste?						
	Are wood, steel and other metals separated for reuse and / or recycling prior to						
4.15	disposal of C&D waste to minimise the quantity of waste to be disposed of to			Ø			
	landfill?						
	Minimise the potential for damage or contamination of construction material by						
4.16	having proper storage and site practices.	Ш	П			Ш	
	Plan and stock construction materials carefully to minimise the amount of surplus						
4.17	materials.			\Box			
		-		_/_			
4.10	Rock and soil generated from excavation are reused for site formation and						
4.18	excavated material from foundation work reused for landscaping as far as		Ш		ш		
	practicable to avoid disposal off-site.				***		
4.19	Is reuse of the public fill and C&D waste practiced on site as far as practicable?			P			
	The handling of C&D materials is governed by WBTC No. 2/93. Inert C&D						
	material (public fill) is directed to an approved public filling area or reclamation						
4.20	site, where it has the benefit of offsetting the need for removal of materials from			Ø			
	borrow areas for reclamation purposes and helps to reduce the pressure on landfill						
	sites.						
	Are individuals or companies who deliver public fill to public filling areas						
4.21	obtained dumping licences?			Ø			
	commed damping neciecs.			(



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
4.22	Are careful design, planning and good site management adopted to minimise overordering and generation of waste materials such as concrete, mortar and cement grouts? The design of formwork maximise the use of standard wooden or metal panels so that high reuse levels can be achieved. Alternatives such as steel formwork, plastic fencing and reusable site office structures are considered			P		
	to increase the potential for reuse and minimize C&D waste generation.					
4.23	The contractor uses as much as possible of the C&D material on-site. Proper segregation of waste types on site will increase the feasibility of certain components of the waste stream by recycling contractors.			Ø		
4.24	General refuse is stored in enclosed bins or compaction units separate from C&D and chemical wastes. A reputable waste collector is employed by the Contractor to remove general refuse from the site, separately from C&D and chemical wastes, on a daily or every second day basis to minimise odour, pest and litter impacts.			7		
	Chemical Waste					
4.25	Contractor registers with the EPD as chemical waste producer if any chemical waste is generated					
4.26	All the chemical waste is handled according to the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes. The chemical waste is stored and collected by an approved contractor for disposal at a licensed facility in accordance with the Waste Disposal (Chemical Waste) (General) Regulation.			9		
4.27	Principles of reuse and recycle chemical waste on site as far as practicable is adopted by the contractor.			6		
4.28	Are unused chemicals or those with remaining functional capacity reused as far as practicable?			Ø		
4.29	Disposal of chemical waste via a facility licensed to receive chemical waste, such as the Chemical Waste Treatment Facility at Tsing Yi, which offers a chemical waste collection service and can supply the necessary storage containers or a waste recycling plant approved by EPD.			9		
5.00	Landscape and Visual (Construction Phase)					
5.01	Do site offices have olive green roof and façade coating or colour that matche with existing environment?			d		
5.02	Are site offices and the construction yard decommissioned after construction?			Ø		
5.03	The height of site offices, including the rooftop does not exceed 10m, except building services equipment such as antennas, which exceeds 10 m but is coated in black.			P		



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
5.04	Is site hoarding with 2.4m height and colour in harmony with the surrounding environment erected along the site boundary until the completion of relevant construction phases?	Ø				Site handle has
5.05	Are construction plants and building materials orderly and carefully stored to appear neat and avoid visibility from outside where practical?			K		
5.06	Are excess materials removed from site as soon as practical?			d		
5.07	Are all construction plants removed from site upon completion of construction works?	Ø				No planting work
5.08	Are construction lights oriented away from the viewing location of VSRs?			Þ		
5.09	Are all lightings facing sensitive receiver installed with frosted diffusers and reflective covers?			Ø		
5.10	Trees that require removal are transplanted on site if practical. If not practical, these trees will be transplanted in locations within the vicinity as approved by the Architect.			Ø		
5.11	Planting works are carried out under the supervision of a specialist landscape specialist.			Ø		
5.12	The rooftop of the cremation plant room is planted with lawn.	Ø				planted
5.13	New trees, shrubs and groundcover are carefully selected and designed to homogenize with the environment.	Ø				No planting mork
5.14	No tree is transplanted or felled without prior approval by relevant Government departments.			Ø		
5.15	All trees that are marked for retention are fenced off with a 1.2m high fence around the dripline of trees or larger area as far as feasible.	P				All the plently work was completed
5.16	Transplant preparation works are carried out as soon as possible after the commencement of construction. Over-pruning such as hard pruning of tree crown, pollarding or topping are avoided. Rootball and crown pruning are carried out over at least 3 months.			P		
5.17	Existing shrub and ground cover planting areas that will not be removed are maintained in good condition and enhanced if practical.			Ø		
5.18	The chimney has been designed to have sculptural outlook and articulated. It is kept in proportion with the rest of the building.			Ø		
5.19	The chimney stack is designed to locate at the least conspicuous location of the site to VSRs.			6		



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
5.20	Bi-weekly checking would be performed on the nine Terminalia mantaly trees within and outside the works area of the Project, or otherwise if the transplantations are not carried out according to the plan.			Ø		
5.21	Are silting traps installed to minimize silting to streams?			Ø		
5.22	Is the tree compensation to tree loss ratio at least 1:1 in term of quantity? About 100 trees will be planted to compensate for the loss of 54 trees. 100 trees will be planted on site and others, in locations within the vicinity approved by the Architect	Ø				No planting much
5.23	Is amenity planting for open spaces included in the Project?	Ø				No planting work
5.24	Is screen planting such as planting a roll of trees along the site boundary butting Kiu Tau Road carried out?	Ø				No plenting work
5.25	Woodland mix, comprising of tree seedlings and shrubs, are planted within the Wo Hop Shek Cemetery to enhance the ecological value and compensatory of tree loss.	Ø				No plently work
5.26	Is the 10m height headroom cremation plant room half-sunken to reduce the visual impact to pedestrians?			P		
6.00	Water Quality (Construction Phase)					
6.01	Wastewater is properly treated to meet the discharge standards set out in the relevant Water Pollution Control Ordinance (WPCO) discharge licence. No direct discharge of site runoff into the two streams is allowed.			Ø		
6.02	Perimeter channels are provided to intercept storm runoff from outside the site. The channels are constructed in advance of site formation works and earthworks.			P		
6.03	Sand/silt removal facilities such as sand traps, silt traps and sediment basins are provided to remove sand/silt particles from runoff to meet the requirements of the Technical Memorandum standard under the WPCO.			ø		
6.04	Works are carefully programmed to minimise soil excavation works during rainy seasons.	Ø				No execution work
6.05	Exposed soil surfaces are protected by paving as soon as possible to reduce the potential of soil erosion.	Ø				No Example nout
6.06	Temporary access roads are protected by crushed gravel and exposed slope surfaces are protected when rainstorms are likely to occur.			Ø		
6.07	Trench excavation is avoided in the wet season as far as practicable, and if necessary, these trenches are excavated and backfilled in short sections.	Ø				No example nork
6.08	Open stockpiles of construction materials on site are covered with tarpaulin or similar fabric during rainstorms.			Ø		



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
6.09	Sand and silt in the wash water from the wheel from the wheel washing facility are settled out and removed before discharging into the storm drain.			Ø		
6.10	Oil interceptor is provided in the drainage system and regularly emptied to prevent the release of oil and grease into the storm drainage system after accidental spillage.			þ		
6.11	Debris and rubbishes generated on site are collected, handled and disposed of properly to avoid them entering the two streams.			Þ		
6.12	All fuel tanks and storage areas are provided with locks and be sited on sealed areas, within bunds of a capacity equal to 110% of the storage capacity of the largest tank.			Ø		
6.13	Open storm water drains and culverts near the works area are covered to block the entrance of large debris and refuse.			Ø		
6.14	Portable chemical toilets handle the sewage from construction work force if the existing toilets in the Site are not adequate. Licensed contractors who are responsible for appropriate disposal and maintenance of these facilities provide appropriate and adequate portable toilets.			Ø		
6.15	Sheet piling is provided at suitable location around the basement excavation to reduce the effect of lowering the water table from any dewatering process. Any discharge of groundwater pumped out from any dewatering process of the construction works is treated to comply with the standards set in the relevant discharge licence prior discharge. No discharge of the groundwater is allowed into the two streams.	Ø				No snudwath was generated
7.00	Ecology (Construction Phase)					
7.01	Any affected trees are transplanted to grassland / scrubland within the Wo Hop Shek Cemetery.			Ø		
7.02	Temporary accesses to the work sites are carefully planned and located to minimise disturbance caused to the streams and nearby habitats.			Ø		
7.03	Less or smaller construction plants are used to reduce disturbance to the nearby habitats.			Ø		
7.04	Vehicles and other plants are carefully maintained and properly used to minimise the chance for accidental spillage.			Ø.		
7.05	Any spillages that do occur are quickly identified and appropriately cleaned up before they can contaminate streams or groundwater.	Ø				No spillage occured
7.06	Basement formation or any construction activities likely to pump out a large quantity of groundwater are protected with sheet-piling at suitable locations around the basement footprint, or by any like method.	Ø				No grand oute
7.07	No groundwater is pumped back to the two stream courses to protect the natural integrity of the stream habitat and the associated organism.	Ø				No Southorn Nos generated



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
7.08	Sturdy 1.8 metres protective fencings are located at the edge of the tree canopy			Q		
	but not around the trunk.)		
	Works beneath the tree canopy are avoided: If encroachment under the canopy			/		
7.09	area is unavoidable, adequate protections are provided to ensure no damage of any			Ø		
	part of the tree would occur due to the encroachment.			-		
	Any tree transplanting and planting works are implemented by an approved					
7.10	Landscape Contractor. Quality control of the work is undertaken by a qualified			Ø		
	Landscape Architect through site inspections and approval of works.					
7.11	Construction works are restricted within works area which are clearly defined.			A		
7.12	Woodland or other habitats that are affected by the construction works are well-	П		П		
7.12	defined and minimised.	Ц	ш		ш	
7.12	Human inference to habitats beyond the site boundary and habitats proposed to be			$ \overline{} $		
7.13	retained are avoided by providing temporary barricades.		ш		ш	
7.14	Works area is reinstated immediately after completion of the construction.	Ø				he construction who has not have not have completed
7.15	Uncontrolled burning of refuse is strictly prohibited. Appropriate fire control					
7.13	measures are provided in order to protect nearby habitats.					
7.16	Trees requiring transplantation or protection are identified based on the					
7.10	information illustrated in the Tree Survey Report.				П	
2.12	Is layout of the Project carefully designed to avoid or minimize the area of habitat					
7.17	loss and the numbers of trees to be felled?				ш	
	All trees are preserved as far as possible, especially species of conservation			/		
7.18	concern. Recommendations provided in the Tree Survey Report to mitigate			Ø		
	impacts on trees shall be followed.			1		
	Disturbance to the two plant species of conservation concern, namely Aquilaria					
	sinensis and Cibotium barometz, is avoided. Where removal of these species is		-			
7.19	unavoidable, it is recommended to transplant them to habitats with similar	Ø				
	conditions. Following transplantation, regular monitoring of these plants is	2				
	conducted by a suitable qualified botanist / horticulturist over a 12-month period;					
	Compensatory planting of the felled trees follows the Technical					As South week
7.20	Circular No. 3/2006 issued by ETWB.		Ц	Ц	Ш	100 hours nort
	The Site inside or in the proximity of the streams and nearby habitats is			/		
7.21	temporarily isolated, by placing of sandbags or silt curtains with lead edge at the			Ø		
	bottom and properly supported props, to prevent adverse impacts on these areas.			1		



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

Contract no. AL G513 Expansion of Wo Hop Shek Crematorium

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
7.22	Appropriate storage locations are situated well away from the streams and nearby habitats for the temporary storage of materials (e.g. equipment, filling materials, chemicals and fuel) and temporary stockpile of construction debris and spoil are identified before commencement of the works.			Ø		
7.23	Stockpiling of construction materials, are covered and located away from the streams and nearby habitats.			d		
7.24	Construction debris and spoil are covered up and/or properly disposed of as soon as possible to avoid being washed into the streams and nearby habitats by rain.			Ø		
7.25	Construction effluent, site runoff and sewage is properly collected and/or treated.			Ø		
7.26	Proper locations for discharge outlets of any wastewater treatment facilities well away from the streams and nearby habitats are identified.			ď		
7.27	Vehicles and other plant are carefully maintained and properly used to minimise the chance for accidental spillage.			6		
7.28	Temporary geo-textile silt fences around earth moving works are erected to trap any sediments being washed away and prevent them from entering surrounding areas.			Ø		
7.29	Exposed soil or other loose materials are covered with tarpaulins to prevent erosion, and then seeded and covered with a biodegradable geotextile blanket for erosion control purposes.			P		

*Remarks: N/

N/A = Not applicable at current stage

N/O = Not observed in the site walk

Yes = Compliance

No = Non-compliance



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823´| F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

Remark / Follow up of Observation(s) and Non-compliance(s) of Last Weekly Site Inspection:						
observation						
- Nil						
70.00						
Reminder(S):						
Tremme of the day	Id be covered by	importions sheeting				
- Dusty material Show	18 SE					
		2 () ED la \	and soh a			
Note : Figure 4,5	s regarding to clause of the site	3-6 04 EL 400 0	ar arbhidas			
at the entrans	of the site					
at the						
Signatures:	201	W				
ET	Contractor's	Architect's	IEC's			
Representative	Representative	Representative	Representative			
	11	1 /				
	- his	VY				
(Name: Jhny Kury)	(Name: M. Y. WONG)	(Name: F-L-HUNY)	(Name:			



2.00

Noise (Construction Phase)

Acuity Sustainability Consulting Limited

Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

Contract no. AL G513 Expansion of Wo Hop Shek Crematorium

WEEKLY ENVIRONMENTAL INSPECTION CHECKLIST Inspection Date: 11/5/2022 Inspected by: Inspection Time: IEC: Weather Sunny Condition ☐ Fine □ Drizzle ☐ Rain ☐ Storm □ Overcast ☐ Hazy Moderate Temperature Humidity ☐ High □ Low Wind □ Calm Light ☐ Breeze ☐ Strong **Environmental Mitigation Measures** N/A* N/O* Yes* Photo/Remarks 1.00 Air (Construction Phase) Vehicle washing facilities (including a high pressure water jet) were provided at 1.01 every discernible or designated vehicle exit point. Road between the washing facilities and the exit point is paved with concrete, 1.02 bituminous or hardcore material Every main haul road is paved with concrete, bituminous hardcore materials or 1.03 metal plates, and kept clear of dusty materials. Or unpaved haul roads and areas are sprayed with water to keep the entire road surface wet. Stockpile of dusty material including demolished items is either: a) covered entirely by impervious sheeting, or 1.04 b) placed in an area sheltered on the top and the three sides, or c) sprayed with water or a dust suppression chemical so as to maintain the entire surface wet Exposed earth is properly treated by compaction, hydroseeding, vegetation planting 1.05 or seating with latex, vinyl, bitumen within six months after the last construction activity on the site or part of the site where the exposed earth lies. 1.06 Water is sprayed to all dusty materials before loading or transfer operation. Any debris is covered entirely by impervious sheeting or stored in a debris 1.07 collection area sheltered on the top and the three sides. 1.08 Water is sprayed to debris before it is dumped into a chute. Vehicles for transporting dusty materials/spoils are covered with tarpaulin or 1.09 similar material. The cover extends over the edges of the sides and tailboards. Water is sprayed immediately to the working area for uprooting of trees, shrubs, or 1.10 vegetation or the removal of boulders, pole, pillars before, during and after the Workers at all levels are co-operative to avoid dust generation and dispersion to the 1.11 surrounding environment.



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
2.01	Only well-maintained plant is operated on site and the plant should be regularly serviced during the construction works			Ø		
2.02	Plant used intermittently is turned off or throttled down when not in active use.			\(\overline{\pi}\)		
2.03	Plant that emits noise strongly in one direction is oriented to face away from NSRs.			Ø		
2.04	Silencers, mufflers and enclosures for plant are applied where possible and maintained adequately throughout the works			Ø		
2.05	Where possible, mobile plant is sited away from NSRs			Ø		
2.06	PME is well maintained and used properly on site to minimise any excessive noise generated.			7		
2.07	Stockpiles of excavated materials and other structures such as site buildings should be used effectively to screen noise from the works.			Ø		
3.00	Land Contamination (Construction Phase)					
	N/A to the Phase III development					
4.00	Waste Management (Construction Phase)					
4.01	The necessary waste disposal permits from the appropriate authorities are obtained, in accordance with the Waste Disposal Ordinance (Cap. 354), Waste Disposal (Chemical Waste) (General) Regulation and the Land (Miscellaneous Provision) Ordinance (Cap. 28).			Ø		
4.02	A billing account with EPD for disposal of construction waste is obtained.			p		
4.03	A Waste Management Plan (WMP), incorporated in an Environmental Management Plan (EMP) is prepared and submitted to the Engineer/Supervising Officer for approval. Reference is made to Environment, Transport and Works Bureau Technical Circular (Works) (ETWB TCW) 19/2005.			ø		
4.04	An approved person to be responsible for good site practice is nominated, including arrangements for collection and effective disposal to an appropriate facility of all wastes generated at the site.			Ø		
4.05	Is authorised or licensed waste hauler used to collect specific category of waste?			Ø		
4.06	A trip-ticket system is included as one of the contractual requirements and implemented by the Environmental Team to monitor the disposal of C&D and solid wastes at public filling facilities and landfills, and to control fly tipping. Reference is made to ETWB TCW No. 31/2004.			Ø		
4.07	Training of site personnel in proper waste management and chemical waste handling procedures.			P		



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
4.08	Is routine cleaning and maintenance programme for drainage systems, sumps and oil interceptors conducted?			Ø		
	on interceptors conducted:		78133S			
4.09	Are sufficient waste disposal points and regular collection for disposal provided?			Ø		
	Are appropriate measures to minimise windblown litter and dust during					
4.10	transportation of waste, such as covering trucks or transporting wastes in enclosed			ď		
	containers adopted?					
4.11	Is recording system for the amount of wastes generated, recycled and disposed of					
4.11	(including the disposal sites) implemented?			ĻΔ	П	
	Segregation and storage of different types of waste in different containers, skips					
4.12	or stockpiles to enhance reuse or recycling of materials and their proper disposal.			\square	Ш	
	Encourage collection of aluminium cans, plastic bottles and packaging material					
	(e.g. carton boxes) and office paper by individual collectors. Separately labelled			,		
4.13	bins are provided to help segregate this waste from other general refuse generated			\square		
	by the work force.					
4.14	Are C&D materials reused when possible to reduce the amount of C&D			\square		
	material/waste?					
	Are wood, steel and other metals separated for reuse and / or recycling prior to					
4.15	disposal of C&D waste to minimise the quantity of waste to be disposed of to			\square		
	landfill?					
116	Minimise the potential for damage or contamination of construction material by					
4.16	having proper storage and site practices.		Ш	Д	Ш	
	Plan and stock construction materials carefully to minimise the amount of surplus			_	_/ _	
4.17	materials.			Ш		
	Rock and soil generated from excavation are reused for site formation and					
4.18	excavated material from foundation work reused for landscaping as far as			Ø		
505.5413040	practicable to avoid disposal off-site.	_	_	_	_	
	providence to a role disposal of site.					
4.19	Is reuse of the public fill and C&D waste practiced on site as far as practicable?			Ø		
	The handling of C&D materials is governed by WBTC No. 2/93. Inert C&D					
	material (public fill) is directed to an approved public filling area or reclamation					
4.20	site, where it has the benefit of offsetting the need for removal of materials from			Q'		
	borrow areas for reclamation purposes and helps to reduce the pressure on landfill			/		
	sites.					
	Are individuals or companies who deliver public fill to public filling areas					
4.21	obtained dumping licences?			\square		



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks				
4.22	Are careful design, planning and good site management adopted to minimise overordering and generation of waste materials such as concrete, mortar and cement grouts? The design of formwork maximise the use of standard wooden or metal panels so that high reuse levels can be achieved. Alternatives such as steel formwork, plastic fencing and reusable site office structures are considered to increase the potential for reuse and minimize C&D waste generation.			9						
4.23	The contractor uses as much as possible of the C&D material on-site. Proper segregation of waste types on site will increase the feasibility of certain components of the waste stream by recycling contractors.			Ø						
4.24	General refuse is stored in enclosed bins or compaction units separate from C&D and chemical wastes. A reputable waste collector is employed by the Contractor to remove general refuse from the site, separately from C&D and chemical wastes, on a daily or every second day basis to minimise odour, pest and litter impacts.			Ø						
	Chemical Waste									
4.25	Contractor registers with the EPD as chemical waste producer if any chemical waste is generated			Ø						
4.26	All the chemical waste is handled according to the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes. The chemical waste is stored and collected by an approved contractor for disposal at a licensed facility in accordance with the Waste Disposal (Chemical Waste) (General) Regulation.			Ø						
4.27	Principles of reuse and recycle chemical waste on site as far as practicable is adopted by the contractor.			7						
4.28	Are unused chemicals or those with remaining functional capacity reused as far as practicable?			Þ						
4.29	Disposal of chemical waste via a facility licensed to receive chemical waste, such as the Chemical Waste Treatment Facility at Tsing Yi, which offers a chemical waste collection service and can supply the necessary storage containers or a waste recycling plant approved by EPD.			Ø						
5.00	Landscape and Visual (Construction Phase)									
5.01	Do site offices have olive green roof and façade coating or colour that matche with existing environment?			Þ						
5.02	Are site offices and the construction yard decommissioned after construction?			P						
5.03	The height of site offices, including the rooftop does not exceed 10m, except building services equipment such as antennas, which exceeds 10 m but is coated in black.			Ø						



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

Is site houseding with 2.4m height and colour in harmony with the surrounding environment recreted along the site boundary until the completion of relevant construction phases? And construction phases? Are construction phases and building materials orderly and carefully stored to appear neat and avoid visibility from outside where practical? 5.05 Are excess materials removed from site upon completion of construction works? 5.06 Are all construction plants removed from site upon completion of VSRa? 5.07 5.08 Are construction lights oriented away from the viewing location of VSRa? 5.09 5.00 5.00 6.00		Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
special reat and avoid visibility from outside where practical? 5.06 Are excess materials removed from site as soon as practical? 5.07 Are all construction plants removed from site upon completion of construction works? 5.08 Are construction lights oriented away from the viewing location of VSRs? 5.09 Are all lightings facing sensitive receiver installed with frosted diffusers and reflective covers? 5.09 Trees that require removal are transplanted on site if practical. If not practical, these trees will be transplanted in locations within the vieinity as approved by the Architect. 5.10 Planting works are carried out under the supervision of a specialist landscape specialist. 5.11 The rooftop of the cremation plant room is planted with lawn. 5.12 The rooftop of the cremation plant room is planted with lawn. 5.13 New trees, shrubs and groundcover are carefully selected and designed to homogenize with the environment. 5.14 departments. 5.15 All trees that are marked for retention are fenced off with a 1.2m high fence around the dripfine of trees or larger area as far as feasible. 5.16 Transplant preparation works are carried out as soon as possible after the commencement of construction. Over-pruning such as hard pruning of tree crown, polarding or topping are avoided. Rootball and crown pruning are carried out over at least 3 months. 5.16 Existing shrub and ground cover planting areas that will not be removed are maintained in good condition and enhanced if practical. 5.18 kept in proportion with the rest of the building.	5.04	environment erected along the site boundary until the completion of relevant	Ø				site hearding was
Are all construction plants removed from site upon completion of construction works? 5.08 Are construction lights oriented away from the viewing location of VSRs? 5.09 Are all lightings facing sensitive receiver installed with frosted diffusers and reflective covers? Trees that require removal are transplanted on site if practical. If not practical, these trees will be transplanted in locations within the vicinity as approved by the Architect. 5.10 Planting works are carried out under the supervision of a specialist landscape specialist. 5.12 The rooftop of the cremation plant room is planted with lawn. 5.13 New trees, shrubs and groundcover are carefully selected and designed to homogenize with the environment. 5.14 No tree is transplanted or felled without prior approval by relevant Government departments. 5.15 All trees that are marked for retention are fenced off with a 1.2m high fence around the dripline of trees or larger area as fir as feasible. Transplant preparation works are carried out as soon as possible after the commencement of construction. Over-pruning such as hard pruning of tree crown, polarding or topping are avoided. Rootball and crown pruning are carried out over at least 3 months. 5.16 Existing shrub and ground cover planting areas that will not be removed are maintained in good condition and enhanced if practical. 5.18 Kept in proportion with the rest of the building.	5.05				Ø		
Solid Are construction lights oriented away from the viewing location of VSRs?	5.06	Are excess materials removed from site as soon as practical?			Ø		
Are all lightings facing sensitive receiver installed with frosted diffusers and reflective covers? Trees that require removal are transplanted on site if practical. If not practical, these trees will be transplanted in locations within the vicinity as approved by the Architect. 5.10 Planting works are carried out under the supervision of a specialist landscape specialist. 5.12 The rooftop of the cremation plant room is planted with lawn. Sew trees, shrubs and groundcover are carefully selected and designed to homogenize with the environment. 5.14 No tree is transplanted or felled without prior approval by relevant Government departments. 5.15 All trees that are marked for retention are fenced off with a 1.2m high fence around the dripline of trees or larger area as far as feasible. Transplant preparation works are carried out as soon as possible after the commencement of construction. Over-pruning such as hard pruning of tree crown, pollarding or topping are avoided. Rootball and crown pruning are carried out over at least 3 months. 5.16 Existing shrub and ground cover planting areas that will not be removed are maintained in good condition and enhanced if practical. The chimney has been designed to have sculptural outlook and articulated. It is kept in proportion with the rest of the building. The chimney stack is designed to locate at the least conspicuous location of the	5.07		Ø				No planting work
Trees that require removal are transplanted on site if practical. If not practical, these trees will be transplanted in locations within the vicinity as approved by the Architect. S.11	5.08	Are construction lights oriented away from the viewing location of VSRs?			Ø		
these trees will be transplanted in locations within the vicinity as approved by the Architect. Solid	5.09				Ø		-
5.12 The rooftop of the cremation plant room is planted with lawn. Solid	5.10	these trees will be transplanted in locations within the vicinity as approved by the			Ø		
5.12 The rooftop of the cremation plant room is planted with lawn. 5.13 New trees, shrubs and groundcover are carefully selected and designed to homogenize with the environment. 5.14 No tree is transplanted or felled without prior approval by relevant Government departments. 5.15 All trees that are marked for retention are fenced off with a 1.2m high fence around the dripline of trees or larger area as far as feasible. Transplant preparation works are carried out as soon as possible after the commencement of construction. Over-pruning such as hard pruning of tree crown, pollarding or topping are avoided. Rootball and crown pruning are carried out over at least 3 months. 5.17 Existing shrub and ground cover planting areas that will not be removed are maintained in good condition and enhanced if practical. 5.18 Kept in proportion with the rest of the building. 5.19 The chimney stack is designed to locate at the least conspicuous location of the	5.11	A			Ø		
5.13 homogenize with the environment.	5.12	The rooftop of the cremation plant room is planted with lawn.	Ø				1 ()
S.14 departments.	5.13		Ø				No pleasing work
around the dripline of trees or larger area as far as feasible. Transplant preparation works are carried out as soon as possible after the commencement of construction. Over-pruning such as hard pruning of tree crown, pollarding or topping are avoided. Rootball and crown pruning are carried out over at least 3 months. Existing shrub and ground cover planting areas that will not be removed are maintained in good condition and enhanced if practical. The chimney has been designed to have sculptural outlook and articulated. It is kept in proportion with the rest of the building. The chimney stack is designed to locate at the least conspicuous location of the	5.14	**************************************			Ø		
commencement of construction. Over-pruning such as hard pruning of tree crown, pollarding or topping are avoided. Rootball and crown pruning are carried out over at least 3 months. Existing shrub and ground cover planting areas that will not be removed are maintained in good condition and enhanced if practical. The chimney has been designed to have sculptural outlook and articulated. It is kept in proportion with the rest of the building. The chimney stack is designed to locate at the least conspicuous location of the	5.15		Ø				All the plenting nork was completed.
5.17 maintained in good condition and enhanced if practical. The chimney has been designed to have sculptural outlook and articulated. It is kept in proportion with the rest of the building. The chimney stack is designed to locate at the least conspicuous location of the	5.16	commencement of construction. Over-pruning such as hard pruning of tree crown, pollarding or topping are avoided. Rootball and crown pruning are carried out			P		
5.18 kept in proportion with the rest of the building.	5.17				Ø		
5.19	5.18	To decrease and the control of the c			Ø		
	5.19				ď		



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
5.20	Bi-weekly checking would be performed on the nine Terminalia mantaly trees within and outside the works area of the Project, or otherwise if the transplantations are not carried out according to the plan.			p/		
5.21	Are silting traps installed to minimize silting to streams?			Ø		
5.22	Is the tree compensation to tree loss ratio at least 1:1 in term of quantity? About 100 trees will be planted to compensate for the loss of 54 trees. 100 trees will be planted on site and others, in locations within the vicinity approved by the Architect	Ø				No plantly work
5.23	Is amenity planting for open spaces included in the Project?	Ø				No plantity mark
5.24	Is screen planting such as planting a roll of trees along the site boundary butting Kiu Tau Road carried out?	Ø				No plenting work
5.25	Woodland mix, comprising of tree seedlings and shrubs, are planted within the Wo Hop Shek Cemetery to enhance the ecological value and compensatory of tree loss.	Þ				No planting work
5.26	Is the 10m height headroom cremation plant room half-sunken to reduce the visual impact to pedestrians?			Ø		
6.00	Water Quality (Construction Phase)					
6.01	Wastewater is properly treated to meet the discharge standards set out in the relevant Water Pollution Control Ordinance (WPCO) discharge licence. No direct discharge of site runoff into the two streams is allowed.			Þ		
6.02	Perimeter channels are provided to intercept storm runoff from outside the site. The channels are constructed in advance of site formation works and earthworks.			7		
6.03	Sand/silt removal facilities such as sand traps, silt traps and sediment basins are provided to remove sand/silt particles from runoff to meet the requirements of the Technical Memorandum standard under the WPCO.			Ø		
6.04	Works are carefully programmed to minimise soil excavation works during rainy seasons.	Ø				No examplian work
6.05	Exposed soil surfaces are protected by paving as soon as possible to reduce the potential of soil erosion.	Ø				No exacting north
6.06	Temporary access roads are protected by crushed gravel and exposed slope surfaces are protected when rainstorms are likely to occur.			Ø		
6.07	Trench excavation is avoided in the wet season as far as practicable, and if necessary, these trenches are excavated and backfilled in short sections.	Ø				No exposition work
6.08	Open stockpiles of construction materials on site are covered with tarpaulin or similar fabric during rainstorms.			Ø		



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
6.09	Sand and silt in the wash water from the wheel from the wheel washing facility are settled out and removed before discharging into the storm drain.			Ø		
6.10	Oil interceptor is provided in the drainage system and regularly emptied to prevent the release of oil and grease into the storm drainage system after accidental spillage.			Ø		
6.11	Debris and rubbishes generated on site are collected, handled and disposed of properly to avoid them entering the two streams.			ď		
6.12	All fuel tanks and storage areas are provided with locks and be sited on sealed areas, within bunds of a capacity equal to 110% of the storage capacity of the largest tank.			Ø		
6.13	Open storm water drains and culverts near the works area are covered to block the entrance of large debris and refuse.			Ø		
6.14	Portable chemical toilets handle the sewage from construction work force if the existing toilets in the Site are not adequate. Licensed contractors who are responsible for appropriate disposal and maintenance of these facilities provide appropriate and adequate portable toilets.			Ø		
6.15	Sheet piling is provided at suitable location around the basement excavation to reduce the effect of lowering the water table from any dewatering process. Any discharge of groundwater pumped out from any dewatering process of the construction works is treated to comply with the standards set in the relevant discharge licence prior discharge. No discharge of the groundwater is allowed into the two streams.	ø				No Soudrate
7.00	Ecology (Construction Phase)					
7.01	Any affected trees are transplanted to grassland / scrubland within the Wo Hop Shek Cemetery.			Ø		
7.02	Temporary accesses to the work sites are carefully planned and located to minimise disturbance caused to the streams and nearby habitats.			7		
7.03	Less or smaller construction plants are used to reduce disturbance to the nearby habitats.			Ø		
7.04	Vehicles and other plants are carefully maintained and properly used to minimise the chance for accidental spillage.			Ø		
7.05	Any spillages that do occur are quickly identified and appropriately cleaned up before they can contaminate streams or groundwater.	7				No spillage occured
7.06	Basement formation or any construction activities likely to pump out a large quantity of groundwater are protected with sheet-piling at suitable locations around the basement footprint, or by any like method.	p				No grandrata was generated
7.07	No groundwater is pumped back to the two stream courses to protect the natural integrity of the stream habitat and the associated organism.	Ø				No Grandweter was generated



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
7.08	Sturdy 1.8 metres protective fencings are located at the edge of the tree canopy but not around the trunk.			Ø		
7.09	Works beneath the tree canopy are avoided: If encroachment under the canopy area is unavoidable, adequate protections are provided to ensure no damage of any part of the tree would occur due to the encroachment.			Ø		
7.10	Any tree transplanting and planting works are implemented by an approved Landscape Contractor. Quality control of the work is undertaken by a qualified Landscape Architect through site inspections and approval of works.			Ø		
7.11	Construction works are restricted within works area which are clearly defined.			Ø		
7.12	Woodland or other habitats that are affected by the construction works are well-defined and minimised.			Ø		-
7.13	Human inference to habitats beyond the site boundary and habitats proposed to be retained are avoided by providing temporary barricades.			ø		
7.14	Works area is reinstated immediately after completion of the construction.	Ø				has not been completed
7.15	Uncontrolled burning of refuse is strictly prohibited. Appropriate fire control measures are provided in order to protect nearby habitats.			Ø		
7.16	Trees requiring transplantation or protection are identified based on the information illustrated in the Tree Survey Report.			Ø		
7.17	Is layout of the Project carefully designed to avoid or minimize the area of habitat loss and the numbers of trees to be felled?			Þ		
7.18	All trees are preserved as far as possible, especially species of conservation concern. Recommendations provided in the Tree Survey Report to mitigate impacts on trees shall be followed.			Ø		
7.19	Disturbance to the two plant species of conservation concern, namely Aquilaria sinensis and Cibotium barometz, is avoided. Where removal of these species is unavoidable, it is recommended to transplant them to habitats with similar conditions. Following transplantation, regular monitoring of these plants is conducted by a suitable qualified botanist / horticulturist over a 12-month period;	7				
7.20	Compensatory planting of the felled trees follows the Technical Circular No. 3/2006 issued by ETWB.	P				No planting work
7.21	The Site inside or in the proximity of the streams and nearby habitats is temporarily isolated, by placing of sandbags or silt curtains with lead edge at the bottom and properly supported props, to prevent adverse impacts on these areas.			p/		



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

Contract no. AL G513 Expansion of Wo Hop Shek Crematorium

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
7.22	Appropriate storage locations are situated well away from the streams and nearby habitats for the temporary storage of materials (e.g. equipment, filling materials, chemicals and fuel) and temporary stockpile of construction debris and spoil are identified before commencement of the works.			Ø		
7.23	Stockpiling of construction materials, are covered and located away from the streams and nearby habitats.			\square		
7.24	Construction debris and spoil are covered up and/or properly disposed of as soon as possible to avoid being washed into the streams and nearby habitats by rain.			Ø		
7.25	Construction effluent, site runoff and sewage is properly collected and/or treated.					
7.26	Proper locations for discharge outlets of any wastewater treatment facilities well away from the streams and nearby habitats are identified.			ø		
7.27	Vehicles and other plant are carefully maintained and properly used to minimise the chance for accidental spillage.			P		
7.28	Temporary geo-textile silt fences around earth moving works are erected to trap any sediments being washed away and prevent them from entering surrounding areas.			₽′		
7.29	Exposed soil or other loose materials are covered with tarpaulins to prevent erosion, and then seeded and covered with a biodegradable geotextile blanket for erosion control purposes.			Þ		

*Remarks:

N/A = Not applicable at current stage

N/O = Not observed in the site walk

Yes = Compliance

No = Non-compliance



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

Remark / Follow up of Observation(s) and Non-compliance(s) of Last Week	ly Site Inspection:	
Observation (5)			
NI			
			٠
0 . 1 . (():			
Reninder (S):		with imporvious she	-7
Durth materials	should be covered h	with imporvious shee	tig
- Doscy			
11. Flows 45	readly to class	e 3,6 of EP h	as been displayed
Note . , god	ac tusite		
at 1 th where			
Signatures:		*	
ET	Contractor's	Architect's	IEC's
Representative	Representative	Representative	Representative
\mathcal{U} .	1_12	Ae	260
(Name: Johnhy (None)	(Name: M. Y. WONG)	(Name: 7. C. Chuz Mar.)	(Name: Holfon TAM)



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

Contract no. AL G513 Expansion of Wo Hop Shek Crematorium

→ WEEKLY ENVIRONMENTAL INSPECTION CHECKLIST

Inspec	tion Date: _	17/0	1200	Inspected by	' :	ET:	Jen	19 N	4. 1	R: F.L	Hung	_
Inspec	tion Time:_	15	00		Contra	actor:	M.X.	Word	<u>)</u> 11	EC:		_
Weath	ier	/						J				
Condi	tion 🖰	Sunny	☐ Fine	□ Overcast	☐ Drizzle		☐ Rain	n	□ S)(6)	m	☐ Hazy	
Tempe	erature _	V/°C			Humidity		□ Hig	h	Mo	derate	□ Low	
Wind	\preceq	Calm	□ Light	□ Breeze	☐ Strong							
	Environme	ental Mitigation	Measures			N/A*	N/O*	Yes*	No*	Pho	oto/Remarks	
1.00	Air (Const	ruction Phase)										
1.01	Vehicle wa	shing facilities (including a high pr	essure water jet) were	provided at		П					
1.01	every disce	rnible or designa	ated vehicle exit poin	nt.			ш	Щ	Ш			_
1.02	Road between	een the washing	facilities and the	exit point is paved w	rith concrete,		П	M				
1.02	bituminous	or hardcore mate	erial.			ш	Ц		Ш	-		-
	Every mair	n haul road is pa	aved with concrete,	bituminous hardcore	materials or							
1.03	metal plates	s, and kept clear	of dusty materials. (Or unpaved haul roads	and areas are							_
	sprayed wit	th water to keep t	the entire road surfa	ce wet.								
	Stockpile o	f dusty material	including demolishe	ed items is either:								
	a) covered	entirely by impe	ervious sheeting, or									
1.04	b) placed i	n an area shelter	ed on the top and th	e three sides, or				Ø		9 <u></u>		_
	c) sprayed	with water or a	dust suppression ch	emical so as to mainta	ain the entire							
	surface	wet.										
	Exposed ea	rth is properly tre	eated by compaction	, hydroseeding, vegeta	tion planting							
1.05	or seating v	with latex, vinyl,	bitumen within six	months after the last	construction			Ø		-		_
	activity on	the site or part of	f the site where the	exposed earth lies.								
				1'								
1.06	water is spi	rayed to all dusty	materials before to	ading or transfer opera	ation.		Ц	Д	Ц	-		-
1.07	Any debris	s is covered ent	tirely by imperviou	is sheeting or stored	in a debris							
1.07	collection a	rea sheltered on	the top and the three	e sides.			Ц	7		-		_
1.00	Water is an	round to debrie b	efore it is dumped in	ato a abuta				\square			2500	
1.08	water is spi	rayed to debris b	erore it is dumped if	nto a criute.				7				
1.09	Vehicles fo	or transporting of	dusty materials/spo	ils are covered with	tarpaulin or	П						
1.09	similar mat	erial. The cover	extends over the edg	ges of the sides and tai	lboards.		Ш	7				
	Water is spi	rayed immediate	ly to the working ar	ea for uprooting of tree	es, shrubs, or			,				
1.10	vegetation	or the removal of	of boulders, pole, p	sillars before, during	and after the			Ø				_
	operation.							,				
1 11	Workers at	all levels are co-	operative to avoid d	ust generation and disp	persion to the			$ \wedge $				
1.11	surrounding	g environment.						٧	Ш	-		_
2.00	Noise (Con	struction Phase	2)									



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks					
2.01	Only well-maintained plant is operated on site and the plant should be regularly										
2.01	serviced during the construction works	Ш	Ц		ш						
2.02	Plant used intermittently is turned off or throttled down when not in active use.			Ø							
2.03	Plant that emits noise strongly in one direction is oriented to face away from NSRs.			Ø							
2.04	Silencers, mufflers and enclosures for plant are applied where possible and maintained adequately throughout the works			Ø							
2.05	Where possible, mobile plant is sited away from NSRs			P							
2.06	PME is well maintained and used properly on site to minimise any excessive noise generated.			Ø							
2.07	Stockpiles of excavated materials and other structures such as site buildings should be used effectively to screen noise from the works.			Ø							
3.00	Land Contamination (Construction Phase)										
	N/A to the Phase III development										
4.00	Waste Management (Construction Phase)										
4.01	The necessary waste disposal permits from the appropriate authorities are obtained, in accordance with the Waste Disposal Ordinance (Cap. 354), Waste Disposal (Chemical Waste) (General) Regulation and the Land (Miscellaneous Provision) Ordinance (Cap. 28).			Ø							
4.02	A billing account with EPD for disposal of construction waste is obtained.			Þ							
4.03	A Waste Management Plan (WMP), incorporated in an Environmental Management Plan (EMP) is prepared and submitted to the Engineer/Supervising Officer for approval. Reference is made to Environment, Transport and Works Bureau Technical Circular (Works) (ETWB TCW) 19/2005.			Þ							
4.04	An approved person to be responsible for good site practice is nominated, including arrangements for collection and effective disposal to an appropriate facility of all wastes generated at the site.			ď							
4.05	Is authorised or licensed waste hauler used to collect specific category of waste?			Ø							
4.06	A trip-ticket system is included as one of the contractual requirements and implemented by the Environmental Team to monitor the disposal of C&D and solid wastes at public filling facilities and landfills, and to control fly tipping. Reference is made to ETWB TCW No. 31/2004.			Ø							
4.07	Training of site personnel in proper waste management and chemical waste handling procedures.			P							



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
4.08	Is routine cleaning and maintenance programme for drainage systems, sumps and oil interceptors conducted?			Ø		
4.09	Are sufficient waste disposal points and regular collection for disposal provided?			Ø		
4.10	Are appropriate measures to minimise windblown litter and dust during transportation of waste, such as covering trucks or transporting wastes in enclosed containers adopted?			ď		
4.11	Is recording system for the amount of wastes generated, recycled and disposed of (including the disposal sites) implemented?			P		
4.12	Segregation and storage of different types of waste in different containers, skips or stockpiles to enhance reuse or recycling of materials and their proper disposal.					
4.13	Encourage collection of aluminium cans, plastic bottles and packaging material (e.g. carton boxes) and office paper by individual collectors. Separately labelled bins are provided to help segregate this waste from other general refuse generated by the work force.			Ø		
4.14	Are C&D materials reused when possible to reduce the amount of C&D material/waste?			ď		
4.15	Are wood, steel and other metals separated for reuse and / or recycling prior to disposal of C&D waste to minimise the quantity of waste to be disposed of to landfill?			Ø		
4.16	Minimise the potential for damage or contamination of construction material by having proper storage and site practices.			Ø		
4.17	Plan and stock construction materials carefully to minimise the amount of surplus materials.			zí		
4.18	Rock and soil generated from excavation are reused for site formation and excavated material from foundation work reused for landscaping as far as practicable to avoid disposal off-site.			ø		
4.19	Is reuse of the public fill and C&D waste practiced on site as far as practicable?			P		
4.20	The handling of C&D materials is governed by WBTC No. 2/93. Inert C&D material (public fill) is directed to an approved public filling area or reclamation site, where it has the benefit of offsetting the need for removal of materials from borrow areas for reclamation purposes and helps to reduce the pressure on landfill sites.			Ø		
4.21	Are individuals or companies who deliver public fill to public filling areas obtained dumping licences?			Ø		



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks				
4.22	Are careful design, planning and good site management adopted to minimise overordering and generation of waste materials such as concrete, mortar and cement grouts? The design of formwork maximise the use of standard wooden or metal panels so that high reuse levels can be achieved. Alternatives such as steel formwork, plastic fencing and reusable site office structures are considered to increase the potential for reuse and minimize C&D waste generation.			ø						
4.23	The contractor uses as much as possible of the C&D material on-site. Proper segregation of waste types on site will increase the feasibility of certain components of the waste stream by recycling contractors.			ø						
4.24	General refuse is stored in enclosed bins or compaction units separate from C&D and chemical wastes. A reputable waste collector is employed by the Contractor to remove general refuse from the site, separately from C&D and chemical wastes, on a daily or every second day basis to minimise odour, pest and litter impacts.			ď						
	Chemical Waste									
4.25	Contractor registers with the EPD as chemical waste producer if any chemical waste is generated			Ø						
4.26	All the chemical waste is handled according to the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes. The chemical waste is stored and collected by an approved contractor for disposal at a licensed facility in accordance with the Waste Disposal (Chemical Waste) (General) Regulation.			Ø						
4.27	Principles of reuse and recycle chemical waste on site as far as practicable is adopted by the contractor.			Ø						
4.28	Are unused chemicals or those with remaining functional capacity reused as far as practicable?			Ø						
4.29	Disposal of chemical waste via a facility licensed to receive chemical waste, such as the Chemical Waste Treatment Facility at Tsing Yi, which offers a chemical waste collection service and can supply the necessary storage containers or a waste recycling plant approved by EPD.			Þ						
5.00	Landscape and Visual (Construction Phase)									
5.01	Do site offices have olive green roof and façade coating or colour that matche with existing environment?			Ø						
5.02	Are site offices and the construction yard decommissioned after construction?			Ø						
5.03	The height of site offices, including the rooftop does not exceed 10m, except building services equipment such as antennas, which exceeds 10 m but is coated in black.			Ø						



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
5.04	Is site hoarding with 2.4m height and colour in harmony with the surrounding environment erected along the site boundary until the completion of relevant construction phases?	Ø				Site heady was
5.05	Are construction plants and building materials orderly and carefully stored to appear neat and avoid visibility from outside where practical?			Ø		
5.06	Are excess materials removed from site as soon as practical?			Ø		
5.07	Are all construction plants removed from site upon completion of construction works?	Ø				No planting mark
5.08	Are construction lights oriented away from the viewing location of VSRs?			Ø		
5.09	Are all lightings facing sensitive receiver installed with frosted diffusers and reflective covers?			7		
5.10	Trees that require removal are transplanted on site if practical. If not practical, these trees will be transplanted in locations within the vicinity as approved by the Architect.			ø		
5.11	Planting works are carried out under the supervision of a specialist landscape specialist.			Ø		
5.12	The rooftop of the cremation plant room is planted with lawn.	Ø				Lann has not bee
5.13	New trees, shrubs and groundcover are carefully selected and designed to homogenize with the environment.	Ø				No plating nork
5.14	No tree is transplanted or felled without prior approval by relevant Government departments.			Ø		
5.15	All trees that are marked for retention are fenced off with a 1.2m high fence around the dripline of trees or larger area as far as feasible.	Ø				All tree plenting month
5.16	Transplant preparation works are carried out as soon as possible after the commencement of construction. Over-pruning such as hard pruning of tree crown, pollarding or topping are avoided. Rootball and crown pruning are carried out over at least 3 months.			Ø		
5.17	Existing shrub and ground cover planting areas that will not be removed are maintained in good condition and enhanced if practical.			P		
5.18	The chimney has been designed to have sculptural outlook and articulated. It is kept in proportion with the rest of the building.			Ø		
5.19	The chimney stack is designed to locate at the least conspicuous location of the site to VSRs.			Ø		



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

Bi-veckly checking would be performed on the nine Terminalia manually brees within and outside the works area of the Project, or otherwise if the transplantations are not carried out according to the plan. 221 Are silting traps installed to minimize silting to streams?		Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
Is the tree compensation to tree loss ratio at least 1:1 in term of quantity? About 100 trees will be planted to compensate for the loss of 54 trees. 100 trees will be planted on site and others, in locations within the vicinity approved by the Architect 5.23 Is amenity planting for open spaces included in the Project? 5.24 Is sereen planting such as planting a roll of trees along the site boundary butting Kiu Tau Road carried out? Woodand mix, comprising of tree seedlings and shrubs, are planted within the Woodand mix, comprising of tree seedlings and shrubs, are planted within the Woodand mix, comprising of tree seedlings and shrubs, are planted within the Woodand mix, comprising of tree seedlings and shrubs, are planted within the Woodand mix, comprising of tree seedlings and shrubs, are planted within the Woodand mix, comprising of tree seedlings and shrubs, are planted within the Woodand mix, comprising of tree seedlings and shrubs, are planted within the Woodand mix, comprising of tree seedlings and shrubs, are planted within the Woodand mix, comprising of tree seedlings and shrubs, are planted within the Woodand mix, comprising of tree seedlings and shrubs, are planted within the Woodand mix, comprising of tree seedlings and shrubs, are planted within the Woodand mix, comprising of tree seedlings and shrubs, are planted within the Woodand mix comprising of tree seedlings and shrubs, are planted within the woodand mix comprising of tree seedlings and self-and compression of the relevant Water Pollution Control Ordinance (WPCO) discharge licence. No direct discharge of site runoff into the two streams is allowed. 6.02 Perimeter channels are provided to intercept storm runoff from outside the site. The channels are provided to intercept storm runoff from outside the site. The channels are provided to intercept storm runoff no moeet the requirements of the Technical Memorandum standard under the WPCO. 6.04 Works are carefully programmed to minimise soil excavation works during rainy seasons. 6.05 Ex	5.20	within and outside the works area of the Project, or otherwise if the			Ø		
About 100 trees will be planted to compensate for the loss of 54 trees. 100 trees will be planted on site and others, in locations within the vicinity approved by the Architect 5.23 Is amenity planting for open spaces included in the Project?	5.21	Are silting traps installed to minimize silting to streams?			Ø		
Secret planting such as planting a roll of trees along the site boundary butting Kiu Tau Road carried out?	5.22	About 100 trees will be planted to compensate for the loss of 54 trees. 100 trees will be planted on site and others, in locations within the vicinity approved by the	Ø				No plantly work
butting Kiu Tau Road carried out? Woodland mix, comprising of tree seedlings and shrubs, are planted within the Wo Hop Shek Cemetery to enhance the ecological value and compensatory of tree loss. 1 sthe 10m height headroom cremation plant room half-sunken to reduce the visual impact to pedestrians? 6.00 Water Quality (Construction Phase) Wastewater is properly treated to meet the discharge standards set out in the relevant Water Pollution Control Ordinance (WPCO) discharge licence. No direct discharge of site runoff into the two streams is allowed. Perimeter channels are provided to intercept storm runoff from outside the site. The channels are constructed in advance of site formation works and earthworks. Sand/silt removal facilities such as sand traps, silt traps and sediment basins are provided to remove sand/silt particles from runoff to meet the requirements of the Technical Memorandum standard under the WPCO. Works are carefully programmed to minimise soil excavation works during rainy seasons. Exposed soil surfaces are protected by paving as soon as possible to reduce the potential of soil erosion. Exposed soil surfaces are protected by crushed gravel and exposed slope surfaces are protected when rainstorms are likely to occur. Trench excavation is avoided in the wet season as far as practicable, and if necessary, these trenches are excavated and backfilled in short sections. Open stockpiles of construction materials on site are covered with tarpaulin or	5.23	Is amenity planting for open spaces included in the Project?	Ø				No plantly work
S.25 Wo Hop Shek Cemetery to enhance the ecological value and compensatory of tree loss. Substitution S	5.24		Ø				No plante, would
Sand/silt removal facilities such as sand traps, silt traps and sediment basins are provided to remove sand/silt particles from runoff to meet the requirements of the Technical Memorandum standard under the WPCO. Works are carefully programmed to minimise soil excavation works during rainy seasons. Exposed soil surfaces are protected by paving as soon as possible to reduce the potential of soil erosion. Temporary access roads are protected by crushed gravel and exposed slope surfaces are protected when rainstorms are likely to occur. Trenche excavation is avoided in the wet season as far as practicable, and if necessary, these trenches are excavated and backfilled in short sections. Open stockpiles of construction materials on site are covered with tarpaulin or Open stockpiles of construction materials on site are covered with tarpaulin or Open stockpiles of construction materials on site are covered with tarpaulin or Open stockpiles of construction materials on site are covered with tarpaulin or Open stockpiles of construction materials on site are covered with tarpaulin or Open stockpiles of construction materials on site are covered with tarpaulin or Open stockpiles of construction materials on site are covered with tarpaulin or Open stockpiles of construction materials on site are covered with tarpaulin or Open stockpiles of construction materials on site are covered with tarpaulin or Open stockpiles of construction materials on site are covered with tarpaulin or Open stockpiles of construction materials on site are covered with tarpaulin or Open stockpiles of construction materials on site are covered with tarpaulin or Open stockpiles of construction materials on site are covered with tarpaulin or Open stockpiles of construction materials on site are covered with tarpaulin or Open stockpiles of construction materials on site are covered with tarpaulin or Open stockpiles of construction materials on site are covered with tarpaulin or Open stockpiles of constructi	5.25	Wo Hop Shek Cemetery to enhance the ecological value and compensatory of tree	Ø				No planting mork
Wastewater is properly treated to meet the discharge standards set out in the relevant Water Pollution Control Ordinance (WPCO) discharge licence. No direct discharge of site runoff into the two streams is allowed. Perimeter channels are provided to intercept storm runoff from outside the site. The channels are constructed in advance of site formation works and earthworks. Sand/silt removal facilities such as sand traps, silt traps and sediment basins are provided to remove sand/silt particles from runoff to meet the requirements of the Technical Memorandum standard under the WPCO. Works are carefully programmed to minimise soil excavation works during rainy seasons. Exposed soil surfaces are protected by paving as soon as possible to reduce the potential of soil erosion. Temporary access roads are protected by crushed gravel and exposed slope surfaces are protected when rainstorms are likely to occur. Trench excavation is avoided in the wet season as far as practicable, and if necessary, these trenches are excavated and backfilled in short sections. Open stockpiles of construction materials on site are covered with tarpaulin or	5.26				Ø		
relevant Water Pollution Control Ordinance (WPCO) discharge licence. No direct discharge of site runoff into the two streams is allowed. Perimeter channels are provided to intercept storm runoff from outside the site. The channels are constructed in advance of site formation works and earthworks. Sand/silt removal facilities such as sand traps, silt traps and sediment basins are provided to remove sand/silt particles from runoff to meet the requirements of the Technical Memorandum standard under the WPCO. Works are carefully programmed to minimise soil excavation works during rainy seasons. Exposed soil surfaces are protected by paving as soon as possible to reduce the potential of soil erosion. Temporary access roads are protected by crushed gravel and exposed slope surfaces are protected when rainstorms are likely to occur. Trench excavation is avoided in the wet season as far as practicable, and if necessary, these trenches are excavated and backfilled in short sections. Open stockpiles of construction materials on site are covered with tarpaulin or	6.00	Water Quality (Construction Phase)					
The channels are constructed in advance of site formation works and earthworks. Sand/silt removal facilities such as sand traps, silt traps and sediment basins are provided to remove sand/silt particles from runoff to meet the requirements of the Technical Memorandum standard under the WPCO. Works are carefully programmed to minimise soil excavation works during rainy seasons. Exposed soil surfaces are protected by paving as soon as possible to reduce the potential of soil erosion. Temporary access roads are protected by crushed gravel and exposed slope surfaces are protected when rainstorms are likely to occur. Trench excavation is avoided in the wet season as far as practicable, and if necessary, these trenches are excavated and backfilled in short sections. Open stockpiles of construction materials on site are covered with tarpaulin or	6.01	relevant Water Pollution Control Ordinance (WPCO) discharge licence. No direct			Ø		
provided to remove sand/silt particles from runoff to meet the requirements of the Technical Memorandum standard under the WPCO. Works are carefully programmed to minimise soil excavation works during rainy seasons. Exposed soil surfaces are protected by paving as soon as possible to reduce the potential of soil erosion. Temporary access roads are protected by crushed gravel and exposed slope surfaces are protected when rainstorms are likely to occur. Trench excavation is avoided in the wet season as far as practicable, and if necessary, these trenches are excavated and backfilled in short sections. Open stockpiles of construction materials on site are covered with tarpaulin or	6.02				P		
Famour of the seasons of the season of the	6.03	provided to remove sand/silt particles from runoff to meet the requirements of the			Ø		
potential of soil erosion. Temporary access roads are protected by crushed gravel and exposed slope surfaces are protected when rainstorms are likely to occur. Trench excavation is avoided in the wet season as far as practicable, and if necessary, these trenches are excavated and backfilled in short sections. Open stockpiles of construction materials on site are covered with tarpaulin or	6.04		Þ				No execution will
surfaces are protected when rainstorms are likely to occur. Trench excavation is avoided in the wet season as far as practicable, and if necessary, these trenches are excavated and backfilled in short sections. Open stockpiles of construction materials on site are covered with tarpaulin or	6.05	10 C P2 cod (400) 255 to M2 cod (400) 40 Cod	Þ				No exeavation work
6.07 necessary, these trenches are excavated and backfilled in short sections. Open stockpiles of construction materials on site are covered with tarpaulin or	6.06				Ø		
	6.07		Ø				No expandion north
	6.08	•			Þ		



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
6.09	Sand and silt in the wash water from the wheel from the wheel washing facility are settled out and removed before discharging into the storm drain.			Ø		
	Oil interceptor is provided in the drainage system and regularly emptied to					
6.10	prevent the release of oil and grease into the storm drainage system after			\square		
	accidental spillage.		_	7	_	
	Debris and rubbishes generated on site are collected, handled and disposed of			/		
6.11	properly to avoid them entering the two streams.			Ø		
	All fuel tanks and storage areas are provided with locks and be sited on sealed					
6.12	areas, within bunds of a capacity equal to 110% of the storage capacity of the			\Box		<u></u>
	largest tank.					
	Open storm water drains and culverts near the works area are covered to block the					
6.13	entrance of large debris and refuse.		Ш	Д	Ш	
	Portable chemical toilets handle the sewage from construction work force if the					
	existing toilets in the Site are not adequate. Licensed contractors who are			Ø	_	
6.14	responsible for appropriate disposal and maintenance of these facilities provide					
	appropriate and adequate portable toilets.					
	Sheet piling is provided at suitable location around the basement excavation to					
	reduce the effect of lowering the water table from any dewatering process. Any					No gnalunda
	discharge of groundwater pumped out from any dewatering process of the	_/	_	_		
6.15	construction works is treated to comply with the standards set in the relevant	Ы		Ц		vous generated
	discharge licence prior discharge. No discharge of the groundwater is allowed into					
	the two streams.					
7.00	Ecology (Construction Phase)			0.00		
	Any affected trees are transplanted to grassland / scrubland within the Wo Hop					
7.01	Shek Cemetery.			Ø		
	Temporary accesses to the work sites are carefully planned and located to			_/		
7.02	minimise disturbance caused to the streams and nearby habitats.			Ø		
7.02	Less or smaller construction plants are used to reduce disturbance to the nearby					
7.03	habitats.	Ш	Ш	Ы	Ш	
7.04	Vehicles and other plants are carefully maintained and properly used to minimise			4		
7.04	the chance for accidental spillage.	Ш	Ш		Ш	
7.05	Any spillages that do occur are quickly identified and appropriately cleaned up]	1. 11. 1
7.05	before they can contaminate streams or groundwater.		Ц	Ш	П	100 Spillage occures
	Basement formation or any construction activities likely to pump out a large					No Soudute
7.06	quantity of groundwater are protected with sheet-piling at suitable locations	Ø				has penanated
	around the basement footprint, or by any like method.	,				V
7.07	No groundwater is pumped back to the two stream courses to protect the natural					No Sundanatu
7.07	integrity of the stream habitat and the associated organism.	لعر	Ц	Ш		was generated



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
7.08	Sturdy 1.8 metres protective fencings are located at the edge of the tree canopy	П	П	d	П	
	but not around the trunk.					
	Works beneath the tree canopy are avoided: If encroachment under the canopy		/			
7.09	area is unavoidable, adequate protections are provided to ensure no damage of any			ď		
	part of the tree would occur due to the encroachment.					100
	Any tree transplanting and planting works are implemented by an approved			,		
7.10	Landscape Contractor. Quality control of the work is undertaken by a qualified			Ø		-
	Landscape Architect through site inspections and approval of works.					
7.11	Construction works are restricted within works area which are clearly defined.			Ø		
7.12	Woodland or other habitats that are affected by the construction works are well-			Z		
7.12	defined and minimised.	Ы		بع	ш	
7.13	Human inference to habitats beyond the site boundary and habitats proposed to be			И		
7.13	retained are avoided by providing temporary barricades.			,		
7.14	Works area is reinstated immediately after completion of the construction.	ø				has not been complety
7.15	Uncontrolled burning of refuse is strictly prohibited. Appropriate fire control					
7.15	measures are provided in order to protect nearby habitats.			7		
7.16	Trees requiring transplantation or protection are identified based on the		1 [
7.10	information illustrated in the Tree Survey Report.					
7.17	Is layout of the Project carefully designed to avoid or minimize the area of habitat					
,	loss and the numbers of trees to be felled?					
	All trees are preserved as far as possible, especially species of conservation		200-000			
7.18	concern. Recommendations provided in the Tree Survey Report to mitigate			Ø		
	impacts on trees shall be followed.					
	Disturbance to the two plant species of conservation concern, namely Aquilaria					
	sinensis and Cibotium barometz, is avoided. Where removal of these species is					
7.19	unavoidable, it is recommended to transplant them to habitats with similar	19				
	conditions. Following transplantation, regular monitoring of these plants is	'				
	conducted by a suitable qualified botanist / horticulturist over a 12-month period;					
7.20	Compensatory planting of the felled trees follows the Technical	M				No storthe work
	Circular No. 3/2006 issued by ETWB.	~				1 1 1 1 1 1 1
7.21	The Site inside or in the proximity of the streams and nearby habitats is			Ø		
	temporarily isolated, by placing of sandbags or silt curtains with lead edge at the					
	bottom and properly supported props, to prevent adverse impacts on these areas.			/		



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

Contract no. AL G513 Expansion of Wo Hop Shek Crematorium

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
7.22	Appropriate storage locations are situated well away from the streams and nearby habitats for the temporary storage of materials (e.g. equipment, filling materials, chemicals and fuel) and temporary stockpile of construction debris and spoil are identified before commencement of the works.			P		
7.23	Stockpiling of construction materials, are covered and located away from the streams and nearby habitats.			4		
7.24	Construction debris and spoil are covered up and/or properly disposed of as soon as possible to avoid being washed into the streams and nearby habitats by rain.			d		
7.25	Construction effluent, site runoff and sewage is properly collected and/or treated.			ď		
7.26	Proper locations for discharge outlets of any wastewater treatment facilities well away from the streams and nearby habitats are identified.			Ø		-
7.27	Vehicles and other plant are carefully maintained and properly used to minimise the chance for accidental spillage.			$ ot\!\!\!/$		
7.28	Temporary geo-textile silt fences around earth moving works are erected to trap any sediments being washed away and prevent them from entering surrounding areas.			Ø		
7.29	Exposed soil or other loose materials are covered with tarpaulins to prevent erosion, and then seeded and covered with a biodegradable geotextile blanket for erosion control purposes.			d		

*Remarks:

N/A = Not applicable at current stage

N/O = Not observed in the site walk

Yes = Compliance

No = Non-compliance



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

Remark / Follow up of Observation(s) and Non-compliance(s) of Last Weekly Site Inspection:							
Observations:	Nil						
Renarks;	Mil						
St. 4							
Signatures:	0	A 15 de	IFO.				
ET	Contractor's	Architect's	IEC's Representative				
(Name: funn Wf.)	(Name: M-7, WONG)	Representative (Name: F-L-HUNY)	(Name:)				



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

Contract no. AL G513 Expansion of Wo Hop Shek Crematorium

WEEKLY ENVIRONMENTAL INSPECTION CHECKLIST

			y:	ET:	Johnny	Johnny Knong		R: F.L. Hung
Inspec	etion Time: 15:00		Contra	ictor:	M.Y.	Norg	IE	EC:
Weath					9			
Condi	tion Sunny Fine	☐ Overcast	□ Drizzle		□ Rain		☐ Stor	m 🗆 Hazy
Temp	erature 27.\ °C		Humidity		☐ Hig	h	Ø Moo	derate
Wind	□ Calm ☑ Light	□ Breeze	☐ Strong	3				
	,							
	Environmental Mitigation Measures			N/A*	N/O*	Yes*	No*	Photo/Remarks
1.00	Air (Construction Phase)		7 100 400					
1.01	Vehicle washing facilities (including a high p	ressure water jet) were	e provided at	П	П	Ø		
	every discernible or designated vehicle exit po	int.				_		3-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1
1.02	Road between the washing facilities and the	exit point is paved v	vith concrete,	П	П	И		
	bituminous or hardcore material.				. .			
	Every main haul road is paved with concrete					_/	14	
1.03	metal plates, and kept clear of dusty materials.	Or unpaved haul roads	and areas are	Ш		Д	ш	-
	sprayed with water to keep the entire road surf	20.00						
	Stockpile of dusty material including demolish							
	a) covered entirely by impervious sheeting, or							
1.04	b) placed in an area sheltered on the top and the				П	4		
	c) sprayed with water or a dust suppression c	hemical so as to maint	ain the entire					
	surface wet.	Y V Y						
1.05	Exposed earth is properly treated by compaction		0.00					
1.05	or seating with latex, vinyl, bitumen within si		construction		Ц	Щ		
	activity on the site or part of the site where the	exposed earth lies.				-		
1.06	Water is sprayed to all dusty materials before l	oading or transfer oper	ration.			Ø		
	Any debris is covered entirely by impervio	us sheeting or stored	l in a debris			/		
1.07	collection area sheltered on the top and the three	## T				Ø		-
1.08	Water is sprayed to debris before it is dumped	into a chute.						
	Vehicles for transporting dusty materials/spo	oils are covered with	tarpaulin or					
1.09	similar material. The cover extends over the ed	ges of the sides and ta	ilboards.	ш	Ц			
	Water is sprayed immediately to the working a	rea for uprooting of tre	es, shrubs, or			/		
1.10	vegetation or the removal of boulders, pole,	pillars before, during	and after the			Ø		
	operation.					,		
1.11	Workers at all levels are co-operative to avoid of	lust generation and dis	persion to the			\overline{M}	\Box	
1.11	surrounding environment.					<u></u>	ш	
2.00	Noise (Construction Phase)							



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
2.01	Only well-maintained plant is operated on site and the plant should be regularly serviced during the construction works.			Ø		
2.02	Plant used intermittently is turned off or throttled down when not in active use.			Ø		
2.03	Plant that emits noise strongly in one direction is oriented to face away from NSRs.			Ø		
2.04	Silencers, mufflers and enclosures for plant are applied where possible and maintained adequately throughout the works			Ø		
2.05	Where possible, mobile plant is sited away from NSRs			Ø		
2.06	PME is well maintained and used properly on site to minimise any excessive noise generated.			ď		
2.07	Stockpiles of excavated materials and other structures such as site buildings should be used effectively to screen noise from the works.			Ø		
3.00	Land Contamination (Construction Phase)					
	N/A to the Phase III development					
4.00	Waste Management (Construction Phase)					
4.01	The necessary waste disposal permits from the appropriate authorities are obtained, in accordance with the Waste Disposal Ordinance (Cap. 354), Waste Disposal (Chemical Waste) (General) Regulation and the Land (Miscellaneous Provision) Ordinance (Cap. 28).			7		
4.02	A billing account with EPD for disposal of construction waste is obtained.			P		
4.03	A Waste Management Plan (WMP), incorporated in an Environmental Management Plan (EMP) is prepared and submitted to the Engineer/Supervising Officer for approval. Reference is made to Environment, Transport and Works Bureau Technical Circular (Works) (ETWB TCW) 19/2005.			Ø		
4.04	An approved person to be responsible for good site practice is nominated, including arrangements for collection and effective disposal to an appropriate facility of all wastes generated at the site.			ď		
4.05	Is authorised or licensed waste hauler used to collect specific category of waste?			Ø		
4.06	A trip-ticket system is included as one of the contractual requirements and implemented by the Environmental Team to monitor the disposal of C&D and solid wastes at public filling facilities and landfills, and to control fly tipping. Reference is made to ETWB TCW No. 31/2004.			Ø		
4.07	Training of site personnel in proper waste management and chemical waste handling procedures.			Ø		



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
4.08	Is routine cleaning and maintenance programme for drainage systems, sumps and oil interceptors conducted?			7		
4.09	Are sufficient waste disposal points and regular collection for disposal provided?			Ø		
4.10	Are appropriate measures to minimise windblown litter and dust during transportation of waste, such as covering trucks or transporting wastes in enclosed containers adopted?			Ø		
4.11	Is recording system for the amount of wastes generated, recycled and disposed of (including the disposal sites) implemented?			Ø		
4.12	Segregation and storage of different types of waste in different containers, skips or stockpiles to enhance reuse or recycling of materials and their proper disposal.			9		
4.13	Encourage collection of aluminium cans, plastic bottles and packaging material (e.g. carton boxes) and office paper by individual collectors. Separately labelled bins are provided to help segregate this waste from other general refuse generated by the work force.			ø		
4.14	Are C&D materials reused when possible to reduce the amount of C&D material/waste?			Ø		
4.15	Are wood, steel and other metals separated for reuse and / or recycling prior to disposal of C&D waste to minimise the quantity of waste to be disposed of to landfill?			Ø		
4.16	Minimise the potential for damage or contamination of construction material by having proper storage and site practices.			Q [′]		
4.17	Plan and stock construction materials carefully to minimise the amount of surplus materials.			Ø		
4.18	Rock and soil generated from excavation are reused for site formation and excavated material from foundation work reused for landscaping as far as practicable to avoid disposal off-site.			7		
4.19	Is reuse of the public fill and C&D waste practiced on site as far as practicable?			Ø		
4.20	The handling of C&D materials is governed by WBTC No. 2/93. Inert C&D material (public fill) is directed to an approved public filling area or reclamation site, where it has the benefit of offsetting the need for removal of materials from borrow areas for reclamation purposes and helps to reduce the pressure on landfill sites.			Ø		
4.21	Are individuals or companies who deliver public fill to public filling areas obtained dumping licences?			70		



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
4.22	Are careful design, planning and good site management adopted to minimise overordering and generation of waste materials such as concrete, mortar and cement grouts? The design of formwork maximise the use of standard wooden or metal panels so that high reuse levels can be achieved. Alternatives such as steel formwork, plastic fencing and reusable site office structures are considered			Ø		
	to increase the potential for reuse and minimize C&D waste generation.					
4.23	The contractor uses as much as possible of the C&D material on-site. Proper segregation of waste types on site will increase the feasibility of certain components of the waste stream by recycling contractors.			Þ		
4.24	General refuse is stored in enclosed bins or compaction units separate from C&D and chemical wastes. A reputable waste collector is employed by the Contractor to remove general refuse from the site, separately from C&D and chemical wastes, on a daily or every second day basis to minimise odour, pest and litter impacts.			Þ		
	Chemical Waste					
4.25	Contractor registers with the EPD as chemical waste producer if any chemical waste is generated			Ø		
4.26	All the chemical waste is handled according to the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes. The chemical waste is stored and collected by an approved contractor for disposal at a licensed facility in accordance with the Waste Disposal (Chemical Waste) (General) Regulation.			Ø		
4.27	Principles of reuse and recycle chemical waste on site as far as practicable is adopted by the contractor.			Ø		
4.28	Are unused chemicals or those with remaining functional capacity reused as far as practicable?			Ø		
4.29	Disposal of chemical waste via a facility licensed to receive chemical waste, such as the Chemical Waste Treatment Facility at Tsing Yi, which offers a chemical waste collection service and can supply the necessary storage containers or a waste recycling plant approved by EPD.			Ø		
5.00	Landscape and Visual (Construction Phase)					1399
5.01	Do site offices have olive green roof and façade coating or colour that matche with existing environment?			Ø		
5.02	Are site offices and the construction yard decommissioned after construction?			Þ		
5.03	The height of site offices, including the rooftop does not exceed 10m, except building services equipment such as antennas, which exceeds 10 m but is coated in black.			1		



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
5.04	Is site hoarding with 2.4m height and colour in harmony with the surrounding environment erected along the site boundary until the completion of relevant construction phases?	Ø				site housey was
5.05	Are construction plants and building materials orderly and carefully stored to appear neat and avoid visibility from outside where practical?			Ø		
5.06	Are excess materials removed from site as soon as practical?			Ø		
5.07	Are all construction plants removed from site upon completion of construction works?	Ø				No plating work
5.08	Are construction lights oriented away from the viewing location of VSRs?			Ø		
5.09	Are all lightings facing sensitive receiver installed with frosted diffusers and reflective covers?			,ø		
5.10	Trees that require removal are transplanted on site if practical. If not practical, these trees will be transplanted in locations within the vicinity as approved by the Architect.			Ø		
5.11	Planting works are carried out under the supervision of a specialist landscape specialist.			Ø		
5.12	The rooftop of the cremation plant room is planted with lawn.	Ø				Lam has not kn
5.13	New trees, shrubs and groundcover are carefully selected and designed to homogenize with the environment.	Ø				No plantly work
5.14	No tree is transplanted or felled without prior approval by relevant Government departments.			Ø		-
5.15	All trees that are marked for retention are fenced off with a 1.2m high fence around the dripline of trees or larger area as far as feasible.	Ø				All the planting was
5.16	Transplant preparation works are carried out as soon as possible after the commencement of construction. Over-pruning such as hard pruning of tree crown, pollarding or topping are avoided. Rootball and crown pruning are carried out over at least 3 months.			P		
5.17	Existing shrub and ground cover planting areas that will not be removed are maintained in good condition and enhanced if practical.			Ø		
5.18	The chimney has been designed to have sculptural outlook and articulated. It is kept in proportion with the rest of the building.			Ø		
5.19	The chimney stack is designed to locate at the least conspicuous location of the site to VSRs.			d		
	200 00 00 00 00 00 00 00 00 00 00 00 00					



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
5.20	Bi-weekly checking would be performed on the nine Terminalia mantaly trees within and outside the works area of the Project, or otherwise if the transplantations are not carried out according to the plan.			7		
5.21	Are silting traps installed to minimize silting to streams?			Ø		
5.22	Is the tree compensation to tree loss ratio at least 1:1 in term of quantity? About 100 trees will be planted to compensate for the loss of 54 trees. 100 trees will be planted on site and others, in locations within the vicinity approved by the Architect	Ø				No planting would
5.23	Is amenity planting for open spaces included in the Project?	Ø				No Planty nousk
5.24	Is screen planting such as planting a roll of trees along the site boundary butting Kiu Tau Road carried out?	P				No planting work
5.25	Woodland mix, comprising of tree seedlings and shrubs, are planted within the Wo Hop Shek Cemetery to enhance the ecological value and compensatory of tree loss.	Ø				No plenting nort
5.26	Is the 10m height headroom cremation plant room half-sunken to reduce the visual impact to pedestrians?			Ø		
6.00	Water Quality (Construction Phase)					
6.01	Wastewater is properly treated to meet the discharge standards set out in the relevant Water Pollution Control Ordinance (WPCO) discharge licence. No direct discharge of site runoff into the two streams is allowed.			Ø		
6.02	Perimeter channels are provided to intercept storm runoff from outside the site. The channels are constructed in advance of site formation works and earthworks.			Ø		
6.03	Sand/silt removal facilities such as sand traps, silt traps and sediment basins are provided to remove sand/silt particles from runoff to meet the requirements of the Technical Memorandum standard under the WPCO.			Ø		
6.04	Works are carefully programmed to minimise soil excavation works during rainy seasons.	Þ				No excautin work
6.05	Exposed soil surfaces are protected by paving as soon as possible to reduce the potential of soil erosion.	Ø				No excautin work
6.06	Temporary access roads are protected by crushed gravel and exposed slope surfaces are protected when rainstorms are likely to occur.			Ø		
6.07	Trench excavation is avoided in the wet season as far as practicable, and if necessary, these trenches are excavated and backfilled in short sections.	P				No example nor
6.08	Open stockpiles of construction materials on site are covered with tarpaulin or similar fabric during rainstorms.			Ø		



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
6.09	Sand and silt in the wash water from the wheel from the wheel washing facility are settled out and removed before discharging into the storm drain.			Ø		
-	Oil interceptor is provided in the drainage system and regularly emptied to			/		
6.10	prevent the release of oil and grease into the storm drainage system after	П				
0.70	accidental spillage.		ш	Ϋ́	ш	
	Debris and rubbishes generated on site are collected, handled and disposed of		10-11-20	VA		
6.11	properly to avoid them entering the two streams.			7		
	All fuel tanks and storage areas are provided with locks and be sited on sealed				1.00	
6.12	areas, within bunds of a capacity equal to 110% of the storage capacity of the					
	largest tank.			l		
(12	Open storm water drains and culverts near the works area are covered to block the					
6.13	entrance of large debris and refuse.	Ш	⊔ ⊔	Д	П	
	Portable chemical toilets handle the sewage from construction work force if the					
6.14	existing toilets in the Site are not adequate. Licensed contractors who are			\overline{M}		
0.14	responsible for appropriate disposal and maintenance of these facilities provide	П	П		Ш	
	appropriate and adequate portable toilets.					
	Sheet piling is provided at suitable location around the basement excavation to					
	reduce the effect of lowering the water table from any dewatering process. Any					Noimhath
6.15	discharge of groundwater pumped out from any dewatering process of the					No swhath
0.13	construction works is treated to comply with the standards set in the relevant		Ш	ш	П	Mas German Vi
	discharge licence prior discharge. No discharge of the groundwater is allowed into					
	the two streams.					
7.00	Ecology (Construction Phase)					
7.01	Any affected trees are transplanted to grassland / scrubland within the Wo Hop					
7.01	Shek Cemetery.			<u></u>	ш	
7.02	Temporary accesses to the work sites are carefully planned and located to			И		
7.02	minimise disturbance caused to the streams and nearby habitats.					
7.03	Less or smaller construction plants are used to reduce disturbance to the nearby	П				
	habitats.					
7.04	Vehicles and other plants are carefully maintained and properly used to minimise					
	the chance for accidental spillage.					
7.05	Any spillages that do occur are quickly identified and appropriately cleaned up					Sunso oralling
	before they can contaminate streams or groundwater.	7				, stilled
	Basement formation or any construction activities likely to pump out a large					No grown the
7.06	quantity of groundwater are protected with sheet-piling at suitable locations	Ø				was senerated
	around the basement footprint, or by any like method.					A A.
7.07	No groundwater is pumped back to the two stream courses to protect the natural	Ø				No Svardudu
	integrity of the stream habitat and the associated organism.				_	5



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
7.08	Sturdy 1.8 metres protective fencings are located at the edge of the tree canopy			Ø		
	but not around the trunk.					
	Works beneath the tree canopy are avoided: If encroachment under the canopy					
7.09	area is unavoidable, adequate protections are provided to ensure no damage of any					
	part of the tree would occur due to the encroachment.					
	Any tree transplanting and planting works are implemented by an approved					
7.10	Landscape Contractor. Quality control of the work is undertaken by a qualified			\Box		
	Landscape Architect through site inspections and approval of works.			/		
7.11	Construction works are restricted within works area which are clearly defined.			Ø		
	Woodland or other habitats that are affected by the construction works are well-			\Box		
7.12	defined and minimised.		Ш		Ш	
	Human inference to habitats beyond the site boundary and habitats proposed to be			_/		
7.13	retained are avoided by providing temporary barricades.		Ш	Ш	Ш	
		_/				The construction work
7.14	Works area is reinstated immediately after completion of the construction.	Ø				too not beg carplety
7.15	Uncontrolled burning of refuse is strictly prohibited. Appropriate fire control					
7.15	measures are provided in order to protect nearby habitats.		Ш		ш	
	Trees requiring transplantation or protection are identified based on the			\Box		
7.16	information illustrated in the Tree Survey Report.	ш		Д	Ш	
	Is layout of the Project carefully designed to avoid or minimize the area of habitat					
7.17	loss and the numbers of trees to be felled?		Ш	Д	П	-
	All trees are preserved as far as possible, especially species of conservation					
7.18	concern. Recommendations provided in the Tree Survey Report to mitigate			\square		
	impacts on trees shall be followed.					
	Disturbance to the two plant species of conservation concern, namely Aquilaria					0.000
	sinensis and Cibotium barometz, is avoided. Where removal of these species is					
7.19	unavoidable, it is recommended to transplant them to habitats with similar			П	П	
********	conditions. Following transplantation, regular monitoring of these plants is	7				
	conducted by a suitable qualified botanist / horticulturist over a 12-month period;					
	Compensatory planting of the felled trees follows the Technical					1
7.20	Circular No. 3/2006 issued by ETWB.	9				No blands work
	The Site inside or in the proximity of the streams and nearby habitats is	/				
7.21	temporarily isolated, by placing of sandbags or silt curtains with lead edge at the					
7.21						
	bottom and properly supported props, to prevent adverse impacts on these areas.					



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

Contract no. AL G513 Expansion of Wo Hop Shek Crematorium

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
7.22	Appropriate storage locations are situated well away from the streams and nearby habitats for the temporary storage of materials (e.g. equipment, filling materials, chemicals and fuel) and temporary stockpile of construction debris and spoil are identified before commencement of the works.			ď		
7.23	Stockpiling of construction materials, are covered and located away from the streams and nearby habitats.			9		
7.24	Construction debris and spoil are covered up and/or properly disposed of as soon as possible to avoid being washed into the streams and nearby habitats by rain.			$ ot\!\!\!\!/$		
7.25	Construction effluent, site runoff and sewage is properly collected and/or treated.			'n		
7.26	Proper locations for discharge outlets of any wastewater treatment facilities well away from the streams and nearby habitats are identified.			$ ot\!\!\!/$		
7.27	Vehicles and other plant are carefully maintained and properly used to minimise the chance for accidental spillage.			Ø		
7.28	Temporary geo-textile silt fences around earth moving works are erected to trap any sediments being washed away and prevent them from entering surrounding areas.			P		
7.29	Exposed soil or other loose materials are covered with tarpaulins to prevent erosion, and then seeded and covered with a biodegradable geotextile blanket for erosion control purposes.			Ø		

*Remarks:

N/A = Not applicable at current stage

N/O = Not observed in the site walk

Yes = Compliance

No = Non-compliance



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

Remark / Follow up of Observation(s) and Non-compliance(s) of Last Weekly Site Inspection:								
Observation (S)?								
<i>\</i> ∨:\								
Reminder (5)?								
10.1								
Note Figure 4,7 displayed at	5 begand regard to the entrance of the	clause 3.6 of EP site.	has been					
Signatures:								
ET ET	Contractor's	Architect's	IEC's					
Representative	Representative	Representative	Representative					
(Name: Tohn & Lucy)	(Name: M. Y. WONG)	(Name: F-1-41N)	(Name:)					



1.06

1.07

1.08

Water is sprayed to all dusty materials before loading or transfer operation.

collection area sheltered on the top and the three sides.

Water is sprayed to debris before it is dumped into a chute.

Any debris is covered entirely by impervious sheeting or stored in a debris

Acuity Sustainability Consulting Limited

Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

Contract no. AL G513 Expansion of Wo Hop Shek Crematorium WEEKLY ENVIRONMENTAL INSPECTION CHECKLIST Inspection Date: 3 /5/222 Inspected by: Inspection Time: Weather Condition ✓ Sunny □ Overcast □ Drizzle ☐ Rain ☐ Storm ☐ Hazy Temperature Humidity ☐ High ☑ Moderate □ Low Light Wind ☐ Calm ☐ Breeze ☐ Strong **Environmental Mitigation Measures** N/A* N/O* Yes* No* Photo/Remarks 1.00 Air (Construction Phase) Vehicle washing facilities (including a high pressure water jet) were provided at 1.01 every discernible or designated vehicle exit point. Road between the washing facilities and the exit point is paved with concrete, 1.02 bituminous or hardcore material. Every main haul road is paved with concrete, bituminous hardcore materials or 1.03 metal plates, and kept clear of dusty materials. Or unpaved haul roads and areas are sprayed with water to keep the entire road surface wet. Stockpile of dusty material including demolished items is either: a) covered entirely by impervious sheeting, or 1.04 b) placed in an area sheltered on the top and the three sides, or c) sprayed with water or a dust suppression chemical so as to maintain the entire surface wet. Exposed earth is properly treated by compaction, hydroseeding, vegetation planting 1.05 or seating with latex, vinyl, bitumen within six months after the last construction activity on the site or part of the site where the exposed earth lies.

П



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
2.01	Only well-maintained plant is operated on site and the plant should be regularly serviced during the construction works			Ø		
2.02	Plant used intermittently is turned off or throttled down when not in active use.			Ø		
2.03	Plant that emits noise strongly in one direction is oriented to face away from NSRs.			Ø		
2.04	Silencers, mufflers and enclosures for plant are applied where possible and maintained adequately throughout the works			Ø		
2.05	Where possible, mobile plant is sited away from NSRs			Ø		
2.06	PME is well maintained and used properly on site to minimise any excessive noise generated.			ď		
2.07	Stockpiles of excavated materials and other structures such as site buildings should be used effectively to screen noise from the works.			Ø		
3.00	Land Contamination (Construction Phase)					
	N/A to the Phase III development					
4.00	Waste Management (Construction Phase)					
4.01	The necessary waste disposal permits from the appropriate authorities are obtained, in accordance with the Waste Disposal Ordinance (Cap. 354), Waste Disposal (Chemical Waste) (General) Regulation and the Land (Miscellaneous Provision) Ordinance (Cap. 28).			Ø		
4.02	A billing account with EPD for disposal of construction waste is obtained.			Ø		
4.03	A Waste Management Plan (WMP), incorporated in an Environmental Management Plan (EMP) is prepared and submitted to the Engineer/Supervising Officer for approval. Reference is made to Environment, Transport and Works Bureau Technical Circular (Works) (ETWB TCW) 19/2005.			Þ		
4.04	An approved person to be responsible for good site practice is nominated, including arrangements for collection and effective disposal to an appropriate facility of all wastes generated at the site.			Ø		
4.05	Is authorised or licensed waste hauler used to collect specific category of waste?			Ø		
4.06	A trip-ticket system is included as one of the contractual requirements and implemented by the Environmental Team to monitor the disposal of C&D and solid wastes at public filling facilities and landfills, and to control fly tipping. Reference is made to ETWB TCW No. 31/2004.			Ø		
4.07	Training of site personnel in proper waste management and chemical waste handling procedures.			Ø		



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
4.08	Is routine cleaning and maintenance programme for drainage systems, sumps and oil interceptors conducted?			7		
4.09	Are sufficient waste disposal points and regular collection for disposal provided?			P		
4.10	Are appropriate measures to minimise windblown litter and dust during transportation of waste, such as covering trucks or transporting wastes in enclosed containers adopted?			Ø		
4.11	Is recording system for the amount of wastes generated, recycled and disposed of (including the disposal sites) implemented?			Ø		
4.12	Segregation and storage of different types of waste in different containers, skips or stockpiles to enhance reuse or recycling of materials and their proper disposal.			Ø		
4.13	Encourage collection of aluminium cans, plastic bottles and packaging material (e.g. carton boxes) and office paper by individual collectors. Separately labelled bins are provided to help segregate this waste from other general refuse generated by the work force.			Þ		
4.14	Are C&D materials reused when possible to reduce the amount of C&D material/waste?			Ø		
4.15	Are wood, steel and other metals separated for reuse and / or recycling prior to disposal of C&D waste to minimise the quantity of waste to be disposed of to landfill?			Þ		
4.16	Minimise the potential for damage or contamination of construction material by having proper storage and site practices.			Ø		
4.17	Plan and stock construction materials carefully to minimise the amount of surplus materials.			Ø		
4.18	Rock and soil generated from excavation are reused for site formation and excavated material from foundation work reused for landscaping as far as practicable to avoid disposal off-site.			Ø		
4.19	Is reuse of the public fill and C&D waste practiced on site as far as practicable?			Ø		
4.20	The handling of C&D materials is governed by WBTC No. 2/93. Inert C&D material (public fill) is directed to an approved public filling area or reclamation site, where it has the benefit of offsetting the need for removal of materials from borrow areas for reclamation purposes and helps to reduce the pressure on landfill sites.			P		
4.21	Are individuals or companies who deliver public fill to public filling areas obtained dumping licences?			P		



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
4.22	Are careful design, planning and good site management adopted to minimise overordering and generation of waste materials such as concrete, mortar and cement grouts? The design of formwork maximise the use of standard wooden or metal panels so that high reuse levels can be achieved. Alternatives such as steel formwork, plastic fencing and reusable site office structures are considered to increase the potential for reuse and minimize C&D waste generation.			Ø		
4.23	The contractor uses as much as possible of the C&D material on-site. Proper segregation of waste types on site will increase the feasibility of certain components of the waste stream by recycling contractors.			Ø		
4.24	General refuse is stored in enclosed bins or compaction units separate from C&D and chemical wastes. A reputable waste collector is employed by the Contractor to remove general refuse from the site, separately from C&D and chemical wastes, on a daily or every second day basis to minimise odour, pest and litter impacts.			Þ		
	Chemical Waste					
4.25	Contractor registers with the EPD as chemical waste producer if any chemical waste is generated			Ø		
4.26	All the chemical waste is handled according to the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes. The chemical waste is stored and collected by an approved contractor for disposal at a licensed facility in accordance with the Waste Disposal (Chemical Waste) (General) Regulation.			Þ		
4.27	Principles of reuse and recycle chemical waste on site as far as practicable is adopted by the contractor.			ď		
4.28	Are unused chemicals or those with remaining functional capacity reused as far as practicable?			Ø		
4.29	Disposal of chemical waste via a facility licensed to receive chemical waste, such as the Chemical Waste Treatment Facility at Tsing Yi, which offers a chemical waste collection service and can supply the necessary storage containers or a waste recycling plant approved by EPD.			P		
5.00	Landscape and Visual (Construction Phase)					
5.01	Do site offices have olive green roof and façade coating or colour that matche with existing environment?			Ø		
5.02	Are site offices and the construction yard decommissioned after construction?			Ø		
5.03	The height of site offices, including the rooftop does not exceed 10m, except building services equipment such as antennas, which exceeds 10 m but is coated in black.			Þ		



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
5.04	Is site hoarding with 2.4m height and colour in harmony with the surrounding environment erected along the site boundary until the completion of relevant construction phases?	Ø				Title houser cas
5.05	Are construction plants and building materials orderly and carefully stored to appear neat and avoid visibility from outside where practical?			Þ		
5.06	Are excess materials removed from site as soon as practical?			Ø		
5.07	Are all construction plants removed from site upon completion of construction works?	Ø				No planting works.
5.08	Are construction lights oriented away from the viewing location of VSRs?			Ø		
5.09	Are all lightings facing sensitive receiver installed with frosted diffusers and reflective covers?			P		
5.10	Trees that require removal are transplanted on site if practical. If not practical, these trees will be transplanted in locations within the vicinity as approved by the Architect.			ø		
5.11	Planting works are carried out under the supervision of a specialist landscape specialist.			Ø		
5.12	The rooftop of the cremation plant room is planted with lawn.	Ø				plantyl
5.13	New trees, shrubs and groundcover are carefully selected and designed to homogenize with the environment.	Ø				No plantly work
5.14	No tree is transplanted or felled without prior approval by relevant Government departments.			Ø		
5.15	All trees that are marked for retention are fenced off with a 1.2m high fence around the dripline of trees or larger area as far as feasible.	Ø				All free pleathy works
5.16	Transplant preparation works are carried out as soon as possible after the commencement of construction. Over-pruning such as hard pruning of tree crown, pollarding or topping are avoided. Rootball and crown pruning are carried out over at least 3 months.			Ø		
5.17	Existing shrub and ground cover planting areas that will not be removed are maintained in good condition and enhanced if practical.			Ø		
5.18	The chimney has been designed to have sculptural outlook and articulated. It is kept in proportion with the rest of the building.			P		
5.19	The chimney stack is designed to locate at the least conspicuous location of the site to VSRs.			Ø		



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
5.20	Bi-weekly checking would be performed on the nine Terminalia mantaly trees within and outside the works area of the Project, or otherwise if the transplantations are not carried out according to the plan.			Ø		
5.21	Are silting traps installed to minimize silting to streams?			Ø		
5.22	Is the tree compensation to tree loss ratio at least 1:1 in term of quantity? About 100 trees will be planted to compensate for the loss of 54 trees. 100 trees will be planted on site and others, in locations within the vicinity approved by the Architect	Ø				No plathy work
5.23	Is amenity planting for open spaces included in the Project?	7				No planting work
5.24	Is screen planting such as planting a roll of trees along the site boundary butting Kiu Tau Road carried out?	7				No planting work
5.25	Woodland mix, comprising of tree seedlings and shrubs, are planted within the Wo Hop Shek Cemetery to enhance the ecological value and compensatory of tree loss.	7				No plenting nove
5.26	Is the 10m height headroom cremation plant room half-sunken to reduce the visual impact to pedestrians?			Þ		
6.00	Water Quality (Construction Phase)					
6.01	Wastewater is properly treated to meet the discharge standards set out in the relevant Water Pollution Control Ordinance (WPCO) discharge licence. No direct discharge of site runoff into the two streams is allowed.			Ø		
6.02	Perimeter channels are provided to intercept storm runoff from outside the site. The channels are constructed in advance of site formation works and earthworks.			Ø		
6.03	Sand/silt removal facilities such as sand traps, silt traps and sediment basins are provided to remove sand/silt particles from runoff to meet the requirements of the Technical Memorandum standard under the WPCO.			Ø		
6.04	Works are carefully programmed to minimise soil excavation works during rainy seasons.	Þ				No examples note
6.05	Exposed soil surfaces are protected by paving as soon as possible to reduce the potential of soil erosion.	P				No excanction work
6.06	Temporary access roads are protected by crushed gravel and exposed slope surfaces are protected when rainstorms are likely to occur.			Þ		
6.07	Trench excavation is avoided in the wet season as far as practicable, and if necessary, these trenches are excavated and backfilled in short sections.	Ø				No expandia unit
6.08	Open stockpiles of construction materials on site are covered with tarpaulin or similar fabric during rainstorms.			Ø		



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
6.09	Sand and silt in the wash water from the wheel from the wheel washing facility are settled out and removed before discharging into the storm drain.					
6.10	Oil interceptor is provided in the drainage system and regularly emptied to prevent the release of oil and grease into the storm drainage system after accidental spillage.			7		
6.11	Debris and rubbishes generated on site are collected, handled and disposed of properly to avoid them entering the two streams.			9		
6.12	All fuel tanks and storage areas are provided with locks and be sited on sealed areas, within bunds of a capacity equal to 110% of the storage capacity of the largest tank.			Ø		
6.13	Open storm water drains and culverts near the works area are covered to block the entrance of large debris and refuse.			Ø		
6.14	Portable chemical toilets handle the sewage from construction work force if the existing toilets in the Site are not adequate. Licensed contractors who are responsible for appropriate disposal and maintenance of these facilities provide appropriate and adequate portable toilets.			Ø		
6.15	Sheet piling is provided at suitable location around the basement excavation to reduce the effect of lowering the water table from any dewatering process. Any discharge of groundwater pumped out from any dewatering process of the construction works is treated to comply with the standards set in the relevant discharge licence prior discharge. No discharge of the groundwater is allowed into the two streams.	Þ				No guidurte vas consretet.
7.00	Ecology (Construction Phase)					
7.01	Any affected trees are transplanted to grassland / scrubland within the Wo Hop Shek Cemetery.			Ø		
7.02	Temporary accesses to the work sites are carefully planned and located to minimise disturbance caused to the streams and nearby habitats.			Ø		
7.03	Less or smaller construction plants are used to reduce disturbance to the nearby habitats.			Ø		
7.04	Vehicles and other plants are carefully maintained and properly used to minimise the chance for accidental spillage.			Ø		
7.05	Any spillages that do occur are quickly identified and appropriately cleaned up before they can contaminate streams or groundwater.	Ø				No will a spillage
7.06	Basement formation or any construction activities likely to pump out a large quantity of groundwater are protected with sheet-piling at suitable locations around the basement footprint, or by any like method.	Ø				No sundustar was generated.
7.07	No groundwater is pumped back to the two stream courses to protect the natural integrity of the stream habitat and the associated organism.	Ø				No smalmate viras strongtes



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
7.08	Sturdy 1.8 metres protective fencings are located at the edge of the tree canopy			Ø		
	but not around the trunk.					
	Works beneath the tree canopy are avoided: If encroachment under the canopy			/		
7.09	area is unavoidable, adequate protections are provided to ensure no damage of any			otag		
	part of the tree would occur due to the encroachment.					
	Any tree transplanting and planting works are implemented by an approved					
7.10	Landscape Contractor. Quality control of the work is undertaken by a qualified			Ø		
	Landscape Architect through site inspections and approval of works.			,		
7.11	Construction works are restricted within works area which are clearly defined.			ď		
20000	Woodland or other habitats that are affected by the construction works are well-			<u></u>		
7.12	defined and minimised.		Ц		Ш	
	Human inference to habitats beyond the site boundary and habitats proposed to be					
7.13	retained are avoided by providing temporary barricades.	ш	Ш		Ц	
						The construction number
7.14	Works area is reinstated immediately after completion of the construction.	Щ	Ш	П	Ц	has not kee completely
	Uncontrolled burning of refuse is strictly prohibited. Appropriate fire control					
7.15	measures are provided in order to protect nearby habitats.		Ш	Ш	Ц	
	Trees requiring transplantation or protection are identified based on the					
7.16	information illustrated in the Tree Survey Report.	Ш	Ц		Ш	
	Is layout of the Project carefully designed to avoid or minimize the area of habitat					
7.17	loss and the numbers of trees to be felled?		П	Ш	Ц	
	All trees are preserved as far as possible, especially species of conservation					
7.18	concern. Recommendations provided in the Tree Survey Report to mitigate			\square		
	impacts on trees shall be followed.			/		
	Disturbance to the two plant species of conservation concern, namely Aquilaria					
	sinensis and Cibotium barometz, is avoided. Where removal of these species is					
7.19	unavoidable, it is recommended to transplant them to habitats with similar	Ø				
	conditions. Following transplantation, regular monitoring of these plants is	1				
	conducted by a suitable qualified botanist / horticulturist over a 12-month period;					
	Compensatory planting of the felled trees follows the Technical		_			11 1 4 1
7.20	Circular No. 3/2006 issued by ETWB.	Щ			Ш	No plenting work
	The Site inside or in the proximity of the streams and nearby habitats is					
7.21	temporarily isolated, by placing of sandbags or silt curtains with lead edge at the			\square		
	bottom and properly supported props, to prevent adverse impacts on these areas.					
						h



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

Contract no. AL G513 Expansion of Wo Hop Shek Crematorium

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
7.22	Appropriate storage locations are situated well away from the streams and nearby habitats for the temporary storage of materials (e.g. equipment, filling materials, chemicals and fuel) and temporary stockpile of construction debris and spoil are identified before commencement of the works.			Ø		
7.23	Stockpiling of construction materials, are covered and located away from the streams and nearby habitats.			Ø		
7.24	Construction debris and spoil are covered up and/or properly disposed of as soon as possible to avoid being washed into the streams and nearby habitats by rain.			Ø		
7.25	Construction effluent, site runoff and sewage is properly collected and/or treated.			ď		
7.26	Proper locations for discharge outlets of any wastewater treatment facilities well away from the streams and nearby habitats are identified.			Þ		
7.27	Vehicles and other plant are carefully maintained and properly used to minimise the chance for accidental spillage.			d		
7.28	Temporary geo-textile silt fences around earth moving works are erected to trap any sediments being washed away and prevent them from entering surrounding areas.			Ø		
7.29	Exposed soil or other loose materials are covered with tarpaulins to prevent erosion, and then seeded and covered with a biodegradable geotextile blanket for erosion control purposes.			ø		

*Remarks: N/A = Not applicable at current stage

N/O = Not observed in the site walk

Yes = Compliance

No = Non-compliance



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

Remark / Follow up of Observation(s) and Non-cor	mpliance(s) of Last Weekl	y Site Inspection:	
Observation (s):			
WI			
Remin der Cs)			
- My Dusty material sh	he sovered	by impervious shorting	\$
			u.
Signatures:		10.	***
ET Contractor's		Architect's	IEC's
Representative Representative	ve	Representative	Representative
_ A. Ly	12	V	
(Name: Johny Kuong) (Name: M.	T. WONG)	(Name: FLUVIV)	(Name:)





APPENDIX L: STATISTICS ON COMPLAINT, NOTIFICATIONS OF SUMMONS AND SUCCESSFUL PROSECUTIONS





Statistical Summary of Exceedances

Air Quality							
Location	Action Level	Limit Level	Total				
A10	0	0	0				
A20	0	0	0				

Statistical Summary of Environmental Complaints

Reporting Period	Environmental Complaint Statistics					
1 0	Frequency	Cumulative	Complaint Nature			
01 May 2022 -	0	0	N/A			
31 May 2022	-		,			

Statistical Summary of Environmental Non-compliance

but to the first of the first o							
Reporting Period	Environmental Non-compliance Statistics						
	Frequency	Cumulative	Details				
01 May 2022 -	0	0	N/A				
31 May 2022	Ç	Ü	,				

Statistical Summary of Environmental Summons

Reporting Period	Env	Environmental Summons Statistics				
. 0	Frequency	Cumulative	Details			
01 May 2022 - 31 May 2022	0	0	N/A			

Statistical Summary of Environmental Prosecution

	otatisticai saininai y	of bilvir offinental 1 103cc	ution					
Reporting Period	Envi	Environmental Prosecution Statistics						
	Frequency	Cumulative	Details					
01 May 2022 -	0	0	N/A					
31 May 2022	U		11/11					





APPENDIX M: IMPACT MONITORING SCHEDULE OF NEXT REPORTING MONTH





Impact Monitoring Schedule for Expansion of Wo Hop Shek Crematorium Jun-22 Wed Fri Mon Tue Thur Sat Air monitoring for A10, A20 for 1-hr TSP and 24-hr TSP Monitoring Time: 0900-1630 Weekly ET site inspection and audit Air monitoring for A10, A20 for 1-hr TSP and 24-hr TSP Weekly ET site inspection and audit Monitoring Time: 0900-1630 Air monitoring for A10, A20 for 1-hr Air monitoring for A10, A20 for 1-hr TSP and 24-hr TSP TSP and 24-hr TSP Weekly ET site inspection and audit Monitoring Time: Monitoring Time: 0900-1630 0900-1630 Air monitoring for A10, A20 for 1-hr TSP and 24-hr TSP Weekly ET site inspection and audit Monitoring Time: 0900-1630 Air monitoring for A10, A20 for 1-hr TSP and 24-hr TSP Weekly ET site inspection and audit Monitoring Time: 0900-1630

2. Advance notification of the changes will be given to all relevant parties at lease 48 hours prior to implementation.

^{*}Remarks: 1. This impact monitoring schedule is subject to change due to adverse weather conditions or other rationales.






APPENDIX N: TRANSPORTATION ROUTES TO/FROM THE SITE






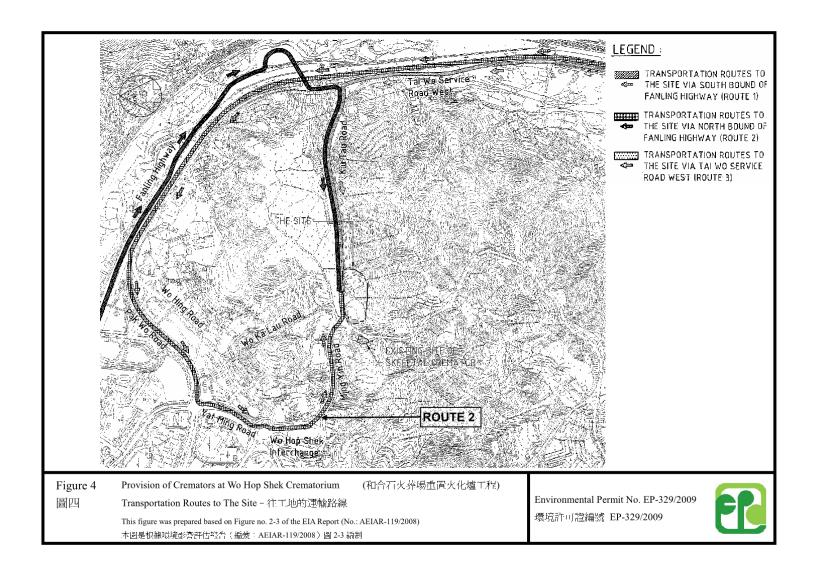





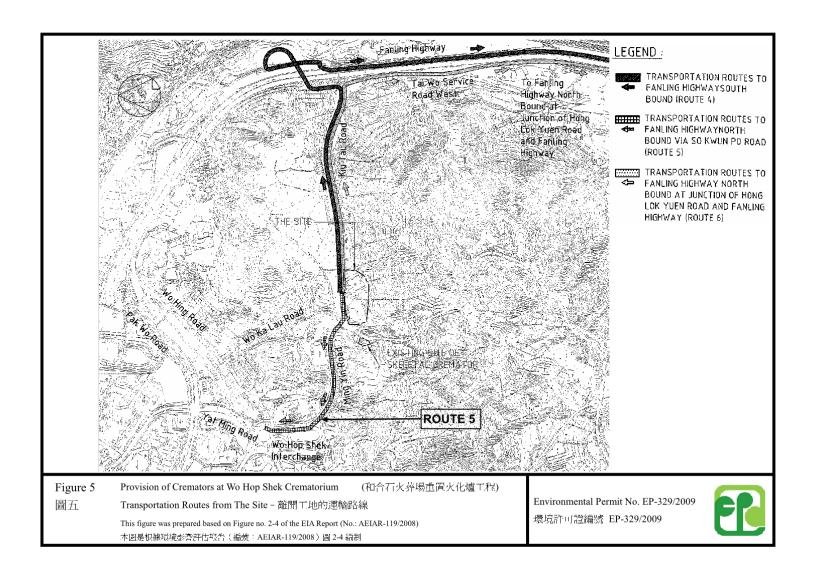

Contract No. AL G513 Expansion of Wo Hop Shek Crematorium Monthly EM&A Report No.27





APPENDIX O: LAB REPORT



Unit D, 12/F, Ford Glory Plaza, No. 37-39 Wing Hong Street, Cheung Sha Wan, Kowloon, Hong Kong Tel: (852) 2333 6823 Fax: (852) 2333 1316

Test Report

Page 1 of 2

Report Number

: Q220003aR220739

Job Number

: R220739

Issue Date

: 23/05/2022

Name of Applicant

: Acuity Sustainability Consulting Limited

Address of Applicant

: Unit E, 12/F, Ford Glory Plaza, No. 37-39 Wing Hong Street, Cheung

Sha Wan, Kowloon, Hong Kong

Project Name

: ASCL-2018028 Expansion of Wo Hop Shek Crematorium

Sample Description

: Total Suspended Particulates

Laboratory ID

: R220739/1-2

Date of Sampling

: 05/05/2022

Date Received

: 19/05/2022

Test Period

: 19/05/2022 - 20/05/2022

Test Required

: Total Suspended Particulates (TSP)

Method Used

: Gravimetric method

Test Result

: Refer to the results on page 2.

For and on behalf of

Acumen Laboratory and Testing Limited

Authorized Signature:

Hui Wai Fung, Huntington

Laboratory Manager

Chemical Division

Hong Kong Accreditation Service (HKAS) has accredited Acumen Laboratory and Testing Limited (Reg. No. HOKLAS 241 - TEST) under the Hong Kong Laboratory Accreditation Scheme (HOKLAS) for specific laboratory activities as listed in the HOKLAS directory of accredited laboratories. This report is issued subject to Acumen Laboratory and Testing Limited standard TERMS AND CONDITIONS, and shall not be reproduced except in full or with written approval by Acumen Laboratory and Testing Limited. The result(s) of this report are applied to the sample(s) submitted only.

E-mail: htthui@acumen-env.com



Tel: (852) 2333 6823 Fax: (852) 2333 1316

Test Report

Page 2 of 2

Report Number : Q220003aR220739

: R220739 Job Number

: 23/05/2022 Issue Date

Test Result:

TOOCITOOUTCE	The state of the s				
Lab ID	Date of Sampling	Client Sample ID	Initial Weight (g)	Final Weight (g)	Total Suspended Particulates (g)
R220739/1	05/05/2022	Fung Kai Liu Yun Sum Memorial School	2.7841	2.8025	0.0184
R220739/2	05/05/2022	Fanling Government Secondary School	2.7554	2.7656	0.0102

0.0066

1. < indicates less than. Note:

2. > indicates more than.

3. NA indicates Not Applicable.

End of Report

Hong Kong Accreditation Service (HKAS) has accredited Acumen Laboratory and Testing Limited (Reg. No. HOKLAS 241 - TEST) under the Hong Kong Laboratory Accreditation Scheme (HOKLAS) for specific laboratory activities as listed in the HOKLAS directory of accredited laboratories. This report is issued subject to Acumen Laboratory and Testing Limited standard TERMS AND CONDITIONS, and shall not be reproduced except in full or with written approval by Acumen Laboratory and Testing Limited. The result(s) of this report are applied to the sample(s) submitted only.



Unit D, 12/F, Ford Glory Plaza, No. 37-39 Wing Hong Street, Cheung Sha Wan, Kowloon, Hong Kong Tel: (852) 2333 6823 Fax: (852) 2333 1316

Test Report

Page 1 of 2

Report Number

: Q220003aR220738

Job Number

: R220738

Issue Date

: 23/05/2022

Name of Applicant

: Acuity Sustainability Consulting Limited

Address of Applicant

: Unit E, 12/F, Ford Glory Plaza, No. 37-39 Wing Hong Street, Cheung

Sha Wan, Kowloon, Hong Kong

Project Name

: ASCL-2018028 Expansion of Wo Hop Shek Crematorium

Sample Description

: Total Suspended Particulates

Laboratory ID

: R220738/1-2

Date of Sampling

: 11/05/2022

Date Received

: 19/05/2022

Test Period

: 19/05/2022 - 20/05/2022

Test Required

: Total Suspended Particulates (TSP)

Method Used

: Gravimetric method

Test Result

: Refer to the results on page 2.

For and on behalf of

Acumen Laboratory and Testing Limited

Authorized Signature:

Hui Wai Fung, Huntington

Laboratory Manager

Chemical Division

Hong Kong Accreditation Service (HKAS) has accredited Acumen Laboratory and Testing Limited (Reg. No. HOKLAS 241 - TEST) under the Hong Kong Laboratory Accreditation Scheme (HOKLAS) for specific laboratory activities as listed in the HOKLAS directory of accredited laboratories. This report is issued subject to Acumen Laboratory and Testing Limited standard TERMS AND CONDITIONS, and shall not be reproduced except in full or with written approval by Acumen Laboratory and Testing Limited. The result(s) of this report are applied to the sample(s) submitted only.



Unit D, 12/F, Ford Glory Plaza, No. 37-39 Wing Hong Street, Cheung Sha Wan, Kowloon, Hong Kong Tel: (852) 2333 6823 Fax: (852) 2333 1316

Test Report

Page 2 of 2

Report Number

: Q220003aR220738

Job Number

: R220738

Issue Date

: 23/05/2022

Test Result:

Lab ID	Date of Sampling	Client Sample ID	Initial Weight (g)	Final Weight (g)	Total Suspended Particulates (g)	
R220738/1	11/05/2022	Fung Kai Liu Yun Sum Memorial School	2.8049	2.8062	0.0013	
R220738/2	11/05/2022	Fanling Government Secondary School	2.8001	2.8067	0.0066	

0.0066

Note:

- 1. < indicates less than.
- 2. > indicates more than.
- 3. NA indicates Not Applicable.

End of Report

Hong Kong Accreditation Service (HKAS) has accredited Acumen Laboratory and Testing Limited (Reg. No. HOKLAS 241 - TEST) under the Hong Kong Laboratory Accreditation Scheme (HOKLAS) for specific laboratory activities as listed in the HOKLAS directory of accredited laboratories. This report is issued subject to Acumen Laboratory and Testing Limited standard TERMS AND CONDITIONS, and shall not be reproduced except in full or with written approval by Acumen Laboratory and Testing Limited. The result(s) of this report are applied to the sample(s) submitted only.



Unit D, 12/F, Ford Glory Plaza, No. 37-39 Wing Hong Street, Cheung Sha Wan, Kowloon, Hong Kong Tel: (852) 2333 6823 Fax: (852) 2333 1316

Test Report

Page 1 of 2

Report Number

: Q220003aR220797

Job Number

: R220797

Issue Date

: 30/05/2022

Name of Applicant

: Acuity Sustainability Consulting Limited

Address of Applicant

: Unit E, 12/F, Ford Glory Plaza, No. 37-39 Wing Hong Street, Cheung

Sha Wan, Kowloon, Hong Kong

Project Name

: ASCL-2018028 Expansion of Wo Hop Shek Crematorium

Sample Description

: Total Suspended Particulates

Laboratory ID

: R220797/1-2

Date of Sampling

: 17/05/2022

Date Received

: 24/05/2022

Test Period

: 24/05/2022 - 25/05/2022

Test Required

: Total Suspended Particulates (TSP)

Method Used

: Gravimetric method

Test Result

: Refer to the results on page 2.

For and on behalf of

Acumen Laboratory and Testing Limited

Authorized Signature:

Hui Wai Fung, Huntington

Laboratory Manager

Chemical Division

Hong Kong Accreditation Service (HKAS) has accredited Acumen Laboratory and Testing Limited (Reg. No. HOKLAS 241 - TEST) under the Hong Kong Laboratory Accreditation Scheme (HOKLAS) for specific laboratory activities as listed in the HOKLAS directory of accredited laboratories. This report is issued subject to Acumen Laboratory and Testing Limited standard TERMS AND CONDITIONS, and shall not be reproduced except in full or with written approval by Acumen Laboratory and Testing Limited. The result(s) of this report are applied to the sample(s) submitted only.



Fax: (852) 2333 1316 Tel: (852) 2333 6823

Test Report

Page 2 of 2

Report Number

: Q220003aR220797

Job Number

: R220797

Issue Date

: 30/05/2022

Test Result:

Lab ID	Date of Sampling	Client Sample ID	Initial Weight (g)	Final Weight (g)	Total Suspended Particulates (g)
R220797/1	17/05/2022	Fung Kai Liu Yun Sum Memorial School	2.7456	2.7836	0.0380
R220797/2	17/05/2022	Fanling Government Secondary School	2.7436	2.8265	0.0829

0.00662.8565

- 1. < indicates less than.
- 2. > indicates more than.
- 3. NA indicates Not Applicable.

End of Report

Hong Kong Accreditation Service (HKAS) has accredited Acumen Laboratory and Testing Limited (Reg. No. HOKLAS 241 - TEST) under the Hong Kong Laboratory Accreditation Scheme (HOKLAS) for specific laboratory activities as listed in the HOKLAS directory of accredited laboratories. This report is issued subject to Acumen Laboratory and Testing Limited standard TERMS AND CONDITIONS, and shall not be reproduced except in full or with written approval by Acumen Laboratory and Testing Limited. The result(s) of this report are applied to the sample(s) submitted only.



Unit D, 12/F, Ford Glory Plaza, No. 37-39 Wing Hong Street, Cheung Sha Wan, Kowloon, Hong Kong Tel: (852) 2333 6823 Fax: (852) 2333 1316

Test Report

Page 1 of 2

Report Number

: Q220003aR220830

Job Number

: R220830

Issue Date

: 06/06/2022

Name of Applicant

: Acuity Sustainability Consulting Limited

Address of Applicant

: Unit E, 12/F, Ford Glory Plaza, No. 37-39 Wing Hong Street, Cheung

Sha Wan, Kowloon, Hong Kong

Project Name

: ASCL-2018028 Expansion of Wo Hop Shek Crematorium

Sample Description

: Total Suspended Particulates

Laboratory ID

: R220830/1-2

Date of Sampling

: 23/05/2022

Date Received

: 01/06/2022

Test Period

: 01/06/2022 - 02/06/2022

Test Required

: Total Suspended Particulates (TSP)

Method Used

: Gravimetric method

Test Result

: Refer to the results on page 2.

For and on behalf of

Acumen Laboratory and Testing Limited

Authorized Signature:

Hui Wai Fung, Huntington

Laboratory Manager

Chemical Division

Hong Kong Accreditation Service (HKAS) has accredited Acumen Laboratory and Testing Limited (Reg. No. HOKLAS 241 - TEST) under the Hong Kong Laboratory Accreditation Scheme (HOKLAS) for specific laboratory activities as listed in the HOKLAS directory of accredited laboratories. This report is issued subject to Acumen Laboratory and Testing Limited standard TERMS AND CONDITIONS, and shall not be reproduced except in full or with written approval by Acumen Laboratory and Testing Limited. The result(s) of this report are applied to the sample(s) submitted only.

E-mail: htthui@acumen-env.com



Tel: (852) 2333 6823 Fax: (852) 2333 1316

Test Report

Page 2 of 2

Report Number

: Q220003aR220830

Job Number

: R220830

Issue Date

: 06/06/2022

Test Result:

Lab ID	Date of Sampling	Client Sample ID	Initial Weight (g)	Final Weight (g)	Total Suspended Particulates (g)
R220830/1	23/05/2022	Fung Kai Liu Yun Sum Memorial School	2.7682	2.8266	0.0584
R220830/2	23/05/2022	Fanling Government Secondary School	2.7430	2.7722	0.0292

Note:

1. < indicates less than.

2. > indicates more than.

3. NA indicates Not Applicable.

End of Report

Hong Kong Accreditation Service (HKAS) has accredited Acumen Laboratory and Testing Limited (Reg. No. HOKLAS 241 - TEST) under the Hong Kong Laboratory Accreditation Scheme (HOKLAS) for specific laboratory activities as listed in the HOKLAS directory of accredited laboratories. This report is issued subject to Acumen Laboratory and Testing Limited standard TERMS AND CONDITIONS, and shall not be reproduced except in full or with written approval by Acumen Laboratory and Testing Limited. The result(s) of this report are applied to the sample(s) submitted only.



Tel: (852) 2333 6823 Fax: (852) 2333 1316

Test Report

Page 1 of 2

Report Number

: Q220003aR220831

Job Number

: R220831

Issue Date

: 06/06/2022

Name of Applicant

: Acuity Sustainability Consulting Limited

Address of Applicant

: Unit E, 12/F, Ford Glory Plaza, No. 37-39 Wing Hong Street, Cheung

Sha Wan, Kowloon, Hong Kong

Project Name

: ASCL-2018028 Expansion of Wo Hop Shek Crematorium

Sample Description

: Total Suspended Particulates

Laboratory ID

: R220831/1-2

Date of Sampling

: 28/05/2022

Date Received

: 31/05/2022

Test Period

: 31/05/2022 - 01/06/2022

Test Required

: Total Suspended Particulates (TSP)

Method Used

: Gravimetric method

Test Result

: Refer to the results on page 2.

For and on behalf of

Acumen Laboratory and Testing Limited

Authorized Signature:

Laboratory Manager **Chemical Division**

Hong Kong Accreditation Service (HKAS) has accredited Acumen Laboratory and Testing Limited (Reg. No. HOKLAS 241 - TEST) under the Hong Kong Laboratory Accreditation Scheme (HOKLAS) for specific laboratory activities as listed in the HOKLAS directory of accredited laboratories. This report is issued subject to Acumen Laboratory and Testing Limited standard TERMS AND CONDITIONS, and shall not be reproduced except in full or with written approval by Acumen Laboratory and Testing Limited. The result(s) of this report are applied to the sample(s) submitted only.



Tel: (852) 2333 6823 Fax: (852) 2333 1316

Test Report

Page 2 of 2

Report Number

: Q220003aR220831

Job Number

: R220831

Issue Date

: 06/06/2022

Test Result:

Lab ID	Date of Sampling	Client Sample ID	Initial Weight (g)	Final Weight (g)	Total Suspended Particulates (g)
R220831/1	28/05/2022	Fung Kai Liu Yun Sum Memorial School	2.7418	2.7809	0.0391
R220831/2	28/05/2022	Fanling Government Secondary School	2.7435	2.7985	0.0550

Note:

- 1. < indicates less than.
- 2. > indicates more than.
- 3. NA indicates Not Applicable.

End of Report

Hong Kong Accreditation Service (HKAS) has accredited Acumen Laboratory and Testing Limited (Reg. No. HOKLAS 241 - TEST) under the Hong Kong Laboratory Accreditation Scheme (HOKLAS) for specific laboratory activities as listed in the HOKLAS directory of accredited laboratories. This report is issued subject to Acumen Laboratory and Testing Limited standard TERMS AND CONDITIONS, and shall not be reproduced except in full or with written approval by Acumen Laboratory and Testing Limited. The result(s) of this report are applied to the sample(s) submitted only.