

Lam Geotechnics Limited

CONTRACT NO: HK/2011/07

WANCHAI DEVELOPMENT PHASE II AND CENTRAL WANCHAI BYPASS SAMPLING, FIELD MEASUREMENT AND TESTING WORK (STAGE 2)

ENVIRONMENTAL PERMIT NO. EP- 416/2011 AND FEP-01/416/2011

SHATIN TO CENTRAL LINK (SCL) PROTECTION WORKS AT CAUSEWAY BAY TYPHOON SHELTER (CBTS)

MONTHLY ENVIRONMENTAL MONITORING & AUDIT REPORT

-FEBRUARY 2013 -

CLIENTS:

Civil Engineering and Development Department

and

Highways Department

PREPARED BY:

Lam Geotechnics Limited

11/F Centre Point 181-185 Gloucester Road, Wanchai, H.K.

Telephone: (852) 2882-3939 Facsimile: (852) 2882-3331 E-mail: <u>info@lamenviro.com</u> Website: <u>http://www.lamenviro.com</u>

CERTIFIED BY:

Raymond Dai Environmental Team Leader

DATE:

8 March 2013

ENVIRON

Ref.: AACWBIECEM00_0_3694L.13

8 March 2013

By Post and Fax (2691 2649)

AECOM Asia Company Limited 8/F, Tower 2 Grand Central Plaza 138 Shatin Rural Committee Road, Shatin, New Territories, Hong Kong

Attention: Mr. Kelvin CHENG

Dear Sir,

Re: Shatin to Central Link – Protection Works at Causeway Bay Typhoon Shelter Monthly Environmental Monitoring and Audit Report (February 2013) for EP-416/2011 & FEP-01/416/2011

Reference is made to the Environmental Team's submission of the captioned Monthly Environmental Monitoring and Audit (EM&A) Report for February 2013 received by email on 8 March 2013.

Please be informed that we have no adverse comment on the captioned submission. We write to verify the captioned submission in accordance with Condition 3.4 in the captioned Environmental Permit.

Thank you very much for your kind attention and please do not hesitate to contact the undersigned should you have any queries.

Yours sincerely,

David Yeung Independent Environmental Checker

c.c.	HyD
	HyD
	CEDD
	AECOM
	AECOM
	MTRCL
	Lam

Mr. Cyrus Wong Mr. Jones Lai Mr. Patrick Keung Mr. Peter Poon Mr. Frankie Fan Mr. Richard Kwan Mr. Raymond Dai by fax: 2761 1508 by fax: 2714 5289 by fax: 2577 5040 by fax: 3912 3010 by fax: 2587 1877 by fax: 2993 7577 by fax: 2882 3331

Q:\Projects\AACWBIECEM00\Corr\AACWBIECEM00_0_3694L 13.doc



TABLE OF CONTENTS

EX	ECUT	IVE SUMMARY	3
1	INTR	ODUCTION	5
	1.1 1.2	Scope of the Report Structure of the Report	
2	PRO	IECT BACKGROUND	7
	2.1 2.2 2.3	Background Scope of the Project and Site Description Project Organization and Contact Personnel	7
3	STAT	TUS OF REGULATORY COMPLIANCE	9
	3.1	Status of Environmental Licensing and Permitting under the Project	10
4	MON	ITORING REQUIREMENTS	12
	4.1 4.2 4.3	Noise Monitoring Air quality monitoring Water Quality Monitoring	13
5	MON	ITORING RESULTS	18
	5.1 5.2 5.3 5.4	Noise Monitoring Results Air quality monitoring Results Water quality monitoring Results Waste Monitoring Results	18 18
6	COM	PLIANCE AUDIT	20
	6.1 6.2 6.3 6.4 6.5	Noise Monitoring Air quality monitoring Water quality monitoring Review of the Reasons for and the Implications of Non-compliance Summary of action taken in the event of and follow-up on non-compliance	20 20 20
7		ULATIVE CONSTRUCTION IMPACT DUE TO THE CONCURRENT IECTS	21
8	ENV	RONMENTAL SITE AUDIT	27
9		PLAINTS, NOTIFICATION OF SUMMONS AND PROSECUTION	
10.	CON	CLUSION	29

1



LIST OF TABLES

- Table I
 Summary of Water Quality Monitoring Exceedances in Reporting Month
- Table 2.1
 Schedule 2 Designated Projects under this Project
- Table 2.3
 Contact Details of Key Personnel
- Table 3.1Summary of the current status on licences and/or permits on environmental
protection pertinent to the Project
- Table 3.2Cumulative Summary of Valid Licences and Permits under Contract no.HY/2009/15
- Table 3.3 Summary of submission status under EP/416/2011 and FEP-01/416/2011
- Table 4.1
 Noise Monitoring Stations
- Table 4.2Air quality monitoring Stations
- Table 4.3
 Marine Water Quality Stations for Water Quality Monitoring
- Table 4.4
 Marine Water Quality Monitoring Frequency and Parameters
- Table 5.1 Noise Monitoring Station
- Table 5.2
 Air quality monitoring Station
- Table 5.3
 Water quality monitoring Station
- Table 5.4
 Summary of Water Quality Monitoring Exceedance in Reporting Month
- Table 5.5
 Details of Waste Disposal
- Table 8.1 Summary of Environmental Inspections for Contract no. HY/2009/15
- Table 9.1
 Cumulative Statistics on Complaints
- Table 9.2
 Cumulative Statistics on Successful Prosecutions
- Table 10.1
 Summary of Key Construction Activities of Individual Contract(s) to be commenced in Coming Reporting Month

LIST OF FIGURES

- Figure 2.1 Project Layout
- Figure 2.2 Project Organization Chart
- Figure 2.3 Locations of Environmental Monitoring Stations

LIST OF APPENDICES

- Appendix 3.1 Environmental Mitigation Implementation Schedule
- Appendix 4.1 Action and Limit Level
- Appendix 4.2 Copies of Calibration Certificates
- Appendix 5.1 Monitoring Schedule for Reporting Month and Coming month
- Appendix 5.2 Noise Monitoring Results and Graphical Presentations
- Appendix 5.3
 Air Quality Monitoring Results and Graphical Presentations

 Appendix 5.4
 Water Quality Monitoring Results and Graphical Presentations
- Appendix 5.4 Water Quality Moni Appendix 6.1 Event Action Plans
- <u>Appendix 6.2</u> Summary of Notification of Exceedances
- Appendix 7.1 Complaint Log
- Appendix 8.1 Construction Programme of Individual Contracts



EXECUTIVE SUMMARY

- i. This is the Environmental Monitoring and Audit (EM&A) Monthly Report February 2013 specific for Environmental Permit no. EP-416/2011 and Further Environmental Permit no. FEP-01/416/2011 on Shatin to Central Link (SCL) Protection Works at Causeway Bay Typhoon Shelter (CBTS). The Shatin to Central Link (SCL) protection works inside the Causeway Bay Typhoon Shelter (CBTS) is entrusted to the Central-Wanchai Bypass (CWB) project and will be carried out concurrently with the construction of the CWB under contract no. HY/2009/15. The construction impact of the SCL protection works on the environment is monitored together with that of the CWB by the Environmental Team (ET) employed under Contractor No. HK/2011/07. This EM&A report captures the environmental monitoring findings and information recorded during the period January 2013 to February 2013. The cut-off date of reporting is on the 27th of each reporting month.
- ii. In the reporting period, the principal work activity is included as follows:
 - Excavation and Lateral Support at ME4

Noise Monitoring

iii. Noise monitoring during daytime was conducted at M2b - Noon-day gun area on a weekly basis. No exceedance was recorded in the reporting period.

Air quality monitoring

- iv. 1-hour and 24-hour Total Suspended Particulates (TSP) monitoring were conducted at CMA3a - CWB PRE Site Office Area. No action and limit level exceedance was recorded in the reporting period.
- v. Due to lack of electricity supply, the following 24hr-TSP monitoring was rescheduled: CMA3a: from 26 Jan 2013 to 28 Jan 2013

Water Quality monitoring

- vi. Water quality monitoring at C7 was conducted three days per week during the reporting period. The action and limit level exceedance of water quality monitoring are summarized in *Table I*.
- vii. Water quality monitoring at C7 was temporarily suspended on 12 February 2013 during midflood and mid-ebb as confirmed by contractors no construction activity was conducted during Chinese New Year holiday.
- viii. No exceedance was recorded at C7 in this reporting month.

	Water				Mid-ebb								
Contract no.	quality monitoring	D	0	Turb	oidity	S	S	D	0	Turb	oidity	S	S
Station	AL	LL	AL	LL	AL	LL	AL	LL	AL	LL	AL	LL	
HY/2009/15	C7	0	0	0	0	0	0	0	0	0	0	0	0
То	tal	0	0	0	0	0	0	0	0	0	0	0	0

Table I Summary of Water Quality Monitoring Exceedances in Reporting Month



_

Complaints, Notifications of Summons and Successful Prosecutions

ix. There was no complaint received in this reporting period.

Site Inspections and Audit

- x. The Environmental Team (ET) conducted weekly site inspections for Contract no. HY/2009/15
 Shatin to Central Link (SCL) Protection Works at Causeway Bay Typhoon Shelter (CBTS), in this reporting period. No non-conformance was identified during the site inspections.
 - Future Key Issues
- xi. In coming reporting month, the principal work activity is anticipated as follows:
 - Excavation and Lateral Support at ME4



1 INTRODUCTION

1.1 Scope of the Report

- 1.1.1. Lam Geotechnics Limited (LGL) has been appointed to work as the Environmental Team (ET) under Environmental Permit no. EP-416/2011 and Further Environmental permit nos. FEP-01/416/2011 to implement the Environmental Monitoring and Audit (EM&A) programme as stipulated in the EM&A Manual of the approved Environmental Impact Assessment (EIA) Report for Shatin to Central Link (SCL) Protection Works at Causeway Bay Typhoon Shelter (CBTS) (Register No.: AEIAR-159/2011) and in the EM&A Manual of the approved EIA Report for Shatin to Central Link Protection Works at Causeway Bay Typhoon Shelter (Register No. AEIAR-159/2011).
- 1.1.2. This report presents the environmental monitoring and auditing work carried out in accordance to the Section 7.5 of EM&A Manual and Environmental Monitoring and Audit Requirements of Environmental permit nos. EP-416/2011 and Further Environmental permit nos. FEP-01/416/2011.
- 1.1.3. This report documents the finding of EM&A works for Environmental Permit (EP) no. EP-416/2011, Further Environmental Permit (FEP) nos. FEP-01-416/2011 during the period January 2013 to February 2013. The cut-off date of reporting is at 27th of each reporting month.

1.2 Structure of the Report

- **Section 1** *Introduction* details the scope and structure of the report.
- Section 2 *Project Background* summarizes background and scope of the project, site description, project organization and contact details of key personnel during the reporting period.
- **Section 3 Status of Regulatory Compliance** summarizes the status of valid Environmental Permits / Licenses during the reporting period.
- Section 4 *Monitoring Requirements* summarizes all monitoring parameters, monitoring methodology and equipment, monitoring locations, monitoring frequency, criteria and respective event and action plan and monitoring programmes.
- **Section 5** *Monitoring Results* summarizes the monitoring results obtained in the reporting period.
- Section 6 Compliance Audit summarizes the auditing of monitoring results, all exceedances environmental parameters.
- Section 7 Cumulative Construction Impact due to the Concurrent Projects -



summarizes the relevant cumulative construction impact due to the concurrent activities of the concurrent Projects.

- **Section 8** *Site Inspection* summarizes the findings of weekly site inspections undertaken within the reporting period, with a review of any relevant follow-up actions within the reporting period.
- Section 9 Complaints, Notification of summons and Prosecution summarizes the cumulative statistics on complaints, notification of summons and prosecution
- Section 10 Conclusion



2 PROJECT BACKGROUND

2.1 Background

- 2.1.1. The "Shatin to Central Link Protection Works at Causeway Bay Typhoon Shelter" (hereafter called "the Project") is a Designed Project (DP) under the Environmental Impact Assessment Ordinance (Cap. 499) (EIAO). The Environmental Impact Assessment (EIA) Reports for Shatin to Central Link Protection Works at CBTS (Register No. AEIAR-159/2011) has been approved on 25 Feb 2011.
- 2.1.2. The key purpose of the SCL Protection Works and associated works at CBTS involves the construction of a 160m tunnel box by cut-and-cover method at the crossing above the Central Wan Chai Bypass (CWB) tunnels. Temporary reclamation is required and has been authorized under the Foreshore and Sea-bed (reclamations) Ordinance. With the presence of the Protection Works, future construction of the SCL on both sides of the CWB tunnels is protected and ensured feasible without damaging or unduly affecting the CWB tunnels which could be operational by then. This arrangement will also minimize public nuisance and impact to the surrounding environment as it can reduce the reclamation area for subsequent construction of the SCL after CWB is completed. Nevertheless, the Protection Works cannot serve to function for any railway service or operation before the completion of SCL.
- 2.1.3. The SCL is strategically important for connecting the existing railway lines into an integrated rail network. The east-west connection will allow the setup of a 57km East-West Corridor across the city connecting Wu Kai Sha with Tuen Mun via Kowloon; whilst the north-south connection will operate over a 41km North-South Corridor with services originating in Lok Ma Chau or Lo Wu travelling via the existing East Rail Line (EAL) to Admiralty. This will enable a direct transportation linkage between Mainland China and Hong Kong Island.

2.2 Scope of the Project and Site Description

- 2.2.1. The study area encompasses existing developments in Causeway Bay Typhoon Shelter as shown in *Figure 2.1*. The scope of the Project includes:
 - Temporary reclamation, which occupies about 0.7ha of Government foreshore and sea-bed (of which 0.3ha is already authorized under CWB project, i.e. additional reclamation of 0.4ha is required).
 - Dredging works at the southeast corner of the CBTS to provide space for temporary relocation of anchorage area due to the additional temporary reclamation for the Project.
 - Construction of a section of the twin track railway tunnel structure (approximately 160m long) above the proposed CWB located entirely offshore within the CBTS.
 - Relocation of the temporary Royal Hong Kong Yacht Club (RHKYC) jetty within the CWB temporary reclamation to a new location.



- Removal of the temporary reclamation, except the small area at the southwest corner of the reclamation (which will be removed by the SCL project upon completion of the future SCL tunnels connecting to the proposed South Ventilation Building (SOV)).
- 2.2.2. The Project contains Schedule 2 DP that, under the EIAO, requires Environmental Permits (EPs) to be granted by the DEP before they may either be constructed or operated. *Table 2.1* summarises the DP under this Project. *Figure 2.1* shows the location of this Schedule 2 DP.

-	- Table 2.1 Schedule 2 Designated Projects under this Project						
Item	Designated Project	EIAO Reference	Reason for inclusion				
DP1	Temporary reclamation, which occupies about 0.7ha of Government foreshore and sea-bed	Schedule 2, Part I, C.12	A dredging operation which is less than 100m from a seawater intake point				

Table 2.1 Schedule 2 Designated Projects under this Project

2.3 **Project Organization and Contact Personnel**

- 2.3.1 Civil Engineering and Development Department and Highways Department are the overall project controllers for the construction phase of the Project, Project Engineer, Contractor(s), Environmental Team and Independent Environmental Checker are appointed to manage and control environmental issues.
- 2.3.2 The proposed project organization and lines of communication with respect to environmental protection works are shown in <u>Figure 2.2</u>. Key personnel and contact particulars are summarized in *Table 2.3*:

Party	Role	Post	Name	Contact No.	Contact Fax
AECOM	Engineer's Representative for WDII	Principal Resident Engineer	Mr. Frankie Fan	2587 1778	2587 1877
	Engineer's Representative for CWB	Principal Resident Engineer	Mr. Peter Poon	3912 3388	3912 3010
MTR Corporation Limited	Permit Holder	Environment Manager	Mr. Richard Kwan	2688 1179	2993 7577
		Environmental Engineer I	Miss. Viola Tong	2163 6139	
		Environmental Engineer II	Mr. Chris Mak	2163 6248	
China State Construction Engineering (HK) Ltd.	Contractor under Contract no. HY/2009/15	Project Director	Mr. Chan Wai Hung	2823 7813	2865 5229
		Site Manager	P J Fan	3557 6368	2566 2192

 Table 2.3
 Contact Details of Key Personnel



Lam Geotechnics Limited

Party	Role	Post	Name	Contact No.	Contact Fax
		Contractor's Representativ e	Mr, David Lau	3557 6358	
		Head of construction	Mr. Roger Cheung	3557 6371	
		Environmental Officer	Mr. Daniel Sin	3557 6347	
ENVIRON Hong Kong Limited	Independent Environmental Checker (IEC)	Independent Environmental Checker (IEC)	Mr. David Yeung	3743 0788	3548 6988
Lam Geotechnics Limited	Environmental Team (ET)	Environmental Team Leader (ETL)	Mr. Raymond Dai	2882 3939	2882 3331

2.3.3 In this reporting period, the principal work activity is included as follows:

- Excavation and Lateral Support at ME4
- 2.3.4 In coming reporting month, the principal work activity is anticipated as follows:
 - Excavation and Lateral Support at ME4



3 STATUS OF REGULATORY COMPLIANCE

3.1 Status of Environmental Licensing and Permitting under the Project

3.1.1. A summary of the current status on licences and/or permits on environmental protection pertinent to the Project is shown in *Table 3.1*.

Table 3.1Summary of the current status on licences and/or permits on environmentalprotection pertinent to the Project

Permits and/or Licences	Reference No.	Issued Date	Status
Environmental Permit	EP-416/2011	4 April 2011	Valid
Further Environmental Permit	FEP-01/416/2011	11 Nov 2011	Valid

3.1.2. Summary of the current status on licences and/or permits on environmental protection pertinent and submission under FEP-01/416/2011 for contract no. HY/2009/15 showed in **Table 3.2** and **Table 3.3**.

Permits and/or Licences	Reference No.	Issued Date	Valid Period/ Expiry Date	Status
Further Environmental Permit	FEP-01/416/2011	11 Nov 2011	N/A	Valid
Notification of Works Under APCO	321822	24 Sep 2010	N/A	Valid
Construction Noise Permit (CNP) for Filling and Diaphragm Wall	GW-RS0924-12	31 Aug 2012	01 Sep 2012 to 28 Feb 2013	Cancelled
Works at TS4/ME4	GW-RS1191-12	26 Nov 2012	26 Nov 2012 to 11 May 2013	Valid
Registration as a Chemical Waste Producer	WPN: 5213-147- C1169-35	15 Nov 2010	N/A	Valid
Billing Account under Waste Disposal Ordinance	7011553	30 Sep 2010	27 Sep 2010 to 27 Jan 2016	Valid
Billing Account under Waste Disposal Ordinance (Dumping by Vessel)	7011761	03 Oct 2012	17 Jan 2013 to 16 Apr 2013	Valid
Water Discharge Licence (Discharge at TS4)	WT00011718- 2012	16 Jan 2012	16 Jan 2012 to 31 Jan 2014	Valid
Dumping Permit (Type 1 – Open Sea Disposal)	EP/MD/13-097	28 Nov 2012	6 Dec 2012 to 5 Jun 2013	Cancelled
	EP/MD/13-113	22 Jan 2013	24 Jan 2013 to 23 Jul 2013	Valid



Permits and/or Licences	Reference No.	Issued Date	Valid Period/ Expiry Date	Status
Sea Disposal (Dedicate Sites) &	EP/MD/13-114	23 Jan 2013	24 Jan 2013 to 23 Feb 2013	Expired
Type 2 – Confined Marine disposal)	EP/MD/13-124	19 Feb 2013	24 Feb 2013 to 23 Mar 2013	Valid

Table 3.3 Summary of submission status under EP/416/2011 and FEP-01/416/2011

EP Condition	FEP Condition	Submission	Date of Submission
2.3	2.1	Notification of setting up of ENPC	Submitted to EPD on 21 Nov 2011
2.4	-	Notification of setting up of CLG	Submitted to EPD on 21 Nov 2011
2.5	2.2	Notification of work commencement date	Submitted to EPD on 21 Oct 2011
2.5	-	Organization chart	Submitted to EPD on 17 Oct 2011
2.6	2.2	Work schedule and Location Plans	Submitted to EPD on 27 Oct 2011
2.7	2.3	Silt Curtain Deployment Plan	Re- submitted to EPD on 15 Dec 2011
2.8	2.4	Silt Screen Deployment Plan	Re- submitted to EPD on 15 Dec 2011
3.3	-	Baseline Monitoring Report	Submitted to EPD on 14 Nov 2011



4 Monitoring Requirements

4.1 Noise Monitoring

NOISE MONITORING STATIONS

4.1.1. The noise monitoring stations for the Project are listed and shown in *Table 4.1* and *Figure* <u>4.1.</u> <u>Appendix 4.1</u> shows the established Action/Limit Levels for the monitoring works.

- Та	ble 4.1 Noise Monitoring Stations
Station	Description
M2b	Noon Gun Area

NOISE MONITORING PARAMETERS, FREQUENCY AND DURATION

- 4.1.2. The construction noise level shall be measured in terms of the A-weighted equivalent continuous sound pressure level (L_{eq}). L_{eq (30 minutes)} shall be used as the monitoring parameter for the time period between 0700 and 1900 hours on normal weekdays. For all other time periods, L_{eq (5 minutes)} shall be employed for comparison with the Noise Control Ordinance (NCO) criteria. Supplementary information for data auditing, statistical results such as L₁₀ and L₉₀ shall also be obtained for reference.
- 4.1.3. Noise monitoring shall be carried out at all the designated monitoring stations. The monitoring frequency shall depend on the scale of the construction activities. The following is an initial guide on the regular monitoring frequency for each station on a weekly basis when noise generating activities are underway:
 - One set of measurements between 0700 and 1900 hours on normal weekdays.

MONITORING EQUIPMENT

- 4.1.4. As referred to in the Technical Memorandum (TM) issued under the NCO, sound level meters in compliance with the International Electrotechnical Commission Publications 651: 1979 (Type 1) and 804: 1985 (Type 1) specifications shall be used for carrying out the noise monitoring. Immediately prior to and following each noise measurement the accuracy of the sound level meter shall be checked using an acoustic calibrator generating a known sound pressure level at a known frequency. Measurements may be accepted as valid only if the calibration level from before and after the noise measurement agree to within 1.0 dB.
- 4.1.5. Noise measurements shall not be made in fog, rain, wind with a steady speed exceeding 5 m/s or wind with gusts exceeding 10 m/s. The wind speed shall be checked with a portable wind speed meter capable of measuring the wind speed in m/s.



4.2 Air quality monitoring <u>AIR QUALITY MONITORING STATIONS</u>

4.2.1. The air quality monitoring stations for the Project are listed and shown in *Table 4.2* and *Figure 4.1. Appendix 4.1* shows the established Action/Limit Levels for the monitoring works.

- Tab	le 4.2 Air quality monitoring Stations	
Station ID	Monitoring Location	Description
CMA3a	CWB PRE Site Office	Causeway Bay

AIR QUALITY MONITORING PARAMETERS, FREQUENCY AND DURATION

- 4.2.2. One-hour and 24-hour TSP levels should be measured to indicate the impacts of construction dust on air quality. The 24-hour TSP levels shall be measured by following the standard high volume sampling method as set out in the Title 40 of the Code of Federal Regulations, Chapter 1 (Part 50), Appendix B.
- 4.2.3. All relevant data including temperature, pressure, weather conditions, elapsed-time meter reading for the start and stop of the sampler, identification and weight of the filter paper, and any other local atmospheric factors affecting or affected by site conditions, etc., shall be recorded down in detail.
- 4.2.4. For regular impact monitoring, the sampling frequency of at least once in every six-days, shall be strictly observed at all the monitoring stations for 24-hour TSP monitoring. For 1-hour TSP monitoring, the sampling frequency of at least three times in every six-days should be undertaken when the highest dust impact occurs.

SAMPLING PROCEDURE AND MONITORING EQUIPMENT

- 4.2.5. High volume samplers (HVSs) in compliance with the following specifications shall be used for carrying out the 1-hour and 24-hour TSP monitoring:
 - 0.6 1.7 m3 per minute adjustable flow range;
 - Equipped with a timing / control device with +/- 5 minutes accuracy for 24 hours operation;
 - Installed with elapsed-time meter with +/- 2 minutes accuracy for 24 hours operation;
 - Capable of providing a minimum exposed area of 406 cm2;
 - Flow control accuracy: +/- 2.5% deviation over 24-hour sampling period;
 - Equipped with a shelter to protect the filter and sampler;
 - Incorporated with an electronic mass flow rate controller or other equivalent devices;
 - Equipped with a flow recorder for continuous monitoring;
 - Provided with a peaked roof inlet;
 - Incorporated with a manometer;
 - Able to hold and seal the filter paper to the sampler housing at horizontal position;
 - Easily changeable filter; and



Lam Geotechnics Limited

- Capable of operating continuously for a 24-hour period.
- 4.2.6. Initial calibration of dust monitoring equipment shall be conducted upon installation and thereafter at bi-monthly intervals. The transfer standard shall be traceable to the internationally recognized primary standard and be calibrated annually. The concern parties such as IEC shall properly document the calibration data for future reference. All the data should be converted into standard temperature and pressure condition.

LABORATORY MEASUREMENT / ANALYSIS

- 4.2.7. A clean laboratory with constant temperature and humidity control, and equipped with necessary measuring and conditioning instruments to handle the dust samples collected, shall be available for sample analysis, and equipment calibration and maintenance. The laboratory should be HOKLAS accredited.
- 4.2.8. Filter paper of size 8" x 10" shall be labelled before sampling. It shall be a clean filter paper with no pinholes, and shall be conditioned in a humidity-controlled chamber for over 24-hours and be pre-weighed before use for the sampling.
- 4.2.9. After sampling, the filter paper loaded with dust shall be kept in a clean and tightly sealed plastic bag. The filter paper shall then be returned to the laboratory for reconditioning in the humidity controlled chamber followed by accurate weighing by an electronic balance with readout down to 0.1 mg. The balance shall be regularly calibrated against a traceable standard.
- 4.2.10. All the collected samples shall be kept in a good condition for 6 months before disposal.
- 4.2.11. Current calibration certificates of equipments are presented in Appendix 4.2.

4.3 Water Quality Monitoring

4.3.1. The EIA Report has identified that the key water quality impact would be associated with the dredging works during the construction phase. Marine water quality monitoring for dissolved oxygen (DO), suspended solid (SS) and turbidity is therefore recommended to be carried out at selected WSD flushing water intakes. The impact monitoring should be carried out during the proposed dredging works to ensure the compliance with the water quality standards.

Water Quality Monitoring Station

- 4.3.2. It is proposed to monitor the water quality at one cooling water intakes along the seafront of the Victoria Harbour. The proposed water quality monitoring stations of the Project are shown in *Table 4.3* and *Figure 4.1*. *Appendix 4.1* shows the established Action/Limit Levels for the monitoring works.
 - -
 - -



Table 12	Marina Water Qualit	w Stations for Water Quali	ty Monitoring
1 abie 4.5		ty Stations for Water Quali	ly monitoring

Cooling Water Intake						
Station ID	Monitoring Location	Easting	Northing			
C7	Windsor House	837193.7	816150.0			

WATER QUALITY PARAMETERS

- 4.3.3. Monitoring of dissolved oxygen (DO), turbidity and suspended solids (SS) shall be carried out at WSD flushing water intakes and cooling water intakes. DO and Turbidity are measured insitu while SS is determined in laboratory.
- 4.3.4. In association with the water quality parameters, other relevant data shall also be measured, such as monitoring location/position, time, sampling depth, water temperature, pH, salinity, dissolved oxygen (DO) saturation, weather conditions, sea conditions, tidal stage, and any special phenomena and work underway at the construction site etc.

SAMPLING PROCEDURES AND MONITORING EQUIPMENT

4.3.5. The interval between two sets of monitoring should not be less than 36 hours except where there are exceedances of Action and/or Limit Levels, in which case the monitoring frequency will be increased. *Table 4.4* shows the proposed monitoring frequency and water quality parameters. Duplicate in-situ measurements and water sampling should be carried out in each sampling event. For selection of tides for in-situ measurement and water sampling, tidal range of individual flood and ebb tides should be not less than 0.5m.

Activities	Monitoring Frequency ¹	Parameters ²
During the 4-week baseline monitoring period	Three days per week, at mid- flood and mid-ebb tides	Turbidity, Suspended Solids (SS), Dissolved Oxygen (DO), pH, Temperature, Salinity
During marine construction works	Three days per week, at mid- flood and mid-ebb tides	Turbidity, Suspended Solids (SS), Dissolved Oxygen (DO), pH, Temperature, Salinity
After completion of marine construction works	Three days per week, at mid- flood and mid-ebb tides	Turbidity, Suspended Solids (SS), Dissolved Oxygen (DO), pH, Temperature, Salinity

Notes:

- 1. For selection of tides for in-situ measurement and water sampling, tidal range of individual flood and ebb tides should be not less than 0.5m.
- 2. Turbidity should be measured in situ whereas SS should be determined by laboratory.

DISSOLVED OXYGEN AND TEMPERATURE MEASURING EQUIPMENT

- 4.3.6. The instrument should be a portable, weatherproof dissolved oxygen measuring instrument complete with cable, sensor, comprehensive operation manuals, and use a DC power source. It should be capable of measuring:
 - a dissolved oxygen level in the range of 0-20 mg/l and 0-200% saturation



Lam Geotechnics Limited

- a temperature of 0-45 degree Celsius
- 4.3.7. It should have a membrane electrode with automatic temperature compensation complete with a cable. Sufficient stocks of spare electrodes and cables should be available for replacement where necessary. (e.g. YSI model 59 meter, YSI 5739 probe, YSI 5795A submersible stirrer with reel and cable or an approved similar instrument).
- 4.3.8. Should salinity compensation not be build-in in the DO equipment, in-situ salinity shall be measured to calibrate the DO equipment prior to each DO measurement.

TURBIDITY MEASUREMENT INSTRUMENT

4.3.9. The instrument should be a portable, weatherproof turbidity-measuring instrument complete with comprehensive operation manual. The equipment should use a DC power source. It should have a photoelectric sensor capable of measuring turbidity between 0-1000 NTU and be complete with a cable (e.g. Hach model 2100P or an approved similar instrument).

SAMPLER

4.3.10. A water sampler comprises a transparent PVC cylinder, with a capacity of not less than 2 litres, and can be effectively sealed with latex cups at both ends. The sampler should have a positive latching system to keep it open and prevent premature closure until released by a messenger when the sampler is at the selected water depth (e.g. Kahlsico Water Sampler or an approved similar instrument).

SAMPLE CONTAINER AND STORAGE

4.3.11. Water samples for suspended solids measurement should be collected in high-density polythene bottles, packed in ice (cooled to 4°C without being frozen), and delivered to ALS Technichem (HK) Pty Ltd. as soon as possible after collection for analysis.

WATER DEPTH DETECTOR

4.3.12. A portable, battery-operated echo sounder shall be used for the determination of water depth at each designated monitoring station. This unit can either be handheld or affixed to the bottom of the workboat, if the same vessel is to be used throughout the monitoring programme.

<u>SALINITY</u>

4.3.13. A portable salinometer capable of measuring salinity in the range of 0-40 ppt shall be provided for measuring salinity of the water at each of monitoring location.

MONITORING POSITION EQUIPMENT

4.3.14. A hand-held or boat-fixed type digital Global Positioning System (GPS) with waypoint bearing indication or other equivalent instrument of similar accuracy shall be provided and used during monitoring to ensure the monitoring vessel is at the correct location before taking measurements.



CALIBRATION OF IN-SITU INSTRUMENTS

- 4.3.15. All in-situ monitoring instrument shall be checked, calibrated and certified by a laboratory accredited under HOKLAS or equivalent before use, and subsequently re-calibrated at 3 monthly intervals throughout all stages of the water quality monitoring. Responses of sensors and electrodes should be checked with certified standard solutions before each use. Wet bulb calibration for a DO meter shall be carried out before measurement at each monitoring location.
- 4.3.16. For the on site calibration of field equipment by the ET, the BS 127:1993, "Guide to Field and on-site test methods for the analysis of waters" should be observed.
- 4.3.17. Sufficient stocks of spare parts should be maintained for replacements when necessary. Backup monitoring equipment shall also be made available so that monitoring can proceed uninterrupted even when some equipment is under maintenance, calibration, etc.
- 4.3.18. Current calibration certificates of equipments are presented in *Appendix 4.2*.

LABORATORY MEASUREMENT / ANALYSIS

4.3.19. Analysis of suspended solids has been carried out in a HOKLAS accredited laboratory, ALS Technichem (HK) Pty Ltd. Water samples of about 1L shall be collected at the monitoring stations for carrying out the laboratory SS determination. The SS determination work shall start within 24 hours after collection of the water samples. The SS determination shall follow APHA 19ed or equivalent methods subject to the approval of IEC and EPD.



5 MONITORING RESULTS

- 5.0.1. Overall layout showing work area, latest status of work commencement and monitoring stations is shown in *Figure 2.1* and *Figure 4.1*.
- 5.0.2. The environment monitoring schedules for reporting month and coming month are presented in *Appendix 5.1*.

5.1 Noise Monitoring Results

The noise monitoring station is shown in *Table 5.1* below.

Table 5.1 Noise Monitoring Station

Station	Description
M2b	Noon Gun Area

5.1.1 No exceedance was recorded in the reporting month. Noise monitoring results measured in this reporting period are reviewed and summarized. Details of noise monitoring results and graphical presentation can be referred in *Appendix 5.2*

5.2 Air quality monitoring Results

5.2.1 The air quality monitoring station is shown in *Table 5.2* below.

Table 5.2Air quality monitoring Station

Station	Description
CMA3a	CWB PRE Site Office

5.2.2 No exceedance was recorded in the reporting month. Air quality monitoring results measured in this reporting period are reviewed and summarized. Details of air quality monitoring results and graphical presentation can be referred in *Appendix 5.3*.

5.3 Water quality monitoring Results

5.3.2 The water quality monitoring station is summarized in *Table 5.3* below.

Table 5.3Water quality monitoring Station

Station Ref. Location Easting Northing						
Cooling Water Intake						
C7	Windsor House	837193.7	816150.0			

- 5.3.2 The DO levels at C7 were monitored during the construction period to avoid aggravation of odour nuisance from seawater arising from temporary reclamation in the CBTS in the reporting month. Neither exceedance nor odour complaint was received in the reporting period.
- 5.3.3 Water quality monitoring location at C7 was finely adjusted to the outside of the inner silt curtain frame since 31 Dec 2012.
- 5.3.4 No exceedance was recorded in the reporting month.



5.3.5 Water quality monitoring results measured in this reporting period are reviewed and summarized. Details of water quality monitoring results and graphical presentation can be referred in Table 5.4 and *Appendix 5.4.*

	Water	Mid-flood					Mid-ebb						
Contract no.	Contract no. quality monitoring	DO		Turbidity		SS		DO		Turbidity		SS	
Station	AL	LL	AL	LL	AL	LL	AL	LL	AL	LL	AL	LL	
HY/2009/15	C7	0	0	0	0	0	0	0	0	0	0	0	0
То	tal	0	0	0	0	0	0	0	0	0	0	0	0

 Table 5.4
 Summary of Water Quality Monitoring Exceedance in Reporting Month

5.4 Waste Monitoring Results

5.4.1. Inert C&D wastes was disposed of in this reporting month. Details of the waste flow table are summarized in *Table 5.5*.

Waste Type	Quantity this month	Cumulative Quantity-to-Date	Disposal / Dumping Grounds	Remarks
Inert C&D	6110	12656	TM38	N/A
materials disposed, m3	2376	3230	TKO137	
Inert C&D	0	25395.7	TS2	N/A
materials recycled, m3	717	717	WDII	
Non-inert C&D materials disposed, m3	NIL	NIL	N/A	N/A
Non-inert C&D materials recycled, m3	NIL	NIL	N/A	N/A
Chemical waste disposed, kg	NIL	NIL	N/A	N/A
Marine Sediment	NIL	10,640	Cheung Chau	Dredging from
(Type 1 – Open Sea Disposal) , m3	(Bulk Volume)	(Bulk Volume)	South	SCL Protection Works (CBTS)
Marine Sediment	NIL	7,500	East of Sha Chau	Dredging from
(Type 1 – Open Sea Disposal (Dedicate Sites) & Type 2 – Confined Marine Disposal), m3	(Bulk Volume)	(Bulk Volume)		SCL Protection Works (CBTS)
Marine Sediment (Type 3 – Special Treatment / Disposal contained in geosynthetic Containers), m3	NIL	NIL	N/A	N/A

Table 5.5Details of Waste Disposal



6 Compliance Audit

6.0.1. The Event Action Plan for construction noise, air qualities are presented in Appendix 6.1.

6.1 Noise Monitoring

6.1.1. No exceedance was recorded in the reporting month.

6.2 Air quality monitoring

6.2.1. No exceedance was recorded in the reporting month.

6.3 Water quality monitoring

6.3.1 No exceedance was recorded in the reporting month.

6.4 Review of the Reasons for and the Implications of Non-compliance

6.4.1. There was no non-compliance from the site audits in the reporting period. The observations and recommendations made in each individual site audit session were presented in Section 8.

6.5 Summary of action taken in the event of and follow-up on non-compliance

6.5.1 There was no particular action taken since no project-related non-compliance was recorded from the site audits and environmental monitoring in the reporting period.



7 Cumulative Construction Impact due to the Concurrent Projects

- 7.0.1. According to Condition 3.4 of the EP-416/2011, this section addresses the relevant cumulative construction impact due to the concurrent activities of the current projects including the Wan Chai Development Phase II (WDII) and Central-WanChai Bypass (CWB).
- 7.0.2. From the Monthly EM&A report (January 2013) of Wan Chai Development Phase II (WDII) the key works in February 2013 are as follows:

<u>Contract no. HK/2009/01 - Wan Chai Development Phase II – Central – Wanchai Bypass at HKCEC</u>

Marine Works

- Installation of precast seawall blocks at east of HKCEC.
- Rockfilling at east of HKCEC near Expo Drive East.
- Rockfilling at the southern part of HKCEC3E (East of HKCEC) between CH290 and CH385 for subsequent open channel construction.
- Construction of temporary open channel for diversion of existing box culvert toward Area 7.
- Installation of ELS for construction of proposed box culvert Bay 8 and Bay 9.
- Rockfilling and rock armour protection works to cross-harbour watermains.
- Reinstatement works at TST seashore
- Rockfilling and rock armour protection works to cross-harbour watermains
- Fresh water flushing for cross-harbour watermains CHA, CHB, CHE & CHF
- Installation of Impressed Current Cathodic Protection (ICCP) system including soil
 resistivity test, anode pits and transformer rectifier to CHA and CHB

Fresh Watermains, Cooling Watermains and Salt Watermains (On Land)

- Works would be continued at Zone B6-1, B6-3, B6-5, A1-2 (CHWM), A2-3D (Stage 2), A3-5A, A3-4A, A3-3B and C1-4.
- Mainlaying works in Zone C1-2.
- Mainlaying works in Zone C1-2 and C1-4 at Expo Drive East.
- Mainlaying works for proposed sewerage system in Zone B6-1, B6-3 and B6-5.
- Mainlaying works in Zone A1-2 (CHWM) and A2-3D (Stage 2) at Convention Avenue.
- Pressure test, grouting works and connection works at jacking pit in Zone A1-2A & A1-3A of Convention Avenue.
- Mainlaying works in Zone A3-4A, A3-5A and A3-3B at Fenwick Pier Street.
- Pressure test for cooling watermain (AC, AE & AF).
- Pressure test for cross harbour watermains (whole length of land pipes in Wan Chai).



Tunnel Works

- Removal of remaining guide wall along Convention Avenue.
- Backfilling at SCL section to the required level
- Installation of pre-bored H-pile in CWB Stage 1b (from Ch80 to Ch120).
- Installation of pre-bored H-pile in CWB Stage 2 under the atrium link (from Ch120 to Ch220).
- CWB diaphragm wall construction under the atrium link.

E&M Works

- Full commissioning for Cooling Water Pumping Station P3 & P4
- Initial commissioning for Cooling Water Pumping Stations P5

<u>Contract no. HK/2009/02 - Wan Chai Development Phase II – Central – Wan Chai Bypass at</u> <u>WanChai East</u>

- Complete concreting works at the roof Level (except late cast portion) at the New Ferry Pier.
- Complete rectification works of cooling mains and pressure test.
- Continue 800MS pipe installation inside Ex-pet Garden.
- Complete hard landscaping works at WSD Pumping Station
- Continue construction of Bay 1b and Bay 2a shaft construction at salt water intake culverts.
- Continue remaining drainage works and reinstatement works along Wan Shing Street.
- Continue Aeration and Chlorination pipe installation of Bay 3 to Bay 11 and Bay 19b to Bay 24 inside Salt Water Intake Culvert.
- Continue 800MS pipe installation inside Ex-pet Garden.
- Resume works for the outfall pipe B connection inside DSD receiving pit and complete dye tests

<u>Contract no. HY/2009/15 - Central-Wanchai Bypass – Tunnel (Causeway Bay Typhoon</u> <u>Shelter Section)</u>

• Removal of eastern breakwater of CBTS



<u>Contract no. HK/2010/06 - Wan Chai Development Phase II – Central – Wan Chai Bypass</u> <u>over MTR Tsuen Wan Line</u>

- Sheet pile installation
- Dredging
- Construction of pre-cast unit in mainland China
- Installation of pre-cast unit

<u>Contract no. HY/2009/19 – Central- Wan Chai Bypass Tunnel (North Point Section) and</u> <u>Island Eastern Corridor Link</u>

- Marine Piling
- Construct ion of socket-H pile
- Dismantling of marine platform
- Construction of Pile caps & columns (Marine)



7.0.3. From the Monthly EM&A report (January 2013) of Central-Wan Chai Bypass (CWB) the key works in February 2013 are as follows:

<u>Contract no. HY/2009/17 – Central – Wan Chai Bypass (CWB) at FEHD Whitfield Depot –</u> <u>Advanced piling works under FEP-03/364/2009</u>

• No further works under designated project.

<u>Contract no. HY/2009/18 – Central – Wan Chai Bypass (CWB) – Central Interchange under</u> <u>FEP-05/364/2009/A</u>

- Excavation of trial pit
- Transplanting of trees
- Hoarding erection and modification
- Installation of couplers, UU detection, trial trench, pre-drilling
- Excavation
- Sheet Piling
- Drainage works
- Tunnel works
- Trough structure construction and associated drilling and grouting
- Road works
- OHVD installation
- Pipe-piling works
- Cooling main bridge construction
- Pre-bored H-piling
- Bridge construction
- Cooling main bridge construction

<u>Contract no. HK/2009/01 – Wan Chai Development Phase II – Central – Wan Chai Bypass at</u> Hong Kong Convention and Exhibition Centre – Tunnel Works under FEP-02/364/2009

- Removal of remaining guide wall along Convention Avenue.
- Backfilling at SCL section to the required level.
- Installation of pre-bored H-pile in CWB Stage 1b (from Ch80 to Ch120).
- Installation of pre-bored H-pile in CWB Stage 2 under the atrium link (from Ch120 to Ch220).
- CWB diaphragm wall construction under the atrium link.

<u>Contract no. HK/2009/02 – Wan Chai Development Phase II – Central – Wan Chai Bypass at</u> <u>Wan Chai East (CWB Tunnel) under FEP-01/364/2009</u>

- Blinding for the base slab construction and waterproofing installation at tunnel portion 1.
- Rebar fixing fro the base slab construction at Tunnel Portion 1.
- Base slab concreting at Tunnel Portion 1.
- G.I. and remove the temporary sheet pile wall at WCR2
- Diaphragm wall construction for Eastern Bulkhead Panel BHP3 and BHP7.



- Bulkhead at Bay 14 of Box Culvert "O" and stage 2 diversion of uncharted drainage works at Box culvert "O".
- Preparation work for Bored Pile construction of EP01 EP11 at Tunnel Portion 3&4.
- Trial excavation, footpath set back, UU diversion, reprovision of street furniture and preparation works for Hung Hing Road Diversion Stage 1
- Curing of caisson seawall precast unit 2X and protective coating on flat-top barge.
- Construction of 1800 connection of Box Culvert N1, Bay 4 & Bay 5 and FRP installation at WCR1 area.

<u>Contract no. HY/2009/15 – Central-Wanchai Bypass – Tunnel (Causeway Bay Typhoon Shelter Section) under FEP-06/364/2009/A</u>

- ELS works at TS4
- Rock breaking works at TPCWAE
- Tunnel works at TS1
- Horizontal drilling for mined tunnel
- Pipe roofing installation
- Construction of Diaphragm Wall at TS2

Contract no. HY/2009/19 – Central – Wanchai Bypass Tunnel (North Point Section) and Island Eastern Corridor Link under FEP-07/364/2009/A

- Road works at Watson Road
- Bored piling (Land)
- Pre-drilling works for bored pile and Diaphragm wall
- D-wall Construction (North & South Section)
- Guide wall construction for D-wall / Barrette at North side
- Construction works for Box Culvert T1
- Marine Piling
- Construct ion of socket-H pile
- Construction works for Culvert U1
- Construction of Pile caps & columns (Land)
- Dismantling of marine platform
- Demolition of parapet at IEC Link
- Construction of Pile caps & columns (Marine)
- Cut & Cover Tunnel sheet piling works and installation of King Pos
- Construction of dewatering well for Cut & Cover Tunnel

<u>Contract no. HK/2010/06 – Wan Chai Development Phase II Central – Wanchai Bypass Over</u> <u>MTR Tseun Wan Line FEP-08/364/2009/A</u>

• Utility works in section 2



7.0.4. According to the construction programme of Wan Chai Development Phase II, Central-Wan Chai Bypass, the major construction activity under Wan Chai Development Phase II were the reclamation works at HKCEC and WanChai East, rock filling work at Expo Drive East Bridge, and marine bored piling at MTR Tunnel Crossing. Tunnel works at Central Interchange, cross-harbour water mains and WCR1; and marine pre-drilling in the reporting month. The major environmental impact was water quality impact at Causeway Bay and Wan Chai. Land-based construction activity were tunnel excavation and sheet piling works at Central, bored pilling works at North Point and tunnel works at Wan Chai East.



8 Environmental Site Audit

- 8.0.1. During this reporting period, weekly environmental site audits were conducted for the SCL Protection Works under the Contract no. HY/2009/15. No non-conformance was identified during the site audits.
- 8.0.2. Five site inspections for Contract no. HY/2009/15 was carried out during this reporting period. No finding was observed during the reporting period.



9 COMPLAINTS, NOTIFICATION OF SUMMONS AND PROSECUTION

- 9.0.1. There was no environmental complaint and prosecution recorded in the reporting period.
- 9.0.2. The details of cumulative complaint log and updated summary of complaints are presented in *Appendix 9.1*
- 9.0.3. Cumulative statistic on complaints and successful prosecutions are summarized in *Table 9.1* and *Table 9.2* respectively.

Table 9.1 Cumulative Statistics on Complaints

Reporting Period	No. of Complaints
February 2013	0
November 2011 to January 2013	0
Total	0

Table 9.2	Cumulative Statistics on Successful Prosecutions

Environmental Parameters	Cumulative No. Brought Forward	No. of Successful Prosecutions this period (Offence Date)	Cumulative No. Project-to-Date
Air	-	0	0
Noise	-	0	0
Water	-	0	0
Waste	-	0	0
Total	-	0	0



10. CONCLUSION

- 10.0.1. The EM&A programme was carried out in accordance with the EM&A Manual requirements, minor alternations to the programme proposed were made in response to changing circumstances.
- 10.0.2. The scheduled construction activities and the recommended mitigation measures for the coming month are listed in *Table 10.1*. The construction programmes of individual contracts are provided in *Appendix 10.1*.

 Table 10.1 Summary of Key Construction Activities of Individual Contract(s) to be

 commenced in Coming Reporting Month

Contract No.	Key Construction Works	Recommended Mitigation Measures				
HY/2009/15	Excavation and Lateral Support at	•	Noise	barrier	shall	be
	ME4		implemented			
		•	Watering of any dust generating			
			activities	S		



Figure 2.1

Project Layout

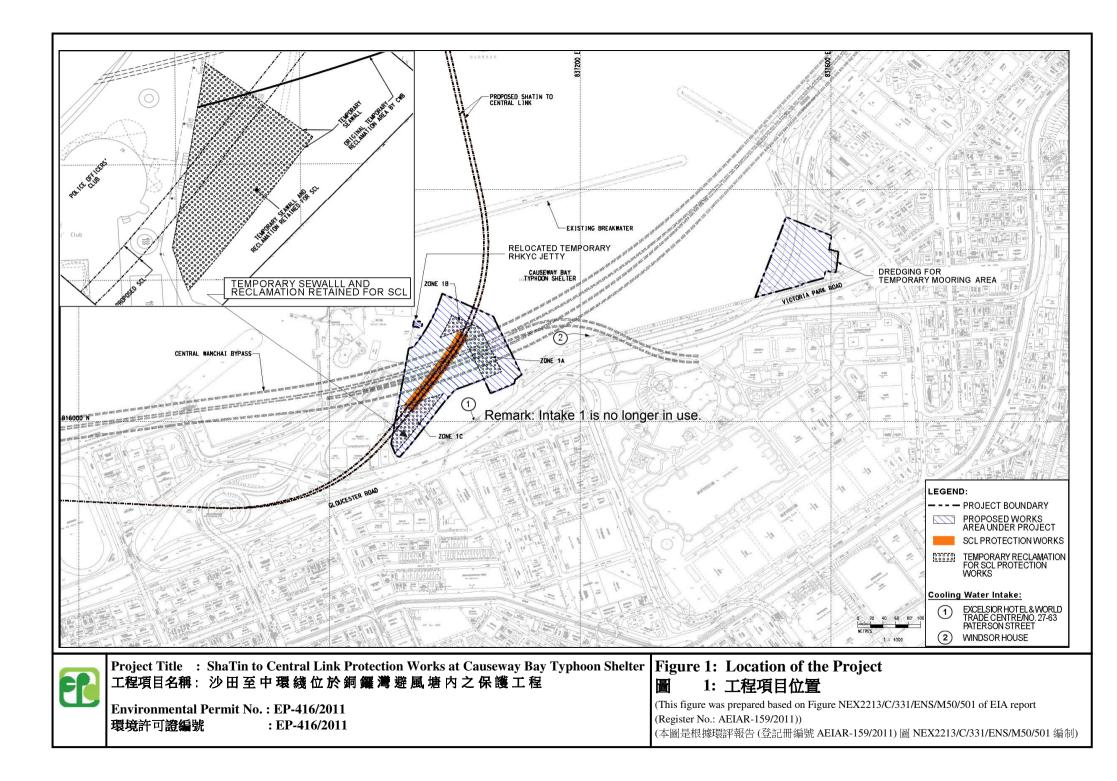




Figure 2.2

Project Organization Chart



Project Organization Chart


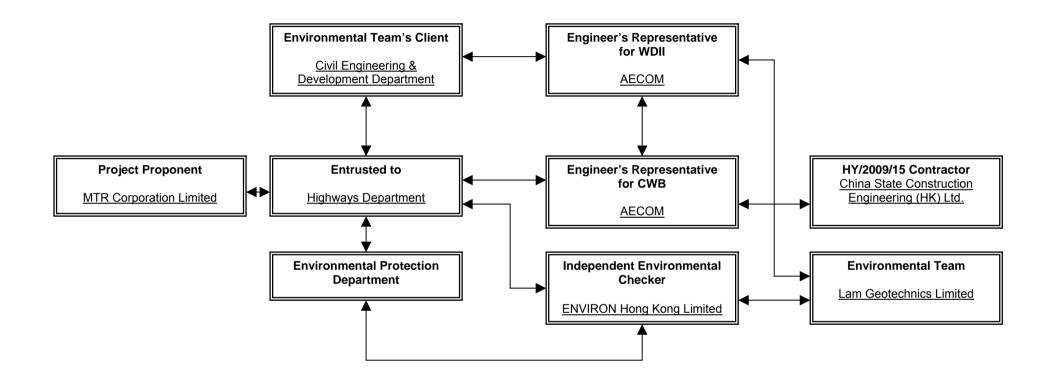




Figure 2.3

Locations of Monitoring Stations

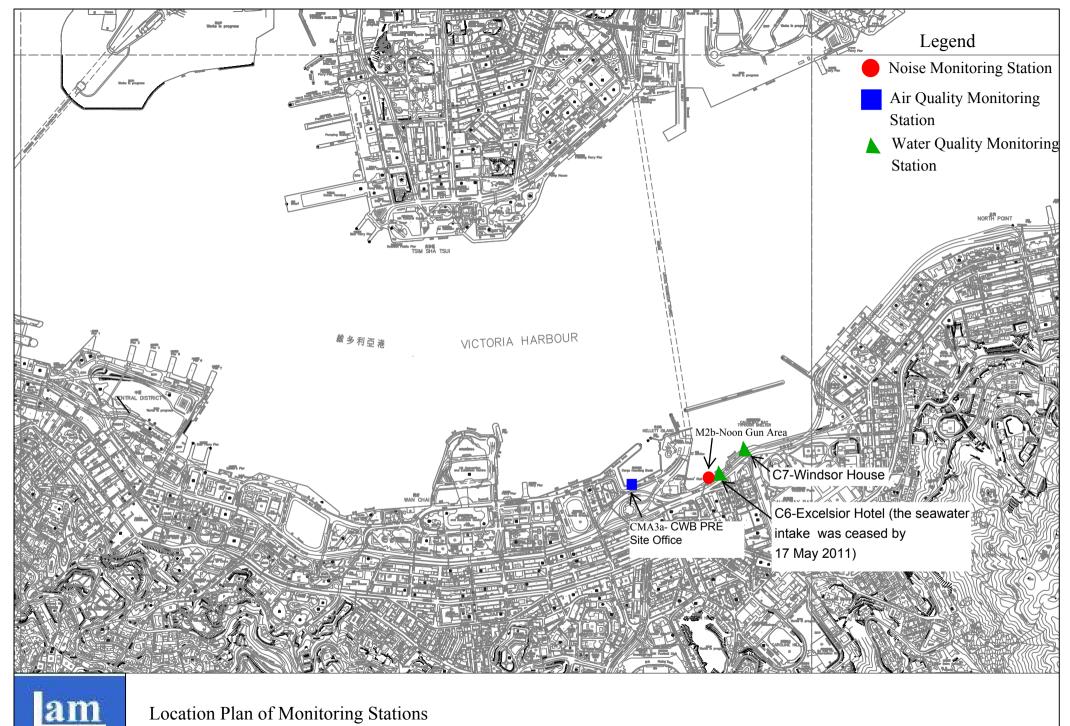

Location Plan of Monitoring Stations



Appendix 3.1

Environmental Mitigation Implementation Schedule

IMPLEMENTATION SCHEDULE OF THE PROPOSED MITIGATION MEASURES

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measure	When to implement the measures?	What requirements or standards for the measure to achieve?
	uality Impact (Construction Phase)			•		·
3.142	Dredging should be carried out by closed grab dredger.	To minimize release of sediment and contaminants during dredging.	Contractor	Dredging works areas in Causeway Bay Typhoon Shelter (CBTS)	Construction Phase	EIAO-TM, WPCO
S3.142	All temporary reclamation works should adopt an approach where temporary seawalls will first be formed to enclose each phase of the temporary reclamation. Installation of diaphragm wall on temporary reclamation as well as any bulk filling will proceed behind the completed seawall. Any gaps that may need to be provided for marine access should be shielded by silt curtains to control sediment plume dispersion away from the site. Demolition of temporary reclamation including the demolition of the diaphragm wall and dredging to the existing seabed levels	To minimize loss of fines and contaminants during temporary reclamations	Contractor	Temporary reclamation works areas in CBTS	Construction Phase	EIAO-TM, WPCO

Wanchai Development Phase II and Central Wanchai Bypass (Shatin to Central Link (SCL) Protection

EM&A Report for Shatin to Central Link Protection Works at Causeway Bay Typhoon SHelter

Works at Causeway Bay Typhoon Shelter)

	should be carried out behind the temporary seawall. Temporary seawall should be removed after completion of all excavation and dredging works for demolition of the temporary reclamation.					
S3.142	During construction of the temporary reclamation, temporary seawall should be partially constructed to protect the nearby seawater intakes from further dredging activities. For example, the seawalls along the southeast and northeast boundaries of PW1.1 should be constructed first (above high water mark) so that the seawater intake at the inner water would be protected from the impacts from the remaining dredging activities along the northwest boundary.	To minimize water quality impact upon the cooling water intakes in CBTS from temporary reclamation works	Contractor	Temporary reclamation works areas in CBTS	onstruction Phase	EIAO-TM, WPCO
S3.142	Silt curtains should be deployed to fully enclose the closed grab dredger during any dredging operation within the CBTS.	To minimize loss of fines and contaminants during dredging in CBTS	Contractor	Dredging works areas in CBTS	Construction Phase	EIAO-TM, WPCO
S3.142	Silt screens will be installed at all the cooling water intakes within the CBTS during temporary reclamation and dredging within the typhoon shelter.	To minimize water quality impact upon the cooling water intakes in CBTS from marine construction activities	Contractor	Cooling water intakes inside CBTS	Construction Phase	EIAO-TM, WPCO
S3.143	No more than two closed grab dredgers should be operated for dredging within the CBTS at	To minimize loss of fines and contaminants	Contractor	Temporary reclamation and	Construction Phase	EIAO-TM, WPCO

Wanchai Development Phase II and Central Wanchai Bypass

(Shatin to Central Link (SCL) Protection

Works at Causeway Bay Typhoon Shelter)

	any time. Moreover, the combined production rate of all concurrent dredging works to be undertaken within the CBTS shall not exceed 6,000 m ₃ per day at all times throughout the entire construction period.	during dredging in CBTS		dredging works areas in CBTS		
S3.145	The following good site practices should be undertaken during sand filling, public filling and dredging: • mechanical grabs, if used, should be designed and maintained to avoid spillage and sealed tightly while being lifted. For dredging of any contaminated mud, closed watertight grabs must be used; • all vessels should be sized so that adequate clearance is maintained between vessels and the seabed in all tide conditions, to ensure that undue turbidity is not generated by turbulence from vessel movement or propeller wash; • all hopper barges and dredgers should be fitted with tight fitting seals to their bottom openings to prevent leakage of material; • construction activities should not cause foam, oil, grease, scum, litter or other objectionable matter to be present on the water within the	To minimize loss of fines and contaminants from dredging / filling	Contractor	Temporary reclamation and dredging works areas in CBTS	Construction Phase	EIAO-TM, WPCO

Wanchai Development Phase II and Central Wanchai Bypass

(Shatin to Central Link (SCL) Protection

Works at Causeway Bay Typhoon Shelter)

	site or dumping grounds; and • loading of barges and hoppers should be controlled to prevent splashing of dredged material into the surrounding water. Barges or hoppers should not be filled to a level that will cause the overflow of materials or polluted water during loading or transportation.					
S3.146	 The following mitigation measures are proposed to minimize the potential water quality impacts from the construction works at or close to the seafront: Temporary storage of construction materials (e.g. equipment, filling materials, chemicals and fuel) and temporary stockpile of construction and demolition materials should be located well away from the seawater front and storm drainage during carrying out of the works. Stockpiling of construction and demolition materials and dusty materials should be covered and located away from the seawater front and storm drainage. Construction debris and spoil should be covered up and/or disposed of as soon as 	To minimize release of construction wastes from construction works at or close to the seafront	Contractor	Construction works at or close to the seafront	Construction Phase	EIAO-TM, WPCO

Wanchai Development Phase II and Central Wanchai Bypass (Shatin to Central Link (SCL) Protection

Works at Causeway Bay Typhoon Shelter)

	possible to avoid being washed into the nearby receiving waters.					
S3.147	Silt curtains should be installed around the working area for the marine piling works for construction of the temporary jetty as necessary to minimize the release of sediment and construction wastes. All wastewater generated from the piling activities should be collected by a derrick lighter or other collection system and be treated before controlled discharge. Spoil from the piling activities should be collected by sealed hopper barges for proper disposal.	To minimize water quality impacts from piling works for construction of the temporary jetty	Contractor	Piling area at the piling location	Construction Phase	EIAO-TM, WPCO
S3.148	Regular maintenance of and refuse collection should be performed at the silt screens deployed at the seawater intakes at regular intervals on a daily basis. The Contractor should be responsible for keeping the water behind the silt screen free from floating rubbish and debris during the impact monitoring period.	To avoid the pollutant and refuse entrapment problems at the silt screens to be installed at the water intakes	Contractor	Proposed silt screens at cooling water intakes inside CBTS	Construction Phase	EIAO-TM, WPCO
S3.149	It is recommended that collection and removal of floating refuse should be performed within the marine construction areas at regular intervals on a daily basis. The Contractor should be	To minimize water quality impacts from illegal dumping and littering from marine vessels and runoff from	Contractor	All marine works areas	Construction Phase	EIAO-TM, WPCO, WDO

Contract No. HK/2011/07 Wanchai Development Phase II and Central Wanchai Bypass (Shatin to Central Link (SCL) Protection Works at Causeway Bay Typhoon Shelter)

	responsible for keeping the water within the site boundary and the neighbouring water free from rubbish during the dredging works.	the coastal areas				
S3.150 to 3.169	The site practices outlined in ProPECC PN 1/94 "Construction Site Drainage" should be followed where practicable.	To minimize water quality impacts from construction site runoff and general construction activities	Contractor	All construction works areas	Construction Phase	EIAO-TM, WPCO, TM- DSS, WDO, ProPECC PN 1/94
S3.170	There is a need to apply to EPD for a discharge licence for discharge of effluent from the construction site under the WPCO. The discharge quality must meet the requirements specified in the discharge licence. All the runoff and wastewater generated from the works areas should be treated so that it satisfies all the standards listed in the TM-DSS. Minimum distances of 100 m should be maintained between the discharge points of construction site effluent and the existing seawater intakes. The beneficial uses of the treated effluent for other on-site activities such as dust suppression, wheel washing and general cleaning etc., can minimise water consumption	To minimize water quality impact from effluent discharges from construction sites	Contractor	All construction works areas	Construction Phase	EIAO-TM, WPCO, TM-DSS

Wanchai Development Phase II and Central Wanchai Bypass (Shatin to Central Link (SCL) Protection

Works at Causeway Bay Typhoon Shelter)

	and reduce the effluent discharge volume. If monitoring of the treated effluent quality from the works areas is required during the construction phase of the Project, the monitoring should be carried out in accordance with the WPCO license which is under the ambit of Regional Office (RO) of EPD.					
S3.171 & 3.172	Construction work force sewage discharges on site are expected to be connected to the existing trunk sewer or sewage treatment facilities. If disposal of sewage to public sewerage system is not feasible, appropriate numbers of portable toilets shall be provided by a licensed contractor to serve the construction workers over the construction site to prevent direct disposal of sewage into the water environment. The Contractor shall also be responsible for waste disposal and maintenance practices. Notices should be posted at conspicuous locations to remind the workers not to discharge any sewage or wastewater into the nearby environment.	To minimize water quality impacts due to sewage generated from construction workforce	Contractor	All construction works areas	Construction Phase	EIAO-TM, WPCO, TM- DSS, WDO
S3.173	Contractor must register as a chemical waste producer if	To minimize water quality	Contractor	All construction	Construction Phase	EIAO-TM, WPCO, TM-

Wanchai Development Phase II and Central Wanchai Bypass

(Shatin to Central Link (SCL) Protection

Works at Causeway Bay Typhoon Shelter)

	chemical wastes would be produced from the construction activities. The Waste Disposal Ordinance (Cap 354) and its subsidiary regulations in particular the Waste Disposal (Chemical Waste) (General) Regulation should be observed and complied with for control of chemical wastes.	impact from accidental spillage of chemical		works areas		DSS, WDO
S3.174	Any service shop and maintenance facilities should be located on hard standings within a bunded area, and sumps and oil interceptors should be provided. Maintenance of vehicles and equipment involving activities with potential for leakage and spillage should only be undertaken within the areas appropriately equipped to control these discharges.	To minimize water quality impact from accidental spillage of chemical	Contractor	All construction works areas	Construction Phase	EIAO-TM, WPCO, TM- DSS, WDO
S3.175	Disposal of chemical wastes should be carried out in compliance with the Waste Disposal Ordinance. The "Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes" published under the Waste Disposal Ordinance details the requirements to deal with chemical wastes. General requirements are given as follows: • Suitable containers should	To minimize water quality impact from accidental spillage of chemical	Contractor	All construction works areas	Construction Phase	EIAO-TM, WPCO, TM- DSS, WDO

Wanchai Development Phase II and Central Wanchai Bypass (Shatin to Central Link (SCL) Protection Works at Causeway Bay Typhoon Shelter)

	 be used to hold the chemical wastes to avoid leakage or spillage during storage, handling and transport. Chemical waste containers should be suitably labelled, to notify and warn the personnel who are handling the wastes, to avoid accidents. Storage area should be selected at a safe location on site and adequate space should be allocated to the storage area. 					
S4. 30	 The following good site practices should be implemented: Only well-maintained plant should be operated on-site and plant should be serviced regularly during the construction program Silencers or mufflers on construction equipment should be properly maintained during the construction program Mobile plant, if any, should be sited as far from NSRs as possible Machines and plant (such as trucks) that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum 	To reduce construction noise impact	Contractor	All works areas	Construction phase	EIAO-TM, NCO

Wanchai Development Phase II and Central Wanchai Bypass (Shatin to Central Link (SCL) Protection

Works at Causeway Bay Typhoon Shelter)

	 Plant known to emit noise strongly in one direction should, wherever possible, be orientated so that the noise is directed away from the nearby NSRs Material stockpiles and other structures should be effectively utilized, wherever practicable, in screening noise from on-site construction activities. 					
S4.31 – S4.32 & Table 4.7	The following quiet PME are recommended for the construction activities: Air Compressor Bulldozer Concrete Pump Concrete Lorry Mixer Crane Dump Truck Excavator Generator Hand-held Breaker Poker Vibrator Roller Trucks	To reduce construction noise impact	Contractor	All works areas	Construction phase	EIAO-TM, NCO
S4.33 – S4.35 & Table 4.8	Movable noise barrier should be used for following PME: Air Compressor Bar Bender Bentonite Plants Concrete pump Diaphragm Wall Rigs Excavator	th e o reduce construction noise impact	Contractor	Affected works areas showing exceedance during un- mitigated scenario	Construction phase	EIAO-TM, NCO

Contract No. HK/2011/07 Wanchai Development Phase II and Central Wanchai Bypass (Shatin to Central Link (SCL) Protection Works at Causeway Bay Typhoon Shelter)

	Poker Vibrator					
Construe	ction Dust Impact					
S5.43	Watering once on construction areas for every working hour	To minimize dust impact	Contractor	Temporary reclamation area in CBTS	Construction phase	APCO
S5.43	Covering/paving the southwest retained area of temporary reclamation once filling is completed	To minimize dust impact	Contractor	southwest retained area of temporary reclamation	Construction phase	phase APCO
S5.44	Dust suppression measures stipulated in the Air Pollution Control (Construction Dust) Regulation and good site practices: Use of regular watering, with complete coverage, to reduce dust emissions from exposed site surfaces and unpaved roads, particularly during dry weather. Use of frequent watering for particularly dusty cons truction areas and areas close to ASRs. Side enclosure and covering of any aggregate or dusty material storage piles to reduce emissions. Where this is not practicable owing to frequent usage, watering shall be applied to aggregate fines.	To minimize dust impacts	Contractor	Temporary reclamation area in CBTS	Construction phase	APCO and Air Pollution Control (Construction Dust) Regulation

Wanchai Development Phase II and Central Wanchai Bypass (Shatin to Central Link (SCL) Protection Works at Causeway Bay Typhoon Shelter)

	Open stockpiles shall be			
	avoided or covered. Where			
	possible, prevent placing dusty			
	material storage piles near			
	ASRs.			
	Tarpaulin covering of all			
	dusty vehicle loads transported			
	to, from and between site			
	locations.			
	Establishment and use of			
	vehicle wheel and body			
	washing facilities at the exit			
	points of the site.			
	Provision of wind shield and			
	dust extraction units or similar			
	dust mitigation measures at the			
	loading points, and use of			
	water sprinklers at the loading			
	area where dust generation is			
	likely during the loading			
	process of loose material,			
	particularly in dry seasons/			
	periods.			
	Provision of not less than			
	2.4m high hoarding from			
	ground level along site			
	boundary where adjoins a road,			
	streets or other accessible to			
	the public except for a site			
	entrance or exit.			
	Imposition of speed controls			
	for vehicles on site haul roads.			
	Where possible, routing of			
	vehicles and positioning of			
	construction plant should be at			
	the maximum possible distance			
	from ASRs.			
L				

Wanchai Development Phase II and Central Wanchai Bypass

(Shatin to Central Link (SCL) Protection

Works at Causeway Bay Typhoon Shelter)

Waste Ma	Every stock of more than 20 bags of cement or dry pulverised fuel ash (PFA) should be covered entirely by impervious sheeting or placed in an area sheltered on the top and the 3 sides. Instigation of an environmental monitoring and auditing program to monitor the construction process in order to enforce controls and modify method of work if dusty conditions arise.	nase)				
6.62	Good Site Practices and Waste Reduction Measures - Prepare a Waste Management Plan approved by the Engineer/Supervising Officer of the Project based on current practices on construction sites; - Training of site personnel in, site cleanliness, proper waste management and chemical handling procedures; - Provision of sufficient waste disposal points and regular collection of waste; - Appropriate measures to minimize windblown litter and dust during transportation of waste by either covering trucks or by transporting wastes in enclosed containers; - Regular cleaning and	To enhance water management practice and achieve waste reduction.	Contractor	All Work Sites	Construction Phase	Waste Disposal Ordinance (Cap. 354) Land (Miscellaneous Provisions) Ordinance (Cap. 28) ETWB TC(W) No.31/2004

Wanchai Development Phase II and Central Wanchai Bypass (Shatin to Central Link (SCL) Protection

Works at Causeway Bay Typhoon Shelter)

	maintenance programme for drainage systems, sumps and oil interceptors; and - Separation of chemical wastes for special handling and appropriate treatment.					
6.63	Good Site Practices and Waste Reduction Measures (con't) - Sorting of demolition debris and excavated materials from demolition works to recover reusable/ recyclable portions (i.e. soil, broken concrete, metal etc.); - Segregation and storage of different types of waste in different containers, skips or stockpiles to enhance reuse or recycling of materials and their proper disposal; - Encourage collection of aluminum cans by providing separate labeled bins to enable this waste to be segregated from other general refuse generated by the workforce; - Proper storage and site practices to minimize the potential for damage or contamination of construction materials; - Plan and stock construction	To achieve waste reduction	Contractor	All Work Sites	Construction Phase	Waste Disposal Ordinance (Cap. 354) Land (Miscellaneous Provisions) Ordinance (Cap. 28)

Wanchai Development Phase II and Central Wanchai Bypass

. . .

(Shatin to Central Link (SCL) Protection Works at Causeway Bay Typhoon Shelter)

	materials carefully to minimize amount of waste generated and avoid unnecessary generation of waste; and - Training should be provided to workers about the concepts of site cleanliness and appropriate waste management procedures, including waste reduction, reuse and recycle.					
6.64	Good Site Practices and Waste Reduction Measures (con't) - The Contractor shall prepare and implement an EMP in accordance with ETWB TCW No. 19/2005. Such management plan should incorporate site specific factors, such as the designation of areas for segregation and temporary storage of reusable and recyclable materials. The EMP should be submitted to the Engineer for approval. The Contractor should implement the waste management practices in the EMP throughout the construction stage of the Project. The EMP should be reviewed regularly and updated by the Contractor, preferably in a monthly basis.	To enhance water management practice and achieve waste reduction.	Contractor	All Work Sites	Construction Phase	ETWB TCW No. 19/2005

Wanchai Development Phase II and Central Wanchai Bypass

(Shatin to Central Link (SCL) Protection

6.66	 Storage, Collection and Transportation of Waste Waste, such as soil, should be handled and stored well to ensure secure containment, thus minimizing the potential of pollution; Maintain and clean storage areas routinely; Stockpiling area should be provided with covers and water spraying system to prevent materials from wind-blown or being washed away; and Different locations should be designated to stockpile each material to enhance reuse. 	To minimize potential adverse environmental impacts arising from waste storage	Contractor	Work Sites	Construction Phase	
6.67	Storage, Collection and Transportation of Waste (con't) - Waste haulier with appropriate permits should be employed by the Contractor for the collection and transportation of waste from works areas to respective disposal outlets.	To minimize potential adverse environmental impacts arising from waste collection and disposal	Contractor	Waste storage area.	Construction Phase	-
6.68	Storage, Collection and Transportation of Waste (con't)- Implementation of trip ticket system with reference to ETWB TC(W) No.31/2004 to monitor disposal of waste and to control fly-tipping at PFRFs or landfills.	To minimize potential adverse environmental impacts arising from waste collection and disposal	Contractor	Work Sites	Construction Phase	ETWB TC(W) No.31/2004

Wanchai Development Phase II and Central Wanchai Bypass (Shatin to Central Link (SCL) Protection

Works at Causeway Bay Typhoon Shelter)

	A recording system for the amount of waste generated, recycled and disposed (including disposal sites) should be proposed.					
6.70 - 6.73	Sorting of C&D Materials - Sorting to be performed to recover the inert materials, reusable and recyclable materials before disposal off- site. - Specific areas should be provided by the Contractors for sorting and to provide temporary storage areas for the sorted materials. - The C&D materials should at least be segregated into inert and non-inert materials, in which the inert portion could be reused and recycled as far as practicable before delivery to PFRFs as mentioned for beneficial use in other projects. While opportunities for reusing the non-inert portion should be investigated before disposal of at designated landfills. - Possibility of reusing the spoil in the Project will be continuously investigated in the construction stage.	To minimize potential adverse environmental impacts during the handling, transportation and disposal of C&D materials	Contractor	All work Sites	Construction Phase	ETWB TCW No. 31/2004 ETWB TCW No. 33/2002 ETWB TCW No. 19/2005
6.75	Sediments - The basic requirements and procedures for dredged	To ensure the sediment to be disposed of in an	Contractor	All works areas with sediments	Construction Phase	PNAP 252

Contract No. HK/2011/07 Wanchai Development Phase II and Central Wanchai Bypass (Shatin to Central Link (SCL) Protection Works at Causeway Bay Typhoon Shelter)

	sediment disposal specified under PNAP 252 shall be followed. MFC manages disposal facilities in Hong Kong for the dredged sediment, while EPD is the authority issuing marine dumping permits under the <i>Dumping at Sea Ordinance</i> .	authorized and least impacted way		concern		
6.76	Sediments (con't) - The Project Proponent should agree in advance with MFC of CEDD on the site allocation by submitting a Construction & Demolition Material Management Plan. The contractor for the dredging works shall then apply for the site allocations of marine sediment disposal based on the prior agreement with MFC/CEDD. A request for reservation of sediment disposal space has been submitted to MFC for onward discussions of disposal approaches and feasible disposal sites. The Project Proponent is also responsible for application of all necessary permits from the relevant authorities, including the dumping permit as required under DASO from EPD, for the disposal of dredged sediment prior to the commencement of the dredging works.	To determine the best handling and disposal option of the sediments	MTR / Contractor	All works areas with sediments concern	Prior to the start of dredging works	PNAP 252; Dumping at Sea Ordinance

Wanchai Development Phase II and Central Wanchai Bypass (Shatin to Central Link (SCL) Protection Works at Causeway Bay Typhoon Shelter)

6.77 –	Sediments (con't)	To ensure	Contractor	Work Sites,	Construction	PNAP 252
6.81	- Requirements of the Air	handling of		Sediment	Phase	Dumping at
0.01	Pollution Ordinance	sediments are in		disposal	1 11000	Sea
	(Construction Dust) Regulation,	accordance to		sites		Ordinance
	where relevant, shall be	statutory				
	adhered to during dredging,	requirements				
	transportation and disposal of	requiremente				
	sediments.					
	- Stockpiling of contaminated					
	sediments should be avoided					
	as far as possible. If temporary					
	stockpiling of contaminated					
	sediments is necessary, the					
	dredged sediment should be					
	covered by tarpaulin and the					
	area should be placed within					
	earth bunds or sand bags to					
	prevent leachate from entering					
	the ground, nearby drains					
	and/or surrounding water					
	bodies. The stockpiling areas					
	should be completely paved or					
	covered by linings in order to					
	avoid contamination to					
	underlying soil or groundwater.					
	Separate and clearly defined					
	areas should be provided for					
	stockpiling of contaminated and					
	uncontaminated materials.					
	Leachate, if any, should be					
	collected and discharged					
	according to the Water					
	Pollution Control Ordinance					
	(WPCO).					
	- In order to minimise the					
	potential odour / dust emissions					
	during dredging and					

Contract No. HK/2011/07 Wanchai Development Phase II and Central Wanchai Bypass (Shatin to Central Link (SCL) Protection Works at Causeway Bay Typhoon Shelter)

			1	
transportation of the sediment,				
the dredged sediments should				
be properly covered when				
placed on barges. Loading of				
the dredged sediment to the				
barge should be controlled to				
avoid splashing and				
overflowing of the sediment				
slurry to the surrounding water.				
- The barge transporting the				
sediments to the designated				
disposal sites should be				
equipped with tight fitting seals				
to prevent leakage and should				
not be filled to a level that				
would cause overflow of				
materials or laden water during				
loading or transportation. In				
addition, monitoring of the				
barge loading shall be				
conducted to ensure that loss				
of material does not take place				
during transportation. Transport				
barges or vessels shall be				
equipped with automatic self-				
monitoring devices as specified				
by the DEP.				
- In order to minimise the				
exposure to contaminated				
materials, workers should wear				
appropriate personal protective				
equipments (PPE) when				
handling contaminated				
sediments. Adequate washing				
and cleaning facilities should				
also be provided on site.				
	1			

Wanchai Development Phase II and Central Wanchai Bypass

(Shatin to Central Link (SCL) Protection

Works at Causeway Bay Typhoon Shelter)

6.82	Sediments (con't) The dredging work and associate sediment handling under this Project will be undertaken together with the CWB project by Highways Department and geosynthetic containment will be adopted to handle Type 3 sediments.	To ensure handling of sediments are in accordance to statutory requirements	Contractor	Work Sites, Sediment disposal sites	Construction Phase	PNAP 252 Dumping at Sea Ordinance
6.86	Containers for Storage of Chemical Waste The Contractor should register with EPD as a chemical waste producer and to follow the guidelines stated in the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes. Containers used for storage of chemical waste should: - Be compatible with the chemical wastes being stored, maintained in good condition and securely sealed; - Have a capacity of less than 450 litters unless the specifications have been approved by EPD; and	To register with EPD as a Chemical waste producer and store chemical waste in appropriate containers	Contractor	Chemical waste storage area	Construction Phase	Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes

Contract No. HK/2011/07 Wanchai Development Phase II and Central Wanchai Bypass (Shatin to Central Link (SCL) Protection Works at Causeway Bay Typhoon Shelter)

	- Display a label in English and Chinese in accordance with instructions prescribed in Schedule 2 of the Waste Disposal (Chemical Waste) (General) Regulation.					
6.87	 Chemical Waste Storage Area Be clearly labeled to indicate corresponding chemical characteristics of the chemical waste and used for storage of chemical waste only; Be enclosed on at least 3 sides; Have an impermeable floor and bunding, of capacity to accommodate 110% of the volume of the largest container or 20% by volume of the chemical waste stored in that area, whichever is the greatest; Have adequate ventilation; Be covered to prevent rainfall from entering; and Be properly arranged so that incompatible materials are adequately separated. 	To prepare appropriate storage areas for chemical waste at works areas	Contractor	Chemical waste storage area	Construction Phase	Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes
6.88	Labelling of Chemical Waste - Lubricants, waste oils and other chemical wastes would be generated during the maintenance of vehicles and mechanical equipments. Used	To clearly label the chemical waste at works areas	Contractor	Chemical waste storage area	Construction Phase	Code of Practice on the Packaging, Labelling and Storage of Chemical

Wanchai Development Phase II and Central Wanchai Bypass (Shatin to Central Link (SCL) Protection

EM&A Report for Shatin to Central Link Protection Works at Causeway Bay Typhoon SHelter

Works at Causeway Bay Typhoon Shelter)

	lubricants should be collected and stored in individual containers which are fully labeled in English and Chinese and stored in a designated secure place.					Wastes
6.89	Collection and Disposal of Chemical Waste - A trip-ticket system should be operated in accordance with the Waste Disposal (Chemical Waste) (General) Regulation to monitor all movements of chemical waste. The Contractor shall employ a licensed collector to transport and dispose of the chemical wastes, to either the approved CWTC at Tsing Yi, or another licensed facility, in accordance with the Waste Disposal (Chemical Waste) (General) Regulation.	To monitor the generation, reuse and disposal of chemical waste	Contractor	Work Sites with chemical waste production	Construction Phase	Waste Disposal (Chemical Waste) (General) Regulation
6.90	General Refuse - General refuse should be stored in enclosed bins or compaction units separate from C&D materials and chemical waste. A reputable waste collector should be employed by the contractor to remove general refuse from the site, separately from C&D materials and chemical wastes. Preferably, an enclosed and	To properly store and separate from other C&D materials for subsequent collection and disposal	Contractor	All Work Sites	Construction Phase	-

Contract No. HK/2011/07 Wanchai Development Phase II and Central Wanchai Bypass (Shatin to Central Link (SCL) Protection Works at Causeway Bay Typhoon Shelter)

	covered area should be provided to reduce the occurrence of windblown light material.					
6.91	General Refuse (con't) - The recyclable component of general refuse, such as aluminum cans, paper and cleansed plastic containers should be separated from other waste. Provision and collection of recycling bins for different types of recyclable waste should be set up by the Contractor. The Contractor should also be responsible for arranging recycling companies to collect these materials.	To facilitate recycling of recyclable portions of refuse	Contractor	All Work Sites	Construction Phase	-
6.92	General Refuse (con't) - The Contractor should carry out an education programme for workers in avoiding, reducing, reusing and recycling of materials generation. Posters and leaflets advising on the use of the bins should also be provided in the sites as reminders.	To raise workers' awareness on recycling issue	Contractor	All Work Sites	Construction Phase	-



Appendix 4.1

Action and Limit Level



Lam Geotechnics Limited

Contract No. HK/2011/07 Wanchai Development Phase II and Central Wanchai Bypass (Shatin to Central Link (SCL) Protection Works at Causeway Bay Typhoon Shelter)

Action and Limit Level

Action and Limit Level for Air Quality Monitoring

1-hour TSP Level in μ g/m ³		24-hour TSP Level in μ g/m ³		
Action Level Limit Level		Action Level	Limit Level	
311.3	500	171.0	260	

Action and Limit Level for Noise Monitoring

Time Period	Action Level	Limit Level
07:00 – 19:00 hours on normal weekdays	When one documented complaint is received.	75 dB(A)/ 70 dB(A)/ 65 db(A) ^{Note 1}

Note 1:

70dB(A) and 65 dB(A) for schools during normal teaching periods and school examination periods, respectively.

- If works are to be carried out during the restricted hours, the conditions stipulated in the Construction Noise Permit (CNP) issued by the Noise Control Authority have to be followed.

Action and Limit Level for Water Quality Monitoring

Parameters	Dry S	Season Wet Season		eason		
	Action Level	Limit Level	Action Level	Limit Level		
Cooling Water Inta	Cooling Water Intake					
SS in mg/L	15.00	22.13	18.42	27.54		
Turbidity in NTU	9.10	10.25	11.35	12.71		
DO in mg/L 3.36		2.73	3.02	2.44		

Remarks: - Contractor shall implement additional improvement measures in case of oxygen depletion (i.e. DO level <2 mg/L) detected within CBTS.



Appendix 4.2

Copies of Calibration Certificates



Certificate No. 23551	Page	1	of	4 Pages
Customer: Lam Geotechnics Limited				
Address : 11/F, Centre Point, 181-185 Gloucester Road, Wand	hai, Hong Kong.			
Order No. : Q21462	Date of receipt	:		11-Jun-12
Item Tested				
Description : Digital Sound Level Meter				
Manufacturer : B&K				
Model : Type 2236	Serial No.	:	2100	736
Test Conditions				
Date of Test: 12-Jun-12	Supply Voltage	; ;		
Ambient Temperature : (23 ± 3)°C	Relative Humic	dity :	(50 ±	25) %
Test Specifications				
Calibration check.				
Ref. Document/Procedure : Z01.				
Test Results				
All results were within the IEC 651 Type 1, IEC 804 Type 1 & IEC 12	60 Class 1 speci	ficati	on.	
The results are shown in the attached page(s).				

Main Test equip	ment used:	
Equipment No.	Description	

Equipment No.	Description	<u>Cert. No.</u>	Traceable to
S017	Multi-Function Generator	C101623	SCL-HKSAR
S024	Sound Level Calibrator	15136	NIM-PRC & SCL-HKSAR

The values given in this Calibration Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environmental changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Hong Kong Calibration Ltd. shall not be liable for any loss or damage resulting from the use of the equipment.

n marine su terres

The test equipment used for calibration are traceable to International System of Units (SI). The test results apply to the above Unit-Under-Test only

Calibrated by :

P. F. Wong

Approved by : Dorothy Che

Dorothy Cheuk

This Certificate is issued by: Hong Kong Calibration Ltd. Unit 8B, 24/F., Well Fung Industrial Centre, No. 58-76, Ta Chuen Ping Street,Kwai Chung, NT,Hong Kong. Tel: 2425 8801 Fax: 2425 8646

The copyright of this certificate is owned by Hong Kong Calibration Ltd.. It may not be reproduced except in full.



Certificate No. 23551

Page 2 of 4 Pages

Results :

1. SPL Accuracy

	J	JUT Setting			
Range	Parameter	Frequency Wt.	Freq. Response	Applied Value (dB)	UUT Reading (dB)
20 - 100	SPL	dBA	F	94.0	93.8
			S		93.8
		dBC	F		93.9
		dBL	F		93.9
		1 kHz	F		93.9
40 - 120	SPL	dBA	F	94.0	93.9
		1 kHz	F		94.0
	SPL	dBA	F	114.0	114.0
			S		114.0
		dBC	F		114.0
		dBL	F		114.1
		1 kHz	F]	114.0

IEC 651 Type 1 Spec. : \pm 0.7 dB Uncertainty : \pm 0.1 dB

 Level Stability : 0.0 dB IEC 651 Type 1 Spec. : ± 0.3 dB Uncertainty : ± 0.01 dB

3. Linearity

3.1 Level Linearity

UUT Range (dB)	Applied Value (dB)	UUT Reading (dB)	Variation (dB)	IEC 651 Type 1 Spec. (Primary Indicator Range)
140	114.0	113.8	-0.1	± 0.7 dB
130	104.0	103.9	0.0	-
120	94.0	93.9 (Ref.)		
110	84.0	83.9	0.0	
100	74.0	73.9	0.0	
90	64.0	63.9	0.0	
90	54.0	53.9	0.0	

Uncertainty : ± 0.1 dB

The copyright of this certificate is owned by Hong Kong Calibration Ltd., It may not be reproduced except in full.



Certificate No. 23551

Page 3 of 4 Pages

3.2 Differential level linearity

UUT Range	Applied	UUT Reading		
(dB)	Value (dB)	(dB)	Variation (dB)	IEC 651 Type 1 Spec.
120	84.0	83.9	0.0	± 0.4 dB
	94.0	93.9 (Ref.)		
	95.0	94.8	-0.1	$\pm 0.2 \text{ dB}$

Uncertainty : $\pm 0.1 \text{ dB}$

4. Frequency Weighting

A weighting

Frequency	Attenuation (dB)	IEC 651 Type 1 Spec.
31.5 Hz	-39.4	- 39.4 dB, ± 1.5 dB
63 Hz	-26.1	- 26.2 dB, ± 1.5 dB
125 Hz	-16.1	- 16.1 dB, ± 1 dB
250 Hz	-8.6	- $8.6 \text{ dB}, \pm 1 \text{ dB}$
500 Hz	-3.2	- $3.2 dB, \pm 1 dB$
1 kHz	0.0 (Ref)	$0 \text{ dB}, \pm 1 \text{ dB}$
2 kHz	+1.3	$+ 1.2 \text{ dB}, \pm 1 \text{ dB}$
4 kHz	+1.0	$+ 1.0 \text{ dB}, \pm 1 \text{ dB}$
8 kHz	-1.1	- 1.1 dB, + 1.5 dB ~ -3 dB
16 kHz	-6.7	$- 6.6 \text{ dB}, + 3 \text{ dB} \sim -\infty$

Uncertainty : $\pm 0.1 \text{ dB}$

5. Time Averaging

Applied Burst duty Factor	Applied Leq Value (dB)	UUT Reading (dB)	IEC 804 Type 1 Spec.
continuous	40.0	40.0	
1/10	40.0	39.9	± 0.5 dB
1/10 ²	40.0	39.8	
1/10 ³	40.0	39.7	± 1.0 dB
1/10 ⁴	40.0	39.5	

Uncertainty : $\pm 0.1 \text{ dB}$

The copyright of this certificate is owned by Hong Kong Calibration Ltd., it may not be reproduced except in full.



Certificate No. 23551

Page 4 of 4 Pages

6. Filter Response

Filter	Setting		Attenuation (d	B)	IEC 1260 Class 1 Spec.
125	Hz		-63.5		<- 61
250	Hz		-44.7		<- 42
500	Hz		-20.8		< - 17.5
707	Hz		-3.5		- 2~- 5
1	kHz	(Ref.)	0.0	(Ref.)	
1.41	4 kHz		-3.9		- 2~- 5
2	kHz		-21.2		<- 17.5
4	kHz		-44.9		<- 42
8	kHz		-63.7		<- 61

Uncertainty : $\pm 0.2 \text{ dB}$

Remark : 1. UUT : Unit-Under-Test

2. The uncertainty claimed is for a confidence probability of not less than 95%.

3. Atmospheric Pressure : 992 hPa

----- END -----



Certificate No.	25144		Page	1	of	2 Pages	
Customer :	Lam Geotechnics Limited						
Address :	11/F, Centre Point, 181-185 Glou	ucester Road, Wand	chai, Hong Kong.				
Order No. : Q22033			Date of receipt : 2-Aug-12			12	
Item Tested							
Description :	Sound Level Calibrator						
Manufacturer :	B&K						
Model :	Туре 4230		Serial No. : 1411076				
Test Conditi	ons						
Date of Test: 10-Aug-12			Supply Voltage :				
Ambient Temp	erature : (23 ± 3)°C		Relative Humidity : (50 ± 25) %				
Test Specifi	cations						
Calibration chec Ref. Document/	sk. Procedure: F21, Z02.						
Test Results	\$						
	within the IEC 942 Class 1 specif shown in the attached page(s).	fication.					
Main Test equip	oment used:						
Equipment No.	Description	<u>Cert. No.</u>		Tra	ceab	<u>le to</u>	
S014	Spectrum Analyzer	13535		NIN	I-PR	C & SCL-HI	KSAR
S024	Sound Level Calibrator	15136		NIN	1-PR	C & SCL-HI	KSAR
S041	Universal Counter	15610		SCI	HK	SAR	
S191	61/2 dgt. Multimeter	20033		NIN	1-PR	С	

The values given in this Calibration Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environmental changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Hong Kong Calibration Ltd. shall not be liable for any loss or damage resulting from the use of the equipment.

The test equipment used for calibration are traceable to International System of Units (SI). The test results apply to the above Unit-Under-Test only

Calibrated by :

This Certificate is issued by:

Stephen Chu

Approved by : _ Dorothy Cheuk

Date: 10-Aug-12

Hong Kong Calibration Ltd. Unit 8B, 24/F., Well Fung Industrial Centre, No. 58-76, Ta Chuen Ping Street,Kwai Chung, NT,Hong Kong. Tel: 2425 8801 Fax: 2425 8646

The copyright of this certificate is owned by Hong Kong Calibration Ltd., It may not be reproduced except in full.



Certificate No. 25144

Page 2 of 2 Pages

Results :

1. Level Accuracy

ſ	UUT Nominal Value (dB)	Measured Value (dB)	IEC 942 Class 1 Spec.
	94	93.96	$\pm 0.3 \text{ dB}$

Uncertainty : $\pm 0.2 \text{ dB}$

2. Frequency

UUT Nominal Value	Measured Value	IEC 942 Class 1 Spec.
1 kHz	1.000 kHz	± 2 %

Uncertainty : \pm 3.6 x 10⁻⁶

- Level Stability : 0.0 dB
 IEC 942 Class 1 Spec. : ± 0.1 dB
 Uncertainty : ± 0.01 dB
- 4. Total Harmonic Distortion : < 1.5 % IEC 942 Class 1 Spec. : < 3 % Uncertainty : ± 2.3 % of reading

Remark : 1. UUT : Unit-Under-Test

- 2. The above measured values are the mean of 3 measurement.
- 3. The uncertainty claimed is for a confidence probability of not less than 95%.
- 4. Atmospheric Pressure : 995 hPa.

----- END -----



ALS Technichem (HK) Pty Ltd

REPORT OF EQUIPMENT PERFORMANCE CHECK/CALIBRATION

CONTACT: MS EMILY KONG CLIENT: LAM GEOTECHNICS LIMITED ADDRESS: 11/F., CENTRE POINT, 181-185 GLOUCESTER ROAD, WAN CHAI, HONG KONG PROJECT: --

HK1230418
HONG KONG
15/11/2012
21/11/2012

COMMENTS

It is certified that the item under calibration/checking has been calibrated/checked by corresponding calibrated equipment in the laboratory.

Maximum Tolerance and calibration frequency stated in the report, unless otherwise stated, the internal aceptance criteria of ALS will be followed.

Scope of Test:	Dissolved Oxygen, pH, Salinity and Temperature
Description:	YSI SONDE
Brand Name:	YSI
Model No.:	YSI Professional plus
Serial No.:	11F100597
Equipment No.:	
Date of Calibration:	20 November, 2012

NOTES

This is the Final Report and supersedes any preliminary report with this batch number. Results apply to sample(s) as submitted. All pages of this report have been checked and approved for release.

ISSUING LABORATORY: HONG KONG

Address

ALS Technichem (HK) Pty Ltd

11/F Chung Shun Knitting Centre 1-3 Wing Yip Street Kwai Chung HONG KONG Phone: Fax: Email: 852-2610 1044 852-2610 2021 hongkong@alsglobal.com

Mr Chan Kwok Fai, Godfrey Laboratory Manager Hong Kong

This report may not be reproduced except with prior written approval from ALS Technichem (HK) Pty Ltd.

Page 1 of 2

ADDRESS 11/F, Chung Shun Knitting Centre, 1-3 Wing Yip Street, Kwai Chung, N.T., Hong Kong PHONE +852 2610 1044 FAX +852 2610 2021 ALS TECHNICHEM (HK) PTY LTD Part of the ALS Laboratory Group A Campbell Brothers Limited Company

Life Sciences

www.alsglobal.com

RIGHT SOLUTIONS RIGHT PARTNER

Work Order: Date of Issue: Client: HK1230418 21/11/2012 LAM GEOTECHNICS LIMITED



Description: Brand Name: Model No.: Serial No.: Equipment No.: Date of Calibration:	YSI SONDE YSI YSI Professional plus 11F100597 20 November, 2012	Date of next Calibration:	20 February, 2013
Parameters:			
Dissolved Oxygen	Method Ref: APHA (21st edition Expected Reading (mg/L) 3.67 5.54 8.76	on), 45000: G Displayed Reading (mg/L) 3.65 5.57 8.72 Tolerance Limit (±mg/L)	Tolerance (mg/L) -0.02 0.03 -0.04 0.20
pH Value	Method Ref: APHA (21st editi Expected Reading (pH Unit)	on), 4500H:B Displayed Reading (pH Unit)	Tolerance (pH unit)
	4.0 7.0 10.0	4.02 7.02 9.97 Tolerance Limit (±unit)	0.02 0.02 -0.03 0.20
Salinity	Method Ref: APHA (21st editi	on), 2520B	
,	Expected Reading (ppt) 0 10 20 30	Displayed Reading (ppt) 0.00 9.75 19.95 30.13	Tolerance (%) -2.5 -0.3 0.4
		Tolerance Limit (±%)	10.0
Temperature		rnational Accreditation New Zeala Iarch 2008: Working Thermomete Displayed Reading (°C)	

dulue No. 5 Second Edition March 2000. Working Thermometer Cambration Procedures		
Expected Reading (°C) Displayed Reading (°C)		Tolerance (°C)
15.5 24.0	15.3 24.3	-0.2 0.3
41.0	40.2	-0.8
	Tolerance Limit (°C)	2.0

Mr/Chan Kwok Fai, Godfrey Laboratory Manager Hong Kong

ALS Technichem (HK) Pty Ltd ALS Environmental



ALS Technichem (HK) Pty Ltd

REPORT OF EQUIPMENT PERFORMANCE CHECK/CALIBRATION

CONTACT: MS EMILY KONG CLIENT: LAM GEOTECHNICS LIMITED ADDRESS: 11/F., CENTRE POINT, 181-185 GLOUCESTER ROAD, WAN CHAI, HONG KONG

WORK ORDER:	HK1303068
LABORATORY:	HONG KONG
DATE RECEIVED:	04/02/2013
DATE OF ISSUE:	14/02/2013

PROJECT:

COMMENTS

It is certified that the item under calibration/checking has been calibrated/checked by corresponding calibrated equipment in the laboratory. Maximum Tolerance and calibration frequency stated in the report, unless otherwise stated, the

internal aceptance criteria of ALS will be followed.

Scope of Test:	Dissolved Oxygen, pH, Salinity and Temperature
Description:	YSI SONDE
Brand Name:	YSI
Model No.:	YSI Professional Plus
Serial No.:	11F100420
Equipment No.:	
Date of Calibration:	05 February, 2013

NOTES

This is the Final Report and supersedes any preliminary report with this batch number. Results apply to sample(s) as submitted. All pages of this report have been checked and approved for release.

ISSUING LABORATORY: HONG KONG

Address

ALS Technichem (HK) Pty Ltd

11/F Chung Shun Knitting Centre 1-3 Wing Yip Street Kwai Chung HONG KONG Phone: Fax: Email: 852-2610 1044 852-2610 2021 <u>hongkong@alsglobal.com</u>

Mr Chan Kwok Fai, Godfrey Laborator Manager - Hong Kong

This report may not be reproduced except with prior written approval from ALS Technichem (HK) Pty Ltd.

Page 1 of 2

ADDRESS 11/F, Chung Shun Knitting Centre, 1-3 Wing Yip Street, Kwai Chung, N.T., Hong Kong | PHONE +852 2610 1044 | FAX +852 2610 2021 ALS TECHNICHEM (HK) PTY LTD An ALS Limited Company

Life Sciences

www.alsglobal.com

RIGHT SOLUTIONS RIGHT PARTNER

Work Order: Date of Issue: Client: HK1303068 14/02/2013 LAM GEOTECHNICS LIMITED



Description: Brand Name:	YSI SONDE YSI			
Model No.: Serial No.:	YSI Professional Plus 11F100420			
Equipment No.: Date of Calibration:	 05 February, 2013	Date of next Calibration:	05 May, 2013	

Parameters:

Method Ref: APHA (21st editio	on), 4500O: G	
Expected Reading (mg/L)	Displayed Reading (mg/L)	Tolerance (mg/L)
2.57	2.47	-0.10
4.14	4.08	-0.06
8.21	8.23	0.02
	Tolerance Limit (±mg/L)	0.20
	Expected Reading (mg/L) 2.57 4.14	2.57 2.47 4.14 4.08 8.21 8.23

pH Value

Method Ref: APHA (21st edition), 4500H:B

Meenoa Ren / III/ (mise carrie		
Expected Reading (pH Unit)	Displayed Reading (pH Unit)	Tolerance (pH unit)
4.0	4.01	0.01
7.0 10.0	7.08 9.95	0.08 -0.05
10.0	Tolerance Limit (± pH unit)	0.20
	rolerance Emit (2 pri unit)	0.20

Salinity

Method Ref: APHA (21st edition), 2520B

Expected Reading (ppt)	Displayed Reading (ppt)	Tolerance (%)
0	0	
10	9.66	-3.4
20	19.19	-4.0
30	28.36	-5.5
	Tolerance Limit (±%)	10.0

Temperature

Method Ref: Section 6 of International Accreditation New Zealand Technical

Guide No. 3 Second edition March 2008: Working Thermometer Calibration Procedure.		
Expected Reading (°C)	Displayed Reading (°C) Tolerance (°C	
12.0 21.0	11.6 21.6	-0.4 0.6
40.0	40.5	0.5
	Tolerance Limit (±°C)	2.0

Remark: "Displayed Reading" presents the figures shown on item under calibration / checking regardless of equipment precision or significant figures.

Mr Chan Kwok Fai, Godfrey aboratory Manager - Hong Kong

ALS Technichem (HK) Pty Ltd ALS Environmental



ALS Technichem (HK) Pty Ltd

REPORT OF EQUIPMENT PERFORMANCE CHECK/CALIBRATION

CONTACT: MS EMILY KONG CLIENT: LAM GEOTECHNICS LIMITED ADDRESS: 11/F., CENTRE POINT, 181-185 GLOUCESTER ROAD, WAN CHAI, HONG KONG PROJECT: --
 WORK ORDER:
 HK1231750

 LABORATORY:
 HONG KONG

 DATE RECEIVED:
 03/12/2012

 DATE OF ISSUE:
 17/12/2012

COMMENTS

It is certified that the item under calibration/checking has been calibrated/checked by corresponding calibrated equipment in the laboratory.

Maximum Tolerance and calibration frequency stated in the report, unless otherwise stated, the internal aceptance criteria of ALS will be followed.

Scope of Test:	Dissolved Oxygen, pH, Salinity and Temperature
Description:	YSI SONDE
Brand Name:	YSI
Model No.:	YSI Professional plus
Serial No.:	11F100421
Equipment No.:	
Date of Calibration:	10 December, 2012

NOTES

This is the Final Report and supersedes any preliminary report with this batch number. Results apply to sample(s) as submitted. All pages of this report have been checked and approved for release.

ISSUING LABORATORY: HONG KONG

Address

ALS Technichem (HK) Pty Ltd

11/F Chung Shun Knitting Centre 1-3 Wing Yip Street Kwai Chung HONG KONG Phone: Fax: Email: 852-2610 1044 852-2610 2021 hongkong@alsglobal.com

Mr Chan Kwok Fai, Godfrey Laboratory Manager - Hong Kong

This report may not be reproduced except with prior written approval from ALS Technichem (HK) Pty Ltd.

Page 1 of 2

ADDRESS 11/F, Chung Shun Knitting Centre, 1-3 Wing Yip Street, Kwai Chung, N.T., Hong Kong PHONE +852 2610 1044 FAX +852 2610 2021 ALS TECHNICHEM (HK) PTY LTD Part of the ALS Laboratory Group A Campbell Brothers Limited Company

Life Sciences

www.alsglobal.com

RIGHT SOLUTIONS RIGHT PARTNER

Work Order: Date of Issue: Client: HK1231750 17/12/2012 LAM GEOTECHNICS LIMITED



Description: Brand Name: Model No.: Serial No.: Equipment No.: Date of Calibration:	YSI SONDE YSI YSI Professional plus 11F100421 10 December, 2012	Date of next Calibration:	10 March, 2013
Parameters:			
Dissolved Oxygen	Method Ref: APHA (21st edition Expected Reading (mg/L)	on), 45000: G Displayed Reading (mg/L)	Tolerance (mg/L)
	4.08 6.16 8.62	4.25 6.16 8.72	0.17 0.00 0.10
		Tolerance Limit (±mg/L)	0.20
pH Value	Method Ref: APHA (21st edition		
		Displayed Reading (pH Unit)	Tolerance (pH unit)
	4.0	3.97	-0.03
	7.0	7.05	0.05
	10.0	9.98	-0.02
		Tolerance Limit (±unit)	0.20
Salinity	Method Ref: APHA (21st edition		
	Expected Reading (ppt)	Displayed Reading (ppt)	Tolerance (%)
	0	0.00	
	10	9.64	-3.6
	20	19.60	-2.0
	30	29.79	-0.7
		Tolerance Limit (±%)	10.0

Temperature

Method Ref: Section 6 of International Accreditation New Zealand Technical

Guide No. 3 Second edition March 2008: Working Thermometer Calibration Procedure.Expected Reading (°C)Displayed Reading (°C)Tolerance (°C)13.012.6-0.423.023.20.239.038.9-0.1Tolerance Limit (°C)

Mr Chan Kwok Fal, Godfrey Laboratory Manager - Hong Kong

ALS Technichem (HK) Pty Ltd ALS Environmental



ALS Technichem (HK) Pty Ltd

REPORT OF EQUIPMENT PERFORMANCE CHECK/CALIBRATION

CONTACT: MS EMILY KONG CLIENT: LAM GEOTECHNICS LIMITED ADDRESS: 11/F., CENTRE POINT, 181-185 GLOUCESTER ROAD, WAN CHAI, HONG KONG PROJECT: --
 WORK ORDER:
 HK1300029

 LABORATORY:
 HONG KONG

 DATE RECEIVED:
 02/01/2013

 DATE OF ISSUE:
 09/01/2013

COMMENTS

It is certified that the item under calibration/checking has been calibrated/checked by corresponding calibrated equipment in the laboratory.

Maximum Tolerance and calibration frequency stated in the report, unless otherwise stated, the internal aceptance criteria of ALS will be followed.

Dissolved Oxygen, pH, Salinity and Temperature
YSI SONDE
YSI
YSI 600XL
05C1607
08 January, 2013

NOTES

This is the Final Report and supersedes any preliminary report with this batch number. Results apply to sample(s) as submitted. All pages of this report have been checked and approved for release.

ISSUING LABORATORY: HONG KONG

Address

ALS Technichem (HK) Pty Ltd

11/F Chung Shun Knitting Centre 1-3 Wing Yip Street Kwai Chung HONG KONG Phone: Fax: Email: 852-2610 1044 852-2610 2021 hongkong@alsglobal.com

Mr. Fung Lim Chee, Richard General Manager Greater China & Hong Kong

This report may not be reproduced except with prior written approval from ALS Technichem (HK) Pty Ltd.

Page 1 of 2

ADDRESS 11/F, Chung Shun Knitting Centre, 1-3 Wing Yip Street, Kwai Chung, N.T., Hong Kong | PHONE +852 2610 1044 | FAX +852 2610 2021 ALS TECHNICHEM (HK) PTY LTD An ALS Limited Company

www.alsglobal.com

RIGHT SOLUTIONS RIGHT PARTNER

Work Order:	HK1300029
Date of Issue:	15/01/2013
Client:	LAM GEOTECHNICS LIMITED



Description:	YSI SONDE
Brand Name:	YSI
Model No.:	YSI 600XL
Serial No.:	05C1607
Equipment No.:	
Date of Calibration:	08 January, 2013

Date of next Calibration:

08 April, 2013

Parameters:

Dissolved Oxygen Method Ref: APHA (21st edition), 45000: G

Expected Reading (mg/L)	Displayed Reading (mg/L)	Tolerance (mg/L)		
4.05	4.25	0.2		
6.10	6.26	0.16		
8.60	8.56	-0.04		
	Tolerance Limit (±mg/L)	0.20		

pH Value

Method Ref: APHA (21st edition), 4500H:B

iou Ren ArnA (Eist cutton), isoonis				
Expected Reading (pH Unit)	Displayed Reading (pH Unit)	Tolerance (pH unit)		
4.0	4.16	0.16		
7.0	7.15	0.15		
10.0	9.82	-0.18		
	Tolerance Limit (±pH Unit)	0.20		

Salinity

Method Ref: APHA (21st edition), 2520B

Meth	Method Rei. AFHA (21st edition), 2520b				
	Expected Reading (g/L)	Displayed Reading (g/L)	Tolerance (%)		
			· · · · · · · · · · · · · · · · · · ·		
	0	0	·		
	10	9.98	-0.20		
	20	20.13	0.65		
	30	30.63	2.10		
		3			
		Tolerance Limit (±%)	10.0		

Temperature

Method Ref: Section 6 of International Accreditation New Zealand Technical

Guide No. 3 Second edition March 2008: Working Thermometer Calibration Procedure.

Reading of Ref. thermometer (°C)	Displayed Reading (°C)	Tolerance (°C)
13.5 21.0	13.16 19.97	-0.3 -1.0
36.0	35.31	-0.7
	Tolerance Limit (±°C)	2.0

Remark: Displayed Reading presents the figures shown on item under calibration / checking regardless of equipment precision or significant figures.

Mr. Fung Lim Chee, Richard General Manager -Greater China & Hong Kong Page 2 of 2

ALS Technichem (HK) Pty Ltd ALS Environmental



CONTACT: MS EMILY KONG CLIENT: LAM GEOTECHNICS LIMITED ADDRESS: 11/F., CENTRE POINT, 181-185 GLOUCESTER ROAD, WAN CHAI, HONG KONG ---

WORK ORDER:	HK1232366
AMENDMENT NO .:	1
LABORATORY:	HONG KONG
DATE RECEIVED:	07/12/2012
DATE OF ISSUE:	14/02/2013

PROJECT:

COMMENTS

It is certified that the item under calibration/checking has been calibrated/checked by corresponding calibrated equipment in the laboratory. Maximum Tolerance and calibration frequency stated in the report, unless otherwise stated, the internal aceptance criteria of ALS will be followed.

Turbidity	
Turbidimeter	
XINRUI	
WGZ-3B	
1203010	
14 December, 2012	
	Turbidimeter XINRUI WGZ-3B 1203010

NOTES

This is the Final Report and supersedes any preliminary report with this batch number. Results apply to sample(s) as submitted. All pages of this report have been checked and approved for release.

ISSUING LABORATORY: HONG KONG

Address

ALS Technichem (HK) Pty Ltd

11/F Chung Shun Knitting Centre 1-3 Wing Yip Street Kwai Chung HONG KONG

Phone: Fax: Email:

852-2610 1044 852-2610 2021 hongkong@alsglobal.com

Mr. Fung Lim Chee, Richard General Manager Greater China & Hong Kong

This report may not be reproduced except with prior written approval from ALS Technichem (HK) Pty Ltd.

Page 1 of 2

ADDRESS 11/F, Chung Shun Knitting Centre, 1-3 Wing Yip Street, Kwai Chung, N.T., Hong Kong | PHONE +852 2610 1044 | FAX +852 2610 2021 ALS TECHNICHEM (HK) PTY LTD An ALS Limited Company

Life Sciences

www.alsglobal.com

RIGHT SOLUTIONS RIGHT PARTNER

Work Order: Amendment No.: Date of Issue: Client: HK1232366 1 14/02/2013 LAM GEOTECHNICS LIMITED



Description:	Turbidimeter		
Brand Name:	XINRUI		
Model No.:	WGZ-3B		
Serial No.:	1203010		
Equipment No.:			
Date of Calibration:	14 December, 2012	Date of next Calibration:	14 March, 2013

Parameters:

Turbidity

Method Ref: APHA 21st Ed. 2130B

Expected Reading (NTU)	Displayed Reading (NTU)	Tolerance (%)
0	0.00	
4	4.10	2.5
40	38.19	-4.5
80	81.59	2.0
400	372.8	-6.8
800	792.0	-1.0
	Tolerance Limit (±%)	10.0

Remark: "Displayed Reading" presents the figures shown on item under calibration / checking regardless of equipment precision or significant figures.

w Mr. Fung Lim Chee, Richard

General Manager Greater China & Høng Kong

ALS Technichem (HK) Pty Ltd **ALS Environmental**



CONTACT: MS EMILY KONG CLIENT: LAM GEOTECHNICS LIMITED ADDRESS: 11/F., CENTRE POINT, 181-185 GLOUCESTER ROAD, WAN CHAI, HONG KONG
 WORK ORDER:
 HK1232007

 LABORATORY:
 HONG KONG

 DATE RECEIVED:
 05/12/2012

 DATE OF ISSUE:
 13/12/2012

PROJECT:

COMMENTS

It is certified that the item under calibration/checking has been calibrated/checked by corresponding calibrated equipment in the laboratory. Maximum Tolerance and calibration frequency stated in the report, unless otherwise stated, the internal aceptance criteria of ALS will be followed.

Scope of Test:	Turbidity
Description:	Turbidimeter
Brand Name:	WTW TURBIDMETER
Model No.:	TURB 430T
Serial No.:	12110692
Equipment No.:	
Date of Calibration:	05 December, 2012

NOTES

This is the Final Report and supersedes any preliminary report with this batch number. Results apply to sample(s) as submitted. All pages of this report have been checked and approved for release.

ISSUING LABORATORY: HONG KONG

Address

ALS Technichem (HK) Pty Ltd

11/F Chung Shun Knitting Centre 1-3 Wing Yip Street Kwai Chung HONG KONG Phone: Fax: Email: 852-2610 1044 852-2610 2021 <u>hongkong@alsglobal.com</u>

Wok Fai, Godfrey Mr/Char Laborator Manager - Hong Kong

This report may not be reproduced except with prior written approval from ALS Technichem (HK) Pty Ltd.

Page 1 of 2

ADDRESS 11/F, Chung Shun Knitting Centre, 1-3 Wing Yip Street, Kwai Chung, N.T., Hong Kong PHONE +852 2610 1044 FAX +852 2610 2021 ALS TECHNICHEM (HK) PTY LTD Part of the ALS Laboratory Group A Campbell Brothers Limited Company

Life Sciences

www.alsglobal.com

RIGHT SOLUTIONS RIGHT PARTNER

Work Order: Date of Issue: Client: HK1232007 13/12/2012 LAM GEOTECHNICS LIMITED

40

80

400

800



-0.7

0.1

-1.3

-1.0

10.0

Description: Brand Name: Model No.: Serial No.: Equipment No.: Date of Calibration:	Turbidimeter WTW TURBIDMETER TURB 430T 12110692 05 December, 2012	Date of next Calibration:	05 March, 2013
Parameters:			
Turbidity	Method Ref: APHA 21st Ed. 2	L30B	
	Expected Reading (NTU)	Displayed Reading (NTU)	Tolerance (%)
	0	0	
	4	4.31	7.7

39.7

80.1

395 792

Tolerance Limit (±%)

foller
Mr Chan Kwok Fai, Godfrey Laboratory Manager - Hong Kong
Laboratory Manager - Hong Kong





TISCH ENVIROMENTAL, INC. 145 SOUTH MIAMI AVE. VILLAGE OF CLEVES, OH 45002 513.467.9000 877.263.7610 TOLL FREE 513.467.9009 FAX WWW.TISCH-ENV.COM

AIR POLLUTION MONITORING EQUIPMENT

ORIFICE TRANSFER STANDARD CERTIFICATION WORKSHEET TE-5025A

Date - Ju	1 19, 2012	Rootsmeter	D / 1	138320	Ta (K) -	298
Operator	Tisch	Orifice I.I)005	Pa (mm) -	751.84
PLATE OR Run #	VOLUME START (m3)	VOLUME STOP (m3)	DIFF VOLUME (m3)	DIFF TIME (min)	METER DIFF Hg (mm)	ORFICE DIFF H2O (in.)
1	NA	NA	1.00	1.3840	3.2	2.00
2	NA	NA	1.00	0.9760	6.4	4.00
3	NA	NA	1.00	0.8730	7.9	5.00
4	NA	NA	1.00	0.8340	8.8	5.50
5	NA	NA	1.00	0.6890	12.7	8.00

DATA TABULATION

Vstd	(x axis) Qstd	(y axis)		Va	(x axis) Qa	(y axis)
0.9850 0.9809 0.9788 0.9777 0.9725	0.7117 1.0050 1.1212 1.1723 1.4115	1.4066 1.9892 2.2240 2.3326 2.8132		0.9957 0.9915 0.9894 0.9883 0.9831	0.7194 1.0159 1.1333 1.1850 1.4268	0.8903 1.2591 1.4078 1.4765 1.7807
Qstd sloj intercep coeffici	t (b) =	2.01145 -0.02803 0.99995		Qa slop intercep coeffici	t (b) =	1.25953 -0.01774 0.99995
v axis =	SQRT [H20 ()	Pa/760) (298/	Ta)]	'y axis =	SQRT [H20 (1	[a/Pa)]

CALCULATIONS

Vstd = Diff. Vol[(Pa-Diff. Hg)/760](298/Ta) Qstd = Vstd/Time

Va = Diff Vol [(Pa-Diff Hg)/Pa] Qa = Va/Time

For subsequent flow rate calculations:

Qstd = $1/m\{ [SQRT(H2O(Pa/760)(298/Ta))] - b \}$ Qa = $1/m\{ [SQRT H2O(Ta/Pa)] - b \}$ am

Lam Geotechincs Limited

Calibration Data for High Volume Sampler (TSP Sampler)

Location	:	СМАЗа	Calbration Date	 7-Feb-13
Equipment no.	:	EL888	Calbration Due Dat :	 7-Apr-13

CALIBRATION OF CONTINUOUS FLOW RECORDER

	Ambient Condition									
Temperature, T _a		294		Kelvin	Pressure, P	a		1018	mmHg	
			Orifice Tra	nsfer Stan	dard Informa	ation				
Equipment No.		EL086		Slope, m _c	2.011	45	Intercept, b	c -0.02	803	
Last Calibration Date	19-Jul-12				(HxH	P _a / 101	13.3 x 298	/T _a) ^{1/2}		
Next Calibration Date	19-Jul-13									
Calibration of RSP										
Calibration	Mar	nometer Re	eading	c	l _{std}	Continu	uous Flow	IC		
Point	H (inches of water)			(m ³	/ min.)	Reco	order, W	(W(P _a /1013.3x298	/T _a) ^{1/2} /35.31)	
	(up)	(down)	(difference)	X-	axis	(C	CFM)	Y-axi	s	
1	6.1	6.1	12.2	1.1	7662		54	54.492	20	
2	4.8	4.8	9.6	1.	5683		44	44.400)9	
3	4.0	4.0	8.0	1.4	4329		39	39.355	54	
4	2.4	2.4	4.8	1.1	1131		25	25.227	78	
5	1.4	1.4	2.8	0.8	3534		15	15.136	37	
By Linear Regression of	Y on X									
Slope, m = 42.8245 Intercept, b = -21.9533							_			
Correlation Co	pefficient*	=	0.99	991						
Calibration	Accepted	=	Yes/	\o **						

* if Correlation Coefficient < 0.990, check and recalibration again.

** Delete as appropriate.

Remarks :						
Calibrated by	:	Sam		Checked by	:	Derek Lo
Date	:	7-Feb-13	-	Date	:	7-Feb-13



Lam Geotechincs Limited

Calibration Data for High Volume Sampler (TSP Sampler)

Location	:	СМАЗа	Calbration Date	:	15-Dec-12
Equipment no.	:	EL888	Calbration Due Dat		15-Feb-13

CALIBRATION OF CONTINUOUS FLOW RECORDER

Ambient Condition									
Temperature, T _a		295		Kelvin	Pressure, P	a		1018	mmHg
			Orifice Tra	nsfer Stan	dard Inform	ation			
Equipment No.		EL086		Slope, m _c	2.011	45	Intercept, b	-0.02	2803
Last Calibration Date		19-Jul-12	2		(Hxl	P _a / 101	3.3 x 298	$(T_a)^{1/2}$	
Next Calibration Date	19-Jul-13								
Calibration of RSP									
Calibration	Mar	nometer Re	eading	Q	std	Continu	ous Flow	IC	
Point	H (inches of water)		(m ³	/ min.)	Reco	rder, W	(W(P _a /1013.3x298	3/T _a) ^{1/2} /35.31)	
	(up)	(down)	(difference)	X-	axis	(0	CFM)	Y-axi	s
1	6.1	6.1	12.2	1.7	7633		52	52.38	48
2	4.8	4.8	9.6	1.5	5657		43	43.31	82
3	4.1	4.1	8.2	1.4	1481		38	38.28	12
4	2.4	2.4	4.8	1.1	1112		24	24.17	76
5	1.5	1.5	3.0	0.8	3814		15	15.11	10
By Linear Regression of	Y on X								
Slope, m = 42.1310 Intercept, b = -22.3882							_		
Correlation Co	pefficient*	=	0.99	997					
Calibration	Accepted	=	Yes/	No**					

* if Correlation Coefficient < 0.990, check and recalibration again.

** Delete as appro	priate.				
Remarks :					
Calibrated by	:	Sam	Checked by	:	Derek Lo
Date	:	15-Dec-12	Date	:	15-Dec-12



Appendix 5.1

Monitoring Schedules for Reporting Month and Coming Reporting Month

Wan Chai Development Phase II and Central-Wan Chai Bypas Sampling, Field Measurement and Testing Works (Stage 2

Environmental Monitoring Schedule February 2013

27-Jan 28-Jan 29-Jan 30-Jan 1-Feb 2-Feb 24hr TSP(CMA3a) thr TSP 10-Feb 10-Feb 1-Feb 2-Feb 2-Feb 2-Feb 2-Feb 2-Feb 2-Feb 2-Feb 2-Feb 2-Feb 10-Feb 10-Feb<
24hr TSP(CMA3a) Ihr TSP Impact WQM Impact WQM<
24hr TSP(CMA3a) Inr TSP Inr TS
24hr TSP(CMA3a) Inr TSP Inr TS
24hr TSP(CMA3a)
24hr TSP(CMA3a)
24hr TSP(CMA3a)
24hr TSP(CMA3a)
24hr TSP(CMA3a) Ihr TSP Impact WQM Impact WQM<
24hr TSP(CMA3a) Ihr TSP Impact WQM Impact WQM<
1hr TSP Noise (Daytime) Impact WQM Impac
1hr TSP Noise (Daytime) Impact WQM Impac
1hr TSP Noise (Daytime) Impact WQM Impac
Impact WQM Noise (Daytime) Impact WQM Im
Impact WQM Mid-fbod: Impact WQ
Md ebb: 13.08 Mid-flood: Mid-flood: 8.36 Mid-flood: Mid-flood: 9.45 Mid-fbb: 3.Feb 4.Feb 5.Feb 6.Feb 7.Feb 8.Feb 9.F 24hr TSP 1hr TSP
Mid-ebb: 13:08 Mid-flood: Mid-flood: 8:36 Mid-flood: Mid-flood: 9.45 Mid-ebb: 3.Feb 4.Feb 5.Feb 6.Feb 7.Feb 8.Feb 9.F 24hr TSP 1hr Hr
3-Feb 4-Feb 5-Feb 6-Feb 7-Feb 8-Feb 9-F 24hr TSP 1hr TSP Noise (Daytime) 1mpact WQM
24hr TSP Ihr TSP Impact WQM Impact WQM Impact WQM Impact WQM Mid-flood: 12:01 Mid-flood: 14:05 Mid-flood: 16:21 Mid-bb: 19:15 Mid-ebb: 21:42 Mid-ebb: 23:21 10-Feb 11-Feb 12-Feb 13-Feb 14-Feb 15-Feb 16-F 10-Feb 11-Feb 12-Feb 13-Feb 14-Feb 15-Feb 16-F Mid-flood: 11-Feb 12-Feb 13-Feb 14-Feb 15-Feb 16-F Mid-flood: 10-Feb 11-Feb 12-Feb 13-Feb 14-Feb 15-Feb 16-F Mid-flood: 10-Feb 11-Feb 12-Feb 13-Feb 14-Feb 15-Feb 16-F Mid-flood: 10-Feb 11-Feb 12-Feb 13-Feb 14-Feb 15-Feb 16-F
Ihr TSP Impact WQM Impact WQM Impact WQM Impact WQM Mid-flood: 12:01 Mid-flood: 14:05 Mid-flood: 16:21 Mid-ebb: 19:15 Mid-ebb: 21:42 Mid-ebb: 23:21 10-Feb 11-Feb 11-Feb 12-Feb 13-Feb 14-Feb 15-Feb 16-F 24hr TSP 1hr TSP Noise (Daytime) Impact WQM Impact WQM Impact WQM Impact WQM Impact WQM Impact WQM Impact WQM Impact WQM Impact WQM Impact WQM Impact WQM Impact WQM <t< th=""></t<>
Ihr TSP Impact WQM Impact WQM Impact WQM Impact WQM Mid-flood: 12:01 Mid-flood: 14:05 Mid-flood: 16:21 Mid-ebb: 19:15 Mid-ebb: 21:42 Mid-ebb: 23:21 10-Feb 11-Feb 11-Feb 12-Feb 13-Feb 14-Feb 15-Feb 16-F 24hr TSP 1hr TSP Noise (Daytime) Impact WQM Impact WQM Impact WQM Impact WQM Impact WQM Impact WQM Impact WQM Impact WQM Impact WQM Impact WQM Impact WQM Impact WQM <t< th=""></t<>
Ihr TSP Impact WQM Impact WQM Impact WQM Impact WQM Mid-flood: 12:01 Mid-flood: 14:05 Mid-flood: 16:21 Mid-ebb: 19:15 Mid-ebb: 21:42 Mid-ebb: 23:21 10-Feb 11-Feb 11-Feb 12-Feb 13-Feb 14-Feb 15-Feb 16-F 24hr TSP 1hr TSP Noise (Daytime) Impact WQM Impact WQM Impact WQM Impact WQM Impact WQM Impact WQM Impact WQM Impact WQM Impact WQM Impact WQM Impact WQM Impact WQM <t< th=""></t<>
Ihr TSP Impact WQM Impact WQM Impact WQM Impact WQM Mid-flood: 12:01 Mid-flood: 14:05 Mid-flood: 16:21 Mid-ebb: 19:15 Mid-ebb: 21:42 Mid-ebb: 23:21 10-Feb 11-Feb 11-Feb 12-Feb 13-Feb 14-Feb 15-Feb 16-F 24hr TSP 1hr TSP Noise (Daytime) Impact WQM Impact WQM Impact WQM Impact WQM Impact WQM Impact WQM Impact WQM Impact WQM Impact WQM Impact WQM Impact WQM Impact WQM <t< th=""></t<>
Impact WQM Impact
Impact WQM Impact
Mid-flood: 12:01 Mid-ebb: Mid-flood: 14:05 14:05 Mid-flood: 16:21 Mid-ebb: Mid-flood: 16:21 Mid-ebb: Mid-flood: 16:21 Mid-ebb: Mid-flood: 16:21 Mid-ebb: Mid-flood: 16:21 Mid-ebb: Mid-flood: 16:21 Mid-ebb: Mid-flood: 16:21 Mid-flood: Mid-flood: 10:75 Mid-flood: Mid-flood: 10:75 Mid-flood: Mid-flood: 10:75 Mid-flood: Mid-flood: 10:75 Mid-flood: Mid-flood: 10:75 Mid-flood: Mid-flood: 10:75 Mid-flood: Mid-flood: 10:75 Mid-flood:
Mid-ebb: 19:15 Mid-ebb: 21:42 Mid-ebb: 23:21 10-Feb 11-Feb 11-Feb 12-Feb 13-Feb 14-Feb 15-Feb 16-F 24hr TSP 1hr TSP Noise (Daytime) 1mpact WQM Impact WQM
10-Feb 11-Feb 12-Feb 13-Feb 14-Feb 15-Feb 16-F 24hr TSP 1hr TSP 1hr TSP 1hr TSP 1hr God: 1hr TSP 1hr God:
24hr TSP 1hr TSP Noise (Daytime) Impact WQM Mid-flood: 9:06 Mid-ebb: 15:11 Mid-ebb: 16:
Impact WQM Impact WQM Mid-flood: 9:06 Mid-ebb: 15:11
Impact WQM Impact WQM Mid-flood: 9:06 Mid-ebb: 15:11
Impact WQM Impact WQM Mid-flood: 9:06 Mid-ebb: 15:11
Impact WQM Impact WQM Mid-flood: 9:06 Mid-ebb: 15:11
Impact WQM Impact WQM Mid-flood: 9:06 Mid-flood: 10: Mid-ebb: 15:11 Mid-ebb: 16:
Mid-flood: 9:06 Mid-flood: 10: Mid-ebb: 15:11 Mid-ebb: 16:
Mid-flood: 9:06 Mid-flood: 10: Mid-ebb: 15:11 Mid-ebb: 16:
Mid-ebb: 15:11 Mid-ebb: 16:
24hr TSP
1hr TSP
Noise (Daytime)
Impact WQM Impact WQM
Mid-flood: 11:04 Mid-flood: 9:05 Mid-flood: 15:27
Mid-ebb: 19:26 Mid-ebb: 21:27 Mid-ebb: 22:51
24-Feb 25-Feb 26-Feb 27-Feb 27-Feb
24hr TSP
1hr TSP Noise (Daytime)
ivoise (Layune)
Impact WQM Impact WQM
Mid-ebb: 12:12 Mid-ebb: 13:20
Mid-flood: 17:59 Mid-flood: 19:26

Wan Chai Development Phase II and Central-Wan Chai Bypass Sampling, Field Measurement and Testing Works (Stage 2)

Tentative Environmental Monitoring Schedule March 2013

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
				28-Feb	1-Mar	2-Mar
					Impact WQM	
					Mid-flood: 8:30	
					Mid-ebb: 14:38	
3-Mar	4-Ma	r 5-Mar	6-Mar	7-Mar	8-Mar	9-Mar
	24hr TSP					24hr TSP
		1hr TSP		Nalas (Dautima)		
				Noise (Daytime)		
	Impact WQM		Impact WQM		Impact WQM	
	Mid-flood: 10:2	3	Mid-flood: 12:29		Mid-flood: 15:17	
	Mid-ebb: 17:15		Mid-ebb: 20:16		Mid-ebb: 22:17	
10-Mar	11-Ma	r 12-Mar	13-Mar	14-Mar	15-Mar	16-Mar
					a.u. TOD	
	41- 700				24hr TSP	41- 700
	1hr TSP	Naina (Dautima)				1hr TSP
		Noise (Daytime)				
	Impact WQM		Impact WQM		Impact WQM	
	Mid-ebb: 12:1	7	Mid-ebb: 13:25		Mid-flood: 8:16	
	Mid-flood: 18:0		Mid-flood: 19:30		Mid-ebb: 14:35	
17-Mar	18-Ma		20-Mar		22-Mar	23-Mar
				24hr TSP		
					1hr TSP	
		Noise (Daytime)				
	In the sector of					
	Impact WQM Mid-flood: 9:2	7	Impact WQM	Impact WQM		Impact WQM Mid-flood: 15:07
	Mid-ebb: 16:4			Mid-flood: 8:02		Mid-ebb: 22:06
24-Mar	25-Ma		27-Mar			22.00
14 mu	20 110	20 Ma	27 100			
			24hr TSP			
		Noise (Daytime)				
	Impact WQM		Impact WQM			
	Mid-ebb: 11:1		Mid-ebb: 12:18			
	Mid-flood: 17:0	2	Mid-flood: 18:36			



Appendix 5.2

Noise Monitoring Results and Graphical Presentations



Noise Monitoring Result

am

Day Time (0700 - 1900hrs on normal weekdays)

Location: M2b - Noon-day gun area


			Measur	ement Noi	se Level	Baseline Level	Construction Noise Level	Limit Level
Date	Time	Weather	Leq	L10	L90	Leq	Leq	Leq
						Unit: dB(A), (3	30-min)	
29/01/13	13:03	Fine	72.5	74.5	69.0	68	71	75
07/02/13	11:15	Cloudy	70.5	71.5	68.5	68	67	75
15/02/13	11:20	Fine	70.2	71.5	67.5	68	67	75
19/02/13	13:00	Fine	70.4	72.0	68.0	68	67	75
26/02/13	11:25	Fine	72.3	74.0	68.5	68	71	75

am

Contract No. HK/2011/07 Wanchai Development Phase II and Central Wanchai Bypass (Shatin to Central Link (SCL) Protection Works at Causeway Bay Typhoon Shelter)

Graphic Presentation of Noise Monitoring Result

Day Time (0700 - 1900hrs on normal weekdays)

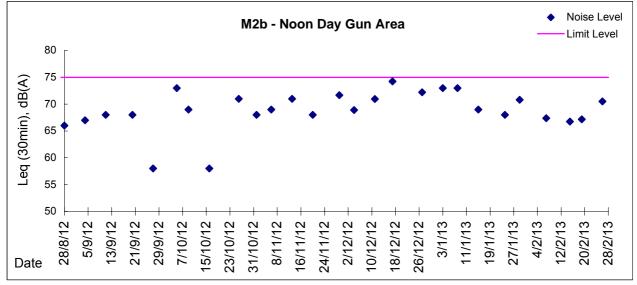



Appendix 5.3 Air Quality Monitoring Results and Graphical Presentations am

CEDD Contract No. HK/2011/07 Wan Chai Development Phase II and Central-Wan Chai Bypass (Shatin to Central Link (SCL) Protection Works at Causeway Bay Typhoon Shelter)

Location: CMA3a - CWB PRE Site Office Area

Report on 24-hour TSP monitoring Action Level (µg/m3) - 171 Limit Level (µg/m3) - 260

Date	Sampling	Weather	Filter paper	Filter Weigh	nt, g	Elapse Time	e, hr	Sampling	Flo	w Rate, m ³ /	min	Total	TSP Level,
	Time	Condition	no.	Initial	Final	Initial	Final	Time, hr	Initial, Q _{si}	Final, Q _{sf}	Average	Volume, m ³	μg/m ³
28-Jan-13	16:00	Fine	004232	2.7048	3.0331	12795.92	12819.92	24.00	1.51	1.60	1.55	2390	137
1-Feb-13	8:00	Cloudy	004419	2.7107	3.0400	12819.92	12843.92	24.00	1.54	1.57	1.56	2246	147
4-Feb-13	8:00	Cloudy	004412	2.6973	3.0200	12846.92	12870.92	24.00	1.59	1.59	1.59	2290	141
8-Feb-13	8:00	Cloudy	004545	2.6464	2.7800	12873.92	12897.92	24.00	1.47	1.48	1.47	2121	63
14-Feb-13	8:00	Fine	004432	2.7123	2.9113	12900.93	12924.93	24.00	1.56	1.55	1.55	2239	89
20-Feb-13	8:00	Cloudy	004241	2.6938	3.0540	12927.93	12951.93	24.00	1.56	1.56	1.56	2241	161
26-Feb-13	8:00	Cloudy	004456	2.6948	3.0717	12954.93	12978.93	24.00	1.55	1.55	1.55	2232	169

*Due to lack of electricity supply, the 24hr-TSP monitoring was rescheduled from 26 Jan 2013 to 28 Jan 2013.


Report on 1-hour TSP monitoring Action Level (μg/m3) - 311.3 Limit Level (μg/m3) - 500

Date	Sampling	Weather	Filter paper	Filter Weigh	nt, g	Elapse Time	e, hr	Sampling	Flo	w Rate, m ³ /	min	Total	TSP Level,
	Time	Condition	no.	Initial	Final	Initial	Final	Time, hr	Initial, Q _{si}	Final, Q _{sf}	Average	Volume, m ³	μg/m ³
28-Jan-13	8:25	Fine	004563	2.6956	2.7230	12791.92	12792.92	1.00	1.55	1.55	1.55	93	294
28-Jan-13	9:30	Fine	004238	2.7073	2.7307	12792.92	12793.92	1.00	1.60	1.60	1.60	96	244
28-Jan-13	14:20	Fine	004423	2.6997	2.7248	12793.92	12794.92	1.00	1.60	1.60	1.60	96	262
2-Feb-13	8:20	Cloudy	004418	2.7187	2.7360	12843.92	12844.92	1.00	1.59	1.59	1.59	95	181
2-Feb-13	9:26	Cloudy	004416	2.7255	2.7422	12844.92	12845.92	1.00	1.54	1.54	1.54	93	180
2-Feb-13	10:30	Cloudy	004414	2.6925	2.7098	12845.92	12846.92	1.00	1.54	1.54	1.54	93	187
5-Feb-13	8:07	Fine	004557	2.6659	2.6921	12870.92	12871.92	1.00	1.45	1.45	1.45	87	301
5-Feb-13	9:10	Fine	004555	2.6731	2.6963	12871.92	12872.92	1.00	1.45	1.45	1.45	87	266
5-Feb-13	10:20	Fine	004553	2.6940	2.7144	12872.92	12873.92	1.00	1.45	1.45	1.45	87	234
9-Feb-13	8:45	Fine	004533	2.6898	2.6958	12897.92	12898.92	1.00	1.57	1.57	1.57	94	64
9-Feb-13	9:55	Fine	004345	2.7236	2.7310	12898.92	12899.92	1.00	1.57	1.57	1.57	94	79
9-Feb-13	10:58	Fine	004349	2.7239	2.7286	12899.92	12900.92	1.00	1.57	1.57	1.57	94	50
15-Feb-13	13:00	Cloudy	004443	2.6875	2.7123	12924.93	12925.93	1.00	1.51	1.51	1.51	90	274
15-Feb-13	14:13	Cloudy	004446	2.6954	2.7153	12925.93	12926.93	1.00	1.51	1.51	1.51	90	220
15-Feb-13	15:16	Cloudy	004448	2.7170	2.7415	12926.93	12927.93	1.00	1.51	1.51	1.51	90	271
21-Feb-13	8:17	Cloudy	004449	2.6892	2.7083	12951.93	12952.93	1.00	1.56	1.56	1.56	93	205
21-Feb-13	9:21	Cloudy	004450	2.7007	2.7244	12952.93	12953.93	1.00	1.56	1.56	1.56	93	254
21-Feb-13	10:25	Cloudy	004453	2.7199	2.7338	12953.93	12954.93	1.00	1.56	1.56	1.56	93	149
27-Feb-13	9:41	Cloudy	002899	2.7663	2.7886	12978.93	12979.93	1.00	1.53	1.53	1.53	92	243
27-Feb-13	10:54	Cloudy	002897	2.7741	2.7982	12979.93	12980.93	1.00	1.51	1.50	1.50	90	267
27-Feb-13	13:00	Cloudy	002895	2.8024	2.8185	12980.93	12981.93	1.00	1.51	1.50	1.50	90	178




Contract No. HK/2011/07 Wanchai Development Phase II and Central Wanchai Bypass

(Shatin to Central Link (SCL) Protection Works at Causeway Bay Typhoon Shelter)

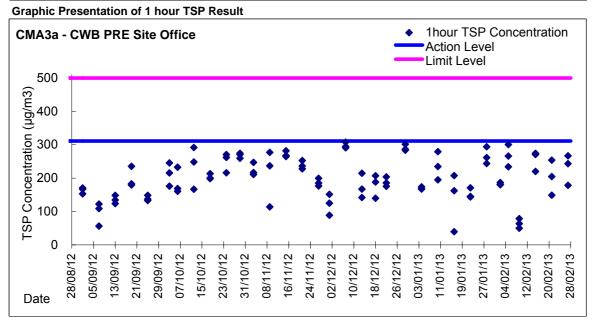

Graphic Presentation of 24 hour TSP Result

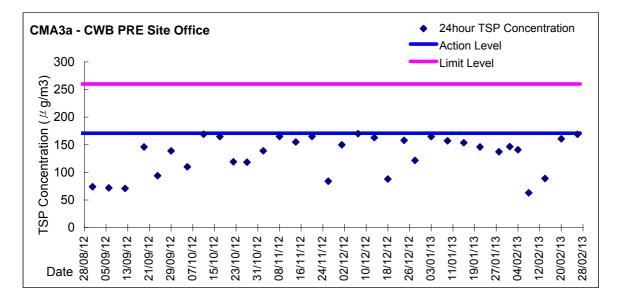



Appendix 5.4 Water Quality Monitoring Results and Graphical Presentation

Water Monitoring Result at C7 - Windsor House Mid-Flood Tide

Date	Time	Weater Condition	Samplin	ig Depth	Wat	er Temp °C	erature		pН			Salini ppt		D	O Satur %	ation		DO mg/L			Turbic NTL			led Solids a/L
		Condition	r	n	Va		Average	Va	lue -	Average	Va		Average	Va		Average	Va		Average	Va	alue	Average	Value	Average
28/1/2013	18:22	Cloudy	Middle	1.5	17.40	17.40	17.40	7.68	7.68	7.68	31.63	31.63	31.63	88.8	88.4	89.0	7.03	7.00	7.05	1.15	1.10	1.15	2	2.50
20/1/2013	18:23	Cloudy	Middle	1.5	17.40	17.40	17.40	7.68	7.68	7.00	31.63	31.63	51.05	89.6	89.0	09.0	7.09	7.06	7.05	1.13	1.20	1.15	3	2.50
30/1/2013	9:18	Fine	Middle	1.5	17.74	17.74	17.74	8.03	8.03	8.03	32.57	32.57	32.09	87.1	86.5	86.6	6.80	6.77	6.77	2.02	2.02	1.99	<2	2.00
00/11/2010	9:20	Tino	Middle	1.5	17.73	17.73		8.03	8.03	0.00	32.60	30.60	02.00	86.5	86.2	00.0	6.77	6.75	0.11	1.98	1.92	1.00	2	2.00
1/2/2013	10:05	Fine	Middle	1.5	18.60	18.60	18.65	8.52	8.52	8.52	30.81	30.81	30.82	50.6	51.1	51.1	3.93	3.97	3.97	2.53	2.48	2.51	8	8.50
	10:07		Middle	1.5	18.70	18.70		8.52	8.52		30.82	30.82		51.3	51.3		3.98	3.98		2.63	2.41		9	
4/2/2013	8:35	Fine	Middle	1.5	19.47	19.47	19.50	7.96	7.96	7.96	32.23	32.23	32.21	68.9	68.7	68.6	5.23	5.22	5.22	4.41	4.34	4.33	4	4.00
	8:37		Middle	1.5	19.53	19.53		7.95	7.95		32.19	32.19		68.5	68.1		5.26	5.17		4.32	4.26		4	
6/2/2013	14:16	Fine	Middle	1.5	20.10	20.10	20.20	7.96	7.96	7.73	30.56	30.56	30.55	68.2	68.1	68.0	5.15	5.14	5.13	2.05	1.93	2.01	8	7.00
	14:18		Middle	1.5	20.30	20.30		7.49	7.49		30.53	30.53		67.9	67.7		5.13	5.11		2.03	2.02		6	
8/2/2013	15:41	Fine	Middle	1.5	18.09	18.09	18.08	8.03	8.03	8.03	32.43	32.43	32.45	99.9	99.7	99.4	7.78	7.76	7.74	3.29	3.22	3.23	4	3.50
	15:43		Middle	1.5	18.07	18.07		8.02	8.02		32.46	32.46		99.1	98.9		7.72	7.70		3.21	3.20		3	
14/2/2013	9:35	Fine	Middle	1.5	18.35	18.35	18.33	7.94	7.94	7.94	32.36	32.36	32.37	79.6	79.4	79.3	6.17	6.15	6.14	1.68	1.68	1.68	4	4.00
	9:37		Middle	1.5	18.31	18.31		7.94	7.94		32.38	32.38		79.1	78.9		6.13	6.12		1.68	1.68		4	<u> </u>
16/2/2013	10:54	Fine	Middle	2.0	18.30	18.30	18.30	8.09	8.09	8.09	31.08	31.08	31.09	52.1	51.5	51.5	4.07	4.03	4.03	4.21	4.12	4.12	<2	<2
	10:56		Middle	2.0	18.30	18.30		8.08	8.08		31.09	31.09		51.1	51.1		4.00	4.00		4.21	3.94		<2	<u> </u>
18/2/2013	11:47	Fine	Middle	1.5	20.06	20.06	20.04	7.90	7.90	7.90	32.18	32.18	32.20	83.7	83.6	83.4	6.30	6.28	6.27	6.11	6.03	6.05	4	4.50
	11:48		Middle	1.5	20.02	20.02		7.89	7.89		32.21	32.21		83.2	83.1		6.26	6.25		6.04	6.03		5	
20/2/2013	11:15	Cloudy	Middle	1.5	18.10	18.10	18.05	7.79	7.79	7.78	33.25	33.25	33.28	52.0	51.7	52.0	4.04	4.01	4.03	1.29	1.22	1.25	4	4.00
	11:16		Middle	1.5	18.00	18.00		7.76	7.76		33.31	33.31		52.5	51.8		4.08	4.00		1.24	1.25		4	
22/2/2013	15:20	Fine	Middle	1.5	19.48	19.48	19.49	7.92	7.92	7.92	32.62	32.62	32.60	89.7	89.5	88.9	6.79	6.77	6.73	4.14	4.40	4.24	4	4.00
	15:22		Middle	1.5	19.50	19.50		7.91	7.91		32.58	32.58		88.3	88.2		6.68	6.67		4.28	4.15	1	4	<u> </u>
25/2/2013	16:55	Fine	Middle	1.5	19.22	19.22	19.22	7.99	7.99	7.99	32.89	32.89	32.89	82.5	82.4	82.4	6.27	6.26	6.26	1.29	1.30	1.31	5	4.50
	16:57		Middle	1.5	19.22	19.22		7.99	7.99		32.89	32.89		82.3	82.2		6.25	6.24		1.31	1.32		4	<u> </u>
27/2/2013	19:30	Misty	Middle	1.5	20.02	20.02	20.04	7.90	7.90	7.90	32.27	32.27	32.27	83.9	83.4	83.1	6.30	6.26	6.24	6.52	6.49	6.55	5	5.00
	19:31		Middle	1.5	20.05	20.05		7.89	7.89		32.26	32.26		82.5	82.4		6.20	6.19		6.55	6.62		5	

Remarks:

Single underline denotes exceedance over Action Level.

Double underline denotes exceedance over Limit Level.

WQM at C7 was temporarily suspended on 12 February 2013 during mid-flood as confirmed by contractors no construction activity was conducted during Chinese New Year holiday.



Date	Time	Weater Condition	Samplin	g Depth	Wat	er Temp °C	erature		pН			Salini ppt	ty	C	O Satur %	ration		DO ma/L		-	Turbic		Suspend	led Solids
		Condition	r	n	Va		Average	Va	alue	Average	Va	alue	Average	Va	alue	Average	Va	lue	Average	Va	alue	Average	Value	Average
28/1/2013	11:30	Fine	Middle	2	17.73	17.73	17.74	7.97	7.97	7.97	32.73	32.73	32.73	79.5	79.4	79.3	6.22	6.21	6.21	2.08	2.09	2.10	3	2.50
26/1/2013	11:32	Fine	Middle	2	17.74	17.74	17.74	7.96	7.96	7.97	32.73	32.73	32.73	79.3	79.1	79.5	6.20	6.19	0.21	2.10	2.11	2.10	2	2.50
30/1/2013	14:40	Fine	Middle	2	18.68	18.68	18.68	7.97	7.97	7.97	32.59	32.59	32.60	90.6	90.4	90.4	6.96	6.95	6.95	3.90	3.91	3.90	4	4.00
30/1/2013	14:42	Tine	Middle	2	18.67	18.67	10.00	7.97	7.97	1.91	32.60	32.60	32.00	90.3	90.2	30.4	6.94	6.93	0.95	3.90	3.87	3.90	4	4.00
1/2/2013	14:55	Fine	Middle	2	19.40	19.40	19.50	8.23	8.23	8.23	30.52	30.52	30.53	50.1	50.0	50.2	3.82	3.82	3.83	1.18	1.19	1.20	4	4.50
	14:57		Middle	2	19.60	19.60	10.00	8.22	8.22	0.20	30.54	30.54	00.00	50.4	50.1	00.2	3.85	3.83	0.00	1.23	1.19		5	
4/2/2013	17:51	Cloudy	Middle	1	20.00	20.00	20.00	8.22	8.22	8.22	30.59	30.59	30.59	89.3	90.2	88.5	6.77	6.83	6.71	3.86	3.90	3.80	4	3.00
	17:52		Middle	1	20.00	20.00		8.22	8.22		30.59	30.59		88.5	86.0		6.71	6.53		3.66	3.77		2	
6/2/2013	23:30	Cloudy	Middle	1	19.05	19.05	19.05	7.87	7.87	7.87	31.92	31.92	31.92	97.0	97.0	97.0	7.44	7.43	7.43	3.80	3.91	3.95	5	4.50
	23:31	-	Middle	1	19.05	19.05		7.87	7.87		31.92	31.92		96.9	96.9		7.43	7.43		3.98	4.09		4	
8/2/2013	23:55	Cloudy	Middle	1	15.50	15.50	15.50	7.87	7.87	7.87	32.11	32.11	32.11	89.2	89.7	88.4	7.32	7.37	7.26	3.25	3.07	3.07	<2	3.00
	23:56	-	Middle	1	15.50	15.50		7.86	7.86		32.11	32.11		87.5	87.3		7.18	7.18		2.97	2.99	-	3	
14/2/2013	14:20	Fine	Middle	2	19.00	19.00	19.02	7.96	7.96	7.96	32.62	32.62	32.62	89.5	89.3	89.2	6.84	6.82	6.81	5.83	5.83	5.82	6	5.50
	14:22		Middle	2	19.03	19.03		7.95	7.95		32.61	32.61		89.0	88.8		6.80	6.78		5.85	5.76		5	
16/2/2013	14:35	Fine	Middle	2	18.70	18.70	18.75	8.06	8.06	8.08	31.15	31.15	31.14	69.7	69.9	70.1	5.38	5.40	5.41	2.75	2.47	2.63	3	3.50
	14:37		Middle	2	18.80	18.80		8.09	8.09		31.12	31.12		70.3	70.4		5.43	5.44		2.62	2.66		4	
18/2/2013	19:55	Fine	Middle	1	19.70	19.70	19.70	7.69	7.69	7.69	32.40	32.40	32.40	76.1	76.1	75.2	5.74	5.74	5.66	1.48	1.55	1.47	3	3.00
	19:56		Middle	1	19.70	19.70		7.68	7.68		32.40	32.40		75.2	73.3	1	5.64	5.53		1.41	1.44		3	
20/2/2013	20:00	Cloudy	Middle	2	18.11	18.11	15.61	7.96	7.96	7.96	32.01	32.00	32.00	88.9	88.9	88.8	6.94	6.94	6.93	3.68	3.63	3.60	<2	<2
	20:01		Middle	2	18.10	8.10		7.95	7.95		32.00	32.00		88.7	88.6		6.92	6.91		3.51	3.56		<2	<u> </u>
22/2/2013	0:00	Cloudy	Middle	1	18.43	18.43	18.43	7.80	7.80	7.80	31.20	31.20	31.20	88.6	88.5	88.5	6.90	6.89	6.89	1.88	1.83	1.76	4	4.50
	0:01		Middle	1	18.42	18.42		7.80	7.80		31.20	31.20		88.4	88.4		6.89	6.88		1.68	1.65		5	<u> </u>
25/2/2013	12:04	Fine	Middle	2	19.29	19.29	19.30	7.92	7.92	7.92	33.00	33.00	33.00	102.5	102.5	102.2	7.77	7.77	7.75	2.76	2.86	2.79	3	3.50
	12:06		Middle	2	19.31	19.31		7.92	7.92		33.00	33.00		101.9	101.8		7.73	7.72		2.77	2.75		4	<u> </u>
27/2/2013	14:04	Fine	Middle	2	19.90	19.90	20.00	7.91	7.91	7.90	33.30	33.30	33.27	72.8	73.4	73.0	5.43	5.47	5.44	3.37	3.37	3.41	2	2.00
	14:06		Middle	2	20.10	20.10		7.89	7.89		33.23	33.23		73.5	72.2		5.48	5.38		3.51	3.39		2	

Remarks:


Single underline denotes exceedance over Action Level.


Double underline denotes exceedance over Limit Level.


WQM at C7 was temporarily suspended on 12 February 2013 during mid-ebb as confirmed by contractors no construction activity was conducted during Chinese New Year holiday.



Graphic Presentation of Water Quality Result of C7 - Windsor House

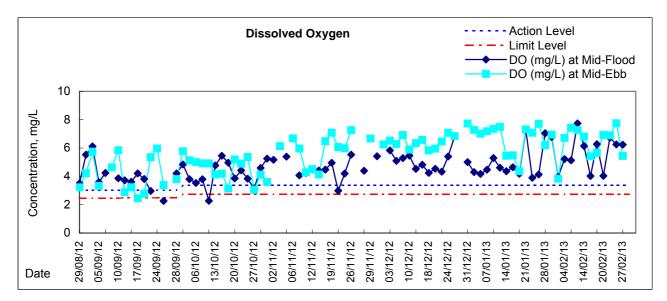

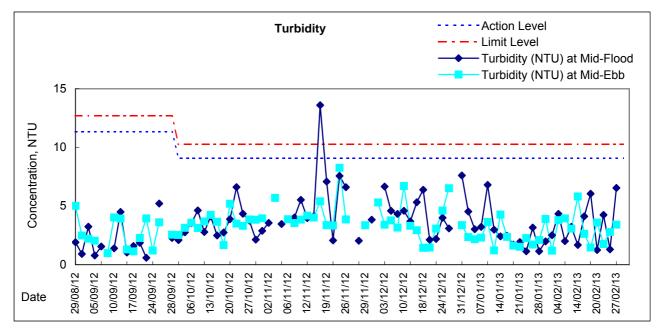

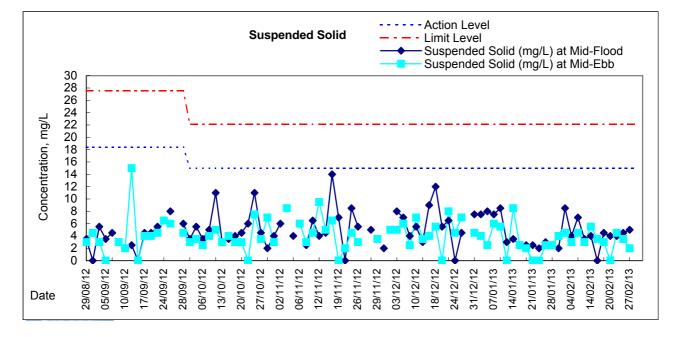



Appendix 6.1

Event Action Plans



Contract No. HK/2011/07 Wanchai Development Phase II and Central Wanchai Bypass (Shatin to Central Link (SCL) Protection Works at Causeway Bay Typhoon Shelter)

Event/Action Plan for Construction Noise

EVENT		A	CTION	
	ET	IEC	ER	CONTRACTOR
Action Level	 Notify IEC, ER and Contactor Carry out investigation Report the results of investigation to the IEC, ER and Contactor Discuss with the IEC and Contractor on remedial measures required Increase monitoring frequency to check mitigation effectiveness (The above actions should be taken within 2 working days after the exceedance is identified) 	 Review the investigation results submitted by the ET Review the proposed remedial measures by the Contractor and advise the ER accordingly Advise the ER on the effectiveness of the proposed remedial measures (The above actions should be taken within 2 working days after theexceedance is identified) 	 Confirm receipt of notification of failure in writing Notify Contractor In consolidation with the IEC, agree with the Contractor on the remedial measures to be implemented Supervise the implementation of remedial measures (The above actions should be taken within 2 working days after theexceedance is identified) 	 Submit noise mitigation proposals to IEC and ER Implement noise mitigation proposals (The above actions should be taken within 2 working days after theexceedance is identified)
Limit Level	 Inform IEC, ER, EPD and Contractor Repeat measurement to confirm findings Increase monitoring frequency Identify source and investigate the cause of exceedance Carry out analysis of Contractor's working procedures. Discuss with the IEC, Contractor and ER on remedial measures require Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results If exceedance stops, cease additional monitoring The above actions should be taken within 2 working days after the exceedance is identified) 	 Discuss amongst ER, ET and Contractor on the potential remedial actions Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly (The above actions should be taken within 2 working days after theexceedance is identified) 	 Confirm receipt of notification of failure in writing Notify Contractor In consolidation with the IEC, agree with the Contractor on the remedial measures to be implemented Supervise the implementation of remedial measures If exceedance continues, consider stopping the Contractor to continue working on that portion of work which causes the exceedance until the exceedance is abated (The above actions should be taken within 2 working days after the exceedance is identified) 	 Take immediate action to avoid further exceedance Submit proposals for remedial actions to IEC and ER within 3 working days of notification Implement the agreed proposals Submit further proposal if problem still not under control Stop the relevant portion of works as instructed by the ER until the exceedance is abated (The above actions should be taken within 2 working days after the exceedance is identified)



Contract No. HK/2011/07 Wanchai Development Phase II and Central Wanchai Bypass (Shatin to Central Link (SCL) Protection Works at Causeway Bay Typhoon Shelter)

Event / Action Plan for Construction Air Quality

EVENT		ACTION		
EVENI	ET	IEC	ER	CONTRACTOR
ACTION LEVEL				
1. Exceedance for one sample	 Identify source, investigate the causes of complaint and propose remedial measures; Inform IEC and ER; Repeat measurement to confirm finding; Increase monitoring frequency to daily. (The above actions should be taken within 2 working days after the exceedance is identified.) 	 Check monitoring data submitted by ET; Check Contractor's working method. (The above actions should be taken within 2 working days after the exceedance is identified.) 	 Notify Contractor. (The above actions should be taken within 2 working days after theexceedance is identified.) 	 Rectify any unacceptable practice; Amend working methods if appropriate. (The above actions should be taken within 2 working days after the exceedance is identified.)
2. Exceedance for two or more consecutive samples	 Identify source; Inform IEC and ER; Advise the ER on the effectiveness of the proposed remedial measures; Repeat measurements to confirm findings; Increase monitoring frequency to daily; Discuss with IEC and Contractor on remedial actions required; If exceedance continues, arrange meeting with IEC and ER; If exceedance stops, cease additional monitoring. (The above actions should be taken within 2 working days after the exceedance is identified.) 	 Check monitoring data submitted by ET; Check Contractor's working method; Discuss with ET and Contractor on possible remedial measures; Advise the ET on the effectiveness of the proposed remedial measures; Supervise Implementation of remedial measures. (The above actions should be taken within 2 working days after the exceedance is identified.) 	 Confirm receipt of notification of failure in writing; Notify Contractor; Ensure remedial measures properly implemented. (The above actions should be taken within 2 working days after theexceedance is identified.) 	 Submit proposals for remedial to ER within three working days of notification; Implement the agreed proposals; Amend proposal if appropriate. (The above actions should be taken within 2 working days after the exceedance is identified.)
LIMIT LEVEL				
1. Exceedance for one sample	 Identify source, investigate the causes ofexceedance and propose remedial measures; Inform IEC, ER, Contractor and EPD; Repeat measurement to confirm finding; Increase monitoring frequency to daily; Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results. (The above actions should be taken within 2 working days after the exceedance is identified.) 	 Check monitoring data submitted by ET; Check Contractor's working method; Discuss with ET and Contractor on possible remedial measures; Advise the ER on the effectiveness of the proposed remedial measures; Supervise implementation of remedial measures. (The above actions should be taken within 2 working days after the exceedance is identified.) 	 Confirm receipt of notification of failure in writing; Notify Contractor; Ensure remedial measures properly implemented. (The above actions should be taken within 2 working days after theexceedance is identified.) 	 Take immediate action to avoid further exceedance; Submit proposals for remedial actions to IEC within three working days of notification; Implement the agreed proposals; Amend proposal if appropriate. (The above actions should be taken within 2 working days after the exceedance is identified.)



Lam Geotechnics Limited

Contract No. HK/2011/07 Wanchai Development Phase II and Central Wanchai Bypass (Shatin to Central Link (SCL) Protection Works at Causeway Bay Typhoon Shelter)



Lam Geotechnics Limited

Contract No. HK/2011/07 Wanchai Development Phase II and Central Wanchai Bypass (Shatin to Central Link (SCL) Protection Works at Causeway Bay Typhoon Shelter)

Event and Action Plan for Marine Water Quality

EVENT		ACTION		
	ET	IEC	ER	CONTRACTOR
Action level being exceeded by one sampling day	Repeat in-situ measurement to confirm findings; Identify source(s) of impact; Inform IEC and Contractor; Check monitoring data, all plant, equipment and Contractor's working methods; Discuss mitigation measures with IEC and Contractor; (The above actions should be taken within 1 working day after the exceedance is identified) Repeat measurement on next day of exceedance.	Discuss with ET and Contractor on the mitigation measures; Review proposals on mitigation measures submitted by Contractor and advise the ER accordingly; Assess the effectiveness of the implemented mitigation measures. (The above actions should be taken within 1 working day after the exceedance is identified)	Discuss with IEC on the proposed mitigation measures; Make agreement on the mitigation measures to be implemented. (The above actions should be taken within 1 working day after the exceedance is identified)	Inform the ER and confirm notification of the non-compliance in writing; Rectify unacceptable practice; Check all plant and equipment; Consider changes of working methods; Discuss with ET and IEC and propose mitigation measures to IEC and ER; Implement the agreed mitigation measures. (The above actions should be taken within 1 working day after the exceedance is identified)
Action level being exceeded by more than one consecutive sampling days	Identify source(s) of impact; Inform IEC and Contractor; Check monitoring data, all plant, equipment and Contractor's working methods; Discuss mitigation measures with IEC and Contractor; Ensure mitigation measures are implemented; Prepare to increase the monitoring frequency to daily; (The above actions should be taken within 1 working day after the exceedance is identified) Repeat measurement on next working day of exceedance.	Discuss with ET and Contractor on the mitigation measures; Review proposals on mitigation measures submitted by Contractor and advise the ER accordingly; Assess the effectiveness of the implemented mitigation measures. (The above actions should be taken within 1 working day after the exceedance is identified)	Discuss with IEC on the proposed mitigation measures; Make agreement on the mitigation measures to be implemented; Assess the effectiveness of the implemented mitigation measures. (The above actions should be taken within 1 working day after the exceedance is identified)	Inform the Engineer and confirm notification of the non-compliance in writing; Rectify unacceptable practice; Check all plant and equipment; Consider changes of working methods; Discuss with ET and IEC and propose mitigation measures to IEC and ER within 3 working days; Implement the agreed mitigation measures. (The above actions should be taken within 1 working day after the exceedance is identified)



Lam Geotechnics Limited

Contract No. HK/2011/07 Wanchai Development Phase II and Central Wanchai Bypass (Shatin to Central Link (SCL) Protection Works at Causeway Bay Typhoon Shelter)

EVENT		ACTION		
	ET	IEC	ER	CONTRACTOR
Limit level being exceeded by one sampling day	Repeat in-situ measurement to confirm findings; Identify source(s) of impact; Inform IEC and Contractor and EPD; Check monitoring data, all plant, equipment and Contractor's working methods; Discuss mitigation measures with IEC and Contractor; Ensure mitigation measures are implemented; Increase the monitoring frequency to daily until no exceedance of Limit level. (The above actions should be taken within 1 working day after the exceedance is identified)	Discuss with ET and Contractor on the mitigation measures; Review proposals on mitigation measures submitted by Contractor and advise the ER accordingly; Assess the effectiveness of the implemented mitigation measures. (The above actions should be taken within 1 working day after the exceedance is identified)	Discuss with IEC, ET and Contractor on the proposed mitigation measures; Request Contractor to critically review the working methods; Make agreement on the mitigation measures to be implemented; Assess the effectiveness of the implemented mitigation measures. (The above actions should be taken within 1 working day after the exceedance is identified)	Inform the Engineer and confirm notification of the non-compliance in writing; Rectify unacceptable practice; Check all plant and equipment; Consider changes of working methods; Discuss with ET , IEC and ER and propose mitigation measures to IEC and ER within 3 working days; Implement the agreed mitigation measures. (The above actions should be taken within 1 working day after the exceedance is identified)
Limit level being exceeded by more than one consecutive sampling days	Identify source(s) of impact; Inform IEC, contractor and EPD; Check monitoring data, all plant, equipment and Contractor's working methods; Discuss mitigation measures with IEC, ER and Contractor; Ensure mitigation measures are implemented; Increase the monitoring frequency to daily until no exceedance of Limit level for two consecutive days. (The above actions should be taken within 1 working day after the exceedance is identified)	Discuss with ET and Contractor on the mitigation measures; Review proposals on mitigation measures submitted by Contractor and advise the ER accordingly; Assess the effectiveness of the implemented mitigation measures. (The above actions should be taken within 1 working day after the exceedance is identified)	Discuss with IEC, ET and Contractor on the proposed mitigation measures; Request Contractor to critically review the working methods; Make agreement on the mitigation measures to be implemented; Assess the effectiveness of the implemented mitigation measures; Consider and instruct, if necessary, the Contractor to slow down or to stop all or part of the marine work until no exceedance of Limit level. (The above actions should be taken within 1 working day after the exceedance is identified)	Inform the ER and confirm notification of the non-compliance in writing; Rectify unacceptable practice; Check all plant and equipment; Consider changes of working methods; Discuss with ET , IEC and ER and propose mitigation measures to IEC and ER within 3working days; Implement the agreed mitigation measures; As directed by the Engineer, to slow down or to stop all or part of the marine work or construction activities. (The above actions should be taken within 1 working day after the exceedance is identified)



Appendix 6.2

Summary of Notification of Exceedances



Ref no.	Date	Tidal	Location	Parameters (Unit)	Measured	Action Leve	Limit Level	Follow-up action	
-	-	-	-	-	-	-	-	-	-



Appendix 7.1

Complaint Log



Environmental Complaints Log

Complaint Log No.	Date of Complaint	Received From and Received By	Nature of Complaint	Outcome	Status
			 	-	



Appendix 8.1

Construction Programme of Individual Contracts

WB-29		T		Layout: CWB-29 / T	ASK filter: All A	ctivities		Date Pr	inted: 13-Oct-1	1 16:20	-	and the second second				
tivity ID	Activity Name	Orig.	Start	Finish			2	012	Inted: 13-Oct-1	1 16:30						
Shatta t		Dur.	An and a second second second		Q4	Q1	Q2	Q3	Q4	Q1		2013			20	14
	o Central Link - Protection Works at CBTS				1						Q	2	Q3	Q4	Q1	
Submiss	ions Complying with EP												, , , ,			
A1000	EM&A Manual (EP condition 2.5)															
A1010	Baseline Monitoring Report (EP condition 3.3)															
A1020	Monthly EM&A (EP condition 3.4)															
A1030	A dedicated web site (EP condition 4.2)			-								-	4 2 4			
A1040	Management organization of main construction companies (EP condition 2.5)	1d	14-Oct-11*	14-Oct-11	Manager	ment organi	ization of ma	ain construc	tion compa	nies (EP c	ondition	2.5)				
A1050	Work schedule and location plans (EP condition 2.6)	1d	28-Oct-11*	28-Oct-11	۱ Work s	chedule ar	d location p	lans (EP co	ndition 2.6)			5 8 1 1 1 1 1				
A1060	Silt curtain deployment plan (EP condition 2.7)	1d	28-Oct-11*	28-Oct-11			ment plan (I									
A1070	Silt screen deployment plan (EP condition 2.8)	1d	28-Oct-11*	28-Oct-11			ment plan (I									
Zone 1A																
A1080	Rockfill, trimming and levelling (below seabed)	17d	18-Nov-11*	04-Dec-11	= Ro	ckfill, trimr	ning and lev	elling (belo	v seabed)							
A1090	Sea wall block installation (above seabed)	25d	19-Jan-12*	15-Feb-12			wall block i			ed)						
A1100	Temporary reclamation	25d	02-Mar-12*	26-Mar-12			Temporary									
A1110	Removal of reclamation	113d	29-Jul-13*	21-Nov-13								_		Rer	noval of	-
Zone 1B					<u>.</u>										novar or	
A1120	Rockfill, trimming and levelling (below seabed)	56d	18-Nov-11*	16-Jan-12		Rockfill	trimming ar	nd levelling	(helow seat							
A1130	Sea wall block installation (above seabed)	65d	19-Jan-12*	26-Mar-12			Sea wall bl						4 7 1 1			
A1140	Temporary reclamation	65d	31-Jan-12*	05-Apr-12			Temporary			scabed)						
A1150	Removal of reclamation	113d	29-Jul-13*	21-Nov-13											and of a	
Zone 1C															noval of i	e
A1160	Rockfill, trimming and levelling (below seabed)	21d	18-Nov-11*	08-Dec-11	- Ro	ckfill, trimn	ning and lev	elling (below	v seabed)							
A1170	Sea wall block installation (above seabed)	25d	19-Jan-12*	15-Feb-12			wall block in			ed)						
A1180	Temporary reclamation	15d	16-Feb-12	01-Mar-12			n porary recl									
A1190	Removal of reclamation	113d	29-Jul-13*	21-Nov-13									1	- Rem	ioval of r	0
Temporary	/ Mooring Area															-
A1200	Dredging	12d	18-Nov-11*	29-Nov-11	= Dred	dging										
****	1						1				<u>{</u>					
Critical F	ing Work Milestone Remaining Work Milestone		Ch	ina State Constru	iction Engir	neering (H	long Kong	g) Ltd		wonana ang sing sing sing sing sing sing sing si	12.000	_				-
Actual P	rogress 🔶 I Milestone		HY/200	09/15 - Shatin to	Central Link	- Protect	tion Works	at CBTS			eSDE	中図 CHINA ST/	建架工 TE CONSTRUC	程(香港)有限。	4