Agreement No. SP 05/2012 Environmental Audit for Sewerage Works at Pik Shui Sun Tsuen

Monthly Environmental Audit Report No. 03 – October 2013 Ref: 322036/ENL/02/03/A

> November 2013 Drainage Services Department





Agreement No. SP 05/2012 Environmental Audit for Sewerage Works at Pik Shui Sun Tsuen

Monthly Environmental Audit Report No. 03 – October 2013 Ref: 322036/ENL/02/03/A

November 2013

Drainage Services Department

44/F, Revenue Tower 5 Gloucester Road Wan Chai Hong Kong

Agreement No. SP 05/2012 Environmental Audit for Sewerage Works at Pik Shui Sun Tsuen



Pursuant to Condition 2.2 of Environmental Permit No. EP-435/ 2011, this Monthly Environmental Audit Report has been reviewed and certified by the Independent Checker (IC)

**Certified by:** 

Terence Kong Independent Checker Mott MacDonald Hong Kong Limited

Date


7 November 2013

Recycled Paper



Chapter	Title	Page
Executive	Summary	1
1.	Environmental Status during the reporting month	2
1.1	Construction Programme	2
1.2	Key Issues for the reporting month	2
1.3	Project Organisation	
1.4	Environmental Mitigation Measures - Implementation Status	2
2.	Environmental Site Inspection	3
2.1	Site Inspection	
2.2	Advice on the Solid and Liquid Waste Management Status	
2.3	Status of Environmental Licenses and Permits	
3.	Report on Complaints, Notifications of Summons and Successful Prosecutions	4
3.1	Record on Environmental Complaints Received	4
3.2	Record on Notifications of Summons and Successful Prosecution	4
3.3	Review of Reasons for and Implications of Non-compliance, Complaints, Summons and	
<b>.</b> (	Prosecutions	
3.4	Follow-up Actions Taken	4
4.	Future Key Issues	5
4.1	Major Site Works for the Coming Month(s)	5
4.2	Key Issues for the Coming Month	
5.	Conclusions and Recommendations	6
5.1	Conclusions	6
5.2	Recommendations	
Figures		7

#### 9 **Appendices** Appendix A. Tentative Construction Programme 11 \_\_\_\_\_ Appendix B. Project Organization\_\_\_\_\_ 13 Appendix C. Environmental Mitigation Measures- Implementation Status \_\_\_\_\_ 15 Appendix D. Waste Flow Table\_\_\_\_ 19 Appendix E. Cumulative statistics on complaints, notifications of summons and successful prosecutions\_\_\_\_\_ 21












### **Executive Summary**

On 3 May 2013, Mott MacDonald Hong Kong Limited (MMHK) was commissioned by the Drainage Services Department (DSD) under Agreement No. SP 05/2012 to undertake the Independent Checker (IC) services for the Sewerage Works at Pik Shui Sun Tsuen (The Project).

The Environmental Permit (EP) No. EP- 435/2011 for the "Sewerage Works at Pik Shui Sun Tsuen" was granted by the Environmental Protection Department (EPD) on 20 December 2011. The construction works was carried out Welcome Construction Co Ltd. (the Contractor), commenced on 26 August 2013.

In accordance with Section 5.1 and 5.3 of the Brief for the Project and Condition 2.2 of the EP, a Monthly Environmental Audit Report shall be prepared and submitted at monthly intervals to confirm in writing the full implementation of the mitigation measures recommended in the Project Profile (PP) (Register No. PP-454/2011) during and upon completion of the construction works. This is the 3<sup>rd</sup> Monthly Environmental Audit Report covering the period from 1 October 2013 and 31 October 2013 (the reporting month).

322036/ENL/ENL/02/03/A October 2013 P:\Hong Kong\ENL\PROJECTS\322036 DSD Pik Shui Sun Tsuen IC\Deliverables\02 Env. Audit Report\3. Oct 2013\Env. Audit Report\_ Oct 2013 Rev A.doc





# 1. Environmental Status during the reporting month

#### **1.1 Construction Programme**

No construction work was conducted during this reporting month. The liaison work with the local residents is in progress.

The construction works programme of the Project is provided in <u>Appendix A.</u> A layout plan of the Project is provided in <u>Figure 1.1.</u>

#### **1.2 Key Issues for the reporting month**

No construction work was conducted during this reporting month.

#### **1.3 Project Organisation**


The organisation chart and lines of communication with respect to the on-site environmental management structure together with the contact information of the key personnel are shown in <u>Appendix B</u>.

#### **1.4 Environmental Mitigation Measures - Implementation Status**

Since there was no construction work conducted during this reporting month, no environmental site audit was conducted during this reporting month. The implementation status of environmental protection and pollution control/ mitigation measures recommended in the PP would be audited in next reporting month. The checklist of implementation status of the environmental mitigation measures is provided in <u>Appendix</u> <u>C.</u>

322036/ENL/ENL/02/03/A October 2013

P:\Hong Kong\ENL\PROJECTS\322036 DSD Pik Shui Sun Tsuen IC\Deliverables\02 Env. Audit Report\3. Oct 2013\Env. Audit Report\_ Oct 2013 Rev A.doc





### 2. Environmental Site Inspection

#### 2.1 Site Inspection

Since no construction activity was conducted during the reporting month, no environmental site inspection was carried out during this reporting month.

#### 2.2 Advice on the Solid and Liquid Waste Management Status

The Contractor has been applied for a bill account for disposal. No waste was disposed of in this reporting month.

The waste flow table is present in Appendix D.

#### **2.3 Status of Environmental Licenses and Permits**

The environmental permits, licenses, and/or notifications on environmental protection for this Project which were valid during the period is summarised in **Table 2-1**.


Statutory Reference	Description	Permit /Reference No.	Status
EIAO	Environmental Permit	EP- 435/2011	Valid
APCO	Notification of Construction Work under APCO	355015	Valid
WPCO	Discharge License	WT00016437-2013	Valid
	Discharge License	WT00016957-2013	Valid
WDO	Bill Account for disposal	7016760	Valid

Table 2-1: Status of Environmental Submissions, Licenses and Permits

Legend: EIAO – Environmental Impact Assessment Ordinance APCO – Air Pollution Control Ordinance WPCO – Water Pollution Control Ordinance WDO – Waste Disposal Ordinance

322036/ENL/ENL/02/03/A October 2013

P:\Hong Kong\ENL\PROJECTS\322036 DSD Pik Shui Sun Tsuen IC\Deliverables\02 Env. Audit Report\3. Oct 2013\Env. Audit Report\_ Oct 2013 Rev A.doc





### 3. Report on Complaints, Notifications of Summons and Successful Prosecutions

#### 3.1 Record on Environmental Complaints Received

No environmental complaint was received this month. The cumulative statistics on complaints were provided in <u>Appendix E.</u>

#### 3.2 Record on Notifications of Summons and Successful Prosecution

No notifications of summons or successful prosecution were received this month. The cumulative statistics on notifications of summons and successful prosecutions were provided in <u>Appendix E.</u>

#### **3.3 Review of Reasons for and Implications of Non-compliance,** Complaints, Summons and Prosecutions

Not applicable.

#### 3.4 Follow-up Actions Taken

Not applicable.





### 4. Future Key Issues


#### 4.1 Major Site Works for the Coming Month(s)

The major site works scheduled to be commissioned in the coming month include:

• Site preparation for sewerage works at Pik Shui Sun Tsuen

#### 4.2 Key Issues for the Coming Month

- Generation of dust from construction works;
- Noise impact from operating equipment and machinery on-site;
- Generation of site surface runoffs and wastewater from activities on-site;
- Sorting, recycling, storage and disposal of general refuse and construction waste; and
- Display of EP at all vehicular site entrances.





### 5. Conclusions and Recommendations

#### 5.1 Conclusions

Since the liaison work with the local resident is in progress, no construction activity was conducted during the reporting month.

#### 5.2 **Recommendations**

With considerations on the construction activities in the next reporting month, recommendations on mitigation measures for impacts on air quality, noise, water quality and waste were provided.




### Figures

Figure 1.1. Project Layout Plan Figure 2.1. Locations of Representative Noise and Air Sensitive Receivers Figure 2.2. Locations of Visually Sensitive Receivers

322036/ENL/ENL/02/03/A October 2013 P:\Hong Kong\ENL\PROJECTS\322036 DSD Pik Shui Sun Tsuen IC\Deliverables\02 Env. Audit Report\3. Oct 2013\Env. Audit Report\_ Oct 2013 Rev A.doc







Sources: Black & Veatch Hong Kong Limited. (2011). Project Profile for Sewerage Works at Pik Shui Sun Tsuen [Online]. Available: http://www.epd.gov.hk/eia/register/profile/latest/dir218/dir218.pdf



Sources: Black & Veatch Hong Kong Limited. (2011). Project Profile for Sewerage Works at Pik Shui Sun Tsuen [Online]. Available: http://www.epd.gov.hk/eia/register/profile/latest/dir218/dir218.pdf



Sources: Black & Veatch Hong Kong Limited. (2011). Project Profile for Sewerage Works at Pik Shui Sun Tsuen [Online]. Available: http://www.epd.gov.hk/eia/register/profile/latest/dir218/dir218.pdf




### Appendices

Appendix A.	Tentative Construction Programme	_ 11
Appendix B.	Project Organization	_ 13
Appendix C.	Environmental Mitigation Measures- Implementation Status	_ 15
Appendix D.	Waste Flow Table	_ 19
Appendix E.	Cumulative statistics on complaints, notifications of summons and successful prosecutions	_ 21

















Agreement No. SP 05/2012 Environmental Audit for Sewerage Works at Pik Shui Sun Tsuen



322036/ENL/ENL/02/03/A October 2013 P:\Hong Kong\ENL\PROJECTS\322036 DSD Pik Shui Sun Tsuen IC\Deliverables\02 Env. Audit Report\3. Oct 2013\Env. Audit Report\_ Oct 2013 Rev A.doc Recycled Paper


#### Welcome Constuction Co Ltd. Contract No. DC/2012/06 Sewerage at Clear Water Bay Road, Pik Shui Sun Tsuen and West of Sai Kung Town Detailed Program for Pik Shui Sun Tsuen Pumping Station

1 Pil 2		I			13			014			4
2 3 4 5 6 7	k Shui Sun Tsuen Pumping Station (PSST SPS) & Associated Works	1095 days	Mon 26/8/13	Wed 24/8/16	3rd Quarter 4th Quarter Jul Sep Nov		2nd Quarte ar May		4th Quarter ep Nov		ter 2nd Quarte Mar May
3 4 5 6 7		-									
4 5 6 7	Tree survey	7 days	Mon 26/8/13	Sun 1/9/13	3 26/8 1/9			     			
5 6 7	Site Clearance	7 days	Mon 26/8/13	Sun 1/9/13	3 <b>26/8 </b> 1/9						
6 7	Pruning & Protection of existing trees	10 days	Mon 2/9/13	Wed 11/9/13	3 2/9 11/9						
7	UU Detection & Trial Pits to locate UU	10 days	Mon 2/9/13	Wed 11/9/13	3 2/9 11/9			     			l l
	Erection of Temporary Hoarding, Fencing & Gate	20 days	Thu 12/9/13	Tue 1/10/13	3 12/9 🎽 1/10						
8	Structure of PSST SPS	334 days	Wed 2/10/13	Sun 31/8/14	1						
	Shoring & Excavation	30 days	Wed 2/10/13	Thu 31/10/13	3 2/10 31/10			     		   	l l
9	Construction of Base Slab (B/F)	30 days	Fri 1/11/13	Sat 30/11/13	3 1/11 🎽 30/	11					
10	Construction of Walls (B/F to G/F)	40 days	Sun 1/12/13	Thu 9/1/14	4 1/12	9/1					
11	Construction of Slab (G/F)	35 days	Fri 10/1/14	Thu 13/2/14	10/1	13/2		     		   	l l
12	Construction of Valve Chamber Base Slab	15 days	Fri 14/2/14	Fri 28/2/14	4	14/2 🎽 28/	2				
13	Construction of Valve Chamber Walls & Slab over Compacted Fill (B/F to G/F)	30 days	Sat 1/3/14	Sun 30/3/14	4	1/3 🎽	30/3				
14	Dismantle Shoring & Backfill Excavation	30 days	Mon 31/3/14	Tue 29/4/14	<b>4</b> 1 1	31/3	29/4	     		   	l l
15	Laying Concrete Benching.at Inlet Chamber (between B/F & G/F)	3 days	Wed 30/4/14	Fri 2/5/14	4	30	0/4 2/5	         			
16	Laying Concrete Plinth for Deodourizing Unit (G/F)	3 days	Thu 1/5/14	Sat 3/5/14	4	-	/5 3/5				
17	Consruction of Concrete Columns, Walls & Canopy (G/F to 1/F)	60 days	Sun 4/5/14	Wed 2/7/14	4		4/5	2/7			
18	Construction of Roof Slab & Beams (R/F)	40 days	Thu 3/7/14	Mon 11/8/14	4		3/7	11/8			
19	Construction of Parapet Walls (R/F)	20 days	Tue 12/8/14	Sun 31/8/14	4			12/8 🎽 31/	8	   	
20	Metal Works, Plumibing & Irrigation Works in PSST SPS	145 days	Mon 1/9/14	Fri 23/1/15	5			-			
21	Installation of Ladder, Basket Screen, Chequer Plates, Muti-span Covers & etc	55 days	Mon 1/9/14	Sat 25/10/14	4			1/9	25/10		
22	Installation of Irrigation System (G/F to R/F) & Plumbing System (G//F)	40 days	Sun 26/10/14	Thu 4/12/14	1			26/	10 📥 4/	/12	
23	Installation of Metal Works & Glass Panels (G/F)	50 days	Fri 5/12/14	Fri 23/1/15	5				5/12	23/1	
24	E & M Works in PSST SPS	365 days	Sat 24/1/15	Sat 23/1/16	<b>b</b>					-	
25	Handover to Other Cotractors for E & M Works	1 day	Sat 24/1/15	Sat 24/1/15	5				24	4/1 24/1	
26	E & M Works carried out by other Contractors	365 days	Sat 24/1/15	Sat 23/1/16	3			     	24	4/1	1
27	Finishes Works, Landscaping Works & External Works	214 days	Sun 24/1/16	Wed 24/8/16	<b>b</b>						
28	Formation of External Ground Area	5 days	Sun 24/1/16	Thu 28/1/16	5						
29	Drainage & Sewerage Works in External Area	30 days	Fri 29/1/16	Sat 27/2/16	5						
30	Erection of Permanent Fence & Gate	40 days	Sun 28/2/16	Thu 7/4/16	5						
31	Installation of Irrigation System in External Area	30 days	Fri 8/4/16	Sat 7/5/16	5						
32	Formation of Planting Area in External Area	20 days	Sun 8/5/16	Fri 27/5/16	5						
33	Planting of Trees & Shrubs in External Area	34 days	Sat 28/5/16	Thu 30/6/16	5					   	




#### Welcome Constuction Co Ltd. Contract No. DC/2012/06 Sewerage at Clear Water Bay Road, Pik Shui Sun Tsuen and West of Sai Kung Town Detailed Program for Pik Shui Sun Tsuen Pumping Station

ID	Task Name	Duration	Start	Finish												
					13						2014					2
					3rd Quai	rter∣4th Sep	Quarter	1st Qua Jan	rter∣2r Mar			uarter   4t Sep				
34	Construction of Paving in External Area	20 days	Fri 1/7/16	Wed 20/7/16	Jui	<u> </u>	INUV	Jan	Iviai	iviay	Jui	<u> </u>	INOV	Jan	Iviai	Iviay
35	Installation of External Steel Staircase	30 days	Thu 21/7/16	Fri 19/8/16												
36	Laying Concrete Benching (B/F)	7 days	Sun 24/1/16	Sat 30/1/16												
37	Internal Finishes Works	64 days	Sun 31/1/16	Sun 3/4/16												
38	Fixing of Signboard on External Walls	45 days	Mon 4/4/16	Wed 18/5/16												
39	External Finishes Works	93 days	Thu 19/5/16	Fri 19/8/16	   									   		
40	Timber Decking on Roof	50 days	Sun 31/1/16	Sun 20/3/16												
41	Laying of Waterproof System & Roof Finishes Works (R/F)	50 days	Mon 21/3/16	Mon 9/5/16												
42	Formation of Planting Area & Fixing of Hanging Planter Boxes (R/F)	22 days	Tue 10/5/16	Tue 31/5/16												
43	Installation of Irrigation System (R/F)	30 days	Wed 1/6/16	Thu 30/6/16												
44	Planting Works on Roof	50 days	Fri 1/7/16	Fri 19/8/16												
45	Clear Up Site	5 days	Sat 20/8/16	Wed 24/8/16												
46	Completion of PSST SPS & Associated Works	0 days	Wed 24/8/16	Wed 24/8/16			1									

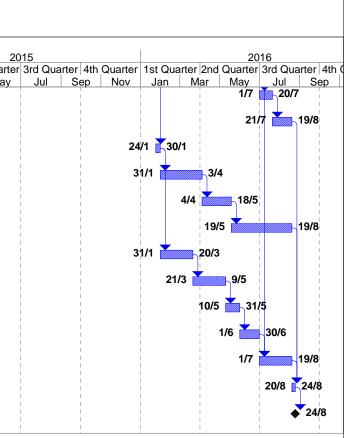



## Appendix B. Project Organization

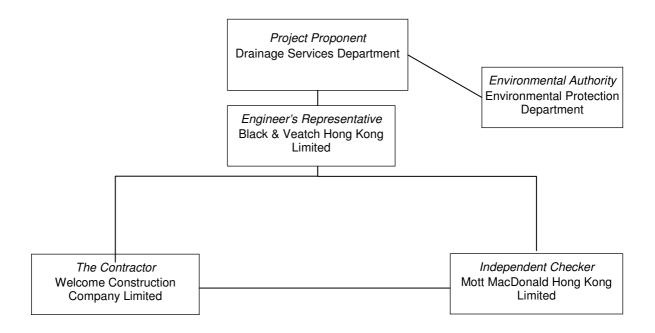

Company / Department	Position	Name	Telephone / Mobile
Drainage Services Department	Project Proponent	Mr Chow Sui Ping	2594 7453
Black & Veatch Hong Kong Limited	Engineer's Representative	Mr Eugene Chan	6075 8606
Mott MacDonald Hong Kong Ltd.	Independent Checker	Mr Terence Kong	2828 5919
Welcome Construction Company Limited	Project Director	Mr Sunny Ngan	6109 5569
Welcome Construction Company Limited	Site Agent	Mr Frankie Lui	6021 7973
Welcome Construction Company Limited	Assistant Environmental Officer	Mr Sze Ming Fung	6018 6936

3322036/ENL/ENL/02/03/A October 2013

P:\Hong Kong\ENL\PROJECTS\322036 DSD Pik Shui Sun Tsuen IC\Deliverables\02 Env. Audit Report\3. Oct 2013\Env. Audit Report\_ Oct 2013 Rev A.doc







### Appendix C. <u>Environmental Mitigation</u> <u>Measures- Implementation</u> <u>Status</u>

Table C1:	Construction Noise – Recommended Mitigation Measures	
* PP / ^ EP ref:	Recommended measures	Implementation Status
*5.2.6	<ul> <li>Only well-maintained plant should be operated on-site and plant should be serviced regularly during the construction works.</li> </ul>	N/A
	<ul> <li>Machines and plant that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum.</li> </ul>	N/A
	<ul> <li>Plant known to emit noise strongly in one direction, should, where possible, be orientated to direct noise away from nearby NSRs.</li> </ul>	N/A
	• Silencers or mufflers on construction equipment should be utilised and should be properly maintained during the construction works.	N/A
	• Mobile plant should be sited as far away from NSRs as possible.	N/A
*5.2.2, 5.2.6	Use of temporary noise barrier, mobile barrier	N/A
*5.2.6	<ul> <li>Material stockpiles and other structures should be effectively utilised, where practicable, to screen noise from on-site construction activities</li> </ul>	N/A
*5.2.6	<ul> <li>Noisy construction activities such as road breaking, should be scheduled to less sensitive hours during the day</li> </ul>	N/A
*5.2.6	• Liaise with the affected noise sensitive receivers on the anticipated construction activities, possible impacts, expected duration and communication channel with the project office.	N/A
*5.2.1,*Table 6.1	Adoption of quiet powered mechanical equipment (QPME) during construction	N/A
*5.2.4, ^2.3	<ul> <li>For the sewer works located less than 15 m away from Cheng Chek Chee Secondary School, construction works can only be conducted after school hours or during school breaks. For the sewer works located between 15 m – 30 m away from the School, the contractor should liaise with the school and/or the Examination Authority to ascertain the exact dates and times of all examination periods and to avoid noisy construction activities during these periods.</li> </ul>	N/A

Table C2:	Air Quality – Recommended Mitigation Measures	
* PP / ^ EP ref:	Recommended measures	Implementation Status
*5.2.8, ^1.2	<ul> <li>Comply with the control measures in the Air Pollution Control (Construction dust) Ordinance.</li> </ul>	N/A
*5.2.8	<ul> <li>Excavated dusty materials should be covered by impervious sheeting or sprayed with water to keep the entire surface wet.</li> </ul>	N/A
*5.2.8	<ul> <li>Use of regular watering, with complete coverage, to reduce dust emissions from exposed site surfaces and unpaved roads, particularly during dry weather.</li> </ul>	N/A

3322036/ENL/ENL/02/03/A October 2013

P:\Hong Kong\ENL\PROJECTS\322036 DSD Pik Shui Sun Tsuen IC\Deliverables\02 Env. Audit Report\3. Oct 2013\Env. Audit Report\_ Oct 2013 Rev A.doc



Table C3:	Water Quality – Recommended Mitigation Measures	
* PP / ^ EP ref:	Recommended measures	Implementation Status
*5.2.10, * Table 6.1	<ul> <li>Follow the guidelines in ProPECC PN 1/94 "Construction Site Drainage".</li> </ul>	N/A
	<ul> <li>Silt removal facilities should be provided according to the guidelines stipulated in EPD's ProPECC PN 1/94.</li> </ul>	N/A
	Cover open stockpiles of construction materials with tarpaulin or similar fabric during rainstorms.	N/A

Table C4:	Waste Management – Recommended Mitigation Measures	
* PP / ^ EP ref:	Recommended measures	Implementation Status
*5.2.12, *Table 6.1	<ul> <li>Sort all C&amp;D materials and waste into different categories for reuse on site, recycling and disposal at designated public fill reception facilities or landfills.</li> </ul>	N/A
	• C&D material and excavated materials should be reused on-site as fill material as far as possible.	N/A
	• Disposal of C&D materials should be managed through the trip ticket system for disposal of C&D materials.	N/A
*5.2.12	• All Chemical waste should be handled, stored and disposed of in accordance with the Waste Disposal (Chemical Waste) (General) Regulation.	N/A

Table C5:	Landscape and Visual Impact – Recommended Mitigation Measures	
* PP / ^ EP ref:	Recommended measures	Implementation Status
*5.2.14, *Table 6.2	<ul> <li>Retain and protect existing trees near works site.</li> </ul>	N/A
Table 0.2	<ul> <li>Erect site hoarding compatible with the surrounding environment for the pumping station works area</li> </ul>	N/A
	<ul> <li>Maintain site cleanliness and tidiness in accordance with the requirements stipulated in DEVB TCW No. 8/2010.</li> </ul>	N/A
	<ul> <li>Properly manage construction waste in the works area.</li> </ul>	N/A
	Minimize the number and size of temporary works area.	N/A
	<ul> <li>Promptly reinstate each section of the trench upon completion of the sewer works.</li> </ul>	N/A
	<ul> <li>Control of night-time security lightning to minimize night-time glare to nearby village.</li> </ul>	N/A

3322036/ENL/ENL/02/03/A October 2013 P:\Hong Kong\ENL\PROJECTS\322036 DSD Pik Shui Sun Tsuen IC\Deliverables\02 Env. Audit Report\3. Oct 2013\Env. Audit Report\_ Oct 2013 Rev A.doc



Table C6:	Others	
* PP / ^ EP ref:	Recommended measures	Implementation Status
^1.5	• A copy of the valid Environmental Permit shall be displayed conspicuously on the Project site(s) at all vehicular site entrances/exits or at a convenient location for public information at all times. The most updated information about the Permit, including any amended Permit, shall be displayed at such locations. If the Permit Holder surrenders a part or whole of the Permit, the notice he send to the Director shall also be displayed at the same locations as the original Permit. The suspended, varied or cancelled Permit shall be removed from display at the Project site(s).	N/A
n/a	The required licenses should be obtained by the Contractor (including CNP (if any), WPCO license, etc.)	$\checkmark$

#### Legend:

$\checkmark$	Implemented
×	Not implemented
Р	Partially implemented
N/A	Not applicable
N/O	Not observed











### Monthly Summary Waste Flow Table for October 2013

	Actual Quantities of Inert C&D Materials Generated Monthly					Actual Quantities of C&D Wastes Generated Monthly					
Month	Total Quantity Generated	Hard Rock and Large Broken Concrete	Reused in the Contract	Reused in other Projects	Disposed as Public Fill	Imported Fill	Metals	Paper/ cardboard packaging	Plastics (see Note 3)	Chemical Waste	Others, e.g. general refuse
	(in '000m <sup>3</sup> )	(in '000m <sup>3</sup> )	(in '000m <sup>3</sup> )	(in '000m <sup>3</sup> )	(in '000m <sup>3</sup> )	(in '000m <sup>3</sup> )	(in '000 kg)	(in '000kg)	(in '000kg)	(in '000kg)	(in '000m <sup>3</sup> )
Yr 2013	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
Jan	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
Feb	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
Mar	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
Apr	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
Мау	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
June	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
Sub-total	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
July	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
Aug	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
Sept	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
Oct	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
Nov											
Dec											
Total											



### Appendix E. Cumulative statistics on complaints, notifications of summons and successful prosecutions

Cumulative statistics for complaints, notifications of summons and successful prosecutions for the Project account for period starting from the date of commencement of construction works (i.e. 26 August 2013) to the end of the reporting month and are summarized in the **Table F1** below.

Table F1: Statistics for complaints, notifications of summons and successful prosecutions

Reporting Period	Cumulative Statistics					
	Complaints	Notifications of summons	Successful prosecutions			
This reporting month	0	0	0			
From 26 August 2013 to end of the reporting month	0	0	0			



