

Ocean Park Tai Shue Wan Water World Project

Monthly EM&A Report November 2017

December 2017

Mott MacDonald
20/F AIA Kowloon Tower
Landmark East
100 How Ming Street
Kwun Tong
Kowloon
Hong Kong

T +852 2828 5757
F +852 2827 1823
mottmac.hk

Gammon Engineering &
Construction Company
Limited
28/F Devon House, Taikoo
Place 979 King's Road,
Hong Kong

Ocean Park Tai Shue Wan Water World Project

Monthly EM&A Report November 2017

December 2017

This Monthly EM&A Report for November 2017 has been reviewed and certified by the Environmental Team Leader (ETL) and verified by the Independent Environmental Checker (IEC) as having complied with the requirements as set out in the EM&A Manual in accordance with

Condition 3.4 of Environmental Permit No. EP-487/2014.

Certified by:



Gary Chow
Environmental Team Leader (ETL)
Mott MacDonald Hong Kong Limited

Date:

14 Dec 2017

Verified by:



Gerald Kam
Independent Environmental Checker (IEC)
Ove Arup and Partners Hong Kong Limited

Date:

14 - Dec - 2017

Contents

Executive Summary	1
1 Introduction	3
1.1 Introduction	3
2 Project Organization and Construction Progress	4
2.1 Project Organization	4
2.2 Construction Progress	6
2.3 Summary of Environmental Submissions	7
3 Construction Noise Monitoring	9
3.1 Monitoring Requirements, Frequency and Duration	9
3.2 Monitoring Locations	9
3.3 Monitoring Equipment	10
3.4 Monitoring Methodology	10
3.5 Monitoring Schedule	11
3.6 Results of Impact Monitoring	11
4 Ecology Monitoring	13
4.1 General	13
4.2 Monitoring Requirement	13
4.3 Inspection Findings	14
4.4 Conclusion	14
5 Landscape & Visual Monitoring	16
5.1 General	16
5.2 Inspection Findings	16
6 Waste Management	17
6.1 General Waste Management	17
6.2 Records of Waste Quantities	17
7 Site Inspection	18
7.1 Requirements	18
7.2 Findings / Deficiencies during the reporting month	18
8 Environmental Complaint, Summons and Prosecution	19
8.1 Environmental Complaint, Summons and Prosecution	19

9	Implementation Status of Mitigation Measures	20
9.1	General Requirements	20
9.2	Tentative Construction Activities in the Coming Month	20
9.3	Key Issues for the Coming Month	21
10	Recommendation	22
A.	Layout Plan of the Project	1
B.	Project Organisation	2
C.	3-month Look-ahead Program	3
D.	Designated Monitoring Locations as Recommended in the Approved EM&A Manual	4
E.	Actual Locations of Impact Monitoring	5
F.	Calibration Certificates	6
G.	Event and Action Plan	7
H.	Impact Monitoring Schedule	8
I.	Noise Monitoring Data	9
J.	Graphical Plots for Noise Monitoring Data	10
K.	Meteorological Data	11
L.	Ecological Inspection Records	34
M.	Waste Flow Table	2
N.	Implementation Schedule for Environmental Mitigation Measures	3

Executive Summary

Mott MacDonald Hong Kong Ltd. ("MMHK") has been commissioned by the Gammon Engineering & Construction Company Limited, to undertake the Environmental Team (ET) services to carry out environmental monitoring and audit (EM&A) for Ocean Park Tai Shue Wan Development Water World.

This is the 6th monthly EM&A report for the construction phase of Waterpark Main Building Works submitted under Condition 3.4 of the Environmental Permit (No. EP-487/2014). This report summarises the findings on EM&A during the period from 1 to 30 November 2017.

Exceedance of Action and Limit Levels

The summary of measured noise level (as L_{eq}) is presented in **Section 3**. No exceedance of Action or Limit Levels for noise levels were recorded in the reporting month.

Result of Ecological Monitoring

The plant species of conservation interest - *Platycodon grandifloras* was found in fence up area in the reporting month. No sign of construction activities was noted in the fence up area.

No ardeids were noted within or in the vicinity of the project area during the monitoring period.

Detail of the result is presented in **Section 4**.

Result of Landscape and Visual Monitoring

No non-compliance of Landscape and Visual monitoring was recorded in the reporting month. Detail of the result is presented in **Section 5**.

Record of Complaints

There was no record of complaints received in the reporting month.

Record of Notification of Summons and Successful Prosecutions

There were no record of notification of summons and successful prosecution in the reporting month.

Reporting Changes

There are no reporting changes.

Site inspection

In the Reporting Period, joint site inspections were undertaken by the PMR, ET and the Contractor on 3, 10, 17, 24 November 2017. Furthermore, IEC performed the site inspection and audit on 10 November 2017. During site inspection, non-compliance was not observed by the ET and IEC.

Future Key Issues

- Site formation for ride footing construction
- Cut soil slope and soil nail installation for Ride P1, P2, P3, P4 and P5
- Rock breaking and slope stabilization works for Ride P3 and P5

- Construction of drainage channels to slopes
- Mini pile construction
- North Plant Room Formation: HKE Substation On-grade slab and cable trench excavation and on-grade slab construction. Cart away excavated rock materials.
- North Plant Room and L2 slab (10E4): Column construction, install concrete block retaining wall to form ground for falsework erection, L2 slab falsework erection, formwork, rebar, concreting.
- Zone 3 Foundation at L2: Rock excavation and mucking out, rock mapping inspection, cast concrete blinding, construct footings
- South Plant Room (footing construction, backfilling)
- B1 and L1 underground manholes and drainage
- L1 zone 6 on grade slab
- Core wall
- L1 and L2 slab and column construction

1 Introduction

1.1 Introduction

On 27 August 2014, the Environment Impact Assessment (EIA) Report and Environmental Monitoring and Audit (EM&A) Manual (Register No.: AEIAR-184/2014) for the “Tai Shue Wan Development at Ocean Park” (the Project) was approved and an Environmental Permit (EP) (Permit No.: EP-487/2014) was issued to the Ocean Park Corporation (Project Proponent). The layout plan of the Project is indicated in **Appendix A**.

Mott MacDonald Hong Kong Ltd. (“MMHK”) has been commissioned by Gammon Engineering & Construction Company Limited to undertake the Environmental Team (ET) services to carry out environmental monitoring and audit for the Ocean Park Tai Shue Wan Water World Project.

As part of the EM&A program, baseline monitoring for the required parameters including background noise, landscape & visual baseline review and baseline ardeid inspection were carried out between 24 October 2014 and 10 December 2014 by the environmental consultants of Ocean Park Corporation. Furthermore, the baseline monitoring report which verified by the previous IEC was submitted to EPD and endorsed in December 2014.

The previous contract (Contract No.: TSW-C004) of Site Formation and Foundation Works has been completed since 31 May 2017, the next construction phase (Contract No.: TSW-C006) for the Ocean Park Tai Shue Wan Development was handed over to Gammon Engineering & Construction Company Limited on 31 May 2017. This is 6th monthly EM&A report presenting the monitoring results and inspection findings for the Construction Phase of Waterpark Main Building Works during the Reporting Period from 1 to 30 November 2017.

2 Project Organization and Construction Progress

2.1 Project Organization

The project organization is shown in **Appendix B**. The responsibilities of respective parties are:

Ocean Park Corporation

Ocean Park Corporation is the Project Proponent and the Permit Holder of the EP for the development of the Project and will assume overall responsibility for the project. An Independent Environmental Checker (IEC) shall be employed by Ocean Park Corporation to audit the results of the EM&A works carried out by the ET.

Environmental Protection Department (EPD)

EPD is the statutory enforcement body for environmental protection matters in Hong Kong.

Project Management Representative (PMR) of Ocean Park Corporation

The PMR is responsible for overseeing the construction works and for ensuring that the works are undertaken by the Contractor in accordance with the specification and contract requirements. The duties and responsibilities of the ER with respect to EM&A are:

- Monitor the Contractors' compliance with contract specifications, including the implementation and operation of the environmental mitigation measures and their effectiveness
- Monitor Contractors', ET's and IEC's compliance with the requirements in the Environmental Permit (EP) and EM&A Manual
- Facilitate ET's implementation of the EM&A programme
- Participate in joint site inspection by the ET and IEC
- Oversee the implementation of the agreed Event / Action Plan in the event of any exceedance
- Adhere to the procedures for carrying out complaint investigation
- Liaison with the related government departments, ET, IEC, the Contractor and the other Contractors of the Project discussing regarding the cumulative impact issues.

The Contractor

The duties and responsibilities of the Contractor are:

- Comply with the relevant contract conditions and specifications on environmental protection
- Employ an Environmental Team (ET) to undertake monitoring, laboratory analysis and reporting of EM & A Facilitate ET's monitoring and site inspection activities
- Participate in the site inspections by the ET and IEC, and undertake any corrective actions
- Provide information / advice to the ET regarding works programme and activities which may contribute to the generation of adverse environmental impacts
- Submit proposals on mitigation measures in case of exceedances of Action and Limit levels in accordance with the Event / Action Plans

- Implement measures to reduce impact where Action and Limit levels are exceeded
- Adhere to the procedures for carrying out complaint investigation

Environmental Team (ET)

The ET should be employed by the Contractor to conduct the EM&A programme. The ET should be managed by the ET Leader. ET Leader should have relevant professional qualifications in environmental control and possess at least 7 years' experience in EM&A. Suitably qualified professional and technical staff should be included in the ET, and resources for the implementation of the EM&A programme should be allocated in the time under the Contract, to enable fulfilment of the Project's EM&A requirements as specified in the EM&A Manual during construction of the Project. The ET shall include qualified botanist/ecologist for the ecological service and a Registered Landscape Architect for review of implementation of landscape and visual mitigation measures. The ET should report to the OPC and the duties should include:

- to monitor and audit various environmental parameters as required in the Approved EM&A Manual;
- to analyse the EM&A data, review the success of EM&A programme and the adequacy of mitigation measures implemented, confirm the validity of the EIA predictions, and identify any adverse environmental impacts arising;
- to monitor compliance with conditions in the EP, environmental protection, pollution prevention and control regulations and contract specifications;
- to audit environmental conditions on site;
- to report on the EM&A results to EPD, the ER, the IEC and Contractor or their delegated representatives;
- to recommend suitable mitigation measures to the Contractor in the case of exceedance of Action and Limit levels in accordance with the Event and Action Plans;
- to liaise with the IEC on all environmental performance matters, and ensure timely submission of all relevant EM&A pro forma for IEC's approval;
- to provide advice to the Contractor on environmental improvement, awareness and enhancement matters, etc on site;
- to adhere to the procedures for carrying out complaint investigation;
- to prepare reports on the environmental monitoring data and the site environmental conditions;
- to submit the EM&A report to Director of Environmental Protection (DEP) timely;
- to review proposals of mitigation measures from the Contractor in case of exceedance of Action and Limit levels, in accordance with the Event and Action Plan; and
- to carry out site inspection to investigate and audit the Contractor's site practice, equipment and work methodologies with respect to pollution control and mitigation measures.

Independent Environmental Checker (IEC)

- The IEC is empowered to audit the environmental performance of construction, but is independent from the management of construction works. As such, the IEC should not be in any way an associated body of the Contractor or the ET for the Project. The IEC should be employed by OPC prior to the commencement of the construction of the Project. The IEC should be a person who has relevant professional qualifications in environmental control and

at least 7 years' experience in EM&A and environmental management. The duties and responsibilities of the IEC are:

- to provide proactive advice to the ER and OPC on EM&A matters related to the project;
- to review and verify the monitoring data and all submissions in connection with the EP and EM&A Manual submitted by the ET;
- to arrange and conduct regular, at least monthly site inspections of the works during the construction phase, and to carry out ad hoc inspections if significant environmental problems are identified;
- to check compliance with the agreed Event and Action Plan in the event of any exceedance;
- to check compliance with the procedures for carrying out complaint investigation;
- to check the effectiveness of corrective measures;
- to feedback audit results to the ET by signing off relevant EM&A pro forma;
- to check that mitigation measures are effectively implemented;
- to report the works conducted, and the findings, recommendations and improvements of the site inspections, after reviewing ET's and Contractor's works, the ER and OPC on a monthly basis;
- to verify the investigation result of the environmental complaint cases and the effectiveness of corrective measures;
- to verify EM&A report that has been certified by the ET leader; and
- to audit EIA recommendations and requirements against the status of implementation of environmental mitigation measures on site.

2.2 Construction Progress

The construction program is enclosed in **Appendix C**. In the Reporting Period, the major construction activity conducted under the Contract is summarized in below:

- Site formation for ride footing construction
- Cut soil slope and soil nail installation for Ride P1, P2, P3, P4 and P5
- Rock breaking and slope stabilization works for Ride P3 and P5
- Construction of drainage channels to slopes
- Mini pile construction
- Zone 3 Foundation at L2: Rock excavation near Intake 2 for Pad Footings. Cart away excavated rock materials
- North Plant Room: HKE Substation On-grade slab and cable trench excavation. Cart away excavated rock materials.
- North Plant Room and L2 slab at roundabout: Core7 and Column scaffolding, rebar fixing, and shutter erection
- Bearing Wall BWF01: Backfilling works surrounding the bearing wall (re-use site material)
- L2 Column Construction: Excavate to top of footing for column construction near G.L. 15-24/170-171
- L2 Slab Construction: Excavate site formation of L2 slope edge, construction of suspended slab (near G.L. 15-24/170-171)
- South Plant Room (footing construction, backfilling)
- B1 and L1 underground manholes and drainage

- L1 zone 6 on grade slab
- Core wall
- L1 and L2 slab and column construction

2.3 Summary of Environmental Submissions

Summaries of validity permits, licenses, and/or notifications on environmental protection for the Project are presented in **Table 1**.

Table 1: Status of Environmental Licenses and Permits of the Project

Type of Permit/ License	Submissi on Date	Reference / License No.	Date of Issue	Date of Expiry	Status
Environmental Permit	/	EP-487/2014	27-Aug-14	N/A	Valid
Notification pursuant to Air Pollution Control (Construction Dust) Regulation	15-Mar-17	414651	N/A	N/A	Valid
Application for a Billing Account for Disposal of Construction Waste	14-Dec-16	Account No. 7026786	28-Dec-16	N/A	Valid
Discharge Licence under WPCO WT00028196-2017	15-Mar-17	414650	29-May-17	31-May-22	Valid
Registration as a Chemical Waste Producer (WPN: 5213-176-G2785-01)	21-Apr-17	415966	31-May-17	N/A	Completed
Construction Noise Permit under NCO GW-RS0439-17	26-Apr-17	416080	15-May-17	29-Dec-17	Superseded
Construction Noise Permit under NCO GW-RS0825-17	8-Sep-17	420985	22-Sep-17	21-Mar-18	Superseded
Renew Construction Noise Permit under NCO GW-RS1024-17	3-Nov-17	422922	21-Nov-17	16-May-18	Valid

To according with the EP stipulation, the required documents has been submitted to EPD for retention as listed below:

- Project Layout Plans
- Management Organization of Main Construction Companies

- Detailed Vegetation Survey Report
- Woodland Compensation Plan
- Ardeid Inspection Report
- Short-nosed Fruit Bat Inspection Report
- Baseline Monitoring Report Revision A of the Project

3 Construction Noise Monitoring

3.1 Monitoring Requirements, Frequency and Duration

Construction noise is one of the key environmental issue during the construction phase of the Project in accordance to the approved EM&A Manual. Following the requirements in the EM&A Manual, continuous noise monitoring for A-weighted levels L_{eq} , L_{10} , L_{90} shall be undertaken once every week during the construction phase. Measurement of $L_{eq}(30min)$ between 07:00-19:00 hours on normal weekdays.

If construction works are necessary to carry out at other time periods, i.e. restricted time period (19:00-07:00 the next morning and whole day on public holidays) (hereinafter referred as “the restricted hours”), 3 consecutive $L_{eq}(5min)$ measurements shall be recorded, while complying specific conditions as stipulated on the Construction Noise Permit (CNP). Supplementary information for data auditing, statistical results such as L_{10} and L_{90} shall also be obtained for reference. Summary of these monitoring requirements is listed in **Table 2**.

Table 2: Noise Monitoring Parameters

Monitoring Station	Parameters
NM1A and NM2	<ul style="list-style-type: none"> $L_{eq}(30min)$ in normal working days (Monday to Saturday) 07:00-19:00 except public holiday; 3 sets of consecutive $L_{eq}(5min)$ on restricted hours i.e. 19:00 to 07:00 next day, and whole day of public holiday or Sunday when applicable, and Supplementary information for data auditing, statistical results such as L_{10} and L_{90} shall also be obtained for reference

The baseline results form the basis for determining the environmental acceptance criteria for the impact monitoring. According to the approved EM&A Manual with baseline monitoring results, construction noise criterion, namely Action and Limit levels proposed are listed in **Table 3**.

Table 3: Action and Limit Levels for Construction Noise

Monitoring Location	Action Level	Limit Level in dB(A)
NM1A and NM2	When one or more documented complaints are received	70 dB(A) ^{1,2}

Note: 1. Acceptable noise levels for school should be reduced to 65 dB(A) during examination period
 2. If works are to be carried out during restricted hours, the conditions stipulated in the CNP have to be followed.

3.2 Monitoring Locations

Two designated noise monitoring locations as established in the EM&A Manual is shown in **Appendix D**. After the baseline monitoring, alternative location NM1A has been proposed by MMHK due to rejection of the monitoring location set up at NM1. The proposal was verified and agreed by EPD in the Baseline Monitoring Report.

Table 4 and **Appendix E** respectively list and show the construction noise monitoring locations for the Project.

Table 4: Impact Monitoring locations

Monitoring location	Descriptions	Type of measurement
NM1A	Slope near Victoria Shanghai Academy (VSA) to replace NM1 of the VSA	Free field
NM2	Hong Kong Juvenile Care Centre (HKJCC)	Facade

3.3 Monitoring Equipment

Integrating sound level meter in compliance with the International Electrotechnical Commission Publications 651: 1979 (Type 1) and 804: 1985 (Type 1) specifications shall be used for carrying out the noise monitoring. The sound level meter shall be checked using an acoustic calibrator. The wind speed shall be checked with a portable wind speed meter capable of measuring the wind speed in ms^{-1} . The acoustic calibrator and sound level meter to be used in the impact monitoring will be calibrated yearly.

Noise monitoring equipment used for monitoring is listed in **Table 5**.

Table 5: Noise Monitoring Equipment

Equipment	Model
Integrating Sound Level Meter	Rion NL-52
Calibrator	Larson Davis CAL200
Portable Wind Speed Indicator	Anemometer/ Lutron AM-4201

3.4 Monitoring Methodology

Field Monitoring

- Sound Level Meter was set on a tripod at a height of at least 1.2m above ground.
- Noise measurements were taken in terms of the A-weighted equivalent sound pressure level (L_{eq}) measured in decibels (dB). Supplementary statistical results (L_{10} and L_{90}) were also obtained for reference.
- Free field measurement was made at NM1A while facade measurement was made at NM2.
- The battery condition was checked to ensure the correct functioning of the meter.
- Prior of and after each noise measurement, the meter is calibrated using an acoustic calibrator for 94dB at 1kHz. The checking is performed before and after the noise measurement.
- During the monitoring, all noise measurements would be performed with the meter with Fast time weighting and on the A-weighted equivalent continuous sound pressure level (L_{eq}). $L_{eq}(30\text{min})$ as the monitoring parameter for the time period between 0700-1900 hours on weekdays; and also $L_{eq}(15\text{min})$ in three consecutive $L_{eq}(5\text{min})$ measurements would be used as monitoring parameter for other time periods (e.g. during restricted hours), if necessary. In addition, any site observations and noise sources were recorded on a standard record sheet.
- A correction of +3dB(A) was made to the free field measurement.
- Noise measurements were not made in fog, rain, wind with a steady speed exceeding 5ms^{-1} or wind with gust exceeding 10ms^{-1} .

Equipment calibration

- The sound level meter and calibrator are calibrated and certified by a HOKLAS accredited laboratory at yearly intervals.

- Calibration records of sound level meter and calibrator, together with the Anemometer used for impact monitoring program in the Reporting Period are shown in **Appendix F**.

Meteorological Information

Meteorological information was extracted from “the Hong Kong Observatory Wong Chuk Hang Station” to provide the humidity, wind speed, wind direction and temperature etc. as background weather information. The meteorological data throughout the impact monitoring period is summarized in **Appendix K**.

Derivation of Action/Limit (A/L) Levels

According to the approved EM&A Manual and baseline monitoring results, Action and Limit levels proposed on construction noise criterion monitoring are listed in **Table 6**.

Table 6: Action and Limit Levels for Construction Noise

Monitoring Location	Action Level	Limit Level in dB(A)
	Time Period: 07:00-19:00 hours on normal weekdays	
NM1A and NM2	When one or more documented complaints are received	70 dB(A) ^{1,2}

Note: 1. A correction of +3dB(A) was made to the free field measurement at monitoring station NM1A.
 2. No examination has taken place during this reporting month.

Should non-compliance of the environmental quality criteria occur, remedial actions will be triggered according to the Event and Action Plan which presented in **Appendix G**.

Data Management and Data QA/QC Control

All monitoring data will be handled by the ET’s in-house data recording and management system. The monitoring data recorded in the equipment will be downloaded directly from the equipment at the end of each monitoring day. The downloaded monitoring data will input into a computerized database properly maintained by the ET.

3.5 Monitoring Schedule

Monitoring for noise levels due to construction work was undertaken during the reporting month in compliance with the EM&A manual in the Reporting Period. Regular monitoring surveys were carried out on 1st, 7th, 15th, 23rd, 29th November 2017 and one additional impact monitoring for the construction works held during the restricted hour period on 26th November 2017 during the reporting month to access the compliance with environmental requirements. A total of 12 occasions of noise monitoring surveys were carried out at the two noise monitoring locations.

3.6 Results of Impact Monitoring

As shown in **Table 7**, results of the noise monitoring measurement were below 70dB(A). No noise complaints were received in this Reporting Period. No exceedance (Action/Limit Level) of construction noise was thus recorded in this period.

Table 7: Summary of Construction Noise Monitoring Results (Noise level for 30 minutes)

Monitoring date	Time		Mean and range of noise levels, dB(A)		Limit Level for L_{eq} (dB(A)) ²
	Start	Finish	L_{eq} (30min)	Corrected L_{eq} (30min) ¹	
NM1A					
01-Nov-17	09:02	09:32	58.2	61.2	70
07-Nov-17	09:35	10:05	57.6	60.6	70
15-Nov-17	10:10	10:40	56.1	59.1	70
23-Nov-17	10:35	11:05	57.0	60.0	70
29-Nov-17	10:00	10:30	56.2	59.2	70
NM2					
01-Nov-17	10:25	10:55	52.3	-	70
07-Nov-17	08:55	09:25	52.0	-	70
15-Nov-17	09:30	10:00	52.9	-	70
23-Nov-17	09:55	10:25	53.9	-	70
29-Nov-17	09:20	09:50	52.4	-	70

Note: 1. A correction of +3dB(A) was made to the free field measurement at monitoring station NM1A.
 2. No examination has taken place in this reporting month.

As shown in **Table 8**, results of the additional noise monitoring measurement were below 70dB(A). No exceedance (Action/Limit Level) of construction noise was thus recorded in this period.

Table 8: Summary of Construction Noise Monitoring Results (Noise level for 15 minutes)

Monitoring date	Time		Mean and range of noise levels, dB(A)		Limit Level for L_{eq} (dB(A)) ²
	Start	Finish	L_{eq} (15min)	Corrected L_{eq} (15min) ¹	
NM1A					
26-Nov-17	15:35	15:50	51.4	54.4	70
NM2					
26-Nov-17	15:00	15:15	44.9	-	70

Note: 1. A correction of +3dB(A) was made to the free field measurement at monitoring station NM1A.
 2. No examination has taken place in this reporting month.

Summary of data and the supplementary information for data auditing is presented in **Appendix I**. Graphical plots of the monitoring data are as shown in **Appendix J**.

4 Ecology Monitoring

4.1 General

As required under the Section 8.3.2 of the approved EM&A Manual, the implementation of ecological mitigation measures as detailed in the Section 15 of the EIA report and Appendix C of the approved EM&A Manual shall be routinely audited during the routine environmental audit; and any observations and recommendations shall be reported in periodic EM&A reports.

Among those mitigation measures recommended to avoid or minimize the disturbance to any plants of conservation interest (EM&A reference 8.3.1.1), nested ardeids (EM&A reference 8.3.1.2) and roosted short-nosed fruit bat (EM&A reference 8.3.1.3), the required inspection has already been undertaken in August/September 2014 with the results presented in the submitted respective baseline report. Therefore, the following sections only address those applicable to this stage of the project, i.e., Section 8.3.2 of the approved EM&A Manual.

4.2 Monitoring Requirement

Monitoring of Plants of Conservation Interest (*Platycodon grandiflorus*)

According to Condition 2.6 of Environmental Permit No. EP-487/2014, the Detailed Vegetation Survey Report has located two groups of the protected *Platycodon grandiflorus* and recommended that the plants should be protected with temporary protective fencing to avoid potential impact from construction activities (such as material storage), and monitor the identified *Platycodon grandiflorus* on a monthly basis throughout the construction phase to make sure that they are not affected by the construction works of the Project. Accordingly, the following monitoring parameters will be undertaken on a monthly basis during the construction period:

- Effective implementation of the protection measures as recommended in the Section 4.1 of the Detailed Vegetation Survey Report
- Monitoring of the two groups of *Platycodon grandiflorus* identified during the detailed vegetation survey to make sure that they are not affected by the construction works

Monitoring of Nesting Activities of Ardeids in Breeding Season

The project area should be checked monthly in breeding season (April to July) for any potential breeding and nesting activities, and if required, suitably sized buffer area will be recommended to avoid human or machinery disturbance until the nest is abandoned.

Monitoring of Roosting Activities of Ardeids in Peak Wintering Season

The existing ardeid night roost within the project area should be monitored monthly during peak wintering season (November to March) during the construction phase using direct observation from a vantage point (i.e., point count method) at evening time from an hour before sunset, and last until the nightfall.

Compensation for Ardeid roosting Site

An enhancement area provided as an alternative roosting site for ardeids should be developed during the first phase of the construction.

Compensation of Woodland Habitat

Mitigation measures recommended in the approved Woodland Compensation Plan should be fully and properly implemented, including but not limited to the creation of 0.84 ha woodland compensation on-site and 0.78 ha on-site woodland reinstatement, to mitigate for permanent loss of woodland habitat.

4.3 Inspection Findings

The ecological inspection was undertaken on 10 November 2017 by the qualified ecologist. The inspection findings are presented below.

Plants of Conservation Interest (*Platycodon grandiflorus*)

Platycodon grandiflorus is a perennial herb up to 120 cm high. Stems erect and scarcely any branches. It is often found on sunny grassy hillslopes in brushes. Two groups of *Platycodon grandiflorus* (see Figure 1 of **Appendix L** for their locations) that were recorded in 2015's growing season within the fenced area (see Photo 1 of **Appendix L** of this report).

On the other hand, the preventive mitigation measures, i.e., erecting of temporary protective fencing and sign post, were found to be effectively implemented for human disturbance (see Photo 2 of **Appendix L** of this report), and there are no signs or evidence (e.g. dust coating of plant) to prove that the on-going construction activities within the Project Area has affected the health condition of the *Platycodon grandiflorus*.

Nesting Activities of Ardeids in Breeding Season

This monitoring parameter only required during the breeding season of ardeids, i.e., from April to July, and the last monitoring event for nesting activities of Ardeids in the 2017's breeding season was undertaken on 21 July 2017, and such monitoring would not be required for the Reporting Period.

Roosting Activities of Ardeids in Peak Wintering Season.

Monitoring of roosting activities of Ardeids has been carried out on by direct observation at vantage point on 10 November 2017, and covered the evening time from an hour before sunset to last until nightfall (1630 to 1820). The location of vantage point has shown in Figure 2 of **Appendix L**.

No ardeids were noted within or in the vicinity of the project area during the monitoring period.

Compensation for Ardeid roosting Site

To be implemented.

Compensation of Woodland Habitat

To be implemented.

4.4 Conclusion

The implementation of the mitigation measures for the plant species of conservation interest, i.e., erecting of temporary protective fencing and sign post during the Reporting Period was noted. The two groups of *Platycodon grandiflorus* within the fenced area were found to be vigorous and all new branches were in healthy condition.

Roosting activities of ardeids have not been observed within the project area during the monitoring.

The tentative ecological inspection and monitoring in the next Reporting Period is scheduled on 15 December 2017.

5 Landscape & Visual Monitoring

5.1 General

Landscape and visual mitigation measures for the construction phase are listed in the Approved EM&A Manual Table 9.1.

The design, implementation and maintenance of landscape and visual mitigation measures shall be checked bi-weekly to ensure that they are fully realized during the construction phase. The scope of the site audit during construction shall include the following:

- The extent of the agreed works areas should be regularly checked. No construction activities or storage shall be undertaken outside the limit of the works;
- The progress of the engineering works should be regularly reviewed on site to identify the earliest practical opportunities for the landscape works to be undertaken;
- All landscaping works are carried out in accordance with the specifications; and
- All new plantings are carried out properly and during the right season.

Any potential conflicts between the proposed landscape and visual mitigation measures and any other project works or operational requirements shall be recorded for the Contractor to resolve in an early stage, without compromising the intention of the mitigation measures.

5.2 Inspection Findings

In the Reporting Period, bi-weekly landscape and visual site inspection were conducted on 3 and 17 November 2017.

According to the bi-weekly site inspections, it was observed that the Contractor complied with the intended aims of the mitigation measures, for example, no construction activities or materials storage conducted and placed outside of the working site boundary.

The Contractor was advised to improve and maintain the tree protection zone.

6 Waste Management

6.1 General Waste Management

Waste management was carried out by an on-site Environmental Officer or an Environmental Supervisor from time to time.

6.2 Records of Waste Quantities

All types of waste arising from the construction work are classified into the following:

- Construction & Demolition (C&D) Material;
- Chemical Waste;
- General Refuse; and
- Excavated Soil.

Monthly Summary Waste Flow Table provided by the Contractor is shown in **Appendix M**.
Materials were reused on-site as far as practicable.

7 Site Inspection

7.1 Requirements

According to the approved EM&A Manual, the environmental site inspection shall be formulated by the ET Leader. Weekly environmental site inspections should be carried out to confirm the environmental performance.

7.2 Findings / Deficiencies during the reporting month

In the Reporting Period, joint site inspections were undertaken by the PMR, ET and the Contractor on 3, 10, 17, 24 November 2017. Furthermore, IEC performed the site inspection and audit on 10 November 2017. During site inspection, non-compliance was not observed by the ET and IEC.

During site inspections, non-compliance was not observed by the ET and IEC. However, total of four observations were recorded in the Reporting Period. The findings / deficiencies of the Project observed during the weekly site inspections are listed in **Table 9**.

Table 9: Summary of findings / deficiencies

Date	Findings / Deficiencies	Follow-up Status
10 Nov 2017	Trip tray should be provided for diesel container.	Trip tray had been provided for diesel container at E.V.A on 17 Nov 2017.
17 Nov 2017	Stagnant water should be cleared.	Stagnant water has been cleared on 24 Nov 2017.
17 Nov 2017	Trip tray should be provided at level 2, zone 1.	Trip tray has been provided for the chemical containers at level 2, zone 1 on 24 Nov 2017.
24 Nov 2017	Chemical waste label should be shown clearly on the cabinet.	Chemical waste label has been shown clearly on 1 Dec 2017.

The Contractor has rectified the above deficiencies immediately or within deadline. Therefore, the environmental performance of the Project managed by the Contractor with OPC was considered satisfactory.

Special attention shall be paid on the proper implementation of mitigation measures to prevent runoff flow to public area.

As a general reminder, dust mitigation measures should be provided to prevent fugitive dust from haul road, stockpile materials and construction activities; and the site housekeeping should be maintained. Furthermore, all chemical materials shall be stored in the designated area after use.

8 Environmental Complaint, Summons and Prosecution

8.1 Environmental Complaint, Summons and Prosecution

No environmental complaint, summons and prosecution were received in the Reporting Period.

The statistical summary for environmental complaints is presented in **Table 10**.

Table 10: Statistics for complaints, notifications of summons and successful

Reporting Period	Cumulative Statistics		
	Complaints	Notifications of summons	Successful prosecutions
This report month	0	0	0

9 Implementation Status of Mitigation Measures

9.1 General Requirements

The environmental mitigation measures that were recommended in the Implementation Schedule for Environmental Mitigation Measures in the approved EM&A Manual covered the issues of dust, noise, water and waste and are presented in **Appendix N**.

The Project shall be implementing the required environmental mitigation measures according to the approved EM&A Manual as subject to the site condition. Environmental mitigation measures generally implemented by the Contractor in this Reporting Month are summarized in **Table 11**.

Table 11: Environmental Mitigation Measures

Issues	Environmental Mitigation Measures
Construction Noise	<ul style="list-style-type: none"> Construction equipment shut down when not in use
Ecology	<ul style="list-style-type: none"> Wire fencing was provided for temporary protection of the identified flora species of conservation concern Site inspection of the flora species of conservation and the Ardeid of breeding and nesting activities was undertaken
Landscape & Visual	<ul style="list-style-type: none"> Good site management
Air Quality	<ul style="list-style-type: none"> Good site management to reduce air quality impact Main temporary access road paved with concrete Prior to any loading or transfer operation, all dusty materials were sprayed with water to keep them wet All debris had been covered entirely by impervious sheeting Before debris was dumped into a chute, water was sprayed onto the debris to make them wet Vehicles were covered with tarpaulin during transport of dusty materials When vehicles were leaving the construction site, any vehicles loaded with dusty materials were covered with clean impervious sheeting to prevent fugitive dusty material emission The speed of the trucks passing site areas was controlled to below 10 km/hour Water spraying was provided for soil-nailing work
Water Quality	<ul style="list-style-type: none"> Portable chemical toilets were provided on site A licensed collector has been employed to collect effluent and off-site dispose.
Waste and Chemical Management	<ul style="list-style-type: none"> A temporary container located far away from sea shore and drainage channel was provided for chemical materials and waste storage Drip tray was provided for chemical materials at the working areas Waste skip was provided for general refuse disposal
General	<ul style="list-style-type: none"> The site was generally kept tidy and clean

9.2 Tentative Construction Activities in the Coming Month

Construction activities to be undertaken in the coming month for the Project are listed below:

- Site formation for ride footing construction
- Cut soil slope and soil nail installation for Ride P1, P2, P3,P4 and P5
- Rock breaking and slope stabilization works for Ride P3 and P5
- Construction of drainage channels to slopes
- Mini pile construction
- North Plant Room Formation: HKE Substation On-grade slab and cable trench excavation and on-grade slab construction. Cart away excavated rock materials.
- North Plant Room and L2 slab (10E4): Column construction, install concrete block retaining wall to form ground for falsework erection, L2 slab falsework erection, formwork, rebar, concreting.
- Zone 3 Foundation at L2: Rock excavation and mucking out, rock mapping inspection, cast concrete blinding, construct footings
- South Plant Room (footing construction, backfilling)
- B1 and L1 underground manholes and drainage
- L1 zone 6 on grade slab
- Core wall
- L1 and L2 slab and column construction

9.3 Key Issues for the Coming Month


Based on construction activities as undertaken in the coming month, key environment issues consider to be included:

- Potential fugitive dust impact due to the dry/loose/exposure soil surface/dusty material;
- Potential water quality impact due to surface runoff especially on the hillside;
- Implement dust suppression measures at the all times;
- Ensure noise and dust mitigation measures are implemented properly;
- Sediment catch-pits and silt removal facilities should be regularly maintained;
- Site effluent discharge shall be fulfilled the discharge license requirements;
- Management of chemical wastes properly implement;
- Ensure chemical storage should be managed properly; and
- Implementation of construction noise preventative control measures.

10 Recommendation

- Dust mitigation measures for potential fugitive dust impact should be implemented in dry season.
- Noise mitigation measures, including the use of quiet plants, should be implemented in accordance with the EM&A requirement.

A. Layout Plan of the Project

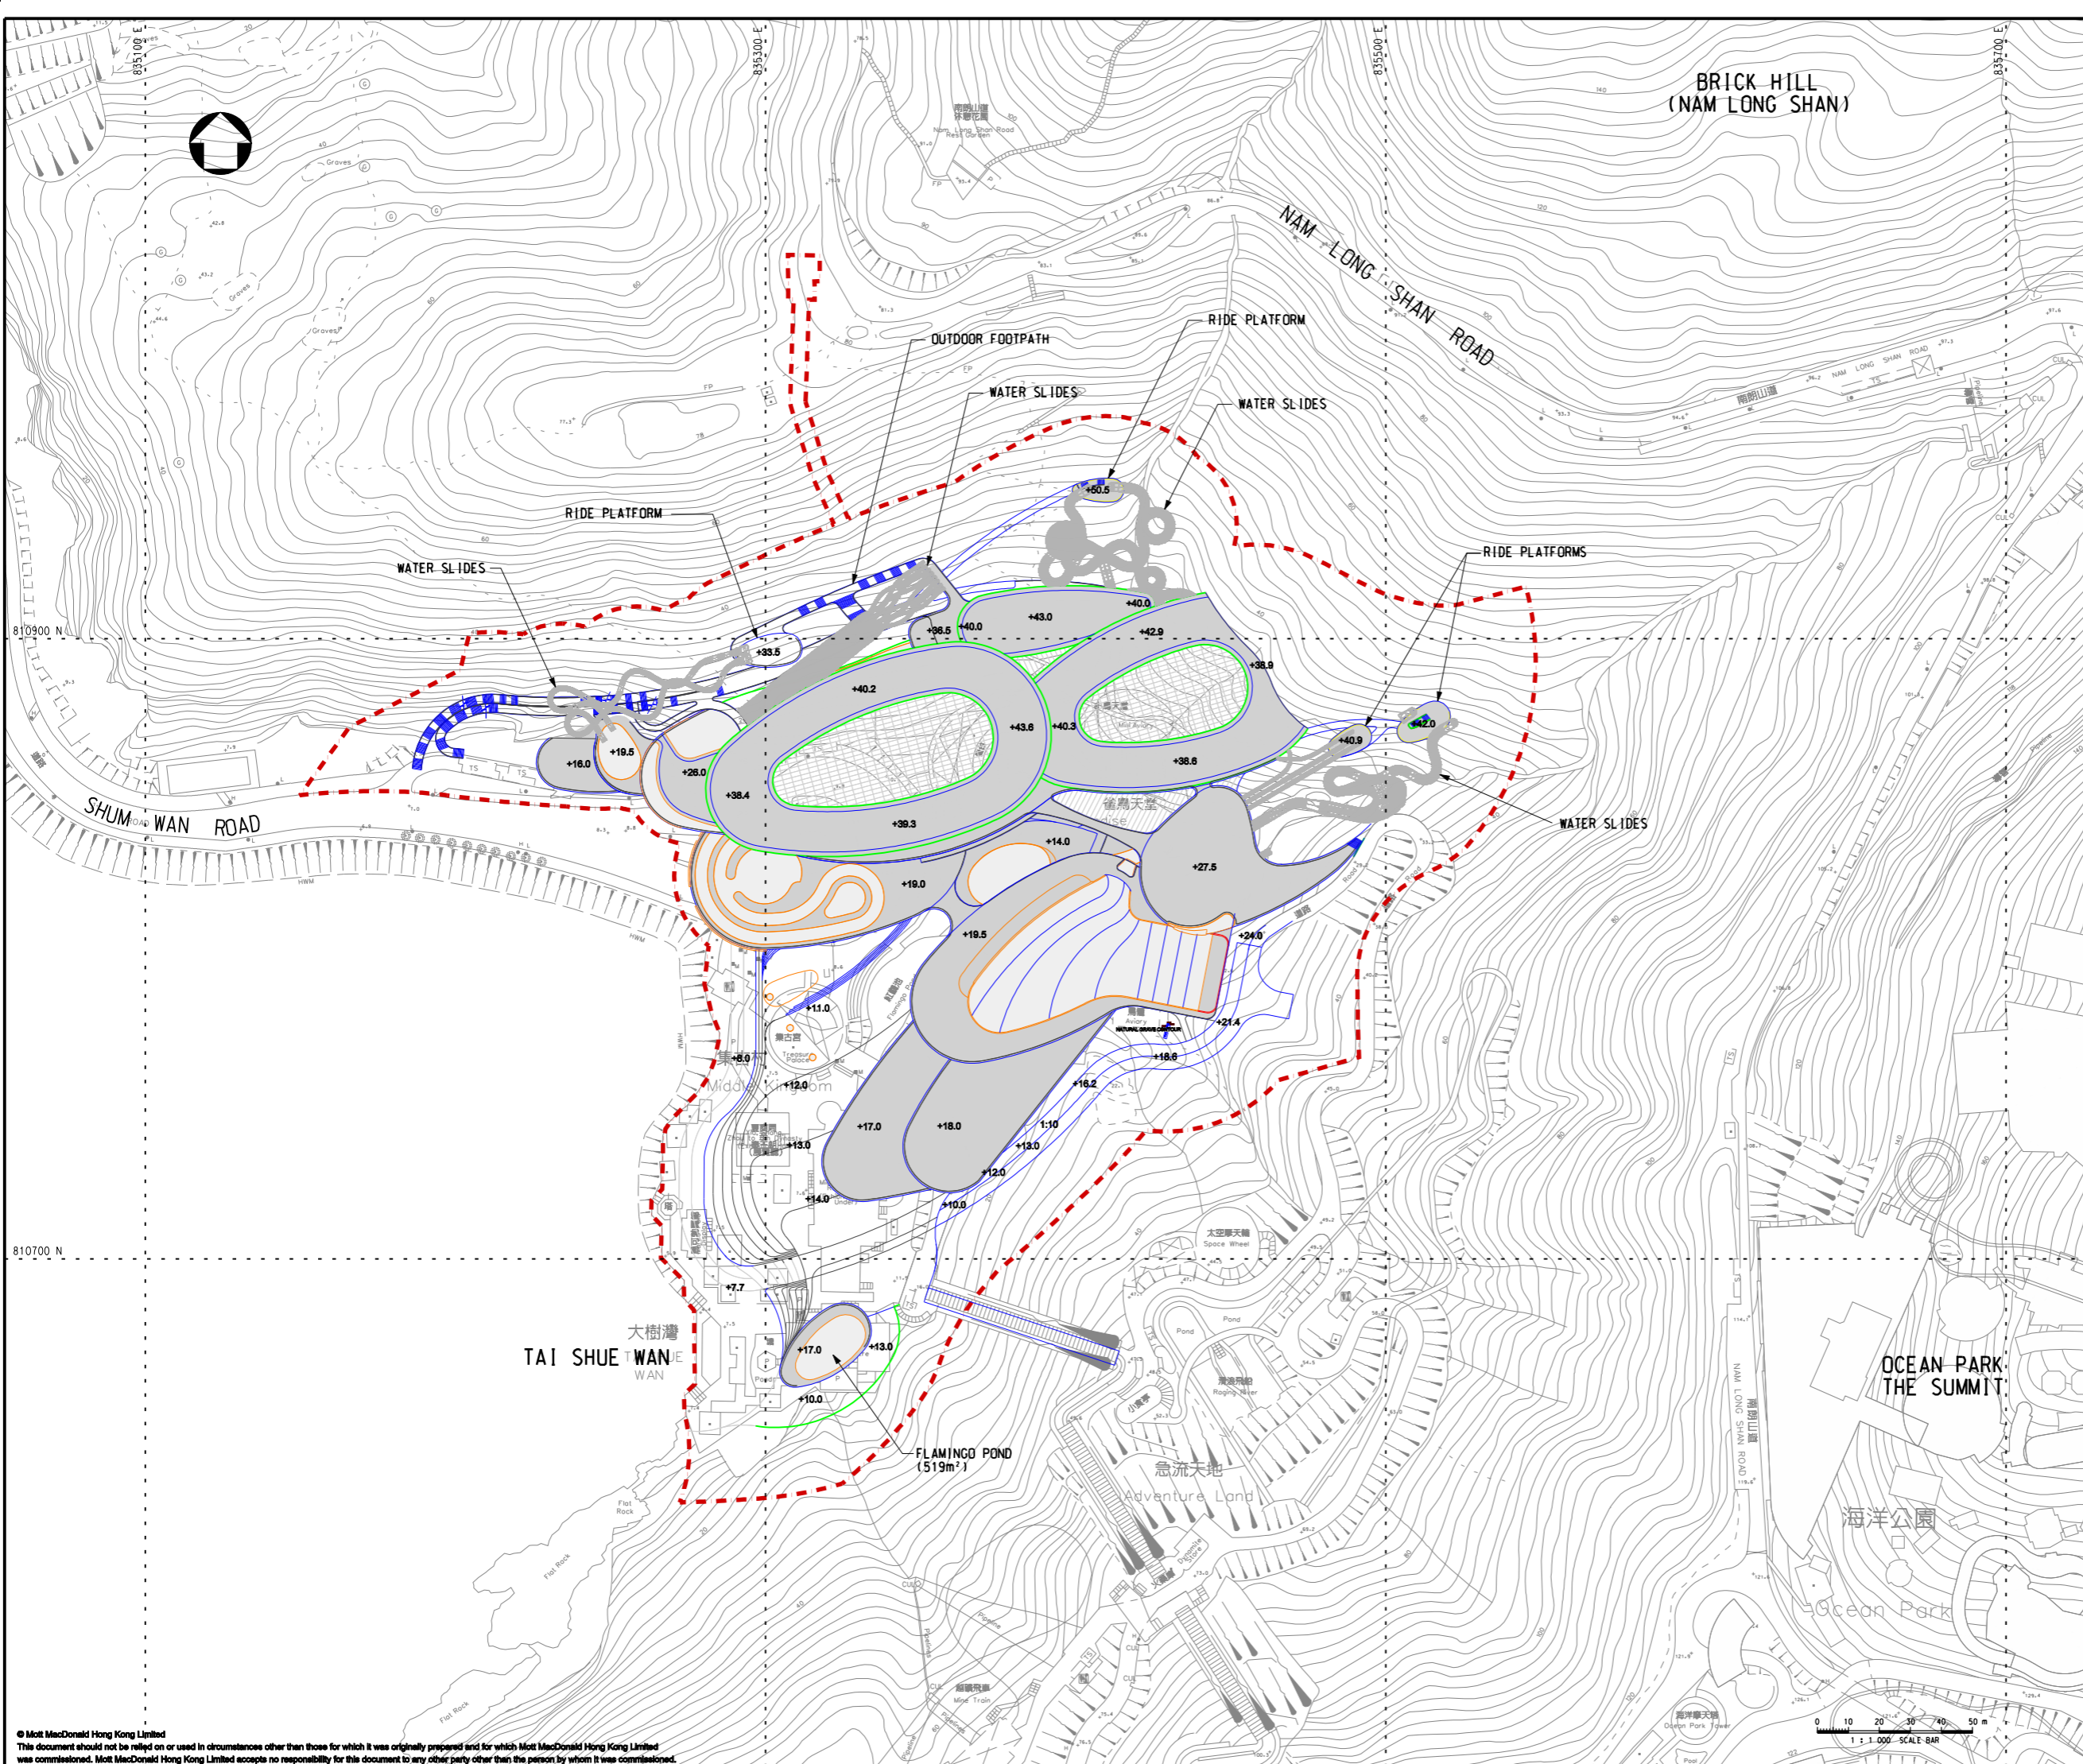

Notes

Key to symbols

--- PROJECT BOUNDARY

Reference drawings

Rev	Date	Drawn	Description	Ch'kd	App'd
P3	MAR 14	MING	GENERAL REVISION	RH	AFK
P2	FEB 14	MING	GENERAL REVISION	RH	AFK
P1	JAN 14	MING	FIRST ISSUE	GC	AFK



20/F Two Landmark East
100 How Ming Street
Kowloon, Kowloon
Hong Kong
T +852 2828 5757
F +852 2827 1823
www.mottmac.com.hk

Client



Project

**TAI SHUE WAN DEVELOPMENT
AT OCEAN PARK**

Title

PROJECT LAYOUT PLAN

Designed	HY	Eng check	FW
Drawn	MING	Coordination	FW
Dwg check	HY	Approved	AFK
Scale at A1	1:1000	Status	PRE
Drawing Number	FIGURE 2.6		Rev P3

B. Project Organisation

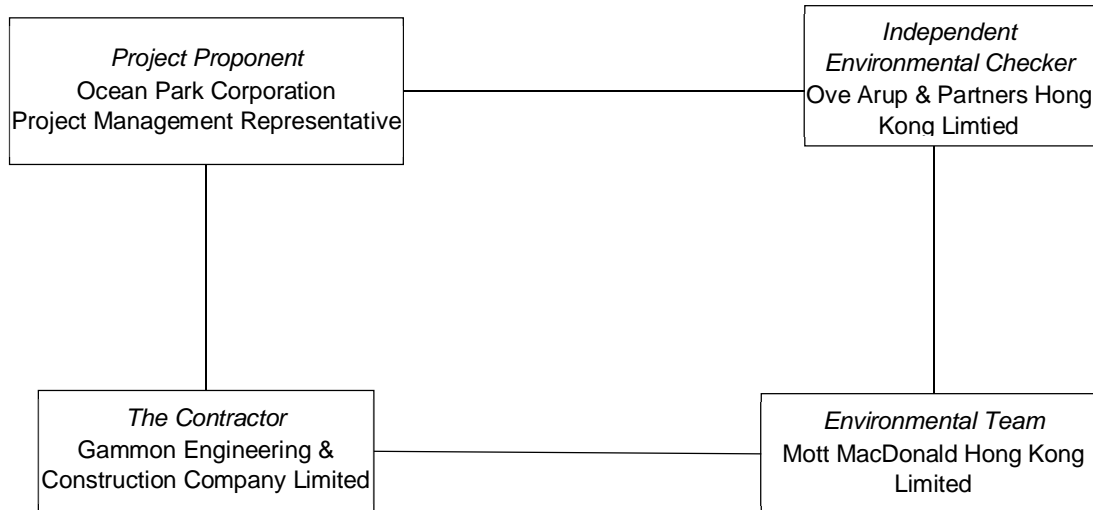


Table A: Contact information

Company / Department	Position	Name	Telephone / Mobile	Fax No.
Ocean Park Corporation	Project Management Representative	Mr Augustine Li	2870 6130	2814 0179
Ove Arup & Partners Hong Kong Ltd.	Independent Environmental Checker	Mr Gerald Kam	2268 3915	2268 3950
Mott MacDonald Hong Kong Ltd.	Environmental Team Leader	Mr Gary Chow	2828 5874	2827 1823
Mott MacDonald Hong Kong Ltd.	Qualified Ecologist	Mr Roy Hung	2828 5965	2827 1823
Gammon Engineering & Construction Company Limited	Construction Manager	Mr Paul Leaver	3690 9229	2148 2890
Gammon Engineering & Construction Company Limited	Environmental Officer	Ms Sammie Chan	2269 1507	2148 2890

C. 3-month Look-ahead Program

ID	Activity	Duration	Start	Finish	October					November					December				
					02	09	16	23	30	06	13	20	27	04	11	18	25		
OCEAN PARK - TAI SHUE WAN WATER WORLD PROJECT Master ((CONST 3MR Programme Nov 20171101 WK-																			
CONTRACT DATES																			
Key Dates																			
Contract																			
CD.C10-KD3	C10-KD3-Complete Performance Test to Curtain Wall	0	07-Dec-17*												▼ C10-KD3-Complete Performance Test to Curtain				
NOMINATED SUB-CONTRACTORS																			
Thematic Works & Wayfinding Signage																			
NS.DS.1130	Thematic Works detail design & approvals	90	11-Jan-18	10-Apr-18															
PRELIMINARIES																			
E&M Submission																			
Drawing and Method Statement																			
ELV																			
EM.DM005002	Submission and approval of Installation Method Statement	90	30-Dec-17	29-Mar-18															
SLOPE WORKS -SITE FORMATION																			
Tower Crane																			
TC5																			
PR.STC5.5140	TC5 - Tower Crane in Use	216	06-Aug-17	26-May-18															
TC1																			
PR.STC1.1130	TC1 - Tower Crane in Use	362	02-Aug-17	02-Feb-19															
Works for Roof B Horizontal Pipe Piles																			
Horizontal Piling (On Hold)																			
LR.STC5.7140	Horizontal Pipe Piles - 15no. 273dia @ 3days /pile	45	30-Jan-18	26-Mar-18															
Slope Works for Rides																			
Ride P1																			
P1 RIDE FORMATION																			
Zone 1A-1a (no footings)																			
FM.P1.1A-1a.110	Zone 1A-1a: Excavate soil and rock from 26 mPD to 24 mPD	12	26-Sep-17	10-Nov-17															
FM.P1.1A-1a.140	Zone 1A-1a: Excavate soil and rock from 24 mPD to 22 mPD	14	11-Nov-17	27-Nov-17															
FM.P1.1A-1a.160	Zone 1A-1a: Excavate soil and rock from 22 mPD to 20 mPD	15	25-Nov-17	12-Dec-17															
FM.P1.1A-1a.190	Zone 1A-1a: Excavate rock from 20 mPD to 18 mPD	17	11-Dec-17	02-Jan-18															
FM.P1.1A-1a.230	Zone 1A-1a: Excavate rock from 18 mPD to 16 mPD	18	30-Dec-17	20-Jan-18															
FM.P1.1A-1a.310	Zone 1A-1a: Excavate rock from 16 mPD to 14.2 mPD	15	19-Jan-18	05-Feb-18															
Zone 1A-1c																			
FM.P1.1A-1c.420	Zone 1A-1c: Submit BA14 site formation works	14	24-Jan-18	08-Feb-18															
FM.P1.1A-1c.250	Zone 1A-1c: Excavate Soil from 18.8 mPD to 16.8 mPD (Tree clash RFI:333)	12	25-Nov-17	08-Dec-17															
FM.P1.1A-1c.300	Zone 1A-1c: Excavate soil and rock from 16.8 mPD to 14.8 mPD	14	09-Dec-17	27-Dec-17															
FM.P1.1A-1c.360	Zone 1A-1c: Excavate soil and rock from 14.8 mPD to 12.9 mPD	16	28-Dec-17	16-Jan-18															
FM.P1.1A-1c.410	Zone 1A-1c: Prepare Geological assessment report	6	17-Jan-18	23-Jan-18															
Zone 1B-1																			
FM.P1.1B-1.210	Zone 1B-1: Excavate soil and rock from 29.7 mPD to 28.5 mPD	13	04-Nov-17	18-Nov-17															
FM.P1.1B-1.290	Zone 1B-1: Submit BA14 site formation works	14	02-Dec-17	18-Dec-17															
FM.P1.1B-1.280	Zone 1B-1: Prepare Geological assessment report	6	20-Nov-17	25-Nov-17															
FM.P1.1B-1.190	Zone 1B-1: Excavate soil and rock from 31.7 mPD to 29.7 mPD	17	18-Sep-17	03-Nov-17															
Zone 1B-2																			
FM.P1.1B-2.270	Zone 1B-2: Excavate soil and rock from 32.6 mPD to 30.5 mPD	18	20-Sep-17	09-Nov-17															
FM.P1.1B-2.370	Zone 1B-2: Submit BA14 site formation works	14	02-Dec-17	18-Dec-17															
FM.P1.1B-2.340	Zone 1B-2: Prepare Geological assessment report	6	10-Nov-17	16-Nov-17															
Zone 1A-2																			
FM.P1.1A-2.220	Zone 1A-2: Excavate Soil from 30.4 mPD to 28.4 mPD	12	04-Nov-17	17-Nov-17															
FM.P1.1A-2.260	Zone 1A-2: Excavate soil and rock from 28.4 mPD to 26.4 mPD	14	18-Nov-17	04-Dec-17															
FM.P1.1A-2.320	Zone 1A-2: Excavate soil and rock from 26.4 mPD to 24.4 mPD	16	05-Dec-17	22-Dec-17															
FM.P1.1A-2.390	Zone 1A-2: Excavate soil and rock from 24.4 mPD to 22.4 mPD	17	23-Dec-17	15-Jan-18															
FM.P1.1A-2.430	Zone 1A-2: Excavate rock from 22.4 mPD to 21.7 mPD	14	16-Jan-18	31-Jan-18															
Zone 1A-1b																			
FM.P1.1A-1b.350	Zone 1A-1b: Submit BA14 site formation works	14	21-Dec-17	09-Jan-18															
FM.P1.1A-1b.170	Zone 1A-1b: Excavate soil and rock from 22 mPD to 20 mPD	12	16-Aug-17	06-Nov-17															
FM.P1.1A-1b.200	Zone 1A-1b: Excavate rock from 20 mPD to 18 mPD	16	07-Nov-17	24-Nov-17															
FM.P1.1A-1b.240	Zone 1A-1b: Excavate rock from 18 mPD to 16.2 mPD	16	25-Nov-17	13-Dec-17															
FM.P1.1A-1b.330	Zone 1A-1b: Prepare Geological assessment report	6	14-Dec-17	20-Dec-17															
Ride P5																			
P5 RIDE FORMATION																			
Zone 5A-1																			
FM.P5.5A-1.660	Zone 5A-1: Submit BA14 site formation works	14	13-Dec-17	30-Dec-17															
FM.P5.5A-1.330	Zone 5A-1: Excavate soil and rock from 46.1 mPD to 44.1 mPD	20	21-Dec-17	22-Nov-17															
FM.P5.5A-1.400	Zone 5A-1: Excavate soil and rock from 44.1 mPD to 42.1 mPD	19	26-Oct-17	14-Nov-17															
FM.P5.5A-1.460	Zone 5A-1: Excavate rock from 42.1 mPD to 40.3 mPD	18	15-Nov-17	05-Dec-17															

■ critical level of effort ■ Critical Remaining Work
■ Current
◆ Milestone ◆ Milestone
■ % Complete

Project: Ocean Park Tai Shue Wan Water World Project
 Contract No. TSW-C006
 Project ID: T16004-87
 Layout: 3 Month look ahead IMPACTED OCT
 Page: 1 of 11

OCEAN PARK - TAI SHUE WAN DEVELOPMENT
Contract No. TSW-C006
3 month Rolling Construction program _NOV 2017



Date	Revision	Checked	Approved
01-Nov-17	Rev 0	PL LN ME	

ID	Activity	Duration	Start	Finish	October					November					December				
					5					6					7				
					02	09	16	23	30	06	13	20	27	04	11	18	25		
SFD.P1.1030	Excavate and Construct 450 SC - 11m	14	06-Sep-17	10-Nov-17															
SFD.P1.1040	Excavate and Construct 525 UC -24m	9	09-Nov-17	18-Nov-17															
P3																			
SFD.P3.1000	Excavate and Construct catchpits -1No	6	31-Oct-17	06-Nov-17															
SFD.P3.1010	Excavate and Construct 300 UC- 35m	10	07-Nov-17	17-Nov-17															
SFD.P3.1020	Excavate and Construct 300 UC- 12m	7	07-Nov-17	14-Nov-17															
P4/5																			
SFD.P45.1000	Excavate and Construct catchpits -1No	6	24-Nov-17	30-Nov-17															
SFD.P45.1010	Excavate and Construct 300 UC- 48m	24	01-Dec-17	30-Dec-17															
SFD.P45.1020	Excavate and Construct 450 SC - 42m	36	01-Dec-17	15-Jan-18															
RIDES - PILING & FOOTINGS																			
Ride P1 - Giant Aquatube Slide																			
Zone 1 FOOTING																			
Zone 1 Footing																			
Zone 1B-2																			
RC.P1.1A2260	Zone 1B-2: Submit BA8/10 for Foundation Works	28	09-Dec-17	13-Jan-18															
RC.P1.1A2270	Zone 1B-2: Rock Excavation for Footings	0	02-Dec-17	02-Dec-17															
RC.P1.1A2280	Zone 1B-2: Founding report / BD Inspection of Bearing Stratum	6	02-Dec-17	08-Dec-17															
Zone 1B-1																			
RC.P1.1A2310	Zone 1B-1: Submit BA8/10 for Foundation Works	28	09-Dec-17	13-Jan-18															
RC.P1.1A2320	Zone 1B-1: Rock Excavation for Footings	0	02-Dec-17	02-Dec-17															
RC.P1.1A2330	Zone 1B-1: Founding report / BD Inspection of Bearing Stratum	6	02-Dec-17	08-Dec-17															
Zone 1A-1b																			
RC.P1.1A2410	Zone 1A-1b: Submit BA8/10 for Foundation Works	28	30-Dec-17	01-Feb-18															
RC.P1.1A2420	Zone 1A-1b: Rock Excavation for Footings	0	21-Dec-17	21-Dec-17															
RC.P1.1A2430	Zone 1A-1b: Founding report / BD Inspection of Bearing Stratum	6	21-Dec-17	29-Dec-17															
Zone 1A-1c																			
RC.P1.1A2370	Zone 1A-1c: Rock Excavation for Footings	0	24-Jan-18	24-Jan-18															
RC.P1.1A2380	Zone 1A-1c: Founding report / BD Inspection of Bearing Stratum	6	24-Jan-18	30-Jan-18															
Ride P2 - Aqua Twist Mat Races																			
Zone 2 FOOTING																			
Zone 2 Footing																			
Zone 2C-2																			
RCF.P2.2C-2.120	Zone 2C-2: Submit BA8/10 for Foundation Works	28	06-Jan-18	07-Feb-18															
RCF.P2.2C-2.100	Zone 2C-2: Rock Excavation for Footings	0	29-Dec-17	29-Dec-17															
RCF.P2.2C-2.110	Zone 2C-2: Founding report / BD Inspection of Bearing Stratum	6	29-Dec-17	05-Jan-18															
Zone 2A-1																			
RCF.P2.2A-1.100	Zone 2A-1: Rock Excavation for Footings	44	03-Jan-18	26-Feb-18															
Zone 2C-1 (MP)																			
MP.P2.2B1480	Zone 2C-1 (MP): Submit BA8/10 for Minipiles	28	02-Dec-17	06-Jan-18															
MP.P2.2B1490	Zone 2C-1 (MP): Minipiles (2V4R)	15	18-Jan-18	03-Feb-18															
Ride P3 - Hybrid Funnel/Dark Ride																			
Zone 3 FOOTING																			
Zone 3 Footing																			
Zone 3B																			
RCF.P3.3B.100	Zone 3B: Rock Excavation for Footings	50	19-Dec-17	21-Feb-18															
Zone 3A																			
RCF.P3.3A.120	Zone 3A: Submit BA8/10 for Foundation Works	28	15-Jan-18	15-Feb-18															
RCF.P3.3A.100	Zone 3A: Rock Excavation for Footings	28	02-Dec-17	06-Jan-18															
RCF.P3.3A.110	Zone 3A: Founding report / BD Inspection of Bearing Stratum	6	08-Jan-18	13-Jan-18															
Zone 3A-2																			
RCF.P3.3A-2.120	Zone 3A-2: Submit BA8/10 for Foundation Works	28	17-Jan-18	21-Feb-18															
RCF.P3.3A-2.100	Zone 3A-2: Rock Excavation for Footings	16	19-Dec-17	09-Jan-18															
RCF.P3.3A-2.110	Zone 3A-2: Founding report / BD Inspection of Bearing Stratum	6	10-Jan-18	16-Jan-18															
Zone 3E-1																			
RCF.P3.3E-1.120	Zone 3E-1: Submit BA8/10 for Foundation Works	28	19-Dec-17	23-Jan-18															
RCF.P3.3E-1.100	Zone 3E-1: Rock Excavation for Footings	25	09-Nov-17	07-Dec-17															
RCF.P3.3E-1.110	Zone 3E-1: Founding report / BD Inspection of Bearing Stratum	6	08-Dec-17	14-Dec-17															
Zone 3E-2 (MP)																			
MP.P3.3C1170	Zone 3E-2 (MP): Submit BA8/10 for Minipiles	28	02-Dec-17	06-Jan-18															
MP.P3.3C1180	Zone 3E-2 (MP): Minipiles (3V3R)	14	18-Jan-18	02-Feb-18															
Zone 3E-3																			
RCF.P3.3E-3.120	Zone 3E-3: Submit BA8/10 for Foundation Works (formation below 3C-2)	28	21-Dec-17	25-Jan-18															
RCF.P3.3E-3.100	Zone 3E-3: Rock Excavation for Footings	10	02-Dec-17	13-Dec-17															
RCF.P3.3E-3.110	Zone 3E-3: Founding report / BD Inspection of Bearing Stratum	6	14-Dec-17	20-Dec-17															
Zone 3E-4 (MP)																			
MP.P3.3C1200	Zone 3E-4 (MP): Submit BA8/10 for Minipiles	28	09-Dec-17	13-Jan-18															
MP.P3.3C1210	Zone 3E-4 (MP): Minipiles (3V3R)	14	18-Jan-18	02-Feb-18															
Zone 3F																			

critical level of effort Critical Remaining Work
 Current
 Milestone Milestone
 % Complete

Project: Ocean Park Tai Shue Wan Water World Project
 Contract No. TSW-C006
 Project ID: T16004-87
 Layout: 3 Month look ahead IMPACTED OCT
 Page: 5 of 11

OCEAN PARK - TAI SHUE WAN DEVELOPMENT
Contract No. TSW-C006
3 month Rolling Construction program _NOV 2017



Date	Revision	Checked	Approved
01-Nov-17	Rev 0	PL LN ME	

ID	Activity	Duration	Start	Finish	October					November					December				
					5					6					7				
					02	09	16	23	30	06	13	20	27	04	11	18	25		
RCF.P3.3F.120	Zone 3F: Submit BA8/10 for Foundation Works	28	04-Jan-18	05-Feb-18															
RCF.P3.3F.100	Zone 3F: Rock Excavation for Footings	13	09-Dec-17	23-Dec-17															
RCF.P3.3F.110	Zone 3F: Founding report / BD Inspection of Bearing Stratum	6	27-Dec-17	03-Jan-18															
Zone 3G-1																			
RCF.P3.3G-1.120	Zone 3G-1: Submit BA8/10 for Foundation Works	28	06-Jan-18	07-Feb-18															
RCF.P3.3G-1.100	Zone 3G-1: Rock Excavation for Footings	0	29-Dec-17	29-Dec-17															
RCF.P3.3G-1.110	Zone 3G-1: Founding report / BD Inspection of Bearing Stratum	6	29-Dec-17	05-Jan-18															
Zone 3G-2																			
RCF.P3.3G-2.120	Zone 3G-2: Submit BA8/10 for Foundation Works	28	19-Dec-17	23-Jan-18															
RCF.P3.3G-2.100	Zone 3G-2: Rock Excavation for Footings	0	12-Dec-17	12-Dec-17															
RCF.P3.3G-2.110	Zone 3G-2: Founding report / BD Inspection of Bearing Stratum	6	12-Dec-17	18-Dec-17															
Zone 3G-3																			
RCF.P3.3G-3.120	Zone 3G-3: Submit BA8/10 for Foundation Works	28	22-Jan-18	26-Feb-18															
RCF.P3.3G-3.100	Zone 3G-3: Rock Excavation for Footings	0	15-Jan-18	15-Jan-18															
RCF.P3.3G-3.110	Zone 3G-3: Founding report / BD Inspection of Bearing Stratum	6	15-Jan-18	20-Jan-18															
Phase 3D																			
Footing																			
RC.P3.3D2130	BD Inspection of Bearing Stratum	6	29-Jan-18	03-Feb-18															
Phase 3F																			
Footing																			
RC.P3.3F2130	BD Inspection of Bearing Stratum	6	27-Jan-18	02-Feb-18															
Ride P4 - Aqua Drop Speed Slide																			
Zone 4 FOOTING																			
Zone 4 Footing																			
Zone 4B-3 (MP)-1																			
Piling Works																			
MP.P4.4A1170	Zone 4B-3: Piling Works: Submit BA8/10 for Minipiles	28	23-Nov-17	27-Dec-17															
MP.P4.4A1210	Piling Works: Post-Drilling	6	30-Jan-18	05-Feb-18															
MP.P4.4A1200	Piling Works: Minipiles (2V2R)	10	18-Jan-18	29-Jan-18															
MP.P4.4A1180	Piling Works: Preparation of Trial Pile	7	28-Dec-17	05-Jan-18															
MP.P4.4A1190	Piling Works: Trial Pile	7	06-Jan-18	13-Jan-18															
MP.P4.4A1270	Piling Works: Approval of Trial Pile	3	15-Jan-18	17-Jan-18															
Zone 4A																			
RCF.P4.4A.120	Zone 4A: Submit BA8/10 for Foundation Works	28	08-Jan-18	08-Feb-18															
RCF.P4.4A.100	Zone 4A: Rock Excavation for Footings	16	09-Dec-17	29-Dec-17															
RCF.P4.4A.110	Zone 4A: Founding report / BD Inspection of Bearing Stratum	6	30-Dec-17	06-Jan-18															
Zone 4B-1																			
RCF.P4.4B-1.120	Zone 4B-1: Submit BA8/10 for Foundation Works	28	16-Dec-17	20-Jan-18															
RCF.P4.4B-1.100	Zone 4B-1: Rock Excavation for Footings	6	02-Dec-17	08-Dec-17															
RCF.P4.4B-1.110	Zone 4B-1: Founding report / BD Inspection of Bearing Stratum	6	09-Dec-17	15-Dec-17															
Zone 4B-2																			
RCF.P4.4B-2.120	Zone 4B-2: Submit BA8/10 for Foundation Works	28	18-Dec-17	22-Jan-18															
RCF.P4.4B-2.100	Zone 4B-2: Rock Excavation for Footings	6	04-Dec-17	09-Dec-17															
RCF.P4.4B-2.110	Zone 4B-2: Founding report / BD Inspection of Bearing Stratum	6	11-Dec-17	16-Dec-17															
Zone 4C-2																			
RCF.P4.4C-2.120	Zone 4C-2: Submit BA8/10 for Foundation Works	28	27-Dec-17	29-Jan-18															
RCF.P4.4C-2.100	Zone 4C-2: Rock Excavation for Footings	6	11-Dec-17	16-Dec-17															
RCF.P4.4C-2.110	Zone 4C-2: Founding report / BD Inspection of Bearing Stratum	6	18-Dec-17	23-Dec-17															
Ride P5 - Family Boomerango																			
Zone 5 FOOTING																			
Zone 5 Footing																			
Zone 5A-1																			
RCF.P5.5A-1.120	Zone 5A-1: Submit BA8/10 for Foundation Works	28	20-Dec-17	24-Jan-18															
RCF.P5.5A-1.100	Zone 5A-1: Rock Excavation for Footings	0	13-Dec-17	13-Dec-17															
RCF.P5.5A-1.110	Zone 5A-1: Founding report / BD Inspection of Bearing Stratum	6	13-Dec-17	19-Dec-17															
Phase 5C																			
Footing																			
RC.P5.5C2120	Rock Excavation for Footings	28	16-Dec-17	20-Jan-18															
RC.P5.5C2130	BD Inspection of Bearing Stratum	6	22-Jan-18	27-Jan-18															
Phase 5B																			
Footing																			
RC.P5.5B2110	Submit BA8/10 for Foundation Works	28	17-Jan-18	21-Feb-18															
RC.P5.5B2120	Rock Excavation for Footings	30	17-Jan-18	23-Feb-18															
RISING MAIN (SEWERAGE)																			
Site Formation/Access/ Excavation																			
RM.SFHL.1110	Rising Main - Excavation from CH170-CH220	27	05-Jan-18	05-Feb-18															
Thrust Block, Pipe Trough & Slope Pipe																			
RM.PTHL.1010	Install Concrete Slope Pipe Supports 17no.	34	19-Jan-18	02-Mar-18															

■ critical level of effort ■ Critical Remaining Work
■ Current
◆ Milestone ▼ Milestone
 % Complete

Project: Ocean Park Tai Shue Wan Water
 World Project
 Contract No. TSW-C006
 Project ID: T16004-87
 Layout: 3 Month look ahead IMPACTED
 OCT
 Page: 6 of 11

OCEAN PARK - TAI SHUE WAN DEVELOPMENT
Contract No. TSW-C006
3 month Rolling Construction program _NOV 2017



Date	Revision	Checked	Approved
01-Nov-17	Rev 0	PL LN ME	

ID	Activity	Duration	Start	Finish	October					November					December				
					02	09	16	23	30	06	13	20	27	04	11	18	25		
SOUTH SERVICES BUILDING																			
Basement Level																			
Basement Level																			
SB.BLS.0120	BL: Underground Utilities	18	17-Nov-17	07-Dec-17											BL: Underground Utilities				
SB.BLS.130	BL: Raft Footings & Wall Kickers	17	31-Oct-17	16-Nov-17											BL: Raft Footings & Wall Kickers				
SB.BLS.180	BL: founding report	2	11-Aug-17	16-Nov-17											BL: founding report				
SB.BLS.200	BL: Instruction to Divert temporary sewerage utilities (RFI 427) and divert sewerage pipe	45	03-Aug-17	20-Nov-17											BL: Instruction to Divert temporary sewerage utilities (RFI 427) and divert sewerage				
SB.BLS.220	BL: Excavation to Footings	6	22-Sep-17	10-Nov-17											BL: Excavation to Footings				
SB.BLS.250	BL: Demolish existing structure in way of foundations (PMI)	7	31-Oct-17	08-Nov-17											BL: Demolish existing structure in way of foundations (PMI)				
SB.BLS.260	South Services Building: BL: Divert Utilities in way of structure (PMI)	7	31-Oct-17*	07-Nov-17											South Services Building: BL: Divert Utilities in way of structure (PMI)				
SB.BLS.190	South Services Building: BL: Ground bearing stratum report	7	16-Nov-17*	24-Nov-17											South Services Building: BL: Ground bearing stratum report				
SB.BLS.0230	BL: On-Grade Slab	8	08-Dec-17	16-Dec-17											BL: On-Grade Slab				
Level 1																			
Level 1																			
SB.L1S.1010	L1: Walls columns Slab at +12.95	20	17-Nov-17	09-Dec-17											L1: Walls columns Slab at +12.95				
SB.L1S.1020	L1: Walls columns Slab at +14.5	20	04-Dec-17	28-Dec-17											L1: Walls columns Slab at +14.5				
Earthworks																			
OP.260	Backfill to +15mPd	28	29-Dec-17	31-Jan-18															
PRIMARY RC STRUCTURE																			
Foundations																			
Zone 02 (Foundation Level 1) (GL 46-49/DD-FF)																			
SPL1S.1060	Zone 02: Strike Formwork & Backfill	10	12-Aug-17	02-Nov-17											Zone 02: Strike Formwork & Backfill				
Zone 06 Foundation Level 2 (GL 173-175/PP-MM)																			
SPL1S.1195	Zone 06: Strike Formwork & Backfill	4	03-Sep-17	02-Nov-17											Zone 06: Strike Formwork & Backfill				
SPL1S.1175	Zone 06: Excavations to Footings (3no) (on hold under EVA)	20	18-Aug-17	10-Nov-17											Zone 06: Excavations to Footings (3no) (on hold under EVA)				
SPL1S.1360	Zone 06: Footings (1no) (on hold under EVA)	6	13-Nov-17	18-Nov-17											Zone 06: Footings (1no) (on hold under EVA)				
Zone 01 (Foundation transformer room) (GL A-C/1-9)																			
Grid 1-5																			
SPL1S.13200	Zone 01-2: GL A-C/1-5: Footings	10	24-Aug-17	08-Dec-17											Zone 01-2: GL A-C/1-5: Footings				
SPL1S.13400	Zone 01-2: GL A-C/1-5: Backfill	4	27-Dec-17	02-Jan-18															
SPL1S.13600	Zone 01-2: GL A-C/1-5: On-Grade Slab +8.6mpd (20 bays)	12	10-Jan-18	24-Jan-18															
SPL1S.14000	Zone 01: GL A-C/1-5: Founding report	2	03-Nov-17	07-Nov-17											Zone 01: GL A-C/1-5: Founding report				
SPL1S.14100	Zone 01: GL A-C/1-5: Additional excavation 1m depth and soil replacment	11	24-Aug-17	02-Nov-17											Zone 01: GL A-C/1-5: Additional excavation 1m depth and soil replacment				
SPL1S.13210	Zone 01: GL A-C/1-5:UU Obstruction (RFI 589) awaiting PMI and divert UU	28	17-Aug-17	01-Dec-17											Zone 01: GL A-C/1-5:UU Obstruction (RFI 589) awaiting PM				
Grid 5-9																			
SPL1S.1220	Zone 01-1: GL A-C/5-9: Footings	14	19-Sep-17	07-Nov-17											Zone 01-1: GL A-C/5-9: Footings				
SPL1S.1240	Zone 01-1: GL A-C/5-9: Backfill	4	21-Dec-17	28-Dec-17															
SPL1S.1260	Zone 01-1: GL A-C/5-9: On-Grade Slab +8.6mpd (20 bays)	12	02-Jan-18	16-Jan-18															
Zone 03 (North Wall-Foundation Level 3) GL19-27																			
SPL1S.1105	Zone 03: GL 19-27: Excavation to footings (not deeper than 4.5m)	14	18-Sep-17	18-Nov-17											Zone 03: GL 19-27: Excavation to footings (not deeper than 4.5m)				
SPL1S.1115	Zone 03: GL 19-27: Strike Formwork & Backfill	8	06-Dec-17	14-Dec-17											Zone 03: GL 19-27: Strike Formw				
SPL1S.14110	Zone 03: GL 20-24: Footings	22	25-Oct-17	02-Nov-17											Zone 03: GL 20-24: Footings				
SPL1S.14120	Zone 03: GL 24-: Footings	14	20-Nov-17	05-Dec-17											Zone 03: GL 24-: Footings				
SPL1S.14130	Zone 03: GL 25-26: Footings	10	03-Nov-17	14-Nov-17											Zone 03: GL 25-26: Footings				
Level 1																			
Slab																			
On Grade Slab																			
OG.L1.1010	Construct on grade slab GL MM / 47-174	21	11-Dec-17	06-Jan-18															
OG.L1.1000	Install Underground Utilities	21	16-Nov-17	09-Dec-17											Install Underground Utilities				
Spiral slab																			
OG.L1.1020	Construct on grade slap - Spiral GL FF-JJ / 23-27	14	08-Nov-17	23-Nov-17											Construct on grade slap - Spiral GL FF-JJ / 23-27				
Zone A																			
Zone A1																			
SPL1A.1140	Zone A1: Falsework Dismantling (350)	12	16-Jan-18	29-Jan-18															
SPL1A.1690	Zone A1-1: Falsework Dismantling (350)	6	16-Jan-18	22-Jan-18															
SPL1A.1700	Zone A1-2: Falsework Dismantling (350)	6	23-Jan-18	29-Jan-18															
Zone A2																			
SPL1A.1790	Zone A2-2: L1 Slab	17	24-Aug-17	07-Nov-17											Zone A2-2: L1 Slab				
SPL1A.1240	Zone A2: Core 0	14	20-Sep-17	31-Oct-17											Zone A2: Core 0				
Zone A3																			
SPL1A.1340	Zone A3: Falsework Dismantling (350)	6	29-Jan-18	05-Feb-18															
Zone A5																			
SPL1A.2010	Zone A5-2: L1 Slab	10	13-Oct-17	11-Nov-17											Zone A5-2: L1 Slab				
Zone B																			
Zone B2																			
SPL1B.1580	Zone B2-1: L1 Slab (On hold MJ)	17	07-Sep-17	11-Nov-17											Zone B2-1: L1 Slab (On hold MJ)				

■ critical level of effort ■ Critical Remaining Work
■ Current
◆ Milestone ◆ Milestone
■ % Complete

Project: Ocean Park Tai Shue Wan Water World Project
 Project ID: T16004-87
 Layout: 3 Month look ahead IMPACTED OCT
 Page: 7 of 11

OCEAN PARK - TAI SHUE WAN DEVELOPMENT
Contract No. TSW-C006
3 month Rolling Construction program _NOV 2017



Date	Revision	Checked	Approved
01-Nov-17	Rev 0	PL LN ME	

ID	Activity	Duration	Start	Finish	October					November					December					
					5					6					7					
					02	09	16	23	30	06	13	20	27	04	11	18	25			
Zone B4																				
SPL1B.15110	Zone B4-1b: L1 Slab	12	25-Oct-17	11-Nov-17																
Zone B5																				
SPL1B.1530	Zone B5: Strike & Falsework Dismantling	9	28-Nov-17	07-Dec-17																
SPL1B.1540	Zone B5: Falsework Dismantling (350)	6	15-Jan-18	20-Jan-18																
SPL1B.1880	Zone B5-1: L1 Slab	17	31-Oct-17	18-Nov-17																
SPL1B.1920	Zone B5-2: L1 Slab	18	07-Nov-17	27-Nov-17																
SPL1B.1940	Zone B5-3: L1 Slab	14	31-Oct-17	15-Nov-17																
SPL1B.1890	Zone B5-2: L1 Slab	17	31-Oct-17	18-Nov-17																
Level 2																				
On Grade Slab																				
SPL2S.2010	GL 172-KK: On-grade Slab	9	31-Oct-17	09-Nov-17																
Zone A																				
Zone A1																				
SPL2A.2110	Zone A1: L1-L2 Columns	6	02-Sep-17	06-Nov-17																
SPL2A.2120	Zone A1: L2 Slab	30	16-Oct-17	04-Dec-17																
SPL2A.2130	Zone A1: Strike & Falsework Dismantling	8	15-Dec-17	23-Dec-17																
Zone A2																				
SPL2A.2230	Zone A2: Strike & Falsework Dismantling	8	09-Dec-17	18-Dec-17																
SPL2A.2210	Zone A2: L1-L2 Columns	6	29-Aug-17	06-Nov-17																
SPL2A.2220	Zone A2: L2 Slab	25	16-Oct-17	28-Nov-17																
Zone A3																				
SPL2A.2310	Zone A3: L1-L2 Columns	7	04-Sep-17	07-Nov-17																
SPL2A.2320	Zone A3: L2 Slab	28	31-Oct-17	01-Dec-17																
SPL2A.2330	Zone A3: Strike & Falsework Dismantling	8	13-Dec-17	21-Dec-17																
Zone A4																				
SPL2A.2410	Zone A4: L1-L2 Columns	6	19-Oct-17	06-Nov-17																
Zone A5																				
SPL2A.2520	Zone A5: L2 Slab	25	04-Oct-17	11-Nov-17																
SPL2A.2530	Zone A5: Strike & Falsework Dismantling	8	23-Nov-17	01-Dec-17																
Zone A6																				
SPL2A.2640	Zone A6-2: L2 Slab	18	11-Sep-17	31-Oct-17																
Zone A7, Lobby Ramp																				
SPL2A.2710	Zone A7: L1-L2 Columns	4	20-Sep-17	03-Nov-17																
SPL2A.2730	Zone A7: L2 Slab	20	04-Nov-17	27-Nov-17																
SPL2A.2740	Zone A7: Strike & Falsework Dismantling	7	28-Dec-17	05-Jan-18																
SPL2A.2720	Zone A7: Lobby Ramp	23	17-Nov-17	13-Dec-17																
Zone A8, Lobby Ramp																				
SPL2A.2810	Zone A8: L1-L2 Columns	5	17-Nov-17	22-Nov-17																
SPL2A.2830	Zone A8: L2 Slab	21	23-Nov-17	16-Dec-17																
SPL2A.2820	Zone A8: Lobby Ramp	24	04-Nov-17	01-Dec-17																
SPL2A.2840	Zone A8: Strike & Falsework Dismantling	8	30-Dec-17	09-Jan-18																
Zone A9																				
SPL2A.2910	Zone A9: L1-L2 Columns	5	15-Dec-17	21-Dec-17																
SPL2A.2920	Zone A9: L2 Slab	23	19-Dec-17	18-Jan-18																
SPL2A.2930	Zone A9: Strike & Falsework Dismantling	9	29-Jan-18	08-Feb-18																
Zone A10																				
SPL2A.2940	Zone A10: L1-L2 Columns	6	21-Dec-17	30-Dec-17																
SPL2A.2950	Zone A10: L2 Slab	23	29-Dec-17	26-Jan-18																
Zone A11 (Ramp)																				
SPL2A.2970	Zone A11: L1-L2 Columns	9	28-Nov-17	07-Dec-17																
SPL2A.2980	Zone A11a & A11b: L2 Slab	25	04-Dec-17	04-Jan-18																
SPL2A.2990	Zone A11: Strike & Falsework Dismantling	9	16-Jan-18	25-Jan-18																
SPL2A.2975	Zone A11: Ramp	31	04-Dec-17	11-Jan-18																
Zone A12																				
SPL2A.3000	Zone A12: L1-L2 Columns	4	29-Dec-17	04-Jan-18																
SPL2A.3010	Zone A12: L2 Slab	24	03-Jan-18	31-Jan-18																
Zone A13																				
SPL2A.3030	Zone A13: L1-L2 Columns	5	04-Jan-18	10-Jan-18																
SPL2A.3040	Zone A13: L2 Slab	24	09-Jan-18	06-Feb-18																
Zone A16																				
SPL2A.3060	Zone A16: L1-L2 Columns	4	08-Jan-18	12-Jan-18																
SPL2A.3070	Zone A16: L2 Slab	24	12-Jan-18	09-Feb-18																
Zone A17																				
SPL2A.3090	Zone A17: L1-L2 Columns	4	11-Jan-18	16-Jan-18																
SPL2A.3100	Zone A17: L2 Slab	28	15-Jan-18	20-Feb-18																
Zone A18																				
SPL2A.3120	Zone A18: L1-L2 Columns	4	15-Jan-18	19-Jan-18																

■ critical level of effort ■ Critical Remaining Work
■ Current
◆ Milestone ▼ Milestone
 % Complete

Project: Ocean Park Tai Shue Wan Water World Project
 Project ID: T16004-87
 Layout: 3 Month look ahead IMPACTED OCT
 Page: 8 of 11

OCEAN PARK - TAI SHUE WAN DEVELOPMENT
Contract No. TSW-C006
3 month Rolling Construction program _NOV 2017



Date	Revision	Checked	Approved
01-Nov-17	Rev 0	PL LN ME	

ID	Activity	Duration	Start	Finish	October					November					December						
					5					6					7						
					02	09	16	23	30	06	13	20	27	04	11	18	25				
SPL2A.3130	Zone A18: L2 Slab	28	19-Jan-18	24-Feb-18																	
Zone A19 , (Including Bridge)																					
SPL2A.3150	Zone A19: L1-L2 Columns	1	18-Jan-18	19-Jan-18																	
SPL2A.3160	Zone A19: L2 Slab	30	19-Jan-18	27-Feb-18																	
Zone A14 (North Plant Below)																					
SPL2A.3180	Zone A14: L1-L2 Columns	5	15-Dec-17	21-Dec-17																	Zone A14: L1-L2 Co
Zone A15 (North Plant Room)																					
SPL2A.3210	Zone A15: L1-L2 Columns	8	15-Dec-17	27-Dec-17																	Zone A
SPL1S.1040	Columns & Slab +14.5mPD	27	24-Jan-18	28-Feb-18																	
Zone A - Spiral Ramp																					
SPL2A.3240	Zone A: Spiral Ramp - L2	26	24-Nov-17	23-Dec-17																	Zone A: Spiral R
Zone B																					
Zone B3																					
SPL2B.2330	Zone B3: Strike & Falsework Dismantling	7	14-Dec-17	21-Dec-17																	Zone B3: Strike & F
Zone B4																					
SPL2B.2420	Zone B4: L2 Slab	37	18-Oct-17	12-Dec-17																	Zone B4: L2 Slab
SPL2B.2430	Zone B4: Strike & Falsework Dismantling	8	23-Dec-17	04-Jan-18																	
Zone B5																					
SPL2B.2530	Zone B5: Strike & Falsework Dismantling	8	07-Nov-17	15-Nov-17																	Zone B5: Strike & Falsework Dismantling
Zone B6																					
SPL2B.2620	Zone B6: L2 Slab	28	06-Nov-17	07-Dec-17																	Zone B6: L2 Slab
SPL2B.2630	Zone B6: Strike & Falsework Dismantling	7	19-Dec-17	28-Dec-17																	Zone
Zone B7																					
SPL2B.2720	Zone B7: L2 Slab	28	23-Sep-17	06-Nov-17																	Zone B7: L2 Slab
Zone B9																					
SPL2B.2910	Zone B9: L1-L2 Columns	7	05-Sep-17	14-Nov-17																	Zone B9: L1-L2 Columns
SPL2B.2920	Zone B9: L2 Slab	24	13-Nov-17	09-Dec-17																	Zone B9: L2 Slab
Zone B10																					
SPL2B.3010	Zone B10: L1-L2 Columns	7	26-Aug-17	10-Nov-17																	Zone B10: L1-L2 Columns
SPL2B.3020	Zone B10: L2 Slab	24	20-Sep-17	14-Nov-17																	Zone B10: L2 Slab
Zone B1																					
SPL2B.2110	Zone B1: L1-L2 Columns	7	01-Dec-17	08-Dec-17																	Zone B1: L1-L2 Columns
SPL2B.2120	Zone B1: L2 Slab	20	07-Dec-17	02-Jan-18																	
SPL2B.2130	Zone B1: Strike & Falsework Dismantling	9	11-Jan-18	20-Jan-18																	
Zone B2																					
SPL2B.3210	Zone B2: L1-L2 Columns	7	02-Dec-17	09-Dec-17																	Zone B2: L1-L2 Columns
SPL2B.3220	Zone B2: L2 Slab	19	08-Dec-17	02-Jan-18																	
SPL2B.3230	Zone B2: Strike & Falsework Dismantling	9	13-Jan-18	23-Jan-18																	
Level 3																					
Zone A																					
Zone A1																					
SPL3A.3110	Zone A1: L2-L3 Columns	6	05-Sep-17	16-Nov-17																	Zone A1: L2-L3 Columns
SPL3A.3120	Zone A1: L3 Slab	28	17-Nov-17	19-Dec-17																	Zone A1: L3 Slab
SPL3A.3130	Zone A1: Strike & Falsework Dismantling	8	04-Jan-18	12-Jan-18																	
Zone A2																					
SPL3A.3210	Zone A2: L2-L3 Columns	8	06-Dec-17	14-Dec-17																	Zone A2: L2-L3 Columns
SPL3A.3220	Zone A2: L3 Slab	26	12-Dec-17	13-Jan-18																	
SPL3A.3230	Zone A2: Strike & Falsework Dismantling	9	26-Jan-18	05-Feb-18																	
Zone A3																					
SPL3A.3310	Zone A3: L2-L3 Columns	5	06-Dec-17	11-Dec-17																	Zone A3: L2-L3 Columns
SPL3A.3320	Zone A3: L3 Slab	23	12-Dec-17	10-Jan-18																	
SPL3A.3330	Zone A3: Strike & Falsework Dismantling	9	23-Jan-18	01-Feb-18																	
Zone A5																					
SPL3A.3510	Zone A5: L2-L3 Columns	6	20-Oct-17	06-Nov-17																	Zone A5: L2-L3 Columns
SPL3A.3520	Zone A5: L3 Slab	38	04-Nov-17	18-Dec-17																	Zone A5: L3 Slab
SPL3A.3530	Zone A5: Strike & Falsework Dismantling	8	04-Jan-18	12-Jan-18																	
Zone A6																					
SPL3A.3610	Zone A6: L2-L3 Columns	7	05-Jan-18	12-Jan-18																	
SPL3A.3630	Zone A6: L3 Slab	26	11-Jan-18	09-Feb-18																	
SPL3A.3620	Zone A6: Ramp	26	09-Jan-18	07-Feb-18																	
Zone A7																					
SPL3A.3710	Zone A7: L2-L3 Columns	8	20-Oct-17	22-Nov-17																	Zone A7: L2-L3 Columns
SPL3A.3720	Zone A7: L3 Slab	25	20-Nov-17	18-Dec-17																	Zone A7: L3 Slab
SPL3A.3730	Zone A7: Strike & Falsework Dismantling	8	21-Dec-17	02-Jan-18																	
Zone B																					
Zone B1																					
SPL3B.3110	Zone B1: L2-L3 Columns	7	15-Dec-17	22-Dec-17																	Zone B1: L2-L3 C

critical level of effort Critical Remaining Work
 Current
 Milestone Milestone
 % Complete

Project: Ocean Park Tai Shue Wan Water World Project
 Project ID: T16004-87
 Layout: 3 Month look ahead IMPACTED OCT
 Page: 9 of 11

OCEAN PARK - TAI SHUE WAN DEVELOPMENT
Contract No. TSW-C006
3 month Rolling Construction program _NOV 2017



Date	Revision	Checked	Approved
01-Nov-17	Rev 0	PL LN ME	

ID	Activity	Duration	Start	Finish	October					November					December				
					5					6					7				
					02	09	16	23	30	06	13	20	27	04	11	18	25		
SPL3B.3120	Zone B1: L3 Slab	28	21-Dec-17	25-Jan-18															
Zone B2																			
SPL3B.3210	Zone B2: L2-L3 Columns	7	23-Dec-17	03-Jan-18															
SPL3B.3220	Zone B2: L3 Slab	27	02-Jan-18	01-Feb-18															
Zone B spiral ramp																			
SPL2A.3250	Zone A: Spiral Ramp - L3	26	27-Dec-17	26-Jan-18															
Zone B3, Bridge																			
SPL3B.3310	Zone B3: L2-L3 Columns	7	03-Jan-18	10-Jan-18															
Platform Level																			
Zone PL																			
SPL4S.4010	Zone: Inclined Column S4	13	21-Dec-17	08-Jan-18															
Roof Level																			
Slab																			
Roof A																			
Zone R-A1																			
SPRLA.5110	Zone R-A1: L3-RL Inclined Column S4 (1st lift)	13	22-Dec-17	09-Jan-18															
SPRLA.5115	Zone R-A1: L3-RL Inclined Column S4 (2nd lift)	9	10-Jan-18	19-Jan-18															
Zone R-A3																			
SPRLA.5305	Zone R-A3: L3-RL Inclined Column R15	11	22-Dec-17	06-Jan-18															
Zone R-A4																			
SPRLA.5410	Zone R-A4: L3-RL Inclined Column S6	12	19-Dec-17	04-Jan-18															
Zone R-A5																			
SPRLA.5510	Zone R-A5: L3-RL Inclined Column S5	12	28-Dec-17	11-Jan-18															
Roof B																			
Zone R-B1																			
SPRLB.5110	Zone R-B1: L3-RL Inclined Column S11	12	17-Jan-18	30-Jan-18															
SPRLB.5115	Zone R-B1: L3-RL Inclined Column S12	12	17-Jan-18	30-Jan-18															
Zone R-B2																			
SPRLB.5210	Zone R-B2: L3-RL Inclined Column S10	12	18-Jan-18	31-Jan-18															
Zone R-B3																			
SPRLB.5310	Zone R-B3: L3-RL Inclined Column S20	13	20-Jan-18	03-Feb-18															
Zone R-B5																			
SPRLB.5520	Zone R-B5: Strike Formwork (S13)	0	20-Dec-17	20-Dec-17															
SPRLB.5510	Zone R-B5: L2-RL Inclined Columns S13 (1st lift)	12	11-Nov-17	24-Nov-17															
SPRLB.5530	Zone R-B5: RL Slab	30	05-Dec-17	11-Jan-18															
SPRLB.5515	Zone R-B5: L2-RL Inclined Columns S13 (2nd lift)	8	25-Nov-17	04-Dec-17															
Zone R-B7																			
SPRLB.5710	Zone R-B7: L3-RL Inclined Columns S17	13	10-Nov-17	24-Nov-17															
Zone R-B8																			
SPRLB.5810	Zone R-B8: L3-RL Inclined Columns S18	12	27-Jan-18	09-Feb-18															
Roof C																			
Zone R-C																			
SPRLC.5130	Zone RC: Columns (12no)	28	12-Jan-18	13-Feb-18															
SECONDARY RC STRUCTURE (M & E Zone)																			
Basement Level																			
Secondary structures																			
SPBLS.1740	Secondary BL structures	75	29-Dec-17	03-Apr-18															
Level 2																			
Zone A																			
Zone A5																			
SSL2A.2510	Zone-A5: L2 Secondary Slab	28	15-Jan-18	15-Feb-18															
Zone A7																			
SSL2A.2710	Zone-A7: L2 Secondary Slab	28	03-Jan-18	03-Feb-18															
Zone B																			
Zone B2																			
SSL2B.2210	Zone-B2: L2 Secondary Slab (Wave Pool)	22	08-Dec-17	05-Jan-18															
SSL2B.2220	Zone-B2: Strike Formwork & Dismantling	5	17-Jan-18	22-Jan-18															
Zone B3																			
SSL2B.2320	Zone-B3: Strike Formwork & Dismantling	5	22-Dec-17	29-Dec-17															
Zone B4																			
SSL2B.2410	Zone-B4: L2 Secondary Slab (Landscape)	25	03-Jan-18	31-Jan-18															
Zone B5																			
SSL2B.2510	Zone-B4: L2 Secondary Slab (above Chinese Resto)	15	03-Jan-18	19-Jan-18															
Pool Unit																			
Level 2																			
Pool A - Outdoor Wave Pool																			

- critical level of effort
- Critical Remaining Work
- Current
- Milestone
- Milestone
- % Complete

Project: Ocean Park Tai Shue Wan Water
World Project
Project ID: T16004-87
Layout: 3 Month look ahead IMPACTED
OCT
Page: 10 of 11

OCEAN PARK - TAI SHUE WAN DEVELOPMENT
Contract No. TSW-C006
3 month Rolling Construction program _NOV 2017



Date	Revision	Checked	Approved
01-Nov-17	Rev 0	PL LN ME	

ID	Activity	Duration	Start	Finish	October					November					December				
					5					6					7				
					02	09	16	23	30	06	13	20	27	04	11	18	25		
SS.PUPA.1110	Pool A: Construct Slab Outdoor Wave Pool	35	23-Jan-18	07-Mar-18															
ABWF WORKS																			
Binnacles																			
BIN.GDP.1000	Binnacles Shop drawing Submission	90	26-Jan-18	19-May-18															
Blockwork																			
Basement Level																			
AB.BWBL.0110	BL Zone-B1-1: Install Blockwork	18	16-Jan-18	05-Feb-18															
AB.BWBL.0120	BL Zone-B1-2: Install Blockwork	12	09-Jan-18	22-Jan-18															
AB.BWBL.0130	BL Zone-B1-3: Install Blockwork	12	16-Jan-18	29-Jan-18															
AB.BWBL.0150	BL Zone-B1-5: Install Blockwork	10	29-Jan-18	08-Feb-18															
AB.BWBL.0170	BL Zone-B1-7: Install Blockwork	10	16-Jan-18	26-Jan-18															
Level 1																			
Zone A																			
AB.BWL1.1110	L1 Zone-A1: Install Blockwork	18	26-Jan-18	15-Feb-18															
Zone B																			
AB.BWL1.1550	L1 Zone-B5: Install Blockwork	10	24-Jan-18	03-Feb-18															
AB.BWL1.1540	L1 Zone-B4: Install Blockwork	14	24-Jan-18	08-Feb-18															
AB.BWL1.1520	L1 Zone-B2: Install Blockwork	7	06-Dec-17	13-Dec-17															
AB.BWL1.1530	L1 Zone-B3: Install Blockwork	21	08-Jan-18	31-Jan-18															
Lift Works																			
Lift No.3																			
AB.LW3.3105	Complete Lift 3 - Core Shell	0		10-Nov-17															
Lift No.1																			
AB.LW1.1105	Complete Lift 1 - Core Shell	0		02-Jan-18															
ABWF Works to Enable E&M Access																			
Basement Level																			
AB.EABL.0135	BL Zone SSB: ABWF to enable E&M access - Fan & MCC Rm (050)	18	29-Dec-17	19-Jan-18															
Level 1																			
AB.EAL1.1120	L1 SSB: ABWF to enable E&M access - Cooling Tower	24	29-Dec-17	26-Jan-18															
E&M WORKS																			
New Water Park																			
Level 2																			
Pool A - Outdoor Wave Pool																			
EM.IN023060	Pool A Lighting Installation - 1st fix	65	23-Jan-18	16-Apr-18															
Statutory Submission, Inspection & Approval																			
Obtain Occupation Permit																			
EM.SS010010	CT1A available	0		27-Dec-17															
EM.SS010011	Submit CT1B with CT4	0		27-Dec-17															

- critical level of effort
- Current
- Milestone
- Milestone
- % Complete


Project: Ocean Park Tai Shue Wan Water World Project
Project ID: T16004-87
Layout: 3 Month look ahead IMPACTED
OCT
Page: 11 of 11

OCEAN PARK - TAI SHUE WAN DEVELOPMENT
Contract No. TSW-C006
3 month Rolling Construction program _NOV 2017



Date	Revision	Checked	Approved
01-Nov-17	Rev 0	PL LN ME	

D. Designated Monitoring Locations as Recommended in the Approved EM&A Manual

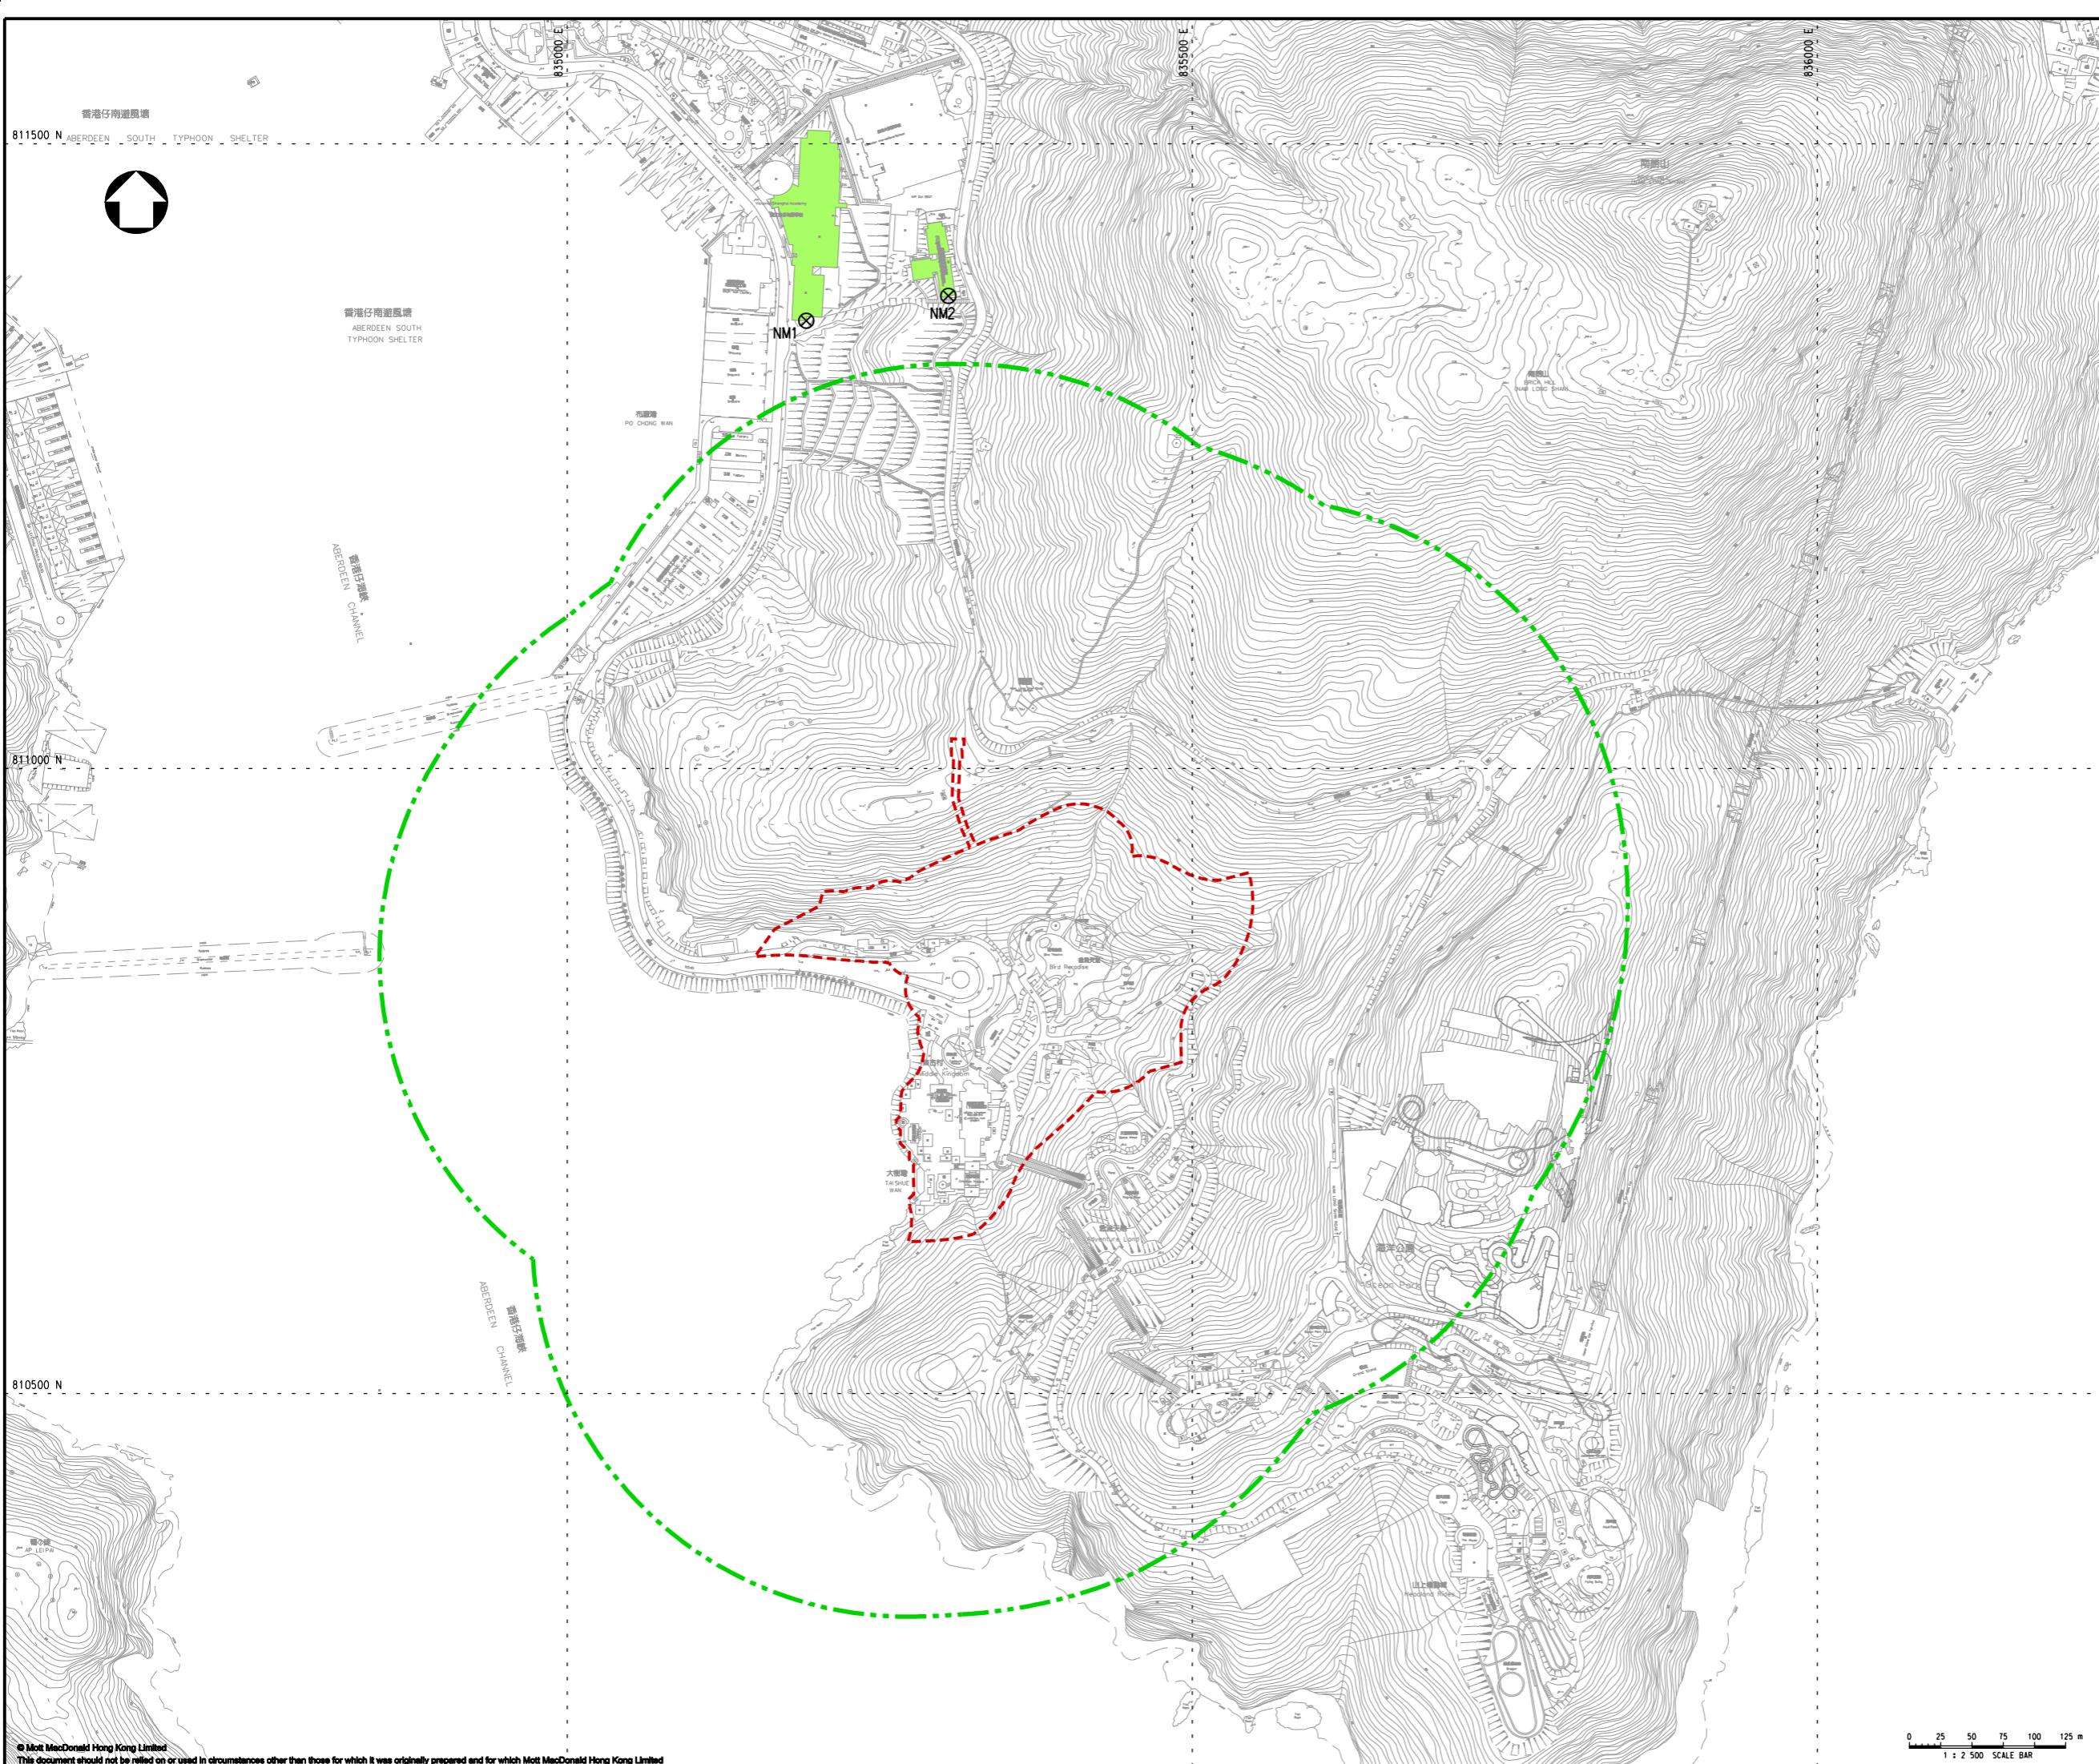


Notes

Key to symbols

- - - 300m ASSESSMENT AREA
- - - PROJECT BOUNDARY
- ⊗ CONSTRUCTION NOISE MONITORING STATION

Reference drawings

Rev	Date	Drawn	Description	Ch'k'd	App'd
P2	MAR 14	MING	GENERAL REVISION	AM	AFK
P1	FEB 14	MING	FIRST ISSUE	AM	AFK



20/F Two Landmark East
100 How Ming Street
Kowloon, Kowloon
Hong Kong
T +852 2828 5757
F +852 2827 1823
W www.mottmac.com.hk

Client




Project
**TAI SHUE WAN DEVELOPMENT
AT OCEAN PARK**


Title
**DESIGNATED MONITORING
LOCATIONS AS RECOMMENDED
IN THE APPROVED EM&A
MANUAL**

Designed	AM	Eng check	FW
Drawn	MING	Coordination	FW
Dwg check	AM	Approved	AFK
Scale at A1	1:2500	Status	PRE
Rev			P2

Drawing Number
FIGURE 3.1



E. Actual Locations of Impact Monitoring

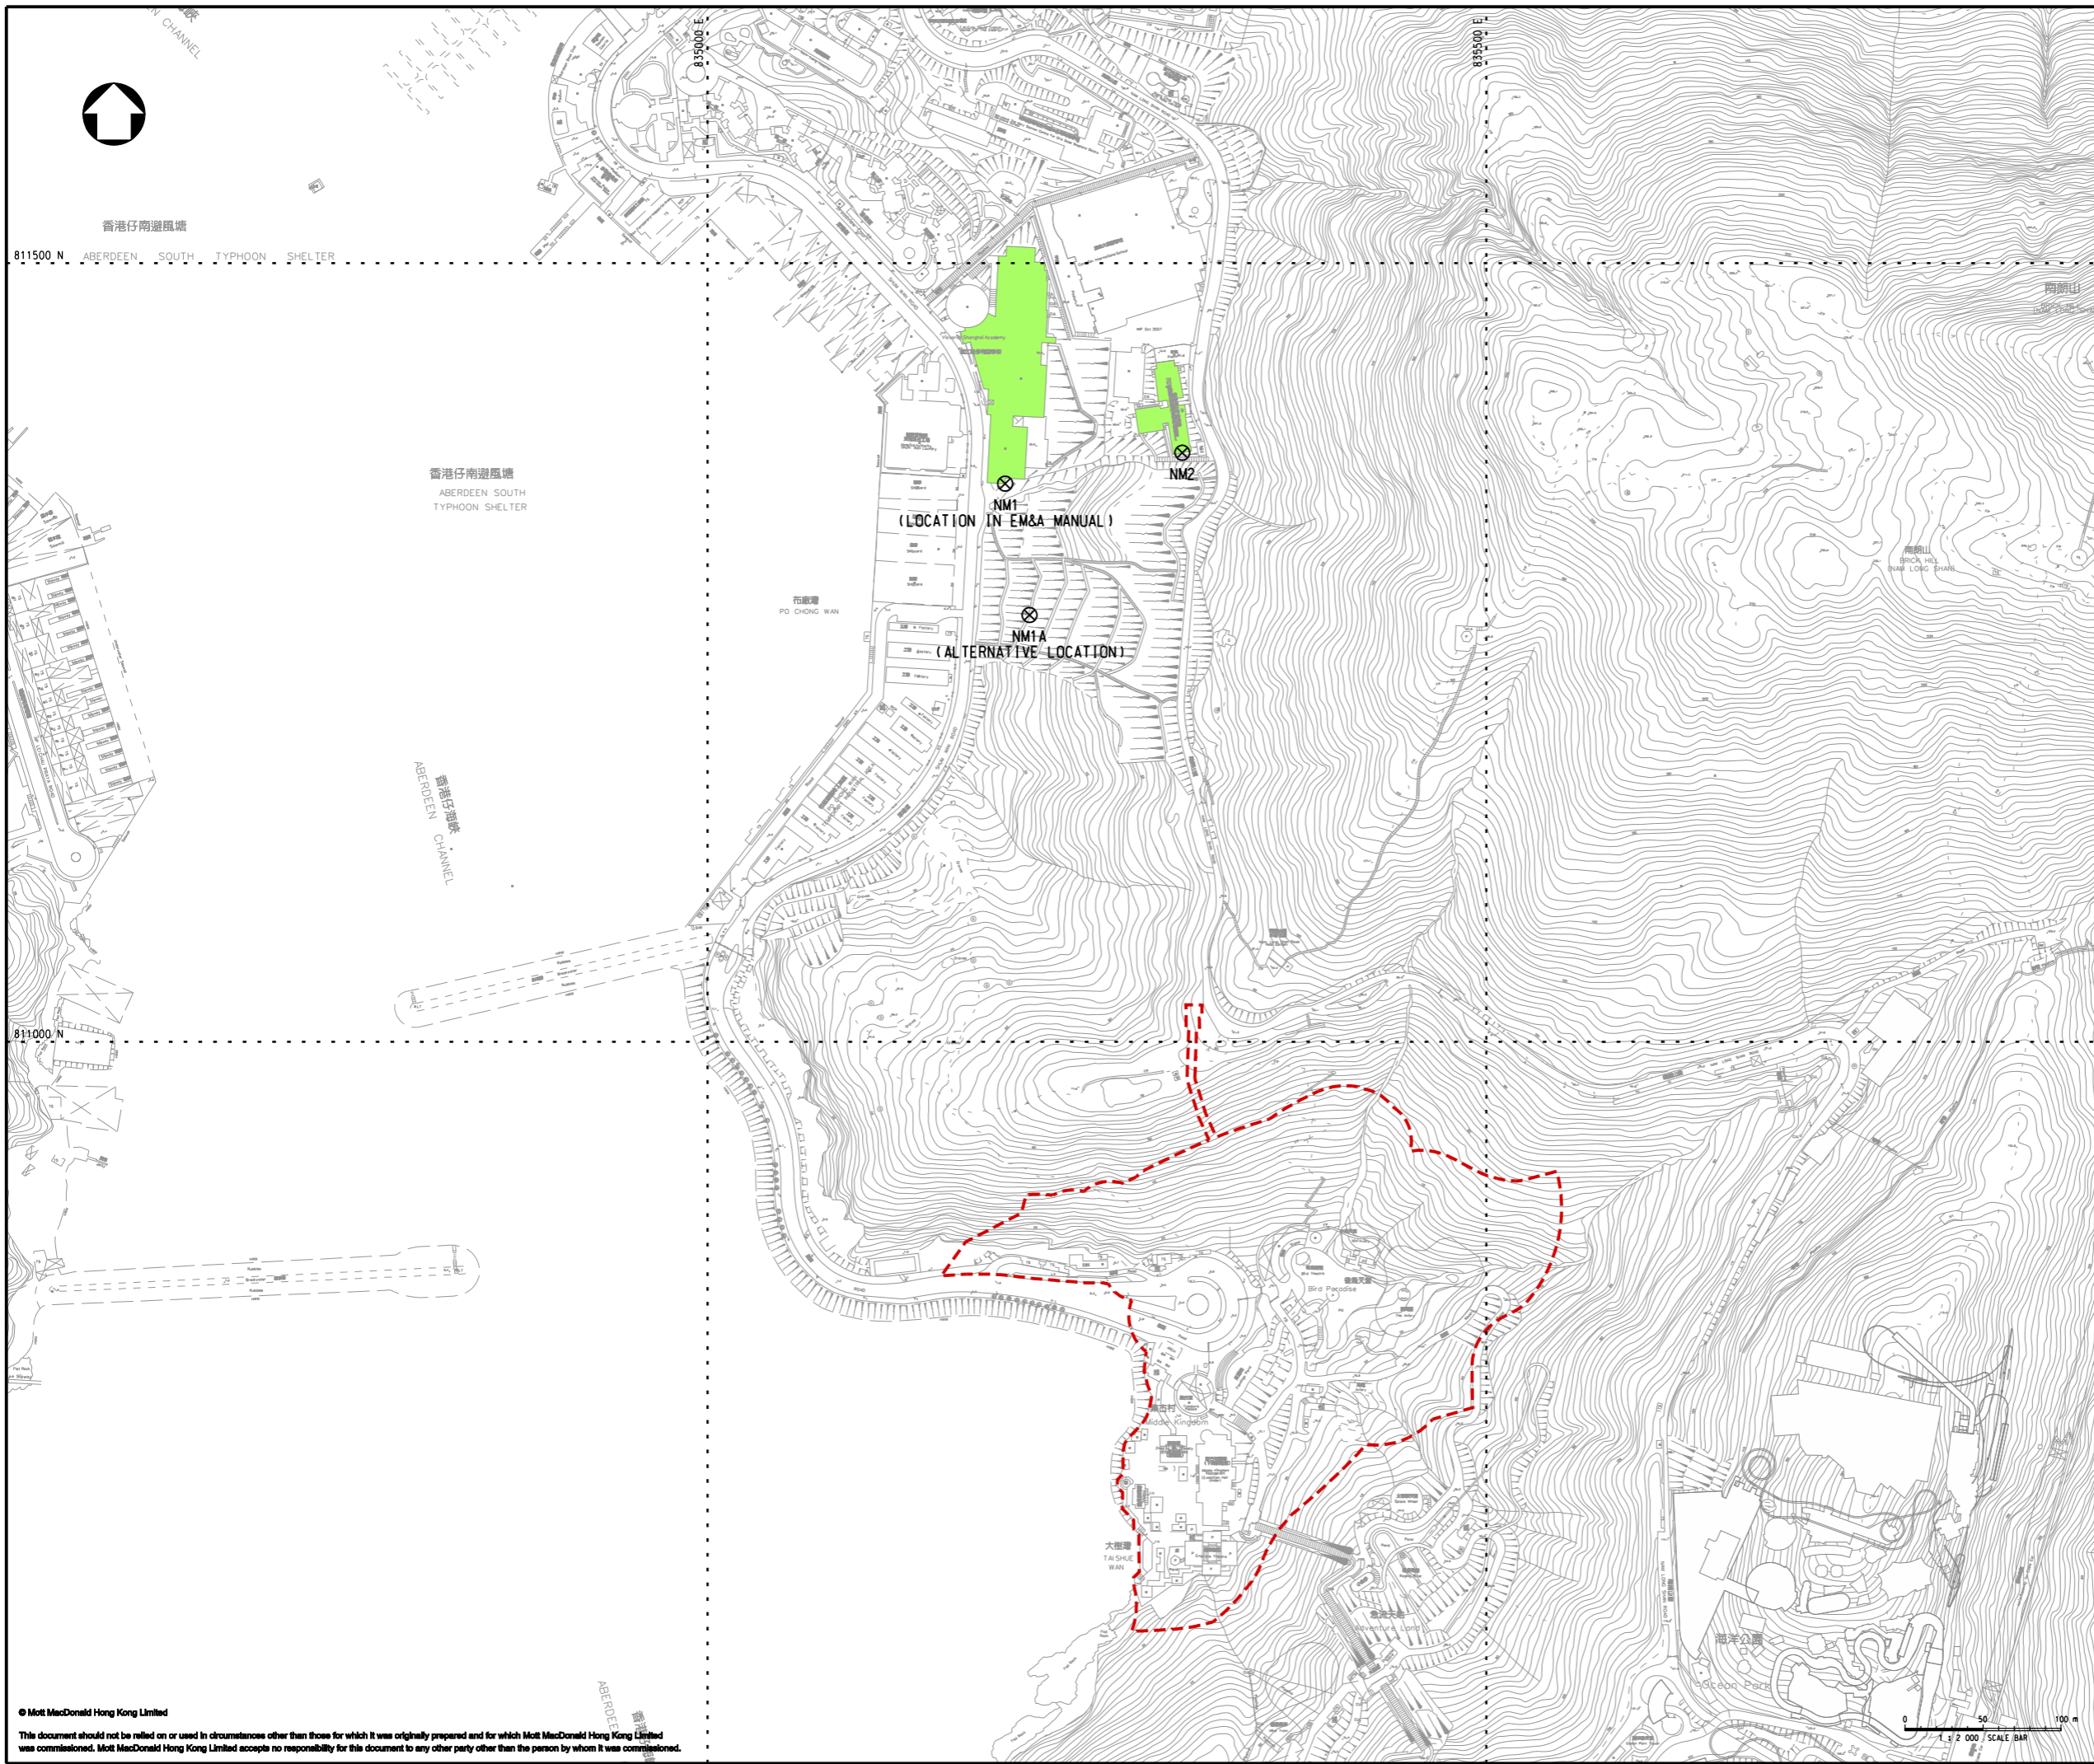

Notes

Key to symbols

--- PROJECT BOUNDARY

⊗ CONSTRUCTION NOISE MONITORING STATION

Reference drawings

Rev	Date	Drawn	Description	Ch'k'd	App'd
P1	NOV 14	MING	FIRST ISSUE	BW	AFK

Mott MacDonald

20/F AIA Kowloon Tower
Landmark East
100 How Ming Street
Kwun Tong, Kowloon
Hong Kong
☎ +852 2828 5757
☎ +852 2827 1823
www.mottmac.com.hk

Client

Project

**TAI SHUE WAN DEVELOPMENT
AT OCEAN PARK**

Title

**ACTUAL LOCATIONS OF IMPACT
MONITORING**

Designed	BW	Eng check	FW
Drawn	MING	Coordination	FW
Dwg check	BW	Approved	AFK
Scale at A1	1:2000	Status	PRE
Drawing Number	FIGURE 2.1		Rev P1

F. Calibration Certificates



輝創工程有限公司

Sun Creation Engineering Limited

Calibration and Testing Laboratory

Certificate of Calibration

校正證書

Certificate No. : C171427

證書編號

ITEM TESTED / 送檢項目 (Job No. / 序引編號 : IC17-0555)

Date of Receipt / 收件日期 : 9 March 2017

Description / 儀器名稱 : Sound Level Meter

Manufacturer / 製造商 : Rion

Model No. / 型號 : NL-52

Serial No. / 編號 : 00643040

Supplied By / 委託者 : Envirotech Services Co.

Room 113, 1/F, My Loft, 9 Hoi Wing Road, Tuen Mun,
New Territories, Hong Kong

TEST CONDITIONS / 測試條件

Temperature / 溫度 : (23 ± 2)°C

Relative Humidity / 相對濕度 : (55 ± 20)%

Line Voltage / 電壓 : ---

TEST SPECIFICATIONS / 測試規範

Calibration

DATE OF TEST / 測試日期 : 16 March 2017

TEST RESULTS / 測試結果

The results apply to the particular unit-under-test only.

The results do not exceed manufacturer's specification.

The results are detailed in the subsequent page(s).

The test equipment used for calibration are traceable to National Standards via :

- The Government of The Hong Kong Special Administrative Region Standard & Calibration Laboratory
- Agilent Technologies / Keysight Technologies
- Rohde & Schwarz Laboratory, Germany
- Fluke Everett Service Center, USA

Tested By

測試

H T Wong

Technical Officer

Certified By

核證

K C Lee

Project Engineer

Date of Issue

簽發日期

20 March 2017

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書面批准。

Sun Creation Engineering Limited – Calibration & Testing Laboratory

c/o 4/F, Tsing Shan Wan Exchange Building, 1 Hing On Lane, Tuen Mun, New Territories, Hong Kong

輝創工程有限公司 – 校正及檢測實驗室

c/o 香港新界屯門興安里一號青山灣機樓四樓

Tel/電話: 2927 2606 Fax/傳真: 2744 8986

E-mail/電郵: callab@suncreation.com

Website/網址: www.suncreation.com

Certificate of Calibration

校正證書

Certificate No. : C171427
證書編號

- The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 12 hours, and switched on to warm up for over 10 minutes before the commencement of the test.
- Self-calibration using the internal standard (After Adjustment) was performed before the test 6.1.1.2 to 6.3.2.
- The results presented are the mean of 3 measurements at each calibration point.
- Test equipment :

Equipment ID	Description	Certificate No.
CL280	40 MHz Arbitrary Waveform Generator	C170048
CL281	Multifunction Acoustic Calibrator	PA160023

- Test procedure : MA101N.

- Results :

6.1 Sound Pressure Level

6.1.1 Reference Sound Pressure Level

6.1.1.1 Before Adjustment

UUT Setting				Applied Value		UUT Reading (dB)	IEC 61672 Class 1 Spec. (dB)
Range (dB)	Function	Frequency Weighting	Time Weighting	Level (dB)	Freq. (kHz)		
30 - 130	L _A	A	Fast	94.00	1	94.9	± 1.1

6.1.1.2 After Adjustment

UUT Setting				Applied Value		UUT Reading (dB)	IEC 61672 Class 1 Spec. (dB)
Range (dB)	Function	Frequency Weighting	Time Weighting	Level (dB)	Freq. (kHz)		
30 - 130	L _A	A	Fast	94.00	1	94.0	± 1.1

6.1.2 Linearity

UUT Setting				Applied Value		UUT Reading (dB)
Range (dB)	Function	Frequency Weighting	Time Weighting	Level (dB)	Freq. (kHz)	
30 - 130	L _A	A	Fast	94.00	1	94.0 (Ref.)
				104.00		104.1
				114.00		114.0

IEC 61672 Class 1 Spec. : ± 0.6 dB per 10 dB step and ± 1.1 dB for overall different.

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗室書面批准。

Certificate of Calibration

校正證書

Certificate No. : C171427
證書編號

6.2 Time Weighting

UUT Setting				Applied Value		UUT Reading (dB)	IEC 61672 Class 1 Spec. (dB)
Range (dB)	Function	Frequency Weighting	Time Weighting	Level (dB)	Freq. (kHz)		
30 - 130	L _A	A	Fast	94.00	1	94.0	Ref.
			Slow			94.0	± 0.3

6.3 Frequency Weighting

6.3.1 A-Weighting

UUT Setting				Applied Value		UUT Reading (dB)	IEC 61672 Class 1 Spec. (dB)
Range (dB)	Function	Frequency Weighting	Time Weighting	Level (dB)	Freq.		
30 - 130	L _A	A	Fast	94.00	63 Hz	67.8	-26.2 ± 1.5
					125 Hz	95.2	-16.1 ± 1.5
					250 Hz	85.3	-8.6 ± 1.4
					500 Hz	90.7	-3.2 ± 1.4
					1 kHz	94.0	Ref.
					2 kHz	95.2	+1.2 ± 1.6
					4 kHz	95.0	+1.0 ± 1.6
					8 kHz	93.0	-1.1 (+2.1 ; -3.1)
					12.5 kHz	89.6	-4.3 (+3.0 ; -6.0)

6.3.2 C-Weighting

UUT Setting				Applied Value		UUT Reading (dB)	IEC 61672 Class 1 Spec. (dB)
Range (dB)	Function	Frequency Weighting	Time Weighting	Level (dB)	Freq.		
30 - 130	L _C	C	Fast	94.00	63 Hz	93.1	-0.8 ± 1.5
					125 Hz	93.8	-0.2 ± 1.5
					250 Hz	94.0	0.0 ± 1.4
					500 Hz	94.0	0.0 ± 1.4
					1 kHz	94.0	Ref.
					2 kHz	93.8	-0.2 ± 1.6
					4 kHz	93.2	-0.8 ± 1.6
					8 kHz	91.0	-3.0 (+2.1 ; -3.1)
					12.5 kHz	87.6	-6.2 (+3.0 ; -6.0)

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗室書面批准。



輝創工程有限公司

Sun Creation Engineering Limited

Calibration and Testing Laboratory

Certificate of Calibration

校正證書

Certificate No. : C171427

證書編號

Remarks : - UUT Microphone Model No. : UC-59 & S/N : 10445

- Mfr's Spec. : IEC 61672 Class 1

- Uncertainties of Applied Value :

94 dB	63 Hz - 125 Hz	: ± 0.35 dB
	250 Hz - 500 Hz	: ± 0.30 dB
	1 kHz	: ± 0.20 dB
	2 kHz - 4 kHz	: ± 0.35 dB
	8 kHz	: ± 0.45 dB
	12.5 kHz	: ± 0.70 dB
104 dB	1 kHz	: ± 0.10 dB (Ref. 94 dB)
114 dB	1 kHz	: ± 0.10 dB (Ref. 94 dB)

- The uncertainties are for a confidence probability of not less than 95 %.

Note :

Only the original copy or the laboratory's certified true copy is valid.

The values given in this Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environment changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Sun Creation Engineering Limited shall not be liable for any loss or damage resulting from the use of the equipment.

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗室書面批准。

Sun Creation Engineering Limited – Calibration & Testing Laboratory

c/o 4/F, Tsing Shan Wan Exchange Building, 1 Hing On Lane, Tuen Mun, New Territories, Hong Kong

輝創工程有限公司 – 校正及檢測實驗室

c/o 香港新界屯門興安里一號青山灣機樓四樓


Tel/電話: 2927 2606

Fax/傳真: 2744 8986

E-mail/電郵: callab@suncreation.com

Website/網址: www.suncreation.com

Page 4 of 4

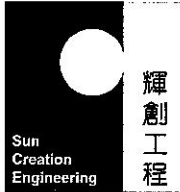

輝創工程

輝創工程有限公司

Sun Creation Engineering Limited

Calibration and Testing Laboratory

Certificate of Calibration 校正證書

Certificate No. : C175522
證書編號

ITEM TESTED / 送檢項目 (Job No. / 序引編號 : IC17-2161) Date of Receipt / 收件日期 : 18 September 2017

Description / 儀器名稱 : Precision Acoustic Calibrator
Manufacturer / 製造商 : LARSON DAVIS
Model No. / 型號 : CAL200
Serial No. / 編號 : 11334
Supplied By / 委託者 : Envirotech Services Co.
Room 113, 1/F, My Loft, 9 Hoi Wing Road, Tuen Mun,
New Territories, Hong Kong

TEST CONDITIONS / 測試條件

Temperature / 溫度 : (23 ± 2)°C Relative Humidity / 相對濕度 : (55 ± 20)%
Line Voltage / 電壓 : ---

TEST SPECIFICATIONS / 測試規範

Calibration check

DATE OF TEST / 測試日期 : 2 October 2017

TEST RESULTS / 測試結果

The results apply to the particular unit-under-test only.
The results do not exceed manufacturer's specification.
The results are detailed in the subsequent page(s).

The test equipment used for calibration are traceable to National Standards via :

- The Government of The Hong Kong Special Administrative Region Standard & Calibration Laboratory
- Agilent Technologies / Keysight Technologies
- Rohde & Schwarz Laboratory, Germany
- Fluke Everett Service Center, USA

Tested By : 
測試 : H T Wong
Technical Officer

Certified By : 
核證 : K C Lee
Engineer

Date of Issue : 3 October 2017
簽發日期

This certificate is valid only if used in accordance with the National Standard specified in the certificate. This certificate shall not be reproduced, except in full, with out the prior written consent of the issuer.

此證書只適用於按照證書內所列之國家標準進行校準。此證書不得被複製，除非事先獲得發行人之書面同意。

Sun Creation Engineering Limited, Calibration and Testing Laboratory

Co. 11, Hoi Yee, New Territories, Tuen Mun, Hong Kong, New Territories, Hong Kong

輝創工程有限公司, 輝創工程

Co. 11, Hoi Yee, New Territories, Tuen Mun, Hong Kong

Tel: 3439 2222 Fax: 3439 2222 E-mail: info@suncreation.com.hk Website: www.suncreation.com



輝創工程

輝創工程有限公司

Sun Creation Engineering Limited

Calibration and Testing Laboratory

Certificate of Calibration

校正證書

Certificate No. : C175522

證書編號

1. The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 12 hours before the commencement of the test.
2. The results presented are the mean of 3 measurements at each calibration point.
3. Test equipment :

<u>Equipment ID</u>	<u>Description</u>	<u>Certificate No.</u>
CL130	Universal Counter	C173864
CL281	Multifunction Acoustic Calibrator	PA160023
TST150A	Measuring Amplifier	C161175

4. Test procedure : MA100N.

5. Results :

5.1 Sound Level Accuracy

UUT Nominal Value	Measured Value (dB)	Mfr's Spec. (dB)	Uncertainty of Measured Value (dB)
94 dB, 1 kHz	93.9	± 0.2	± 0.2
114 dB, 1 kHz	113.9		

5.2 Frequency Accuracy


UUT Nominal Value (kHz)	Measured Value (kHz)	Mfr's Spec. (Hz)	Uncertainty of Measured Value (Hz)
1	1.000	1 kHz ± 1 %	± 1

Remark : The uncertainties are for a confidence probability of not less than 95 %.

Note :

Only the original copy or the laboratory's certified true copy is valid.

The values given in this Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environment changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Sun Creation Engineering Limited shall not be liable for any loss or damage resulting from the use of the equipment.

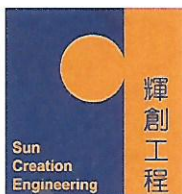

Certificate of Calibration 校正證書

Certificate No. : C165934
證書編號

ITEM TESTED / 送檢項目 (Job No. / 序引編號 : IC16-2438) Date of Receipt / 收件日期 : 26 October 2016

Description / 儀器名稱 : Anemometer
Manufacturer / 製造商 : Lutron
Model No. / 型號 : AM-4201
Serial No. / 編號 : AF.27513
Supplied By / 委託者 : Envirotech Services Co.
Room 113, 1/F, My Loft, 9 Hoi Wing Road, Tuen Mun,
New Territories, Hong Kong

TEST CONDITIONS / 測試條件

Temperature / 溫度 : $(23 \pm 2)^{\circ}\text{C}$ Relative Humidity / 相對濕度 : $(55 \pm 20)\%$
Line Voltage / 電壓 : ---

TEST SPECIFICATIONS / 測試規範


Calibration check


DATE OF TEST / 測試日期 : 27 October 2016

TEST RESULTS / 測試結果

The results apply to the particular unit-under-test only.
The results are detailed in the subsequent page(s).

The test equipment used for calibration are traceable to National Standards via :
- Testo Industrial Services GmbH, Germany

Tested By : 
測試 : _____
T L Shek
Assistant Engineer

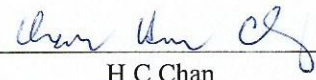Certified By : 
核證 : _____
H C Chan
Engineer

Date of Issue : 28 October 2016
簽發日期

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書面批准。



輝創工程有限公司

Sun Creation Engineering Limited

Calibration and Testing Laboratory

Certificate of Calibration 校正證書

Certificate No. : C165934

證書編號

1. The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 12 hours before the commencement of the test.
2. The results presented are the mean of 10 measurements at each calibration point.
3. Test equipment :

<u>Equipment ID</u>	<u>Description</u>	<u>Certificate No.</u>
CL386	Multi-function Measuring Instrument	S12109

4. Test procedure : MA130N.
5. Results :

Air Velocity

Applied Value (m/s)	UUT Reading (m/s)	Measured Correction		
		Value (m/s)	Measurement Uncertainty	
			Expanded Uncertainty (m/s)	Coverage Factor
2.0	1.8	+0.2	0.2	2.0
4.0	3.8	+0.2	0.2	2.0
6.0	5.8	+0.2	0.3	2.0
8.1	8.0	+0.1	0.3	2.0
10.0	10.0	0.0	0.4	2.0

Remarks : - The Measured Corrections are defined as :
Value = Applied Value - UUT Reading

- The expanded uncertainties are for a level of confidence of 95 %.

Note :

Only the original copy or the laboratory's certified true copy is valid.

The values given in this Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environment changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Sun Creation Engineering Limited shall not be liable for any loss or damage resulting from the use of the equipment.

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗室書面批准。

Sun Creation Engineering Limited – Calibration & Testing Laboratory

c/o 4/F, Tsing Shan Wan Exchange Building, 1 Hing On Lane, Tuen Mun, New Territories, Hong Kong

輝創工程有限公司 – 校正及檢測實驗室

c/o 香港新界屯門興安里一號青山灣機樓四樓

Tel/電話: 2927 2606

Fax/傳真: 2744 8986

E-mail/電郵: callab@suncreation.com

Website/網址: www.suncreation.com

G. Event and Action Plan

Event and Action Plan for Construction Noise

Event	Action			
	ET	IEC	ER	Contractor
Action Level	<ol style="list-style-type: none"> 1. Notify ER, IEC and Contractor; 2. Carry out investigation; 3. Report the results of investigation to the IEC, ER and Contractor; 4. Discuss with the IEC and Contractor on remedial measures required; 5. Increase monitoring frequency to check mitigation effectiveness. 	<ol style="list-style-type: none"> 1. Review the investigation results submitted by the ET; 2. Review the proposed remedial measures by the Contractor and advise the ER accordingly; 3. Advise the ER on the effectiveness of the proposed remedial measures. 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of failure in writing; 2. Notify Contractor; 3. In consolidation with the IEC, agree with the Contractor on the remedial measures to be implemented; 4. Supervise the implementation of remedial measures. 	<ol style="list-style-type: none"> 1. Submit noise mitigation proposals to IEC and ER; 2. Implement noise mitigation proposals.
Limit Level	<ol style="list-style-type: none"> 1. Inform IEC, ER, Contractor and EPD; 2. Repeat measurements to confirm findings; 3. Increase monitoring frequency; 4. Identify source and investigate the cause of exceedance; 5. Carry out analysis of Contractor's working procedures; 6. Discuss with the IEC, Contractor and ER on remedial measures required; 7. Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results; 8. If exceedance stops, cease additional monitoring. 	<ol style="list-style-type: none"> 1. Discuss amongst ER, ET, and Contractor on the potential remedial actions; 2. Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly. 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of failure in writing; 2. Notify Contractor; 3. In consolidation with the IEC, agree with the Contractor on the remedial measures to be implemented; 4. Supervise the implementation of remedial measures; 5. If exceedance continues, consider stopping the Contractor to continue working on that portion of work which causes the exceedance until the exceedance is abated. 	<ol style="list-style-type: none"> 1. Take immediate action to avoid further exceedance; 2. Submit proposals for remedial actions to IEC and ER within 3 working days of notification; 3. Implement the agreed proposals; 4. Submit further proposal if problem still not under control; 5. Stop the relevant portion of works as instructed by the ER until the exceedance is abated.

Event and Action Plan for Landscape and Visual Impact during Construction Phase

Action Level	Environmental Team Leader (ETL)	Independent Environmental Checker (IEC)	Engineer's Representative (ER)	Contractor
Non-conformity on one occasion	<ol style="list-style-type: none"> 1. Identify source 2. Inform the IEC and the ER 3. Discuss remedial actions with the IEC, the ER and the Contractor 4. Monitor remedial action until rectification has been completed 	<ol style="list-style-type: none"> 1. Check report 2. Check the Contractor's working method 3. Discuss with the ER and the Contractor on possible remedial measures 4. Advise the ER on effectiveness of proposed remedial measures 	<ol style="list-style-type: none"> 1. Notify the Contractor 2. Ensure remedial measures are properly implemented 	<ol style="list-style-type: none"> 1. Amend working methods 2. Rectify damage and undertake remedial measures or any necessary replacement
Repeated Non-conformity	<ol style="list-style-type: none"> 1. Identify source 2. Inform the IEC and the ER 3. Increase monitoring (site audit) frequency 4. Discuss remedial actions with the IEC, the ER and the Contractor 5. Monitor remedial actions until rectification has been completed 6. If exceedance stops, cease additional monitoring (site audit) 	<ol style="list-style-type: none"> 1. Check report 2. Check the Contractor's working method 3. Discuss with the ER and the Contractor on possible remedial measures 4. Advise the ER on effectiveness of proposed remedial measures 5. Supervise implementation of remedial measures 		

H. Impact Monitoring Schedule

NOVEMBER 2017

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday																																																																																									
			1 Noise Monitoring	2	3 ET weekly site inspection Landscape and Visual Monitoring	4																																																																																									
5	6	7 Noise Monitoring	8	9	10 ET weekly site inspection Ecological Monitoring	11																																																																																									
12	13	14	15 Noise Monitoring	16	17 ET weekly site inspection Landscape and Visual Monitoring	18																																																																																									
19	20	21	22	23 Noise Monitoring	24 ET weekly site inspection	25																																																																																									
26 Noise Monitoring	27	28	29 Noise Monitoring	30																																																																																											
		October 2017 <table border="1"> <thead> <tr> <th>S</th> <th>M</th> <th>T</th> <th>W</th> <th>Th</th> <th>F</th> <th>Sa</th> </tr> </thead> <tbody> <tr> <td>1</td> <td>2</td> <td>3</td> <td>4</td> <td>5</td> <td>6</td> <td>7</td> </tr> <tr> <td>8</td> <td>9</td> <td>10</td> <td>11</td> <td>12</td> <td>13</td> <td>14</td> </tr> <tr> <td>15</td> <td>16</td> <td>17</td> <td>18</td> <td>19</td> <td>20</td> <td>21</td> </tr> <tr> <td>22</td> <td>23</td> <td>24</td> <td>25</td> <td>26</td> <td>27</td> <td>28</td> </tr> <tr> <td>29</td> <td>30</td> <td>31</td> <td></td> <td></td> <td></td> <td></td> </tr> </tbody> </table>	S	M	T	W	Th	F	Sa	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25	26	27	28	29	30	31					December 2017 <table border="1"> <thead> <tr> <th>S</th> <th>M</th> <th>T</th> <th>W</th> <th>Th</th> <th>F</th> <th>Sa</th> </tr> </thead> <tbody> <tr> <td></td> <td></td> <td></td> <td></td> <td></td> <td>1</td> <td>2</td> </tr> <tr> <td>3</td> <td>4</td> <td>5</td> <td>6</td> <td>7</td> <td>8</td> <td>9</td> </tr> <tr> <td>10</td> <td>11</td> <td>12</td> <td>13</td> <td>14</td> <td>15</td> <td>16</td> </tr> <tr> <td>17</td> <td>18</td> <td>19</td> <td>20</td> <td>21</td> <td>22</td> <td>23</td> </tr> <tr> <td>24</td> <td>25</td> <td>26</td> <td>27</td> <td>28</td> <td>29</td> <td>30</td> </tr> <tr> <td>31</td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> </tr> </tbody> </table>	S	M	T	W	Th	F	Sa						1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25	26	27	28	29	30	31							Notes:
S	M	T	W	Th	F	Sa																																																																																									
1	2	3	4	5	6	7																																																																																									
8	9	10	11	12	13	14																																																																																									
15	16	17	18	19	20	21																																																																																									
22	23	24	25	26	27	28																																																																																									
29	30	31																																																																																													
S	M	T	W	Th	F	Sa																																																																																									
					1	2																																																																																									
3	4	5	6	7	8	9																																																																																									
10	11	12	13	14	15	16																																																																																									
17	18	19	20	21	22	23																																																																																									
24	25	26	27	28	29	30																																																																																									
31																																																																																															

DECEMBER 2017

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday																																																																																				
					1 ET weekly site inspection	2																																																																																				
3	4	5 Noise Monitoring	6	7	8 ET weekly site inspection Landscape and Visual Monitoring	9																																																																																				
10	11	12	13 Noise Monitoring	14	15 ET weekly site inspection Ecological Monitoring	16																																																																																				
17	18	19	20 Noise Monitoring	21	22 ET weekly site inspection Landscape and Visual Monitoring	23																																																																																				
24	25	26	27	28 Noise Monitoring	29 ET weekly site inspection	30																																																																																				
31		November 2017 <table border="1"> <thead> <tr><th>S</th><th>M</th><th>T</th><th>W</th><th>Th</th><th>F</th><th>Sa</th></tr> </thead> <tbody> <tr><td></td><td></td><td></td><td>1</td><td>2</td><td>3</td><td>4</td></tr> <tr><td>5</td><td>6</td><td>7</td><td>8</td><td>9</td><td>10</td><td>11</td></tr> <tr><td>12</td><td>13</td><td>14</td><td>15</td><td>16</td><td>17</td><td>18</td></tr> <tr><td>19</td><td>20</td><td>21</td><td>22</td><td>23</td><td>24</td><td>25</td></tr> <tr><td>26</td><td>27</td><td>28</td><td>29</td><td>30</td><td></td><td></td></tr> </tbody> </table>		S	M	T	W	Th	F	Sa				1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25	26	27	28	29	30			January 2018 <table border="1"> <thead> <tr><th>S</th><th>M</th><th>T</th><th>W</th><th>Th</th><th>F</th><th>Sa</th></tr> </thead> <tbody> <tr><td></td><td>1</td><td>2</td><td>3</td><td>4</td><td>5</td><td>6</td></tr> <tr><td>7</td><td>8</td><td>9</td><td>10</td><td>11</td><td>12</td><td>13</td></tr> <tr><td>14</td><td>15</td><td>16</td><td>17</td><td>18</td><td>19</td><td>20</td></tr> <tr><td>21</td><td>22</td><td>23</td><td>24</td><td>25</td><td>26</td><td>27</td></tr> <tr><td>28</td><td>29</td><td>30</td><td>31</td><td></td><td></td><td></td></tr> </tbody> </table>		S	M	T	W	Th	F	Sa		1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25	26	27	28	29	30	31				Notes:
S	M	T	W	Th	F	Sa																																																																																				
			1	2	3	4																																																																																				
5	6	7	8	9	10	11																																																																																				
12	13	14	15	16	17	18																																																																																				
19	20	21	22	23	24	25																																																																																				
26	27	28	29	30																																																																																						
S	M	T	W	Th	F	Sa																																																																																				
	1	2	3	4	5	6																																																																																				
7	8	9	10	11	12	13																																																																																				
14	15	16	17	18	19	20																																																																																				
21	22	23	24	25	26	27																																																																																				
28	29	30	31																																																																																							

I. Noise Monitoring Data

Noise Monitoring Data - Summary of Construction Noise Monitoring Results (30mins), dB(A)

NM1A - Slope near the Victoria Shanghai Academy						
Date	Time		Noise Levels, dB(A)			Limit Level for L_{eq} (dB(A)) ⁽²⁾
	Start	Finish	Corrected L_{eq} (30min) ⁽¹⁾	Corrected L_{90} ⁽¹⁾	Corrected L_{10} ⁽¹⁾	
01-Nov-17	09:02	09:32	61.2	59.3	62.2	70
07-Nov-17	09:35	10:05	60.6	58.4	62.3	70
15-Nov-17	10:10	10:40	59.1	57.0	61.1	70
23-Nov-17	10:35	11:05	60.0	54.8	63.8	70
29-Nov-17	10:00	10:30	59.2	55.3	61.3	70

NM2 - Hong Kong Juvenile Care Centre						
Date	Time		Noise Levels, dB(A)			Limit Level for L_{eq} (dB(A)) ⁽²⁾
	Start	Finish	L_{eq} (30min)	L_{90}	L_{10}	
01-Nov-17	10:25	10:55	52.3	50.9	53.9	70
07-Nov-17	08:55	09:25	52.0	49.6	53.6	70
15-Nov-17	09:30	10:00	52.9	51.3	58.3	70
23-Nov-17	09:55	10:25	53.9	50.8	56.7	70
29-Nov-17	09:20	09:50	52.4	49.3	54.5	70

Noise Monitoring Data - Summary of Construction Noise Monitoring Results (15mins), dB(A)

NM1A - Slope near the Victoria Shanghai Academy						
Date	Time		Noise Levels, dB(A)			Limit Level for L_{eq} (dB(A)) ⁽²⁾
	Start	Finish	Corrected L_{eq} (5min) ⁽¹⁾	Corrected L_{90} ⁽¹⁾	Corrected L_{10} ⁽¹⁾	
26-Nov-17	15:35	15:50	55.0	50.3	57.7	70
			52.8	49.1	53.8	
			55.0	50.7	57.9	

NM2 - Hong Kong Juvenile Care Centre						
Date	Time		Noise Levels, dB(A)			Limit Level for L_{eq} (dB(A)) ⁽²⁾
	Start	Finish	L_{eq} (5min)	L_{90}	L_{10}	
26-Nov-17	15:00	15:15	45.2	42.6	47.5	70
			45.3	41.2	41.2	
			44.2	42.0	42.0	


Notes:

- (1) A free field correction of +3dB(A) has been made to these measurements as specified in the EM&A Manual and EPD guidelines.
- (2) Acceptable noise level should be reduced to 65dB(A) upon school examination period.


J. Graphical Plots for Noise Monitoring Data

Graphical Plot for Noise Monitoring Data (August - November 2017)

Noise Level for 30 min, dB(A), at NM1A

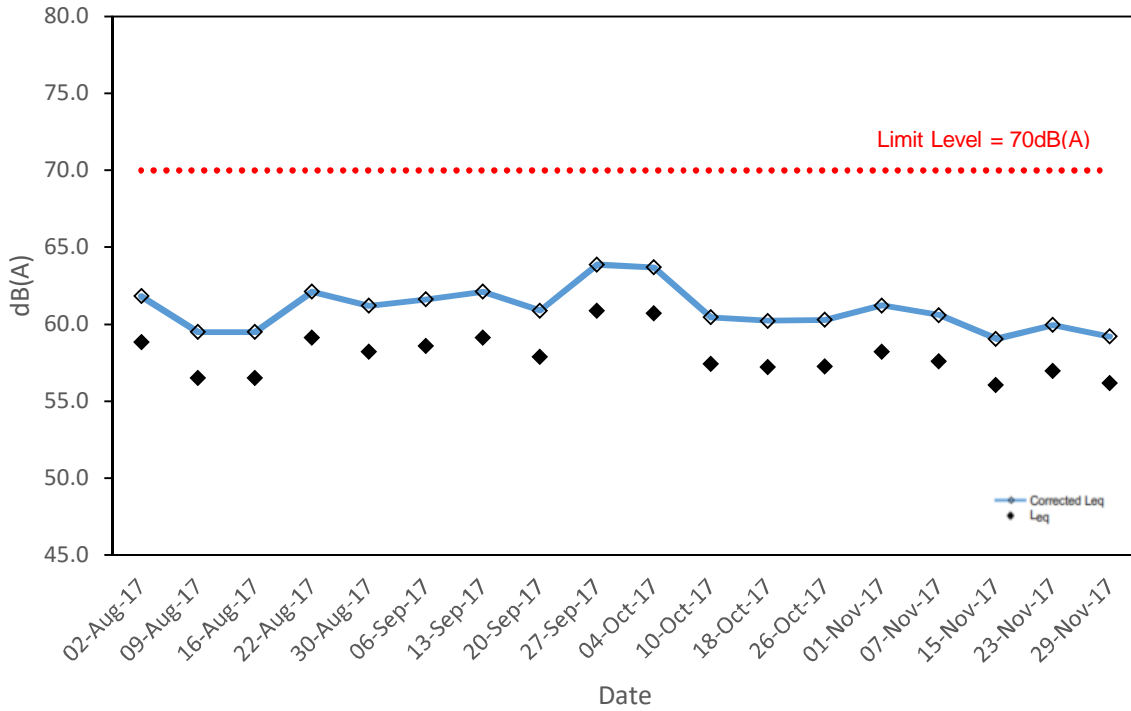

Noise Level for 30 min, dB(A), at NM2

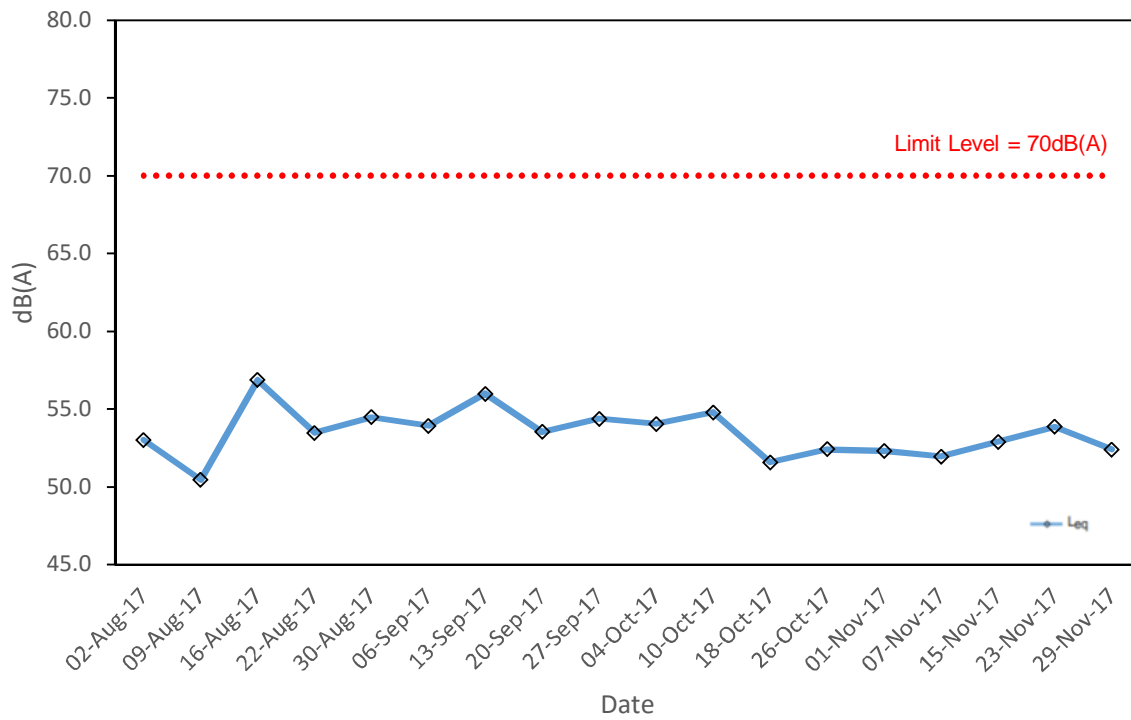


K. Meteorological Data

1/11/2017

Wong Chuk Hang Station


Temperature/Humidity:

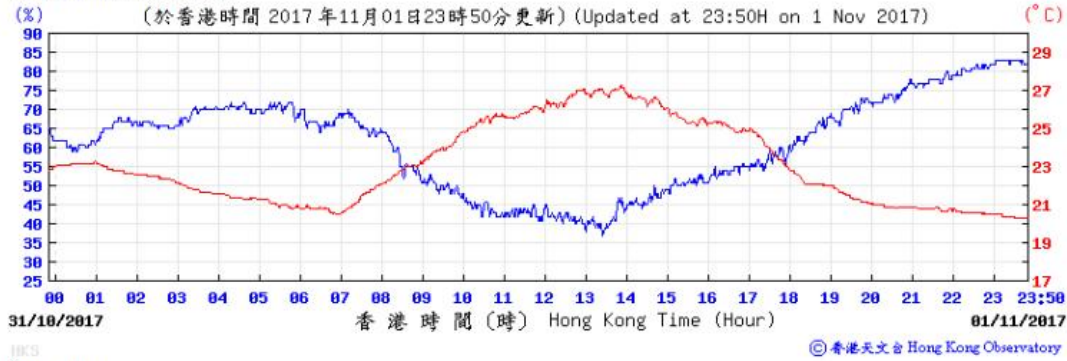


Pressure:



Wind Direction:

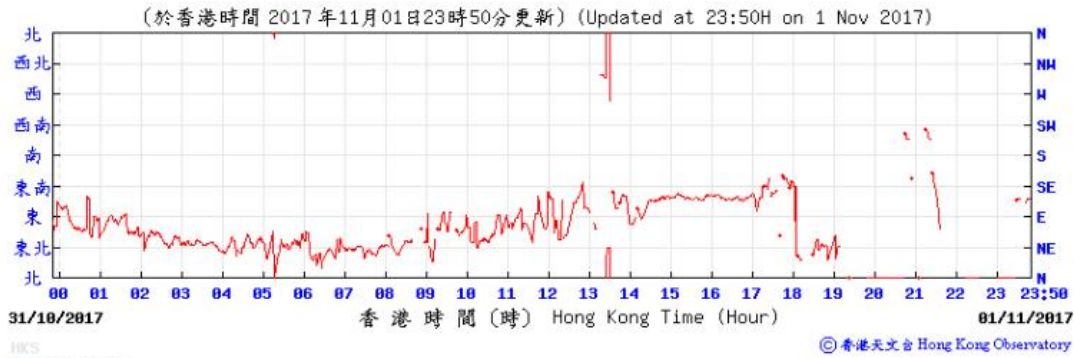


Wind Speed:

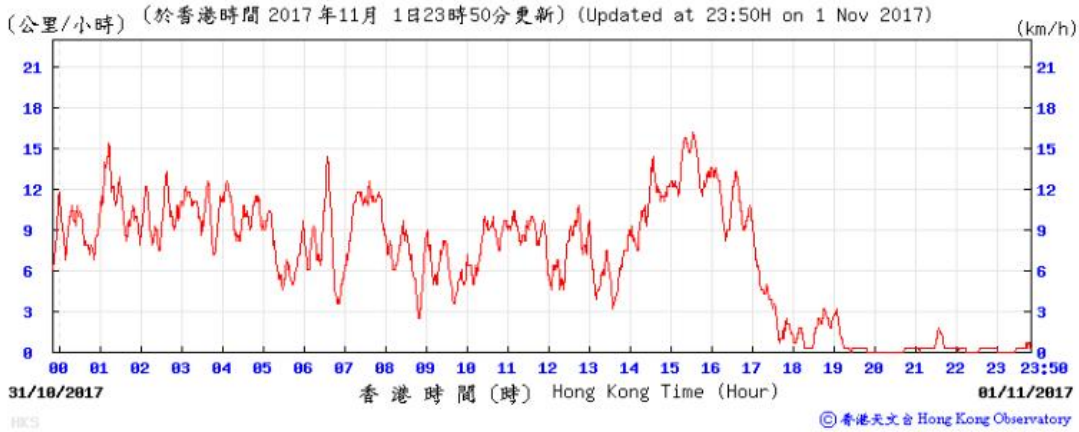

2/11/2017


Temperature/Humidity:

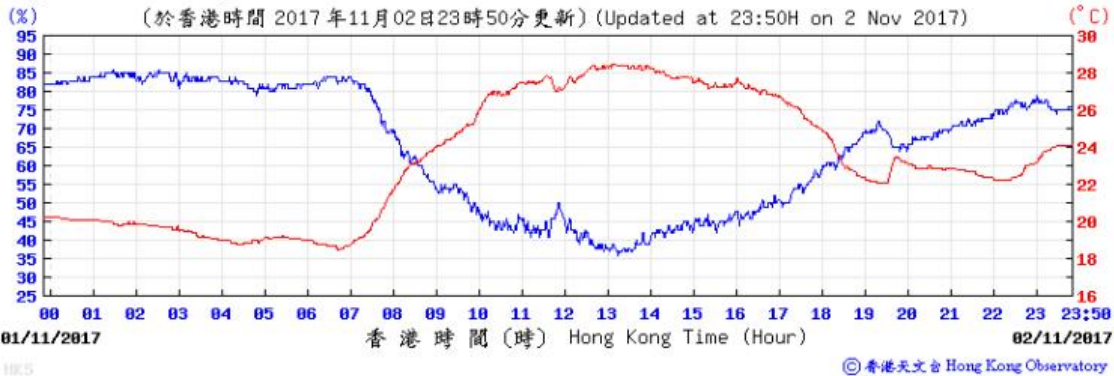


Pressure:



Wind Direction:

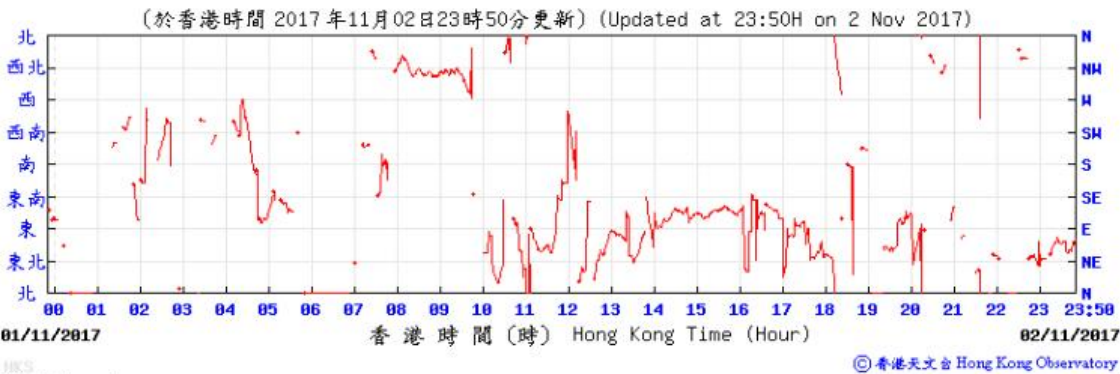


Wind Speed:

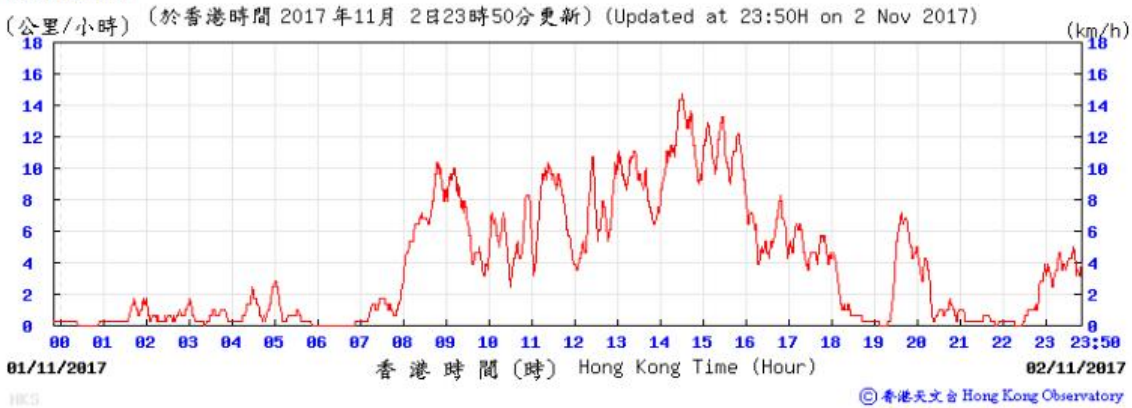

3/11/2017


Temperature/Humidity:

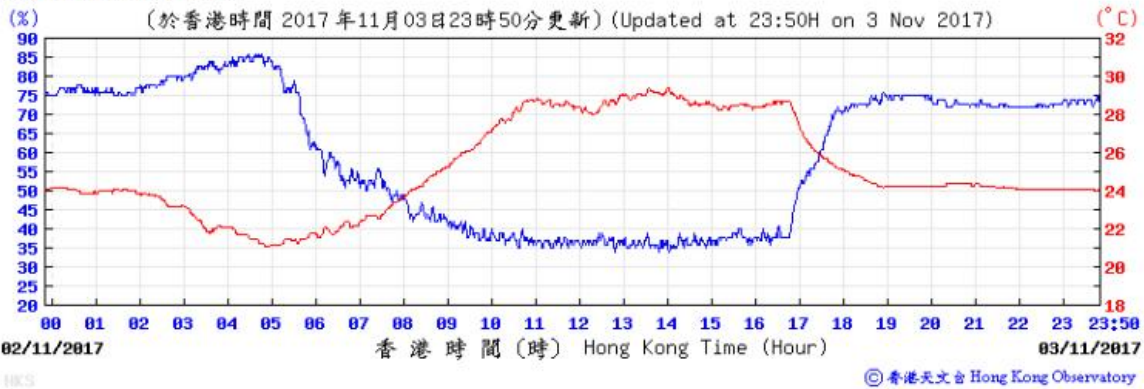


Pressure:



Wind Direction:

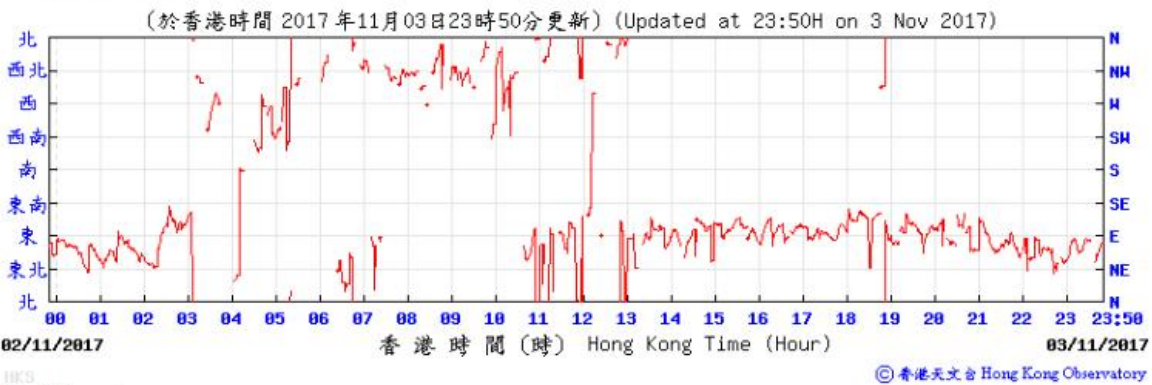


Wind Speed:

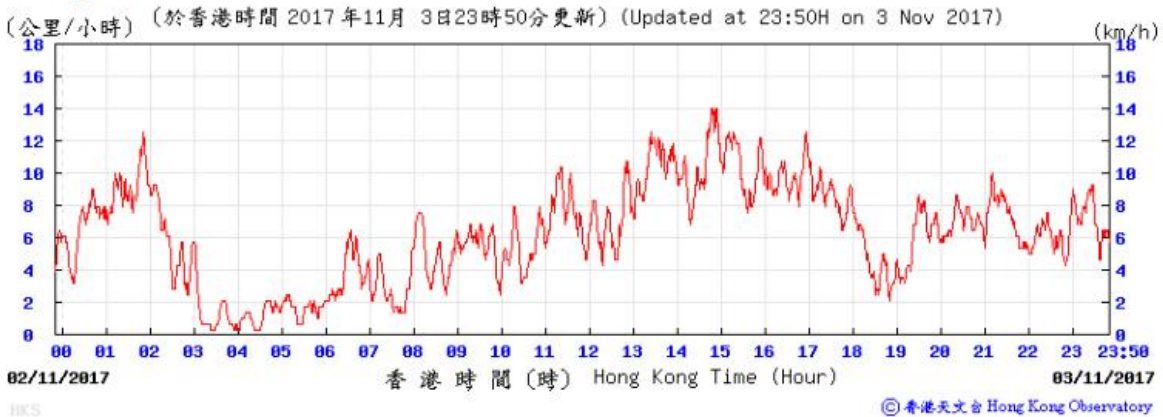

6/11/2017


Temperature/Humidity:

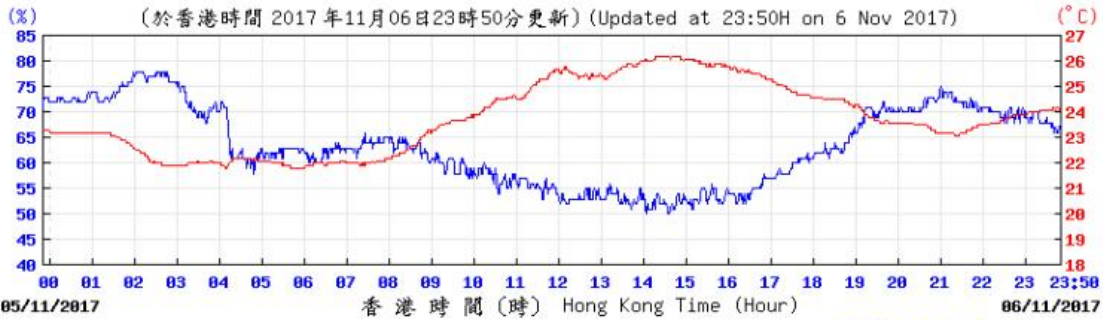


Pressure:



Wind Direction:

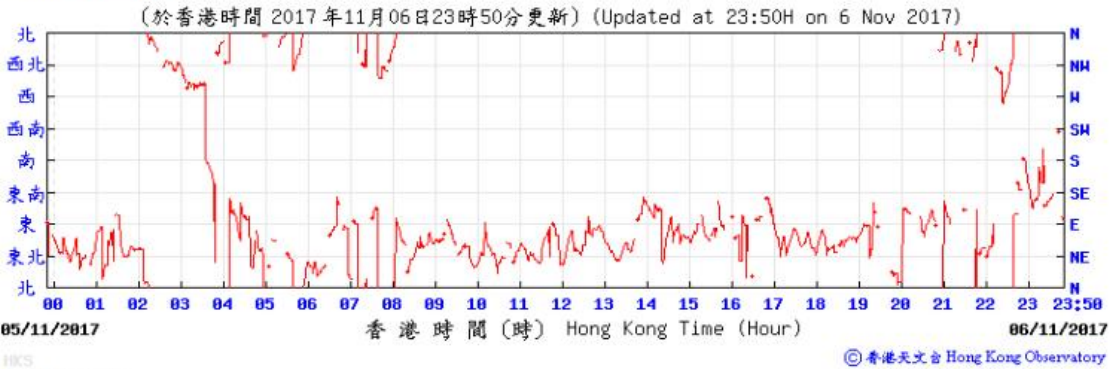


Wind Speed:

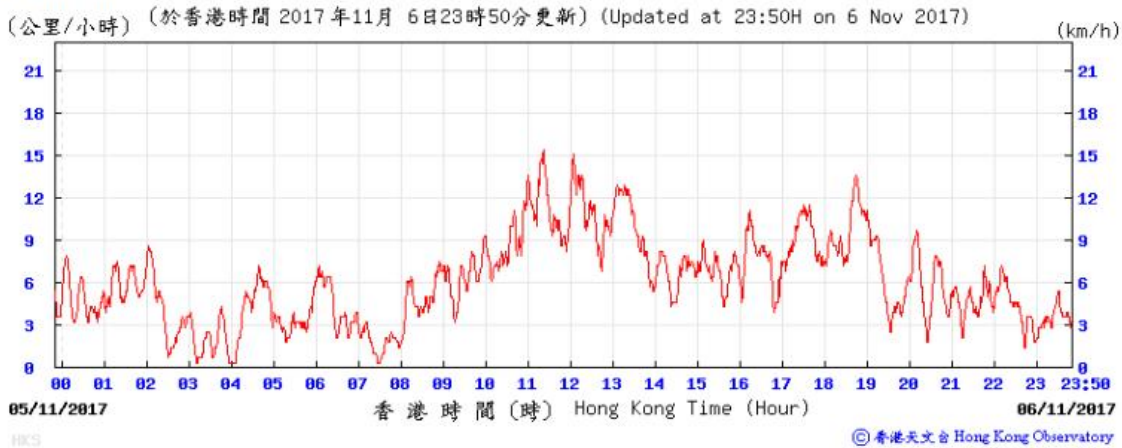

7/11/2017


Temperature/Humidity:

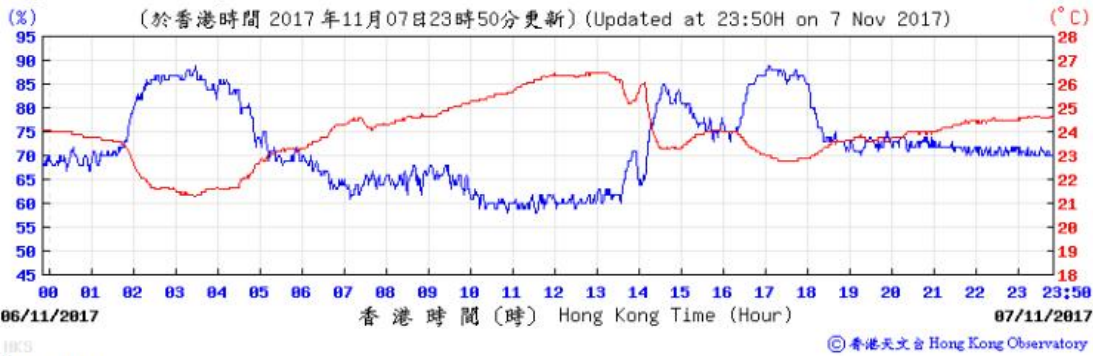


Pressure:



Wind Direction:

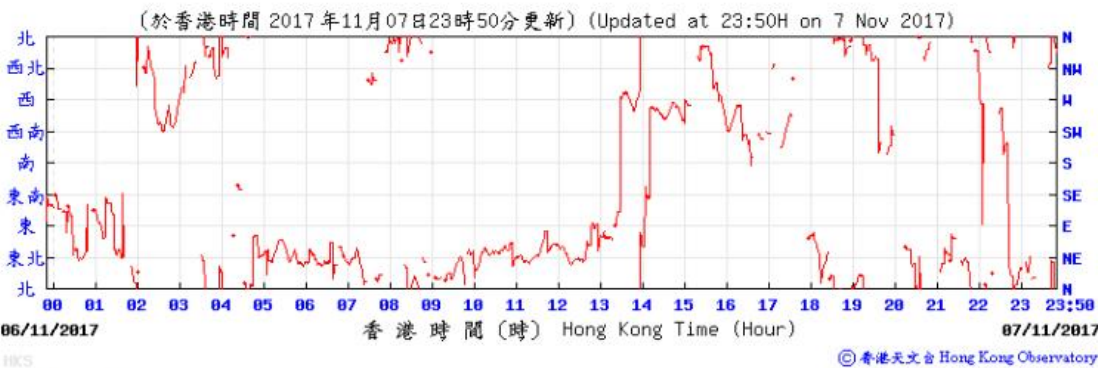


Wind Speed:

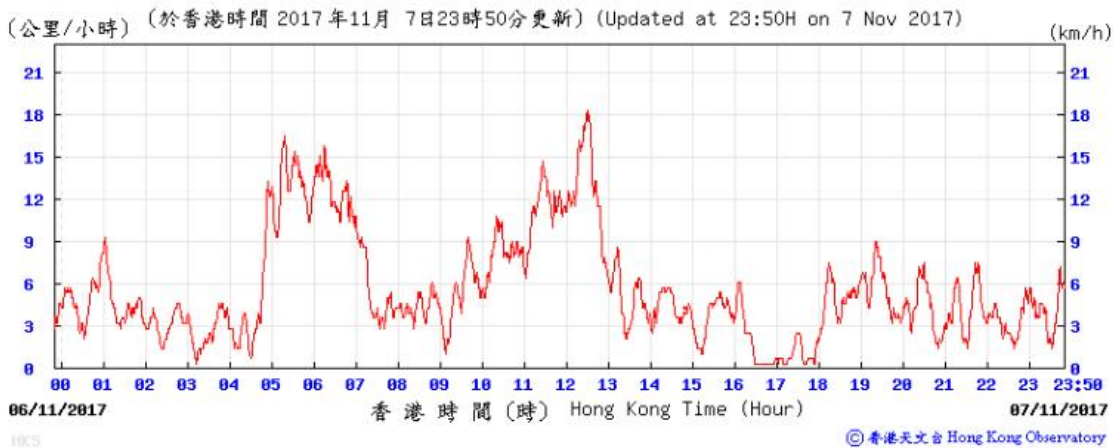

8/11/2017


Temperature/Humidity:

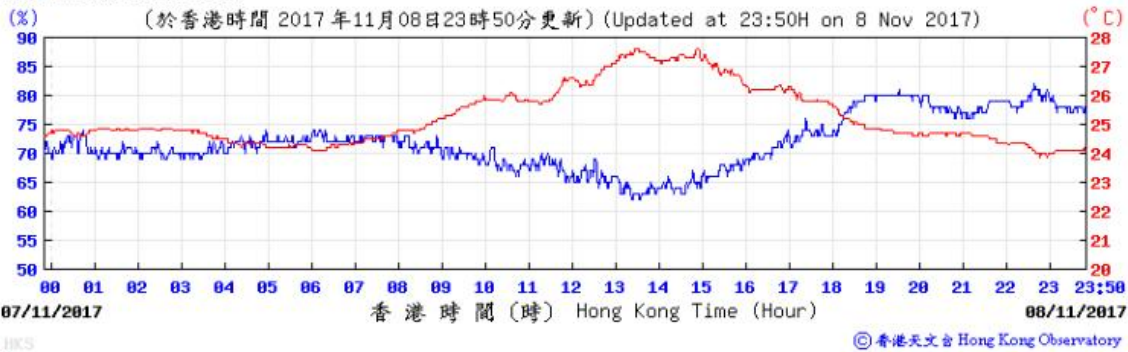


Pressure:



Wind Direction:

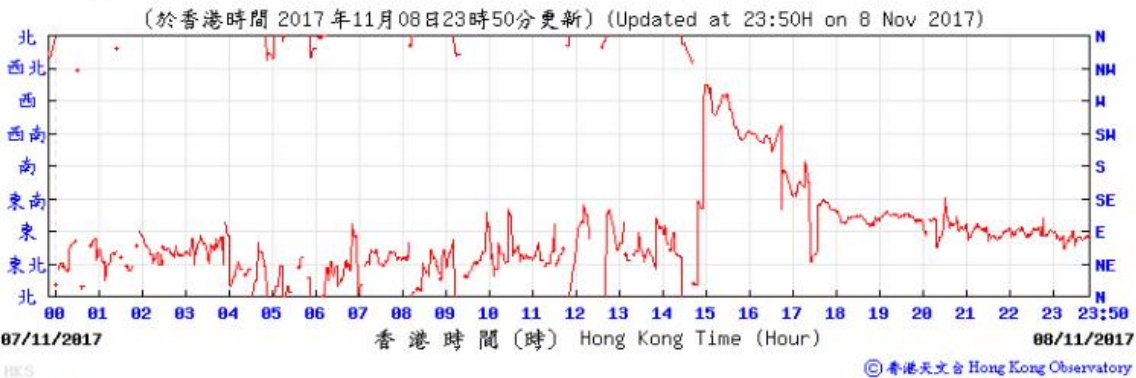

Wind Speed:

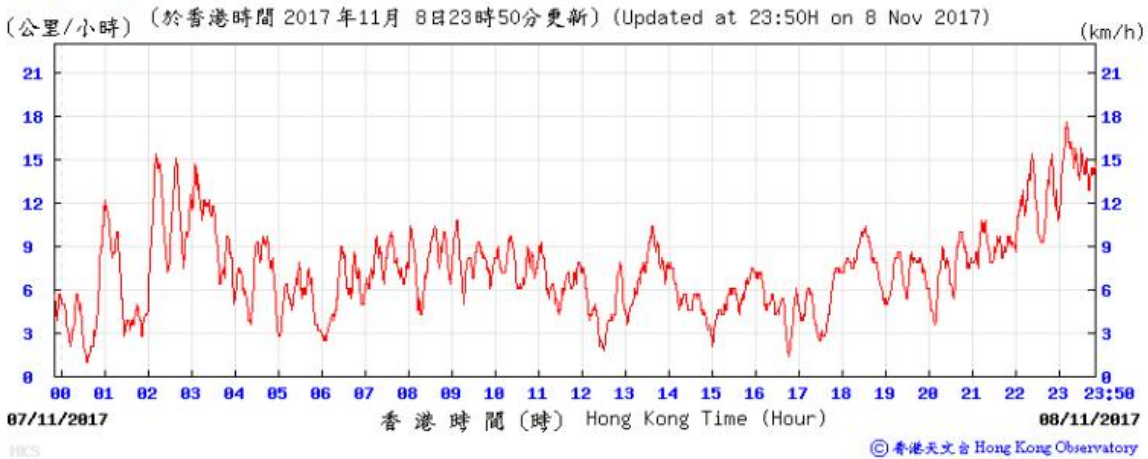

9/11/2017

Temperature/Humidity:




Pressure:



Wind Direction:




Wind Speed:

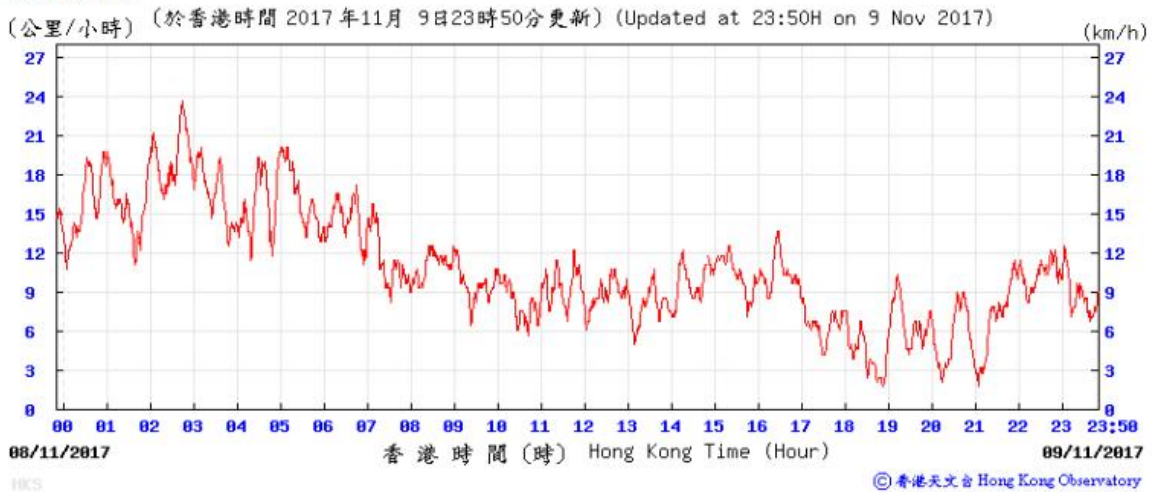

10/11/2017

Temperature/Humidity:

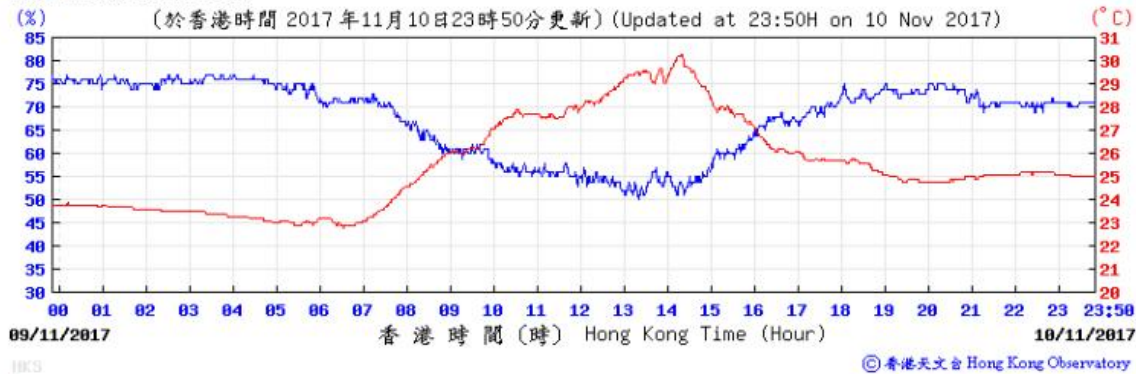


Pressure:



Wind Direction:




Wind Speed:

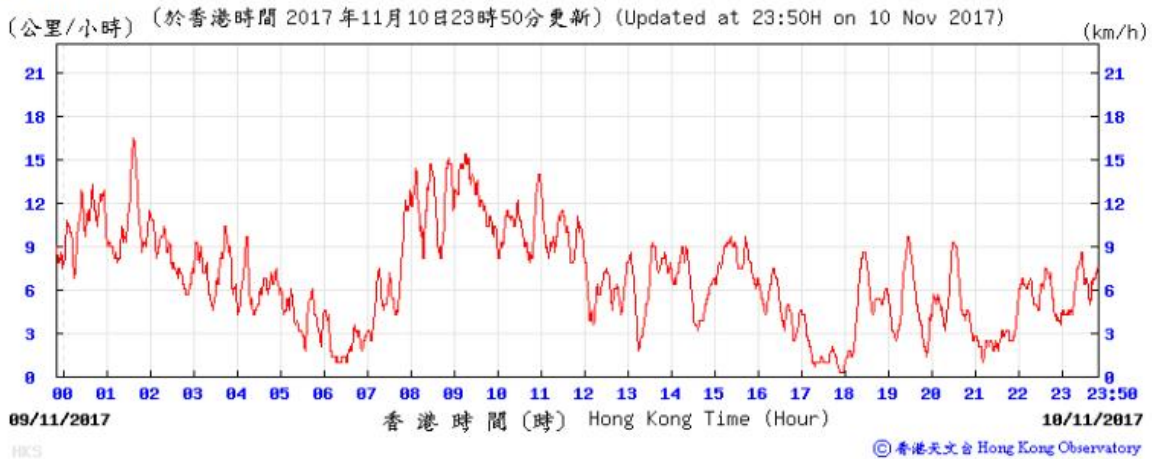

13/11/2017


Temperature/Humidity:

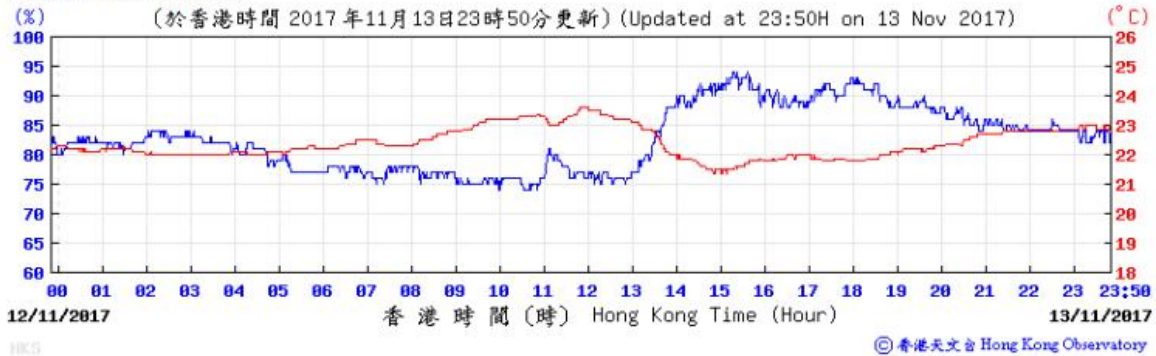


Pressure:



Wind Direction:

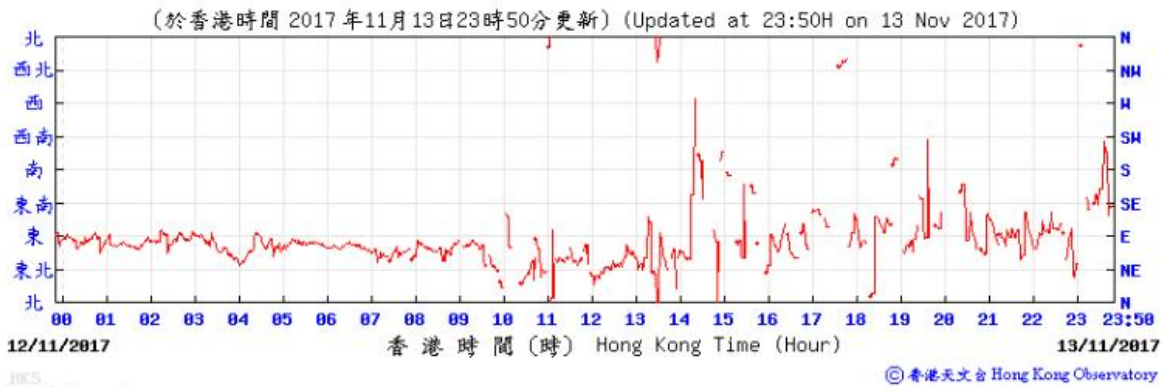


Wind Speed:

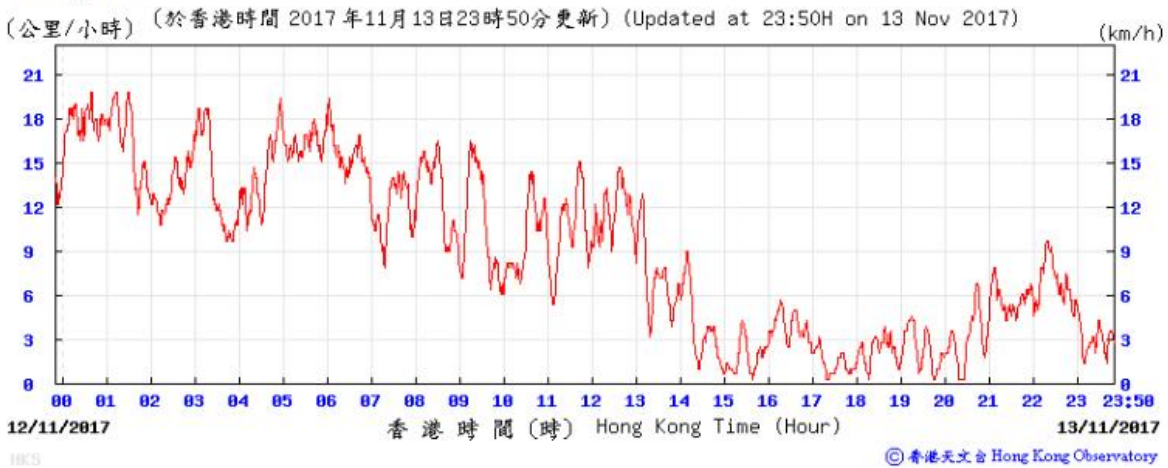

14/11/2017


Temperature/Humidity:

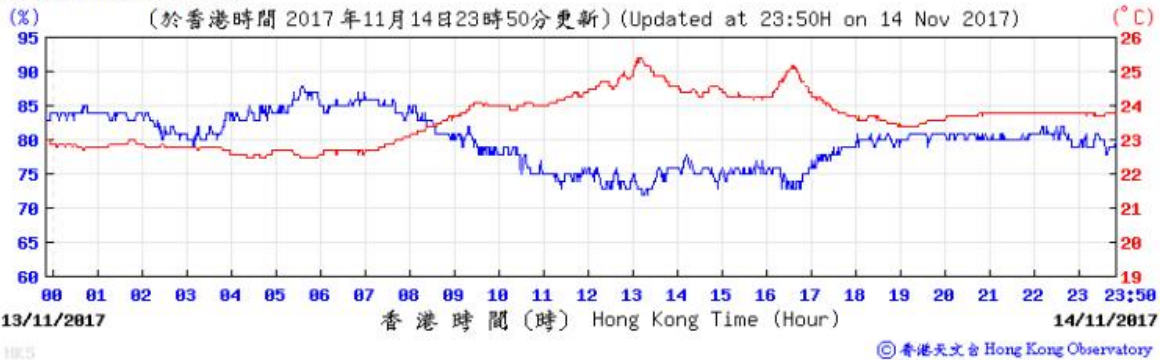


Pressure:



Wind Direction:

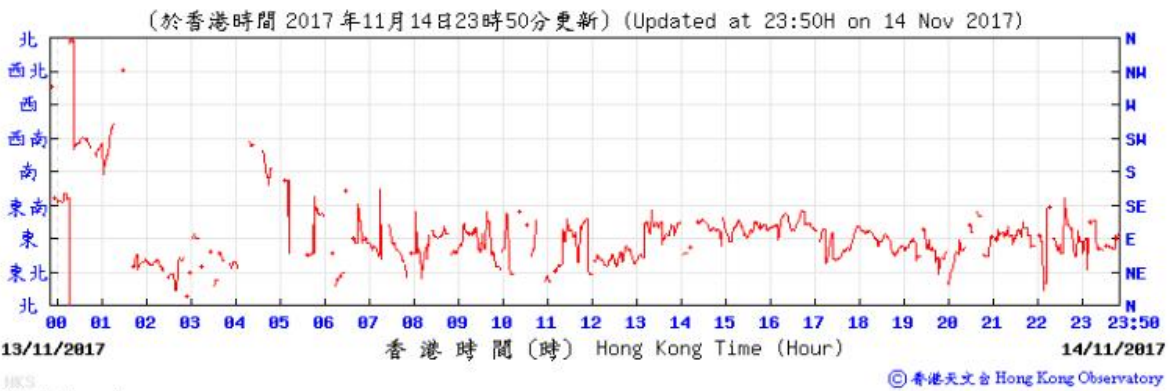


Wind Speed:

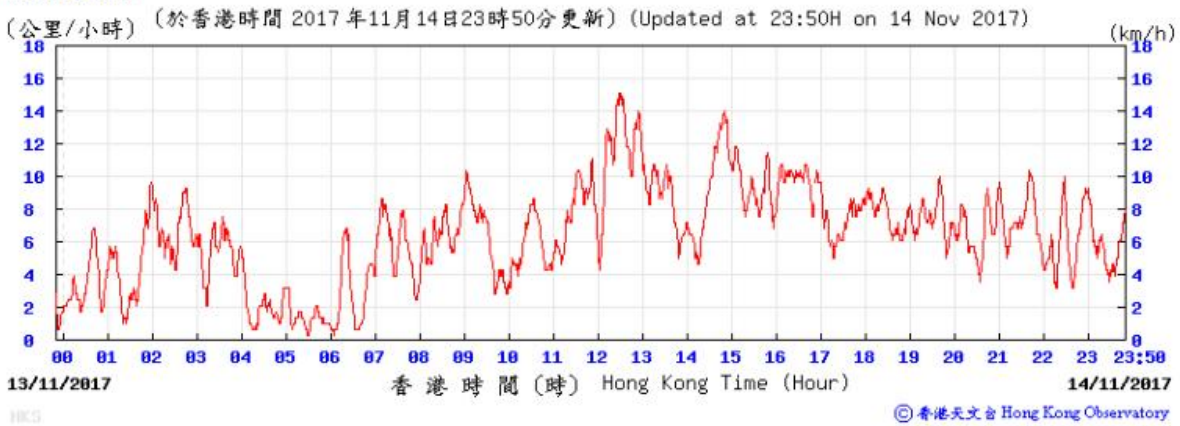

15/11/2017


Temperature/Humidity:

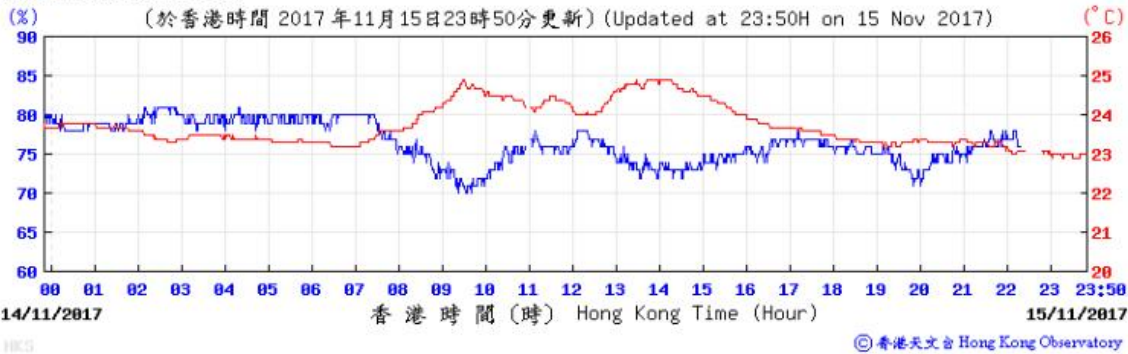


Pressure:



Wind Direction:

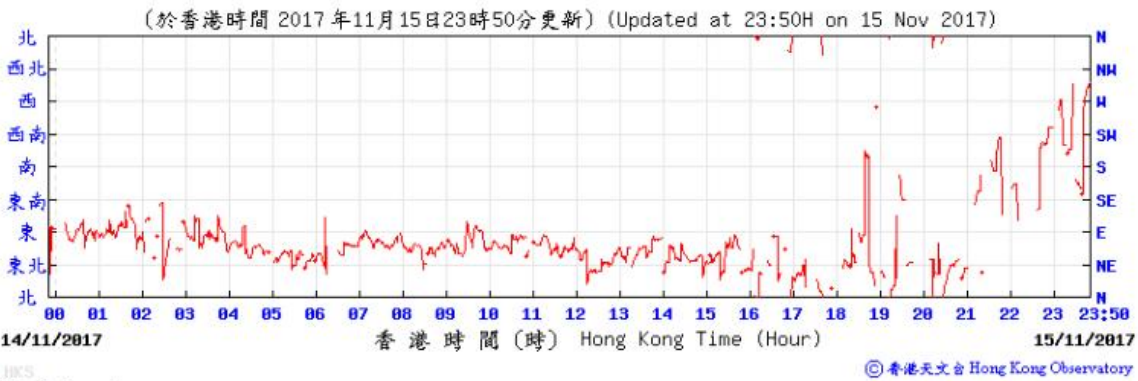


Wind Speed:

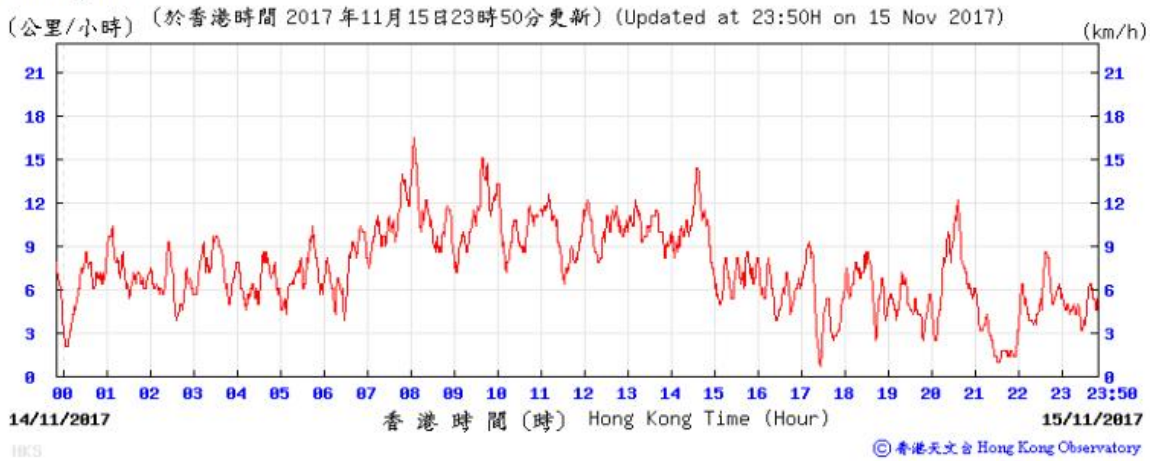

16/11/2017


Temperature/Humidity:

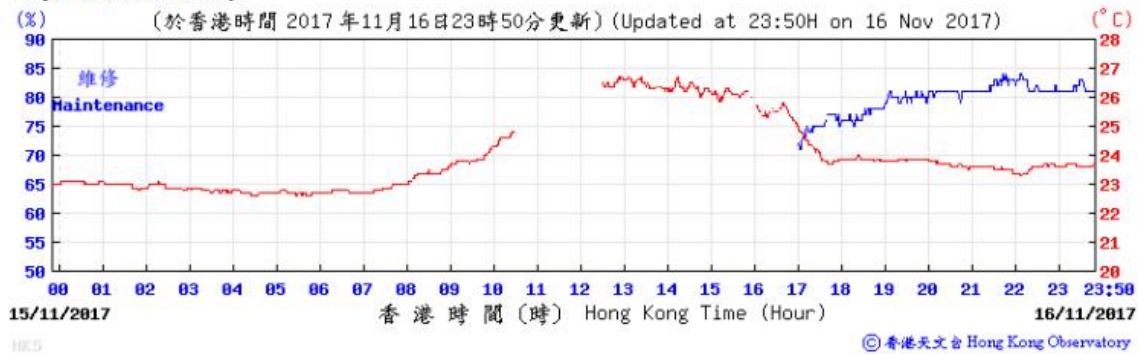


Pressure:



Wind Direction:

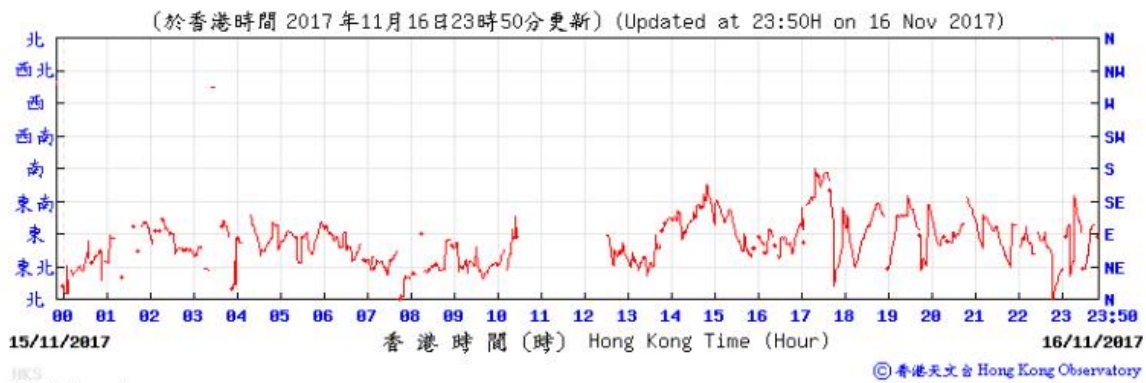


Wind Speed:

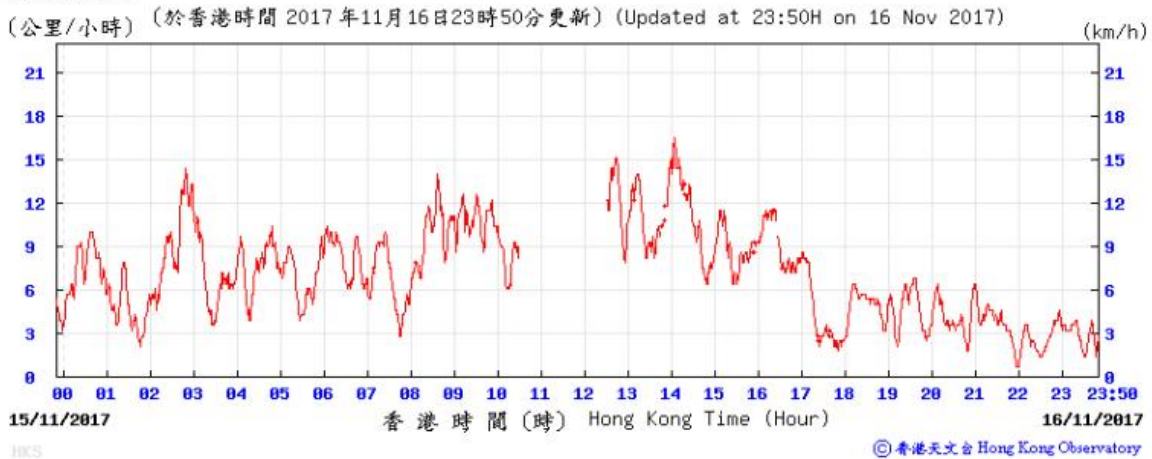

17/11/2017


Temperature/Humidity:

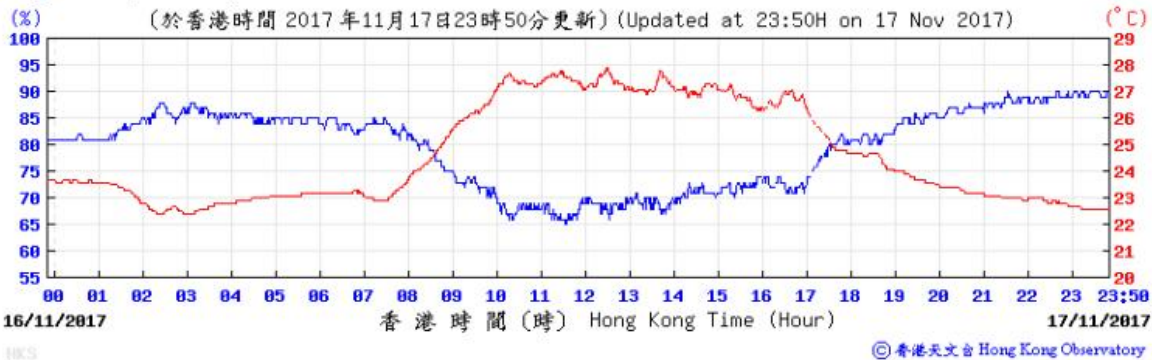


Pressure:



Wind Direction:

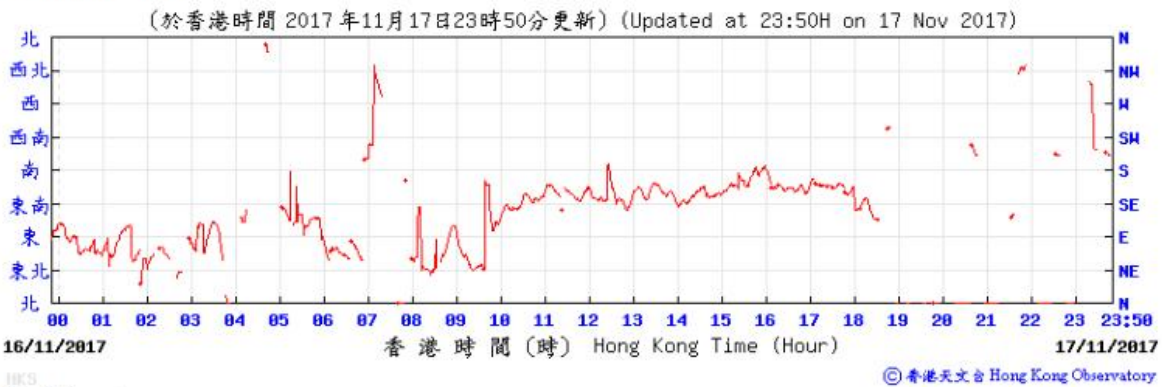


Wind Speed:

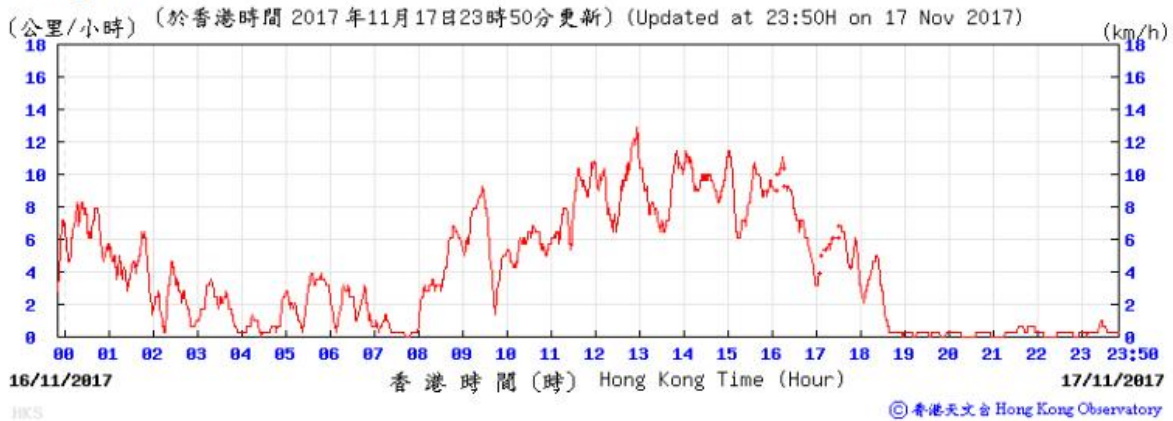

20/11/2017

Temperature/Humidity:

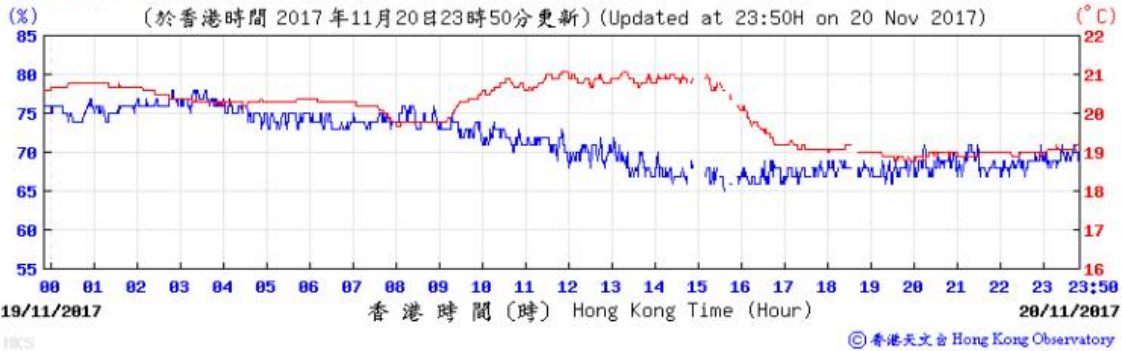


Pressure:



Wind Direction:




Wind Speed:

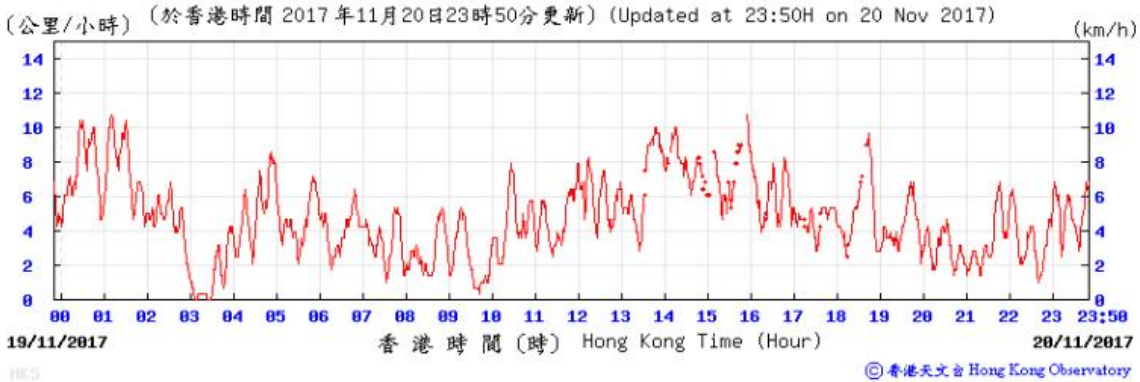

21/11/2017


Temperature/Humidity:

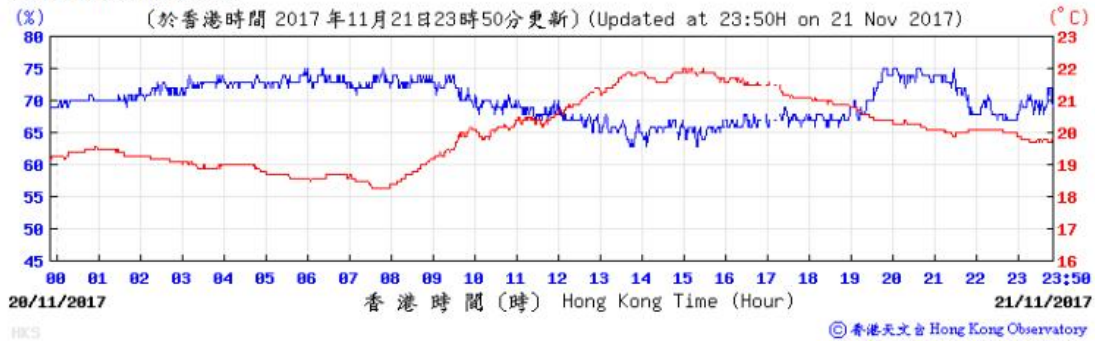

Pressure:



Wind Direction:

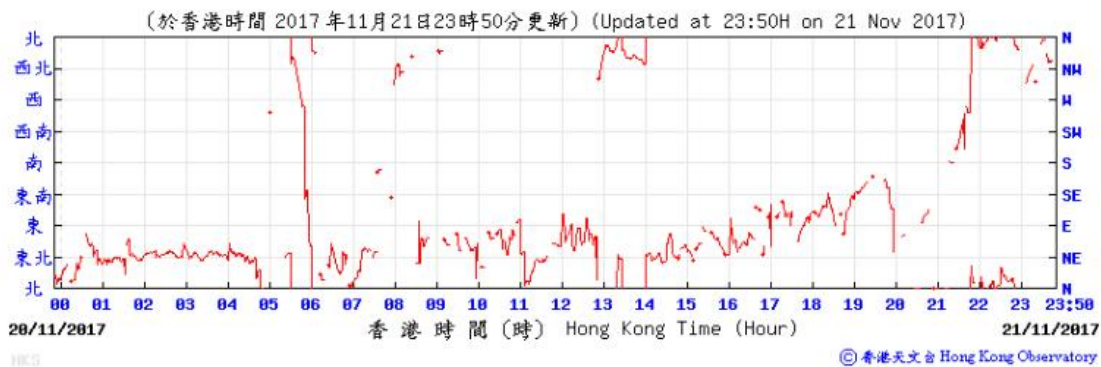


Wind Speed:



22/11/2017


Temperature/Humidity:

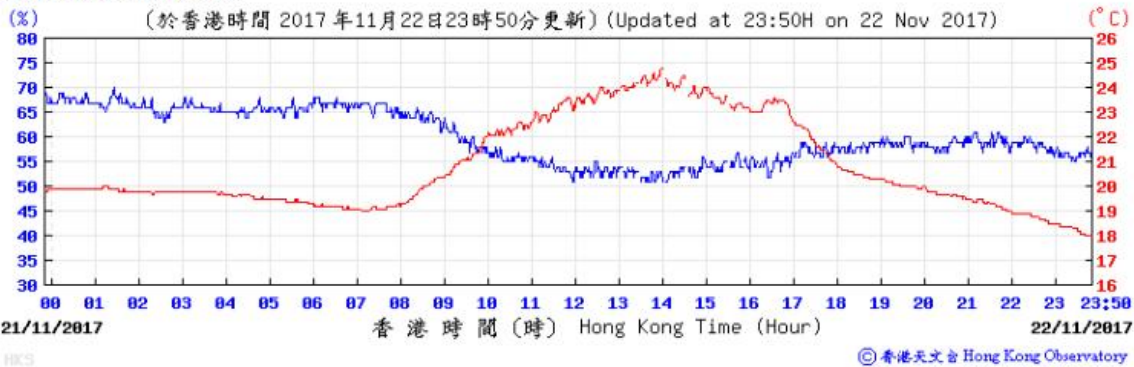


Pressure:



Wind Direction:

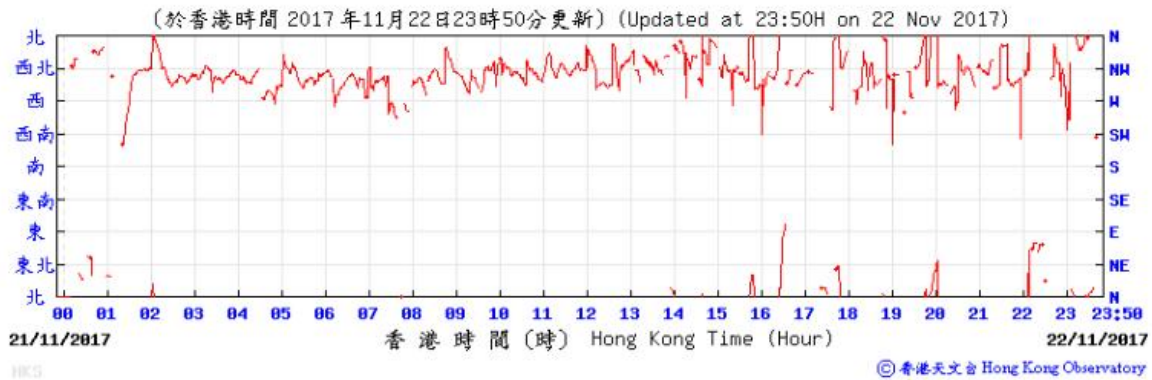


Wind Speed:

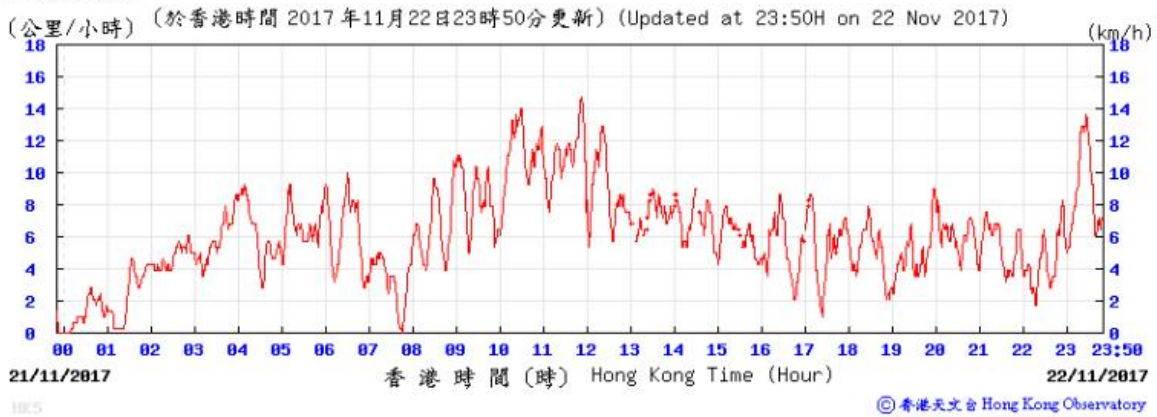

23/11/2017


Temperature/Humidity:

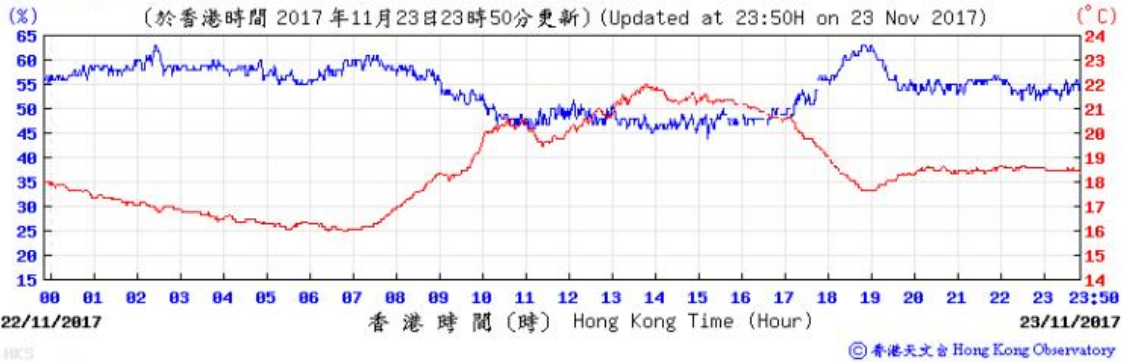


Pressure:



Wind Direction:

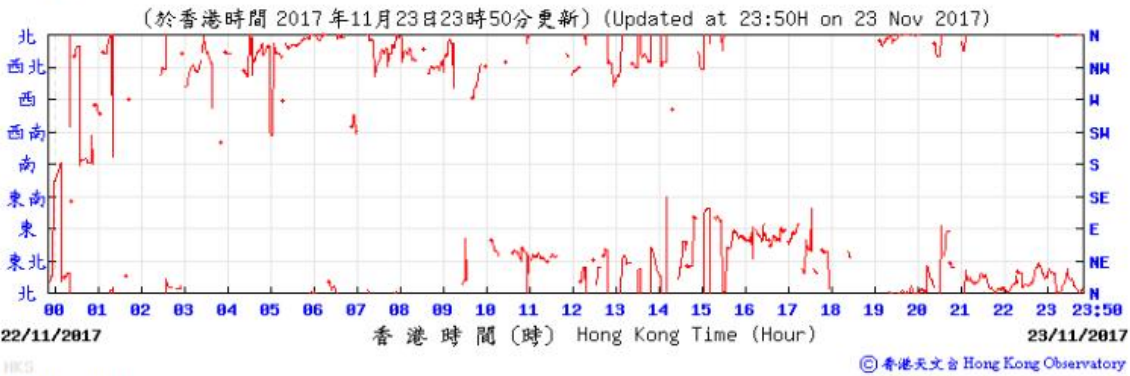


Wind Speed:

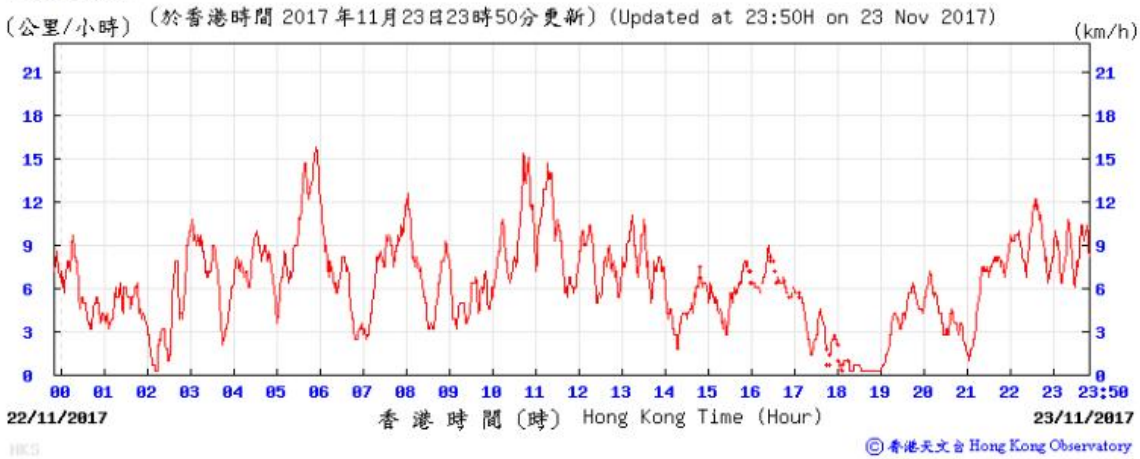

24/11/2017


Temperature/Humidity:

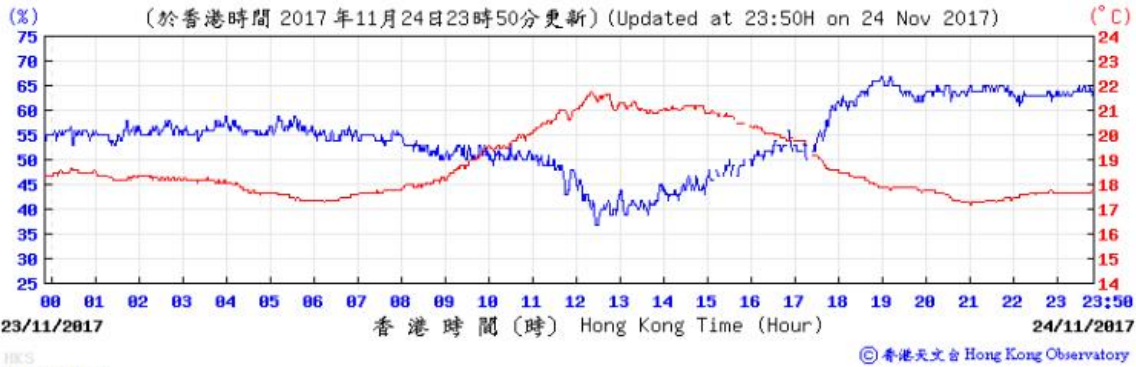


Pressure:



Wind Direction:

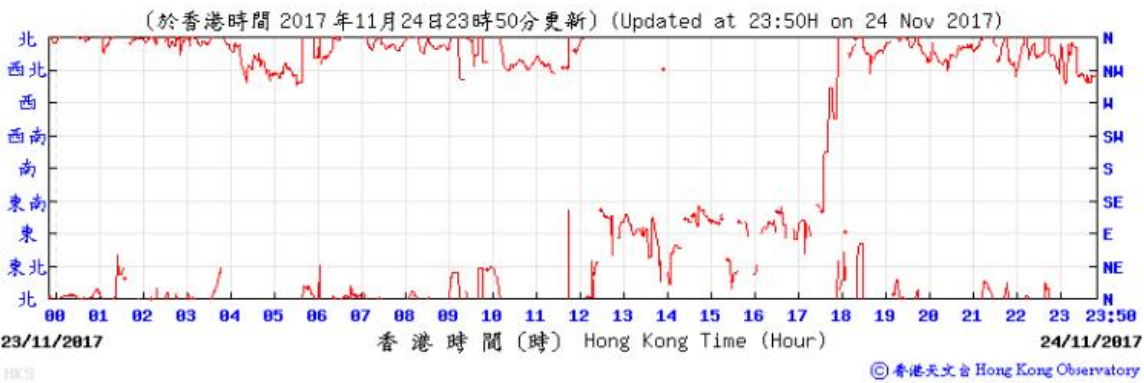

Wind Speed:

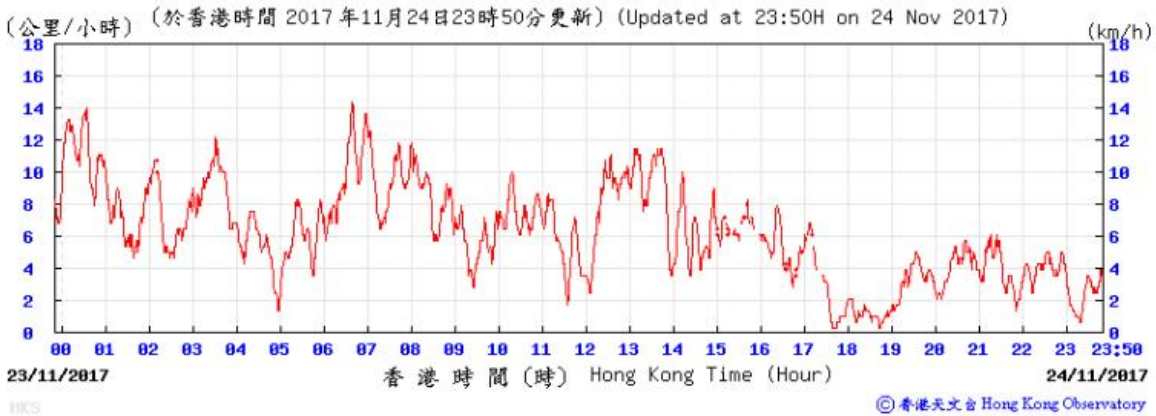

27/11/2017


Temperature/Humidity:




Pressure:



Wind Direction:

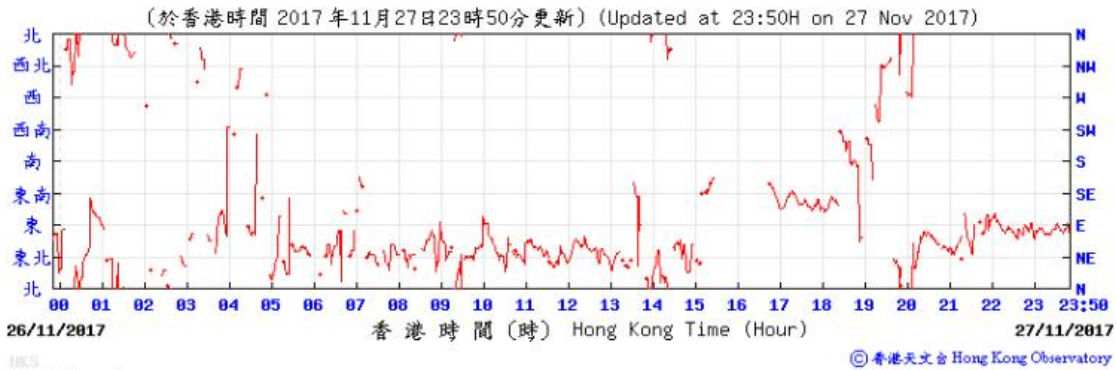


Wind Speed:

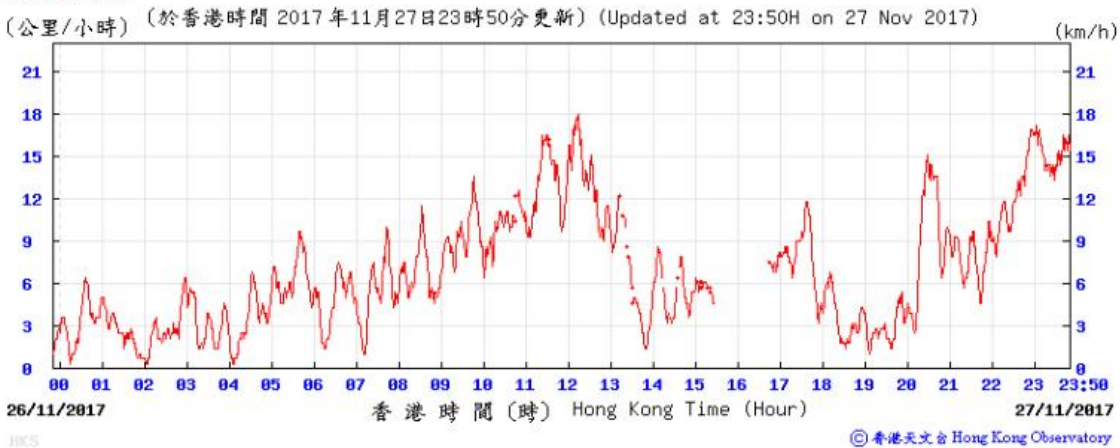

28/11/2017

Temperature/Humidity:

(%) (於香港時間 2017 年11月28日23時50分更新) (Updated at 23:50H on 28 Nov 2017) (°C)

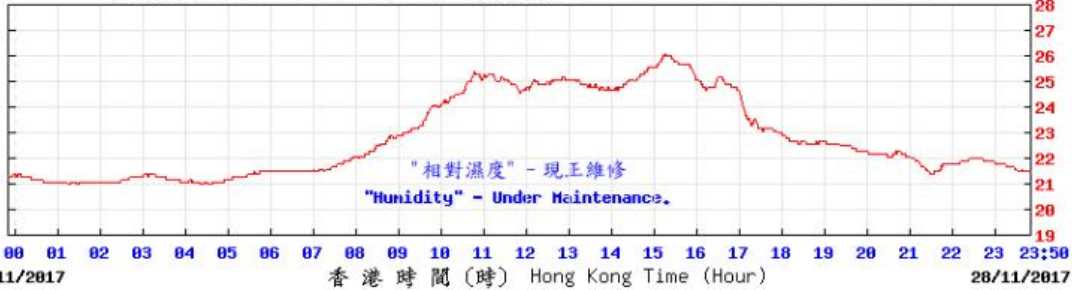


© 香港天文台 Hong Kong Observatory

Pressure:



Wind Direction:


(於香港時間 2017 年11月28日23時50分更新) (Updated at 23:50H on 28 Nov 2017)

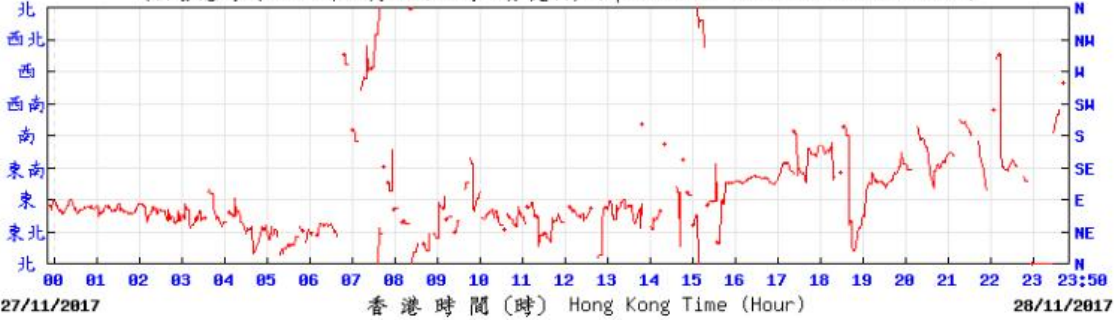

© 香港天文台 Hong Kong Observatory

Wind Speed:

(公里/小時) (於香港時間 2017 年11月28日23時50分更新) (Updated at 23:50H on 28 Nov 2017) (km/h)

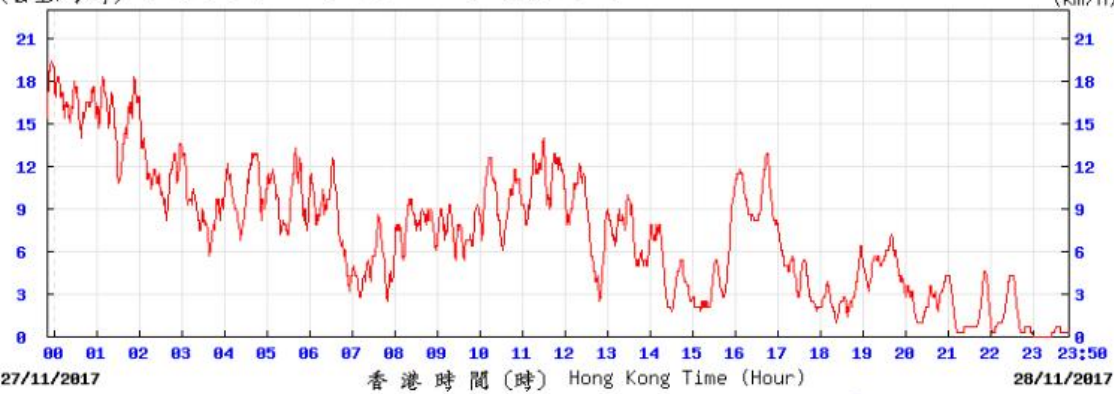

© 香港天文台 Hong Kong Observatory

29/11/2017

Temperature/Humidity:

(%) (於香港時間 2017 年11月29日23時50分更新) (Updated at 23:50H on 29 Nov 2017) (°C)




© 香港天文台 Hong Kong Observatory

Pressure:



Wind Direction:


(於香港時間 2017 年11月29日23時50分更新) (Updated at 23:50H on 29 Nov 2017)

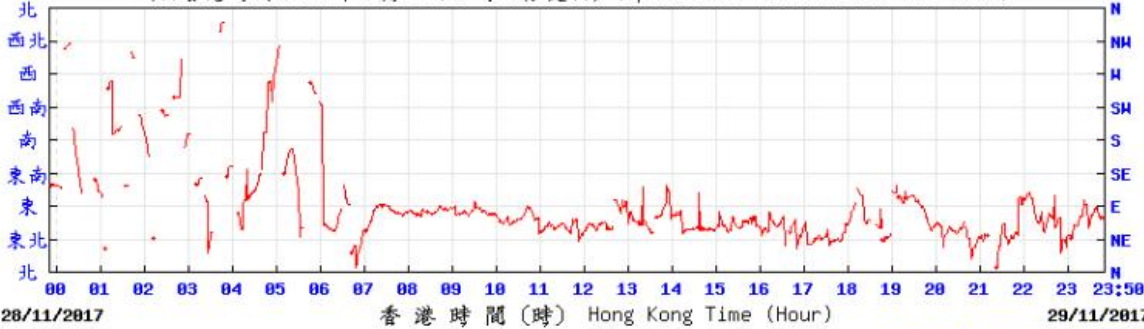

© 香港天文台 Hong Kong Observatory

Wind Speed:


(公里/小時) (於香港時間 2017 年11月29日23時50分更新) (Updated at 23:50H on 29 Nov 2017) (km/h)

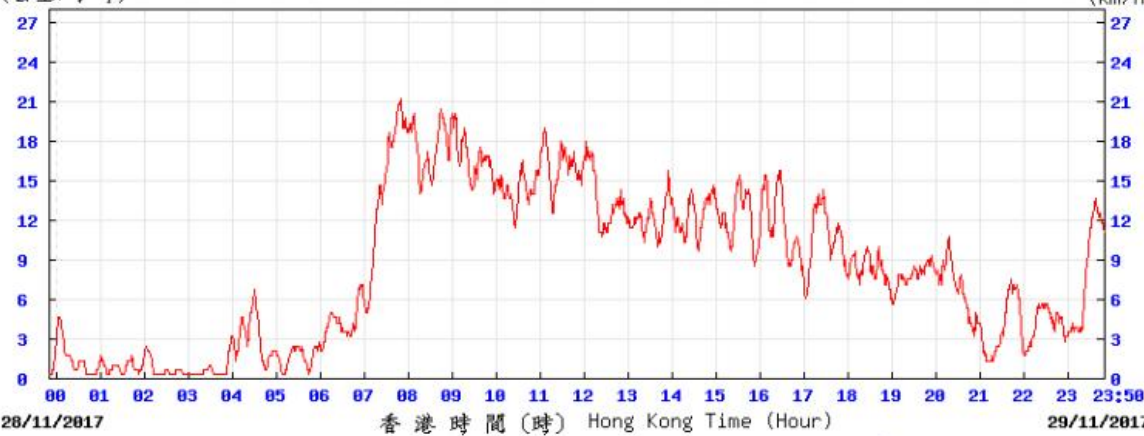

© 香港天文台 Hong Kong Observatory

30/11/2017


Temperature/Humidity:

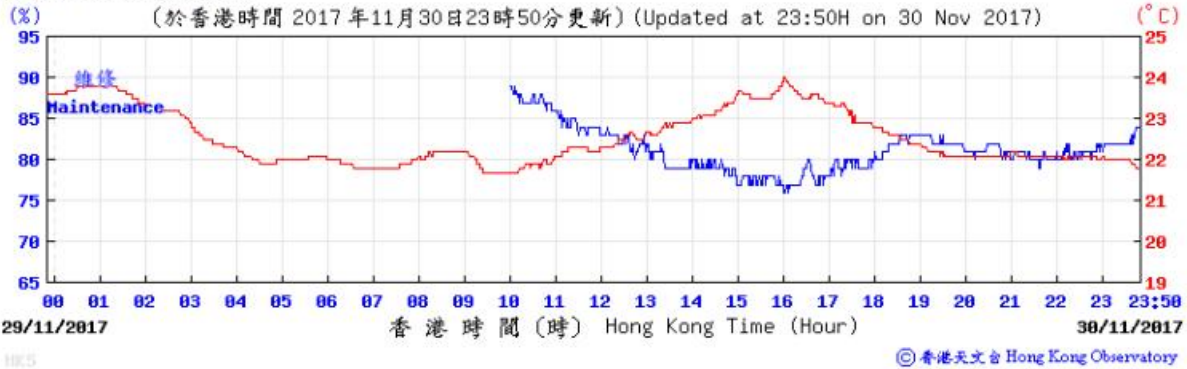


Pressure:



Wind Direction:

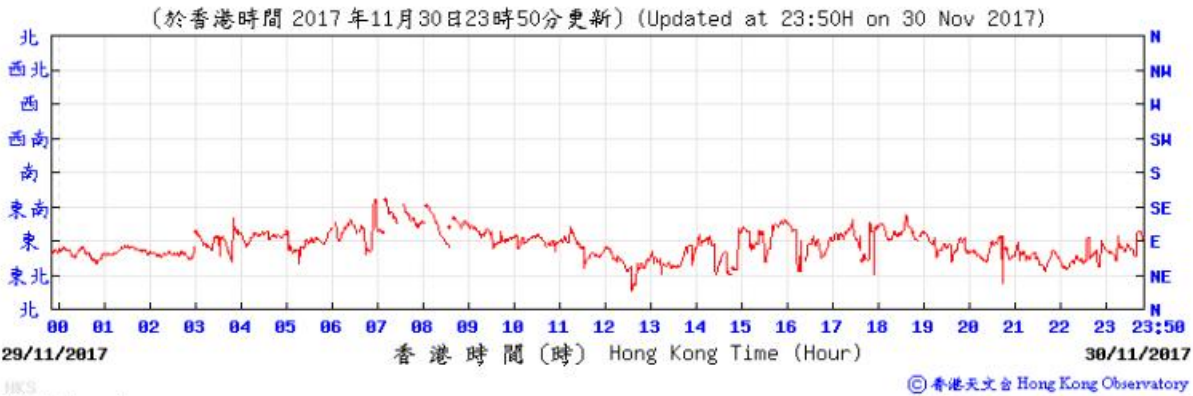

Wind Speed:

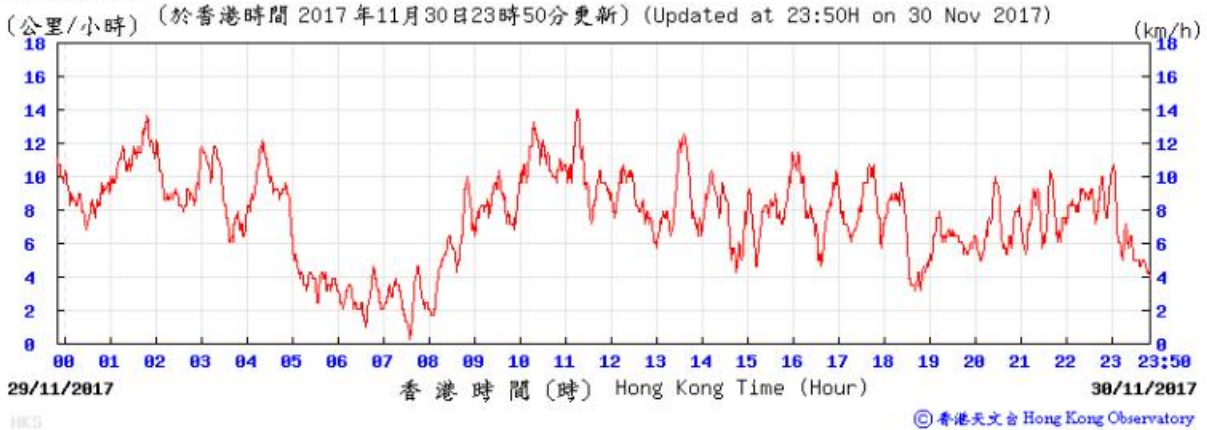

L. Ecological Inspection Records

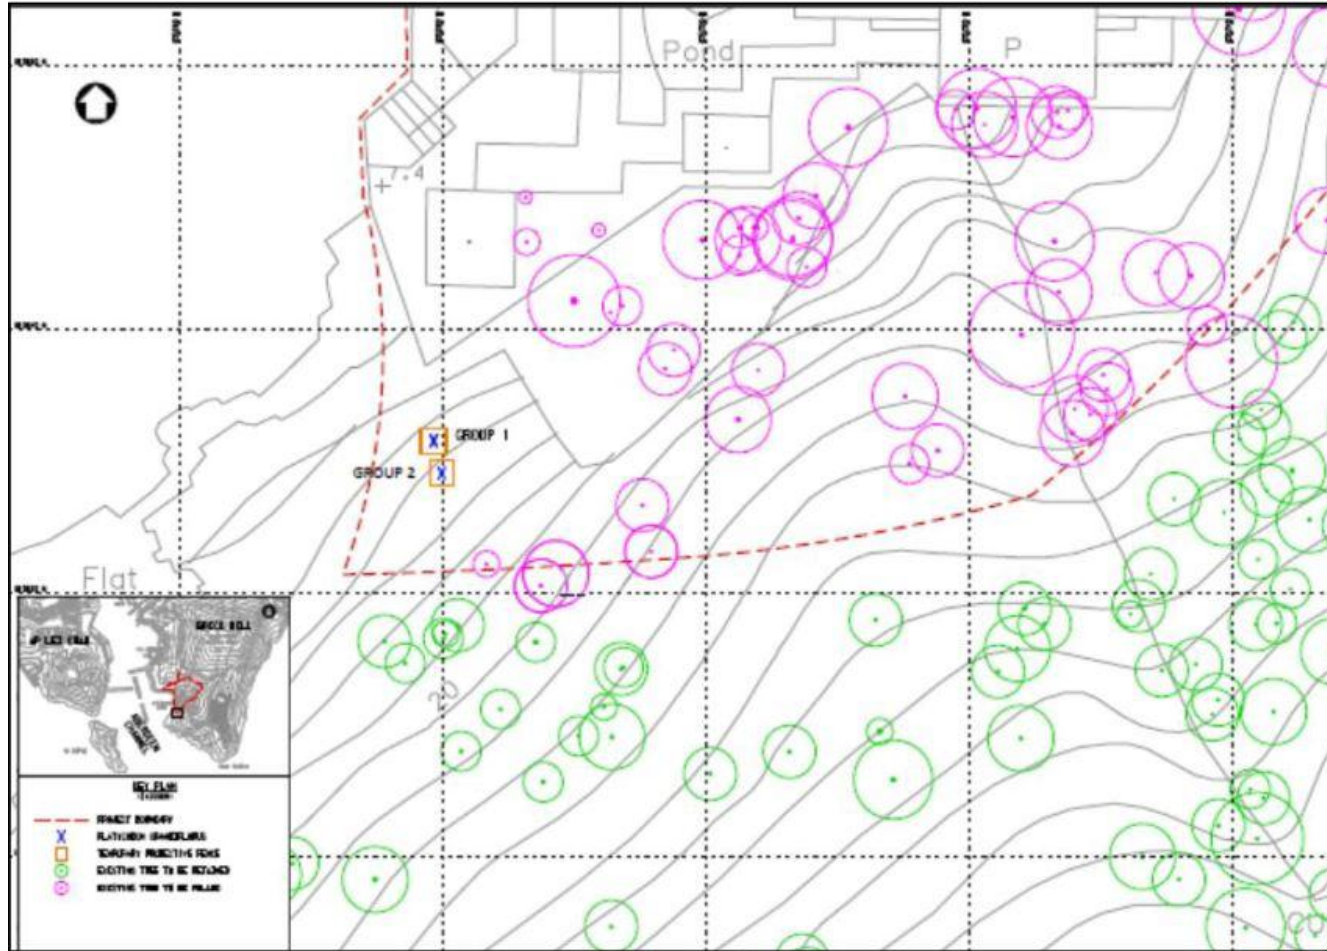


Figure 1 – Location of Two Groups of *Platycodon Grandiflorus*

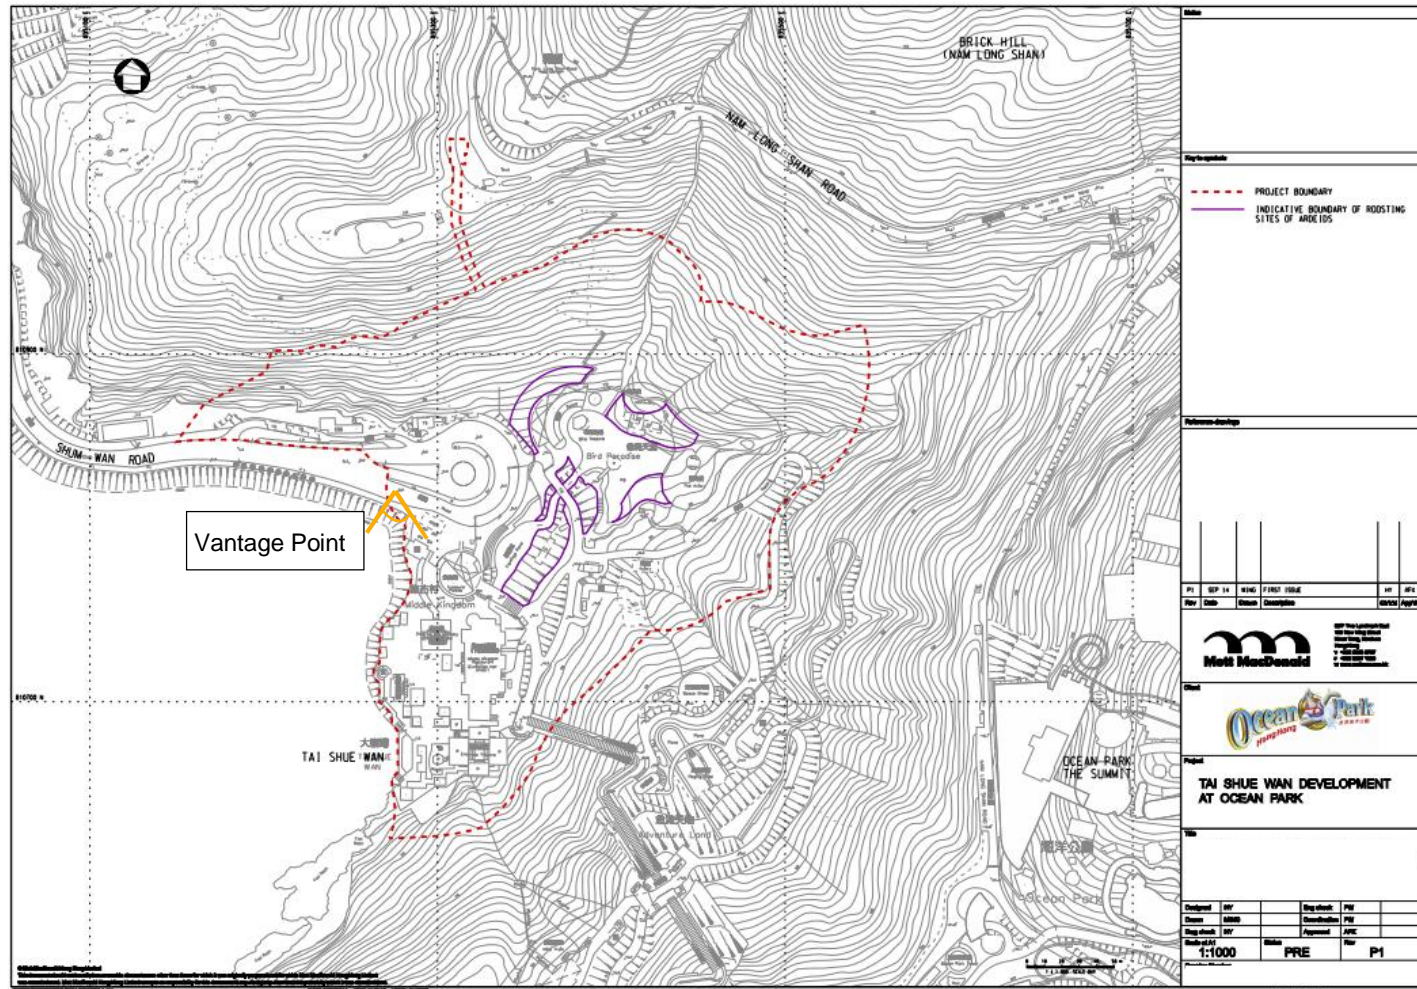


Figure 2: Vantage point for Roosting Activities of Ardeids in Peak Wintering Season



Photo 1 – Group 1 of *Platycodon Grandiflorus*



Photo 2 – Current situation of fencing and warning sign

M. Waste Flow Table

**Ocean Park Tai Shue Wan Water World Project Contact No. TSW-C006
Waterpark - Main Building Works**

Monthly Summary Waste Flow Table for 2017 (Year)

Month	Quantity of Inert C&D Materials							Quantity of Non-inert C&D Materials (i.e. C&D Wastes)					
	Generated	Disposed			Reused			Recycled			Disposed		
	Total Quantity Generated	Disposed as Public Fill at CW-PFBP	Disposed as Public Fill at TKO137	Total Quantity Disposal	Reused in the Contract	Reused in other Projects	Total Quantity Reused	Metals	Paper/ cardboard packaging	Plastics	Chemical Waste	General Refuse	
Unit	(Tonne)	(Tonne)	(Tonne)	(Tonne)	(Tonne)	(Tonne)	(Tonne)	(kg)	(kg)	(kg)	(kg)	(Tonne)	
Jan													
Feb													
Mar													
Apr													
May													
Jun	4917.45	3061.36	156.09	3217.45	1700.00	0.00	1700.00	0.00	258.00	0.00	0.00	60.93	
SUB-TOTAL	4917.45	3061.36	156.09	3217.45	1700.00	0.00	1700.00	0.00	258.00	0.00	0.00	60.93	
Jul	7447.78	6416.15	191.63	6607.78	840.00	0.00	840.00	0.00	0.00	0.00	0.00	45.82	
Aug	4168.41	2211.67	356.74	2568.41	1600.00	0.00	1600.00	0.00	311.00	0.00	0.00	52.86	
Sep	6370.40	4641.55	868.85	5510.40	860.00	0.00	860.00	0.00	0.00	0.00	0.00	71.06	
Oct	5607.83	3646.03	161.80	3807.83	1800.00	0.00	1800.00	0.00	210.00	0.00	0.00	61.09	
Nov	5587.77	4175.11	421.46	4596.57	732.00	259.20	991.20	0.00	210.00	0.00	0.00	86.47	
Dec													
TOTAL	34099.64	24151.87	2156.57	26308.44	7532.00	259.20	7791.20	0.00	989.00	0.00	0.00	378.23	

N. Implementation Schedule for Environmental Mitigation Measures

Appendix C. Implementation Schedule for Environmental Mitigation Measures

EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of measures / Timing of completion of measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	Con	Op	Dec	
Cat.1 Key/specific proposed mitigation measure									
Noise Impact (Construction)									
5.7	3.2	Selecting Quiet Plant The actual SWL of quiet plant is less than the value specified in GW-TM for the same piece of equipment. It should be noted that the silenced PME taken from EPD's Quality Powered Mechanical Equipment (QPME) Inventory.	Within Project area / Duration of the construction phase / Prior to commencement of operation	Contractor appointed by OPC	✓				EIAO and Noise Control Ordinance
5.7	3.2	Use of Movable Barriers Movable noise barriers can be very effective in screening noise from particular items of plant when constructing the Project. Noise barriers located along the active works area close to the noise generating component of a PME could produce at least 10 dB(A) screening for stationary plant and 5 dB(A) for mobile plant provided that the direct line of sight between the PME and the NSRs is blocked.	Within Project area / Duration of the construction phase / Prior to commencement of operation	Contractor appointed by OPC	✓				EIAO and Noise Control Ordinance
Ecological Impact									
10.7	8.3	Inspection of Active Ardeid Nest Prior to site clearance works at the planting area abandoned for ardeid breeding, the area around the boundary of the ardeids roosting site as indicatively shown in Figure 8.1 should be inspected to confirm no active ardeid nest is present. If any active ardeid nest is observed, suitably sized buffer area should be established to avoid human or machinery disturbance until the nest is abandoned.	Indicative boundary of the ardeids roosting site within Project construction site (location indicated in Figure 8.1) / For once / Before site clearance	Qualified ecologist appointed by OPC	✓				EIAO-TM; HK Ordinance Cap. 170
10.7	8.3	Inspection of Short-nosed Fruit Bat As precautionary measure, prior to any proposed arboricultural works of the trees (particularly the Chinese Fan-palms), daytime	Project construction site / For once / Before arboricultural works of	ET appointed by OPC	✓				EIAO-TM; HK Ordinance Cap. 170

Tai Shue Wan Development at Ocean Park Environmental Monitoring and Audit Manual



EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of measures / Timing of completion of measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	Con	Op	Dec	
		inspection should be carried out to confirm no Short-nosed Fruit Bat is present. If any Short-nosed Fruit Bat is observed roosting, suitably sized buffer area should be established around the tree to minimise human or machinery disturbance until the bat has left.	the trees						
10.7	8.3	In-situ Preservation of Plant Species of Conservation Interest During construction phase, protective fence for the identified flora species of conservation concern shall be erected and maintained.	Project construction site / Throughout construction stage / Until completion of all construction activities	Contractor appointed by OPC	✓				EIAO-TM
10.7	8.3	Inspection of Ardeid Nest during breeding season After commencement of construction phase, the Site should be monitored monthly in breeding season (April to July) to check for any potential breeding and nesting activities.	Project construction site / Throughout construction stage / Until completion of all construction activities	Qualified ecologist appointed by OPC	✓				EIAO-TM
10.7	8.2	Timing of site clearance and tree felling works Site clearance and tree felling works at the existing ardeid night roost location as shown in Figure 8.1 should be avoided during the peak wintering season of ardeids, i.e. between November and March.	Indicative boundary of the ardeids roosting site within Project construction site (location indicated in Figure 8.1) / Throughout construction stage / Until completion of site clearance and tree felling works within the boundary	Contractor appointed by OPC	✓				EIAO-TM
10.7	8.3	Compensation for Ardeid Roosting Site An enhancement area with following features should be provided as an alternative roosting site for ardeids. <ul style="list-style-type: none"> ▪ The location is at southern part of the Project area (location indicated in Figure 8.1) ▪ The enhancement area shall include a Flamingo Pond ▪ Native tree species <i>Macaranga tanarius</i> and <i>Celtis sinensis</i> and tree species which was used by ardeids for roosting <i>Mallotus paniculatus</i>, <i>Ficus hispida</i> and <i>Cratogeomys cochinchinense</i> shall be considered in the plan. ▪ Heavy standard sized trees shall be considered for planting to allow early establishment of the trees around the Flamingo 	Southern part of Project construction site (location indicated in Figure 8.1) / Before and throughout construction stage / Until completion of Flamingo Pond construction and tree planting activities at that area	Qualified ecologist and Contractor appointed by OPC	✓	✓			EIAO-TM

Tai Shue Wan Development at Ocean Park
Environmental Monitoring and Audit Manual



EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of measures / Timing of completion of measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	Con	Op	Dec	
10.7	8.3	<p>Pond.</p> <p>Compensation for Woodland Habitat</p> <ul style="list-style-type: none"> ▪ Provision of a Woodland Area of about 1.62 ha, which includes 0.84 ha woodland compensation on-site and 0.78 ha on-site woodland reinstatement, to mitigate for permanent loss of woodland habitat. ▪ In the woodland compensation area, whips should be planted with predominately native tree species similar to the affected woodland, such as <i>Celtis sinensis</i>, <i>Cratogeomys cochinchinense</i>, <i>Polyspora axillaris</i> and <i>Sterculia lanceolata</i>. 	Location of Woodland Compensation Area indicated in Figure 8.2/ Before and throughout construction stage / Until completion of all construction activities	Contractor appointed by OPC	✓	✓	✓	EIAO-TM	
Landscape and Visual Impact (Construction)									
Table 12.13 (CP07)	Table 9.1 (CP07)	<p>Temporary Tree Nurseries</p> <p>Temporary tree nurseries may be set up within the Project area at an early stage to allow small trees to grow during the construction period. By the time these trees are needed for landscape planting at the end of the construction phase, they will have grown larger, require minimal pruning and suffer much less damage during transplanting, as the moving distance from an on-site rather than off-site nursery will be much smaller. The temporary tree nurseries can also temporarily hold the existing trees to be transplanted if direct transplantation from their original locations to the final recipient location is impracticable. The locations of the temporary tree nurseries should be carefully selected so that the trees can also act as screen planting to block the views of the Project area from the VSRs during the construction phase, if practicable.</p>	Project construction site / Throughout construction stage / Until completion of all construction activities	Contractor appointed by OPC	✓	✓	✓	EIAO-TM	
Table 12.13 (CP08)	Table 9.1 (CP08)	<p>Advance Planting</p> <p>Advance planting should be undertaken at the earliest possible stage of the construction phase of the project. Plant species, preferably native ones, should be carefully selected to blend in with the existing preserved vegetation. Landscape planting in movable planters should also be considered as a temporary greening measure for the Project area.</p>	Project construction site / Throughout construction stage / Until completion of all construction activities	Contractor appointed by OPC	✓	✓	✓	EIAO-TM	
Landscape and Visual Impact (Operation)									
Table 12.14 (OP04)	Table 9.2 (OP04)	<p>Green Roofs and Vertical Greening</p> <p>Green Roofs and Vertical Greening should be provided where feasible and appropriate to screen and soften the hard edges of</p>	Project building rooftops / During design stage / Throughout operation	Design Architect / Contractor appointed by OPC	✓	✓	✓	EIAO-TM	

Tai Shue Wan Development at Ocean Park
Environmental Monitoring and Audit Manual



EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Implementation Stage ¹					Relevant Legislation & Guidelines
			Location / Duration of measures / Timing of completion of measures	Implementation Agent	Des	Con	Op	
		building structures.	phase					
Table 12.14 (OP05)	Table 9.2 (OP05)	Reprovision of Flamingo Pond A pond is recommended to replace the demolished Flamingo Pond as compensation for the loss of semi-natural ponds, where wildlife, such as birds, can utilise.	Project area / During design stage / Throughout operation phase	Design Architect / Contractor appointed by OPC	✓	✓		EIAO-TM
Table 12.14 (OP07)	Table 9.2 (OP07)	Woodland Compensation 1.53ha of affected woodland is recommended to be reinstated / compensated by 1.62ha of whip tree planting adjacent to the existing unaffected woodland and tall shrubland. Native species should be proposed as far as practicable to re-create a native landscape, restore the ecological habitats and blend in with the existing native vegetation.	Project area / During design stage / Throughout operation phase	Design Architect / Contractor appointed by OPC	✓	✓		EIAO-TM
Cat. 2 Submission required post EIA stage								
Sewerage and Sewage Treatment Implications								
7.7	5.2	Detailed Sewerage Design Report In order to prevent septicity problems during operation phase, a detailed sewerage design report should be submitted to DSD for approval prior to installation of the rising mains.	Rising mains site / During design stage	Design Engineer	✓			Sewerage Manual Part 1
Ecological Impact (Construction)								
10.7	8.3	Vegetation Survey for Plant Species of Conservation Interest For precautionary purposes and to further ensure no flora species of conservation interest to be affected, a detailed vegetation survey need to conduct to the exact locations, number and condition of individuals of <i>Platycodon grandiflorus</i> .	Project construction site / For once / Before site clearance	Qualified botanist/ecologist of the ET appointed by OPC	✓			EIAO-TM; Hong Kong Ordinance Cap. 96
10.7	8.3	Woodland Compensation Plan A Woodland Compensation Plan shall be prepared and submitted to AFCD for approval no later than one month prior to commencement of site clearance. The plan shall include but not limited to the following: <ul style="list-style-type: none"> ▪ Timing of planting works ▪ Planting location ▪ Species, size and number of trees ▪ Monitoring methodology 	Location of Woodland Compensation Area indicated in Figure 8.2/ Before construction stage / No later than one month prior to commencement of site clearance	Qualified botanist/ecologist of the ET appointed by OPC	✓			EIAO-TM

Tai Shue Wan Development at Ocean Park
Environmental Monitoring and Audit Manual



EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of measures / Timing of completion of measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	Con	Op	Dec	
<p>■ Action Plan</p>									
Landscaping and Visual Impact (Construction)									
Table 12.13 (CP05)	Table 9.1 (CP05)	<p>Transplantation of Existing Trees</p> <p>Trees which are in direct conflict with the development proposals and suitable for transplantation should be transplanted as far as practicable. A tree transplantation proposal should be submitted together with the tree removal application. Trees proposed to be transplanted should preferably be transplanted from their original locations directly to their final recipient locations in one go. If this is infeasible, the trees should be held in a temporary tree nursery, preferably within the Project area, where the trees will be properly maintained.</p>	Project construction site / Throughout construction stage / Until completion of all construction activities	Contractor appointed by OPC	✓	✓			EIAO-TM; LAO PN No. 07/2007
Landscaping and Visual Impact (Operation)									
Table 12.14 (OP02)	Table 9.2 (OP02)	<p>Compensatory Tree Planting</p> <p>Existing trees to be felled should be compensated as far as practicable. Native species should be proposed as far as practicable to re-create a native landscape, restore the ecological habitats and blend in with the existing native vegetation. A compensatory tree planting proposal should be submitted together with the tree removal application for approval by relevant authorities in accordance with LAO Practice Note No. 7/2007. It is recommended that approximately 608 heavy standard trees and approximately 18,202 whip trees could be planted on-site. The availability of off-site compensatory tree planting area is still subject to further investigation and agreement with relevant authorities.</p>	Project area / During design stage / Throughout operation phase	Design Architect / Contractor appointed by OPC	✓	✓			EIAO-TM; LAO PN No. 07/2007
Cat. 3 Good site practice/housekeeping measures under EM&A mechanism									
Air Quality Impact (Construction)									
3.9.1	2.2	<p>Dust Control Measures</p> <p>To achieve compliance with the FSP, RSP and TSP criteria during the construction phase, good practices for dust control should be implemented to reduce dust impacts. The dust control measures are detailed as follows:</p> <ul style="list-style-type: none"> ■ Use of regular water spraying (once every 2.5 hours or 4 times per day) to reduce dust emissions from heavy construction activities (including ground excavation, earth moving, etc.) at all active works area exposed site surfaces and unpaved 	Project construction site / Duration of the construction phase / Prior to commencement of operation	Contractor appointed by OPC	✓				EIA Recommendation and Air Pollution Control (Construction Dust) Regulation

Tai Shue Wan Development at Ocean Park Environmental Monitoring and Audit Manual



EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of measures / Timing of completion of measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	Con	Op	Dec	
		<p>roads, particularly during dry weather.</p> <ul style="list-style-type: none"> Covering 80% of stockpiling area by impervious sheets and spraying all dusty material with water immediately prior to any loading transfer operations to keep the dusty materials wet during material handling at the stockpile areas <p>Relevant dust control practices as stipulated in the Air Pollution Control (Construction Dust) Regulation should be adopted:</p> <p>Good Site Management</p> <ul style="list-style-type: none"> Good site management is important to help reduce potential air quality impact down to an acceptable level. As a general guide, the Contractor should maintain high standards of housekeeping to prevent emissions of fugitive dust. Loading, unloading, handling and storage of raw materials, wastes or by-products should be carried out in a manner so as to minimise the release of visible dust emission. Any piles of materials accumulated on or around the work areas should be cleaned up regularly. Cleaning, repair and maintenance of all plant facilities within the work areas should be carried out in a manner minimising generation of fugitive dust emissions. The material should be handled properly to prevent fugitive dust emission before cleaning. <p>Disturbed Parts of the Roads</p> <ul style="list-style-type: none"> Main temporary access points should be paved with concrete, bituminous hardcore materials or metal plates and be kept clear of dusty materials; or Unpaved parts of the road should be sprayed with water or a dust suppression chemical so as to keep the entire road surface wet. <p>Exposed Earth</p> <ul style="list-style-type: none"> Exposed earth should be properly treated by compaction, hydroseeding, vegetation planting or seeding with latex, vinyl, bitumen within six months after the last construction activity on the site or part of the site where the exposed earth lies. <p>Loading, Unloading or Transfer of Dusty Materials</p> <ul style="list-style-type: none"> All dusty materials should be sprayed with water immediately prior to any loading or transfer operation so as 							

Tai Shue Wan Development at Ocean Park Environmental Monitoring and Audit Manual



EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of measures / Timing of completion of measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	Con	Op	Dec	
		<p>to keep the dusty material wet.</p> <p>Debris Handling</p> <ul style="list-style-type: none"> Any debris should be covered entirely by impervious sheeting or stored in a debris collection area sheltered on the top and the three sides. Before debris is dumped into a chute, water should be sprayed onto the debris so that it remains wet when it is dumped. <p>Transport of Dusty Materials</p> <ul style="list-style-type: none"> Vehicles used for transporting dusty materials/spoils should be covered with tarpaulin or similar material. The cover should extend over the edges of the sides and tailboards. <p>Wheel washing</p> <ul style="list-style-type: none"> Vehicle wheel washing facilities should be provided at each construction site exit. Immediately before leaving the construction site, every vehicle should be washed to remove any dusty materials from its body and wheels. <p>Use of vehicles</p> <ul style="list-style-type: none"> The speed of the trucks within the site should be controlled to about 10 km/hour in order to reduce adverse dust impacts and secure the safe movement around the site. Immediately before leaving the construction site, every vehicle should be washed to remove any dusty materials from its body and wheels. Where a vehicle leaving the construction site is carrying a load of dusty materials, the load should be covered entirely by clean impervious sheeting to ensure that the dusty materials do not leak from the vehicle. <p>Site hoarding</p> <ul style="list-style-type: none"> Where a site boundary adjoins a road, street, service lane or other area accessible to the public, hoarding of not less than 2.4 m high from ground level should be provided along the entire length of that portion of the site boundary except for a site entrance or exit 							
Noise Impact (Construction)									

Tai Shue Wan Development at Ocean Park Environmental Monitoring and Audit Manual



EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of measures / Timing of completion of measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	Con	Op	Dec	
5.7	3.2	<p>Good Site Practice</p> <p>Good site practice and noise management can significantly reduce the impact of construction site activities on nearby NSRs.</p> <ul style="list-style-type: none"> ▪ only well-maintained plant to be operated on-site and plant should be serviced regularly during the construction works; ▪ machines and plant that may be in intermittent use to be shut down between work periods or should be throttled down to a minimum; ▪ plant known to emit noise strongly in one direction, should, where possible, be orientated to direct noise away from the NSRs; ▪ mobile plant should be sited as far away from NSRs as possible; and ▪ material stockpiles and other structures to be effectively utilised, where practicable, to screen noise from on-site construction activities. 	Project construction site / Duration of the construction phase / Prior to commencement of operation	Contractor appointed by OPC	✓			EIAO and Noise Control Ordinance	
Noise Impact (Operation)									
5.7	3.3.2	<p>Fixed Plant Noise</p> <p>With the adoption of the proposed maximum allowable SWLs, all representative NSRs is expected to comply with the relevant noise criteria for the daytime and evening time periods. No adverse fixed plant noise impact is anticipated.</p> <p>It is also recommended that the following noise reduction measures should be considered as far as practicable during design stage:</p> <ul style="list-style-type: none"> ▪ choose quiet plant such as those which have been effectively silenced; ▪ include noise levels specification when ordering new plant (including chiller and E&M equipment); ▪ locate fixed plant / louvre away from any NSRs as far as practicable; ▪ locate fixed plant in walled plant rooms or in specially designed enclosures; ▪ locate noisy machine in a basement or a completely separate building; 	Within Project area / Prior to operation phase / Duration of the operation phase / Throughout operation phase	Design Architect / Contractor appointed by OPC	✓	✓	✓	EIAO and Noise Control Ordinance	

Tai Shue Wan Development at Ocean Park
Environmental Monitoring and Audit Manual



EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of measures / Timing of completion of measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	Con	Op	Dec	
5.7	3.3.2	<ul style="list-style-type: none"> install direct noise mitigation measures including silencers, acoustic louvres and acoustic enclosure where necessary; and develop and implement a regularly scheduled plant maintenance programme so that equipment is properly operated and serviced in order to maintain a controlled level of noise. <p>Prior to the operation of the Project, noise commissioning tests for all major fixed noise sources should be conducted.</p> <p>Open Air Entertainment Noise With the adoption of the proposed maximum allowable SWLs, all representative NSRs is expected to comply with the relevant noise criteria for the daytime and evening periods, the following measures should be considered as far as practicable during stage:</p> <ul style="list-style-type: none"> use small clusters of small power loudspeakers rather than a few large power loudspeakers; and loudspeakers should be pointed away from nearby NSRs. 	Within Project area / Duration of the operation phase / Throughout operation phase	Design Architect / Contractor appointed by OPC	✓	✓			EIAO and Noise Control Ordinance
Water Quality Impact (Construction)									
6.7	4.2	<p>Construction Site Runoff The site practices outlined in ProPECC Note PN 1/94 should be followed as far as practicable in order to minimise surface runoff and erosion. The following measures are recommended to protect water quality of the inland areas:</p> <ul style="list-style-type: none"> At the start of site establishment, perimeter cut-off drains to direct off-site water around the site should be constructed with internal drainage works and erosion and sedimentation control facilities implemented. Channels, earth bunds or sand bag barriers should be provided on site to direct storm water to silt removal facilities. The design of the temporary on-site drainage system should be undertaken by the Contractors prior to the commencement of construction; Sand/ silt removal facilities such as sand/silt traps and sediment basins should be provided to remove sand/silt particles from runoff to meet the requirements of the TM standards under the WPCO. The design of efficient silt removal facilities should be based on the guidelines in 	Project construction site / Duration of the construction phase	Contractor appointed by OPC	✓				EIAO-TM; ProPECC Note PN 1/94; WPCO; TM-DSS

Tai Shue Wan Development at Ocean Park Environmental Monitoring and Audit Manual



EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of measures / Timing of completion of measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	Con	Op	Dec	
		<p>Appendix A1 of ProPECC Note PN 1/94. Sizes may vary depending upon the flow rate. The detailed design of the sand/silt traps should be undertaken by the Contractors prior to the commencement of construction;</p> <ul style="list-style-type: none"> ▪ All drainage facilities and erosion and sediment control structures should be regularly inspected and maintained to ensure proper and efficient operation at all times and particularly during rainstorms. Deposited silt and grit should be regularly removed, at the onset of and after each rainstorm to ensure that these facilities are functioning properly at all times; ▪ Measures should be taken to minimise the ingress of site drainage into excavations. If excavation of trenches in wet periods is necessary, they should be dug and backfilled in short sections wherever practicable. Water pumped out from site formation excavations should be discharged into storm drains via silt removal facilities; ▪ All vehicles and plant should be cleaned before leaving a construction site to ensure no earth, mud, debris and the like is deposited by them on roads. An adequately designed and sited wheel washing facility should be provided at construction site exit where practicable. Wash-water should have sand and silt settled out and removed regularly to ensure the continued efficiency of the process. The section of access road leading to, and exiting from, the wheel-wash bay to the public road should be paved with sufficient backfall toward the wheel-wash bay to prevent vehicle tracking of soil and silty water to public roads and drains; ▪ Open stockpiles of construction materials or construction wastes on-site should be covered with tarpaulin or similar fabric during rainstorms. Measures should be taken to prevent the washing away of construction materials, soil, silt or debris into any drainage system; ▪ Manholes (including newly constructed ones) should be adequately covered and temporarily sealed so as to prevent silt, construction materials or debris being washed into the drainage system and stormwater runoff being directed into foul sewers; ▪ Precautions should be taken at any time of the year when 							

Tai Shue Wan Development at Ocean Park Environmental Monitoring and Audit Manual



EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of measures / Timing of completion of measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	Con	Op	Dec	
6.7	4.2	<p>rainstorms are likely. Actions should be taken when a rainstorm is imminent or forecasted and actions to be taken during or after rainstorms are summarised in Appendix A2 of ProPECC Note PN 1/94. Particular attention should be paid to the control of silty surface runoff during storm events, especially for areas located near steep slopes; and,</p> <ul style="list-style-type: none"> Bentonite slurries used on site should be reconditioned and reused wherever practicable. Temporary enclosed storage locations should be provided on site for any unused bentonite that needs to be transported away after all the related construction activities are completed. The requirements in ProPECC Note PN 1/94 should be adhered to in the handling and disposal of bentonite slurries. <p>The Contractor would be required to obtain a license from EPD under the WPCO for discharge to the public drainage system or the marine environment. Construction site discharge should be collected by the temporary drainage system installed by the Contractor and treated or desilted on-site to fulfil the WPCO discharge license requirements before discharge.</p>	Project construction site / Duration of the construction phase	Contractor appointed by OPC	✓			EIAO-TM; ProPECC Note PN 1/94	
6.7	4.2	<p>General Construction Activities Best Management Practices (BMPs) should be implemented at the construction site, including proper handling, sorting and storage of construction solid waste, debris and refuse generated on-site prior to disposal. Stockpiles of cement and other construction materials should be kept covered when not being used. The Contractor should also follow the guidelines set in the "Pesticides Used for Outdoor Mosquito Control", published by AFCD in 2010, for mosquito control on site.</p> <p>Expansion of Existing Storm U-Channel Guidelines and measures summarised in ProPECC PN 1/94 for trenching activities should be implemented.</p>	Project construction site / Duration of the construction phase	Contractor appointed by OPC	✓			ProPECC Note PN 1/94	
6.7	4.2	<p>Interception of Natural Streams Guidelines and measures summarised in ProPECC PN 1/94 for excavation and stockpiling activities should be implemented.</p>	Project construction site / Duration of the construction phase	Contractor appointed by OPC	✓			ProPECC Note PN 1/94	
6.7	4.2	<p>Site Formation Works The construction programme should be properly planned to minimise excavation works during the wet season (April to September), temporarily exposed slope/soil surfaces should be</p>	Project construction site / Duration of the construction phase	Contractor appointed by OPC	✓			ProPECC Note PN 1/94	

Tai Shue Wan Development at Ocean Park
Environmental Monitoring and Audit Manual



EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Implementation Stage ¹					Relevant Legislation & Guidelines
			Location / Duration of measures / Timing of completion of measures	Implementation Agent	Des	Con	Op	
		covered by a tarpaulin or other means, as far as practicable. Interception channels should be provided (e.g. along the crest/edge of the excavation) to prevent storm runoff from washing across exposed soil surfaces. Arrangements should be in place to ensure that adequate surface protection measures can be safely carried out well before the arrival of a rainstorm. Measures will be taken to minimise water ingress into the excavation. Diverting any water from the excavated areas to on-site wastewater treatment facilities for treatment prior to discharge should also be performed. Other measures that need to be implemented before, during and after rainstorms are summarised in ProPECC PN 1/94.						
6.7	4.2	<p>Construction of Sewage Sump Pit and Rising Mains</p> <p>Measures for excavation works summarised for site formation works should also be implemented during construction of the sewage sump pit.</p> <p>During the laying of rising mains, guidelines and measures summarised in ProPECC PN 1/94 for trenching activities should be performed. Concrete water generated from the construction of the concrete support should be collected and treated with the wastewater treatment facilities prior to discharge.</p> <p>Accidental Spillage</p> <p>The Contractor should register as a chemical waste producer if chemical wastes are produced from construction activities. The Waste Disposal Ordinance (Cap 354) and its subsidiary regulations in particular the Waste Disposal (Chemical Waste) (General) Regulation should be observed and complied with for control of chemical wastes. This will prevent contamination of top soil and water pollution due to construction site runoff.</p> <p>Maintenance of vehicles and equipment, involving activities with potential for leakage and spillage, should only be undertaken within areas appropriately equipped to control these discharges.</p> <p>Oils and fuels should only be stored in designated areas which have pollution prevention facilities. To prevent spillage of fuels and solvents to any nearby storm water drain, all fuel tanks and storage areas should be provided with locks and be sited on sealed areas, within bunds of a capacity equal to 110% of the storage capacity of the largest tank. The bund should be drained of rainwater after a rain event.</p>	Project construction site / Duration of the construction phase	Contractor appointed by OPC		✓		ProPECC Note PN 1/94
6.7	4.2	<p>Accidental Spillage</p> <p>The Contractor should register as a chemical waste producer if chemical wastes are produced from construction activities. The Waste Disposal Ordinance (Cap 354) and its subsidiary regulations in particular the Waste Disposal (Chemical Waste) (General) Regulation should be observed and complied with for control of chemical wastes. This will prevent contamination of top soil and water pollution due to construction site runoff.</p> <p>Maintenance of vehicles and equipment, involving activities with potential for leakage and spillage, should only be undertaken within areas appropriately equipped to control these discharges.</p> <p>Oils and fuels should only be stored in designated areas which have pollution prevention facilities. To prevent spillage of fuels and solvents to any nearby storm water drain, all fuel tanks and storage areas should be provided with locks and be sited on sealed areas, within bunds of a capacity equal to 110% of the storage capacity of the largest tank. The bund should be drained of rainwater after a rain event.</p>	Project construction site / Duration of the construction phase	Contractor appointed by OPC		✓		ProPECC Note PN 1/94; Waste Disposal Ordinance (Cap 354); Waste Disposal (Chemical Waste) (General) Regulation

Tai Shue Wan Development at Ocean Park Environmental Monitoring and Audit Manual



EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of measures / Timing of completion of measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	Con	Op	Dec	
		<p>Disposal of chemical wastes should be carried out in compliance with the Waste Disposal Ordinance. The Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes published under the Waste Disposal Ordinance details the requirements to deal with chemical wastes. General requirements are given as follows:</p> <ul style="list-style-type: none"> ▪ Suitable containers should be used to hold the chemical wastes to avoid leakage or spillage during storage, handling and transport. ▪ Chemical waste containers should be suitably labelled, to notify and warn the personnel who are handling the wastes, to avoid accidents. ▪ Storage area should be selected at a safe location on site and adequate space should be allocated to the storage area. 							
6.7	4.2	<p>Sewage Effluent from the Construction Workforce The Contractor should provide temporary sanitary facilities, such as portable chemical toilets within the construction site to handle sewage from the workforce. The Contractor has the responsibility to ensure that chemical toilets are used and properly maintained, and that licensed Contractors are employed to collect and dispose of the waste off-site at approved locations.</p>	Project construction site / Duration of the construction phase	Contractor appointed by OPC	✓				ProPECC Note PN 1/94
Water Quality Impact (Operation)									
6.7	4.2	<p>Runoff from Road Surfaces Road drainage system design has already included silt traps in the gully inlets to remove silt and grit before the runoff enters the public storm water drainage system. Silt traps should be regularly checked and maintained to ensure efficient operation.</p>	Within Project area / During operation phase	OPC/Operator appointed by OPC		✓			EIAO-TM; WPCO
6.7	4.2	<p>Runoff from On-site Planting Area Watering of plants on site should always be performed before application of pesticides, herbicides and fertilizers. Regular training should also be provided to frontline staff on the appropriate treatment and disposal of pesticides, herbicides and fertilizers.</p>	Within Project area / During operation phase	OPC/Operator appointed by OPC		✓			EIAO-TM; WPCO; TM-DSS
Waste Management Implications (Construction)									
8.5.1.1	6.2	Good Site Practice	Project construction site / Throughout construction	Contractor	✓				Waste Disposal Ordinance; Waste

Tai Shue Wan Development at Ocean Park Environmental Monitoring and Audit Manual



EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of measures / Timing of completion of measures	Implementation Agent	Implementation Stage ¹					Relevant Legislation & Guidelines
					Des	Con	Op	Dec		
8.5.1.2	6.2	<p>Recommendations for good site practices during the construction activities include:</p> <ul style="list-style-type: none"> Nomination of an approved person, such as a site manager, to be responsible for good site practices, arrangements for collection and effective disposal to an appropriate facility, of all wastes generated at the site Training of site personnel in proper waste management and chemical handling procedures Provision of sufficient waste disposal points and regular collection of waste Appropriate measures to minimise windblown litter and dust/ odour during transportation of waste by either covering trucks or by transporting wastes in enclosed containers Stockpiles of C&D materials should be kept covered by impervious sheets to avoid wind-blown dust All dusty materials including C&D materials should be sprayed with water immediately prior to any loading transfer operation so as to keep the dusty material wet during material handling at the stockpile areas Provision of wheel washing facilities before the trucks leaving the works area so as to minimise dust introduction to public roads Well planned delivery programme for offsite disposal such that adverse environmental impact from transporting the inert or non-inert C&D materials is not anticipated <p>Waste Reduction Measures</p> <p>Good management and control can prevent the generation of a significant amount of waste. Waste reduction is best achieved at the planning and design stage, as well as by ensuring the implementation of good site practices. Recommendations to achieve waste reduction include:</p> <ul style="list-style-type: none"> Sort inert C&D materials to recover any recyclable portions such as metals Segregation and storage of different types of waste in different containers or skips to enhance reuse or recycling of 	<p>stage / Until completion of all construction activities</p>	appointed by OPC					<p>Disposal (Chemical Wastes) (General) Regulation; and ETWB Technical Circular (Works) No. 19/2005 Environmental Management on Construction Site</p>	
			<p>Project construction site / Throughout construction stage / Until completion of all construction activities</p>	Contractor appointed by OPC			✓		<p>Waste Disposal Ordinance</p>	

Tai Shue Wan Development at Ocean Park Environmental Monitoring and Audit Manual



EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of measures / Timing of completion of measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	Con	Op	Dec	
8.5.1.3	6.2	<p>materials and their proper disposal</p> <ul style="list-style-type: none"> ▪ Encourage collection of recyclable waste such as waste paper and aluminium cans by providing separate labelled bins to enable such waste to be segregated from other general refuse generated by the work force ▪ Proper site practices to minimise the potential for damage or contamination of inert C&D materials ▪ Plan the use of construction materials carefully to minimise amount of waste generated and avoid unnecessary generation of waste <p>Inert and Non-inert C&D materials</p> <p>In order to minimise impacts resulting from collection and transportation of inert C&D materials for off-site disposal, the inert C&D materials should be reused on-site as fill material as far as practicable. In addition, inert C&D materials generated from excavation works could be reused as fill materials in local projects that require public fill for reclamation.</p> <p>The surplus inert C&D materials will be disposed of at the Government's PFRFs for beneficial use by other projects in Hong Kong.</p> <p>The C&D materials generated from general site clearance should be sorted on site to segregate any inert materials for reuse or disposal at PFRFs whereas the non-inert materials will be disposed of at the designated landfill site.</p> <p>In order to monitor the disposal of inert and non-inert C&D materials at respectively PFRFs and the designated landfill site, and to control fly-tipping, it is recommended that the Contractor should follow the DEVB Technical Circular (Works) No.6/2010 for Trip Ticket System for Disposal of Construction & Demolition Materials issued by Development Bureau. In addition, it is also recommended that the Contractor should prepare and implement a Waste Management Plan detailing their various waste arising and waste management practices in accordance with the relevant requirements of the ETWB Technical Circular (Works) No. 19/2005 Environmental Management on Construction Site.</p>	Project construction site / Throughout construction stage / Until completion of all construction activities	Contractor appointed by OPC	✓				Waste Disposal Ordinance ; DEVB Technical Circular (Works) No.6/2010 for Trip Ticket System for Disposal of Construction & Demolition Materials; and ETWB Technical Circular (Works) No. 19/2005 Environmental Management on Construction Site
8.5.1.4	6.2	<p>Chemical Waste</p> <p>If chemical wastes are produced at the construction site, the</p>	Project construction site / Throughout construction	Contractor appointed by OPC	✓				Code of Practice on the Packaging

Tai Shue Wan Development at Ocean Park
Environmental Monitoring and Audit Manual



EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of measures / Timing of completion of measures	Implementation Agent	Implementation Stage ¹					Relevant Legislation & Guidelines
					Des	Con	Op	Dec		
		Contractor will be required to register with the EPD as a chemical waste producer and to follow the guidelines stated in the "Code of Practice on the Packaging Labelling and Storage of Chemical Wastes". Good quality containers compatible with the chemical wastes should be used, and incompatible chemicals should be stored separately. Appropriate labels should be securely attached on each chemical waste container indicating the corresponding chemical characteristics of the chemical waste, such as explosive, flammable, oxidising, irritant, toxic, harmful, corrosive, etc. The Contractor should use a licensed collector to transport and dispose of the chemical wastes at the approved Chemical Waste Treatment Centre or other licensed recycling facilities, in accordance with the Waste Disposal (Chemical Waste) (General) Regulation.	Project construction stage / Until completion of all construction activities							Labelling and Storage of Chemical Wastes; Waste Disposal (Chemical Waste) (General) Regulation
8.5.1.5	6.2	General Refuse General refuse should be stored in enclosed bins or compaction units separated from inert C&D materials. A reputable waste collector should be employed by the Contractor to remove general refuse from the site, separately from inert C&D materials. Preferably an enclosed and covered area should be provided to reduce the occurrence of 'wind blown' light material.	Project construction site / Throughout construction stage / Until completion of all construction activities	Contractor appointed by OPC		✓				Waste Disposal Ordinance and Public Health and Municipal Services Ordinance - Public Cleansing and Prevention of Nuisances Regulation
8.5.1.6	6.2	Floating Refuse Provide general refuse collection points on site can minimise the refuse contaminate the marine environment. The construction contractors will be required to regularly check and clean any refuse trapped or accumulated along the artificial seawall. Such refuse will then be stored and disposed of together with the general refuse.	Project construction site / Throughout construction stage / Until completion of all construction activities	Contractor appointed by OPC		✓				Waste Disposal Ordinance
Waste Management Implications (Operation)										
8.5.2.1	6.2	General Refuse General refuse should be collected on daily basis and delivered	Project area / On a regular basis /	Contractor appointed by OPC				✓		Waste Disposal Ordinance

Tai Shue Wan Development at Ocean Park Environmental Monitoring and Audit Manual



EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of measures / Timing of completion of measures	Implementation Agent	Implementation Stage ¹					Relevant Legislation & Guidelines
					Des	Con	Op	Dec		
8.5.2.2	6.2	<p>to the refuse collection point accordingly. A reputable waste collector should be employed to remove general refuse regularly to avoid odour nuisance or pest/vermin problem. Sufficient recycling containers are recommended to be provided at suitable locations of the Project to encourage recycling of such waste as aluminium cans, plastics and waste paper.</p> <p>Chemical Waste If chemical wastes are expected to be produced during the operation phase, the Project Proponent should register with the EPD as a chemical waste producer and follow the guidelines stated in the "Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes". Good quality containers compatible with the chemical wastes should be used, and incompatible chemicals should be stored separately. Appropriate labels should be securely attached on each chemical waste container indicating the corresponding chemical characteristics of the chemical waste, such as explosive, flammable, oxidising, irritant, toxic, harmful, corrosive, etc. Licensed collector should be deployed to transport and dispose of the chemical wastes at the approved Chemical Waste Treatment Centre or other licensed recycling facilities, in accordance with the Waste Disposal (Chemical Waste) (General) Regulation.</p>	Throughout operation stage	Contractor appointed by OPC			✓		Code of Practice on the Packaging Labelling and Storage of Chemical Wastes; Waste Disposal (Chemical Waste) (General) Regulation	
8.5.2.3	6.2	<p>Floating Refuse Regular inspection should be carried out along the artificial seawall of the Project boundary for any entrapment or accumulation of floating refuse. Where an appreciable amount of floating refuse is found on the artificial seawall during the inspection, the locations of such refuse will be recorded and arrangements with the project proponent will immediately be made to collect and clear the refuse from the seawall.</p>	Project area / On a regular basis / Throughout operation stage	Contractor appointed by OPC			✓		Waste Disposal Ordinance	
Land Contamination (Construction)										
9.6	7.2	In any case where contaminated soil is identified after the commencement of works, a Contamination Assessment Plan (CAP) is required to be prepared for EPD's endorsement prior to	Project construction site / Before construction stage	Contractor appointed by OPC	✓				Guidance Note for Contaminated Land Assessment and Remediation	

Tai Shue Wan Development at Ocean Park Environmental Monitoring and Audit Manual



EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Implementation Stage ¹					Relevant Legislation & Guidelines
			Location / Duration of measures / Timing of completion of measures	Implementation Agent	Des	Con	Op	
9.6	7.2	<p>the site investigation. The Contamination Assessment Report (CAR) and/ or Remediation Action Plan (RAP) should be prepared for EPD's approval after the site investigation. If land contamination is confirmed, remediation works should be carried out according to the approved RAP. A Remediation Report (RR) should also be prepared for EPD's endorsement to demonstrate that the clean-up of the contaminated land is completed. No construction work or development of site should be carried out before the approval of the RR.</p> <p>If contaminated soil is identified, the following mitigation measures are for the excavation and transportation of contaminated materials (if any):</p> <ul style="list-style-type: none"> ▪ To minimise the incidents of construction workers coming in contact with any contaminated materials, bulk earth-moving excavation equipment should be employed; ▪ Contact with contaminated materials can be minimised by wearing appropriate clothing and personal protective equipment such as gloves and masks (especially when working directly with contaminated material), provision of washing facilities and prohibition of smoking and eating on site; ▪ Stockpiling of contaminated excavated materials on site should be avoided as far as possible; ▪ The use of any contaminated soil for landscaping purpose should be avoided unless pre-treatment was carried out; ▪ Vehicles containing any excavated materials should be suitably covered to reduce dust emissions and/or release of contaminated wastewater; ▪ Truck bodies and tailgates should be sealed to prevent any discharge; ▪ Only licensed waste haulers should be used to collect and transport contaminated material to treatment/disposal site and should be equipped with tracking system to avoid fly 	Project construction site / Throughout construction stage / Until completion of all construction activities	Contractor appointed by OPC		✓		<p>Guidance Manual for Use of Risk-based Remediation Goals for Contaminated Land Management</p> <p>Practice Guide for Investigation and Remediation of Contaminated Land</p> <p>Waste Disposal Ordinance (Cap 354)</p> <p>Waste Disposal (Chemical Waste) (General) Regulation (Cap 354)</p>

Tai Shue Wan Development at Ocean Park
Environmental Monitoring and Audit Manual



EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Implementation Stage ¹					Relevant Legislation & Guidelines
			Location / Duration of measures / Timing of completion of measures	Implementation Agent	Des	Con	Op	
		tipping; <ul style="list-style-type: none"> ▪ Speed control for trucks carrying contaminated materials should be exercised. ▪ Observe all relevant regulations in relation to waste handling, such as Waste Disposal Ordinance (Cap 354), Waste Disposal (Chemical Waste) (General) Regulation (Cap 354) and obtain all necessary permits where required; and ▪ Maintain records of waste generation and disposal quantities and disposal arrangements. 						
Landscaping and Visual Impact (Construction)								
Table 12.13 (CP01)	Table 9.1 (CP01)	Minimisation of Construction Period The construction programme should be carefully designed to minimise the length of the construction period.	Project construction site / Throughout construction stage / Until completion of all construction activities	Contractor appointed by OPC	✓	✓		EIAO-TM
Table 12.13 (CP02)	Table 9.1 (CP02)	Minimisation of Works Areas The footprint of the proposed hard structures as well as the extent of temporary works areas should be minimised as far as practicable.	Project construction site / Throughout construction stage / Until completion of all construction activities	Contractor appointed by OPC	✓	✓		EIAO-TM
Table 12.13 (CP03)	Table 9.1 (CP03)	Construction Site Controls Construction site controls should be enforced, where possible, to ensure that the landscape and visual impacts arising from the construction phase activities, such as the storage of materials, the location and appearance of site accommodation, etc. are minimised.	Project construction site / Throughout construction stage / Until completion of all construction activities	Contractor appointed by OPC	✓	✓		EIAO-TM
Table 12.13 (CP04)	Table 9.1 (CP04)	Preservation of Existing Vegetation The development proposal should avoid disturbance to existing vegetation as far as practicable. A formal tree removal application should be submitted for approval by relevant authorities in accordance with LAO PN No. 07/2007 "Tree Preservation and Tree Removal Application for Building Development in Private Projects" during the detailed design phase of the Project. Where possible, all trees which are not in direct conflict with the development proposals should be retained <i>in situ</i> .	Project construction site / Throughout construction stage / Until completion of all construction activities	Contractor appointed by OPC	✓	✓		EIAO-TM; LAO PN No. 07/2007
Table	Table	No Intrusion Zones	Project construction site /	Contractor	✓	✓		EIAO-TM

Tai Shue Wan Development at Ocean Park Environmental Monitoring and Audit Manual



EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Implementation Stage ¹					Relevant Legislation & Guidelines
			Location / Duration of measures / Timing of completion of measures	Implementation Agent	Des	Con	Op	
12.13 (CP06)	9.1 (CP06)	Where practicable, "no intrusion zones" should be designated within the Project area for protection of existing vegetation. Durable boundary fences should be erected to clearly demarcate these "no intrusion zones". No construction activities, storage of materials and vehicular access will be allowed within the "no intrusion zones" to prevent potential damage to canopies and root zones of vegetation.	Throughout construction stage / Until completion of all construction activities	appointed by OPC				
Table 12.13 (CP09)	Table 9.1 (CP09)	Construction Site Hoardings Two types of hoardings should be considered. One is used for areas in close contact with visitors and for areas where visual intrusion is a key concern. It should be graphical and thematic, and visually 'impermeable' to block the views of construction activities from the VSRs. The other is used for areas to be viewed at a distance. It should be subtle and camouflaged so that it blends in with the surrounding landscape.	Project construction site / Throughout construction stage / Until completion of all construction activities	Contractor appointed by OPC	✓			EIAO-TM
Table 12.13 (CP10)	Table 9.1 (CP10)	Dust and Erosion Control for Exposed Soil Exposed soil shall be covered or "camouflaged" and watered frequently. Areas that are expected to be left with bare soil for a long period of time should be hydroseeded and / or covered with suitable protective fabrics.	Project construction site / Throughout construction stage / Until completion of all construction activities	Contractor appointed by OPC	✓			EIAO-TM
Table 12.13 (CP11)	Table 9.1 (CP11)	Appearance of Construction Plant / Machinery To minimise the visual intrusion of construction activities to visitors and other VSRs, a suitable colour scheme of construction machines and plants should be adopted where possible.	Project construction site / Throughout construction stage / Until completion of all construction activities	Contractor appointed by OPC	✓			EIAO-TM
Table 12.13 (CP12)	Table 9.1 (CP12)	Construction Lighting Control All security floodlights for construction sites should be equipped with adjustable shield, frosted diffusers and reflective covers, and be carefully controlled to minimise light pollution and night-time glare to the VSRs.	Project construction site / Throughout construction stage / Until completion of all construction activities	Contractor appointed by OPC	✓			EIAO-TM
Table 12.13 (CP13)	Table 9.1 (CP13)	Appearance of Construction Workers To protect Ocean Park's image, construction workers should be required to enter the park areas with their helmets and safety vests properly stored or carried in non-transparent bags. They should also dress properly and cleanly.	Project construction site / Throughout construction stage / Until completion of all construction activities	Contractor appointed by OPC	✓			EIAO-TM
Landscape and Visual Impact (Operation)								

Tai Shue Wan Development at Ocean Park Environmental Monitoring and Audit Manual



EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of measures / Timing of completion of measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	Con	Op	Dec	
Table 12.14 (OP01)	Table 9.2 (OP01)	<p>Sensitive Design and Disposition</p> <p>All proposed hard structures should be sensitively designed in a manner that responds to the existing and planned landscape context, and minimises potential adverse landscape and visual impacts. The structural design should seek to reduce the apparent visual mass through the use of natural materials such as wooden frame and semi-transparent panels. Subdued tones should be considered for the colour palette with non-reflective finishes to reduce glare effect. Site specific measures, such as the disposition of the key structures closer to the northern slopes, the design of building forms as extension along the existing slope topography, the use of concave roof form and the location of ride platforms on or near the slopes to minimise structural support, should also be considered for better integration with the surroundings and minimisation of potential visual impacts.</p>	Project buildings / During design stage / Throughout operation phase	Design Architect / Contractor appointed by OPC	✓	✓	✓	✓	EIAO-TM
Table 12.14 (OP03)	Table 9.2 (OP03)	<p>Enhancement Planting</p> <p>Other than compensatory tree planting, additional trees, shrubs, groundcovers and lawn should also be considered to maximise greening within the redevelopment area.</p>	Project area / During design stage / Throughout operation phase	Design Architect / Contractor appointed by OPC	✓	✓	✓	✓	EIAO-TM
Table 12.14 (OP06)	Table 9.2 (OP06)	<p>Responsive Lighting Design</p> <p>Overall lighting design would carefully consider a reasonable level of functional and thematic lighting with due consideration of possible light pollution and night-time glare to the surroundings. Consideration shall be made by the lighting designers to the following measures:</p> <ul style="list-style-type: none"> ▪ Lighting shall be designed with due consideration of mounting height and direction of light fixtures so as not to point directly towards any sensitive receiver. ▪ Lighting shall be arranged with due consideration of reflectance so as to avoid glare effect. ▪ Lighting shall be regularly monitored during operation. ▪ Lights located adjacent or in proximity to neighbours shall be carefully designed to prevent possible light intrusion. ▪ Lighting operation schedule shall specify only lights necessary for security to be left on after business hours. ▪ Paving materials should be selected as necessary to reduce 	Project area / During design stage / Throughout operation phase	Design Architect / Contractor appointed by OPC	✓	✓	✓	✓	EIAO-TM

Tai Shue Wan Development at Ocean Park Environmental Monitoring and Audit Manual



EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of measures / Timing of completion of measures	Implementation Agent	Implementation Stage ¹					Relevant Legislation & Guidelines
					Des	Con	Op	Dec		
		potential glare from surface reflectance. <ul style="list-style-type: none"> ▪ Particular attention should be paid to the use of lighting having a high intensity or harsher tone (e.g. metal halide lamps). ▪ Lights shall generally be models having precise cut-off range (such as full cut-off optics where available and practicable) and if necessary be fitted with adjustable anti-glare shields. 								

Remarks:

1. Des – Design Stage, Con – Construction Stage, Op – Operation, Dec - Decommissioning