

#### By Post & Fax (2147-0894)

The EIA Ordinance Register Office Environmental Protection Department 27th floor, Southorn Centre, 130 Hennessy Road, Wan Chai, Hong Kong

Attention: Mr Andy WONG Wing Hong (Env Protection Offr (Metro Assessment) 24)

Level 5, Festival Walk 80 Tat Chee Avenue Kowloon Tong, Kowloon Hong Kong

t +852 2528 3031 d +852 2268 3208 f +852 2268 3950

sam.tsoi@arup.com www.arup.com

10 Aug 2021

Dear Mr. Wong

Contract No. CM 4/2017

Independent Environmental Checker for Construction of Dry Weather Flow Interceptor at Cherry Street Box Culvert Submission of Monthly Environmental Audit Report No.43

In accordance with Clause 2.1 of the Environmental Permit for Proposed Sewage Pumping Station and Dry Weather Flow Interceptor at Cherry Street Box Culvert (No. EP-523/2016), we are pleased to submit herewith four hard copies and one electronic copy of the Monthly Environmental Audit Report No.43 for your perusal.

If you require any further information, please do not hesitate to contact the undersigned.

Yours sincerely

Sam Tsoi

Independent Environmental Checker

Enc

cc. DSD

Black & Veatch Hong Kong Limited CMGC-TECEL Joint Venture

Mr. Bernard Chan (one hardcopy)

Mr. Quentin Yau (one hardcopy)

Mr. Benson Yau (one hardcopy)

## Drainage Services Department

Contract No. CM 4/2017 Independent Environmental Checker for Construction of Dry Weather Flow Interceptor at Cherry Street Box Culvert

Monthly Environmental Audit Report No.43 (July 2021)

Month Environmental Audit Report

First version | July 2021

This report takes into account the particular instructions and requirements of our client. It is not intended for and should not be relied upon by any third party and no responsibility is undertaken to any third party.

Job number 258952

Ove Arup & Partners Hong Kong Ltd Level 5 Festival Walk 80 Tat Chee Avenue Kowloon Tong Kowloon Hong Kong www.arup.com



## **Contents**

			Page
1	INTI	RODUCTION	1
	1.1	Background	1
	1.2	Scope of the Assignment	2
2	Proje	ect Organization	3
	2.1	Project Organization and Management Structure	3
	2.2	Construction Activities in the Reporting Period	3
3	Conc	cise Overview of Assignment Progress	3
4	Statu	s on Implementation of Environmental Mitigation Measures	s 4
5	Majo	or Accomplishment	7
	5.1	Deliverables	7
	5.2	Meetings	7
	5.3	Summary of Work Done	7
	5.4	IEC Site Audit	8
Figures			
Figure 1	1	Project Location	
Append	lices		

Appendix A Project Organization and Contacts of Key Personnel

**Appendix B** IEC Site Audit Checklist

#### 1 INTRODUCTION

#### 1.1 Background

The existing Cherry Street Box Culvert (CSBC) is a reinforced concrete 8-cell stormwater box culvert; each cell is 4.8 m wide and 3.5 m high. The CSBC collects run-off from three upstream box culverts underneath Palm Street, Cheung Wong Road and a section of West Kowloon Corridor West and ultimately discharges into the New Yau Ma Tei Typhoon Shelter (NYMTTS).

At present, the water quality at NYMTTS and the odour associated with it remains unsatisfactory. It is believed that polluted flow, including those from the expedient connections, cross-connections between the foul water sewerage and the stormwater drainage system in the area found their way into the CSBC and in turn discharges into NYMTTS. Measures have to be taken to improve the present conditions at the CSBC.

In 2010, Environmental Protection Department (EPD) completed a West Kowloon and Tsuen Wan Sewerage Master Plans Study Review and recommended to construct a dry weather flow interceptor (DWFI) at the outfall of the CSBC. Upon commissioning of the DWFI system, the intercepted flow would be discharged to the existing sewerage system via proposed discharge sewerage.

The proposed DWFI system will comprise construction of a DWFI at the CSBC to intercept the dry weather flow (DWF) inside the box culvert and construction of a sewage pumping station to pump the intercepted DWF to the existing sewerage network via proposed twin rising mains.

The Project titled "Construction of dry weather flow interceptor at Cherry Street box culvert" mainly comprises the construction of (i) an underground DWFI with automatic penstocks at CSBC; (ii) a pumping station; (iii) an underground stormwater bypass box culvert; and (iv) about 270 metres of underground twin rising main from the pumping station in (ii) above to an existing sewer at Lin Cheung Road. The Project will be implemented under PWP Item No. 4380DS. The Project location is shown in **Figure 1**.

The Project is classified as a designated project under item F.3(b) (i), Part 1 of the Schedule 2 of the Environmental Impact Assessment Ordinance (Cap. 499) (EIAO), since the proposed sewage pumping station has an installed capacity (average dry weather flow) of more than 2,000m<sup>3</sup> per day and its boundary is less than 150 m from an existing residential area.

A project profile (Register No. PP-527/2015) ("Project Profile") entitled "Proposed Sewage Pumping Station and Dry Weather Flow Interceptor at Cherry Street Box Culvert" was submitted to Environmental Protection Department (EPD) under Application No. DIR241/2015. Permission to apply directly for environmental permit was granted by EPD in September 2015. An Environmental Permit (EP-

523/2016) ("EP") to construct and operate the Designated Project was issued to Drainage Services Department (DSD) on 23 December 2016.

According to the EP, DSD shall employ an Independent Environmental Checker ("IEC") to audit the implementation of all mitigation measures recommended in the Project Profile and required under the EP, and certify in writing in the monthly audit report full implementation of the mitigation measures during the construction phase of the Project

Arup was commissioned by DSD as the IEC in accordance with the conditions stipulated in the EP (EP-523/2016) for a period of 64 months from 8 January 2018.

### 1.2 Scope of the Assignment

Scope of work of this Assignment includes:

- (i) Provide the continual services of an IEC as stipulated in the Project Profile and the EP and reporting the findings to the Employer and the Engineer. The role of the IEC shall be independent from the Contractors;
- (ii) Conduct monthly site audits on the implementation of all mitigation measures recommended in the Project Profile and the EP and reporting the findings to the Employer and the Engineer;
- (iii) Advise the Engineer and the Employer on environmental issues related to the implementation of environmental mitigation measures under Contract No. DC/2017/01;
- (iv) Provide comments on the environmental aspects of the works programme, method statements and other relevant submissions by the Contractors;
- (v) Attend the monthly Site Safety and Environmental Management Committee (SSEMC) meetings;
- (vi) Report the findings of the site inspection and other environmental performance reviews to the Engineer and the Employer; and
- (vii) Submit monthly audit reports to EPD and confirming in writing in the report full implementation of the mitigation measures as recommended in the Project Profile and EP during and upon completion of the construction works under Contract No. DC/2017/01.

## **2** Project Organization

### 2.1 Project Organization and Management Structure

The project organization and contacts of key personnel of the Project are shown in **Appendix A**.

## **3** Concise Overview of Assignment Period

### 3.1 Construction Activities in the Reporting Period

The construction activities carried out by the Contractor during the reporting period included the following:

- External finishing works in sewage pumping station was in progress.
- Excavation to expose Cell 1 of DWFI and founding level of Retaining Wall
   Wall were completed.
- Slab opening at Cell 1 of DWFI for subsequent assembly of DfMA segments was in progress.
- Installation of E&M equipment in sewage pumping station and Maintenance Corridor was in progress.
- Installation of stoplog and penstock in Cell 6 of DWFI was in progress.
- Construction of civil requirement works in Cell 7 of DWFI was in progress.
- Installation of multi-part covers at expanded desilting access of Cell 3,4 and
   8 outside Olympian City 2 was in progress.
- Installation of stoplog frame in Cell 1 of Olympian City 2 was in progress.
- Desilting by Waylung in Cell 5 outside Olympian City 2 using bucket & load method was in progress.
- Desilting by Builderprise's diving teams in Cell 7 outside Olympian City 2 using air-lifting method was in progress.

The environmental performance was considered acceptable during the assignment period from 1 July 2021 to 31 July 2021.

# 4 Status on Implementation of Environmental Mitigation Measures

The potential environmental impacts and proposed mitigation measures to be incorporated into the design and construction of the Project are summarised in **Table 4.1** below.

Table 4.1 Summary of potential environmental impacts and proposed

environmental mitigation measures

Mitigation Measures  Mitigation Measures	Implementation	Status
Dust nuisance	Agent	Status
Adopt dust control and suppression measures as stipulated in the Air Pollution Control (Construction Dust) Regulation.		Implemented
2. Water spraying on exposed area and during excavation.		Implemented
3. Provide wheel-washing facilities.		Implemented
4. Cover stockpile of dusty materials by impervious sheets.	Contractor	Implemented
5. Provide hoarding of not less than 2.4m high from ground level along the site boundary adjoining Hoi Fai Road.	(Construction Phase)	Implemented
6. Cover dusty load on trucks before they leave the construction site.		Implemented
7. Avoid concurrent excavation activities for construction of underground DWFI, underground emergency stormwater bypass culvert and CSBCSPS.		Implemented
8. Minimize area involving dusty construction activities by arrangement of construction activities and methods.  Odour		Implemented
Locate the inlet chamber, screen chamber, valve chamber and wet well of the sewage pumping station underground and enclose them by a reinforced concrete structure.	Contractor (Construction Phase)	Implemented
2. Install and properly maintain a deodorizer with a forced ventilation system and an odour removal efficiency of at least 99.5%.	DSD (Operational Phase)	N/A for the reporting month and shall be implemented in the later months

Mitigation Measures	Implementation Agent	Status	
Water Quality	<u> </u>		
1. Control construction surface run-off according to ProPECC PN1/94, EPD's Practice Note for Professional Persons, Construction Site Drainage.		Implemented	
2. All chemical tanks and storage areas will be provided with locks and placed on sealed areas, within bunds of a capacity equal to 110% of the storage capacity of the largest tank.	Contractor (Construction Phase)	Implemented	
3. Install and properly maintain a standby pump and dual power supply.	Contractor (Construction	Implemented	
4. Provide a telemetry system to transmit signals showing irregularity or operational problem of the sewage pumping station and the dry weather flow interceptor to the Stonecutters Island Sewage Treatment Works.	Phase)  DSD (Operational Phase)	N/A for the reporting month and shall be implemented in the later months	
Noise			
Adoption of standard control measures such as adopting quiet mechanical equipment, temporary noise barriers and good site practices etc.		Implemented	
Construction Noise Permit is required for construction work during restricted hours as defined under the Noise Control Ordinance.	Contractor (Construction	Implemented	
3. Locate the pumps and screening facilities of the sewage pumping station underground and enclose them by a reinforced concrete structure.	Phase)	Implemented	
4. Install all outlets of the extraction fans with acoustic louvers.		Implemented	

Mitigation Measures	Implementation Agent	Status
Waste Management	J	
Standard waste management measures and good site practices in waste handling, disposal and transportation will be implemented.		Implemented
2. The Contractor will be required to sort all C&D materials and general refuse into different categories for reuse on site, recycling and disposal at designated public fill reception facilities or landfills. Disposal of C&D materials will be managed through the trip-ticket system as stipulated in DEVB TC(W) No. 6/2010.	Contractor (Construction	Implemented
3. All chemical wastes due to maintenance of equipment will be handled, stored and disposed of in accordance with the requirements of the Waste Disposal (Chemical Waste) (Chemical) Regulation.	Phase)	Implemented
4. General refuse will be stored and disposed of separately from general construction waste and chemical waste. The storage bins for general refuse will be provided with lids, which should be kept closed to avoid odour nuisance and windblown litter. General refuse will be removed regularly and disposed of to landfills.		Implemented
Landscape and Visual		
Erect site hoarding with decorative features that are compatible with the surrounding environment;		Implemented
2. Maintain site cleanliness and tidiness;	Contractor (Construction Phase)  DSD (Operational Phase)	Implemented
3. Properly manage construction waste in the works area;		Implemented
Reinstate all temporary works areas to its original conditions upon completion of works.		N/A for the reporting month and shall be implemented in the later months

Mitigation Measures	Implementation Agent	Status
5. Implement and properly maintain the landscape and visual mitigation measures (e.g. rooftop greening, grasscrete, paving lock, vertical greening, permanent shrub planter, removable shrub planter, bench with shelter, and removable planter with trees) as shown in Figure 2 of the EP.		N/A for the reporting month and shall be implemented in the later months

## 5 Major Accomplishment

#### 5.1 Deliverables

Deliverables completed in the reporting period are summarised in **Table 5.1**.

**Table 5.1** Completed deliverables

Description	Submitted by IEC
Monthly Environmental Audit Report No. 42	10 July 2021
(June 2021)	

Planned deliverables to be completed in the coming reporting period is summarised in **Table 5.2**.

**Table 5.2** Planned deliverables

Description	Planned Submission Date	Status
Monthly Environmental Audit Report No. 43 (July 2021)	10 Aug 2021	On schedule

## 5.2 Meetings

No meeting was held in the reporting month.

## 5.3 Summary of Work Done

Upon commencement of the Assignment, accumulated numbers of IEC monthly environmental audit report submission and various kinds of meetings are summarized in **Table 5.3**.

Table 5.3 Summary of work done


Work	Number
Reports	
IEC Monthly Environmental Audit Report	43
Meeting	
IEC monthly site inspection with DSD, Engineer Representative and Contractor	39
Project related meeting with DSD and EPD	1

### 5.4 IEC Site Audit

IEC site audit was conducted on 30 July 2021 with the presence of DSD, Resident Site Engineer, Contractor and IEC. No major site defect was observed in the reporting month. The IEC site audit checklist is given in Appendix B.

## Figure 1

Project Location

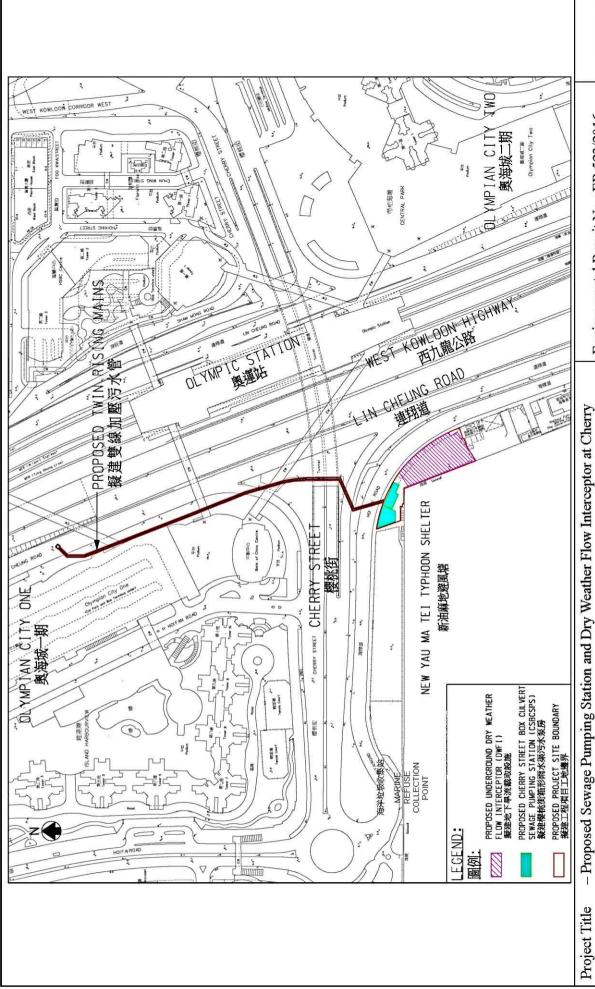



Environmental Permit No.: EP-523/2016

環境許可證編號: EP-523/2016

Project Location Plan 工程項目位置圖 Figure 1 圖 1


- 櫻桃街箱形雨水渠擬建污水泵房及旱流截取設施

Street Box Culvert

工程項目名稱

## **Appendix A**

Project Organization and Contacts of Key Personnel

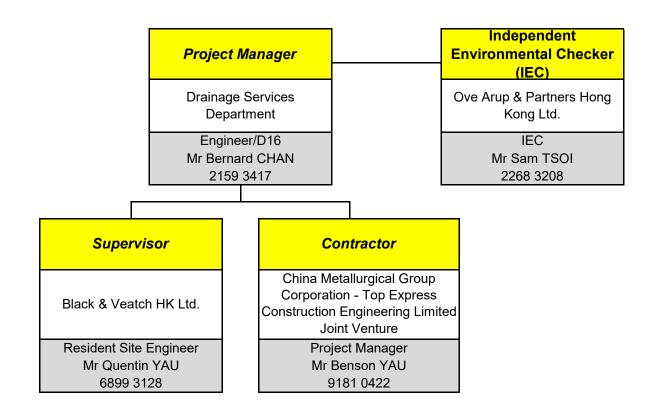

———Contractual Relationship


## Appendix B

IEC Site Audit Checklist

## Construction of Dry Weather Flow Interceptor at Cherry Street Box Culvert Independent Environmental Checker Environmental Site Inspection Checklist



	Ref. No. Project Contract No. Inspected By	at Cherry St CM 4/2017 IEC's Rep. : Cilent's Rep. Engineer's R Contractor's	reet Box Cu	1 -	clm	IEC Cilent Contractor Engineer Inspection Da Time Period	Drai Chin Top Blac	nage Ser a Metallu Express ( k & Veato	artners Horvices Depa rigical Grou Constructio th HK Ltd.	rtment ip Corpo n Engin	oration - eering Limited JV
	Condition Humidity	Weather ⊡sunny ☑sigh ☑sakn	∏ine ∏łoderale ∏ight	Divercast Divercast	∐\$torn	kain	□prizzie Tem	_ peratur <del>e</del>	]lazy		32°°
								-			
No. 1 2 3 4 5	Is drainage sy. Is drainage sy. Is drainage sy. Are there dyke Are there perir	stem well main stem adequate as to surround meter channel tside the site s	e? ntained? ely designe areas of ea s at site bo so that it wil	d for storm i arthworks fo undaries to il not wash a	r flood prote intercept sto icross the sit	rm e?	0000	0000 0890		0000	Photos / Remarks
6 7	Are sediment of Are there temporary watercourse?		,			•	Ø				
8 9a 9b 10 11	Are these tem Do permanent Is site runoff p Is groundwate	drainage cha	nnels have entering th	: sedim traps : ne river char	entation basir and baffles? inel?	97	_ □	<u> </u>		00000	OBS I
12 13a 13b	via sedimenta Are there sedi Are the sedim	mentation tani	ks for settli : construc		med individua		000				
13c 14 15	Are there neut is the discharg is the discharg	e diverted to	free from s for concr and treated	n siit and sedi ete batching I in neutralis	ment? /mlxing disc ation tanks?	-	□ □/	.0 🗹			
17	tanks before d Are there oil in	lisposal? nterceptors in o	drainage sy	stem?	·		⊴,				
18 19 20	Are oil and great is there any by Are vehicles a leaving the site	pass for oil to Ind plant clean	prevent flu	ishing durin	g periods of	•	다 라				
21 22a 22b 22c 22d 22e	Is a wheel was	shing bay prov	th: adequ adequ paved acces	rate design? rate settling & l access road	i removal of s leading to ex ently backfill t	it?				0000	
23 24 25 26 27 28 29 30	is exposed ea Are exposed s Are open stoc Are manholes Are accessed Are toilets con Are debris and is wastewater	slope surfaces kpiles covered covered and roads protect inected to foul d rubbish on si	after complete covered (to during her sealed? ed by crush sewer or collected	etion of eart by tarpaulin avy rain? ned stones o themical toil d and dispos	or other mea or gravels? ets provided sed of prope	?				0000000	

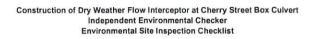



No.		
	Part III Air Quality	N/A,N/O Yes Rdr Obs N/C Photos / Remarks
1	Are vehicles in the site travelling within speed limit of 10 km/h?	
2	Are site vehicle movement confined to designated haul roads?	
3	Is the public road around the site entrance kept clean and free from dust?	
4	Are areas of site with regular traffic movement have hard surface?	
5		/
	Are the haul roads watered regularly to avoid dust disturbance?	
6	Are unpaved areas watered regularly to avoid dust disturbance?	
7	Does the water spraying truck work effectively?	
8	Is working area of excavation or earth moving operation sprayed with	
	water to maintain the entire surface wet?	/
9	Are the dusty materials sprayed with water during transfer operation?	
10	Do the site vehicles use the wheel wash at the site exits?	
11	Does the wheel wash work effectively?	
12	Are hoarding not less than 2.4m tall provided beside roads or areas with	
	public access?	
13	Are incombustible screens not less than 1.8m tall provided in the public area	
	affected by exhaust fumes or smoke emission?	, , , , , , , , , , , , , , , , , , , ,
14	Is dark smoke emission avoided?	
15	Are dusty materials properly covered?	
16	Are the bags of cement (more than 20) covered entirely?	
17	Are the excavated materials dropped at minimum practical height?	
18	Are conveyor belts fitted with windboards, transfer points and hoppers	gòoooo ————
40	enclosed?	_/
19	Are bulk fine grained materials stored in closed silos fitted with high level	
	alarm indicator?	_/
20	Are air vents on cements silos fitted with fabric filters?	
21	Are weigh hoppers vented to suitable filters?	g,o o o o o
22	Are there enclosures around the main dust-generating activities?	
23	Are completed earthworks sealed and hydroseeded and planted as soon	
	as practicable?	/
24	Is open burning avoided?	Ø
25	Are vehicles and equipment switched off while not in use?	
26	Are all trucks loaded to a level within the side and tail boards?	
	Are materials transported by dump trucks with mechanical cover?	
27		
27 28		
28	Do the truck covers work effectively?	
28 29	Do the truck covers work effectively?  Does ULSD used in the construction activities?	
28	Do the truck covers work effectively?  Does ULSD used in the construction activities?  Observable dust sources	
28 29	Do the truck covers work effectively?  Does ULSD used in the construction activities?	
28 29 30	Do the truck covers work effectively?  Does ULSD used in the construction activities?  Observable dust sources	grice/equipment movements  Construction
28 29 30 No.	Do the truck covers work effectively?  Does ULSD used in the construction activities?  Observable dust sources	N/A N/O Yes, Rdr Obs N/C Photos / Remarks
28 29 30 No. 1a	Do the truck covers work effectively?  Does ULSD used in the construction activities?  Observable dust sources	N/A N/O Yes Rdr Obs N/C Photos / Remarks
28 29 30 No.	Do the truck covers work effectively?  Does ULSD used in the construction activities?  Observable dust sources	N/A N/O Yes, Rdr Obs N/C Photos / Remarks
28 29 30 No. 1a	Do the truck covers work effectively?  Does ULSD used in the construction activities?  Observable dust sources	N/A N/O Yes Rdr Obs N/C Photos / Remarks
28 29 30 No. 1a 1b	Do the truck covers work effectively?  Does ULSD used in the construction activities?  Observable dust sources	N/A N/O Yes Rdr Obs N/C Photos / Remarks
28 29 30 No. 1a 1b 2a	Do the truck covers work effectively?  Does ULSD used in the construction activities?  Observable dust sources	N/A N/O Yes Rdr Obs N/C Photos / Remarks
28 29 30 No. 1a 1b 2a 2b	Do the truck covers work effectively?  Does ULSD used in the construction activities?  Observable dust sources	N/A N/O Yes Rdr Obs N/C Photos / Remarks
28 29 30 No. 1a 1b 2a 2b 3	Do the truck covers work effectively?  Does ULSD used in the construction activities?  Observable dust sources	N/A N/O Yes Rdr Obs N/C Photos / Remarks
28 29 30 No. 1a 1b 2a 2b 3	Do the truck covers work effectively?  Does ULSD used in the construction activities?  Observable dust sources	N/A N/O Yes Rdr Obs N/C Photos / Remarks
28 29 30 No. 1a 1b 2a 2b 3 4 5	Do the truck covers work effectively?  Does ULSD used in the construction activities?  Observable dust sources	N/A N/O Yes Rdr Obs N/C Photos / Remarks
28 29 30 No. 1a 1b 2a 2b 3 4 5	Do the truck covers work effectively?  Does ULSD used in the construction activities?  Observable dust sources	N/A N/O Yes Rdr Obs N/C Photos / Remarks
28 29 30 No. 1a 1b 2a 2b 3 4 5	Do the truck covers work effectively?  Does ULSD used in the construction activities?  Observable dust sources	N/A N/O Yes Rdr Obs N/C Photos / Remarks
28 29 30 No. 1a 1b 2a 2b 3 4 5	Do the truck covers work effectively?  Does ULSD used in the construction activities?  Observable dust sources   Wind erosion	N/A N/O Yes Rdr Obs N/C Photos / Remarks
28 29 30 No. 1a 1b 2a 2b 3 4 5	Do the truck covers work effectively?  Does ULSD used in the construction activities?  Observable dust sources	N/A N/O Yes Rdr Obs N/C Photos / Remarks
28 29 30 No. 1a 1b 2a 2b 3 4 5	Do the truck covers work effectively?  Does ULSD used in the construction activities?  Observable dust sources	N/A N/O Yes Rdr Obs N/C Photos / Remarks
28 29 30 No. 1a 1b 2a 2b 3 4 5	Do the truck covers work effectively?  Does ULSD used in the construction activities?  Observable dust sources	N/A N/O Yes Rdr Obs N/C Photos / Remarks    Description
28 29 30 No. 1a 1b 2a 2b 3 4 5 6 7	Do the truck covers work effectively?  Does ULSD used in the construction activities?  Observable dust sources	N/A N/O Yes Rdr Obs N/C Photos / Remarks    Strict   Stri
28 29 30 No. 1a 1b 2a 2b 3 4 5 6 7 8 9 10 11 12	Do the truck covers work effectively?  Does ULSD used in the construction activities?  Observable dust sources    Wind erosion   Loading/unloading of materials	N/A N/O Yes Rdr Obs N/C Photos / Remarks    Strict   Stri
28 29 30 No. 1a 1b 2a 2b 3 4 5 6 7	Do the truck covers work effectively?  Does ULSD used in the construction activities?  Observable dust sources    Wind erosion	N/A N/O Yes Rdr Obs N/C Photos / Remarks
28 29 30 No. 1a 1b 2a 2b 3 4 5 6 7 8 9 10 11 12	Do the truck covers work effectively?  Does ULSD used in the construction activities?  Observable dust sources    Wind erosion   Loading/unloading of materials	N/A N/O Yes Rdr Obs N/C Photos / Remarks    Strict   Stri

## Construction of Dry Weather Flow Interceptor at Cherry Street Box Culvert Independent Environmental Checker Environmental Site Inspection Checklist



			· · · · · · - · ·
No.	Part V Waste Management and Contamination	N/A N/O Yes Rdr Obs N/C	Photos / Remarks
1a	General refuse: Is accumulation avoided?		
1b	Is receptacles (e.g. rubbish bins) available?		
i C	is there regular and proper disposal?		
2a	Construction waste: Is there avoidance or minimization of construction	<b>12</b>	
	waste generation (e.g. use of steel formwork)?	• /	
2b	Is there on site segregation as far as practicable	00000	
	for reuse and recycle?	,	
2c	Is construction waste reused where practicable?		
2d	Is construction waste disposed at public dumping		
•	area or public landfill?	_	
2e	Are trip tickets available for inspection?		
3a	Chemical waste/waste oil: Is there designated storage area?		
3b	is chemical waste/waste oil stored properly?		
3c	Is there proper disposal?		
3d	Are trip tickets available for inspection?		
3e	Is chemical waste license available for	76555	
	inspection?	<del>*</del>	
4a	Excavated material: Does excavated material appear uncontaminated	00000	
	(colour, odour)?	<i>+</i>	
4b	If contamination is suspected, is appropriate procedure		
	followed?	<del>-</del>	
4c	Are trip tickets available for inspection?		
5a	Chemical/fuel: Is chemical/fuel stored in bunded area?	Ø. 6 6 6 6	
5b	is bund capacity adequate (>110% of the largest tank)?		
5c	Are storage areas provided with locks and located on	75555	
	sealed area?		
6	Are relevant license/permit for disposal of construction waste or excavated		
	materials available for inspection?		
7	Is foam, oil, grease or other objectionable matters in water of nearby drains	<b>d</b> o o o o o	
	or sewer avoided?		
		MANO NO DE OS NO	
No.	Part VI Landscape & Visual Impact and Ecology	N/A/N/O Yes Rdr Obs N/C	
1	Is stripped top soil stored for re-use?		
2	Are retained trees protected from damage?		
3	Are compensatory trees planted and properly maintained?	<b>Ā</b> 🗆 🗆 🗆 🗆	
4	For trees identified for transplant in EP:	4	
4a	sufficient buffer zone allowed prior to transplant?		
4b	properly maintained following transplant?		
5	Is night-time lighting controlled to minimise glare to sensitive receivers?	a	
6	Is the screen hoarding compatible with the surrounding setting?		
7	Do the site clearance and tree felling works at the existing ardeid night roost	& c c c c c	
	only be carried out at wintering season (November to March inclusive)?		
No.	Part VII Others	□□□□□□□□□□□□□□□□□□□□□□□□□□□□□□□□□□□□□	
1	Is a copy of the relevant permits/licences/registrations displayed		
	on the Project site at all vehicular site entrances/exits or at a convenient location for public information all times?		
	a convenient location for poolic information all times r		
	·		

Part VIII Follow-up for the Pervious Site Audit

#### Construction of Dry Weather Flow Interceptor at Cherry Street Box Culvert Independent Environmental Checker Environmental Site Inspection Checklist



Part IX Remarks

Obs Z: Following previous inspection 57th curtain has sunk below sea level which results in contamination water laakage into open sea. Constructor should rectify the issue immediately.

Part X Signatures

IEC's Representative

(Name: Halton TAM)

Engineer's Representative

(Name: J'. EKO-4

Client's Representative

(Name: Jason CHEWG

Contractor's R∮presentative

(Name: W-1+-1977