



CONTRACT NO. STW 01/2021

**ENVIRONMENTAL TEAM FOR
RELOCATION OF SHA TIN SEWAGE TREATMENT
WORKS TO CAVERNS**

UNDER ENVIRONMENTAL PERMIT NO. EP-533/2017

**QUARTERLY ENVIRONMENTAL MONITORING &
AUDIT SUMMARY REPORT**

- MARCH 2022 TO MAY 2022 -

CLIENTS:

Drainage Services Department

PREPARED BY:

Lam Environmental Services Limited

19/F, Remex Centre,
42 Wong Chuk Hang Road,
H.K.

Telephone: (852) 2882-3939
Facsimile: (852) 2882-3331
E-mail: info@lamenviro.com
Website: <http://www.lamenviro.com>

CERTIFIED BY:

Derek LO
Environmental Team Leader

DATE:

23 June 2022

Date: 6 July 2022

Your ref:

Our ref: PL-202207002

AECOM Asia Limited
c/o Site Office
21 Hang Tai Road
Ma On Shan
New Territories

Attn: Mr. Peter Poon, PRE

Dear Mr. Poon,

Re: Contract No. DC/2020/05

**Relocation of Sha Tin Sewage Treatment Works to Cavern – Main Caverns
Construction
Verification of Quarterly EM&A Report (March 2022 to May 2022)**

Reference is made to the EM&A Quarterly Report **(March 2022 to May 2022)** provided by the Environmental Team on 28 June 2022 with the amended pages provided on 29 June 2022.

Please be informed that we have no adverse comments on the captioned submission. We hereby verify the report in accordance with Condition 3.5 of Environmental Permit No. EP-533/2017.

Thank you for your attention.

Yours sincerely,

For and on behalf of

Acuity Sustainability Consulting Limited



Ir Y.H. LAW

Independent Environmental Checker

c.c. Drainage Services Department
Lam Environmental Services Limited

Attn.: Ms. Linda Hui By e-mail

Attn.: Mr. Derek Lo By e-mail

TABLE OF CONTENTS

1	INTRODUCTION.....	6
1.1	Scope of the Report	6
1.2	Structure of the Report.....	6
2	PROJECT BACKGROUND.....	7
2.1	Background.....	7
2.2	Scope of the Project and Site Description.....	7
2.3	Project Organization and Contact Personnel	8
2.4	Construction Activities.....	9
3	MONITORING REQUIREMENTS.....	11
3.1	Air Monitoring.....	11
3.2	Noise Monitoring.....	12
4.	MONITORING RESULTS.....	14
4.1	Air Monitoring Results	14
4.2	Noise Monitoring Results.....	14
4.3	Waste Management	14
5	LAND CONTAMINATION.....	17
6	COMPLIANCE AUDIT.....	18
6.1	Air Monitoring.....	18
6.2	Noise Monitoring.....	18
6.3	Review of the Reasons for and the Implications of Non-compliance.....	18
6.4	Summary of action taken in the event of and follow-up on non-compliance	18
	18	
7	COMPLAINTS, NOTIFICATION OF SUMMONS AND PROSECUTION.....	19
8	CONCLUSION.....	21

LIST OF TABLES

Table 2.1	<i>Schedule 2 Designated Projects under this Project</i>
Table 2.2	<i>Contact Details of Key Personnel</i>
Table 3.1	<i>Air Monitoring Station</i>
Table 3.2	<i>Noise Monitoring Station</i>
Table 4.1	<i>Details of Waste Disposal for Contract no. DC/2018/05</i>
Table 7.1	<i>Cumulative Statistics on Complaints</i>
Table 7.2	<i>Cumulative Statistics on Successful Prosecutions</i>

LIST OF FIGURES

<u>Figure 2.1</u>	<u>Project Layout</u>
<u>Figure 2.2</u>	<u>Project Organization Chart</u>
<u>Figure 3.1</u>	<u>Locations of Environmental Monitoring Station</u>

LIST OF APPENDICES

<u>Appendix 2.1</u>	<u>Environmental Mitigation Implementation Schedule</u>
<u>Appendix 3.1</u>	<u>Action and Limit Level</u>
<u>Appendix 4.1</u>	<u>Air Quality Monitoring Results and Graphical Presentations</u>
<u>Appendix 4.2</u>	<u>Noise Monitoring Results and Graphical Presentations</u>
<u>Appendix 4.3</u>	<u>Monthly Summary Waste Flow Table</u>
<u>Appendix 6.1</u>	<u>Event and Action Plans</u>
<u>Appendix 7.1</u>	<u>Complaint Log</u>
<u>Appendix 8.1</u>	<u>Construction Programme of Individual Contracts</u>

EXECUTIVE SUMMARY

- i. This is the Quarterly Environmental Monitoring and Audit (EM&A) Summary Report – [March 2022 to May 2022](#) of Relocation of Sha Tin Sewage Treatment Works to Caverns under Environmental Permit no. EP-533/2017 (Hereafter as “the Project”). The report presenting the environmental monitoring findings and information recorded during the period of [1 March 2022 to 31 May 2022](#).

Construction activities for the reporting period

During this reporting period, the principal work activities are included as follow:

Contract no. DC/2018/05 - Relocation of Sha Tin Sewage Treatment Works to Caverns – Site Preparation and Access Tunnel Construction

March 2022	April 2022	May 2022
<ul style="list-style-type: none"> • Retaining wall construction • Road construction • Drainage works • Tunnelling works • Landscape works 	<ul style="list-style-type: none"> • Drainage works • Tunnelling works 	<ul style="list-style-type: none"> • All major works are completed and handover to CSAJV in April 2022

Contract no. DC/2020/05 - Relocation of Sha Tin Sewage Treatment Works to Caverns – Main Caverns Construction

The contract was commenced on 5 July 2021

March 2022	April 2022	May 2022
<ul style="list-style-type: none"> • Hoarding erection • Tree transplant and felling works • Site clearance • Ground investigation • Construction of RC wall • Construction of temporary drainage system • Haul road construction • Slope stabilization works • Construction of temporary explosive magazine • Tunneling works • Site office construction • Rigid barrier construction 	<ul style="list-style-type: none"> • Hoarding erection • Tree transplant and felling works • Site clearance • Ground investigation • Construction of RC wall • Construction of temporary drainage system • Haul road construction • Slope stabilization works • Construction of temporary explosive magazine • Tunneling works • Site office construction • Rigid barrier construction 	<ul style="list-style-type: none"> • Tree transplant and felling works • Construction of RC wall • Construction of temporary drainage system • Haul road construction • Slope stabilization works • Construction of temporary explosive magazine • Tunneling works • Site office construction • Rigid barrier construction

Air Quality Monitoring

- ii. 1-hour Total Suspended Particulates (TSP) monitoring would be conducted at five monitoring stations. The sampling frequency is 3 times in every 6 days.
- iii. Air quality monitoring for the stations AM1 and AM2 were commenced on 12 April 2019 while station AM5 was commenced on 18 April 2019. Air quality monitoring for the station AM4 was commenced on 3 May 2019. The proposal for proposed fine adjustment for air and noise monitoring station at Kowloon City Baptist Church Hay Nien Primary School was agreed by EPD on 17 December 2020, therefore, air quality monitoring for the station AM3(B) was commenced on 18 December 2020. Air quality monitoring for the station AM6 was commenced on 2 November 2021 since the demolition of DSD staff quarter and ended on 31 December 2021.
- iv. [No action or limit level exceedance was determined in the reporting period for the stations of AM1, AM2, AM4, and AM5.](#)

Noise Monitoring

- v. Noise monitoring would be conducted at five noise monitoring stations once per week.
- vi. Noise monitoring for stations CM4 and CM5 were commenced on 13 April 2019 and 18 April 2019 respectively. Noise monitoring for stations CM1 and CM3 were commenced on 2 May 2019. The proposal for proposed fine adjustment for air and noise monitoring station at Kowloon City Baptist Church Hay Nien Primary School was agreed by EPD on 17 December 2020, therefore, noise monitoring for station CM2(B) was commenced on 18 December 2020. Noise monitoring for stations DM1, DM2 and DM3 were commenced on 2 November 2021 since the demolition of DSD staff quarter and ended on 31 December 2021.
- vii. [Additional weekly noise monitoring from 19:00 to 23:00 was carried out at CM4 with respect to the restricted hour works under CNP GW-RN0824, GW-RN0044-22, GW-RN0371-22 and GW-RN0302-22. All the results are within the baseline level range after baseline correction.](#)
- viii. [Additional weekly night time noise monitoring from 23:00 to 07:00 on next day was carried out at CM4 with respect to the restricted hour works under CNP GW-RN0824, GW-RN0044-22, GW-RN0371-22 and GW-RN0302-22. All the results are within the baseline level range after baseline correction.](#)
- ix. [No action or limit level exceedance was determined in the reporting period for the stations of CM1, CM3, CM4 and CM5.](#)

Site Inspection and Audit

- x. [Within this reporting period, weekly environmental site audits, bi-weekly landscape site audits and monthly ecology site audits were conducted by Environmental Team, ER and the](#)

Contractor, IEC attended the joint site inspection on 28 March 2022, 27 April 2022 and 25 May 2022.

Complaints, Notifications of Summons and Successful Prosecutions

- xi. ET subsequently received a public complaint regarding construction noise referred by the Contractor on 12 May 2022.
- xii. The complainant reported to 1823 Call Centre (ICC) dated on 6 May 2022 that the construction noise (rock-breaking and excavation) generated from the construction site of Portion 10 at Mui Tsz Lam Road was causing noise nuisance to complainant.
- xiii. According to the relevant site information provided by the Contractor of DC/2020/05, rock-breaking and excavation works were conducted during the concerned period.
- xiv. Based on review on noise monitoring data, no exceedances were recorded at the noise monitoring stations CM1 - G/F, Wellborn Kindergarten and CM2(B) - G/F, Outside A Kung Kok Street Garden (located within the Chevalier Garden) during the scheduled Leq30 min noise monitoring in April 2022. ET conducted regular noise monitoring on 6 May 2022, no exceedances were recorded at the noise monitoring stations CM1 - G/F, Wellborn Kindergarten and CM2(B) - G/F, Outside A Kung Kok Street Garden. Site inspection was conducted on 5 & 12 May 2022, it is observed that rock-breaking was conducted at the construction site of Portion 10. Ad-hoc noise monitoring at CM1 - G/F, Wellborn Kindergarten and CM2(B) - G/F, Outside A Kung Kok Street Garden on 13 May 2022, no exceedances were recorded.
- xv. During execution of rock breaking works, below noise mitigation measures had been implemented by the Contractor of DC/2020/05
 - Erection of 8m height noise barrier
 - Wrapping up the breaker tip with acoustic material
 - Upgrade the existing hoarding to perform as noise barrier by affixing a layer of sound absorption material to the hoarding surface
 - Voluntary to late start of rock breaking work at 0900hrs instead of 0700hrs, which is allowed under the Regulation.
- xvi. Contractor of DC/2020/05 also carried out self-noise monitor for the rock-breaking works on 4, 5 & 6 May 2022, All results show the construction noise levels are below the 75dB(A).
- xvii. ET would continue to monitor the adequacy of mitigation measures and review the monitoring data of the monitoring stations of CM1 - G/F, Wellborn Kindergarten and CM2(B) - G/F, Outside A Kung Kok Street Garden.
- xviii. The Contractor is recommend to review the construction operation to erect the temporary noise barriers, if feasible and ensure all idled PME are shut down to minimize potential noise emanation at the concerned works area to avoid potential nuisance.
- xix. No notification of summons and successful prosecutions was received in the reporting period.

1 Introduction

1.1 Scope of the Report

1.1.1. Lam Environmental Services Limited (LES) has been appointed to work as the Environmental Team (ET) under Environmental Permit (EP) no. EP-533/2017 to implement the Environmental Monitoring and Audit (EM&A) programme as stipulated in the EM&A Manual of the approved Environmental Impact Assessment (EIA) Report for Relocation of Sha Tin Sewage Treatment Works to Caverns – Site Preparation and Access Tunnel Construction (Register No.: AEIAR-202/2016).

xx. This report documents the finding of EM&A works for this project and during the period of [1 March 2022 to 31 May 2022](#).

1.1.2. In accordance with Section 13.5 of the Project EM&A Manual, the Quarterly EM&A Summary Report should be prepared and submitted to the IEC, the ER and EPD.

1.2 Structure of the Report

Section 1 ***Introduction*** – details the scope and structure of the report.

Section 2 ***Project Background*** – summarizes background and scope of the project, site description, project organization and contact details of key personnel during the reporting period.

Section 3 ***Monitoring Requirements*** – summarizes all monitoring parameters, monitoring locations, monitoring frequency, criteria and respective event and action plan and monitoring programmes.

Section 4 ***Monitoring Results*** – summarizes the monitoring results obtained in the reporting period.

Section 5 ***Compliance Audit*** – summarizes the auditing of monitoring results, all exceedances environmental parameters.

Section 6 ***Complaints, Notification of summons and Prosecution*** – summarizes the cumulative statistics on complaints, notification of summons and prosecution

Section 7 ***Conclusion***

2 Project Background

2.1 Background

- 2.1.1. The Relocation of Sha Tin Sewage Treatment Works (STSTW) to Caverns (the Project) is implemented so as to release the existing site, of a size about 28 hectares, for other uses.
- 2.1.2. In May 2012, Drainage Services Department (DSD), the Project Proponent commenced a detailed feasibility study on “Relocation of Sha Tin Sewage Treatment Works to Caverns” (the Feasibility Study). The findings of Feasibility Study affirmed that relocating the STSTW to caverns to be constructed at Nui Po Shan of A Kung Kok is technically feasible and financially viable.
- 2.1.3. The Project is a Designated Project (DP) under the Environmental Impact Assessment Ordinance (EIAO). An application for an Environmental Impact Assessment (EIA) Study Brief under section 5(1)(a) of the EIAO was submitted on 12 May 2014 with a Project Profile (No. PP-508/2014) for the Project. An EIA Study Brief (No. ESB-273/2014) was issued in September 2014. An EIA for the Project was then undertaken, as part of the Assignment, in accordance with this EIA Study Brief and the Technical Memorandum on Environmental Impact Assessment Process (EIAO-TM). The location of the Project is shown [Figure 2.1](#).

2.2 Scope of the Project and Site Description

- 2.2.1. The Project covers the following DP elements as specified in Schedule 2 of the EIAO (Cap.499), **Table 2.1** summarises the DPs under this Project.

Table 2.1 Schedule 2 Designated Projects under this Project

Item	Designated Project	EIAO Reference
DP1	Sewage treatment works with an installed capacity of more than 15,000 m3 per day under Item F.1	Schedule 2, Part I,
DP2	Sewage treatment works under Item F.2 <ul style="list-style-type: none"> • With an installed capacity of more than 5,000 m3 per day; and • A boundary of which is less than 200m from the nearest boundary of an existing or planned residential area, educational institution and health care institution. 	Schedule 2 Part I
DP3	An activity for the reuse of treated sewage effluent from a treatment plant under Item F.4	Schedule 2 Part I

DP4	Underground rock caverns under Item Q.2	Schedule 2 Part I
DP5	An explosives depot in a stand-alone, purpose built building under Item K.10	Schedule 2 Part I;
DP6	Decommissioning of an explosives depot under Item 11	Schedule 2 Part II

2.3 Project Organization and Contact Personnel

2.3.1 Drainage Services Department is the overall project controllers for the Project. For the construction phase of the Project, Project Engineer, Contractor(s), Environmental Team and Independent Environmental Checker are appointed to manage and control environmental issues.

2.3.2 The proposed project organization and lines of communication with respect to environmental protection works are shown in [Figure 2.2](#). Key personnel and contact particulars are summarized in **Table 2.2**:

Table 2.2 Contact Details of Key Personnel

Party	Role	Post	Name	Contact No.	Contact Fax
AECOM	Engineer's Representative	Chief Resident Engineer	Mr .Leung Chi Man, Simon	6393 8645	3914 5888
China State Joint Venture (DC/2018/05)	Contractor	Site Agent	Mr. KONG Ming, Elvis	9186 2081	2672 2501
		Environmental Officer	Ms. Yeung Ka Ching, Tiffany	6761 8726	
		Environmental Supervisor	TSANG Chiu Fat	9137 8733	
			CHAN Chin Ming	9128 9993	
China State – Alchemex Joint Venture (DC/2020/05)	Contractor	Site Agent	Mr. KONG Ming, Elvis	9186 2081	2672 2501
		Environmental Officer	Mr. LAM Moon Lin	9489 4641	
		Environmental Supervisor	TSANG Chiu Fat	9137 8733	

Acuity Sustainability Consulting Limited	Independent Environmental Checker (IEC)	Independent Environmental Checker (IEC)	Ir. Law Yui Hung	2698 6833	2698 9383
Lam Environmental Services Limited	Environmental Team (ET)	Environmental Team Leader (ETL)	Mr. Derek Lo	2882 3939	2882 3331
Hotline telephone number for the public to make enquiries:				3142 2256	

2.4 Construction Activities

2.4.1 In the reporting period, the principal work activities conducted are as follow.

Contract no. DC/2018/05 - Relocation of Sha Tin Sewage Treatment Works to Caverns – Site Preparation and Access Tunnel Construction

March 2022	April 2022	May 2022
<ul style="list-style-type: none"> Retaining wall construction Road construction Drainage works Tunnelling works Landscape works 	<ul style="list-style-type: none"> Drainage works Tunnelling works 	<ul style="list-style-type: none"> All major works are completed and handover to CSAJV in April 2022

Contract no. DC/2020/05 - Relocation of Sha Tin Sewage Treatment Works to Caverns – Main Caverns Construction

The contract was commenced on 5 July 2021

March 2022	April 2022	May 2022
<ul style="list-style-type: none"> Hoarding erection Tree transplant and felling works Site clearance Ground investigation Construction of RC wall Construction of temporary drainage system Haul road construction Slope stabilization works Construction of temporary explosive magazine Tunneling works Site office construction Rigid barrier construction 	<ul style="list-style-type: none"> Hoarding erection Tree transplant and felling works Site clearance Ground investigation Construction of RC wall Construction of temporary drainage system Haul road construction Slope stabilization works Construction of temporary explosive magazine Tunneling works Site office construction Rigid barrier construction 	<ul style="list-style-type: none"> Tree transplant and felling works Construction of RC wall Construction of temporary drainage system Haul road construction Slope stabilization works Construction of temporary explosive magazine Tunneling works Site office construction Rigid barrier construction

2.4.2 Mitigation measures according to the environmental mitigation implementation schedule and the EIA were generally implemented by the Contractor in this reporting period. The Environmental Mitigation Implementation Schedule (EMIS) such as air quality, construction noise, water quality, Ecological, Landscape & Visual Impact and wastes management is presented in [Appendix 2.1](#)

3 Monitoring Requirements

3.1 Air Monitoring

AIR QUALITY MONITORING STATIONS

3.1.1. Air monitoring stations AM1 and AM2 were setup and commencement of monitoring on 12 April 2019 while AM5 was setup and commencement of monitoring on 18 April 2019. Air quality monitoring for the station AM4 was commenced on 3 May 2019. The proposal for proposed fine adjustment for air and noise monitoring station at Kowloon City Baptist Church Hay Nien Primary School was agreed by EPD on 17 December 2020, therefore, air quality monitoring for the station AM3(B) was commenced on 18 December 2020.

3.1.2. A change of the monitoring location in subsequent impact monitoring for AM3(A) - Kowloon City Baptist Church Hay Nien Primary School was identified necessary as access was not granted for setting up the onsite monitoring station. The new monitoring location AM3(B) – ground level of outside A Kung Kok Street Garden for impact air quality monitoring station was proposed based on the criteria as stated in section 2.2.4.2 and 2.2.4.3 of EM&A Manual by ET and approved by ER and verified by IEC and submitted to EPD for agreement on 5 September 2019. The proposal was agreed by EPD on 17 December 2020.

Air quality monitoring station AM6 was setup and commencement of monitoring on 2 November 2021 since the demolition of DSD staff quarter and ended on 31 December 2021. The proposal was verified by IEC and approved by EPD on 9 May 2019.

3.1.3. The air monitoring stations for the Project are listed and shown in **Table 3.1** and [Figure 3.1](#).

Table 3.1 Air Monitoring Station

Monitoring Station ID	Monitoring Location	Level (in terms of no. of floor)
AM1	Ah Kung Kok Fishermen Village	G/F
AM2	Block H, Kam Tai Court	Roof
AM3(B)	Outside A Kung Kok Street Garden	G/F
AM4	Wellborn Kindergarten	G/F
AM5	The Neighbourhood Advice-Action Council Harmony Manor	Roof
AM6	Seaview Villa	G/F

AIR MONITORING PARAMETERS, FREQUENCY AND DURATION

- 3.1.4. One-hour TSP levels should be measured to indicate the impacts of construction dust on air quality.
- 3.1.5. The sampling frequency of at least three times in every six-days should be undertaken when the highest dust impact occurs.

3.2 Noise Monitoring

NOISE MONITORING STATIONS

- 3.2.1. Noise monitoring stations CM4 and CM5 were setup and commencement of monitoring on 13 April 2019 and 18 April 2019 respectively. Noise monitoring for stations CM1 and CM3 were commenced on 2 May 2019. The proposal for proposed fine adjustment for air and noise monitoring station at Kowloon City Baptist Church Hay Nien Primary School was agreed by EPD on 17 December 2020, therefore, noise monitoring for station CM2(B) was commenced on 18 December 2020. Noise monitoring for stations DM1, DM2 and DM3 were commenced on 2 November 2021 since the demolition of DSD staff quarter and ended on 31 December 2021.
- 3.2.2. A change of the monitoring location in subsequent impact monitoring for CM2(A) - Kowloon City Baptist Church Hay Nien Primary School was identified necessary as access was not granted for setting up the onsite monitoring station. The new monitoring location CM2(B) – ground level of outside A Kung Kok Street Garden for impact air quality monitoring station was proposed based on the criteria as stated in section 2.2.4.2 and 2.2.4.3 of EM&A Manual by ET and approved by ER and verified by IEC and submitted to EPD for agreement on 5 September 2019. The proposal was agreed by EPD on 17 December 2020.
- 3.2.3. The noise monitoring stations for the Project are listed and shown in **Table 3.2** and [Figure 3.1](#).

Table 3.2 Noise Monitoring Station

Monitoring Station ID	Monitoring Location	Measurement Type	Level (in terms of no. of floor)
CM1	Wellborn Kindergarten	Free field	G/F
CM2(B)	Outside A Kung Kok Street Garden	Free field	G/F
CM3	S.K.H. Ma On Shan Holy Spirit Primary School	Façade	Roof
CM4	Ah Kung Kok Fishermen Village	Free field	G/F
CM5	The Neighbourhood Advice-Action Council Harmony Manor	Façade	Roof
DM1	Seaview Villa	Free field	G/F
DM2	Racecourse Gardens	Free field	G/F
DM3	S.K.H. Ma On Shan Holy Spirit Primary School	Façade	Roof

NOISE MONITORING PARAMETERS, FREQUENCY AND DURATION

- 3.2.4. Noise monitoring shall be carried out at all the designated monitoring stations. The monitoring frequency shall depend on the scale of the construction activities. The following is an initial guide on the regular monitoring frequency for each station on a weekly basis when noise generating activities are underway:
- One set of measurements between 0700-1900 hours on normal weekdays;
 - One set of measurements between 1900-2300 hours;
 - One set of measurements between 2300-0700 hours of next day; and
 - One set of measurements between 0700-2300 hours on holidays (three consecutive Leq/5min readings).
- 3.2.5. If construction works are extended to include works during the hours of 1900-0700, additional weekly impact monitoring shall be carried out during evening and night-time works for the latter 3 sets of measurements specified in Section 3.2.3 above, one set of measurements shall at least include 3 consecutive Leq (5min) results.
- 3.2.6. Additional weekly noise monitoring from 19:00 to 23:00 was carried out at CM4 with respect to the restricted hour works under CNP GW-RN0824, GW-RN0044-22, GW-RN0371-22 and GW-RN0302-22. All the results are within the baseline level range after baseline correction.
- 3.2.7. Additional weekly night time noise monitoring from 23:00 to 07:00 on next day was carried out at CM4 with respect to the restricted hour works under CNP GW-RN0824, GW-RN0044-22, GW-RN0371-22 and GW-RN0302-22. All the results are within the baseline level range after baseline correction.
- 3.2.8. Supplementary information for data auditing, statistical results such as L10 and L90 shall also be obtained for reference.
- 3.2.9. If a school exists near the construction activity, noise monitoring shall be carried out at the monitoring stations for the schools during the examination periods. The ET leader shall liaise with the school's personnel and the examination authority to ascertain the exact dates and times of all examination periods during the course of the contract.

4. Monitoring Results

4.0.1 The environmental monitoring will be implemented based on the division of works areas of each designed projects. Overall layout showing work areas and monitoring stations is shown in [Figure 2.1](#) and [Figure 3.1](#) respectively.

4.1 Air Monitoring Results

4.1.1 1-hour TSP monitoring was conducted at AM1, AM2, AM3(B), AM4 and AM5 in the reporting period.

4.1.2 No action or limit level exceedance was determined in the reporting period at stations of AM1, AM2, AM3(B), AM4 and AM5.

4.1.3 Air quality monitoring results measured in this reporting period for AM1, AM2, AM3(B), AM4 and AM5 are reviewed and summarized. Details of air monitoring results and graphical presentation can be referred in [Appendix 4.1](#).

4.2 Noise Monitoring Results

4.2.1 Noise monitoring was conducted at CM1, CM2(B), CM3, CM4 and CM5 in the reporting period.

4.2.2 Additional weekly noise monitoring from 19:00 to 23:00 was carried out at CM4 with respect to the restricted hour works under CNP GW-RN0824, GW-RN0044-22, GW-RN0371-22 and GW-RN0302-22. All the results are within the baseline level range after baseline correction.

4.2.3 Additional weekly night time noise monitoring from 23:00 to 07:00 on next day was carried out at CM4 with respect to the restricted hour works under CNP GW-RN0824, GW-RN0044-22, GW-RN0371-22 and GW-RN0302-22. All the results are within the baseline level range after baseline correction.

4.2.4 No action or limit level exceedance was determined in the reporting period at stations of CM1, CM2(B), CM3, CM4 and CM5.

4.2.5 Noise monitoring results measured in this reporting period for CM1, CM2(B), CM3, CM4 and CM5 are reviewed and summarized. Details of noise monitoring results and graphical presentation can be referred in [Appendix 4.2](#).

4.3 Waste Management

4.3.1 The quantities of waste for disposal in the Reporting Period are summarized in **Table 4.1**. The updated Monthly Summary waste Flow Table is shown in [Appendix 4.4](#). Whenever possible, materials were reused on-site as far as practicable.

Table 4.1 Details of Waste Disposal for Contract no. DC/2018/05

Waste Type	Quantity this report period	Cumulative Quantity-to-Date	Disposal / Dumping Grounds
Inert C&D materials disposed, m³	21	12,038	Fill Bank at Tuen Mun Area 38
	6252	248,099	Taylor Recycled Aggregated Ltd. & Lam Tei Quarry (Alternative Disposal Ground)
Inert C&D materials recycled, m³	56	2,367	Fill Bank at Tuen Mun Area 38 (Broken concrete)
Non-inert C&D materials disposed, tonne	44.39	1441.40	NENT
Non-inert C&D materials recycled, kg	250	2,391	Golden Sino Management Limited (Waste paper)
	0	14	Golden Sino Management Limited (Plastic)
	0	19,843	Golden Sino Management Limited (Metals)
Chemical waste disposed, L	0	1,090	Collected by licensed chemical waste collector_ Ecospace Limited
Asbestos waste disposed, Kg	0	300	WENT

Table 4.2 Details of Waste Disposal for Contract no. DC/2020/05

Waste Type	Quantity this report period	Cumulative Quantity-to-Date	Disposal / Dumping Grounds
Inert C&D materials disposed, m³	2107	8,711	Fill Bank at Tuen Mun Area 38
	28308	28,343	Lam Tei Quarry (Alternative Disposal Ground)
Inert C&D materials recycled, m³	45	492*	Fill Bank at Tuen Mun Area 38 (Broken concrete)
Non-inert C&D materials disposed, tonne	157.31	515.52	SENT
Non-inert C&D materials recycled, kg	250	250	Golden Sino Management Limited (Waste Paper)
	0	0	Golden Sino Management Limited (Plastic)
	73,129	148,399	Golden Sino Management Limited (Metals)



Waste Type	Quantity this report period	Cumulative Quantity-to-Date	Disposal / Dumping Grounds
Chemical waste disposed, L	0	0	Collected by licensed chemical collector: Ecospace Limited (Spent Lube Oil)
Asbestos waste disposed, Kg	0	560	WENT

*Remark: Cumulative-quantity of Inert C&D materials recycled is updated.



5 Land Contamination

5.0 Land decontamination work for the DSD staff quarter at existing STSTW started on 16 June 2021, the Remediation Report was submitted to EPD for approval on 9 September 2021. The Remediation Report was accepted by EPD on 8 November 2021.

6 Compliance Audit

6.0.1 The Event Action Plan for construction noise, air quality are presented in [Appendix 6.1](#).

6.1 Air Monitoring

6.1.1 No action or limit level exceedance was determined in the reporting period at stations of AM1, AM2, AM3(B), AM4 and AM5.

6.2 Noise Monitoring

6.2.1 Additional weekly noise monitoring from 19:00 to 23:00 was carried out at CM4 with respect to the restricted hour works under CNP GW-RN0824, GW-RN0044-22, GW-RN0371-22 and GW-RN0302-22. All the results are within the baseline level range after baseline correction.

6.2.2 Additional weekly night time noise monitoring from 23:00 to 07:00 on next day was carried out at CM4 with respect to the restricted hour works under CNP GW-RN0824, GW-RN0044-22, GW-RN0371-22 and GW-RN0302-22. All the results are within the baseline level range after baseline correction.

6.2.3 No action or limit level exceedance was determined in the reporting period at stations of CM1, CM2(B), CM3, CM4 and CM5.

6.3 Review of the Reasons for and the Implications of Non-compliance

6.3.1 No environmental non-compliance was recorded in the reporting period.

6.4 Summary of action taken in the event of and follow-up on non-compliance

6.4.1 There was no particular action taken since no non-compliance was recorded in the reporting period.

7 Complaints, Notification of Summons and Prosecution

- 7.0.1 ET subsequently received a public complaint regarding construction noise referred by the Contractor on 12 May 2022.
- 7.0.2 The complainant reported to 1823 Call Centre (ICC) dated on 6 May 2022 that the construction noise (rock-breaking and excavation) generated from the construction site of Portion 10 at Mui Tsz Lam Road was causing noise nuisance to complainant.
- 7.0.3 According to the relevant site information provided by the Contractor of DC/2020/05, rock-breaking and excavation works were conducted during the concerned period.
- 7.0.4 Based on review on noise monitoring data, no exceedances were recorded at the noise monitoring stations CM1 - G/F, Wellborn Kindergarten and CM2(B) - G/F, Outside A Kung Kok Street Garden (located within the Chevalier Garden) during the scheduled Leq30 min noise monitoring in April 2022. ET conducted regular noise monitoring on 6 May 2022, no exceedances were recorded at the noise monitoring stations CM1 - G/F, Wellborn Kindergarten and CM2(B) - G/F, Outside A Kung Kok Street Garden. Site inspection was conducted on 5 & 12 May 2022, it is observed that rock-breaking was conducted at the construction site of Portion 10. Ad-hoc noise monitoring at CM1 - G/F, Wellborn Kindergarten and CM2(B) - G/F, Outside A Kung Kok Street Garden on 13 May 2022, no exceedances were recorded.
- 7.0.5 During execution of rock breaking works, below noise mitigation measures had been implemented by the Contractor of DC/2020/05
- Erection of 8m height noise barrier
 - Wrapping up the breaker tip with acoustic material
 - Upgrade the existing hoarding to perform as noise barrier by affixing a layer of sound absorption material to the hoarding surface
 - Voluntary to late start of rock breaking work at 0900hrs instead of 0700hrs, which is allowed under the Regulation.
- 7.0.6 Contractor of DC/2020/05 also carried out self-noise monitor for the rock-breaking works on 4, 5 & 6 May 2022, All results show the construction noise levels are below the 75dB(A).
- 7.0.7 ET would continue to monitor the adequacy of mitigation measures and review the monitoring data of the monitoring stations of CM1 - G/F, Wellborn Kindergarten and CM2(B) - G/F, Outside A Kung Kok Street Garden.
- 7.0.8 The Contractor is recommend to review the construction operation to erect the temporary noise barriers, if feasible and ensure all idled PME are shut down to minimize potential noise emanation at the concerned works area to avoid potential nuisance.
- 7.0.9 No notification of summons and successful prosecutions was received in the reporting period.

- 7.0.10 No notification of summons and successful prosecutions was received in the reporting period.
- 7.0.11 The details of cumulative complaint log and updated summary of complaints are presented in [Appendix 7.1](#).
- 7.0.12 Cumulative statistic on complaints and successful prosecutions are summarized in [Table 7.1](#) and [Table 7.2](#) respectively.

Table 7.1 Cumulative Statistics on Complaints

Reporting Period	No. of Complaints
March 2022 to May 2022	1
Total	5

Table 7.2 Cumulative Statistics on Successful Prosecutions

Environmental Parameters	Cumulative No. Brought Forward	No. of Successful Prosecutions in this reporting period (Offence Date)	Cumulative No. Project-to-Date
Air	-	0	0
Noise	-	0	0
Waste	-	0	0
Total	-	0	0

8 Conclusion


- 8.0.1 The EM&A programme was carried out in accordance with the EM&A Manual requirements, minor alterations to the programme proposed were made in response to changing circumstances.
- 8.0.2 No non-compliances were noted and no prosecutions were received during the reporting period.
- 8.0.3 Mitigation measures according to the environmental mitigation implementation schedule and the EIA were generally implemented by the Contractor in this reporting period. Weekly environmental site audits, bi-weekly landscape site audits and monthly ecology site audits were conducted by Environmental Team, ER and the Contractor and no cumulative environmental impact was identified in the reporting period. Hence, the EM&A programme was considered effective and shall be maintained.
- 8.0.4 The construction programmes of individual contracts are provided in [Appendix 8.1](#)



Figure 2.1

Project Layout

Pd File by: PENGM 2016/02/24
 PATH: P:\proj\60334056\DRAWING\REPORT\EM&A\MA_711.dgn
 Project Management Initials: Designer: Checked: Approved: ISO A1 594mm x 841mm

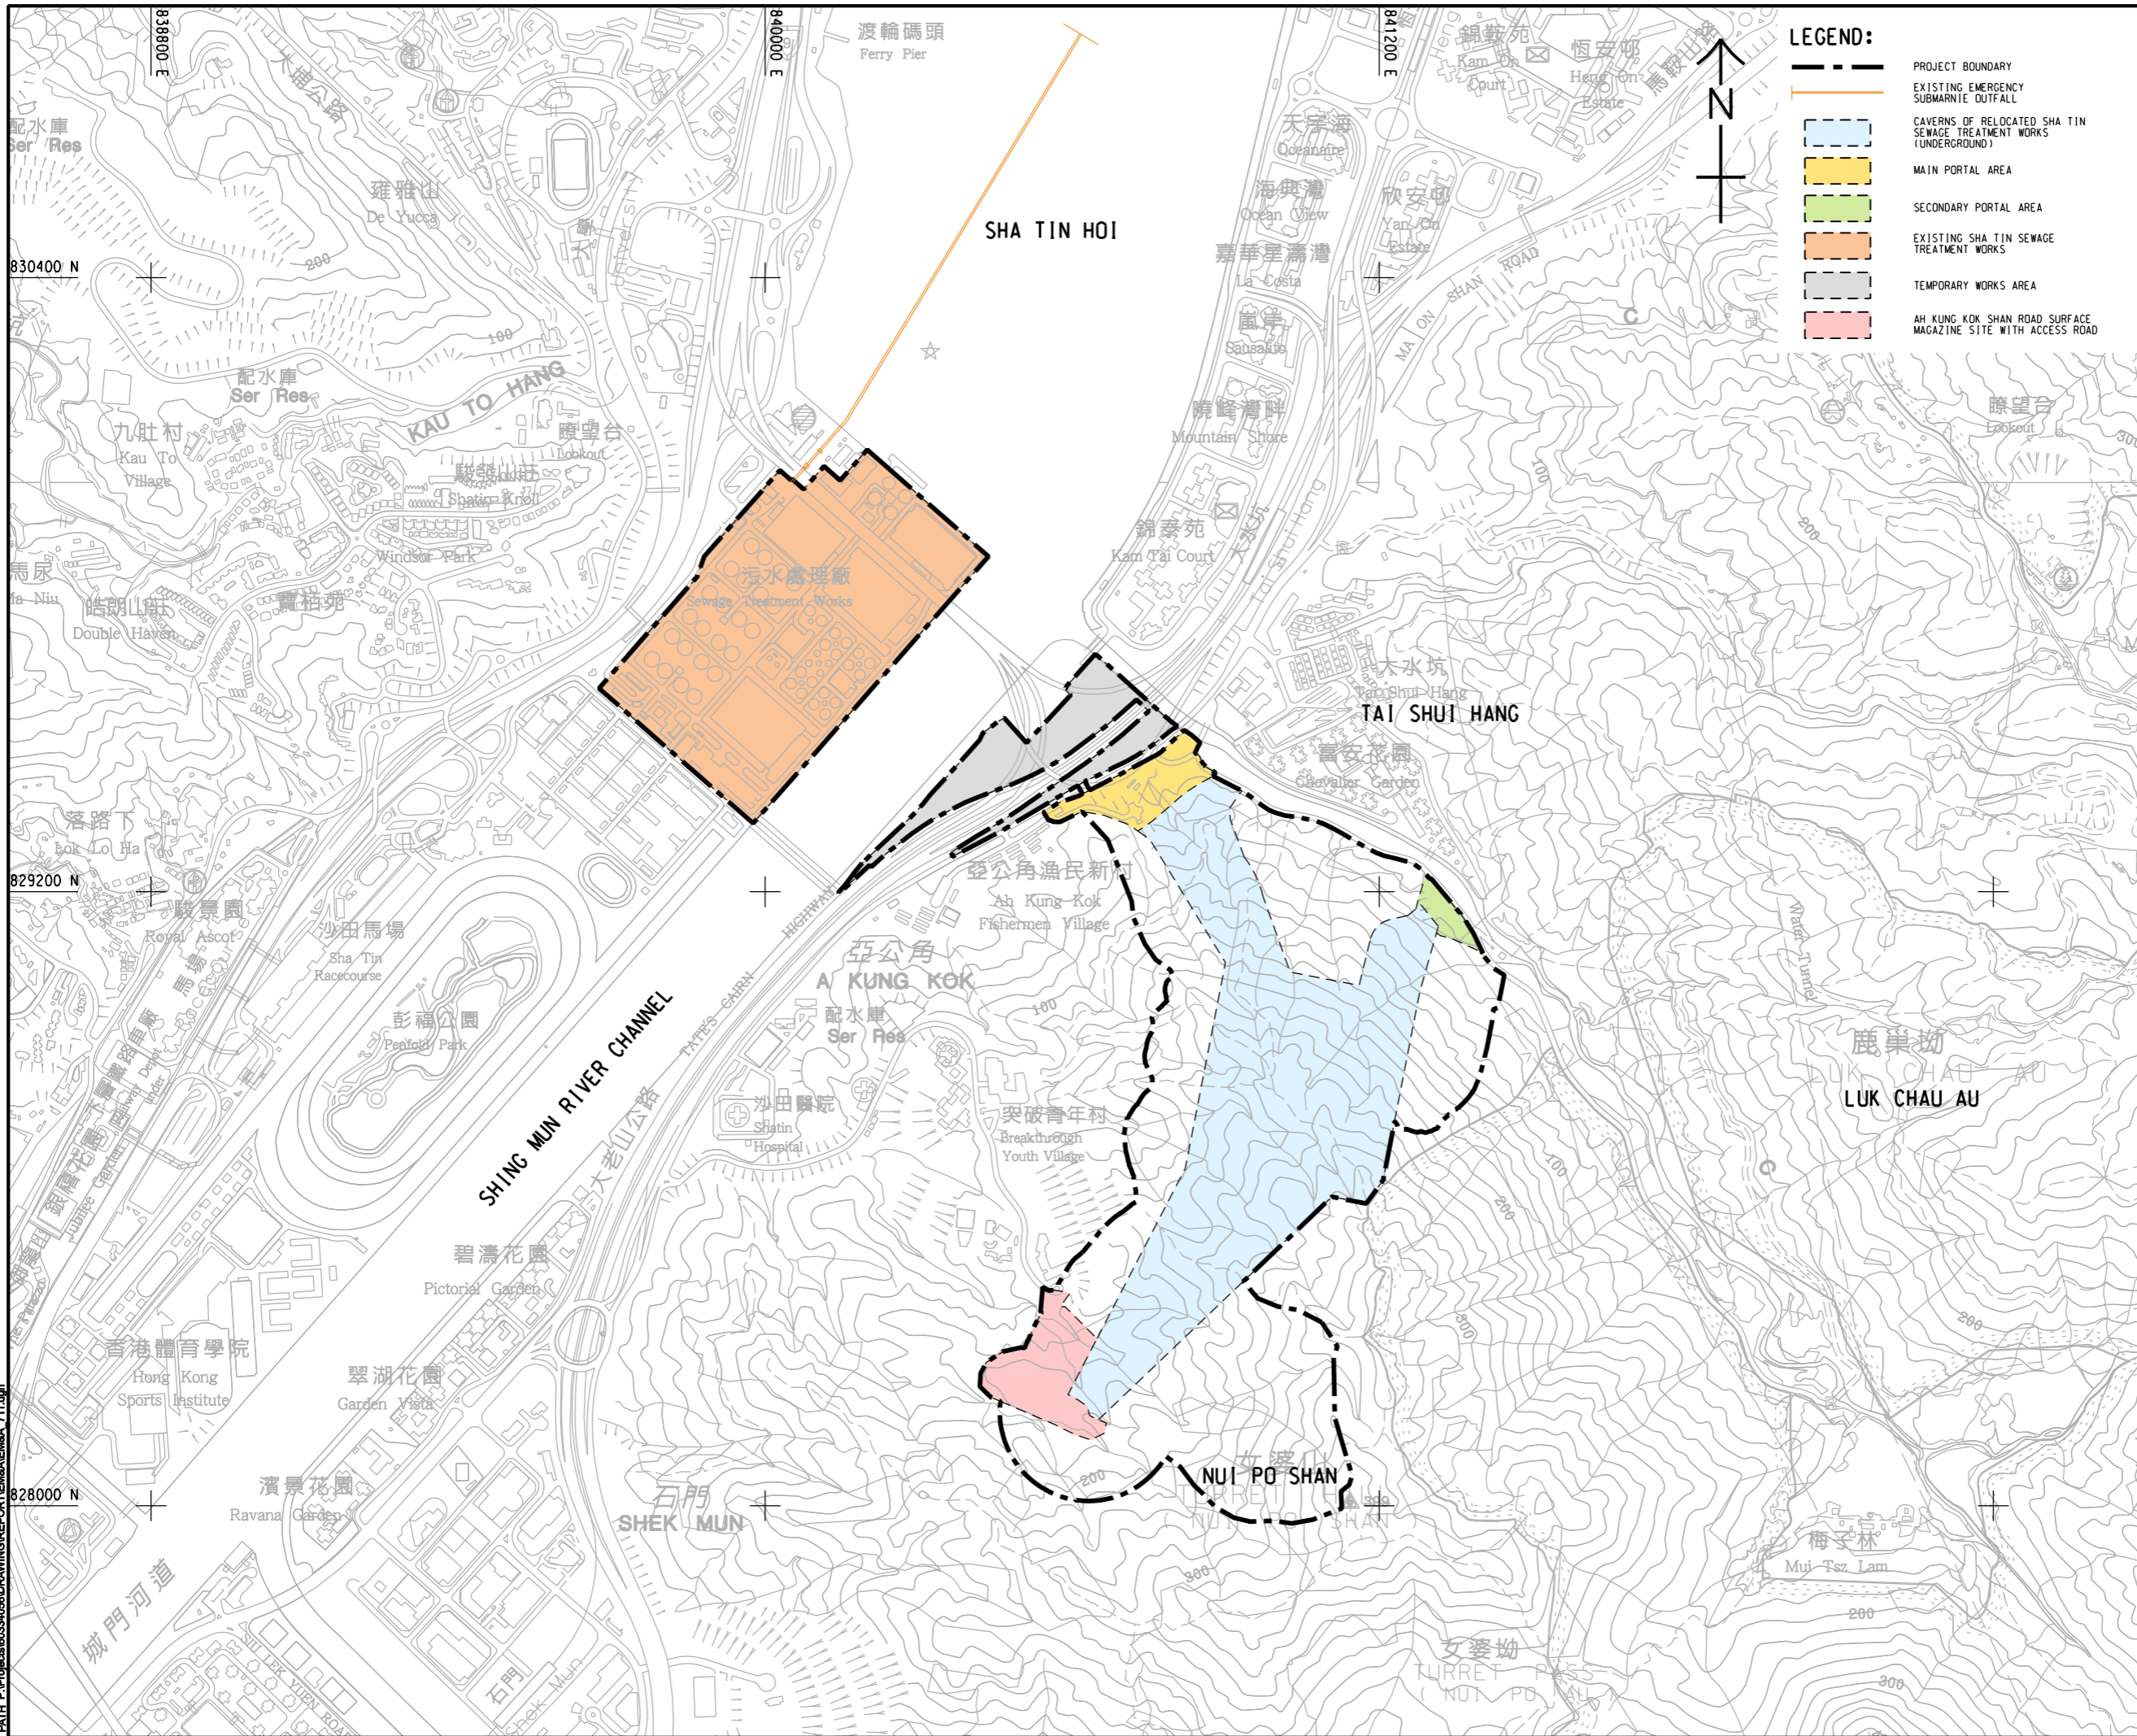

LEGEND:

- PROJECT BOUNDARY
- EXISTING EMERGENCY SUBMARINE OUTFALL
- CAVERNS OF RELOCATED SHA TIN SEWAGE TREATMENT WORKS (UNDERGROUND)
- MAIN PORTAL AREA
- SECONDARY PORTAL AREA
- EXISTING SHA TIN SEWAGE TREATMENT WORKS
- TEMPORARY WORKS AREA
- AH KUNG KOK SHAN ROAD SURFACE MAGAZINE SITE WITH ACCESS ROAD

AECOM

PROJECT
 項目
RELOCATION OF SHA TIN SEWAGE TREATMENT WORKS TO CAVERNS: CAVERNS AND SEWAGE TREATMENT WORKS - INVESTIGATION, DESIGN AND CONSTRUCTION

CLIENT
 業主
 渠務署
 Drainage Services Department

CONSULTANT
 工程顧問公司
 AECOM Asia Company Ltd.
 www.aecom.com

SUB-CONSULTANTS
 分判工程顧問公司

ISSUE/REVISION
 修訂


IR/ 修訂	DATE/ 日期	DESCRIPTION/ 內容摘要	CHK/ 校核

STATUS
 階段

SCALE
 比例
 A3 1: 12000

DIMENSION UNIT
 尺寸單位
 METRES

KEY PLAN A3 1: 50000
 索引圖

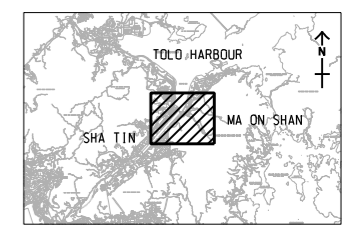

PROJECT NO.
 項目編號
 60334056

CONTRACT NO.
 合約編號
 CE 30/2014 (DS)

SHEET TITLE
 圖紙名稱
 LOCATION PLAN OF THE PROJECT

SHEET NUMBER
 圖紙編號
 60334056/EM&A/1.01

This drawing has been prepared for the use of AECOM's client. It may not be used, modified, reproduced or relied upon by third parties, except as approved by AECOM or as required by law. AECOM accepts no responsibility, and denies any liability whatsoever, for any party that uses or relies on this drawing without AECOM's express written consent. Do not scale this document. All measurements must be obtained from the stated dimensions.



Figure 2.2
Project Organization Chart



Project Organization Chart

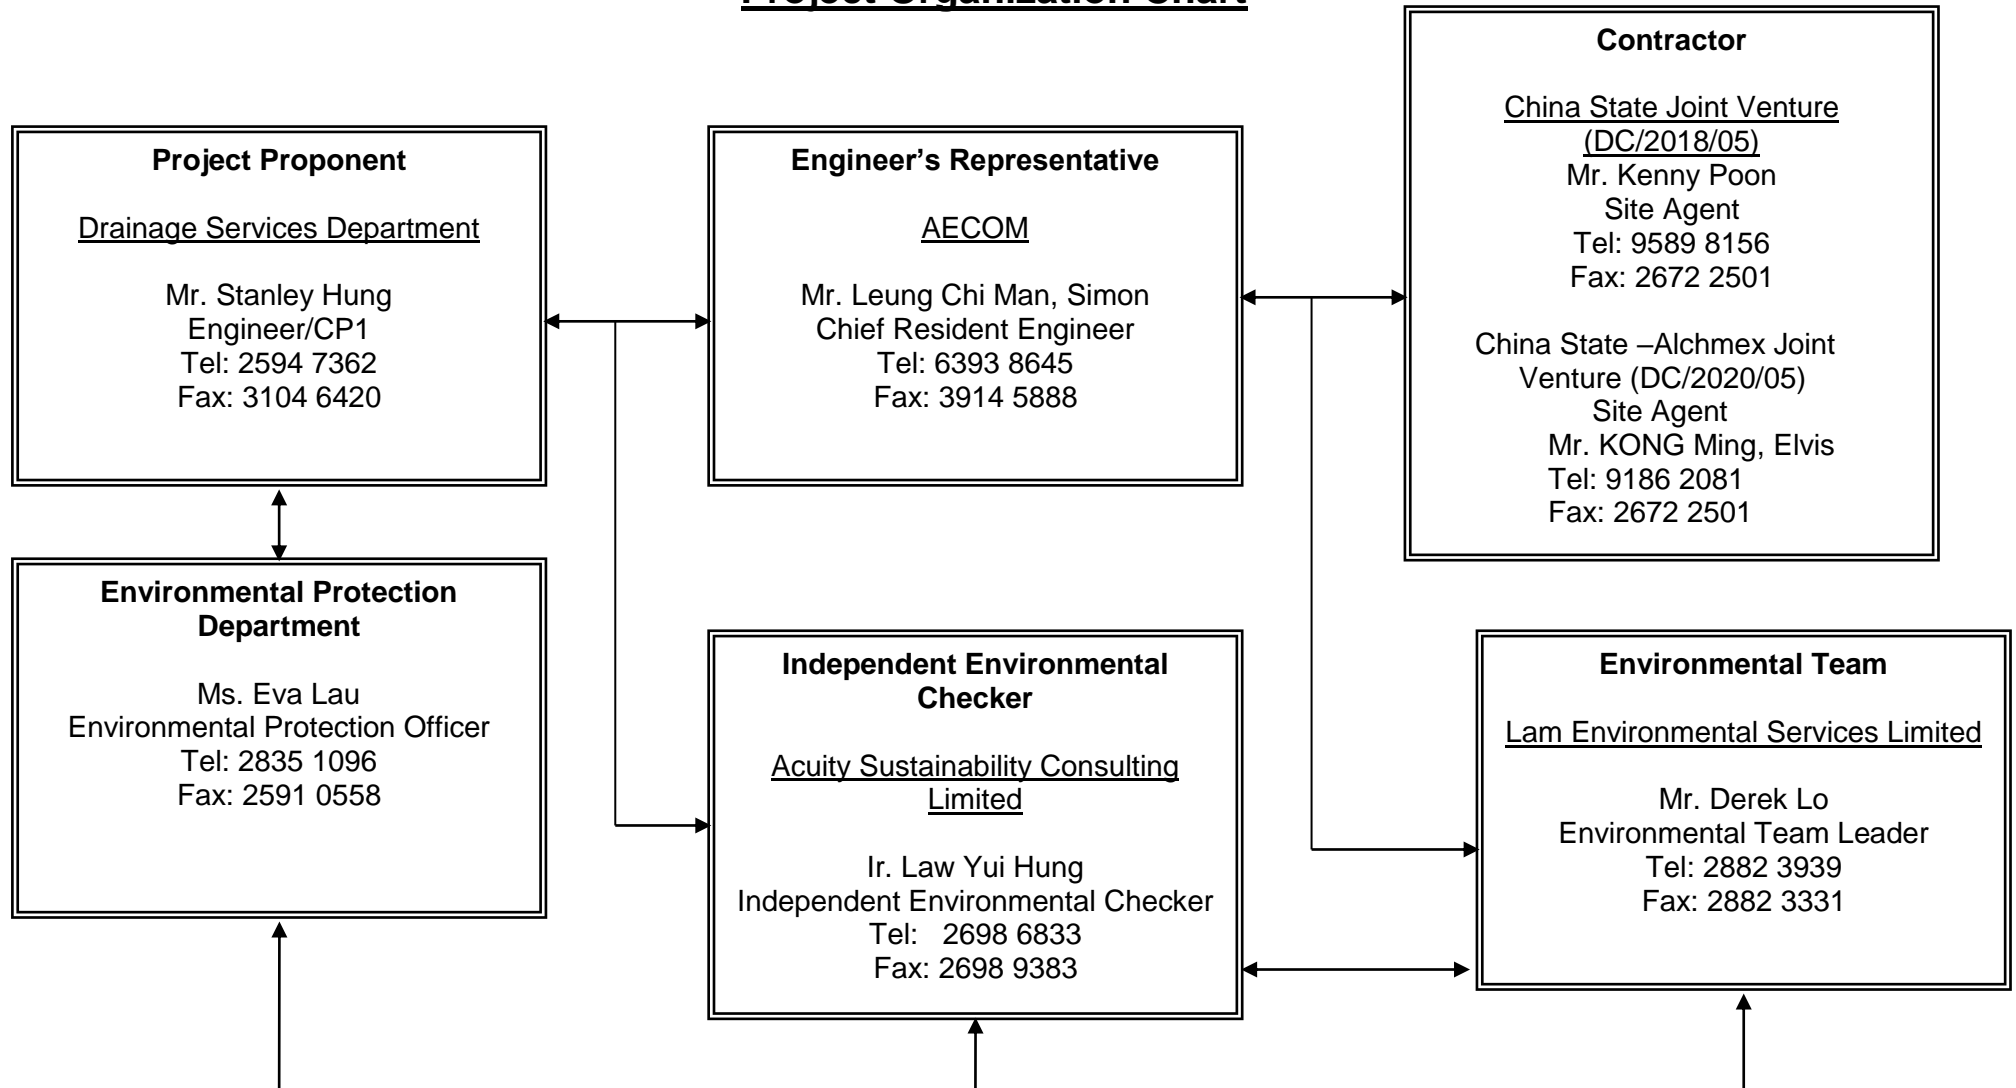



Figure 2.2



Figure 3.1

Locations of Environmental Monitoring Station

ISO A1 594mm x 841mm
 Approved: _____
 Checked: _____
 Designer: _____
 Project Management Initials: _____
 9/2/2020
 Plot File by: \$USERS
 PATH

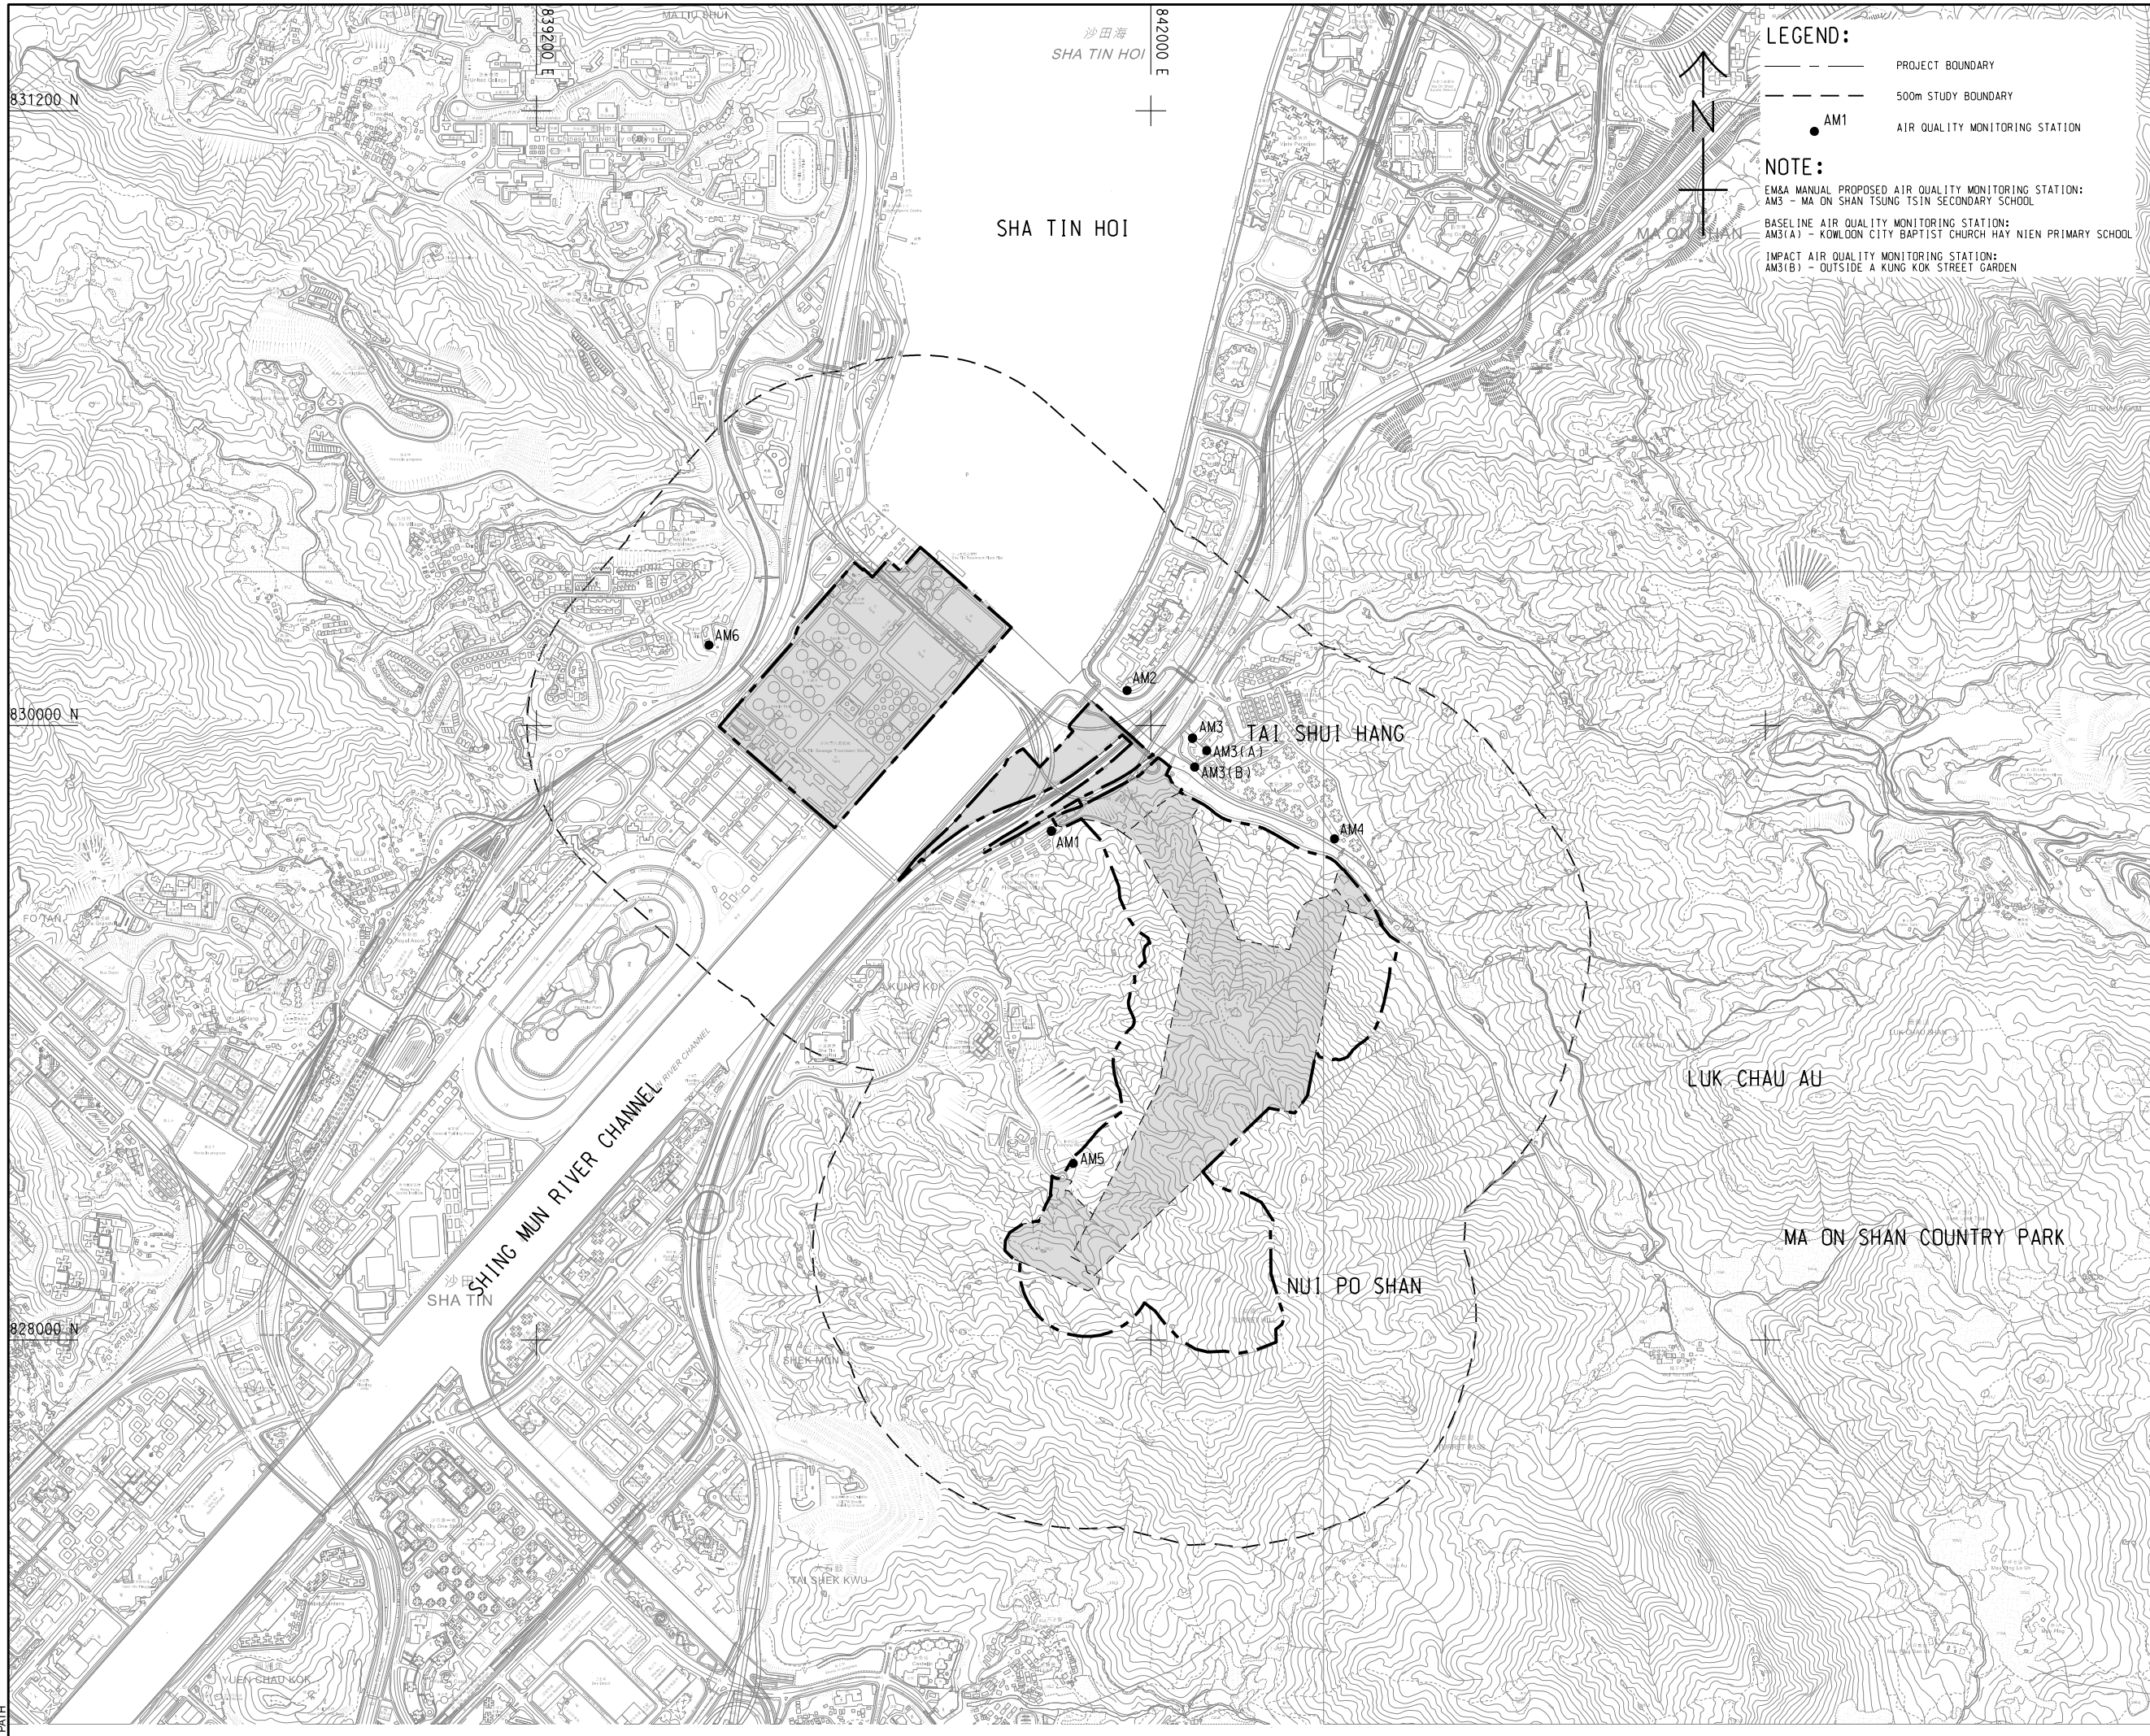

LEGEND:
 - - - - - PROJECT BOUNDARY
 - · - · - 500m STUDY BOUNDARY
 ● AM1 AIR QUALITY MONITORING STATION

NOTE:
 EM&A MANUAL PROPOSED AIR QUALITY MONITORING STATION:
 AM3 - MA ON SHAN TSUNG TSIN SECONDARY SCHOOL
 BASELINE AIR QUALITY MONITORING STATION:
 AM3(A) - KOWLOON CITY BAPTIST CHURCH HAY NIEN PRIMARY SCHOOL
 IMPACT AIR QUALITY MONITORING STATION:
 AM3(B) - OUTSIDE A KUNG KOK STREET GARDEN

AECOM

PROJECT
 項目
RELOCATION OF SHA TIN SEWAGE TREATMENT WORKS TO CAVERNS: CAVERNS AND SEWAGE TREATMENT WORKS - INVESTIGATION, DESIGN AND CONSTRUCTION

CLIENT
 業主
 渠務署
 Drainage Services Department

CONSULTANT
 顧問公司
 AECOM Asia Company Ltd.
 www.aecom.com

SUB-CONSULTANTS
 分判工程師/顧問公司

ISSUE/REVISION
 修訂


IR	DATE	DESCRIPTION	CHK.
修訂	日期	修訂內容	校核

STATUS
 情況

SCALE **DIMENSION UNIT**
 比例尺 尺寸單位

A3 1: 16000 METRES

KEY PLAN A3 1: 400000
 索引圖

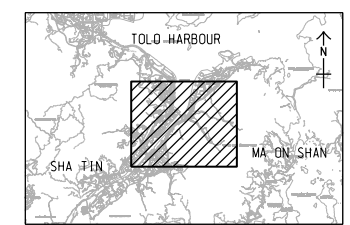

PROJECT NO. **CONTRACT NO.**
 項目編號 合約編號

60334056 CE 30/2014 (DS)

SHEET TITLE
 圖紙標題


LOCATION OF AIR QUALITY MONITORING STATION DURING CONSTRUCTION PHASE

SHEET NUMBER
 圖紙編號

60334056/EM&A/2.01

This drawing has been prepared for the use of AECOM's client. It may not be used, modified, reproduced or relied upon by third parties, except as agreed by AECOM or as required by law. AECOM accepts no responsibility, and disclaims liability, whatsoever to any party that uses or relies on this drawing without AECOM's express written consent. Do not scale this document. All measurements must be obtained from the stated dimensions.

ISO A1 594mm x 841mm
 Approved: _____
 Checked: _____
 Designer: _____
 Project Management Initials: _____
 9/2/2020
 Plot File by: \$USERS
 PATH

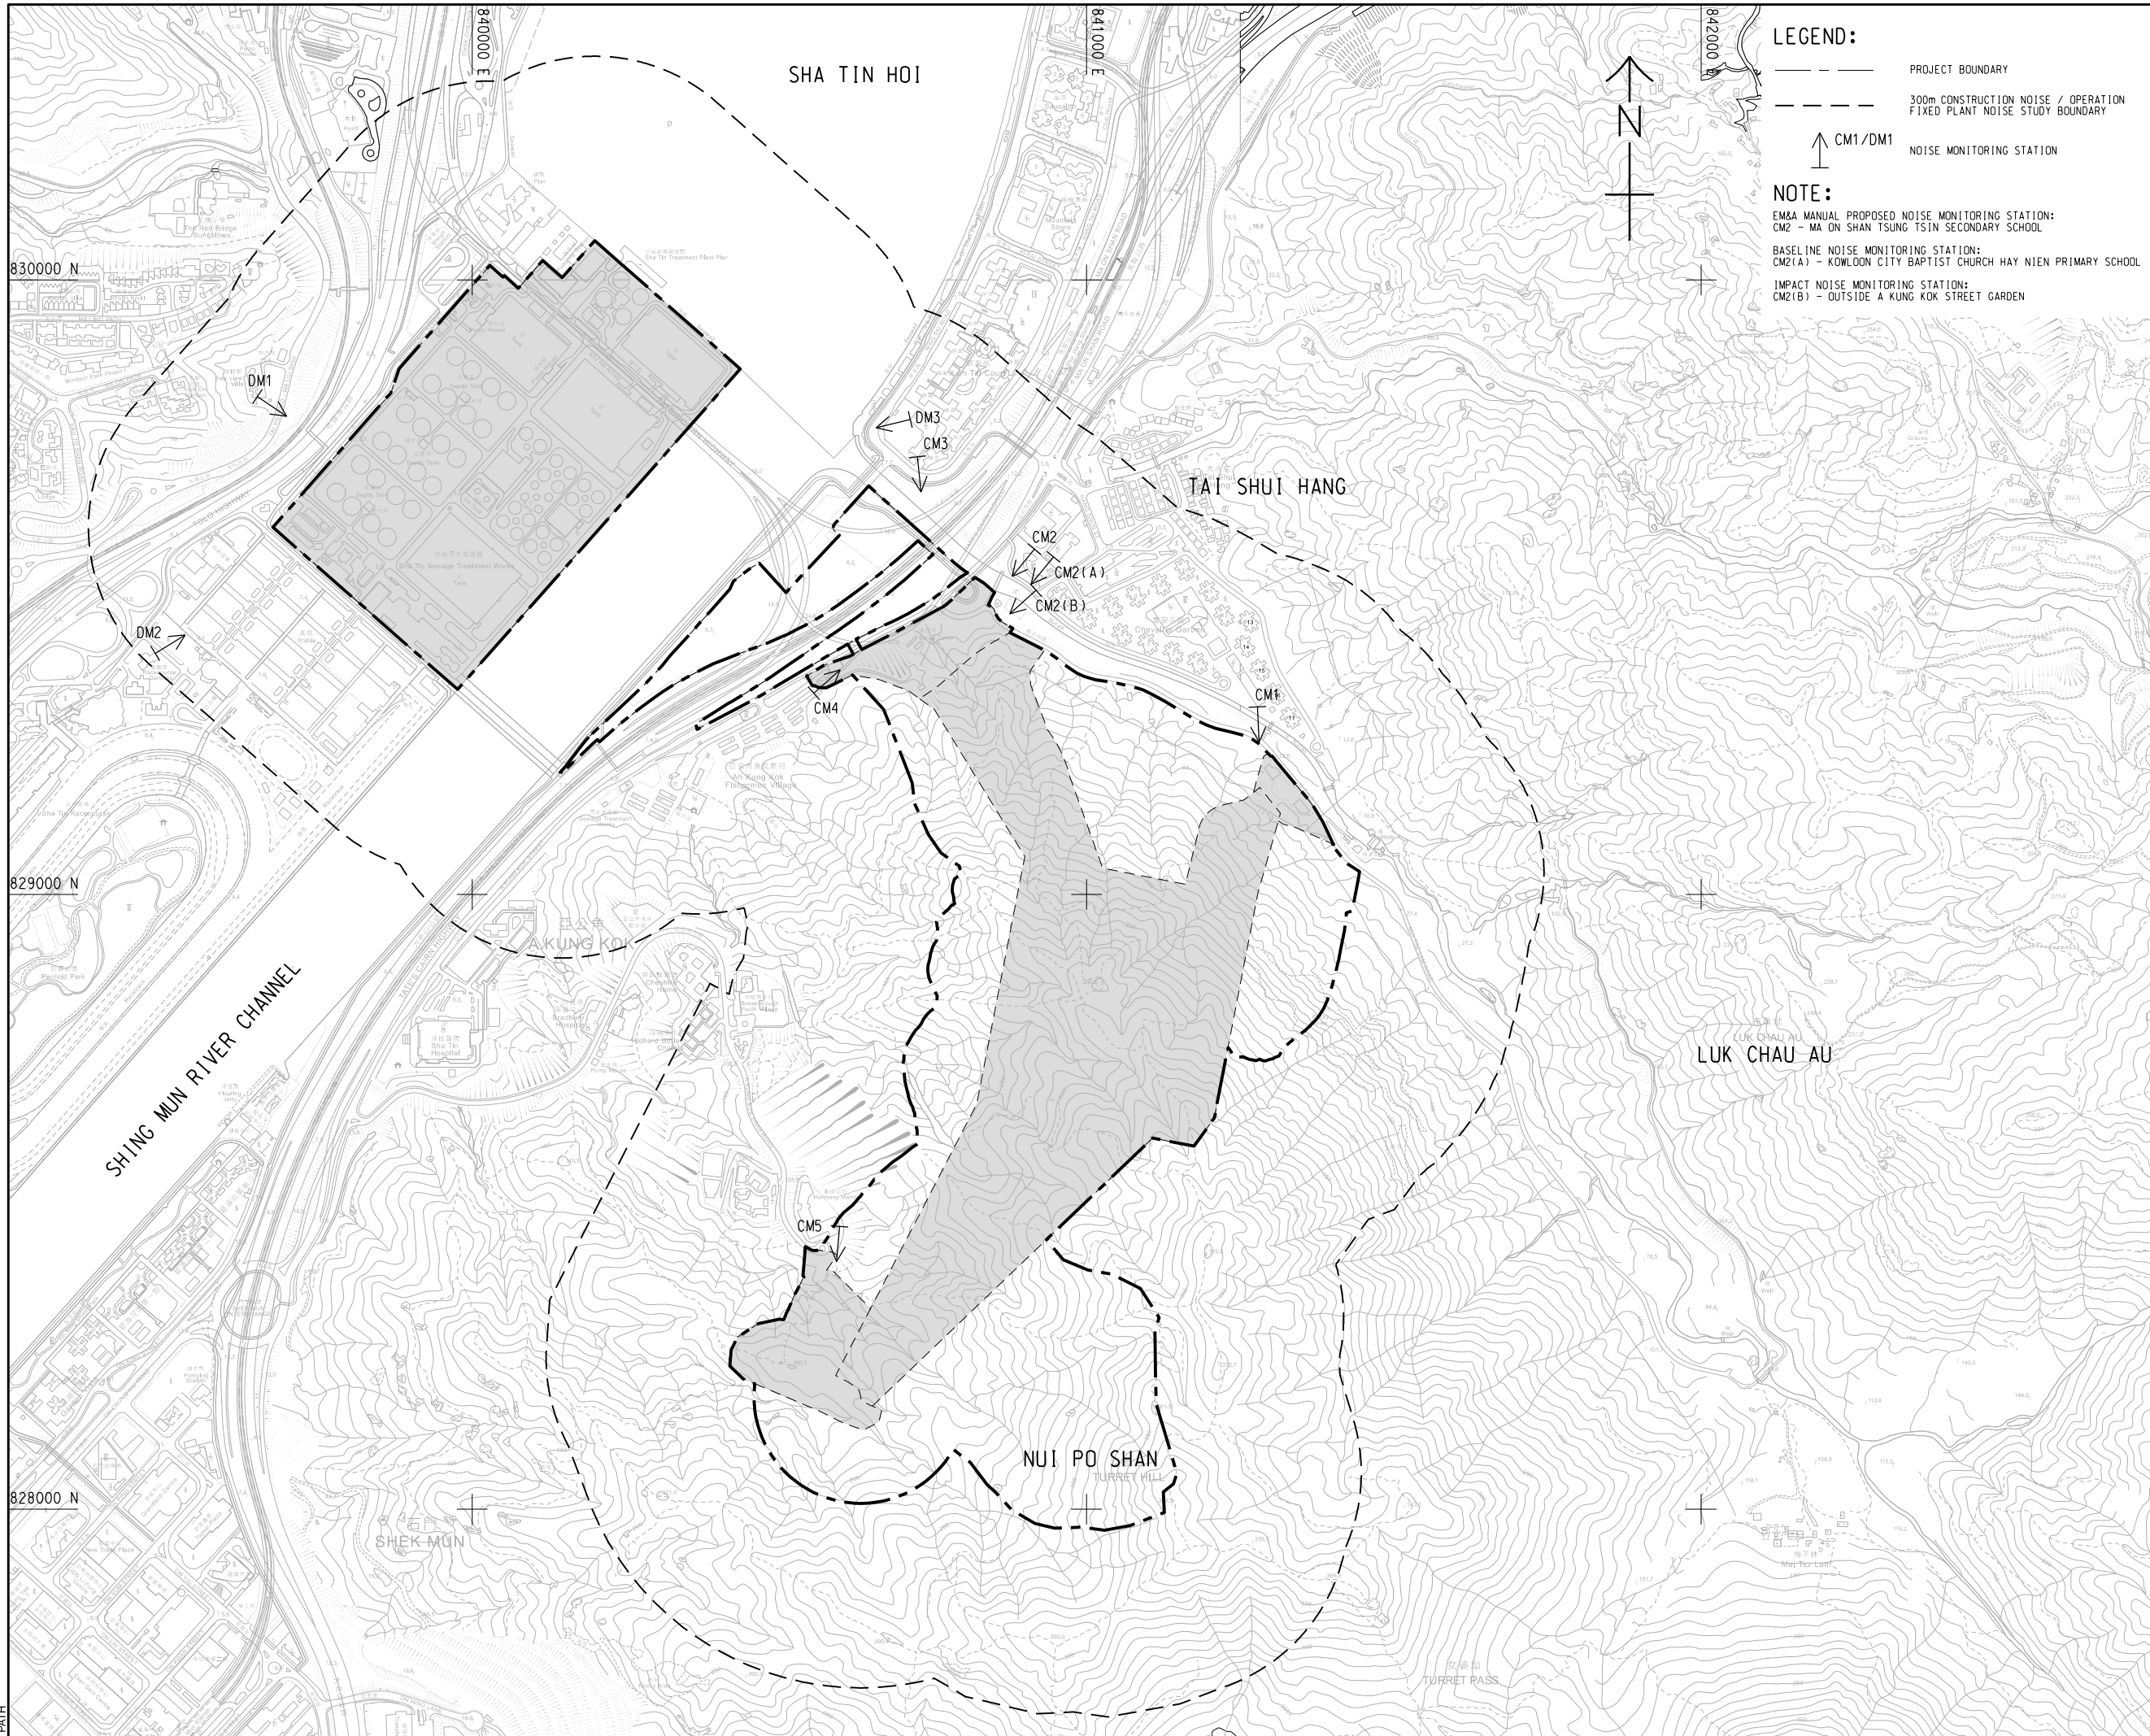

LEGEND:
 - - - - - PROJECT BOUNDARY
 - - - - - 300m CONSTRUCTION NOISE / OPERATION FIXED PLANT NOISE STUDY BOUNDARY
 ↑ CM1/DM1 NOISE MONITORING STATION

NOTE:
 EM&A MANUAL PROPOSED NOISE MONITORING STATION:
 CM2 - MA ON SHAN TSUNG TSIN SECONDARY SCHOOL
 BASELINE NOISE MONITORING STATION:
 CM2(A) - KOWLOON CITY BAPTIST CHURCH HAY NIEN PRIMARY SCHOOL
 IMPACT NOISE MONITORING STATION:
 CM2(B) - OUTSIDE A KUNG KOK STREET GARDEN

AECOM

PROJECT
 項目
RELOCATION OF SHA TIN SEWAGE TREATMENT WORKS TO CAVERNS: CAVERNS AND SEWAGE TREATMENT WORKS - INVESTIGATION, DESIGN AND CONSTRUCTION

CLIENT
 業主
 渠務署
 Drainage Services Department

CONSULTANT
 顧問公司
 AECOM Asia Company Ltd.
 www.aecom.com

SUB-CONSULTANTS
 分列工程師行公司

ISSUE/REVISION
 修訂


IR	DATE	DESCRIPTION	CHK.
修訂	日期	修訂內容	校核

STATUS
 階段

SCALE
 比例
 A3 1 : 10000

DIMENSION UNIT
 尺寸單位
 METRES

KEY PLAN A3 1 : 500000
 索引圖

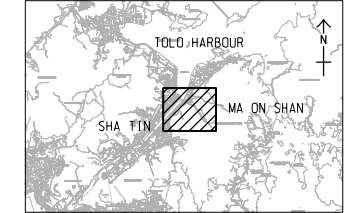

PROJECT NO.
 項目編號
 60334056


CONTRACT NO.
 合約編號
 CE 30/2014 (DS)

SHEET TITLE
 圖紙標題
 LOCATION OF CONSTRUCTION PHASE TRAFFIC NOISE MONITORING STATION

SHEET NUMBER
 圖紙編號
 60334056/EM&A/3.01

This drawing has been prepared for the use of AECOM's client. It may not be used, modified, reproduced or relied upon by third parties, except as agreed by AECOM, or as required by law. AECOM accepts no responsibility, and hereby disclaims liability, whatsoever, to any party that uses or relies on this drawing without AECOM's express written consent. All measurements must be obtained from the stated dimensions.

ISO A1 594mm x 841mm
 Approved:
 Checked:
 Designer:
 Project Management Initials:
 Pld File by: PENGMW 20160227
 PATH: P:\proj\60334056\DRAWING\REPORT\EM&A\EM&A_741.dwg

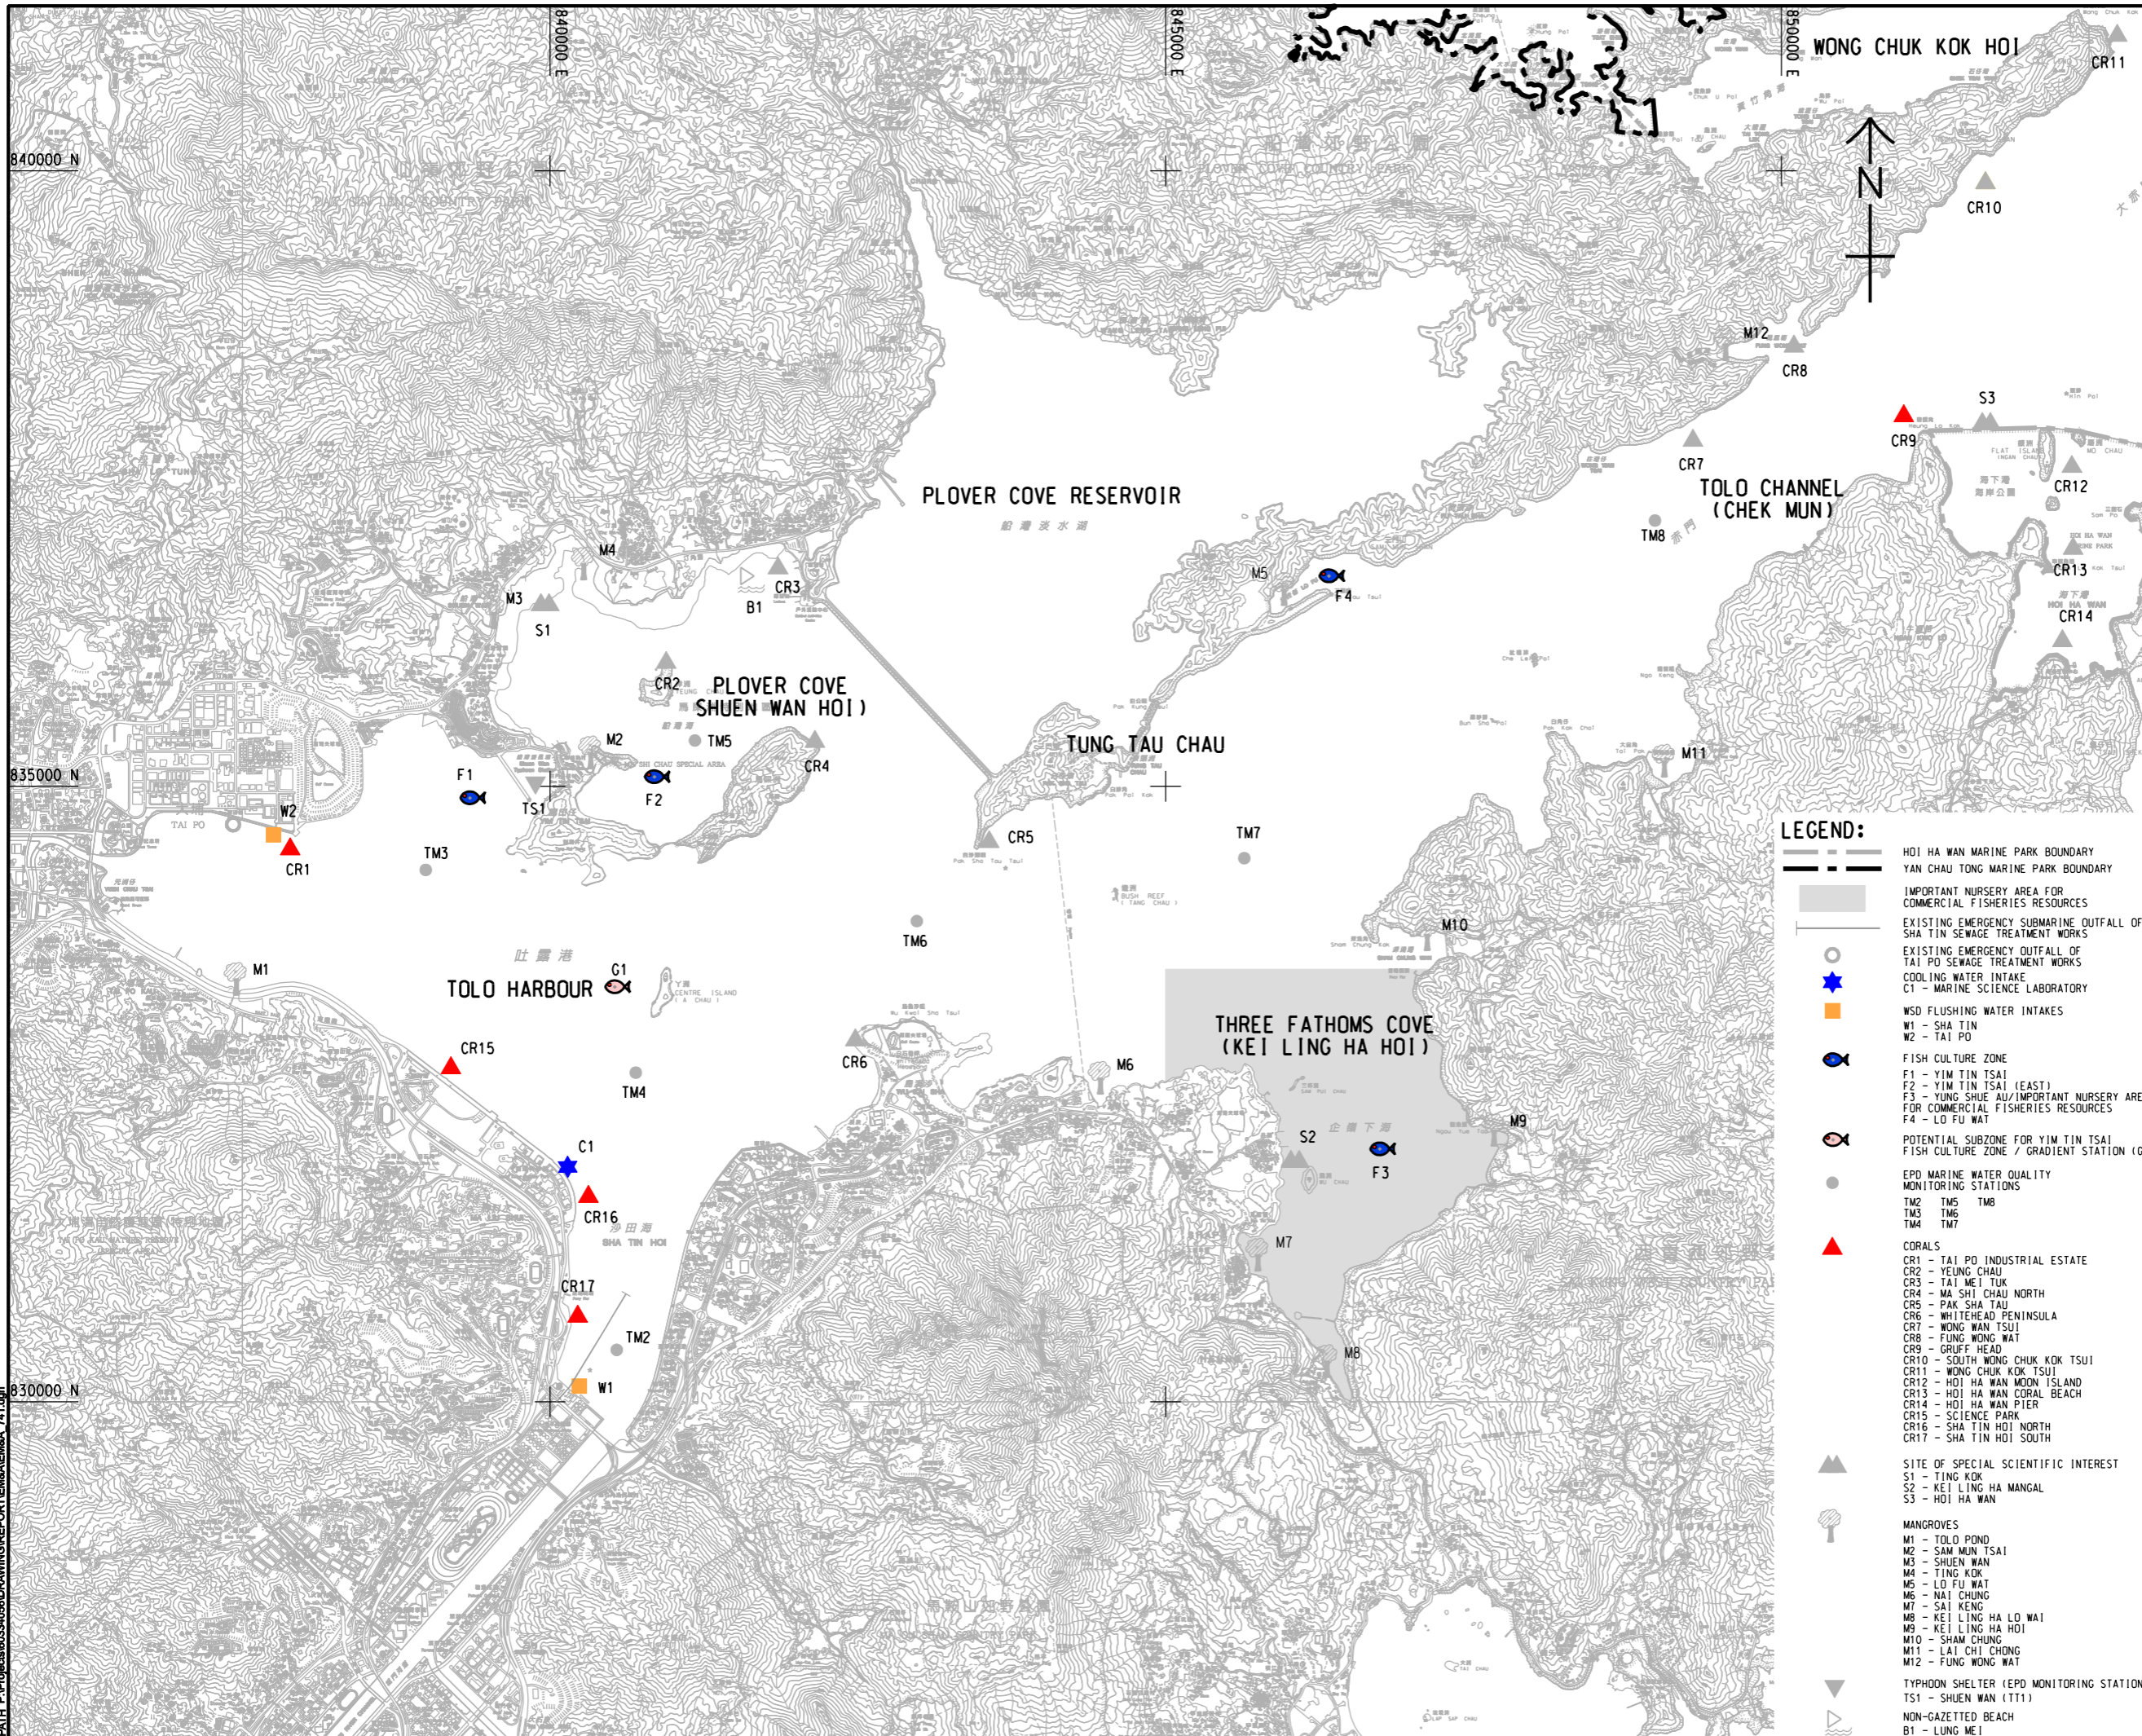

AECOM

PROJECT

RELOCATION OF SHA TIN SEWAGE TREATMENT WORKS TO CAVERNS: CAVERNS AND SEWAGE TREATMENT WORKS - INVESTIGATION, DESIGN AND CONSTRUCTION

CLIENT

渠務署
Drainage Services Department

CONSULTANT

AECOM Asia Company Ltd.
www.aecom.com

SUB-CONSULTANTS

分項工程顧問公司

LEGEND:

- HOI HA WAN MARINE PARK BOUNDARY
- YAN CHAU TONG MARINE PARK BOUNDARY
- IMPORTANT NURSERY AREA FOR COMMERCIAL FISHERIES RESOURCES
- EXISTING EMERGENCY SUBMARINE OUTFALL OF SHA TIN SEWAGE TREATMENT WORKS
- EXISTING EMERGENCY OUTFALL OF TAI PO SEWAGE TREATMENT WORKS
- COOLING WATER INTAKE
- C1 - MARINE SCIENCE LABORATORY
- WSD FLUSHING WATER INTAKES
- W1 - SHA TIN
- W2 - TAI PO
- FISH CULTURE ZONE
- F1 - YIM TIN TSAI
- F2 - YIM TIN TSAI (EAST)
- F3 - YUNG SHUE AU/IMPORTANT NURSERY AREA FOR COMMERCIAL FISHERIES RESOURCES
- F4 - LO FU WAT
- POTENTIAL SUBZONE FOR YIM TIN TSAI FISH CULTURE ZONE / GRADIENT STATION (G1)
- EPD MARINE WATER QUALITY MONITORING STATIONS
- TM2 TM5 TM8
- TM3 TM6
- TM4 TM7
- CORALS
- CR1 - TAI PO INDUSTRIAL ESTATE
- CR2 - YEUNG CHAU
- CR3 - TAI MEI TUK
- CR4 - MA SHI CHAU NORTH
- CR5 - PAK SHA TAU
- CR6 - WHITEHEAD PENINSULA
- CR7 - WONG WAN TSUI
- CR8 - FUNG WONG WAT
- CR9 - GRUFF HEAD
- CR10 - SOUTH WONG CHUK KOK TSUI
- CR11 - WONG CHUK KOK TSUI
- CR12 - HOI HA WAN MOON ISLAND
- CR13 - HOI HA WAN CORAL BEACH
- CR14 - HOI HA WAN PIER
- CR15 - SCIENCE PARK
- CR16 - SHA TIN HOI NORTH
- CR17 - SHA TIN HOI SOUTH
- SITE OF SPECIAL SCIENTIFIC INTEREST
- S1 - TING KOK
- S2 - KEI LING HA MANGAL
- S3 - HOI HA WAN
- MANCROVES
- M1 - TOLO POND
- M2 - SAM MUN TSAI
- M3 - SHUEN WAN
- M4 - TING KOK
- M5 - LO FU WAT
- M6 - NAI CHUNG
- M7 - SAI KENG
- M8 - KEI LING HA LO WAI
- M9 - KEI LING HA HOI
- M10 - SHAM CHUNG
- M11 - LAI CHI CHONG
- M12 - FUNG WONG WAT
- TYPHOON SHELTER (EPD MONITORING STATION)
- TS1 - SHUEN WAN (TT1)
- NON-GAZETTED BEACH
- B1 - LUNG MEI

ISSUE/REVISION

NO.	DATE	DESCRIPTION	CHK.

STATUS


SCALE

A3 1: 50000

DIMENSION UNIT

METRES

KEY PLAN

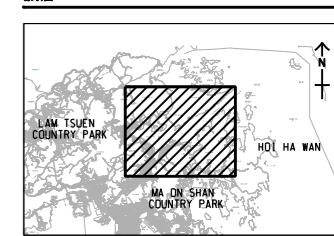

PROJECT NO.

60334056

CONTRACT NO.

CE 30/2014 (DS)

SHEET TITLE

LOCATIONS OF MARINE WATER QUALITY MONITORING STATIONS

SHEET NUMBER

60334056/EM&A/4.01

This drawing has been prepared for the use of AECOM's client. It may not be used, modified, reproduced or relied upon by third parties, except as agreed by AECOM or as required by law. AECOM accepts no responsibility, and denies any liability whatsoever, to any party, for uses or reliance on this drawing without AECOM's express written consent. Do not scale this document. All measurements must be obtained from the stated dimensions.



Appendix 2.1

Environmental Mitigation Implementation Schedule

APPENDIX C IMPLEMENTATION SCHEDULE OF RECOMMENDED MITIGATION MEASURES

C.1 Introduction

C.1.1 This section presents the implementation schedule of mitigation measures for the Project. **Table C.1** summarises the details of the recommended mitigation measures for all works areas. For each recommended mitigation measures, both the location and timing for the measure have clearly been identified as well as the parties responsible for implementing the measure and for maintenance (where applicable).

Table C.1 Implementation Schedule of Recommended Mitigation Measures

EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of Measures / Timing of Completion of Measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	C	O	Dec	
Air Quality Impact									
Construction Phase									
Table 3.5	2.4.1	The rock crushing plant is configured as an enclosed system. Dust collector with dust removal efficiency of 99% will be provided at the exhaust of the rock crusher during rock crushing. Watering will be provided to maintain material in wet condition. Vehicles would be required to pass through the wheel washing facilities provided at site exit.	Rock Crushing Plant / Construction Phase	Contractor	√	√		√	Air Pollution Control Ordinance (APCO)
3.8.1	2.4.1	Watering eight times a day on active works areas, exposed areas and unpaved haul roads to reduce dust emission by 87.5%.	All active works areas, exposed areas and unpaved haul roads	Contractor		√		√	APCO

¹ Des = Design; C = Construction; O = Operation; Dec = Decommissioning

EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of Measures / Timing of Completion of Measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	C	O	Dec	
3.8.1	2.4.1	<p>Dust suppression measures stipulated in the Air Pollution Control (Construction Dust) Regulation and good site practices:</p> <ul style="list-style-type: none"> • Use of regular watering to reduce dust emissions from exposed site surfaces and unpaved roads, particularly during dry weather. • Use of frequent watering for particularly dusty construction areas and areas close to ASRs. • Side enclosure and covering of any aggregate or dusty material storage piles to reduce emissions. Where this is not practicable owing to frequent usage, watering shall be applied to aggregate fines. • Open stockpiles shall be avoided or covered. Where possible, prevent placing dusty material storage piles near ASRs. • Tarpaulin covering of all dusty vehicle loads transported to, from and between site locations. • Establishment and use of vehicle wheel and body washing facilities at the exit points of the site. • Provision of wind shield and dust extraction units or similar dust mitigation measures at the loading area of barging point, and use of water sprinklers at the loading area 	Construction Sites	Contractor		√		√	APCO and Air Pollution Control (Construction Dust) Regulation

EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of Measures / Timing of Completion of Measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	C	O	Dec	
		<p>where dust generation is likely during the loading process of loose material, particularly in dry seasons/ periods.</p> <ul style="list-style-type: none"> • Provision of not less than 2.4m high hoarding from ground level along site boundary where adjoins a road, streets or other accessible to the public except for a site entrance or exit. • Imposition of speed controls for vehicles on site haul roads. • Where possible, routing of vehicles and positioning of construction plant should be at the maximum possible distance from ASRs. • Every stock of more than 20 bags of cement or dry PFA should be covered entirely by impervious sheeting or placed in an area sheltered on the top and the 3 sides. • Instigation of an environmental monitoring and auditing program to monitor the construction process in order to enforce controls and modify method of work if dusty conditions arise. 							

EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of Measures / Timing of Completion of Measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	C	O	Dec	
	Operation Phase								
3.5.2	-	Sludge tanks with totally enclosed design proven by DSD should be deployed for transporting sludge. With thorough cleaning practice and regular condition test of the sludge tanks, odour emission and leachate leakage during storage and transportation are not anticipated.	Cavern Sewage Treatment Works (CSTW) / Operation Phase	Project Proponent / Operator	√		√		-
3.6.2, 3.7.2	2.4.2	All treatment units with potential odour emission will be covered and the exhausted air will be conveyed to the deodouriser (with 80 – 97% odour removal efficiency) for treatment before discharge to the environment.	CSTW / Operation Phase	Design team / Project Proponent / Operator	√		√		-
3.7.2	2.4.2	The following appropriate odour control measures would be implemented. (i) Adopting the advantage of caverns as natural barriers for odour control; (ii) Covering up of odour sources; (iii) Preventing odour leakage through the access tunnels by applying negative pressure inside caverns; (iv) Installing deodourizing units to clean up the collected foul air; (v) Discharging exhausted air at height to further enhance the dilution effect; and (vi) Enhancing the odour management of the sludge transportation.	CSTW / Operation Phase	Design team / Project Proponent / Operator	√		√		-

EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of Measures / Timing of Completion of Measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	C	O	Dec	
3.10.2	2.3.1	Odour monitoring at the inlet and outlet of the deodourizing units is proposed to be conducted for first three years of the operation of CSTW, quarterly in the first year, and once every 6 months in the second and third years if monitoring results remain below the limit levels.	CSTW / Operation Phase	Project Proponent / Operator	√		√		-
3.10.2	2.3.2	An Odour Complaint Registration System is also proposed in the EM&A programme to check whether the deodorizing units can fulfill the recommended odour removal performance.	CSTW / Operation Phase	Operator			√		-
3.10.2	-	Any unexpected leakage from tanks could be observed with monitoring equipment. Monitoring equipment would be installed in the CSTW to monitor the concentration of H ₂ S, CO and CO ₂ and methane. Investigation and repair works would be carried out immediately if abrupt increase of these concentrations are reported. Emergency Plan would be established for these upset conditions.	CSTW / Operation Phase	Project Proponent / Operator	√		√		-
Noise Impact									
Construction Phase									
4.5.1.6	-	Re-provision of 220m length noise barrier with 10mPD on temporary access haul road to replace the existing 150m length noise barrier with 9.2mPD to 10mPD on Ma On Sha Road. The	Proposed temporary access / Construction Phase	Contractor		√			Technical Memorandum on Environmental Impact Assessment Process (EIAO-TM), Noise Control Ordinance (NCO)

EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of Measures / Timing of Completion of Measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	C	O	Dec	
		location of the relocated noise barrier is shown in Figure No. 60334056/EIA/4.02 and Appendix 4.07 . Once the construction work for the CSTW is completed, the temporary access roads would be demolished and the relevant section of Ma On Shan Road and associated noise barrier would be recovered as before.							
4.8.1	3.8.1	The use of quiet plant associated with the construction works is prescribed in British Standard "Code of practice for noise and vibration control on construction and open sites, BS5228" which contains the SWLs for specific quiet PME.	All Construction Work Sites	Contractor		√		√	EIAO-TM, NCO
4.8.1	3.8.1	To alleviate the construction noise impact on the affected NSRs, movable noise barrier for Air Compressor, Bar Bender and Cutter, Breaker, Chisel, Saw, Compactor, Mixers, Pump, Crane, Desander, Drilling Rig, Dump Truck, Excavator, Generator, Grab, Lorry, Paver, Poker and Roller are proposed.	All Construction Work Sites	Contractor		√		√	EIAO-TM, NCO
4.8.1	3.8.1	Provision of noise barrier/acoustic mats for Drilling Jumbo so as to have screening effecting with 10 dB(A) noise attenuation	Drilling Jumbo operate outside the portal and within 20m inside the portal	Contractor		√			EIAO-TM, NCO
4.8.1	3.8.1	To further alleviate the construction noise impact on the Neighbourhood Advice-Action Council Harmony	Construction Site for access road for	Contractor		√		√	EIAO-TM, NCO

EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of Measures / Timing of Completion of Measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	C	O	Dec	
		Manor, it is proposed to limit the number of on-time operating PMEs within 120m of this NSR during construction of access road.	magazine at A Kung Kok Road						
4.9.1	3.8.1	<p>In addition to the above-mentioned mitigation measures, good site practices listed below shall be adopted by all the contractors to further ameliorate the noise impacts.</p> <ul style="list-style-type: none"> • Only well-maintained plant should be operated on-site and plant should be serviced regularly during the construction program. • Silencers or mufflers on construction equipment should be utilised and should be properly maintained during the construction program. • Mobile plant, if any, should be sited as far away from NSRs as possible. • Machines and plant (such as trucks) that may be in intermittent use should be shut down between works periods or should be throttled down to a minimum. • Plant known to emit noise strongly in one direction should, wherever possible, be orientated so that the noise is directed away from the nearby NSRs. 	All Construction Work Sites	Contractor		√		√	EIAO-TM, NCO

EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of Measures / Timing of Completion of Measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	C	O	Dec	
		<ul style="list-style-type: none"> Material stockpiles and other structures should be effectively utilised, wherever practicable, in screening noise from on-site construction activities. 							
	Operation Phase								
4.7.4	3.8.2	The maximum allowable sound power levels for the ventilation shaft, ventilation buildings at main portal and emergency portal, ventilation fan for chiller plant room and cooling tower at the administration building as presented in Table 4.16 of the EIA Report should be achieved such that the nearest affected NSRs can be in compliance with the noise criteria	Ventilation Shaft, Administration Building and Ventilation Buildings/ Operation Phase	Project Proponent	√		√		EIAO-TM, NCO
4.11.2	3.8.2	Prior to the operational phase of the Project, a commissioning test for the ventilation buildings, the ventilation shaft, ventilation fan for chiller plant room at administration building and cooling tower at the administration building would be conducted to ensure compliance with the relevant allowable maximum sound power levels.	Ventilation Shaft, Administration Building and Ventilation Buildings/ Operation Phase	Contractor			√		EIAO-TM, NCO

EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of Measures / Timing of Completion of Measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	C	O	Dec	
Water Quality Impact									
Construction Phase									
5.7.2	4.10	Water used in ground boring and drilling for site investigation or rock / soil anchoring should as far as practicable be re-circulated after sedimentation. When there is a need for final disposal, the wastewater should be discharged into storm drains via silt removal facilities.	Construction Sites / Construction Phase	Contractor		√			Water Pollution Control Ordinance (WPCO), EIAO-TM
5.7.2	4.10	All vehicles and plant should be cleaned before they leave a construction site to minimise the deposition of earth, mud, debris on roads. A wheel washing bay should be provided at every site exit if practicable and wash-water should have sand and silt settled out or removed before discharging into storm drains. The section of construction road between the wheel washing bay and the public road should be paved with backfill to reduce vehicle tracking of soil and to prevent site run-off from entering public road drains.	Construction Sites / Construction Phase	Contractor		√			Professional Persons Environmental Consultative Committee (ProPECC) Practice Note (PN) 1/94, WPCO, Waste Disposal Ordinance (WDO)
5.7.2	4.10	Good site practices should be adopted to remove rubbish and litter from construction sites so as to prevent the rubbish and litter from spreading from the site area. It is recommended to clean the construction sites on a regular basis.	Construction Sites / Construction Phase	Contractor		√			WPCO, EIAO-TM

EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of Measures / Timing of Completion of Measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	C	O	Dec	
5.7.2	4.10	The site practices outlined in ProPECC PN 1/94 "Construction Site Drainage" should be followed where applicable to minimise surface run-off and the chance of erosion.	Construction Sites / Construction Phase	Contractor		√			WPCO, EIAO-TM, ProPECC PN 1/94
5.7.2	4.10	There is a need to apply to EPD for a discharge licence for discharge of effluent from the construction site under the WPCO. The discharge quality must meet the requirements specified in the discharge licence. All the runoff and wastewater generated from the works areas should be treated so that it satisfies all the standards listed in the Technical Memorandum on Standards for Effluents Discharged into Drainage and Sewerage Systems, Inland and Coastal Waters (TM-DSS). The beneficial uses of the treated effluent for other on-site activities such as dust suppression, wheel washing and general cleaning etc., can minimise water consumption and reduce the effluent discharge volume. If monitoring of the treated effluent quality from the works areas is required during the construction phase of the Project, the monitoring should be carried out in accordance with the relevant WPCO licence which is under the ambit of RO of EPD.	Construction Sites / Construction Phase	Contractor		√			WPCO, EIAO-TM, (TM-DSS)
5.7.2	4.10	Contractor must register as a chemical waste producer if chemical wastes would be produced from the	Construction Sites / Construction Phase	Contractor		√			WPCO, EIAO-TM, WDO

EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of Measures / Timing of Completion of Measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	C	O	Dec	
		construction activities. The Waste Disposal Ordinance (Cap 354) and its subsidiary regulations in particular the Waste Disposal (Chemical Waste) (General) Regulation, should be observed and complied with for control of chemical wastes.							
5.7.2	4.10	Any service shop and maintenance facilities should be located on hard standings within a bonded area, and sumps and oil interceptors should be provided. Maintenance of vehicles and equipment involving activities with potential for leakage and spillage should only be undertaken within the areas appropriately equipped to control these discharges.	Construction Sites / Construction Phase	Contractor		√			WPCO, EIAO-TM
5.7.2	4.10	Disposal of chemical wastes should be carried out in compliance with the Waste Disposal Ordinance. The Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes published under the Waste Disposal Ordinance should be followed to avoid leakage or spillage of chemicals.	Construction Sites / Construction Phase	Contractor		√			WPCO, EIAO-TM, WDO
5.7.2	4.10	Sufficient chemical toilets should be provided in the works areas. A licensed waste collector should be deployed to clean the chemical toilets on a regular basis.	Construction Sites / Construction Phase	Contractor		√			WPCO, EIAO-TM

EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of Measures / Timing of Completion of Measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	C	O	Dec	
5.7.2	4.10	Notices should be posted at conspicuous locations to remind the workers not to discharge any sewage or wastewater into the surrounding environment.	Construction Sites / Construction Phase	Contractor		√			WPCO, EIAO-TM
5.7.2	4.10	The practices outlined in ETWB TC (Works) No. 5/2005 "Protection of natural streams/rivers from adverse impacts arising from construction works" should also be adopted where applicable to minimise the water quality impacts upon any natural streams or surface water systems.	Construction Sites / Construction Phase	Contractor		√			WPCO, EIAO-TM, ETWB TC (Works) No. 5/2005
5.7.2	4.10	Appropriate measures during the construction of the cavern construction should be implemented to minimise the groundwater infiltration.	Construction Sites / Construction Phase	Contractor		√			WPCO, EIAO-TM
5.7.2	4.10	No directly discharge of groundwater from contaminated areas should be adopted. Prior to any excavation works within the potentially contaminated areas at the existing STSTW site, the baseline groundwater quality in these areas should be reviewed based on the relevant SI data and any additional groundwater quality measurements to be performed with reference to <i>Guidance Note for Contaminated Land Assessment and Remediation</i> and the review results should be submitted to EPD for examination. If the review results indicated that the groundwater to be generated from the excavation	Construction Sites / Construction Phase	Contractor		√			WPCO, EIAO-TM, Guidance Note for Contaminated Land Assessment and Remediation

EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of Measures / Timing of Completion of Measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	C	O	Dec	
		works would be contaminated, this contaminated groundwater should be either properly treated or properly recharged into the ground in compliance with the requirements of the TM-DSS. If wastewater treatment is to be deployed for treating the contaminated groundwater, the wastewater treatment unit shall deploy suitable treatment processes (e.g. oil interceptor / activated carbon) to reduce the pollution level to an acceptable standard and remove any prohibited substances (such as TPH) to an undetectable range. All treated effluent from the wastewater treatment plant shall meet the requirements as stated in TM-DSS and should be either discharged into the foul sewers or tankered away for proper disposal.							
5.7.2	4.10	If deployment of wastewater treatment is not feasible for handling the contaminated groundwater, groundwater recharging wells should be installed as appropriate for recharging the contaminated groundwater back into the ground. The recharging wells should be selected at places where the groundwater quality will not be affected by the recharge operation as indicated in section 2.3 of the TM-DSS. The baseline groundwater quality should be determined prior to the selection of the recharge wells, and submit a working plan to EPD for agreement. Pollution	Construction Sites / Construction Phase	Contractor		√			WPCO, EIAO-TM, TM-DSS

EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of Measures / Timing of Completion of Measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	C	O	Dec	
		levels of groundwater to be recharged shall not be higher than pollutant levels of ambient groundwater at the recharge well. Groundwater monitoring wells should be installed near the recharge points to monitor the effectiveness of the recharge wells and to ensure that no likelihood of increase of groundwater level and transfer of pollutants beyond the site boundary. Prior to recharge, free products should be removed as necessary by installing the petrol interceptor. The Contractor should apply for a discharge licence under the WPCO through the Regional Office of EPD for groundwater recharge operation or discharge of treated groundwater							
5.7.2	4.10	THEES connection works should be synchronized with the THEES maintenance, for a duration not longer than 4 weeks each outside the algae blooming season (January to May) and frequency of THEES maintenance shall be no more than once per year during the construction phase of the Project.	Tolo Harbour / Construction Phase	Project Proponent / Contractor	√	√			EIAO-TM
Construction and Operation Phases									
5.10.2	4.10	Shutdown of the THEES for maintenance should be shortened as far as possible. It is recommended that the maintenance of the THEES tunnel should be avoided during the algae blooming season (January to May).	Tolo Harbour / Construction and Operation Phase	Project Proponent		√	√		WPCO, EIAO-TM

EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of Measures / Timing of Completion of Measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	C	O	Dec	
5.10.2	4.10	Relevant government departments including EPD, WSD, AFCD as well as the key stakeholders for mariculture and fisheries in Tolo Harbour should be informed of the maintenance event prior to any discharge.	Tolo Harbour / Construction and Operation Phase	Project Proponent		√	√		WPCO, EIAO-TM
5.10.3	4.2-4.5	An event and action plan and a water quality monitoring programme (as presented in the EM&A Manual) should be implemented for the THEES maintenance discharge	Tolo Harbour / Construction and Operation Phase	Project Proponent		√	√		WPCO, EIAO-TM
5.10.1	4.10	Silt screen may be installed at the flushing water intakes during the THEES maintenance discharge should it appear necessary. Close communication between DSD and WSD should be maintained to minimize any impact on the flushing water intakes due to THEES maintenance discharge.	WSD flushing water intakes / Construction and Operation Phase	WSD / Project Proponent		√	√		WPCO, EIAO-TM
Design and Operation Phases									
5.8.3	4.6	In case adverse impact on KTN is identified based on the result of the three-month monitoring programme after commissioning of the project, the operation conditions of the treatment and THEES system should be investigated, and corrective and remedial action should be implemented to improve the effluent discharge from the CSTW. Furthermore, DSD should extend the water quality monitoring	Project site / Design and Operation Phases	Project Proponent			√		WPCO, EIAO-TM

EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of Measures / Timing of Completion of Measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	C	O	Dec	
		programme for at least three months or as agreed by the Director of Environmental Protection.							
5.11.2	4.10	Dual power supply or ring main supply from CLP Power Hong Kong Ltd. CLP should be provided for the CSTW to prevent the occurrence of power failure. In addition, standby facilities for the main treatment units and standby equipment parts / accessories should also be provided in order to minimise the chance of emergency discharge. CLP should be consulted in order to ascertain the power supply for normal plant operation within the caverns. It is recommended that government departments including EPD, WSD and AFCD as well as the key stakeholders for mariculture and fisheries in Tolo Harbour should be informed as soon as possible in case of any emergency discharge so that appropriate actions can be taken.	Project site / Design and Operation Phases	Project Proponent	√		√		WPCO, EIAO-TM
5.11.2	4.10	In case of emergency discharge, the plant operators of CSTW should carry out necessary follow-up actions according to the procedures of the current contingency plan formulated for the existing STSTW to minimise the water quality impact.	Project site / Operation Phase	Project Proponent			√		WPCO, EIAO-TM
5.11.2	4.10	WSD may also consider, should it appear necessary, to shut down the Sha Tin seawater pumping station for a short period of time in case of	Sha Tin seawater pumping station / Operation Phase	WSD / Project Proponent			√		WPCO, EIAO-TM

EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of Measures / Timing of Completion of Measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	C	O	Dec	
		emergency discharge in order to minimize any adverse impacts.							
5.13.2	4.10	<p>Best Management Practices to reduce storm water and non-point source pollution are also proposed as follows:</p> <p><u>Design Measures</u></p> <ul style="list-style-type: none"> Exposed surface shall be avoided within the road and portal sites to minimise soil erosion. The access road and the portal areas shall be either hard paved or covered by landscaping area where appropriate. Streams near the Project site will be retained to maintain the original flow path. The drainage system will be designed to avoid flooding. Green areas / planting etc. should be introduced alongside the access road and within the portal areas, as far as possible, to minimise runoff pollution. <p><u>Devices/ Facilities to Control Pollution</u></p> <ul style="list-style-type: none"> Screening facilities such as standard gully grating and trash grille, with spacing which is capable of screening off large substances such as fallen leaves and rubbish should be provided at the inlet of drainage system. Road gullies with standard design and silt traps should be provided to 	Project site / Design and Operation Phase	Project Proponent	√		√		WPCO, ProPECC PN 5/93

EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of Measures / Timing of Completion of Measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	C	O	Dec	
		remove particles present in stormwater runoff, where appropriate. <u>Administrative Measures</u> <ul style="list-style-type: none"> • Good management measures such as regular cleaning and sweeping of road surface/ open areas are suggested. The road surface/ open area cleaning should also be carried out prior to occurrence rainstorm. • Manholes, as well as stormwater gullies, ditches provided at the Project site should be regularly inspected and cleaned (e.g. monthly). Additional inspection and cleansing should be carried out before forecast heavy rainfall. 							
Land Contamination									
6.7.1	-	Further site walkover and/or detailed land contamination assessment will be required for sites that are inaccessible or currently in operation / yet to be constructed (i.e. existing STSTW, David Camp and part of existing Sha Tin VDC, and proposed A Kung Kok Shan Road surface magazine site within the Project boundary). The site walkover, detailed land contamination assessment and if necessary, remediation works should be carried out after decommissioning of the sites	Existing STSTW, David Camp and VDC / Construction Phase	Project Proponent / Contractor		√		√ (for existing STS TW)	Guidance Note for Contaminated Land Assessment and Remediation, Practice Guide for Investigation and Remediation of Contaminated Land, Guidance Manual for Use of Risk-based Remediation Goals for Contaminated Land Management

EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of Measures / Timing of Completion of Measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	C	O	Dec	
		<p>but prior to re-development and should include the following:</p> <ul style="list-style-type: none"> • Prior to the commencement of the SI works, review the CAP to confirm whether the proposed SI works (e.g. sampling locations, testing parameters etc.) are still valid and to confirm the appropriate RBRGs land use scenario for the development; • Submit supplementary CAP(s), presenting the findings of the above review for EPD endorsement. If land contamination issues were identified within David Camp or part of existing VDC / proposed A Kung Kok Shan Road surface magazine site within the Project boundary in the further site walkover, findings of the site walkover and the proposal for SI works should also be presented in the supplementary CAP(s); • Carry out SI works according to the supplementary CAP endorsed by EPD; • Submit CAR(s), detailing findings of the SI works and nature/extent of any soil/groundwater contamination, and, if contaminated identified, RAP(s), discussing the appropriate remedial methods and mitigation 							

EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of Measures / Timing of Completion of Measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	C	O	Dec	
		measures, for the identified contamination, for EPD agreement; and <ul style="list-style-type: none"> Carry out soil/groundwater remediation works according to EPD agreed RAP and submit RR(s) afterwards for EPD agreement. The remediation works and agreement of RR should be completed prior to re-development. 							
6.7.2	-	If contamination were identified, mitigation measures as recommended in the RAP should be followed and should include the following: <ul style="list-style-type: none"> Excavation profiles must be properly designed and executed with attention to the relevant requirements for environment, health and safety; Excavation shall be carried out during dry season as far as possible to minimise contaminated runoff from contaminated soils; Supply of suitable clean backfill material (or treated soil) after excavation; Stockpiling site(s) shall be lined with impermeable sheeting and bunded. Stockpiles shall be fully covered by impermeable sheeting to reduce dust emission. If this is not practicable due to frequent 	Project Site / Construction Phase	Contractor		√		√ (for existing STS TW)	Guidance Note for Contaminated Land Assessment and Remediation, Practice Guide for Investigation and Remediation of Contaminated Land, Guidance Manual for Use of Risk-based Remediation Goals for Contaminated Land Management

EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of Measures / Timing of Completion of Measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	C	O	Dec	
		<p>usage, regular watering shall be applied. However, watering shall be avoided on stockpiles of contaminated soil to minimise contaminated runoff.</p> <ul style="list-style-type: none"> • Vehicles containing any excavated materials shall be suitably covered to limit potential dust emissions or contaminated wastewater run-off, and truck bodies and tailgates shall be sealed to prevent any discharge during transport or during wet conditions; • Speed control for the trucks carrying contaminated materials shall be enforced; • Vehicle wheel and body washing facilities at the site's exist points shall be established and used; and • Pollution control measures for air emissions (e.g. from biopile blower and handling of cement), noise emissions (e.g. from blower or earthmoving equipment), and water discharges (e.g. runoff control from treatment facility) shall be implemented and complied with relevant regulations and guidelines. 							

EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of Measures / Timing of Completion of Measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	C	O	Dec	
Hazard to Life									
Construction Phase									
7.14.1	6.2.2	<p>The following recommendations are justified to be implemented to meet the EIAO-TM requirements:</p> <ul style="list-style-type: none"> The truck should be designed to minimise the amount of combustible in the cabin. The fuel carried in the fuel tank should also be minimised to reduce the duration of any fire; The accident involvement frequency of the explosives delivery truck should be minimised through implementation of several administrative measures, such as providing training programme to the driver, regular "tool box" briefing session, implementing a defensive driving attitude, selecting driver with good safety record, and providing regular medical checks for the driver; Avoidance of returning unused explosives to the magazine, only the required quantity of explosives for a particular blast should be transported; Maintain a minimum headway of 10 minutes between two 	Explosives delivery route / Construction Phase	Contractor	√	√			EIAO-TM

EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of Measures / Timing of Completion of Measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	C	O	Dec	
		consecutive truck convoys whenever practicable; and <ul style="list-style-type: none"> The fire involvement frequency should be minimised by carrying better types of fire extinguishers and with bigger capacity onboard of the explosives delivery truck. Emergency plans and trainings could also be provided to make sure that the fire extinguishers are used adequately. 							
7.14.2	6.2.3	The magazine should be designed, built, operated and maintained in accordance with Mines Division's guidelines and appropriate industry best practice. In addition, the following recommendations should be implemented: <ul style="list-style-type: none"> The security plan should address different alert security level to reduce opportunity for arson or deliberate initiation of explosives; Emergency plan should be developed to address uncontrolled fire in magazine area, and drill of the emergency plan should be regularly carried out; Suitable work control system should be set-up, such as an operational manual including Permit-to-Work system, to ensure that work activities undertaken 	Magazine Site/ Construction Phase	Contractor	√	√			-

EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of Measures / Timing of Completion of Measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	C	O	Dec	
		during operation of the magazine are properly controlled; <ul style="list-style-type: none"> • Good house-keeping within the magazine to ensure no combustible materials are accumulated; • Good house-keeping outside the magazine stores to ensure no combustible materials are accumulated; and • Regular checking of the magazine store to ensure no water seepage through the roof, walls or floor. 							
7.14.3	6.2.4	The following recommendations should be implemented: <ul style="list-style-type: none"> • Emergency plan should be developed to address uncontrolled fire during transport. Case of fire near an explosive delivery truck in jammed traffic should be included in the plan. Activation of fuel and battery isolation switches on vehicle when fire breaks out should also be included in the emergency plan to reduce likelihood of prolonged fire leading to explosion; • Working guideline should be developed to define procedure for explosives transport during adverse weather such as thunderstorm; 	To and from Magazine Site / Construction Phase	Contractor	√	√			-

EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of Measures / Timing of Completion of Measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	C	O	Dec	
		<ul style="list-style-type: none"> • Detonators should be transported separately from other Class 1 explosives. Separation of vehicles should also be maintained through the trip; • Develop procedure to ensure the availability of parking space on site for the explosives delivery truck. Delivery should not be commenced if parking space on site is not secured; • Hot work or other activities should be banned in the vicinity of the explosives offloading or charging activities; • Lining should be provided within the transportation box on the vehicle; • Fire screen should be used between cabin and the load on the vehicle; • Ensure packaging of detonators remains intact until handed over at blasting site; • Ensure that cartridged emulsion packages are not damaged before every trip; and • Use experienced driver with good safety record. 							

EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of Measures / Timing of Completion of Measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	C	O	Dec	
7.14.4	6.2.5	<p>The following recommendations should be implemented for the safe use of explosives:</p> <ul style="list-style-type: none"> • Blast Charge Weight should be within MIC as specified for the given blast face; • Temporary mitigation measures such as blast doors or heavy duty blast curtains should be installed at the portals or shafts and at suitable locations underground to prevent flyrock and control the air overpressure; • Multiple faces blasting will be carried out for the construction of cavern in this project. Good communication and control will need to be adopted in ensuring that the works are carried out safely; • It is not intended to carry out complete evacuation of the construction areas and secure refuge areas should be identified to workers in the areas; • A Chief Shotfirer and a Blasting Engineer shall be employed in addition to the normal blasting personnel to ensure that the works are safe and coordinated between blasting areas; • Shotfirer to be provided with a lightning detector, and appropriate 	CSTW / Construction Phase	Contractor	√	√			-

EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of Measures / Timing of Completion of Measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	C	O	Dec	
		control measures should be in place; <ul style="list-style-type: none"> • Speed limit for the diesel vehicle truck and bulk emulsion truck in the access tunnel and cavern should be imposed. The truck may be escorted while underground to ensure route is clear from hazards and obstructions; and • Hot work should be suspended during passage of the diesel vehicle truck and bulk emulsion truck in the access tunnel and cavern. • A boulder survey should be undertaken based on the likely PPV values that would result from the blasting process. Those boulders subject to the vibration higher than the allowable limit should be strengthened, removed, or constructed with boulder fence, prior to the commencement of blasting. 							
	Operation Phase								
		Nil							

EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of Measures / Timing of Completion of Measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	C	O	Dec	
Ecological Impact (Terrestrial and Marine)									
Construction Phase									
8.8.2	7.2.1	Construction of access roads and other temporary works should be carefully designed (e.g. elevated road for crossing streams) to avoid / minimise habitat loss and fragmentation.	Project site – areas access road / Pre-Construction Phase	Design team / Project Proponent	√				-
8.8.3	7.2.2	Minimise habitat loss to nearby habitats and associated wildlife by implementing the following mitigation measures: - <ul style="list-style-type: none"> • confining the works within the site boundary; • controlling access of site staff to avoid damage to the vegetation in surrounding areas; and • placement of equipment or stockpile in the existing disturbed / urbanised land within the site boundary of the Project to minimise disturbance to vegetated areas; 	Project site / Construction Phase	Contractor		√			-
8.8.3	7.2.2	Reinstatement planting should be implemented upon the completion of construction works to minimise the ecological impact arising from the temporary habitat loss	Project Site (Main Portal Area / Secondary Portal Area / Access Road / Temporary Works Area) /Construction Phase	Project Proponent	√	√		√	

EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of Measures / Timing of Completion of Measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	C	O	Dec	
8.8.2, 8.8.3 & 8.10	7.2.2	<p>Detailed Vegetation Survey shall be conducted by a suitably qualified botanist / ecologist within the works area requiring vegetation clearance prior to commencement of works to identify plant species of conservation importance.</p> <p>The potentially affected individuals shall be tagged and fenced off for preservation, and in the case of unavoidable loss, for transplantation to nearby suitable habitat(s).</p>	Proposed works areas (Main Portal, Secondary Portal, Access Road) / Pre-Construction Phase	Project Proponent / Qualified botanist or ecologist		√			
8.8.2, 8.8.3 & 8.10	7.3.1	<p>A Protection and Transplantation Proposal including the subsequent monitoring visit for the affected plant species should be prepared and conducted by a suitably qualified local ecologist. The Proposal should be submitted for approval at least one month before works commencement.</p> <p>To review the performance of the transplantation exercise, monitoring of transplanted flora should be conducted monthly after the transplantation throughout the construction phase. The parameters to be monitored should include the health condition and survival rate of the transplanted flora and presence of weedy species. Any observations and recommendations should be reported in monthly EM&A reports</p>	Recipient Site for transplanted species / Construction Phase	Project Proponent / Qualified botanist or ecologist		√			

EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of Measures / Timing of Completion of Measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	C	O	Dec	
8.8.3	7.2.2	<p>Mitigation measures should be implemented to control runoff from the construction site, as well as the adopting guidelines and good site practices for handling and disposal of construction discharges in order to minimise the potential indirect impact on the streams (particularly S2) resulting from site runoff.</p> <p>Precautionary measures should also be implemented to minimise indirect impacts to the streams, such as isolating the work site by placing sandbags and silt curtains, covering up construction materials, debris and spoil to avoid being washed into the stream, and properly collecting and treating construction effluent and sewage.</p>	Access Road on Nui Po Shan / Construction Phase	Contractor		√			ETWB TCW No. 5/2005
8.8.3	7.2.2	<p>Implement good site practice to further minimise impacts from disturbance such as noise, air quality and water quality issues, such as: -</p> <ul style="list-style-type: none"> • the use of quiet plant and EPD's QPME and the availability of British Standards 5228 has been considered; • the use of movable noise barrier; • the use of temporary noise screening structures or purpose-built temporary noise barriers; 	Project site / Construction Phase	Contractor		√			-

EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of Measures / Timing of Completion of Measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	C	O	Dec	
		<ul style="list-style-type: none"> install site hoarding as temporary noise barrier where construction works are undertaken; only well-maintained plant should be operated on site and plant should be serviced regularly during the construction programme; Mitigation measures stipulated in the ProPECC PN 1/94 "Construction Site Drainage" should be complied to minimise water quality impact; Installation of stand-by pump, emergency power supply and telemetry system to avoid sewage overflow and surcharge to sewerage system due to power/equipment failure. 							
8.8.3	7.2.2	Minimise groundwater infiltration during cavern construction with the following water control strategies:- <ul style="list-style-type: none"> Probing Ahead: As a normal practice, the Contractor will undertake rigorous probing of the ground ahead of excavation works to identify zones of significant water inflow. The probe drilling results will be evaluated to determine specific grouting requirements in line with the tunnel / cavern advance. In such zones of significant water inflow that could occur as a result of discrete, permeable features, the intent 	Project site / Construction Phase	Contractor		√			-

EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of Measures / Timing of Completion of Measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	C	O	Dec	
		<p>would be to reduce overall inflow by means of cut-off grouting executed ahead of the tunnel / cavern advance;</p> <ul style="list-style-type: none"> • Pre-grouting: Where water inflow quantities are excessive, pre-grouting will be required to reduce the water inflow into the tunnel / cavern. The pre-grouting will be achieved via a systematic and carefully specified protocol of grouting; • In principle, the grout pre-treatment would be designed on the basis of probe hole drilling ahead of the tunnel / cavern face; • The installation of waterproof lining would also be adopted after the formation of the tunnels and caverns. 							
8.8.3	7.2.2	<p>In the event of excessive infiltration being observed as a result of the tunnelling or excavation works even after incorporation of the water control strategies, post-grouting should be applied as far as practicable as described below:</p> <ul style="list-style-type: none"> • Post-grouting: Groundwater drawdown will be most likely due to inflows of water into the tunnel / cavern that have not been sufficiently controlled by the pre-grouting measures in high permeability area. Where this 	Project site / Construction Phase	Contractor		√			-

EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of Measures / Timing of Completion of Measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	C	O	Dec	
		<p>occurs post grouting will be undertaken before the lining is installed. Whilst unlikely to be required in significant measure, such a contingency should be allowed for reduction in permeability of the tunnel / cavern surround (by grouting) to limit inflow to acceptable levels.</p> <p>The practical groundwater control measures stated above are proven technologies and have been extensively applied in other past projects. These measures or other similar methods, as approved by the Engineer to suit the works condition shall be applied to minimise the groundwater infiltration.</p>							
8.8.3	7.2.2	<p>In case seepage of groundwater occurs, groundwater should be pumped out from works areas and discharged to the storm system via silt trap. Uncontaminated groundwater from dewatering process should also be discharged to the storm system via silt removal facilities.</p>	Project site / Construction Phase	Contractor		√			-

EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of Measures / Timing of Completion of Measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	C	O	Dec	
8.8.3	7.2.2	<p>Mitigation measures recommended in the water quality impact assessment for controlling water quality impact will also serve to protect marine ecological resources from indirect impacts and ensure no unacceptable impact on marine ecological resources.</p> <p>Relevant government departments including EPD, WSD and AFCD as well as key stakeholders for mariculture and fisheries in Tolo Harbour should be informed of the THEES maintenance / emergency discharge event prior to any discharge.</p> <p>It is recommended that the temporary effluent bypass event and the THEES maintenance period should be shortened as far as possible.</p>	Tolo Harbour / Construction Phase	Contractor and Operator		√			-
Construction and Operation Phase									
8.8.3	7.2.2	<p>Overall reduction of glare during both construction and operation phase should be considered. A balance between lighting for safety, and avoiding excessive lighting can be achieved through the use of directional lighting to avoid light spill into sensitive areas, and control/timing of lighting periods of some facilities, particularly at the secondary portal which lies approximately 200 m northwest of Ma On Shan Country Park.</p>	Project site / Construction and Operation Phase	Contractor and Operator		√	√		-

EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of Measures / Timing of Completion of Measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	C	O	Dec	
8.8.3	7.2.2	During the decommissioning and demolition of the existing STSTW, the direction and lighting periods should be controlled during ardeid breeding season (March to August) to minimise the potential indirect impact on Penfold Park Egretty and the ardeids flying over the existing STSTW.	Existing STSTW / Decommissioning / March to August	Contractor				√	-
8.10	7.3	It is anticipated that the construction of rock caverns would not have adverse impacts on groundwater in Nui Po Shan. Nonetheless, surface water level or groundwater level near the caverns will be closely monitored during the construction and operation stage.	Project site / Construction and Operation Phase	Contractor and Operator		√	√		-
Compensatory Planting									
8.8.4& 8.10.1	7.2.3	Compensatory planting would be provided at main and secondary portal areas, and along the access road.	Main portal, secondary portal, and along access road	Project Proponent	√	√			DEVB TC(W) No. 7/2015
8.8.4 & 8.10.1	7.2.3	To facilitate successful planting, a detailed Woodland Compensation Plan should be prepared by local ecologists with at least 10 years relevant experience to form the basis of the proposed compensatory planting. The Woodland Compensation Plan should include implementation details, management requirement, as well as monitoring requirements (e.g. frequency and parameters) of the	Compensatory planting area (Main portal, secondary portal, and along access road) / pre-construction	Project Proponent	√	√			

EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of Measures / Timing of Completion of Measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	C	O	Dec	
		compensatory planting area. Approval of the Plan should be obtained from EPD at least three months before the prior to commencement of compensatory woodland planting.							
8.8.4 & 8.10.1	7.2.3	Upon the completion of planting, monitoring of the woodland compensation areas should be implemented, with maintenance works (e.g. irrigation, weeding, pruning, control of pests and diseases, replacement planting, repair of damage, etc.) conducted as necessary.	Compensatory planting area (Main portal, secondary portal, and along access road) / Operation	Project Proponent / CSTW Operator			√		
Fisheries Impact									
9.6	8.2	Potential impacts on fisheries resources and fishing operations arising from the Project have been avoided and minimised by construction of a connection pipes to the existing emergency outfall of STSTW by trenchless method underneath Shing Mun River with the least water quality impact. In addition, the temporary effluent bypass event for THEES connection work would be synchronized within regular THEES maintenance. Therefore, additional water quality impact and fisheries impact from changes of water quality have been avoided. Furthermore, the THEES maintenance discharge would avoid the blooming season of algae (i.e. January to May) to minimise the potential water quality impacts. It is	Tolo Harbour /Construction and Operation Phase	Project Proponent / Contractor	√	√			-

EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of Measures / Timing of Completion of Measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	C	O	Dec	
		recommended that any THEES maintenance period should be shortened as far as possible.							
9.6	8.2	Mitigation measures recommended in the water quality impact assessment for controlling water quality impact will also serve to protect fisheries from indirect impacts and ensure no unacceptable impact on fisheries resources and operations. For more detailed mitigation measures regarding water quality refer to Sections 5.7.2 and 5.13.2 of the EIA Report.	Construction and Operation Phase	Contractor and Operator		√	√		-
9.6	8.2	Relevant government departments including EPD, WSD and AFCD as well as key stakeholders for mariculture and fisheries in Tolo Harbour should be informed prior to the THEES maintenance / emergency discharge events.	Tolo Harbour / Construction and Operation Phase	Project Proponent		√	√		
Landscape and Visual Impact									
Table 10.10	-	CM1 - Preservation of Existing Vegetation	Construction Sites/ Construction Phase	Project Proponent	√	√		√	DEVB TCW No. 7/2015 and latest Guidelines on Tree Preservation during Development issued by GLTM Section of DEVB
Table 10.10	-	CM2 - Transplanting of Affected Trees	Construction Sites/ Construction Phase	Project Proponent	√	√		√	DEVB TCW No. 7/2015 and the latest Guidelines on Tree Transplanting issued by GLTM Section of DEVB

EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of Measures / Timing of Completion of Measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	C	O	Dec	
Table 10.10	-	CM3 - Compensatory Tree Planting	Construction Sites/ Construction Phase	Project Proponent	√	√		√	DEVB TCW No. 7/2015
Table 10.10	-	CM4 - Control of Night-time Lighting Glare	Construction Sites/ Construction Phase	Project Proponent	√	√		√	
Table 10.10	-	CM5 - Erection of Decorative Screen Hoarding	Construction Sites/ Construction Phase	Project Proponent	√	√		√	
Table 10.10	-	CM6 - Management of Construction Activities and Facilities	Construction Sites/ Construction Phase	Project Proponent	√	√		√	
Table 10.10	-	CM7 - Reinstatement of Temporarily Disturbed Landscape Areas	Construction Sites/ Construction Phase	Project Proponent	√	√		√	
Table 10.11	-	OM1 - Tree and Shrub Planting at the Temporary Project Magazine Site after Completion of Engineering Works	Temporary Project Magazine Site / Operation Phase	Project Proponent	√	√	√		
Table 10.11	-	OM2 - Aesthetically pleasing design of Aboveground Structures	Tunnel Portals, Administration Building, Ventilation Buildings, Electrical Substations and Ventilation Shaft / Operation Phase	Project Proponent	√	√	√		

EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of Measures / Timing of Completion of Measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	C	O	Dec	
Table 10.11	-	OM3 - Aesthetically pleasing design of Highways Structures	Access Road to Ventilation Shaft / Operation Phase	Highways Department	√	√	√		
Table 10.11	-	OM4 - Reprovision of Cycle Track	Cycle track / Operation Phase	Highways Department	√	√	√		
Table 10.11	-	OM5 - Provision of Green Roof	Administration Building and Ventilation Buildings / Operation Phase	Project Proponent	√	√	√		
Table 10.11	-	OM6 - Provision of Buffer Planting	Main and Secondary Portal Areas / Operation Phase	Project Proponent	√	√	√		
Table 10.11	-	OM7 - Hydroseeding on the disturbed ground surface after demolition works prior to future redevelopment of the existing STSTW	Existing STSTW / Operation Phase	Lands Department (LandsD) or future development agent in existing STSTW	√	√	√		
Table 10.11	-	OM8 - Woodland Mix Planting on Soil Slopes	Soil Slopes / Operation Phase	Project Proponent	√	√	√		

EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of Measures / Timing of Completion of Measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	C	O	Dec	
Cultural Heritage Impact									
11.5.1.1	10.1.1	No potential direct or indirect impact to cultural heritage resource is anticipated, and therefore no mitigation measures are required.	N/A	N/A					EIAO EIAO-TM Antiquities and Monuments Ordinance Guidelines for Cultural Heritage Impact Assessment
Wastes Management Implications									
12.6.2	11.2.2	<p>Appropriate waste handling, transportation and disposal methods for all waste arising generated during the construction works for the Project should be implemented to ensure that construction wastes do not enter the nearby streams or drainage channel.</p> <p>It is anticipated that adverse impacts would not arise on the construction site, provided that good site practices are strictly followed. Recommendations for good site practices during the construction activities include:</p> <ul style="list-style-type: none"> Nomination of approved personnel, such as a site manager, to be responsible for good site practices, and making arrangements for collection of all wastes generated at the site and effective disposal to an appropriate facility. 	Project Site Area / Construction Phase	Contractor		√		√	Waste Disposal Ordinance

EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of Measures / Timing of Completion of Measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	C	O	Dec	
		<ul style="list-style-type: none"> • Training of site personnel in proper waste management and chemical waste handling procedures. • Provision of sufficient waste reception/ disposal points, of a suitable vermin-proof design that minimises windblown litter. • Arrangement for regular collection of waste for transport off-site and final disposal. • Appropriate measures to minimise windblown litter and dust during transportation of waste by either covering trucks or by transporting wastes in enclosed containers. • Regular cleaning and maintenance programme for drainage systems, sumps and oil interceptors. • A recording system for the amount of wastes generated, recycled and disposed (including the disposal sites) should be proposed. • A Waste Management Plan should be prepared and should be submitted to the Engineer for approval. One may make reference to ETWB TCW No. 19/2005 for details. <p>In order to monitor the disposal of C&D material at landfills and public filling areas, as appropriate, and to control fly tipping, a trip-ticket system should be included as one of the contractual</p>							

EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of Measures / Timing of Completion of Measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	C	O	Dec	
		requirements to be implemented by an Environmental Team undertaking the Environmental Monitoring and Audit work. One may make reference to DEVB TCW No.6/2010 for details.							
12.6.3	11.2.3	<p>Good management and control of construction site activities / processes can minimise the generation of waste. Waste reduction is best achieved at the planning and design stage, as well as by ensuring the implementation of good site practices. Recommendations to achieve waste reduction include:</p> <ul style="list-style-type: none"> • Segregate and store different types of construction related waste in different containers, skips or stockpiles to enhance reuse or recycling of materials and their proper disposal. • Provide separate labelled bins to segregate recyclable waste such as aluminium cans from other general refuse generated by the work force, and to encourage collection by individual collectors. • Any unused chemicals or those with remaining functional capacity shall be recycled. • Maximising the use of reusable steel formwork to reduce the amount of C&D material. • Prior to disposal of C&D waste, it is recommended that wood, steel 	Project Site Area / Construction Phase	Contractor		√		√	Waste Disposal Ordinance

EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of Measures / Timing of Completion of Measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	C	O	Dec	
		<p>and other metals shall be separated for re-use and / or recycling to minimise the quantity of waste to be disposed of to landfill.</p> <ul style="list-style-type: none"> On-site crushing and sorting facilities are being considered to reduce the rock size to fulfill the size requirements from relevant waste collection / transfer / disposal facilities; Adopt proper storage and site practices to minimise the potential for damage to, or contamination of, construction materials. Plan the delivery and stock of construction materials carefully to minimise the amount of surplus waste generated. Adopt pre-cast construction method instead of cast-in-situ method for construction of concrete structures as much as possible; and Minimise over ordering of concrete, mortars and cement grout by doing careful check before ordering. <p>In addition to the above measures, other specific mitigation measures are recommended below to minimise environmental impacts during handling, transportation and disposal of wastes.</p>							

EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of Measures / Timing of Completion of Measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	C	O	Dec	
12.6.4	11.2.4	<p>Storage of materials on site may induce adverse environmental impacts if not properly managed, recommendations to minimise the impacts include:</p> <ul style="list-style-type: none"> Waste, such as soil, should be handled and stored well to ensure secure containment, thus minimising the potential of pollution; Maintain and clean storage areas routinely; Stockpiling area should be provided with covers as much as practicable and water spraying system to prevent materials from wind-blown or being washed away; and Different locations should be designated to stockpile each material to enhance reuse. 	Project Site Area / Construction Phase	Contractor		√		√	-
12.6.4	11.2.4	<p>Licensed waste haulers should be employed for the collection and transportation of waste generated. The following measures should be enforced to minimise the potential adverse impacts:</p> <ul style="list-style-type: none"> Remove waste in timely manner; Waste collectors should only collect wastes prescribed by their permits; Impacts during transportation, such as dust and odour, should be 	Project Site Area / Construction Phase	Contractor		√		√	<p>Waste Disposal Ordinance</p> <p>Waste Disposal (Charges for Disposal of Construction Waste) Regulation</p> <p>Land (Miscellaneous Provisions) Ordinance</p>

EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of Measures / Timing of Completion of Measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	C	O	Dec	
		mitigated by the use of covered trucks or in enclosed containers; <ul style="list-style-type: none"> Obtain relevant waste disposal permits from the appropriate authorities, in accordance with the Waste Disposal Ordinance (Cap. 354), Waste Disposal (Charges for Disposal of Construction Waste) Regulation (Cap. 345) and the Land (Miscellaneous Provisions) Ordinance (Cap. 28); Waste should be disposed of at licensed waste disposal facilities; and Maintain records of quantities of waste generated, recycled and disposed. 							
12.6.4	11.2.4	Land transport will be used for transportation of excavated and stockpile materials. It is expected there will be 1260 vehicles per day for transporting waste during peak construction phase. The tentative transportation routings for the disposal of various types of wastes are shown in Table 12.4. The transportation routing may be changed subject to the traffic conditions. Nevertheless, it is anticipated that there is no adverse impact from the waste during transportation with the implementation of appropriated measures (e.g. using water-tight containers and covered trucks).	Transportation Route of Waste / Construction Phase	Contractor		√			-

EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of Measures / Timing of Completion of Measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	C	O	Dec	
12.6.4	11.2.4	In order to monitor the disposal of C&D materials at PFRFs and landfills and to control fly-tipping, a trip-ticket system should be established in accordance with DEVB TCW No. 6/2010. A recording system for the amount of waste generated, recycled and disposed, including the disposal sites, should also be set up. Warning signs should be put up to remind the designated disposal sites. Close-circuited television should be installed at the vehicular entrance and exit of the site as additional measures to prevent fly-tipping.	Project Site Area / Construction Phase	Contractor		√		√	DEVB TCW No. 6/2010
12.6.4	11.2.5	In addition to the above general measures, other specific mitigation measures on handling the C&D materials and materials generated from site formation and demolition work are recommended below, which should form the basis of the WMP to be prepared by the contractor(s) in construction phase.	Project Site Area / Construction Phase	Contractor		√		√	Technical Circular (Works) No. 19/2005 Environmental Management on Construction Site
12.6.5	11.2.5	In order to minimise the impact resulting from collection and transportation of C&D materials for off-site disposal, the excavated material arising from site formation and foundation works should be reused on-site as backfilling material and for landscaping works as far as practicable. Other mitigation requirements are listed below:	Project Site Area / Construction Phase	Contractor		√		√	Waste Disposal Ordinance ETWB TCW No.19/2005 DEVB TCW No. 6/2010

EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of Measures / Timing of Completion of Measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	C	O	Dec	
		<ul style="list-style-type: none"> A WMP, which becomes part of the EMP, should be prepared in accordance with ETWB TCW No.19/2005; A recording system for the amount of wastes generated, recycled and disposed (including the disposal sites) should be adopted for easy tracking; and In order to monitor the disposal of C&D materials at public filling facilities and landfills and to control fly-tipping, a trip-ticket system should be adopted (refer to DEVB TCW No. 6/2010). <p>It is recommended that specific areas should be provided by the Contractors for sorting and to provide temporary storage areas (if required) for the sorted materials.</p>							
12.6.5	11.2.5	The Contactor should prepare and implement an EMP in accordance with ETWB TCW No.19/2005, which describes the arrangements for avoidance, reuse, recovery, recycling, storage, collection, treatment and disposal of different categories of waste to be generated from construction activities. Such a management plan should incorporate site specific factors, such as the designation of areas for segregation and temporary storage of reusable and recyclable materials. The EMP should	Project Site Area / Construction Phase	Contractor		√			ETWB TCW No.19/2005

EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of Measures / Timing of Completion of Measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	C	O	Dec	
		be submitted to the Engineer for approval. The Contractor should implement waste management practices in the EMP throughout the construction stage of the Project. The EMP should be reviewed regularly and updated by the Contractor, preferably on a monthly basis.							
12.6.5	11.2.5	All surplus C&D materials arising from or in connection with construction works should become the property of the Contractor when it is removed unless otherwise stated. The Contractor would be responsible for devising a system to work for on-site sorting of C&D materials and promptly removing all sorted and process materials arising from the construction activities to minimise temporary stockpiling on-site. The system should be included in the EMP identifying the source of generation, estimated quantity, arrangement for on-site sorting, collection, temporary storage areas and frequency of collection by recycling Contractors or frequency of removal off-site.	Project Site Area / Construction Phase	Contractor		√		√	-
12.6.6	11.2.6	The practices of good housekeeping for CSTW listed below should be followed to ameliorate any odour impact from handling, collection, transportation and disposal of sludge:	Operation Phases	Operator			√		Waste Disposal Ordinance

EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of Measures / Timing of Completion of Measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	C	O	Dec	
		<ul style="list-style-type: none"> • Screens should be cleaned regularly to remove any accumulated organic debris • Grit and screening transfer systems should be flushed regularly with water to remove organic debris and grit • Grit and screened materials should be transferred to closed containers • Scum and grease collection wells and troughs should be emptied and flushed regularly to prevent putrefaction of accumulated organics • Skim and remove floating solids and grease from primary clarifiers regularly • Frequent sludge withdrawal from tanks is necessary to prevent the production of gases • Sludge should be transported to the STF by water-tight containers to avoid Hydrogen Sulphide (H₂S)/odour emission and ingress of water into the containers which would lower the sludge dryness during transportation • Sludge cake should be transferred to closed containers • Sludge containers should be flushed with water regularly 							

EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of Measures / Timing of Completion of Measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	C	O	Dec	
		<ul style="list-style-type: none"> Sludge trucks and containers should be washed thoroughly before leaving the CSTW to avoid any odour nuisance during transportation 							
12.6.6	11.2.6	In addition, all wastewater generated from the sludge dewatering process and all contaminated water from the cleaning operations recommended for odour control will be diverted to the relocated STSTW for proper treatment.	Operation Phases	Operator			√		Waste Disposal Ordinance
12.6.7	11.2.7	If chemical wastes are produced at the construction site or during operation, the Contractor during construction or the operator during operation will be required to register with the EPD as a chemical waste producer and to follow the guidelines stated in the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes. Good quality containers compatible with the chemical wastes should be used, and incompatible chemicals should be stored separately. Appropriate labels should be securely attached on each chemical waste container indicating the corresponding chemical characteristics of the chemical waste, such as explosive, flammable, oxidising, irritant, toxic, harmful, corrosive, etc. The Contractor shall use a licensed collector to transport and dispose of the chemical wastes, to the licensed Chemical Waste Treatment Centre, or other	Construction and Operation Phases	Contractor / Operator		√	√		Waste Disposal (Chemical Waste) (General) Regulation Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes

EIA Ref.	EM&A Log Ref.	Environmental Protection Measures	Location / Duration of Measures / Timing of Completion of Measures	Implementation Agent	Implementation Stage ¹				Relevant Legislation & Guidelines
					Des	C	O	Dec	
		licensed facilities, in accordance with the Waste Disposal (Chemical Waste) (General) Regulation.							
12.6.8	11.2.8	Recycling of waste paper, aluminium cans and plastic bottles should be encouraged, it is recommended to place clearly labelled recycling bins at designated locations which could be accessed conveniently. Other general refuse should be separated from chemical and industrial waste by providing separated bins for storage to maximise the recyclable volume.	Construction and Operation Phases	Contractor / Operator		√	√		Public Health and Municipal Services Ordinance (Cap.132)
12.6.8	11.2.8	A reputable licensed waste collector should be employed to remove general refuse on a daily basis to minimise odour, pest and litter impacts.	Construction and Operation Phases	Contractor / Operator		√	√		Public Health and Municipal Services Ordinance (Cap. 132)
Health Impact									
-	-	Not applicable.							



Appendix 3.1

Action and Limit Level



Action and Limit Level

Action and Limit Level for Noise Monitoring

Monitoring Station	Action Level	Limit Level (dB(A))		
		0700-1900 hrs on normal weekdays	0700-2300 hrs on holidays (including Sundays); and 1900-2300 hrs on all days ²	2300-0700 hrs of all days ²
CM1	When one documented complaint is received	65 / 70 ¹	60 / 65 / 70 ³	45 / 50 / 55 ³
CM2(A)		65 / 70 ¹		
CM3		65 / 70 ¹		
CM4		75		
CM5		75		
DM1		75		
DM2		75		
DM3		65 / 70 ¹		

Remark 1: Limit level of CM1, CM2(A), CM3 and DM3 reduce to 65 dB (A) during examination periods if any.

Remark 2: Construction noise during restricted hours is under the control of Noise Control Ordinance Limit Level to be selected based on Area Sensitivity Rating.

Remark 3: Limit Level for restricted hour monitoring shall act as reference level only. Investigation would be conducted on CNP compliance if exceedance recorded during restricted hour noise monitoring period.

Action and Limit Level for Air Quality Monitoring

Monitoring Locations	1-hour TSP Level in µg/m ³	
	Action Level	Limit Level
AM1	294	500
AM2	325	500
AM3(A)	360	500
AM4	297	500
AM5	349	500
AM6	312	500



Appendix 4.1

Air Quality Monitoring Results and Graphical Presentations

Report on 1-hour TSP monitoring at AM1 - Ah Kung Kok Fishermen Village

Action Level ($\mu\text{g}/\text{m}^3$) - 294
Limit Level ($\mu\text{g}/\text{m}^3$) - 500

Date	Weather Condition	Time	Mass Concentration ($\mu\text{g}/\text{m}^3$)
4-Mar-22	Fine	8:40	28
4-Mar-22	Fine	9:41	32
4-Mar-22	Fine	10:42	37
10-Mar-22	Fine	8:06	14
10-Mar-22	Fine	9:07	25
10-Mar-22	Fine	10:08	33
16-Mar-22	Cloudy	8:16	19
16-Mar-22	Cloudy	9:17	16
16-Mar-22	Cloudy	10:18	24
22-Mar-22	Cloudy	8:32	19
22-Mar-22	Cloudy	9:33	16
22-Mar-22	Cloudy	10:34	23
28-Mar-22	Rainy	8:18	4
28-Mar-22	Rainy	9:19	8
28-Mar-22	Rainy	10:20	9
2-Apr-22	Cloudy	8:18	38
2-Apr-22	Cloudy	9:19	42
2-Apr-22	Cloudy	10:10	42
8-Apr-22	Cloudy	8:06	38
8-Apr-22	Cloudy	9:07	42
8-Apr-22	Cloudy	10:08	42
14-Apr-22	Cloudy	8:10	35
14-Apr-22	Cloudy	9:11	32
14-Apr-22	Cloudy	10:12	37
20-Apr-22	Cloudy	8:24	34
20-Apr-22	Cloudy	9:25	37
20-Apr-22	Cloudy	10:26	43
26-Apr-22	Fine	8:15	39
26-Apr-22	Fine	9:16	46
26-Apr-22	Fine	10:17	55
30-Apr-22	Fine	8:29	17
30-Apr-22	Fine	9:30	8
30-Apr-22	Fine	10:31	16
6-May-22	Fine	8:30	43
6-May-22	Fine	9:31	50
6-May-22	Fine	10:32	42
12-May-22	Fine	8:25	34
12-May-22	Fine	9:26	29
12-May-22	Fine	10:27	30
18-May-22	Cloudy	8:22	17
18-May-22	Cloudy	9:23	22
18-May-22	Cloudy	10:24	29
24-May-22	Cloudy	8:15	34
24-May-22	Cloudy	9:16	26
24-May-22	Cloudy	10:17	31
30-May-22	Cloudy	8:18	13
30-May-22	Cloudy	9:19	18
30-May-22	Cloudy	10:20	19



Report on 1-hour TSP monitoring at AM2 - Block H, Kam Tai Court

Action Level ($\mu\text{g}/\text{m}^3$) - 325
Limit Level ($\mu\text{g}/\text{m}^3$) - 500

Date	Weather Condition	Time	Mass Concentration ($\mu\text{g}/\text{m}^3$)
4-Mar-22	Fine	8:00	15
4-Mar-22	Fine	9:01	29
4-Mar-22	Fine	10:02	20
10-Mar-22	Fine	8:50	27
10-Mar-22	Fine	9:51	29
10-Mar-22	Fine	10:52	38
16-Mar-22	Cloudy	8:56	29
16-Mar-22	Cloudy	9:57	22
16-Mar-22	Cloudy	10:58	25
22-Mar-22	Cloudy	8:22	29
22-Mar-22	Cloudy	9:23	22
22-Mar-22	Cloudy	10:24	20
28-Mar-22	Rainy	8:46	10
28-Mar-22	Rainy	9:47	6
28-Mar-22	Rainy	10:48	8
2-Apr-22	Cloudy	8:43	29
2-Apr-22	Cloudy	9:44	33
2-Apr-22	Cloudy	10:45	38
8-Apr-22	Cloudy	8:18	43
8-Apr-22	Cloudy	9:19	49
8-Apr-22	Cloudy	10:20	44
14-Apr-22	Cloudy	8:30	49
14-Apr-22	Cloudy	9:31	57
14-Apr-22	Cloudy	10:32	54
20-Apr-22	Cloudy	8:13	45
20-Apr-22	Cloudy	9:14	54
20-Apr-22	Cloudy	10:15	55
26-Apr-22	Fine	8:35	40
26-Apr-22	Fine	9:36	44
26-Apr-22	Fine	10:37	57
30-Apr-22	Fine	8:57	26
30-Apr-22	Fine	9:58	44
30-Apr-22	Fine	10:59	30
6-May-22	Fine	8:58	66
6-May-22	Fine	9:59	68
6-May-22	Fine	10:00	74
12-May-22	Fine	8:55	52
12-May-22	Fine	9:56	53
12-May-22	Fine	10:57	56
18-May-22	Cloudy	7:30	18
18-May-22	Cloudy	8:31	18
18-May-22	Cloudy	9:32	20
24-May-22	Cloudy	8:40	41
24-May-22	Cloudy	9:41	37
24-May-22	Cloudy	10:42	44
30-May-22	Cloudy	8:45	32
30-May-22	Cloudy	9:46	28
30-May-22	Cloudy	10:47	25

Report on 1-hour TSP monitoring at AM3(B) - Outside A Kung Kok Street Garden

Action Level ($\mu\text{g}/\text{m}^3$) - 360
 Limit Level ($\mu\text{g}/\text{m}^3$) - 500

Date	Weather Condition	Time	Mass Concentration ($\mu\text{g}/\text{m}^3$)
4-Mar-22	Fine	8:25	26
4-Mar-22	Fine	9:26	23
4-Mar-22	Fine	10:27	21
10-Mar-22	Fine	8:27	26
10-Mar-22	Fine	9:28	22
10-Mar-22	Fine	10:29	23
16-Mar-22	Cloudy	8:29	20
16-Mar-22	Cloudy	9:30	22
16-Mar-22	Cloudy	10:31	25
22-Mar-22	Cloudy	8:52	17
22-Mar-22	Cloudy	9:53	24
22-Mar-22	Cloudy	10:54	22
28-Mar-22	Rainy	8:30	7
28-Mar-22	Rainy	9:31	6
28-Mar-22	Rainy	10:32	7
2-Apr-22	Cloudy	8:25	63
2-Apr-22	Cloudy	9:26	44
2-Apr-22	Cloudy	10:27	50
8-Apr-22	Cloudy	8:30	45
8-Apr-22	Cloudy	9:31	43
8-Apr-22	Cloudy	10:32	41
14-Apr-22	Cloudy	8:20	36
14-Apr-22	Cloudy	9:21	39
14-Apr-22	Cloudy	10:22	36
20-Apr-22	Cloudy	8:08	34
20-Apr-22	Cloudy	9:09	27
20-Apr-22	Cloudy	10:10	25
26-Apr-22	Fine	13:00	38
26-Apr-22	Fine	14:01	52
26-Apr-22	Fine	15:02	55
30-Apr-22	Fine	8:50	34
30-Apr-22	Fine	9:51	39
30-Apr-22	Fine	10:52	30
6-May-22	Fine	8:44	79
6-May-22	Fine	9:45	92
6-May-22	Fine	10:46	82
12-May-22	Fine	8:48	74
12-May-22	Fine	9:49	60
12-May-22	Fine	10:50	49
18-May-22	Cloudy	8:35	38
18-May-22	Cloudy	9:36	42
18-May-22	Cloudy	10:37	33
24-May-22	Cloudy	8:30	36
24-May-22	Cloudy	9:31	31
24-May-22	Cloudy	10:32	37
30-May-22	Cloudy	8:34	22
30-May-22	Cloudy	9:35	26
30-May-22	Cloudy	10:36	25



Report on 1-hour TSP monitoring at AM4 - Wellborn Kindergarten

Action Level ($\mu\text{g}/\text{m}^3$) - 297
Limit Level ($\mu\text{g}/\text{m}^3$) - 500

Date	Weather Condition	Time	Mass Concentration ($\mu\text{g}/\text{m}^3$)
4-Mar-22	Fine	8:32	31
4-Mar-22	Fine	9:33	26
4-Mar-22	Fine	10:34	28
10-Mar-22	Fine	8:22	16
10-Mar-22	Fine	9:23	18
10-Mar-22	Fine	10:24	21
16-Mar-22	Cloudy	8:43	26
16-Mar-22	Cloudy	9:44	31
16-Mar-22	Cloudy	10:45	34
22-Mar-22	Cloudy	8:47	23
22-Mar-22	Cloudy	9:48	33
22-Mar-22	Cloudy	10:49	30
28-Mar-22	Rainy	8:25	8
28-Mar-22	Rainy	9:26	8
28-Mar-22	Rainy	10:27	5
2-Apr-22	Cloudy	8:30	26
2-Apr-22	Cloudy	9:31	25
2-Apr-22	Cloudy	10:32	21
8-Apr-22	Cloudy	8:40	40
8-Apr-22	Cloudy	9:41	42
8-Apr-22	Cloudy	10:42	35
14-Apr-22	Cloudy	8:18	38
14-Apr-22	Cloudy	9:19	40
14-Apr-22	Cloudy	10:20	39
20-Apr-22	Cloudy	8:18	25
20-Apr-22	Cloudy	9:19	27
20-Apr-22	Cloudy	10:20	28
26-Apr-22	Fine	13:00	28
26-Apr-22	Fine	14:01	22
26-Apr-22	Fine	15:02	30
30-Apr-22	Fine	8:45	33
30-Apr-22	Fine	9:46	24
30-Apr-22	Fine	10:47	27
6-May-22	Fine	8:53	48
6-May-22	Fine	9:54	70
6-May-22	Fine	10:55	54
12-May-22	Fine	8:40	68
12-May-22	Fine	9:42	59
12-May-22	Fine	10:43	49
18-May-22	Cloudy	8:40	16
18-May-22	Cloudy	9:40	18
18-May-22	Cloudy	10:42	15
24-May-22	Cloudy	8:25	37
24-May-22	Cloudy	9:26	36
24-May-22	Cloudy	10:27	33
30-May-22	Cloudy	8:30	25
30-May-22	Cloudy	9:31	29
30-May-22	Cloudy	10:32	24






Report on 1-hour TSP monitoring at AM5 - The NAAC Harmony Manor

Action Level ($\mu\text{g}/\text{m}^3$) - 349
Limit Level ($\mu\text{g}/\text{m}^3$) - 500



Date	Weather Condition	Time	Mass Concentration ($\mu\text{g}/\text{m}^3$)
4-Mar-22	Fine	13:00	25
4-Mar-22	Fine	14:01	32
4-Mar-22	Fine	15:02	39
10-Mar-22	Fine	7:55	20
10-Mar-22	Fine	8:56	15
10-Mar-22	Fine	9:57	28
16-Mar-22	Cloudy	7:50	22
16-Mar-22	Cloudy	8:51	25
16-Mar-22	Cloudy	9:52	17
22-Mar-22	Cloudy	8:10	14
22-Mar-22	Cloudy	9:11	26
22-Mar-22	Cloudy	10:12	21
28-Mar-22	Rainy	8:08	6
28-Mar-22	Rainy	9:09	9
28-Mar-22	Rainy	10:10	4
2-Apr-22	Cloudy	8:08	34
2-Apr-22	Cloudy	9:09	39
2-Apr-22	Cloudy	10:10	41
8-Apr-22	Cloudy	8:50	49
8-Apr-22	Cloudy	9:51	53
8-Apr-22	Cloudy	10:52	46
14-Apr-22	Cloudy	8:00	36
14-Apr-22	Cloudy	9:01	32
14-Apr-22	Cloudy	10:02	37
20-Apr-22	Cloudy	8:48	31
20-Apr-22	Cloudy	9:49	38
20-Apr-22	Cloudy	10:50	35
26-Apr-22	Fine	8:05	47
26-Apr-22	Fine	9:06	50
26-Apr-22	Fine	10:07	40
30-Apr-22	Fine	8:20	25
30-Apr-22	Fine	9:21	29
30-Apr-22	Fine	10:22	34
6-May-22	Fine	8:15	47
6-May-22	Fine	9:16	44
6-May-22	Fine	10:17	42
12-May-22	Fine	8:10	36
12-May-22	Fine	9:11	39
12-May-22	Fine	10:12	45
18-May-22	Cloudy	8:13	20
18-May-22	Cloudy	9:14	28
18-May-22	Cloudy	10:15	23
24-May-22	Cloudy	8:05	19
24-May-22	Cloudy	9:06	25
24-May-22	Cloudy	10:07	33
30-May-22	Cloudy	8:10	21
30-May-22	Cloudy	9:11	27
30-May-22	Cloudy	10:12	24

Graphic Presentation of TSP Result

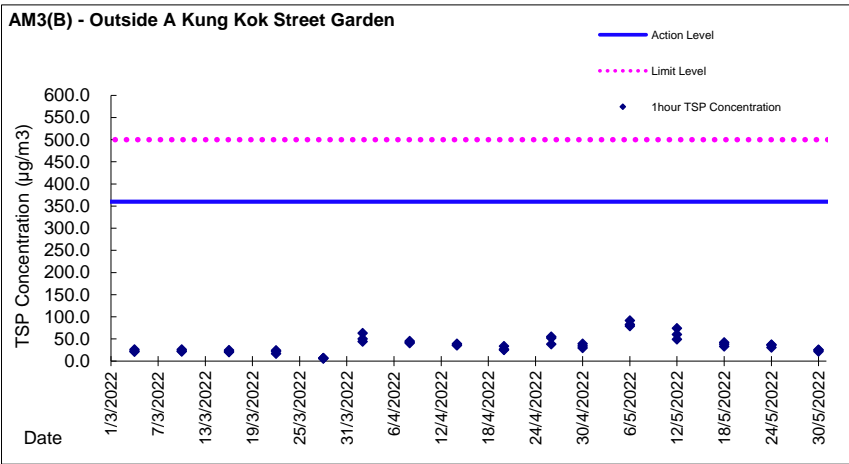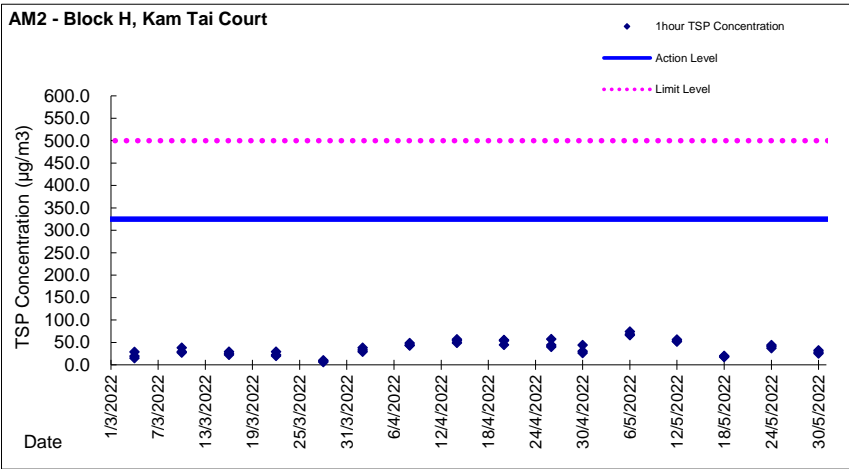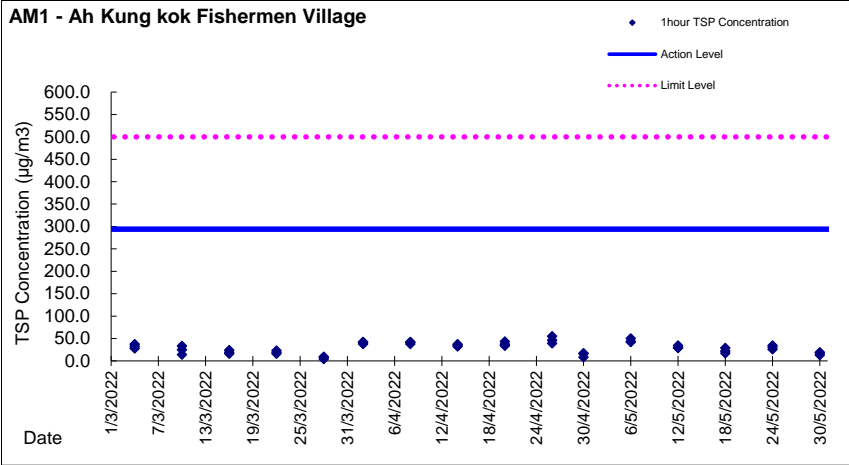



Graphic Presentation of TSP Result

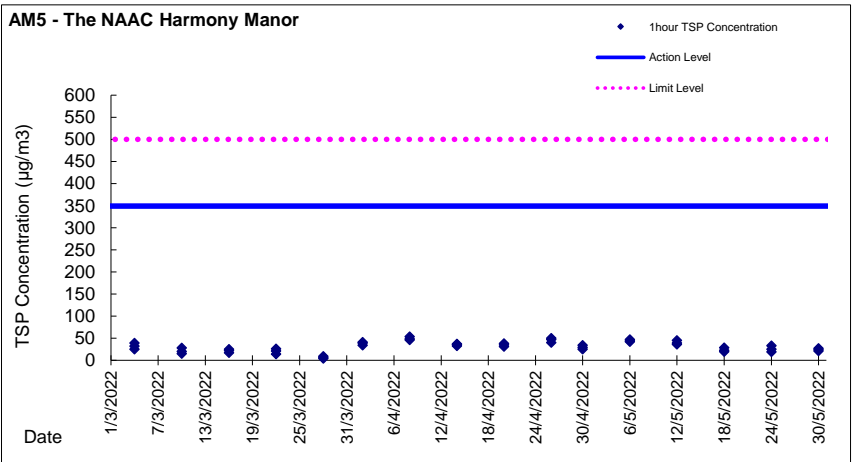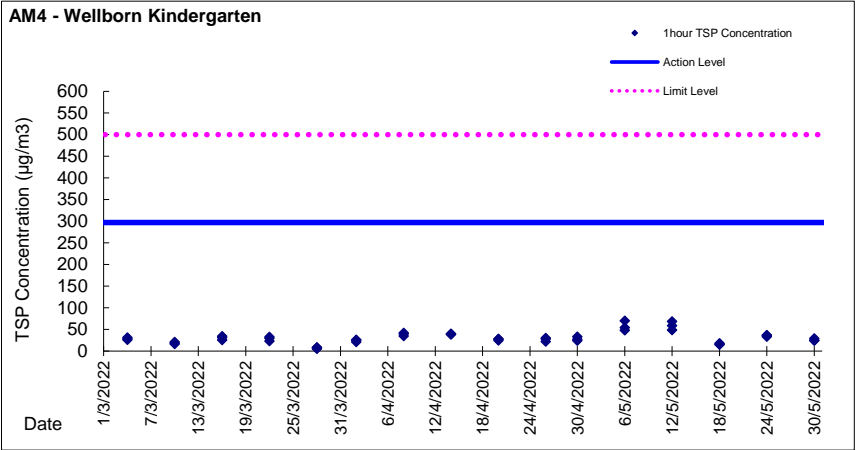



Appendix 4.2

Noise Monitoring Results and Graphical Presentations



Noise Monitoring Result

Day Time (0700 - 1900hrs on normal weekdays)

Location: CM1 - G/F, Wellborn Kindergarten

Date	Time	Weather	Wind Speed (m/s)	Measurement Noise Level			Limit Level
				Leq	L10	L90	Leq
				Unit: dB(A), (30min)			
04/03/2022	9:10	Fine	0.0	56.6	59.4	50.2	70
10/03/2022	9:40	Fine	0.0	57.2	60.1	49.8	70
15/03/2022	13:30	Cloudy	0.0	54.5	58.7	49.0	70
22/03/2022	9:40	Cloudy	0.0	53.8	57.6	48.5	70
28/03/2022	13:30	Cloudy	0.0	55.9	59.2	50.4	70
08/04/2022	15:13	Fine	0.0	60.4	62.8	54.1	70
14/04/2022	17:21	Cloudy	0.0	59.5	63.8	53.0	70
19/04/2022	9:00	Cloudy	0.0	61.8	63.5	51.4	70
25/04/2022	8:30	Fine	0.0	60.6	62.2	50.4	70
06/05/2022	9:20	Fine	0.0	64.0	66.2	60.0	70
13/05/2022	9:25	Cloudy	0.0	61.2	64.7	59.4	70
18/05/2022	16:00	Cloudy	0.0	62.2	66.7	58.9	70
27/05/2022	15:40	Cloudy	0.0	63.8	65.9	60.4	70

* Limit level of noise monitoring station CM1 was adjusted to 65dB(A) during examination period.

Location: CM2(B) - G/F, Kowloon City Baptist Church Hay Nien Primary School

Date	Time	Weather	Wind Speed (m/s)	Measurement Noise Level			Limit Level
				Leq	L10	L90	Leq
				Unit: dB(A), (30-min)			
04/03/2022	9:55	Fine	0.0	58.5	64.3	56.1	70
10/03/2022	10:18	Fine	0.0	60.1	63.8	53.2	70
15/03/2022	14:10	Cloudy	0.0	60.7	65.5	56.4	70
22/03/2022	10:20	Cloudy	0.1	59.6	66.1	55.8	70
28/03/2022	14:10	Cloudy	0.0	62.0	65.4	57.2	70
08/04/2022	15:52	Fine	0.0	61.3	63.1	59.0	70
14/04/2022	16:47	Cloudy	0.0	61.9	62.8	58.9	70
19/04/2022	9:40	Cloudy	0.0	63.4	66.1	57.6	70
25/04/2022	9:10	Fine	0.0	62.0	65.6	57.3	70
06/05/2022	9:57	Fine	0.0	59.3	60.9	56.7	70
13/05/2022	10:00	Cloudy	0.0	59.9	62.4	57.2	70
18/05/2022	16:35	Cloudy	0.0	58.6	61.4	56.2	70
27/05/2022	16:20	Cloudy	0.0	60.3	63.5	57.8	70

* Limit level of noise monitoring station CM2(A) was adjusted to 65dB(A) during examination period.

Location: CM3 - R/F, S.K.H. Ma On Shan Holy Spirit Primary School

Date	Time	Weather	Wind Speed (m/s)	Measurement Noise Level			Limit Level
				Leq	L10	L90	Leq
				Unit: dB(A), (30min)			
02/03/2022	10:22	Cloudy	0.0	64.1	68.8	60.4	70
10/03/2022	11:00	Fine	0.0	63.8	69.4	54.9	70
16/03/2022	10:20	Cloudy	0.0	64.7	68.5	59.8	70
22/03/2022	11:00	Cloudy	0.0	64.1	69.6	60.2	70
28/03/2022	8:30	Cloudy	0.0	63.3	67.6	57.4	70
08/04/2022	16:11	Fine	0.0	60.5	62.5	60.0	70
14/04/2022	14:47	Cloudy	0.0	60.5	61.9	59.3	70
20/04/2022	9:00	Cloudy	0.0	62.5	64.9	60.2	70
25/04/2022	9:55	Fine	0.0	63.1	66.7	59.8	70
06/05/2022	10:45	Fine	0.0	65.1	67.4	58.6	70
12/05/2022	11:00	Fine	0.0	64.9	68.9	55.8	70
18/05/2022	10:40	Cloudy	0.0	65.4	69.0	54.8	70
26/05/2022	9:50	Cloudy	0.0	63.4	66.6	59.1	70



Noise Monitoring Result

Day Time (0700 - 1900hrs on normal weekdays)






Location: CM4 - G/F, Ah Kung Kok Fishermen Village

Date	Time	Weather	Wind Speed (m/s)	Measurement Noise Level			Limit Level
				Leq	L10	L90	Leq
				Unit: dB(A), (30min)			
02/03/2022	17:00	Cloudy	0.0	63.4	67.9	60.3	75
09/03/2022	17:30	Fine	0.0	64.9	68.4	60.6	75
16/03/2022	17:00	Cloudy	0.0	62.4	65.9	58.8	75
23/03/2022	17:00	Cloudy	0.0	63.3	68.2	59.2	75
30/03/2022	16:30	Cloudy	0.0	62.7	67.6	60.4	75
08/04/2022	16:55	Fine	0.0	62.6	65.7	58.6	75
14/04/2022	18:22	Cloudy	0.0	61.2	64.9	57.6	75
20/04/2022	17:00	Cloudy	0.0	63.5	66.1	59.3	75
27/04/2022	17:30	Fine	0.0	61.7	65.2	60.2	75
04/05/2022	17:00	Fine	0.0	60.6	63.9	56.7	75
12/05/2022	9:55	Fine	0.0	58.2	60.1	55.2	75
18/05/2022	10:00	Cloudy	0.0	60.7	61.6	55.2	75
26/05/2022	16:30	Cloudy	0.0	62.1	64.8	58.6	75

Location: CM5 - R/F, The Neighbourhood Advice-Action Council Harmony Manor

Date	Time	Weather	Wind Speed (m/s)	Measurement Noise Level			Limit Level
				Leq	L10	L90	Leq
				Unit: dB(A), (30min)			
04/03/2022	11:00	Fine	0.0	59.7	64.3	49.6	75
10/03/2022	13:00	Fine	0.0	55.9	58.7	49.7	75
16/03/2022	9:30	Cloudy	0.1	57.4	60.8	50.1	75
22/03/2022	9:00	Cloudy	0.4	55.2	58.6	48.9	75
28/03/2022	11:10	Cloudy	0.0	56.8	60.1	51.6	75
08/04/2022	13:51	Fine	0.0	55.6	53.2	48.8	75
14/04/2022	14:28	Cloudy	0.0	54.9	56.2	50.6	75
20/04/2022	11:20	Cloudy	0.0	53.4	55.1	48.2	75
26/04/2022	11:25	Fine	0.0	53.9	56.5	48.0	75
06/05/2022	9:10	Fine	0.0	58.2	60.6	50.9	75
12/05/2022	9:15	Fine	0.0	56.5	57.3	49.6	75
18/05/2022	9:20	Cloudy	0.0	56.2	58.8	47.4	75
26/05/2022	8:10	Cloudy	0.0	53.8	56.4	48.8	75

Graphic Presentation of Noise Monitoring Result
Day Time (0700 - 1900hrs on normal weekdays)

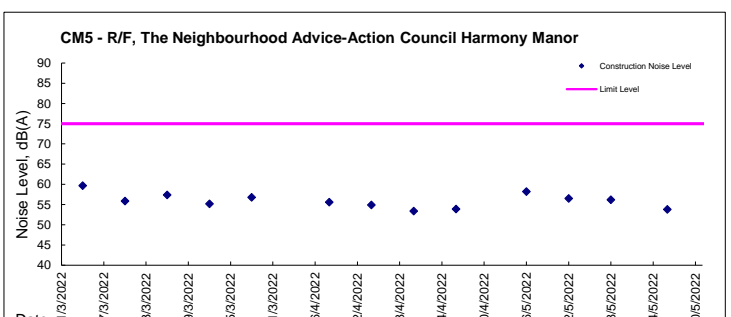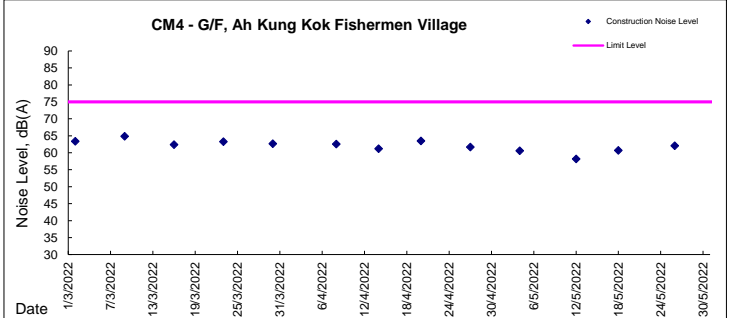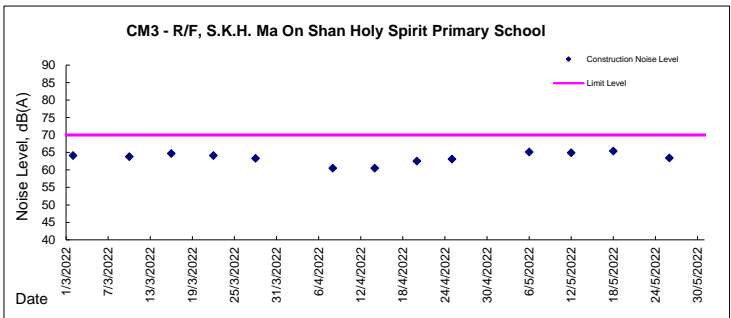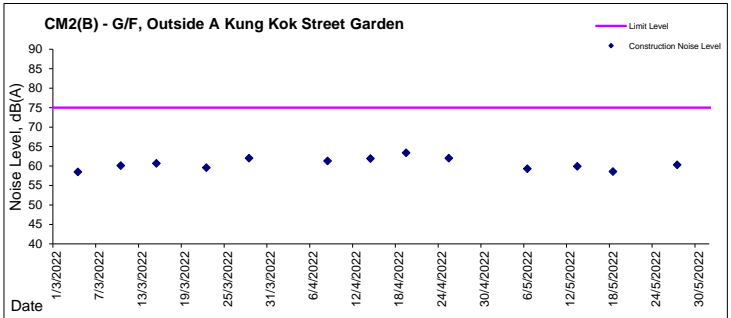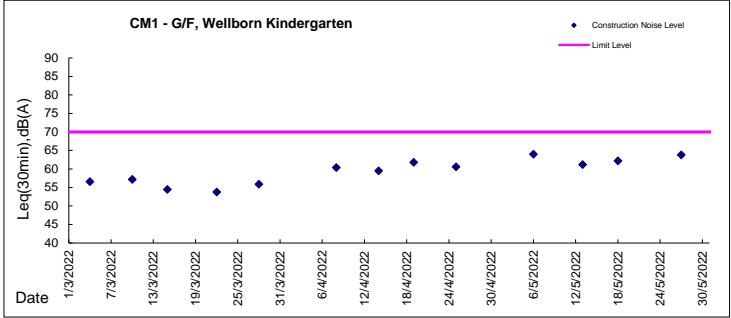



Noise Monitoring Result

Evening Time (1900 - 2300hrs)

Location: CM4 - G/F, Ah Kung Kok Fishermen Village

Date	Weather	Time	Measurement Noise Level			Mean Noise Level	Baseline Level Range (mean level)	Construction Noise Level (baseline correction)	Major Construction Noise Source(s)	Other Noise Source(s)
			Leq	L10	L90	Leq (5min)	Leq	Leq		
			dB(A), (5-min)			Unit: dB(A), (5-min)				
2/3/2022	Cloudy	19:00	65.6	68.9	59.4	64	53.5-70.9 (mean 56.7)	64	nil	Traffic
		19:05	65.1	69.5	60.3					
		19:10	63.8	68.1	58.4					
		19:15	62.5	67.4	58.0					
		19:20	64.2	68.5	59.2					
		19:25	65.7	69.2	60.5					
9/3/2022	Fine	19:05	62.7	66.5	60.2	63	53.5-70.9 (mean 56.7)	62	nil	Traffic
		19:10	62.5	66.8	59.4					
		19:15	63.6	67.2	59.6					
		19:20	64.1	68.5	59.9					
		19:25	63.2	67.5	58.6					
		19:30	61.9	66.4	58.3					
16/3/2022	Cloudy	19:00	62.2	67.4	58.6	63	53.5-70.9 (mean 56.7)	62	nil	Traffic
		19:05	63.4	67.1	58.3					
		19:10	61.9	66.6	58.1					
		19:15	64.3	67.7	59.2					
		19:20	62.8	65.5	57.6					
		19:25	63.4	66.7	57.3					
23/3/2022	Cloudy	19:00	59.7	65.1	57.6	62	53.5-70.9 (mean 56.7)	61	nil	Traffic
		19:05	62.4	66.0	60.1					
		19:10	63.6	66.8	60.1					
		19:15	63.3	66.5	60.6					
		19:20	60.9	65.4	58.7					
		19:25	62.2	65.8	60.4					
30/3/2022	Cloudy	19:00	61.1	66.6	58.4	62	53.5-70.9 (mean 56.7)	61	nil	Traffic
		19:05	60.8	66.7	58.1					
		19:10	61.8	65.9	57.4					
		19:15	62.5	67.1	59.3					
		19:20	64.6	68.2	59.2					
		19:25	63.3	67.8	60.1					



Noise Monitoring Result

Evening Time (1900 - 2300hrs)

Location: CM4 - G/F, Ah Kung Kok Fishermen Village

Date	Weather	Time	Measurement Noise Level			Mean Noise Level Leq (5min)	Baseline Level Range (mean level) Leq	Construction Noise Level (baseline correction) Leq	Major Construction Noise Source(s)	Other Noise Source(s)
			Leq	L10	L90					
			dB(A), (5-min)			Unit: dB(A), (5-min)				
8/4/2022	Fine	19:00	61.9	63.6	58.2	63	53.5-70.9 (mean 56.7)	61	nil	Traffic
		19:05	61.5	64.4	59.7					
		19:10	63.2	65.9	58.1					
		19:15	62.5	64.3	59.2					
		19:20	63.6	65.2	57.4					
		19:25	62.8	64.1	57.6					
14/4/2022	Cloudy	20:00	60.7	62.9	58.2	62	53.5-70.9 (mean 56.7)	60	nil	Traffic
		20:05	60.8	63.3	57.6					
		20:10	61.4	63.6	58.1					
		20:15	60.2	62.5	57.2					
		20:20	63.4	65.8	59.0					
		20:25	62.6	64.2	58.5					
20/4/2022	Cloudy	20:15	58.5	62.4	57.1	61	53.5-70.9 (mean 56.7)	59	nil	Traffic
		20:20	62.1	64.8	58.2					
		20:25	61.6	64.4	57.8					
		20:30	61.9	64.2	58.4					
		20:35	62.3	64.0	58.1					
		20:40	60.8	63.8	57.9					
27/4/2022	Fine	20:00	60.6	62.4	57.7	61	53.5-70.9 (mean 56.7)	59	nil	Traffic
		20:05	61.2	63.1	58.5					
		20:10	61.5	63.2	57.8					
		20:15	62.6	64.1	58.2					
		20:20	59.8	63.3	58.1					
		20:25	60.4	63.2	57.5					



Noise Monitoring Result

Evening Time (1900 - 2300hrs)


Location: CM4 - G/F, Ah Kung Kok Fishermen Village

Date	Weather	Time	Measurement Noise Level			Mean Noise Level Leq (5min)	Baseline Level Range (mean level)	Construction Noise Level (baseline correction) Leq	Major Construction Noise Source(s)	Other Noise Source(s)
			Leq	L10	L90					
			dB(A), (5-min)							
4/5/2022	Cloudy	20:00	60.1	63.9	56.4	61	53.5-70.9 (mean 56.7)	59	nil	Traffic
		20:05	60.6	62.3	55.5					
		20:10	59.7	61.9	55.8					
		20:15	61.2	63.1	57.4					
		20:20	60.4	61.6	57.0					
		20:25	62.5	63.9	58.2					
18/5/2022	Cloudy	19:00	61.7	64.2	58.4	61	53.5-70.9 (mean 56.7)	59	nil	Traffic
		19:05	61.1	63.0	56.8					
		19:10	61.5	62.7	56.9					
		19:15	60.4	62.5	56.1					
		19:20	62.2	64.6	57.8					
		19:25	59.6	62.3	57.2					
27/5/2022	Cloudy	20:00	59.5	61.9	54.6	60	53.5-70.9 (mean 56.7)	57	nil	Traffic
		20:05	58.8	61.2	55.5					
		20:10	60.4	62.8	56.4					
		20:15	60.6	62.9	57.2					
		20:20	61.3	63.5	56.7					
		20:25	59.9	62.5	55.8					

Note: No noise monitoring conducted from 9 to 15 May 2022 due to raining



Graphic Presentation of Noise Monitoring Result
Evening Time (1900 - 2300hrs on normal weekdays)

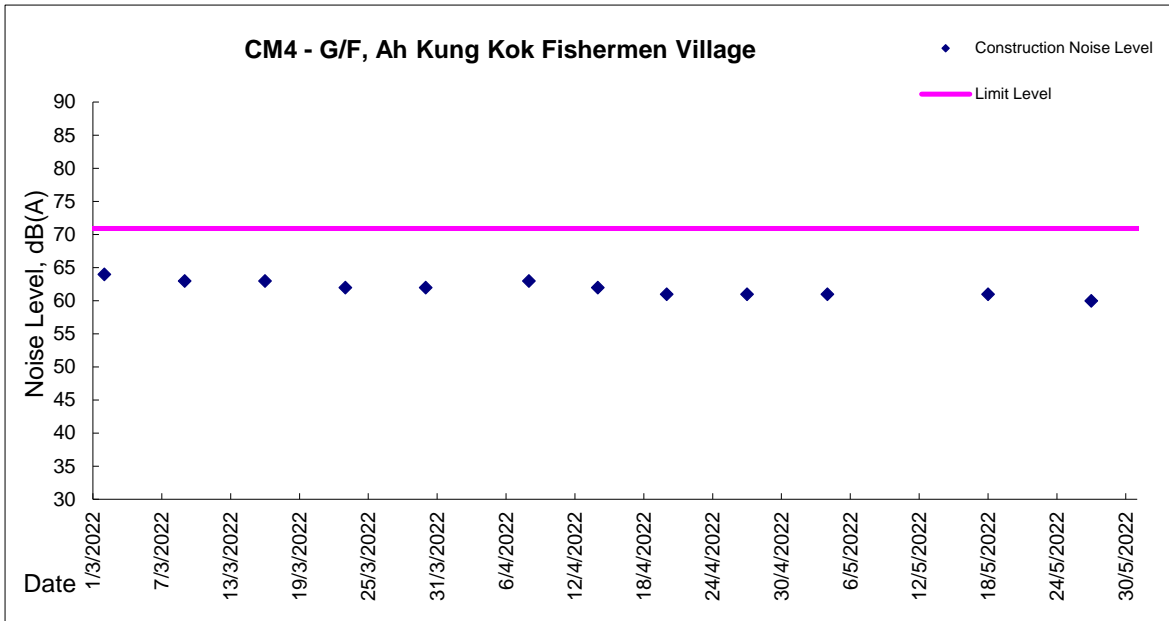



Noise Monitoring Result

Night Time (2300 - 0700hrs on next day)

Location: CM4 - G/F, Ah Kung Kok Fishermen Village

Date	Weather	Time	Measurement Noise Level			Mean Noise Level	Baseline Level Range (mean level)	Construction Noise Level (baseline correction)	Major Construction Noise Source(s)	Other Noise Source(s)
			Leq	L10	L90	Leq (5min)	Leq	Leq		
			dB(A), (5-min)			Unit: dB(A), (5-min)				
2/3/2022	Cloudy	23:10	52.6	57.2	48.9	53	45.6-63.2 (mean 52.8)	39	nil	Traffic
		23:15	51.8	56.2	48.6					
		23:20	52.1	56.3	48.8					
		23:25	54.3	57.4	49.0					
		23:30	53.8	58.9	48.6					
10/3/2022	Fine	0:00	55.2	57.9	49.7	55	45.6-63.2 (mean 52.8)	50	nil	Traffic
		0:05	54.3	57.6	50.5					
		0:10	54.4	56.8	48.2					
		0:15	53.6	56.5	48.9					
		0:20	55.1	57.6	47.5					
16/3/2022	Cloudy	23:05	56.4	59.1	50.7	55	45.6-63.2 (mean 52.8)	51	nil	Traffic
		23:10	53.9	57.2	48.8					
		23:15	55.6	58.3	50.8					
		23:20	55.2	58.7	49.4					
		23:25	54.6	57.3	48.5					
23/3/2022	Cloudy	23:00	52.8	56.3	49.6	54	45.6-63.2 (mean 52.8)	46	nil	Traffic
		23:05	56.2	59.4	50.7					
		23:10	53.1	56.6	49.2					
		23:15	54.3	56.9	50.1					
		23:20	52.5	55.8	48.4					
31/3/2022	Cloudy	0:00	54.2	58.0	49.1	53	45.6-63.2 (mean 52.8)	45	nil	Traffic
		0:05	52.7	56.9	49.4					
		0:10	53.6	56.5	48.2					
		0:15	52.4	55.8	48.1					
		0:20	54.0	57.2	47.4					
		0:25	53.5	56.8	49.5					



Noise Monitoring Result

Night Time (2300 - 0700hrs on next day)

Location: CM4 - G/F, Ah Kung Kok Fishermen Village

Date	Weather	Time	Measurement Noise Level			Mean Noise Level	Baseline Level Range (mean level)	Construction Noise Level (baseline correction)	Major Construction Noise Source(s)	Other Noise Source(s)
			Leq	L10	L90	Leq (5min)	Leq	Leq		
			dB(A), (5-min)			Unit: dB(A), (5-min)				
8/4/2022	Cloudy	23:00	55.9	57.6	49.4	54	45.6-63.2 (mean 52.8)	46	nil	Traffic
		23:05	53.6	56.2	48.3					
		23:10	53.8	56.1	47.7					
		23:15	54.9	57.2	48.6					
		23:20	51.8	54.6	48.2					
	23:25	52.1	55.5	49.6						
15/4/2022	Fine	0:30	52.8	54.1	47.6	53	45.6-63.2 (mean 52.8)	<Baseline Level	nil	Traffic
		0:35	51.6	53.3	47.6					
		0:40	52.2	54.8	48.1					
		0:45	52.5	54.5	48.4					
		0:50	53.0	54.2	49.6					
	0:55	54.1	55.9	48.5						
20/4/2022	Cloudy	23:15	55.2	57.6	49.4	54	45.6-63.2 (mean 52.8)	45	nil	Traffic
		23:20	53.6	55.7	49.5					
		23:25	53.3	56.0	50.4					
		23:30	54.1	56.5	48.9					
		23:35	52.7	54.9	47.6					
	23:40	52.2	54.6	48.3						
28/4/2022	Fine	0:00	50.6	53.6	47.4	52	45.6-63.2 (mean 52.8)	<Baseline Level	nil	Traffic
		0:05	51.2	53.3	48.7					
		0:10	50.4	52.8	47.8					
		0:15	53.3	55.2	48.5					
		0:20	52.1	54.4	50.2					
	0:25	52.8	54.0	48.3						



Noise Monitoring Result

Night Time (2300 - 0700hrs on next day)


Location: CM4 - G/F, Ah Kung Kok Fishermen Village

Date	Weather	Time	Measurement Noise Level			Mean Noise Level Leq (5min)	Baseline Level Range (mean level)	Construction Noise Level (baseline correction) Leq	Major Construction Noise Source(s)	Other Noise Source(s)
			Leq	L10	L90					
			dB(A), (5-min)							
4/5/2022	Fine	23:00	54.1	56.8	50.6	55	45.6-63.2 (mean 52.8)	51	nil	Traffic
		23:05	55.2	56.6	49.9					
		23:10	55.5	56.9	49.7					
		23:15	56.2	58.1	50.1					
		23:20	54.8	56.3	48.6					
		23:25	55.2	57.0	49.4					
18/5/2022	Cloudy	23:00	56.9	58.2	50.4	56	45.6-63.2 (mean 52.8)	52	nil	Traffic
		23:05	54.2	56.6	48.1					
		23:10	54.4	56.5	47.6					
		23:15	55.3	57.2	46.8					
		23:20	56.7	58.6	47.1					
		23:25	55.9	57.6	48.4					
28/5/2022	Cloudy	0:00	53.9	55.2	48.5	55	45.6-63.2 (mean 52.8)	51	nil	Traffic
		0:05	52.5	55.0	47.4					
		0:10	54.8	56.3	48.6					
		0:15	55.1	56.9	47.6					
		0:20	56.8	58.4	49.6					
		0:25	57.3	59.6	48.2					

Note: No noise monitoring conducted from 9 to 15 May 2022 due to raining



Graphic Presentation of Noise Monitoring Result
Night Time (2300 - 0700hrs on normal weekdays)

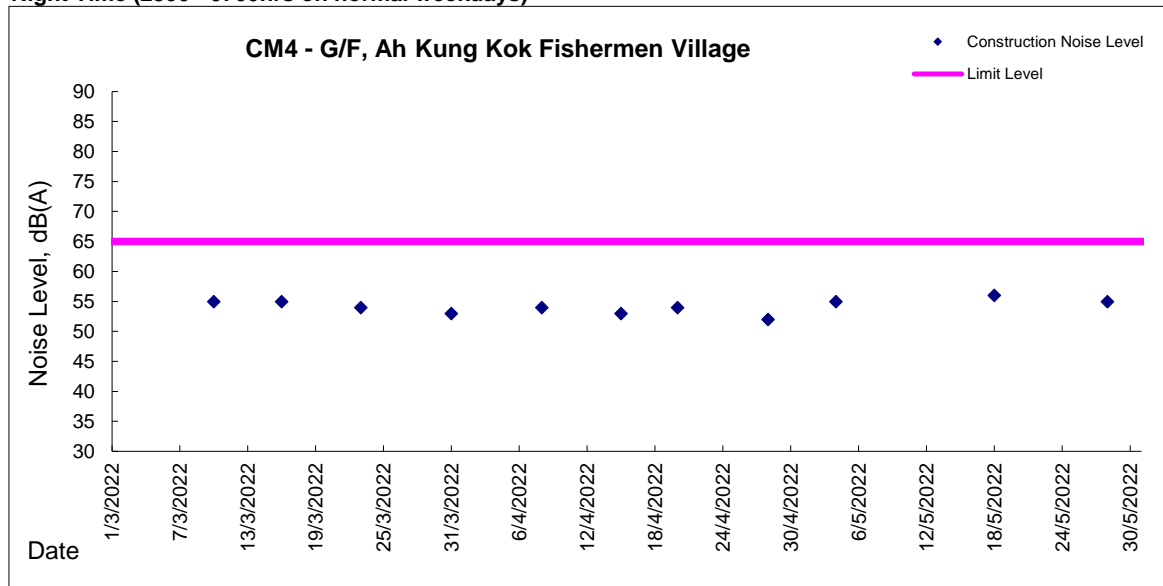



Appendix 4.3

Monthly Summary Waste Flow Table

Monthly Summary Waste Flow Table

Name of Department: Drainage Services Department

Contract No.: DC/2018/05

Monthly Summary Waste Flow Table for April 2022 [to be submitted not later than the 15th day of each month following reporting month]

(All quantities shall be rounded off to 3 decimal places.)

Month	Actual Quantities of Inert C&D Materials Generated Monthly					Actual Quantities of C&D Wastes Generated Monthly				
	(a)=(b)+(c)+(d)+(e) Total Quantity Generated	(b) Broken Concrete (see Note 3)	(c) Reused in the Contract	(d) Reused in other Projects	(e) Disposed as Public Fill	(f) Metals	(g) Paper/cardboard packaging	(h) Plastics (see Note 2)	(i) Chemical Waste	(j) Others, e.g. general refuse disposed at Landfill
	(in '000m ³)	(in '000m ³)	(in '000m ³)	(in '000m ³)	(in '000m ³)	(in '000kg)	(in '000kg)	(in '000kg)	(in L)	(in tonne)
Jan-22	10.122	0.076	0.073	9.951	0.023	0.000	0.000	0.000	0.000	34.29
Feb-22	11.071	0.454	0.065	10.455	0.098	0.000	0.000	0.000	0.000	9.15
Mar-22	4.451	0.056	0.025	4.358	0.013	0.000	0.250	0.000	0.000	18.32
Apr-22	1.904	0.000	0.003	1.894	0.008	0.000	0.000	0.000	0.000	26.07
May-22										
Jun-22										
Sub-total	27.549	0.585	0.166	26.657	0.141	0.000	0.250	0.000	0.000	87.83
Jul-22										
Aug-22										
Sep-22										
Oct-22										
Nov-22										
Dec-22										
Total	27.549	0.585	0.166	26.657	0.141	0.000	0.250	0.000	0.000	87.83

- Notes:
- (1) The waste flow table shall also include C&D materials that are specified in the Contract to be imported for use at the Site.
 - (2) Plastics refer to plastics bottles/containers, plastic sheets/foam from packaging material.
 - (3) Broken concrete for recycling into aggregates.
 - (4) If necessary, use the conversion factor: 1 full load of dumping truck being equivalent to 5 m³ by volume.
 - (5) Conversion factors for reporting purpose:
Excavated: rock = 2.0 tonnes/m³, soil = 1.8 tonnes/m³, broken concrete and bitumen = 2.4 tonnes/m³, Slurry = 2.8 tonnes/m³

Monthly Summary Waste Flow Table

Name of Department: Drainage Services Department

Contract No.: DC/2020/05

Monthly Summary Waste Flow Table for May 2022 [to be submitted not later than the 15th day of each month following reporting month]

(All quantities shall be rounded off to 3 decimal places.)

Month	Actual Quantities of Inert C&D Materials Generated Monthly					Actual Quantities of C&D Wastes Generated Monthly				
	(a)=(b)+(c)+(d)+(e) Total Quantity Generated	(b) Broken Concrete (see Note 3)	(c) Reused in the Contract	(d) Reused in other Projects	(e) Disposed as Public Fill	(f) Metals	(g) Paper/cardboard packaging	(h) Plastics (see Note 2)	(i) Chemical Waste	(j) Others, e.g. general refuse disposed at Landfill
	(in '000m ³)	(in '000m ³)	(in '000m ³)	(in '000m ³)	(in '000m ³)	(in '000kg)	(in '000kg)	(in '000kg)	(in '000kg)	(in tonne)
Jan-22	0.141	0.061	0.000	0.000	0.080	0.000	0.000	0.000	0.000	302.470
Feb-22	4.756	0.077	0.000	0.035	4.645	0.000	0.000	0.000	0.000	23.610
Mar-22	0.177	0.006	0.000	0.042	0.128	0.000	0.000	0.000	0.000	121.970
Apr-22	9.583	0.015	0.000	8.967	0.601	0.000	0.000	0.000	0.000	35.340
May-22	21.701	0.024	1.000	19.299	1.378	73.129	0.250	0.000	0.000	0.000
Sub-total	36.358	0.182	1.000	28.343	6.832	73.129	0.250	0.000	0.000	483.390
Total	36.358	0.182	1.000	28.343	6.832	73.129	0.250	0.000	0.000	483.390

- Notes:
- (1) The waste flow table shall also include C&D materials that are specified in the Contract to be imported for use at the Site.
 - (2) Plastics refer to plastics bottles/containers, plastic sheets/foam from packaging material.
 - (3) Broken concrete for recycling into aggregates.
 - (4) If necessary, use the conversion factor: 1 full load of dumping truck being equivalent to 5 m³ by volume.
 - (5) Conversion factors for reporting purpose:
Excavated: rock = 2.0 tonnes/m³, soil = 1.8 tonnes/m³, broken concrete and bitumen = 2.4 tonnes/m³, Slurry = 2.8 tonnes/m³



Appendix 6.1

Event and Action Plans



Event and Action Plan for Construction Air Quality

EVENT	ACTION			
	ET	IEC	ER	CONTRACTOR
ACTION LEVEL				
1. Action level being exceedance by one sampling	1. Identify source, investigate the causes of exceedance and propose remedial measures; 2. Inform Contractor, IEC and ER; 3. Repeat measurement to confirm finding; and 4. Increase monitoring frequency to daily.	1. Check monitoring data submitted by ET; 2. Check Contractor's working method; and 3. Review and advise the ET and ER on the effectiveness of the proposed remedial measures.	1. Notify Contractor.	1. Identify source(s), investigate the causes of exceedance and propose remedial measures; 2. Implement remedial measures; and 3. Amend working methods agreed with the ER as appropriate
2. Action level being exceeded by two or more consecutive sampling	1. Identify source; 2. Inform Contractor, IEC and ER; 3. Advise the Contractor and ER on the effectiveness of the proposed remedial measures; 4. Repeat measurements to confirm findings; 5. Increase monitoring frequency to daily; 6. Discuss with IEC and Contractor on remedial actions required; 7. If exceedance continues, arrange meeting with Contractor, IEC and ER; 8. If exceedance stops, cease additional monitoring.	1. Check monitoring data submitted by ET; 2. Check Contractor's working method; 3. Discuss with ET, ER and Contractor on possible remedial measures; 4. Advise the ET and ER on the effectiveness of the proposed remedial measures; and 5. Supervise Implementation of remedial measures.	1. Confirm receipt of notification of exceedance in writing; 2. Notify Contractor; 3. Ensure remedial measures properly implemented. 4. If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated.	1. Identify source and investigate the causes of exceedance; 2. Submit proposals for remedial measures to the ER with a copy to ET and IEC within three working days of notification; 3. Implement the agreed proposals; and 4. Amend proposal as appropriate.



Event and Action Plan for Construction Air Quality (Con't)

EVENT	ACTION			
	ET	IEC	ER	CONTRACTOR
LIMIT LEVEL				
1. Limit level exceedance by one sampling	<ol style="list-style-type: none"> 1. Identify source, investigate the causes of exceedance and propose remedial measures; 2. Inform Contractor, IEC, ER, and EPD; 3. Repeat measurement to confirm finding; 4. Increase monitoring frequency to daily; and 5. Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results. 	<ol style="list-style-type: none"> 1. Check monitoring data submitted by ET; 2. Discuss amongst ER, ET, and Contractor on the potential remedial actions; 3. Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly; and 4. Supervise implementation of remedial measures. 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of exceedance in writing; 2. Notify Contractor; 3. Ensure remedial measures properly implemented. 	<ol style="list-style-type: none"> 1. Identify source(s) and investigate the causes of exceedance; 2. Take immediate action to avoid further exceedance; 3. Submit proposals for remedial measures to ER with a copy to ET and IEC within three working days of notification; 4. Implement the agreed proposals; and 5. Amend proposal if appropriate.
2. Limit level exceedance by two or more consecutive sampling	<ol style="list-style-type: none"> 1. Notify IEC, ER, Contractor and EPD; 2. Identify source; 3. Repeat measurement to confirm findings; 4. Increase monitoring frequency to daily; 5. Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented; 6. Arrange meeting with IEC and ER to discuss the remedial actions to be taken; 7. Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results; and 8. If exceedance stops, cease additional monitoring. 	<ol style="list-style-type: none"> 1. Check monitoring data submitted by the ET; 2. Discuss amongst ER, ET, and Contractor on the potential remedial actions; 3. Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly; 4. Supervise the implementation of remedial measures. 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of exceedance in writing; 2. In consultation with the ET and IEC, agree with the Contractor on the remedial measures to be implemented; 3. Supervise the implementation of remedial measures; and 4. If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated. 	<ol style="list-style-type: none"> 1. Identify source(s) and investigate the causes of exceedance; 2. Take immediate action to avoid further exceedance; 3. Submit proposals for remedial measures to the ER with a copy to the IEC and ET within three working days of notification; 4. Implement the agreed proposals; 5. Revise and resubmit proposals if problem still not under control; and 6. Stop the relevant portion of works as determined by the ER until the exceedance is abated.



Event and Action Plan for Construction Noise

EVENT	ACTION			
	ET	IEC	ER	CONTRACTOR
Action Level	<ol style="list-style-type: none"> 1. Notify IEC and Contractor; 2. Carry out investigation; 3. Report the results of investigation to the IEC, ER and Contractor; 4. Discuss with the Contractor and formulate remedial measures; and 5. Increase monitoring frequency to check mitigation effectiveness. 	<ol style="list-style-type: none"> 1. Review the analysed results submitted by the ET; 2. Review the proposed remedial measures by the Contractor and advise the ER accordingly; and 3. Supervise the implementation of remedial measures 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of failure in writing; 2. Notify Contractor; 3. Require Contractor to propose remedial measures for the analyzed noise problem; and 4. Ensure remedial measures are properly implemented. 	<ol style="list-style-type: none"> 1. Submit noise mitigation proposals to IEC; and 2. Implement noise mitigation proposals.
Limit Level	<ol style="list-style-type: none"> 1. Identify source; 2. Inform IEC, ER, EPD and Contractor; 3. Repeat measurements to confirm findings; 4. Increase monitoring frequency; 5. Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented; 6. Inform IEC, ER and EPD the causes and actions taken for the exceedances; 7. Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results; 8. If exceedance stops, cease additional monitoring. 	<ol style="list-style-type: none"> 1. Discuss amongst ER, ET, and Contractor on the potential remedial actions; 2. Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly; and 3. Supervise the implementation of remedial measures. 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of failure in writing; 2. Notify Contractor; 3. Require Contractor to propose remedial measures for the analysed noise problem; 4. Ensure remedial measures properly implemented; and 5. If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated. 	<ol style="list-style-type: none"> 1. Take immediate action to avoid further exceedance; 2. Submit proposals for remedial actions to IEC and ER within 3 working days of notification; 3. Implement the agreed proposals; 4. Resubmit proposal if problem still not under control; and 5. Stop the relevant portion of works as determined by the ER until the exceedance is abated.



Appendix 7.1

Complaint Log



Environmental Complaints Log

Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
190808	29 July 2019	DSD	Construction site area Portion 6	Exposed slope surface without any covering was observed at Portion 6	<p>A public complaint regarding construction dust received by DSD on 29 July 2019 was subsequently referred to ET on 6 August 2019. The complainant reported that exposed slope surface without any covering at Portion 6. Based on the information provided by the Contractor, the concerned area was under slope cutting and filling works for temporary haul road construction.</p> <p>Based on the observation on 6 August 2019 and weekly site inspection on 7 August 2019, the concerned slope was observed covered with the tarpaulin sheets to alleviate the potential dust impact to the surroundings.</p> <p>Upon review on the monitoring data, no exceedances were recorded at the air quality monitoring stations AM2 - Block H, Kam Tai Court and AM4 - Wellborn Kindergarten (located nearest to the concerned slope) during the 1hr TSP monitoring on 23 July 2019 and 29 July 2019 respectively.</p> <p>Follow up site inspection was conducted by the Environmental Team on 07 August 2019 and it was observed that the slope at Portion 6 was properly covered.</p> <p>Nevertheless, in view of the public concern, the Contractor of DC/2018/05 was reminded to enhance the dust suppression measure by providing adequate watering to any exposed surface during cutting slope and fill works to avoid potential dust impact to the surroundings.</p>	Interim investigation report was issue on 16 August 2019
201112	12 November 2020	DSD	Outside site boundary of Portion 11	water contamination / ecological impact	<p>A letter from Kadoorie Farm and Botanic Garden (KFBG) regarding water contamination / ecological impact received by DSD on 12 November 2020 was subsequently referred to ET on 12 November 2020. The KFBG alleged that:</p> <ul style="list-style-type: none">- Extracting water directly from the stream,- Surface run-off silt smothering forest understorey and silting the stream,- Cement has been disposed into the forest understorey and the stream , and- Diesel fuel leaking from pumps and generators at Portion 11.	Interim investigation report was issue on 14 December 2020



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>The concerned area is natural stream near slope cutting and filling works for temporary haul road construction, outside of the DC/2018/05 construction site boundary.</p> <p>The Contractor, RSS conducted walk-through survey on 17 November 2020 starting from around the tree tag T9511/ T9512 and ending at the pool of the natural stream near Portion 11 of DC/2018/05.</p> <p>Additional site inspection with EPD, DSD, RSS, ET and the Contractor was conducted on 17 November 2020, additional site inspection with KFBG, DSD, RSS, ET and the Contractor was conducted on 19 November 2020.</p> <p>No Pollutants were observed being discharged to the stream, the natural stream was clean with running water during above inspections. However, few spots were found with cement and silt on the bedding of the stream.</p> <p>According to the Contractor, the water pumps were the emergency pumps and it had been removed away from the natural stream. No pump was observed during above inspections.</p> <p>There was no sign of any diesel fuel leaking from pumps or generators. The nearest generator for the construction work has been located far away from the concerned location. By the walk-through survey along the natural stream, there was no oil-strain or diesel likes contamination being observed.</p> <p>By the walk-through survey, various locations were found with silting / sand. The sources of the silt were not necessary from the construction site of DC/2018/05. It could also be contributed by the natural erosion from both sides of the stream.</p> <p>Nevertheless, in view of the public concern, the Contractor of DC/2018/05 was willing to clean up the stream to address the concerns from KFBG to protect the environment. The Contractor also reminded to keep review the performance of mitigation measures including well cover slope / area with exposed soil with tarpaulin sheets to prevent surface runoff, using cellular confinement system to prevent soil erosion.</p>	
210127	27 January 2021	DSD	Construction Area at Portion 6 (Tunnel)	Air Quality	A public complaint regarding construction dust referred by DSD on 27 January 2021 was subsequently received by ET on 27 January 2021. The complainant reported that:	Interim investigation report was



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>- Construction dust emission arising from blasting works in tunnel was observed near Block 6, Chevalier Garden.</p> <p>Blasting in the tunnel was carried out under Contract DC/2018/05 at the concerned area</p> <p>According to the relevant site information provided by the Contractor of DC/2018/05, there are total of 13nos. of blasting works was carried out in January 2021 in the tunnel.</p> <p>The blasting works was carried out in the tunnel. Dust screen, mist curtain, sprinkler system and mist cannon were installed / operated when blasting, the blast door was tightly closed during blasting.</p> <p>Based on review on air quality monitoring data, no exceedances were recorded at the air quality monitoring stations AM3(B) - Outside A Kung Kok Street Garden and AM4 - Wellborn Kindergarten (located nearest to the concerned area) during the scheduled 1hr TSP monitoring in January 2021.</p> <p>Ad-hoc TSP monitoring and inspection was carried out on 29 January and 1 February 2021 during blasting, no exceedances were recorded at the air quality monitoring stations AM3(B) - Outside A Kung Kok Street Garden and AM4 - Wellborn Kindergarten.</p> <p>Based on the site inspection on 28 January 2021, 2nos. mist cannons have been installed and operated on the top of blast door during / after the blast door opened to reduce fumes / mists emission.</p> <p>The Contractor of DC/2018/05 was reminded to enhance the dust suppression measure by providing adequate watering after the blast door opened. Contractor is requested to</p>	issue on 7 February 2021



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>consider extend the time to open the blast door after blasting in order to the fumes and rock dust have been settled in the tunnel.</p> <p>Also, the Contractor of DC/2018/05 was reminded that the ventilation system in the tunnel should be maintained in good condition.</p>	
20211201	1 December 2021	AECOM	Construction Area at Portion 12 (The Neighbourhood Advice-Action Council Harmony Manor)	Noise	<p>A public complaint regarding construction noise referred by AECOM on 3 December 2021 was subsequently received by ET on 3 December 2021.</p> <p>The complainant reported to 1823 online dated on 1 December 2021 that the construction noise (heavy vehicle and drilling works) generated from the construction site at A Kung Lok Shan Road was causing noise nuisance to complainant's son.</p> <p>According to the relevant site information provided by the Contractor of DC/2020/05, preparation works for sheet pile driving, which included machinery and materials mobilization, were carried out on 1 December 2021. Sheet pile work was commenced on 2 December 2021.</p> <p>Based on review on noise monitoring data, no exceedances were recorded at the noise monitoring station CM5 - R/F, The Neighbourhood Advice-Action Council Harmony Manor (located nearest to the concerned area) during the scheduled Leq30 min noise monitoring in November 2021. ET conducted regular noise monitoring on 3 December 2021, no exceedances was record at the noise monitoring stations CM5 - R/F, The Neighbourhood Advice-Action Council Harmony Manor. Weekly noise monitoring was conducted on 7 December 2021, no exceedances was recorded at the noise monitoring station CM5 - R/F, The Neighbourhood Advice-Action Council Harmony Manor. Site inspection was conducted on 8 December 2021, it is observed that breaking /drilling works by other contractor was conducted next to The Neighbourhood Advice-Action Council Harmony Manor. No heavy vehicles passing by A</p>	Interim investigation report was issue on 10 December 2021



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>Kung Lok Shan Road during noise monitoring.</p> <p>After receiving the complaint, additional noise mitigation measures, including wrapping up the breaker tip with acoustic mat and deploying of temporary noise barrier have been implemented by the Contractor of DC/2020/05.</p> <p>The Contractor of DC/2020/05 was reminded to enhance the noise mitigation measures by providing sufficient temporary noise barrier. Contractor is advised to make good communication with The Neighbourhood Advice-Action Council Harmony Manor and consider scheduling the time of sheet piling and machinery / materials mobilization in order to avoid further complaint.</p>	
20220506	6 May 2022	Contractor	Construction Area at Portion 10 (Next to the Chevalier Garden)	Noise	<p>A public complaint regarding construction noise referred by the Contractor was received by ET on 12 May 2022.</p> <p>The complainant reported to 1823 Call Centre (ICC) dated on 6 May 2022 that the construction noise (rock-breaking and excavation) generated from the construction site of Portion 10 at Mui Tsz Lam Road was causing noise nuisance to complainant.</p> <p>According to the relevant site information provided by the Contractor of DC/2020/05, rock-breaking and excavation works were conducted during the concerned period.</p> <p>Based on review on noise monitoring data, no exceedances were recorded at the noise monitoring stations CM1 - G/F, Wellborn Kindergarten and CM2(B) - G/F, Outside A Kung Kok Street Garden (located within the Chevalier Garden) during the scheduled Leq30 min noise monitoring in April 2022. ET conducted regular noise monitoring on 6 May 2022, no exceedances were recorded at the noise monitoring stations CM1 - G/F, Wellborn Kindergarten and CM2(B) - G/F, Outside A Kung Kok Street Garden. Site inspection was conducted on 5 & 12 May 2022, it is observed that rock-breaking was conducted at the</p>	Interim investigation report was issue on 13 May 2022



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>construction site of Portion 10. Ad-hoc noise monitoring at CM1 - G/F, Wellborn Kindergarten and CM2(B) - G/F, Outside A Kung Kok Street Garden on 13 May 2022, no exceedances were recorded.</p> <p>During execution of rock breaking works, below noise mitigation measures had been implemented by the Contractor of DC/2020/05</p> <ul style="list-style-type: none">• Erection of 8m height noise barrier• Wrapping up the breaker tip with acoustic material• Upgrade the existing hoarding to perform as noise barrier by affixing a layer of sound absorption material to the hoarding surface• Voluntary to late start of rock breaking work at 0900hrs instead of 0700hrs, which is allowed under the Regulation. <p>Contractor of DC/2020/05 also carried out self-noise monitor for the rock-breaking works on 4, 5 & 6 May 2022, All results show the construction noise levels are below the 75dB(A).</p> <p>ET would continue to monitor the adequacy of mitigation measures and review the monitoring data of the monitoring stations of CM1 - G/F, Wellborn Kindergarten and CM2(B) - G/F, Outside A Kung Kok Street Garden.</p> <p>The Contractor is recommend to review the construction operation to erect the temporary noise barriers, if feasible and ensure all idled PME are shut down to minimize potential noise emanation at the concerned works area to avoid potential nuisance.</p>	



Appendix 8.1

Construction Programme of Individual Contracts

Activity ID	Activity Name	Original Duration	Start	Finish	Total Float	Late Start	Late Finish	2022						
								Feb	Mar	Apr	May	Jun	Jul	
Relocation of Sha Tin Sewage Treatment Works to Caverns - Site Preparation & Access Tunnel														
Contract Particular														
General														
General														
A10190	Contract Completion Date	0		25-Mar-22*	0		25-Mar-22		25-Mar-22*	◆ Contract Completion Date				
Sectional Completion														
Sectional Completion														
Sect040	Sect 4 (1034d) - Comprises works not covered in any other Sections	0		17-Mar-22*	-14		03-Mar-22		17-Mar-22*	◆ Sect 4 (1034d) - Comprises works not covered in any other Sections				
Sect060	Sect 6 (1064d) - Completion of fully coordinated as-built BIM model	0		02-Apr-22*	5		07-Apr-22		02-Apr-22*	◆ Sect 6 (1064d) - Completion of fully coordinated as-built BIM model				
SectCE205	CE205 - All Western Access Tunnel Entrustment Works Complete	0		30-Apr-22*	0		30-Apr-22		30-Apr-22*	◆ CE205 - All Western Access Tunnel Entrustment Works Complete				
Preliminary Works														
Preliminary Works														
Preliminary Works														
A11990	Completion of fully coordinated as-built BIM model	23	08-Mar-22 A	02-Apr-22	3	11-Mar-22	07-Apr-22							
Main Portal Area														
Retaining Wall for Main Portal														
Retaining Wall RMP5 - CSD														
A17200	Retaining Wall wall structure to 23mpd (Bay 1) - CSD RMP5 (at WAT portal area)	10	02-Mar-22 A	17-Mar-22	-12	22-Feb-22	03-Mar-22							
A17235	Catch pits at RMP5	30	18-Mar-22	26-Apr-22	4	23-Mar-22	30-Apr-22							
A17240	450 dia drainage pipe from RMP5 to SMH2010	30	18-Mar-22	26-Apr-22	4	23-Mar-22	30-Apr-22							
CE205 - Western Access Tunnel Entrustment Works														
General														
General														
E01010	All Western Access Tunnel Entrustment Works Complete	0		30-Apr-22*	0		30-Apr-22		30-Apr-22*	◆ All Western Access Tunnel Entrustment Works Complete				
Western Access Tunnel														
Site Formation for Western Tunnel Portal														
E11110	Excavation (+13 to +8mpd) rock breaking (RHS)	76	22-Nov-21 A	31-Mar-22	10	19-Mar-22	13-Apr-22							
Soft Ground Tunnel Excavation by Drill and Break														
E11120	Bottom bench excavation (Ch171 - 222)	79	30-Dec-21 A	30-Apr-22	0	08-Mar-22	30-Apr-22							

Remaining Level of Effort
 Actual Level of Effort
 Actual Work
 Remaining Work
 Critical Remaining Work

Project ID: MP006 (2203)
 Layout: 3 Month Rolling Programme
 Data Date: 08-Mar-22
 Page 1 of 1
 Primavera Systems, Inc.

Contract No. DC/2018/05
Relocation of Sha Tin Sewage Treatment Works to Caverns -
Site Preparation and Access Tunnel Construction
3 Month Rolling Programme



CHINA STATE JOINT VENTURE

Activity ID	Activity Name	Duration % Complete	Remaining Duration	Start	Finish	Total Float	Late Start	Late Finish	2022						
									Apr	May	Jun	Jul	Aug		
DC/2020/05, Relocation of STST to Caverns - Main Caverns Construction															
Contract Particulars, Key Dates, Section of Completions, Access Dates															
Contract Key Date															
C-KD1	KD1 (365d): Complete Temp Explosive Magazine (Mode A store) and approval of Mode A Store Licence by CoM	0%	0d		05-Jul-22*	0d		05-Jul-22						05-Jul-22*	◆ KD1 (365d): Complete Tem
Planned Completion Dates															
Planned Key Date Completion															
KD01	Planned KD1 - Complete Temp Explosive Magazine (Mode A store) and approval of Mode A Store Licence by CoM	0%	0d		05-Jul-22	0d		05-Jul-22						05-Jul-22	◆ Planned KD1 - Complete Te
Preliminary Works & Preparation Works															
Subletting and Procurement															
2nd Batch															
C1031	[Summary] Sub-letting & procurement for the 2nd batch sub-contract (other minor packages)	87.45%	31d	10-Aug-21 A	15-Jun-22	89d	30-Sep-22	30-Sep-22							
C1031-RP28	Sub-letting 2nd batch - pipe jacking for effluent pipeline	87.8%	30d	10-Aug-21 A	14-Jun-22	90d	25-Aug-22	30-Sep-22							
C1031-RP38	Sub-letting 2nd batch - Portion 10 - piling works (Soldier Pile wall)	87.45%	31d	10-Aug-21 A	15-Jun-22	56d	16-Jul-22	20-Aug-22							
3rd Batch															
C1032	[Summary] Sub-letting & procurement for the 3rd batch sub-contract	82.08%	43d	01-Sep-21 A	29-Jun-22	1355d	05-Feb-27	05-Feb-27							
C1032-RP06	Sub-letting 3rd batch - Noise Barrier NB4 (steelwork & panels)	83.33%	37d	15-Sep-21 A	22-Jun-22	1312d	26-Oct-26	07-Dec-26							
C1032-RP08	Sub-letting 3rd batch - Noise Barrier NB4 (r.c. works)	83.33%	37d	15-Sep-21 A	22-Jun-22	1240d	30-Jul-26	10-Sep-26							
C1032-RP20	Sub-letting 3rd batch - Blasting Works (2) - CAV3 &4, BD1,2,3,4, VA	87.56%	25d	27-Sep-21 A	08-Jun-22	166d	26-Nov-22	24-Dec-22							
C1032-RP40	Sub-letting 3rd batch - Blasting Works (4) - Ventilation Shaft VS	87.24%	25d	04-Oct-21 A	08-Jun-22	238d	01-Mar-23	29-Mar-23							
C1032-RP50	Sub-letting 3rd batch - apply for temp power supply for Cavern Tunneling Works	87.24%	25d	04-Oct-21 A	08-Jun-22	414d	04-Oct-23	02-Nov-23							
C1032-RP60	Sub-letting 3rd batch - apply for temp water supply for Cavern Tunneling Works	79.91%	43d	04-Oct-21 A	29-Jun-22	1355d	15-Dec-26	05-Feb-27							
Procurement of Major Construction Plant															
Procurement of Tunneling Equipment															
A20322	Procurement of Drill Jumbo (1st) (for CBAR2, 1 no.) - order and delivery	70.17%	54d	01-Jan-22 A	30-Jun-22	347d	20-Apr-23	12-Jun-23							
A20332	Procurement of Drill Jumbo (2nd) (for CBAR2, 1 no.) - order and delivery	52.48%	115d	01-Jan-22 A	30-Aug-22	1621d	15-Oct-26	06-Feb-27							
A21090	Procurement of Spraying Machine - process of contract award	93.03%	14d	02-Nov-21 A	21-May-22	1692d	25-Dec-26	07-Jan-27							
A21092	Procurement of Spraying Machine - order and delivery	0%	30d	22-May-22	20-Jun-22	1692d	08-Jan-27	06-Feb-27							
A21100	Procurement of Wheel Loader - process of contract award	91.81%	14d	02-Dec-21 A	21-May-22	1692d	25-Dec-26	07-Jan-27							
A21102	Procurement of Wheel Loader - order and delivery	0%	30d	22-May-22	20-Jun-22	1692d	08-Jan-27	06-Feb-27							
Design for Overhead Ventilation Duct (OHVD)															

Remaining Level of Effort
 Actual Level of Effort
 Actual Work
 Remaining Work
 Critical Remaining Work
 Milestone
 Crit. Milestone

Project File: C2-MP004(2205)
 Layout: MPR - 3M Rolling Prog (submission)
 Data Date: 08-May-22
 Page 1 of 9

Contract No. DC/2020/05
Relocation of Sha Tin Sewage Treatment Works to Caverns -
Main Caverns Construction
3 Months Rolling Programme



Activity ID	Activity Name	Duration % Complete	Remaining Duration	Start	Finish	Total Float	Late Start	Late Finish	2022					
									Apr	May	Jun	Jul	Aug	
A25000	Design for Tunnel internal r.c. structure - Prepare and submit Scheme design review	47.75%	58d	16-Mar-22 A	04-Jul-22	396d	08-Jun-23	04-Aug-23						
A25010	Design for Tunnel internal r.c. structure - PM 1st comment scheme design	0%	21d	05-Jul-22	25-Jul-22	396d	05-Aug-23	25-Aug-23						
A25020	Design for Tunnel internal r.c. structure - Review and re-submit scheme design	0%	60d	26-Jul-22	23-Sep-22	396d	26-Aug-23	24-Oct-23						
Off-Site Fabrication for Cavern Complex														
Off-site Fabrication of Lining Shutter for Cavern Complex														
A20340	Lining Shutter - Design preparation, review and accept by PM	0%	60d	20-Jun-22*	29-Aug-22	308d	10-Jul-23	16-Sep-23						
BIM Management [PS App 29.1]														
BIM Training														
A24870	BIM Training - nominate staffs or sub-contractor's staff to attend training course	27.78%	13d	03-May-22 A	20-May-22	889d	13-Oct-24	25-Oct-24						
A24880	BIM Training - Liaise with CIC for schedule of training courses	0%	60d	21-May-22	19-Jul-22	889d	26-Oct-24	24-Dec-24						
A24890	BIM Training - prepare and submit training schedule with proposed staff attendants to PM	0%	30d	20-Jul-22	18-Aug-22	889d	25-Dec-24	23-Jan-25						
General Site Preparation Works														
Tree Preservation and Protection														
C1050	Preservation and Protection of Existing Trees	15.19%	1373d	05-Jul-21 A	07-Jan-27	0d	10-May-22	07-Jan-27						
Hoarding														
Hoarding Erection														
A10050	Hoarding erection - WA4	0%	40d	10-May-22	25-Jun-22	1333d	19-Nov-26	07-Jan-27						
Site Office at WA2														
Site Office Erection at WA2														
A10480	WA2 Site office - design preparation and submission	98.13%	4d	17-Aug-21 A	13-May-22	141d	28-Oct-22	01-Nov-22						
A10490	WA2 Site office - design approval	88.79%	12d	10-Jan-22 A	27-May-22	141d	02-Nov-22	15-Nov-22						
A10495	WA2 Handed over to Dept of Health (30-3 to 30-9)	21.08%	146d	30-Mar-22 A	30-Sep-22	81d	28-Jul-22	20-Dec-22						
A10500	WA2 Site office - off-site fabrication	83.41%	34d	17-Jan-22 A	30-Sep-22	67d	11-Nov-22	20-Dec-22						
WA3 Rock Crushing Plant Design, Procurement and Installation														
WA3 Rock Crushing Plant - Application of Specific Process License														
A21030	WA3 - Rock Crushing Plant - EPD grant Specific Process License	50%	24d	14-Apr-22 A	31-May-22	433d	15-Jul-23	07-Aug-23						
WA3 Rock Crushing Plant - Application of Variation of Environmental Permit (VEP)														
A20480	[Summary] VEP & Specified Process under APCO - Prepare and make application to EPD	86.14%	37d	20-Sep-21 A	13-Jun-22	457d	13-Sep-23	13-Sep-23						
A21120	WA3 - Rock Crushing Plant - VEP - liaison with EPD & update information of AQIA to ERR	100%	0d	18-Dec-21 A	11-May-22 A									
A21130	WA3 - Rock Crushing Plant - VEP - submit Form 5 to EPD	0%	30d	08-May-22	06-Jun-22	457d	08-Aug-23	06-Sep-23						
A21140	WA3 - Rock Crushing Plant - VEP - EPD grant VEP	0%	7d	07-Jun-22	13-Jun-22	457d	07-Sep-23	13-Sep-23						
WA3 Rock Crushing Plant - Procurement														
A21050	WA3 - Rock Crushing Plant - plant procurement & delivery	98.21%	2d	15-Dec-21 A	11-May-22	345d	13-Jul-23	14-Jul-23						
WA3 Rock Crushing Plan - Installation of Rock Crushing Plant														
A21055	WA3 handed over to DEVB from 15-3 to 31-7	30.89%	85d	31-Mar-22 A	31-Jul-22	348d	21-Apr-23	14-Jul-23						
Temporary Explosive Magazine														

Activity ID	Activity Name	Duration % Complete	Remaining Duration	Start	Finish	Total Float	Late Start	Late Finish	2022				
									Apr	May	Jun	Jul	Aug
General													
A18470	Temp Explosive Mag. - Submit information of Explosive Delivery Vehicle (EVD) and drivers	45.16%	17d	21-Apr-22 A	28-May-22	7d	18-May-22	07-Jun-22					
A18520	Temp Explosive Mag. - EVD and drivers approval by mines dept.	0%	28d	29-May-22	25-Jun-22	10d	08-Jun-22	05-Jul-22					
Temporary Explosive Magazine													
A18290	Temp Explosive Mag. - Construct Berm around stores	69.62%	24d	28-Feb-22 A	07-Jun-22	0d	10-May-22	07-Jun-22					
A18300	Temp Explosive Mag. - Lightning conductor	26.92%	19d	29-Apr-22 A	31-May-22	5d	16-May-22	07-Jun-22					
A18330	Temp Explosive Mag. - Security fence	0%	12d	24-May-22	07-Jun-22	0d	24-May-22	07-Jun-22					
A18360	Temp Explosive Mag. - BS installation and FS installation	48.94%	24d	07-Apr-22 A	07-Jun-22	0d	10-May-22	07-Jun-22					
A18370	Temp Explosive Mag. - Statutory approval for Mode A Store Licence	0%	28d	08-Jun-22	05-Jul-22	0d	08-Jun-22	05-Jul-22					
Main Portal Area and Main Access Tunnel (MAT, MATE, MATW)													
Provision of P2 Access and P4 Access													
Construction of P2 Access													
A10140	P2 access - construct Ingress and egress	0%	45d	23-May-22	15-Jul-22	1299d	23-Oct-26	14-Dec-26					
A10150	P2 access - connection to Ma On Shan Road	0%	18d	16-Jul-22	05-Aug-22	1299d	15-Dec-26	07-Jan-27					
Construction of P4 Access													
A10180	P4 access - construct egress	81.36%	11d	08-Mar-22 A	21-May-22	174d	06-Dec-22	17-Dec-22					
Main Portal Area - Site Formation for Main Portal													
Main Portal Area - Instrumentation and Monitoring													
A11620	Main Portion West include RMP7 - Settlement marker	0%	18d	10-May-22	30-May-22	212d	30-Jan-23	18-Feb-23					
Main Portal Area - Retaining Wall RMP7													
A10585	Fill access road for RMP7 and SMP5	0%	90d	18-Jun-22*	05-Oct-22	108d	27-Oct-22	18-Feb-23					
Effluent Pipelines and Connection Chamber													
Effluent Pipeline - ELS construction													
A17245	Effluent Pipe - MD(Ch100 - 123) - MAT Junction 4 blasting works complete	0%	0d		10-May-22	175d		06-Dec-22	10-May-22	◆ Effluent Pipe - MD(Ch100 - 123) - MAT Junction 4 blasting works complete			
A17250	Effluent Pipe - Temp Works and ELS for TBM no.1 construction	0%	60d	15-Jun-22	24-Aug-22	90d	03-Oct-22	12-Dec-22					
Effluent Pipeline - Chamber Retaining Wall RWC2													
A10400	Effluent Pipe - Connection Chamber RWC2 - Excavation for RWC2	0%	6d	16-Jul-22	22-Jul-22	94d	08-Nov-22	14-Nov-22					
A10410	Effluent Pipe - Connection Chamber RWC2 - Footing & wal for RWC2	0%	24d	23-Jul-22	19-Aug-22	94d	15-Nov-22	12-Dec-22					
A10420	ELS works for RWC2 - Soil nails	0%	26d	15-Jun-22	15-Jul-22	95d	08-Oct-22	07-Nov-22					
Effluent Pipeline - TBM Tunneling and Pipe Jacking													
A17263	Effluent Pipe - MD(Ch123 - 213) localize benching blasting for retrieval of TBM near MD/BD4 junction 4 completed	0%	5d	12-May-22	17-May-22	173d	07-Dec-22	12-Dec-22					
Secondary Portal Area and Secondary Access Tunnel (SAT)													
Secondary Portal Area - Site Formation & Landscaping for Secondary Portal													
Secondary Portal Area - Boulder Survey and Stabilization Works													
A20272	SAT - Boulder - Remove hazardous boulders	100%	0d	30-Dec-21 A	07-May-22 A								
Secondary Portal Area - Slope SSP1 - Portal Slope Excavation													

Activity ID	Activity Name	Duration % Complete	Remaining Duration	Start	Finish	Total Float	Late Start	Late Finish	2022					
									Apr	May	Jun	Jul	Aug	
A11105	Slope SSP1 - Portal Slope Excavation	100%	0d	31-Dec-21 A	07-May-22 A									
A11130	Slope SSP1 - Secondary Tunnel ready to start	100%	0d	07-May-22 A										
Secondary Portal Area - Rigid Barrier RB1														
A11390	Rigid Barrier RB1 - Excavation (100.5- 97.5mpd) - RB1	0%	6d	10-May-22	16-May-22	42d	29-Jun-22	06-Jul-22						
A11400	Rigid Barrier RB1 - Soil Nail at 100.5mpd (F1-23)- 23nos - RB1	0%	12d	17-May-22	30-May-22	42d	07-Jul-22	20-Jul-22						
A11410	Rigid Barrier RB1 - Soil Nail at 99.5mpd (E1-24)- 24nos - RB1	0%	12d	31-May-22	14-Jun-22	42d	21-Jul-22	03-Aug-22						
A11420	Rigid Barrier RB1 - Soil Nail at 98.5mpd (D1-23)- 23nos - RB1	0%	12d	15-Jun-22	28-Jun-22	42d	04-Aug-22	17-Aug-22						
A11430	Rigid Barrier RB1 - Excavation (97.5- 95.5mpd) - RB1	0%	6d	29-Jun-22	06-Jul-22	42d	18-Aug-22	24-Aug-22						
A11440	Rigid Barrier RB1 - Soil Nail at 97.5mpd (C1-24)- 24nos - RB1	0%	12d	07-Jul-22	20-Jul-22	42d	25-Aug-22	07-Sep-22						
A11450	Rigid Barrier RB1 - Soil Nail at 96.5mpd (B1-23)- 23nos - RB1	0%	12d	21-Jul-22	03-Aug-22	42d	08-Sep-22	23-Sep-22						
Secondary Portal Area - Flexible Barrier														
Secondary Portal Area - Flexible Barrier - Design & Procurement														
A11550	Flexible Barrier - Material procurement & testing	36.11%	23d	22-Apr-22 A	06-Jun-22	83d	17-Aug-22	14-Sep-22						
Secondary Portal Area - Flexible Barrier - Construction and Installation														
A11560	[Summary] Flexible Barrier - Flexible Barrier installation	0%	168d	07-Jun-22	24-Dec-22	84d	15-Sep-22	17-Apr-23						
A11560-005	Site clearance	40.63%	19d	22-Apr-22 A	31-May-22	88d	23-Aug-22	14-Sep-22						
A11560-010	Flexible Barrier - plant mobilization	0%	3d	07-Jun-22	09-Jun-22	83d	15-Sep-22	17-Sep-22						
A11560-020	Flexible Barrier - setting out	0%	1d	10-Jun-22	10-Jun-22	83d	19-Sep-22	19-Sep-22						
A11560-030	Flexible Barrier - install wire rope anchor [11 nos. @2d/no]	0%	25d	11-Jun-22	11-Jul-22	83d	20-Sep-22	20-Oct-22						
A11560-040	Flexible Barrier - install post base plate anchors [28 nos. @4nos./d]	0%	8d	12-Jul-22	20-Jul-22	83d	21-Oct-22	29-Oct-22						
A11560-050	Flexible Barrier - pull out test and issue report	0%	31d	21-Jul-22	20-Aug-22	102d	31-Oct-22	30-Nov-22						
Secondary Portal Area - Soldier Pile Wall SP1														
A11200	Soldier Pile Wall SP1 - Prebored H-pile - Mobilization	0%	12d	29-Jun-22	13-Jul-22	45d	22-Aug-22	03-Sep-22						
A11210	Soldier Pile Wall SP1 - Prebored H-pile SP1-16 [16 nos.; 1 rig]	0%	48d	14-Jul-22	07-Sep-22	45d	05-Sep-22	03-Nov-22						
Secondary Access Tunnel (SAT)														
SAT - General Works														
A20130	SAT - Application of CNP	0%	52d	16-May-22	16-Jul-22	459d	02-Dec-23	03-Feb-24						
A20140	SAT - Temporary Power for Tunnel work	0%	45d	09-Jun-22	01-Aug-22	414d	03-Nov-23	27-Dec-23						
SAT - CBAR5 Blasting Permit														
A20050	SAT - CBAR5 - [Summary] Blasting Permit application	42.09%	194d	18-Dec-21 A	17-Nov-22	441d	01-Feb-24	01-Feb-24						
A20103	SAT - CBAR5 - response to PM's comments	66.67%	6d	26-Apr-22 A	13-May-22	137d	22-Sep-22	27-Sep-22						
A20105	SAT - CBAR5 - submit CBAR to GEO & Mines Division	0%	1d	14-May-22	14-May-22	137d	28-Sep-22	28-Sep-22						
A20110	SAT - CBAR5 - CBAR review by GEO & Mines Division	0%	28d	15-May-22	11-Jun-22	137d	29-Sep-22	26-Oct-22						

Activity ID	Activity Name	Duration % Complete	Remaining Duration	Start	Finish	Total Float	Late Start	Late Finish	2022				
									Apr	May	Jun	Jul	Aug
									A20120	SAT - CBAR5 - response to GEO & Mines comment via PM	0%	17d	12-Jun-22
A20122	SAT - CBAR5 - GEO & Mines approve CBAR	0%	0d		28-Jun-22	208d		22-Jan-23					
SAT - CBAR5 Blasting Method Statement													
A20060	SAT - CBAR5 - BMS - prepare and submit to PM	0%	21d	12-Jun-22	02-Jul-22	137d	27-Oct-22	16-Nov-22					
A22980	SAT - CBAR5 - BMS - PM review and comment	0%	14d	03-Jul-22	16-Jul-22	137d	17-Nov-22	30-Nov-22					
A22990	SAT - CBAR5 - BMS - response to PM's comments	0%	15d	17-Jul-22	31-Jul-22	137d	01-Dec-22	15-Dec-22					
SAT - CBAR5 Tunnel Temporary Works Design													
A22970	SAT - CBAR5 - Tunnel Temp Work Design - response to PM's comments and PM's accept	100%	0d	07-Apr-22 A	05-May-22 A								
SAT - CBAR5 Blast Door Design and Installation													
A20070	SAT - CBAR5 - Blast Door Design preparation & submission	97.56%	8d	01-Apr-21 A	18-May-22	422d	13-Oct-23	21-Oct-23					
A20080	SAT - CBAR5 - Blast Door Design review and accept by PM	0%	21d	19-May-22	13-Jun-22	422d	24-Oct-23	16-Nov-23					
A20082	SAT - CBAR5 - Blast Door fabrication	0%	14d	14-Jun-22	29-Jun-22	422d	17-Nov-23	02-Dec-23					
SAT - Instrumentation and Monitoring													
A11600	SAT - Vibration monitoring station installation (Portion 10) [8 nos.]	100%	0d	28-Dec-21 A	07-May-22 A								
SAT - Soft Ground Excavation (Drill & Break)													
SAT - Design & Fabrication of Steel Arch													
A11704	SAT - Design approval of steel arch for soft ground excavation	82.41%	19d	08-Feb-22 A	26-May-22	1717d	19-Jan-27	06-Feb-27					
SAT - Excavation (Ch140 - Ch144)													
A11710	SAT - Mobilization (Site set up)	33.33%	2d	07-May-22 A	11-May-22	259d	25-Mar-23	27-Mar-23					
A11715	SAT - Probing and PEG (7nos.0m)	0%	2d	12-May-22	13-May-22	260d	28-Mar-23	29-Mar-23					
A11720	SAT - Long Canopy Tube (Ch140 - 144)	0%	2d	14-May-22	16-May-22	259d	30-Mar-23	31-Mar-23					
A11730	SAT - Tunnel excavation (Ch140 - 144)	0%	10d	17-May-22	27-May-22	259d	01-Apr-23	17-Apr-23					
A11740	SAT - Steel rib & Shortcrete installation (Ch140 - 144)	0%	10d	18-May-22	28-May-22	259d	03-Apr-23	18-Apr-23					
SAT - Excavation (Ch144 - Ch148)													
A11750	SAT - Probing and PEG (4nos.,30m)	0%	1d	30-May-22	30-May-22	259d	19-Apr-23	19-Apr-23					
A11760	SAT - Long Canopy Tube (Ch144 - 148)	0%	2d	31-May-22	01-Jun-22	259d	20-Apr-23	21-Apr-23					
A11770	SAT - Tunnel excavation (Ch144 - 148)	0%	10d	02-Jun-22	14-Jun-22	259d	22-Apr-23	04-May-23					
A11780	SAT - Steel rib & Shortcrete installation (Ch144 - 148)	0%	10d	04-Jun-22	15-Jun-22	259d	24-Apr-23	05-May-23					
SAT - Excavation (Ch148 - Ch152)													
A11790	SAT - Long Canopy Tube (Ch148 - 152)	0%	2d	16-Jun-22	17-Jun-22	259d	06-May-23	08-May-23					
A11800	SAT - Tunnel excavation (Ch148 - 152)	0%	10d	18-Jun-22	29-Jun-22	259d	09-May-23	19-May-23					
A11810	SAT - Steel rib & Shortcrete installation (Ch148 - 152)	0%	10d	20-Jun-22	30-Jun-22	259d	10-May-23	20-May-23					
SAT - Excavation (Ch152 - Ch156)													
A11820	SAT - Long Canopy Tube (Ch152 - 156)	0%	2d	02-Jul-22	04-Jul-22	259d	22-May-23	23-May-23					

Activity ID	Activity Name	Duration % Complete	Remaining Duration	Start	Finish	Total Float	Late Start	Late Finish	2022					
									Apr	May	Jun	Jul	Aug	
A11830	SAT - Tunnel excavation (Ch152 - 156)	0%	10d	05-Jul-22	15-Jul-22	259d	24-May-23	05-Jun-23						
A11840	SAT - Steel rib & Shortcrete installation (Ch152 - 156)	0%	10d	06-Jul-22	16-Jul-22	259d	25-May-23	06-Jun-23						
SAT - Excavation (Ch156 - Ch160)														
A11850	SAT - Long Canopy Tube (Ch156 -160)	0%	2d	18-Jul-22	19-Jul-22	259d	07-Jun-23	08-Jun-23						
A11860	SAT - Tunnel excavation (Ch156 -160)	0%	10d	20-Jul-22	30-Jul-22	259d	09-Jun-23	20-Jun-23						
A11870	SAT - Steel rib & Shortcrete installation (Ch156 -160)	0%	10d	21-Jul-22	01-Aug-22	259d	10-Jun-23	21-Jun-23						
Cavern Complex														
Cavern Complex - Preparation Works														
Cavern Complex - Conveyor Belt System														
A12610	Prepare detail method statement for Conveyor belt system erection	0%	30d	10-May-22	14-Jun-22	322d	13-Jun-23	19-Jul-23						
A12620	PM approval	0%	21d	15-Jun-22	09-Jul-22	322d	20-Jul-23	12-Aug-23						
A12640	Submit application and obtain consent from HyD, TD consent for bridge over across Mui Tsz Lam road	0%	180d	15-Jun-22	18-Jan-23	322d	20-Jul-23	28-Feb-24						
A12645	Submit application and obtain consent from EPD	0%	90d	15-Jun-22	29-Sep-22	412d	06-Nov-23	28-Feb-24						
A12650	Submit application and obtain consent from MTRC	0%	180d	15-Jun-22	18-Jan-23	322d	20-Jul-23	28-Feb-24						
A12655	Submit application and obtain consent from DSD for Sea wall modification	0%	180d	15-Jun-22	18-Jan-23	322d	20-Jul-23	28-Feb-24						
A12660	Coordinate with Utility company for cable diversion under MOS rail	0%	60d	15-Jun-22	24-Aug-22	442d	11-Dec-23	28-Feb-24						
Cavern Complex - CBAR2 Blasting Permit														
A21350	==== CBAR2 - Summary of Blasting Permit Application =====	74.59%	46d	08-Nov-21 A	04-Jul-22	65d	20-Sep-22	20-Sep-22						
A21366	CBAR2 Blasting Permit - close out comments from GEO & Mines	69.81%	16d	21-Mar-22 A	27-May-22	83d	17-Aug-22	03-Sep-22						
A21370	CBAR2 Blasting Permit - pre-licencing inspection, preparation and issue Permit	0%	14d	17-Jun-22	30-Jun-22	80d	05-Sep-22	18-Sep-22						
A21380	CBAR2 Blasting Permit - order explosive (2 days before blasting)	0%	2d	02-Jul-22	04-Jul-22	65d	19-Sep-22	20-Sep-22						
Cavern Complex - CBAR2 Blasting Method Statement														
A21390	[TG] CBAR2 - Summary of Blasting Method Statement (BMS) Submission and approval	63.96%	40d	18-Feb-22 A	16-Jun-22	80d	04-Sep-22	04-Sep-22						
A21430	CBAR2 Blasting Method Statement (BMS) - Mines review BMS	10.34%	26d	27-Apr-22 A	02-Jun-22	80d	27-Jul-22	21-Aug-22						
A21440	CBAR2 Blasting Method Statement (BMS) - response Mines comments on BMS	0%	14d	03-Jun-22	16-Jun-22	80d	22-Aug-22	04-Sep-22						
Cavern Complex - CBAR2 Tunnel Temporary Works Design														
A24442	CBAR2 Tunnel Temporary Work Design (CBAR 2A) - response to PM's comments	100%	0d	17-Mar-22 A	05-May-22 A									
A24462	CBAR2 Tunnel Temporary Work Design (CBAR 2B) - PM review and comment	92.16%	4d	22-Mar-22 A	11-May-22	1732d	03-Feb-27	06-Feb-27						
A24472	CBAR2 Tunnel Temporary Work Design (CBAR 2B) - response to PM's comments	58.93%	23d	05-Apr-22 A	30-May-22	97d	13-Aug-22	04-Sep-22						
Cavern Complex - Temporary Ventilation System														
Cavern Complex - Temp Ventilation (For Stages after CBAR1)														
A20210	Cavern Complex - Temp tunnel ventilation design (Stage 2) approval	40%	9d	30-Apr-22 A	19-May-22	1327d	12-Nov-26	21-Nov-26						
A20220	Cavern Complex - Temp tunnel ventilation facilities procurement (Stage 2)	0%	32d	20-May-22	27-Jun-22	1327d	23-Nov-26	31-Dec-26						

Activity ID	Activity Name	Duration % Complete	Remaining Duration	Start	Finish	Total Float	Late Start	Late Finish	2022					
									Apr	May	Jun	Jul	Aug	
A20230	Cavern Complex - Temp tunnel ventilation and Temp fire & smoke extraction system (Stage 2) installation	0%	30d	28-Jun-22	02-Aug-22	1327d	02-Jan-27	05-Feb-27						
Cavern Complex - Fully Enclosure to Tunnel Entrance														
A12590	Erect Fully Enclosed Stockpile Area Structural works	0%	90d	10-May-22	24-Aug-22	207d	17-Jan-23	13-May-23						
Construction Adit - for Commencement of CAV3														
Construction Adit - Hard Rock Excavation (Drill & Blast)														
P12440	Construction Adit - Completion of 1st 200m & cross cut - Approx. 46 nos. Blasts - for Commencement of CAV3	0%	0d		09-Jul-22	60d		20-Sep-22						09-Jul-22 ◆ Construction Adit - Com
P12450	Construction Adit - CA200, 20 nos. Blasts, Full Face@5.5m Pull length	43.75%	27d	09-Apr-22 A	10-Jun-22	61d	22-Jul-22	22-Aug-22						
PA13050	Cross cut from CA to BD4 at Cav 3, 8 blast	0%	24d	11-Jun-22	09-Jul-22	61d	23-Aug-22	20-Sep-22						
PA13060	Cross cut from CA to BD4 at Cav 2, 4 blast	0%	7d	16-May-22	23-May-22	125d	14-Oct-22	21-Oct-22						
PA13105	Construction Adit - Permanent Support - Bolt and spray concrete	54.87%	51d	19-Feb-22 A	09-Jul-22	60d	21-Jul-22	20-Sep-22						
Main Access Tunnel, MAT (ch288 - 297)														
MAT - Hard Rock Excavation (Drill & Blast) - Top Heading														
PA14400	MAT - Top Permanent Support - (R103, Ch288 - 297) - Bolt and spray concrete [8m]	64.52%	44d	22-Jan-22 A	30-Jun-22	1032d	11-Nov-25	03-Jan-26						
Main Driveway MD														
Main Driveway MD - Zone 1 (ch123 - 213)														
MD - Zone 1 - Hard Rock Excavation (Drill & Blast) - Top Heading														
P10330	MD - Zone 1 - Top Heading - (R105, Ch122.9 to 149.9) - 27m, 9 nos. Blasts @3m Pull length, 672m3 each	88.89%	2d	22-Apr-22 A	11-May-22	105d	14-Sep-22	15-Sep-22						
P10340	MD - Zone 1 - Top Heading - (R105, Ch149.9 to 155.0) - 5.1m, 1 no. Blast @5.5m Pull length, 1210m3 each	0%	3d	12-May-22	14-May-22	105d	16-Sep-22	19-Sep-22						
P10350	MD - Zone 1 - Top Heading - (R105, Ch155.0 to 180.0) - 25m, 5 nos. Blasts @5.5m Pull length, 1210m3 each	0%	15d	16-May-22	01-Jun-22	105d	20-Sep-22	08-Oct-22						
P10360	MD - Zone 1 - Top Heading - (R105, Ch180.0 to 200.6) - 20.6m, 4 nos. Blasts @5.5m Pull length, 1210m3 each	0%	9d	02-Jun-22	13-Jun-22	105d	10-Oct-22	19-Oct-22						
P10364	MD - Zone 1 - Top Heading - (R105, Ch200.6 to 213.6) - 13m, 4 nos. Blasts @5.5m Pull length 1210m3 each	0%	12d	14-Jun-22	27-Jun-22	105d	20-Oct-22	02-Nov-22						
P12350	MD - Junction 3 - Top Heading - (BD3, Ch100.0 to 124.0), 24m, 4 nos. Blasts @5.5m Pull length, 808m3 each	0%	6d	28-Jun-22	05-Jul-22	105d	03-Nov-22	09-Nov-22						
P14250	Completion of 20 nos. of Trials Blasts at MAT & MD	0%	0d		11-May-22	105d		15-Sep-22						11-May-22 ◆ Completion of 20 nos. of Trials Blasts at MAT & MD
PA14500	MD - Zone 1 - Top Permanent Support - (MD, ch123 - 213) - Bolt and spray concrete [114.7m]	17.81%	60d	22-Apr-22 A	20-Jul-22	1016d	22-Oct-25	03-Jan-26						
Main Driveway MD - Zone 2 (ch226 - 392)														
MD - Zone 2 - Hard Rock Excavation (Drill & Blast) - Top Heading														
P12370	MD - Zone 2 - Top Heading - (R105, Ch226.5 to 239.0) - 12.5m, 4 nos. Blasts @5.5m Pull length, 1059m3 each	0%	6d	06-Jul-22	12-Jul-22	105d	10-Nov-22	16-Nov-22						
P12380	MD - Zone 2 - Top Heading - (R105, Ch239.0 to 379.3) - 140.4m, 26 nos. Blasts @5.5m Pull length, 1059m3 each	0%	74d	13-Jul-22	11-Oct-22	115d	29-Nov-22	04-Mar-23						
P12380-05	MD - Zone 2 - Top Heading - (R105, Ch239 to 277) - 38m, 7 nos of blast @5.5m Pull length, 1059m3 each	0%	17d	13-Jul-22	01-Aug-22	115d	29-Nov-22	17-Dec-22						
PA14520	[Summary] MD - Zone 2 - Top Permanent Support - (MD, ch226 - 392, 166m) - Bolt and spray concrete	0%	146d	06-Jul-22	29-Dec-22	105d	10-Nov-22	15-May-23						
PA14520-10	MD - Zone 2 - Top Permanent Support - (MD, ch226 - 281, 55m) - Bolt and spray concrete [55m]	0%	49d	06-Jul-22	31-Aug-22	105d	10-Nov-22	09-Jan-23						
Branch Driveway BD4														
BD4 - Hard Rock Excavation (Drill & Blast) - Top Heading														
P12500	BD4 - MD Completion up to Ch180 - for Commencement of BD4	0%	0d		08-Jun-22	166d		24-Dec-22						08-Jun-22 ◆ BD4 - MD Completion up to Ch180 - for Commenc

Activity ID	Activity Name	Duration % Complete	Remaining Duration	Start	Finish	Total Float	Late Start	Late Finish	2022					
									Apr	May	Jun	Jul	Aug	
P12502	BD4 - Top Heading - Form Construction Adit through BD4 [8 nos. Blasts@3m Pull length]	0%	24d	11-Jul-22	06-Aug-22	1323d	09-Jan-27	05-Feb-27						
P12520	BD4 - Top Heading - (Ch220 to 150) - 70m, 13 nos. Blasts @5.5m Pull Length, 616m3 each	0%	55d	24-May-22	28-Jul-22	124d	22-Oct-22	24-Dec-22						
P13180	BD4 - Complete Ch205 -220 for Commencement of CAV2	0%	0d		28-Jul-22	191d		23-Mar-23						
PA14420	[Summary] BD4 - Top Permanent Support - Bolt and spray concrete	0%	188d	09-Jun-22	30-Jan-23	249d	17-Apr-23	29-Nov-23						
PA14420-10	BD4 - Top Permanent Support - Bolt and spray concrete (Part 1 of 3) [106m]	0%	63d	09-Jun-22	22-Aug-22	249d	17-Apr-23	03-Jul-23						
BD4 - Hard Rock Excavation (Drill & Blast) - Top Heading (1st Half)														
P12510	BD4 - Side Heading 1 - (Ch125.0 to 150.0) - 25.0m, 9 nos. Blasts @3m Pull Length, 539m each	0%	27d	29-Jul-22	29-Aug-22	124d	28-Dec-22	04-Feb-23						
Branch Driveway BD3														
BD3 - Hard Rock Excavation (Drill & Blast) - Top Heading														
PA14440	[Summary] BD3 - Top Permanent Support - Bolt and spray concrete	0%	192d	28-Jun-22	22-Feb-23	173d	01-Feb-23	21-Sep-23						
PA14440-10	BD3 - Top Permanent Support - Bolt and spray concrete (Part 1 of 3) [96.5m]	0%	64d	28-Jun-22	13-Sep-22	173d	01-Feb-23	20-Apr-23						
Cavern 2 - DAF2, MBBR2, PST2														
Cavern 2 - DAF2														
Cavern 2 - DAF2 - Hard Rock Excavation (Drill & Blast) - Top Heading														
PA14620	[Summary] CAV2 - DAF2 - Top Permanent Support - Bolt and spray concrete	0%	306d	29-Jul-22	14-Aug-23	191d	24-Mar-23	11-Apr-24						
PA14620-10	CAV2 - DAF2 - Top Permanent Support - Bolt and spray concrete (Part 1 of 5) [18m]	0%	73d	29-Jul-22	26-Oct-22	191d	24-Mar-23	24-Jun-23						
Cavern 2 - DAF2 - Hard Rock Excavation (Drill & Blast) - Top Heading (1st Half)														
P10520	CAV2 - DAF2 - Side Heading 1 - (DAF2, Ch190.2 to 177.2) - 13m, 4 nos. Blasts @5.5m Pull length, 912m3 each	0%	8d	29-Jul-22	06-Aug-22	191d	24-Mar-23	01-Apr-23						
Cavern 3 - ELC2, STC, ELC1														
Cavern 3 - ELC2														
Cavern 3 - ELC2 - Hard Rock Excavation (Drill & Blast) - Top Heading														
PA14680	[Summary] CAV3 - ELC2 - Top Permanent Support - Bolt and spray concrete	0%	274d	11-Jul-22	16-Jun-23	101d	10-Nov-22	17-Oct-23						
PA14680-10	CAV3 - ELC2 - Top Permanent Support - Bolt and spray concrete (Part 1 of 4) [22.6m]	0%	69d	11-Jul-22	30-Sep-22	101d	10-Nov-22	08-Feb-23						
Cavern 3 - ELC2 - Hard Rock Excavation (Drill & Blast) - Top Heading (1st Half)														
P12750	CAV3 - ELC2 - From Construction Adit through BD4 - Top Heading - 8 nos. Blasts @3m Pull length	0%	24d	11-Jul-22	06-Aug-22	60d	21-Sep-22	20-Oct-22						
Ventilation Shaft and Ventilation Adit														
Ventilation Shaft (VS)														
VS - CBAR3 Blasting Permit														
A18600	[Summary] VS - Blasting Permit License - review by Mines Department & issue Permit/license	43.75%	144d	13-Dec-21 A	31-Oct-22	117d	27-Mar-23	27-Mar-23						
VS - CBAR3 Blasting Method Statement														
A18580	[Summary] VS - CBAR3 Method statement for Blasting Works	64.81%	57d	21-Dec-21 A	16-Jul-22	102d	17-Nov-22	17-Nov-22						
A23092	VS - CBAR3 Blasting Method Statement (BMS) - PM review and comment	82.28%	14d	04-Mar-22 A	21-May-22	124d	09-Sep-22	22-Sep-22						
A23102	VS - CBAR3 Blasting Method Statement (BMS) - response to PM's comments	0%	14d	22-May-22	04-Jun-22	124d	23-Sep-22	06-Oct-22						
A23202	VS - CBAR3 Blasting Method Statement (BMS) - Formal submit BMS to Mines	0%	1d	05-Jun-22	05-Jun-22	124d	07-Oct-22	07-Oct-22						
A23302	VS - CBAR3 Blasting Method Statement (BMS) - Mines review BMS	0%	28d	05-Jun-22	02-Jul-22	124d	07-Oct-22	03-Nov-22						
A24402	VS - CBAR3 Blasting Method Statement (BMS) - close out Mines comments and Mines approve	0%	14d	03-Jul-22	16-Jul-22	124d	04-Nov-22	17-Nov-22						

Activity ID	Activity Name	Duration % Complete	Remaining Duration	Start	Finish	Total Float	Late Start	Late Finish	2022						
									Apr	May	Jun	Jul	Aug		
									VS - Instrumentation and Monitoring						
A18660	VS - Vibration monitoring station installation (Portion 11, 12)	0%	14d	04-Jul-22	19-Jul-22	102d	04-Nov-22	19-Nov-22							
VS - Construct Temporary R.C. Wall															
A24550	VS - Temp R.C. Wall - construct wall (2 pours)	86.75%	11d	07-Feb-22 A	21-May-22	175d	07-Dec-22	19-Dec-22							
A24560	VS - Temp R.C. Wall - backfill to protective enclosure footing founding level [3.5m thk @150mm/layer]	100%	0d	07-Mar-22 A	07-May-22 A										
VS - Erect Protective Enclosure															
A18564	VS - Protective Enclosure - construct footing	0%	24d	20-Jul-22	16-Aug-22	102d	21-Nov-22	17-Dec-22							
VS - Erect Blast Cover															
A24610	VS - Blast Cover - Fabrication	0%	48d	20-Jul-22	15-Sep-22	116d	07-Dec-22	10-Feb-23							