

Agreement No. CE 30/2018 (EP) Environmental Team for Kai Tak Sports Park – Design and Construction

Monthly EM&A Report for July 2021

August 2021

Home Affairs Bureau 1/F, Block A, Kai Tak Sports Park Site Office, Muk Tai Street, Kai Tak, Kowloon

Agreement No. CE 30/2018 (EP) Environmental Team for Kai Tak Sports Park – Design and Construction

Monthly EM&A Report for July 2021

August 2021





Environmental Permit No. EP-544/2017

Kai Tak Sports Park - Investigation

Independent Environmental Checker Verification

Reference Document/Plan

Document/Plan to be Certified/ Verified: Monthly EM&A Report No. 28 (July 2021)

Date of Report: August 2021

Date received by IEC: 10 August 2021

Reference EP Condition

Environmental Permit Condition: 3.4

Three hard copies and one electronic copy of the monthly EM&A Report shall be submitted to the Director within 10 working days after the end of each reporting month. The monthly EM&A Reports shall include a summary of all non-compliance with the recommendations in the approved EIA Report (Register No. AEIAR-204/2017) or this Permit. The submissions shall be certified by the ET Leader and verified by the IEC as complying with the requirements as set out in the EM&A Manual before submission to the Director. Additional copies of submission shall be provided upon request by the Director.

IEC Verification

I hereby verify that the above referenced document/plan complies with the above referenced condition of EP-544/2017.

Ms Mandy To

Mondy 20.

Date: 10 August 2021

Independent Environmental Checker

Our ref: 0500384_IEC Verification Cert_KTSP_Monthly EM&A Rpt No.28.docx





Environmental Permit No. EP-544/2017

Kai Tak Sports Park - Investigation

Environmental Team Leader Certification

Reference Document /Plan

Document/Plan to be Certified: Monthly EM&A Report for July 2021

Date of Report: August 2021

Date received by ETL: 10 August 2021

Reference EP Condition

Environmental Permit Condition: 3.4

Three hard copies and one electronic copy of the monthly EM&A Report shall be submitted to the Director within 10 working days after the end of each reporting month. The monthly EM&A Reports shall include a summary of all non-compliance with the recommendations in the approved EIA Report (Register No. AEIAR–204/2017) or this Permit. The submissions shall be certified by the ET Leader and verified by the IEC as complying with the requirements as set out in the EM&A Manual before submission to the Director. Additional copies of submission shall be provided upon request by the Director.

ETL Certification

I hereby certify that the above reference document complies with the above referenced condition of EP-544/2017.

Mr Sunny Chan

Sumy Chan

Environmental Team Leader Date: 10 August 2021

Contents

Exe	ecutive	e summary	1
1	Intro	oduction	3
	1.1	Background	3
	1.2	Project Organisation	4
	1.3	Works Area and Construction Programme	4
	1.4	Construction Works undertaken during the Reporting Period	5
2	Air (Quality Monitoring	6
	2.1	Introduction	6
	2.2	Monitoring Parameters, Frequency and Duration	6
	2.3	Monitoring Locations	6
	2.4	Monitoring Action and Limit Levels	6
	2.5	Monitoring Schedule for the Reporting Period	7
	2.6	Monitoring Equipment	7
	2.7	Monitoring Methodology	7
	2.8	Monitoring Results	8
	2.9	Wind Data	8
3	Nois	se Monitoring	9
	3.1	Introduction	9
	3.2	Monitoring Parameters, Frequency and Duration	9
	3.3	Monitoring Locations	9
	3.4	Action and Limit Levels	10
	3.5	Monitoring Schedule for the Reporting Period	10
	3.6	Monitoring Equipment	10
	3.7	Monitoring Methodology	10
	3.8	Monitoring Results	11
4	Env	ironmental Site and Audit	12
	4.1	Site Inspection	12
	4.2	Advice on the Solid and Liquid Waste Management Status	13
	4.3	Environmental Licenses and Permits	13
	4.4	Implementation Status of Environmental Mitigation Measures	13
	4.5	Summary of Exceedance of the Environmental Quality Performance Limit	13
	4.6	Summary of Complaints, Notification of Summons and Successful Prosecution	14
5	Futu	ıre Key Issues	15
	5.1	Construction Programme for the Coming Months	15

	5.2	Environmental Site Inspection and Monitoring Schedule for the Next Reporting Period	15
6	Conc	lusions	16
	6.1	Conclusions	16
<u>Figu</u>	<u>res</u>		
Figure	e 2.1: L	ocation of Air Quality Monitoring Stations	
Figure	e 3.1: L	ocation of Noise Monitoring Stations	
Ū		· ·	
Appe	endice	es e	
Appe	ndix A.	Project Organization for Environmental Works	
Appe	ndix B.	Location of Works Areas	
Appe	ndix C.	Construction Programme	
Appe	ndix D.	Event and Action Plan	
<u>Appe</u>	ndix E.	Environmental Site Inspection and Monitoring Schedule	
Appe	ndix F.	Calibration Certificates	
Appe	ndix G.	Monitoring Data and Graphical Plots (Air Quality and Noise)	
<u>Appe</u>	ndix H.	Wind Data	
Appe	ndix I.	Waste Flow Table	
<u>Appe</u>	ndix J.	Environmental Licences and Permits	
Appe	ndix K.	Environmental Mitigation Measures Implementation Status	
<u>Appe</u>	ndix L.	Statistics on Environmental Complaints, Notification of Summons and Successful Prosecutions	
Tabl	es		
Table	1.1: C	ontact Information of Key Personnel	4
		r Quality Monitoring Parameters, Frequency and Duration	6
		onstruction Dust Monitoring Locations	6
		ction and Limit Levels for 1-hour TSP	7
Table	2.4: 1-	hour TSP Monitoring Equipment	7
		ummary of 1-hour TSP Monitoring Results During the Reporting Period	8
Table	3.1: N	oise Monitoring Parameters, Frequency and Duration	9
Table	3.2: C	onstruction Noise Monitoring Locations	9
Table	3.3: A	ction and Limit Level for Construction Noise	10
Table	3.4: N	oise Monitoring Equipment	10
Table	3.5: Sı	ummary of Construction Noise Monitoring Results During the Reporting Period	11
Table	4.1: St	ummary of Site Inspections and Recommendations	12
Table	5.1: C	onstruction Activities for the Next Reporting Period	15
Table Table	D.2: E	vent and Action Plan for Construction Air Quality (Action Level) vent and Action Plan for Construction Air Quality (Limit Level) vent and Action Plan for Construction Noise ite Inspection and Monitoring Schedule for July 2021	

Mott MacDonald | Agreement No. CE 30/2018 (EP) Environmental Team for Kai Tak Sports Park – Design and Construction Monthly EM&A Report for July 2021

- Table E.2: Tentative Site Inspection and Monitoring Schedule for August 2021
- Table J.1: Summary of Environmental Licences and Permits Status (KTSP)
- Table J.2: Summary of Environmental Licences and Permits Status (H/O Development)
- Table L.1: Statistics on Environmental Complaints, Notifications of Summons and Successful Prosecutions

Executive summary

The Project – hereby meaning the Designated Project (Items O.6 and O.7 Part I, Schedule 2 of the Environmental Impact Assessment Ordinance (EIAO)), comprising the "Kai Tak Sports Park" (KTSP) project and the Hotel and Office (H/O) Development of NKIL 6607 adjoining the KTSP – is located in the Kai Tak Development (KTD) area in Kowloon.

An EIA Report for the Project (Register No. AEIAR-204/2017) was approved by the Environmental Protection Department (EPD) on 6 January 2017. The current Environmental Permit (EP) for the Project, namely No. EP-544/2017, was issued on 8 September 2017. These documents are available through the EIA Ordinance Register. The Project construction works commenced on 8 April 2019.

In February 2019, Mott MacDonald Hong Kong Limited was appointed by the Home Affairs Bureau (HAB) as the Environmental Team (ET) to implement the Environmental Monitoring & Audit (EM&A) programme for the construction phase and first year of operation of the Project in accordance with the approved EM&A Manual.

This is the 28th Monthly EM&A Report for the construction phase of the Project which summaries findings of the EM&A programme during the reporting period from 1 to 31 July 2021.

Key Construction Works in the Reporting Period

A summary of construction activities undertaken during the reporting period is presented below:

KTSP

- Ground investigation works;
- Rebar fixing;
- Piling works (Percussive piling, Socket H piling and Bored piling);
- Mobilization; and
- Concreting and excavation.

H/O Development

Excavation.

Environmental Monitoring and Audit Progress

The monthly EM&A programme was undertaken by ET in accordance with the approved EM&A Manual. A summary of the monitoring activities during the reporting period is presented below:

Activity	Monitoring Locations	Date
Air Quality Monitoring (1-hour TSP)	AMS1, AMS2	2, 8, 14, 20, 26, 30 Jul 2021
Noise Monitoring (L _{eq (30 min)})	NMS1, NMS2	2, 8, 14, 20, 26 Jul 2021
Weekly environmental site inspections	-	7, 14, 21, 27 Jul 2021
Landscape and visual site inspections	-	7, 21 Jul 2021

Breaches of Action and Limit Levels

Air Quality

There was no breach of Action or Limit Levels for Air Quality (1-hr TSP) during the reporting month.

Noise

There was no breach of Action or Limit Levels for noise level during the reporting month.

Complaint Log

There was no complaint in relation to the environmental impact received during the reporting month.

Notifications of Summons and Successful Prosecutions

There were no notifications of summons or prosecutions received during this reporting period.

Reporting Changes

There was no reporting change during the reporting period.

Future Key Issues

The future key issues to be undertaken in the upcoming month are:

KTSP

- Ground investigation works;
- Rebar fixing;
- Piling works (Percussive piling, Socket H piling and Bored piling);
- Mobilization and lifting; and
- Concreting and excavation.

H/O Development

Excavation.

1 Introduction

1.1 Background

The Project – hereby meaning the Designated Project (Items O.6 and O.7 Part I, Schedule 2 of the Environmental Impact Assessment Ordinance (EIAO)), comprising the "Kai Tak Sports Park" (KTSP) project and the Hotel and Office (H/O) Development of NKIL 6607 adjoining the KTSP – is located in the Kai Tak Development (KTD) area in Kowloon.

The key construction works of the Project include:

(i) KTSP project

- a. a multi-purpose Main Stadium with a spectator capacity of around 50,000;
- b. a Public Sports Ground, with a spectator capacity of around 5,000;
- c. an Indoor Sports Centre with a multi-purpose main arena with a seating capacity of up to 10,000 and an ancillary sports hall with a seating capacity of 500;
- d. retail and dining outlets with a gross floor area (GFA) of about 57,000 square metres (m²), a bowling centre with 40 lanes and a health and wellness centre with about 2,500 m² GFA;
- e. more than 8 hectares of public open space including landscaped deck structures across Shing Kai Road, passive amenities and park features, outdoor ball courts; and
- f. ancillary facilities such as car parks, toilets, changing rooms, etc.

(ii) H/O Development

- g. an office development;
- h. a 300-room hotel with a GFA of about 16,000 m²; and
- i. ancillary facilities such as retails, car parks, etc.

In February 2019, Mott MacDonald Hong Kong Limited (MMHK) was commissioned by the Home Affairs Bureau (HAB) under Agreement No. CE 30/2018 (EP) to undertake the Environmental Team (ET) services for carrying out the Environmental Monitoring & Audit (EM&A) programme during the construction phase and first year of operation of the Project in accordance with the approved Environmental Impact Assessment (EIA) Report (Register No.: AEIAR-204/2017), EM&A Manual (including any subsequent amendments) and EP (including any subsequent variations of it and/or any further environmental permit issued under the EIAO). The current EP (No. EP-544/2017) was issued by EPD on 8 September 2017.

This is the 28th Monthly EM&A Report summarising the key findings of the construction phase EM&A programme from 1 to 31 July 2021 (the "reporting period") and is submitted to fulfil Condition 3.4 of the EP.

1.2 Project Organisation

The organisation chart and lines of communication with respect to the on-site environmental management structure of the key personnel are shown in **Appendix A**. The key personnel contact names and numbers are summarized in **Table 1.1**.

Table 1.1: Contact Information of Key Personnel

Party	Position	Name	Telephone	Fax
Project Proponent (Home Affairs Bureau)	Project Director (Sports Park)	Edwin Wong	3586 3403	3586 0591
Supervising Officer's Representative (Home Affairs Bureau)	Senior Engineer	Keith Man	3586 3149	3586 0591
Environmental Team	Environmental Team Leader	Sunny Chan	2828 5962	2827 1823
(Mott MacDonald Hong Kong Limited)	Deputy Environmental Team Leader	Henry Leung	2828 5876	2827 1823
Independent Environmental Checker (ERM Hong Kong Limited)	Independent Environmental Checker	Mandy To	2271 3000	2723 5660
Contracted Party (Kai Tak Sports	Senior Project Manager	Michael Wong	3552 5003	2845 9295
Park Limited)	Senior Environmental Engineer	Hiko Law	3552 5013	3552 5099
Hotel and Office De	velopment			
Project Manager (Sanon Limited)	Senior Group Project Director	David Lee	2910 8368	2815 9949
	Project Manager	William Chan	2910 8363	2815 9949
Project Architect (P&T Architects & Engineers Limited)	Project Architect	Patrick Chan	2832 7205	-
Contractor (CR Construction Company Limited)	Contractor	Math Chan	3950 5714	-
24-hour Community Liaison Hotline	-	-	5587 6112	-

1.3 Works Area and Construction Programme

The construction works commenced on 8 April 2019. The works area of the Project is shown in **Appendix B**. The Construction Works Programme of the Project is provided in **Appendix C**.

1.4 Construction Works undertaken during the Reporting Period

A summary of construction activities undertaken during this reporting period is presented below:

KTSP

- Ground investigation works;
- Rebar fixing;
- Piling works (Percussive piling, Socket H piling and Bored piling);
- Mobilization; and
- Concreting and excavation.

H/O Development

Excavation.

2 Air Quality Monitoring

2.1 Introduction

In accordance with the EM&A Manual of the Project, baseline 1-hour Total Suspended Particulates (TSP) levels at air quality monitoring stations AMS1 and AMS2 were established. Impact 1-hour TSP monitoring was conducted for at least three times every 6 days.

2.2 Monitoring Parameters, Frequency and Duration

Table 2.1 summarises the monitoring parameters, frequency and duration of impact noise monitoring.

Table 2.1: Air Quality Monitoring Parameters, Frequency and Duration

Parameter	Frequency and Duration
1-hour TSP	3 times every six-days

2.3 Monitoring Locations

According to the EM&A Manual, a total of five air quality monitoring stations are identified for impact monitoring. Of these, three air sensitive receivers are planned residential use and were not available for baseline monitoring; the same three are also currently not available for impact monitoring.

Table 2.2 describes the impact air quality monitoring stations and <u>Figure 2.1</u> shows their locations.

Table 2.2: Construction Dust Monitoring Locations

Monitoring Station	Location	Status
AMS1	Hong Kong Society for the Blind Workshop, Roof Floor	Existing Air Sensitive Receiver
AMS2	Sky Tower, Podium of Tower 7	Existing Air Sensitive Receiver
AMS3	Kai Tak Area 2B Site 4 (2B4) (residential use)	Planned Air Sensitive Receiver
AMS4	Kai Tak Area 1K Site 3 (1K3) (residential use)	Planned Air Sensitive Receiver
AMS5	Kai Tak Area 1L Site 3 (1L3) (residential use)	Planned Air Sensitive Receiver

During the reporting period, monitoring locations AMS1 and AMS2 were set up at the proposed locations for impact monitoring.

Permission on setting up and carrying out impact monitoring works at AMS3, AMS4 and AMS5 will be sought once each respective development is completed and occupied.

2.4 Monitoring Action and Limit Levels

The Action and Limit Levels for 1-hr TSP are provided in Table 2.3.

Table 2.3: Action and Limit Levels for 1-hour TSP

Monitoring Station	Action Level, μg/m³	Limit Level, µg/m³
AMS1 – Hong Kong Society for the Blind Workshop, Roof Floor	283	500
AMS2 – Sky Tower, Podium of Tower 7	280	500
AMS3 - Kai Tak Area 2B Site 4 (2B4) (residential use)	287*	500
AMS4 - Kai Tak Area 1K Site 3 (1K3) (residential use)	287*	500
AMS5 - Kai Tak Area 1L Site 3 (1L3) (residential use)	287*	500

^{*}Remarks: the Action Level for AMS3, AMS4 and AMS5 were derived from an alternative monitoring station AMS3-4-5 during the baseline monitoring.

The event and action plan is provided in **Appendix D**.

If exceedance(s) at these stations is/are recorded by the ET of the Project, it will carry out an investigation and findings will be reported in the monthly EM&A Report.

2.5 Monitoring Schedule for the Reporting Period

The schedule for air quality monitoring at AMS1 and AMS2 in the reporting period is presented in **Appendix E**.

2.6 Monitoring Equipment

Portable direct reading dust meters were used to carry out the 1-hour TSP monitoring. The brand(s) and model(s) of the equipment used for air quality monitoring stations AMS1 and AMS2 under this Project are given in **Table 2.4**.

Table 2.4: 1-hour TSP Monitoring Equipment

Equipment	Brand	Model No.
Portable direct reading dust meter	Sibata Digital Dust Monitor	LD-3B (S/N: 245833, 276015)

2.7 Monitoring Methodology

Field Monitoring

The measuring procedures of the 1-hour TSP dust meter are in accordance with the Manufacturer's Instruction Manual as follows:

- Turn the power on.
- Close the air collecting opening cover.
- Push the "TIME SETTING" switch to [BG].
- Push "START/STOP" switch to perform background measurement for 6 seconds.
- Turn the knob at SENSI ADJ position to insert the light scattering plate.
- Leave the equipment for 1 minute upon "SPAN CHECK" is indicated in the display.
- Push "START/STOP" switch to perform automatic sensitivity adjustment. This measurement takes 1 minute.
- Pull out the knob and return it to MEASURE position.
- Setting time period of 1 hour for the 1-hour TSP measurement.

- Push "START/STOP" to start the 1-hour TSP measurement.
- Regular checking of the time period setting to ensure monitoring time of 1 hour.

Maintenance and Calibration

- The 1-hour dust meter would be checked at 3-month intervals and calibrated at 1-year intervals throughout all stages of the air quality monitoring.
- Calibration records for direct dust meters are given in Appendix F.

2.8 Monitoring Results

The monitoring results for 1-hour TSP at AMS1 and AMS2 are summarized in **Table 2.5**. Detailed impact air quality monitoring results are presented in **Appendix G**.

Table 2.5: Summary of 1-hour TSP Monitoring Results During the Reporting Period

Monitoring Station	Average, µg/m³	Min, μg/m³	Max, μg/m³	Action Level, μg/m³	Limit Level, μg/m³
AMS1	52	27	72	283	500
AMS2	51	29	71	280	500

There was no Action and Limit Level exceedance of 1-hr TSP level recorded at station AMS1, and AMS2 by the ET during the reporting period.

2.9 Wind Data

Wind data at Kai Tak automatic weather station collected from the Hong Kong Observatory (HKO) were used for the air quality monitoring and they are shown in **Appendix H**. It is considered that the wind data obtained at the existing Kai Tak wind station are representative of the Project area and could be used for undertaking the construction phase baseline and impact air quality monitoring programme for the Project.

The proposed use of the existing wind data from Kai Tak automatic weather station collected from HKO for wind data collection instead of setting up wind monitoring equipment near the monitoring stations was proposed by ET and agreed by IEC in accordance with the requirements as stated in Section 3.4.7 of the EM&A Manual of the Project.

3 Noise Monitoring

3.1 Introduction

In accordance with the EM&A Manual, impact noise monitoring was conducted at least once per week for each noise monitoring location during the construction phase of the Project.

3.2 Monitoring Parameters, Frequency and Duration

Table 3.1 summarises the monitoring parameters, frequency and duration of impact noise monitoring.

Table 3.1: Noise Monitoring Parameters, Frequency and Duration

Parameter	Frequency and Duration
30-minutes measurement at each monitoring station between 0700 and 1900 on normal weekdays (Monday to Saturday).	At least once per week
L_{eq} , L_{10} and L_{90} would be recorded.	

3.3 Monitoring Locations

According to the approved EM&A Manual, a total of seven noise monitoring stations were identified for the impact monitoring locations. Of these, five noise sensitive receivers are planned residential use (NMS1A, NMS2A, NMS3, NMS4 and NMS5) and were not available for baseline monitoring; the same five are also currently not available for impact monitoring.

Table 3.2 describes the details of the monitoring stations and <u>Figure 3.1</u> shows the locations of noise monitoring stations.

Table 3.2: Construction Noise Monitoring Locations

Monitoring Station	Location Description	Status
NMS1	Hong Kong Society for the Blind	Existing Noise Sensitive
	Workshop, Roof Floor	Receiver
NMS2	Sky Tower, Podium of Tower 7	Existing Noise Sensitive
	·	Receiver
NMS1A	Sung Wong Toi Road Public	Planned Noise Sensitive
	Housing Site	Receiver
NMS2A	Sung Wong Toi Road CDA Site	Planned Noise Sensitive
	(mixed use)	Receiver
NMS3	Kai Tak Area 2B Site 4 (2B4)	Planned Noise Sensitive
	(residential use)	Receiver
NMS4	Kai Tak Area 1K Site 3 (1K3)	Planned Noise Sensitive
	(residential use)	Receiver
NMS5	Kai Tak Area 1L Site 3 (1L3)	Planned Noise Sensitive
	(residential use)	Receiver

During the reporting period, monitoring locations NMS1 and NMS2 were set up at the proposed locations for impact monitoring.

Since NMS1A & NMS2A are planned (i.e. not existing) noise sensitive receivers, noise monitoring should be carried out initially at NMS1 and NMS2 respectively before the population intake of the planned developments. Once the planned developments are completed and occupied, NMS1A shall replace NMS1, while NMS2A shall replace NMS2. It is proposed that

the baseline noise level and Limit Level at NMS1A and NMS2A will be the same as those derived from the baseline monitoring data recorded at NMS1 and NMS2 respectively.

Permission on setting up and carrying out impact monitoring works at NMS3, NMS4 and NMS5 will be sought once each respective development is completed and occupied.

3.4 Action and Limit Levels

The Action and Limit Levels for construction noise are defined in **Table 3.3**.

Table 3.3: Action and Limit Level for Construction Noise

Monitoring Station	Time Period	Action Level	Limit Level
NMS1 NMS2	0700 – 1900 hours on normal weekdays	When one documented complaint is received	75 dB(A)

The event and action plan is provided in **Appendix D**.

If exceedance(s) at these stations is/are recorded by the ET of the Project, it will carry out an investigation and findings will be reported in the monthly EM&A Report.

3.5 Monitoring Schedule for the Reporting Period

The schedule for noise monitoring in the reporting period is presented in Appendix E.

3.6 Monitoring Equipment

Noise monitoring was performed using sound level meters at each designed monitoring station. The sound level meters deployed comply with the International Electrotechnical Commission Publications (IEC) 651:1979 (Type 1) and 804:1985 (Type 1) specifications. Acoustic calibrator was deployed to check the sound level meters at a known sound pressure level. Brand and model of the equipment used for noise monitoring under this Project is given in **Table 3.4**.

Table 3.4: Noise Monitoring Equipment

Equipment	Brand	Model No.
Integrated Sound Level Meter	Rion	NL-52 (serial no. 00131627)
Acoustic Calibrator	LARSON DAVIS	CAL200 (S/N 11334)

3.7 Monitoring Methodology

- Façade and Free Field measurements were made at the monitoring locations.
- For Façade measurement, the microphone hear of the head level meter was positioned 1m exterior of the noise sensitive façade and lowered sufficiently so that the building's external wall acts as a reflecting surface.
- For free field, the microphone of the Sound Level Meter was set at least 1.2 m above the ground.
- A correction of +3dB(A) was made for free field measurement.
- The battery condition was checked to ensure the correct functioning of the meter.
- Parameters such as frequency weighting, the time weighting and the measurement time were set as follows:
 - frequency weighting: A
 - time weighting: Fast

- time measurement: 30-minute intervals (between 0700-1900 on normal weekdays)
- Prior to and after each noise measurement, the meter was calibrated using a Calibrator for 94 dB at 1 kHz. If the difference in the calibration level before and after measurement was more than 1 dB, the measurement would be considered invalid and repeated after the recalibration or repair of the equipment.
- During the monitoring period, the Leq, L10 and L90 were recorded. In addition, any site observations and noise sources were recorded on a standard record sheet.
- Noise measurements were not made in presence of fog, rain, wind with a steady speed exceeding 5m/s or wind with gusts exceeding 10m/s.

Maintenance and Calibration

- The microphone head of the sound level meter and calibrator is cleaned with soft cloth at quarterly intervals.
- The sound level meter and calibrator are sent to the supplier or HOKLAS laboratory to check and calibrate at yearly intervals.
- Calibration records are shown in <u>Appendix F</u>.

3.8 **Monitoring Results**

The monitoring results for construction noise are summarized in Table 3.5. Detailed impact noise monitoring results and relevant graphical plots are presented in Appendix G.

Table 3.5: Summary of Construction Noise Monitoring Results During the Reporting Period

	Measured Noise Level Leq (30 mins), dB(A)					
Monitoring Station	Average	Min	Max	Limit Level		
NMS1	70	68	72	75		
NMS2	69	68	71	75		

No noise exceedances were recorded at stations NMS1 and NMS2 by ET during the reporting period.

4 **Environmental Site and Audit**

4.1 **Site Inspection**

Site inspections were carried out by ET on a weekly basis to monitor the implementation of proper environmental pollution control mitigation measures for the Project. Key observations were recorded in the site inspection checklist and passed to the Contracted Party together with the appropriate recommended mitigation measures where necessary. During the reporting period, site inspections were carried out on 7, 14, 21, and 27 July 2021. Joint IEC site inspections were carried out 21 and 27 July 2021.

Bi-weekly landscape and visual site audit was carried out on 7 and 21 July 2021. The landscape and visual audit have been audited by Registered Landscape Architect (RLA). No major observations of landscape and visual impact were identified. The result findings were summarised in Appendix K.

Key observations during the site inspections are described in **Table 4.1**.

Table 4.1: Summary of Site Inspections and Recommendations

Inspection Date	Key Observations	Recommendations / Actions	Close-Out Date / Status
Kai Tak Sports Park			
7 Jul 2021	Breaking work without noise mitigation was observed at northern site.	The contractor was reminded to provide appropriate noise mitigation measure for the breaking work.	14 Jul 2021
7 Jul 2021	Accumulation of cement stack exceeding 20 bags without covering was observed at northern site.	The contractor was reminded to provide covering for the cement stacks with over 20 bags.	14 Jul 2021
14 Jul 2021	Overflow of sewage was observed at northern site	The contractor was reminded to clear the sewage regularly to prevent overflow.	21 Jul 2021
14 Jul 2021	An excavator without NRMM label was observed at northern site	The contractor was reminded to display the NRMM label for the excavator.	21 Jul 2021
21 Jul 2021	A chemical container without drip tray was observed at southern site	The contractor was reminded to provide drip tray for the chemical container.	27 Jul 2021
21 Jul 2021	Accumulation of stagnant water was observed at southern site	The contractor was reminded to provide temporary pumping to clean the stagnant water.	27 Jul 2021
27 Jul 2021	Accumulation of general refuse was observed at southern site	The contractor was reminded to clear the general refuse regularly.	4 Aug 2021
27 Jul 2021	Accumulation of stockpile without covering was observed at southern site.	The contractor was reminded to provide covering for the stockpile on site.	4 Aug 2021

Hotel and Office Development

21 Jul 2021 Accumulation of mud was observed at the hoarding boundary.		27 Jul 2021
--	--	-------------

4.2 Advice on the Solid and Liquid Waste Management Status

KTSP

The Contracted Party was registered as a chemical waste producer for the Project. Construction and demolition (C&D) material sorting was carried out on site. Sufficient numbers of receptacles were provided for general refuse collection and sorting. Excavated inert C&D materials were reused to minimise the disposal of C&D waste to public fill.

The Contracted Party was reminded to maintain on site waste sorting and recording system and maximize reuse / recycling of C&D wastes, whenever these are generated.

H/O Development

Construction and demolition (C&D) material sorting was carried out on site. Sufficient numbers of receptacles were provided for general refuse collection and sorting. Excavated inert C&D materials were designated for on temporary site storage and collected for the disposal to public fill.

The Contractor was reminded to maintain on site waste sorting and maximize reuse / recycling of C&D wastes, whenever these are generated.

The monthly summary of waste flow table is detailed in **Appendix I**.

4.3 Environmental Licenses and Permits

The valid environmental licenses and permits for the Project during the reporting period are summarized in **Appendix J**.

4.4 Implementation Status of Environmental Mitigation Measures

In response to the site audit findings, the Contracted Party carried out corrective actions.

A summary of the environmental mitigation measures implementation status is presented in **Appendix K**. Most of the necessary mitigation measures were implemented properly.

4.5 Summary of Exceedance of the Environmental Quality Performance Limit

Air Quality

No Action and Limit Level exceedances of 1-hour TSP level was recorded at AMS1 and AMS2 during the reporting period.

Noise

No Action and Limit Level exceedances of noise level was recorded at NMS1 and NMS2 during the reporting period.

4.6 Summary of Complaints, Notification of Summons and Successful Prosecution

Complaints

There was no complaint received in relation to the environmental impact during the reporting month.

Notification of Summons and Successful Prosecution

No notification of summons or prosecutions was received during the reporting period.

Statistics on notifications of summons and successful prosecutions are summarized in **Appendix L**.

5 Future Key Issues

5.1 Construction Programme for the Coming Months

As informed by the Contracted Party, the major construction activities for the next reporting period (August 2021) are summarized in **Table 5.1**.

Table 5.1: Construction Activities for the Next Reporting Period

Site Area	Description of Activities
Kai Tak Sports Park	 Ground investigation works; Rebar fixing; Piling works (Percussive piling, Socket H piling and Bored piling); Mobilization and lifting; and Concreting and excavation.
Hotel and Office Development	Excavation.

5.2 Environmental Site Inspection and Monitoring Schedule for the Next Reporting Period

The tentative schedule for weekly site inspection and monitoring for air quality and noise for the next reporting period is provided in **Appendix E**.

6 Conclusions

6.1 Conclusions

General

The construction works for the Project commenced on 8 April 2019.

The ET of the Project has implemented the air quality and noise environmental impact monitoring under the construction phase EM&A programme during the reporting period.

Breaches of Action and Limit Levels

Air Quality

No Action and Limit Level exceedances of 1-hour TSP level was recorded during the reporting period.

Noise

No Action and Limit Level exceedances of noise level was recorded during the reporting period.

Environmental Site Inspections

Environmental site inspections were carried out five times during the reporting period. Recommendations on remedial actions were given to the Contracted Party for the deficiencies identified during the site inspections.


Complaints


There was no complaint received in relation to the environmental impact during the reporting period.

Notifications of Summons and Successful Prosecutions

There were no notifications of summons or prosecutions received during the reporting period.


Figures

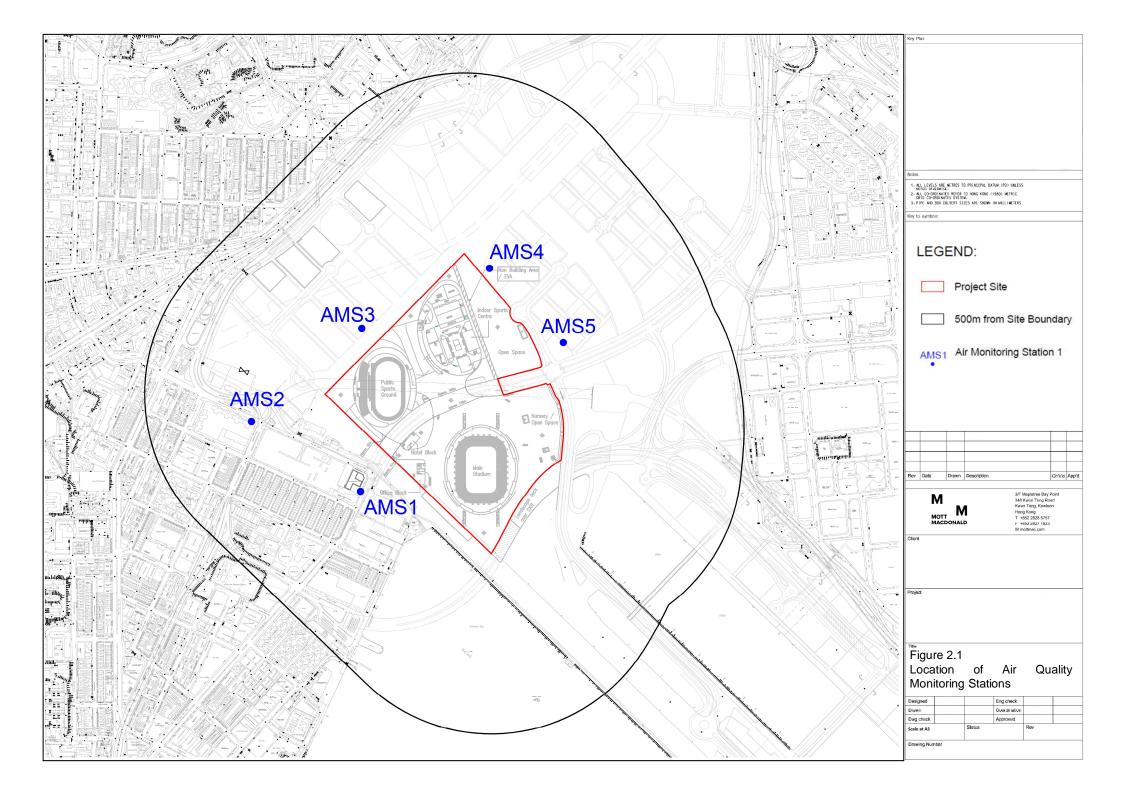

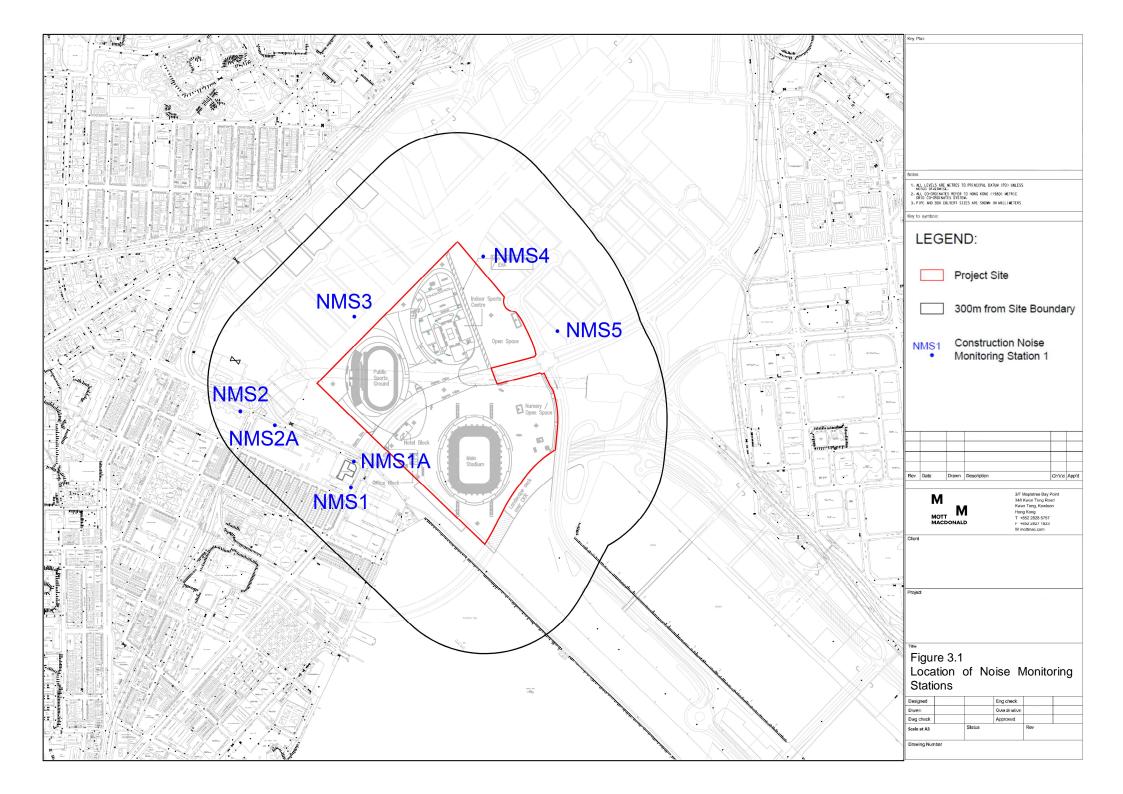


Appendix A. Project Organization for Environmental Works

Project Organisation for Environmental Works

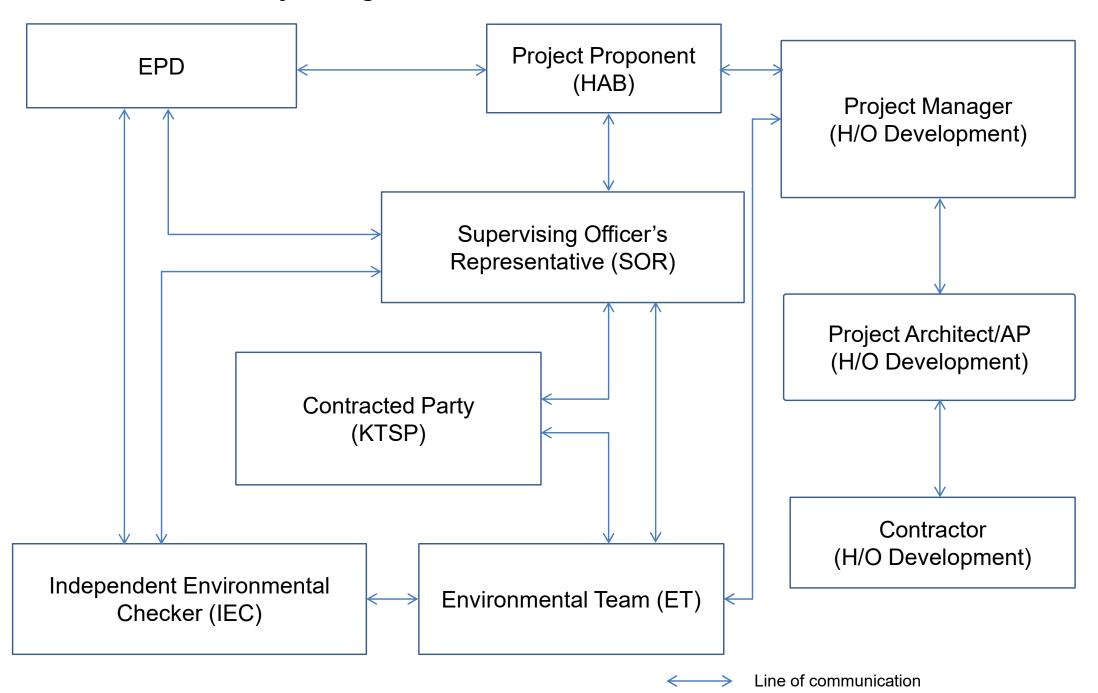

Appendix B. Location of Works Areas

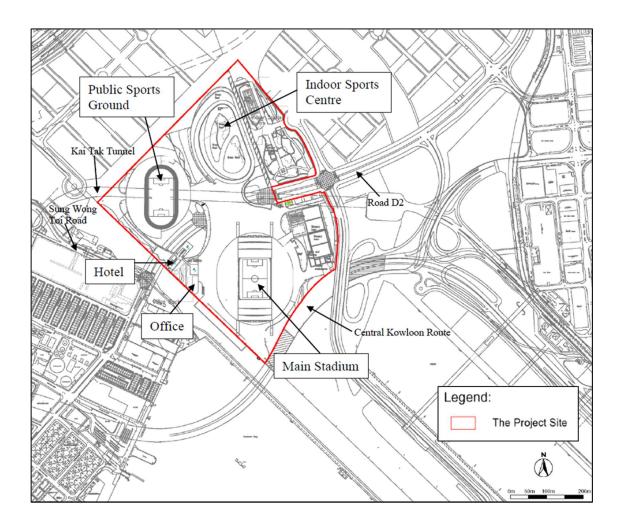

Appendix C. Construction Programme

Construction Programme (Jul 2021 to Oct 2021)

Kai Tak Sports Park

	2021											
Construction Activities	Jan	Feb	Mar	Apr	May	Jun	Jul	Aug	Sep	Oct	Nov	Dec
Plants Mobilization												
C&D Waste Disposal (By vessel)												
Rebar Fixing												
Loading/ Unloading of Materials												
Excavation												
Ground Investigation												
C&D Waste Disposal												
Piling (Percussive Piling)												
Piling (Socket H Piling)												
Piling (Bored Piling)												
Concreting												
Lifting												
C&D Materials Internal Transportation												

Hotel and Office Development

		2021										
Construction Activities	Jan	Feb	Mar	Apr	May	Jun	Jul	Aug	Sep	Oct	Nov	Dec
Loading/Unloading of Materials												
Excavation												
C&D Waste Disposal							4					

Appendix D. Event and Action Plan

Should non-compliance of the air quality criteria occur, actions in accordance with the Event and Action Plan in **Table D.1** and **Table D.2** shall be carried out.

Table D.1: Event and Action Plan for Construction Air Quality (Action Level)

Event	Action							
	ET	IEC	SOR	Contracted Party				
Action Level								
Exceedance for one sample	Inform IEC, SOR and Contracted Party; Identify source, investigate the causes of exceedance and propose remedial measures; Repeat measurement to confirm finding.	Check monitoring data submitted by ET; Check Contracted Party's working method.	Notify Contracted Party.	Rectify any unacceptable practice; Amend working methods if appropriate.				
Exceedance for two or more consecutive samples	1. Inform IEC, SOR and Contracted Party; 2. Identify source; 3. Advise the SOR on the effectiveness of the proposed remedial measures; 4. Repeat measurements to confirm findings; 5. Increase monitoring frequency to daily; 6. Discuss with IEC, SOR and Contracted Party on remedial actions required; 7. If exceedance continues, arrange meeting with IEC and SOR; 8. If exceedance stops, cease additional monitoring.	1. Check monitoring data submitted by ET; 2. Check Contracted Party's working method; 3. Discuss with ET and Contracted Party on possible remedial measures; 4. Advise the ET/SOR on the effectiveness of the proposed remedial measures; 5. Supervise Implementation of remedial measures.	1. Confirm receipt of notification of failure in writing; 2. Notify Contracted Party; 3. Ensure remedial measures properly implemented.	1. Submit proposals for remedial to SOR and IEC within 3 working days of notification; 2. Implement the agreed proposals; 3. Amend proposal if appropriate.				

Table D.2: Event and Action Plan for Construction Air Quality (Limit Level)

Event	Action								
	ET	IEC	ET	Contracted Party					
Limit Level									
Exceedance for one sample	1. Inform IEC, SOR, Contracted Party and EPD; 2. Identify source, investigate the causes of exceedance and propose remedial measures; 3. Repeat measurement to confirm finding; 4. Increase monitoring frequency to daily; 5. Assess effectiveness of Contracted Party's remedial actions and keep IEC, EPD and SOR informed of the results.	1. Check monitoring data submitted by ET; 2. Check Contracted Party's working method; 3. Discuss with ET and Contracted Party on possible remedial measures; 4. Advise the SOR on the effectiveness of the proposed remedial measures; 5. Supervise implementation of remedial measures.	1. Confirm receipt of notification of failure in writing; 2. Notify Contracted Party; 3. Ensure remedial measures properly implemented.	1. Take immediate action to avoid further exceedance; 2. Discuss with ET and IEC on remedial actions; 3. Submit proposals for remedial actions to IEC within 3 working days of notification; 4. Implement the agreed proposals; 5. Amend proposal if appropriate.					
Exceedance for two or more consecutive samples	1. Notify IEC, SOR, Contracted Party and EPD; 2. Identify source; 3. Repeat measurement to confirm findings; 4. Increase monitoring frequency to daily; 5. Carry out analysis of Contracted Party's working procedures to determine possible mitigation to be implemented; 6. Arrange meeting with IEC and SOR and Contracted Party to discuss the remedial actions to be taken; 7. Assess effectiveness of Contracted Party's remedial actions and keep IEC, EPD and SOR informed of the results; 8. If exceedance stops, cease additional monitoring.	1. Check monitoring data submitted by ET; 2. Check Contracted Party's working method; 3. Discuss amongst SOR, ET, and Contracted Party on the potential remedial actions; 4. Review Contracted Party's remedial actions whenever necessary to assure their effectiveness and advise the SOR accordingly; 5. Supervise the implementation of remedial measures.	1. Confirm receipt of notification of failure in writing; 2. Notify Contracted Party; 3. In consultation with the IEC, agree with the Contracted Party on the remedial measures to be implemented; 4. Ensure remedial measures properly implemented; 5. If exceedance continues, consider what portion of the work is responsible and instruct the Contracted Party to terminate that portion of work until the exceedance ceases.	1. Take immediate action to avoid further exceedance; 2. Discuss with ET and IEC on remedial actions; 3. Submit proposals for remedial actions to SOR and IEC within 3 working days of notification; 4. Implement the agreed proposals; 5. Resubmit proposals if problem still not under control; 6. Stop the relevant portion of works as determined by the SOR until the exceedance ceases.					

Should non-compliance of the noise criteria occur, actions in accordance with the Event and Action Plan in **Table D.3** shall be carried out.

Table D.3: Event and Action Plan for Construction Noise

Event	Action								
	ET	IEC	ET	Contracted Party					
Action Level	1. Notify IEC, SOR and Contracted Party of exceedance; 2. Identify source; 3. Investigate the causes of exceedance and propose remedial measures; 4. Report the results of investigation to the IEC, SOR and Contracted Party; 5. Discuss with the IEC, SOR and Contracted Party and formulate remedial measures; 6. Increase monitoring frequency to check mitigation effectiveness.	1. Review the analysed results submitted by the ET; 2. Review the proposed remedial measures by the Contracted Party and advise the SOR accordingly; 3. Supervise the implementation of remedial measures.	1. Confirm receipt of notification of failure in writing; 2. Notify Contracted Party; 3. Require Contracted Party to propose remedial measures for the analysed noise problem; 4. Ensure remedial measures are properly implemented	Submit noise mitigation proposals to SOR with copy to ET and IEC; Implement noise mitigation proposals.					
Limit Level	1. Inform IEC, SOR, EPD and Contracted Party; 2. Identify source; 3. Repeat measurements to confirm findings; 4. Increase monitoring frequency; 5. Carry out analysis of Contracted Party's working procedures to determine possible mitigation to be implemented; 6. Inform IEC, SOR and EPD the causes and actions taken for the exceedances; 7. Assess effectiveness of Contracted Party's remedial actions and keep IEC, EPD and SOR informed of the results; 8. If exceedance stops, cease additional monitoring.	1. Discuss amongst SOR, ET, and Contracted Party on the potential remedial actions; 2. Review Contracted Party's remedial actions whenever necessary to assure their effectiveness and advise the SOR accordingly; 3. Supervise the implementation of remedial measures.	1. Confirm receipt of notification of failure in writing; 2. Notify Contracted Party; 3. Require Contracted Party to propose remedial measures for the analysed noise problem; 4. Ensure remedial measures are properly implemented; 5. If exceedance continues, investigate what portion of the work is responsible and instruct the Contracted Party to terminate that portion of work until the exceedance ceases.	1. Take immediate action to avoid further exceedance; 2. Submit proposals for remedial actions to SOR with copy to ET and IEC within 3 working days of notification; 3. Implement the agreed proposals; 4. Resubmit proposals if problem still not under control; 5. Terminate the relevant portion of works as determined by the SOR until the exceedance ceases.					

Appendix E. Environmental Site Inspection and Monitoring Schedule

Table E.1: Site Inspection and Monitoring Schedule for July 2021



Air Quality/Noise Monitoring

Remark: Joint site walk with IEC on 21 and 27 July 2021

Table E.2: Tentative Site Inspection and Monitoring Schedule for August 2021

Sun	Mon	Tue	Wed	Thu	Fri	Sat
1	2	3	4	5	6	
			site inspection	AMS1, NMS1		
			landscape and visual audit	AMS2, NMS2		
8	9	10	11	12	13	
			site inspection			
			AMS1, NMS1			
			AMS2, NMS2			
15	16	17	18	19	20	
		AMS1, NMS1	site inspection landscape and visual			
		AMS2, NMS2	audit			
22	23	24		26	27	
	AMS1, NMS1		site inspection		AMS1	
	AMS2, NMS2				AMS2	
29	30	31		-		

Air Quality/Noise Monitoring

Remark: The schedule is subject to change due to unforeseeable circumstances (e.g. adverse weather, etc)

Appendix F. Calibration Certificates

ALS Technichem (HK) Pty Ltd

ALS Laboratory Group

ANALYTICAL CHEMISTRY & TESTING SERVICES



SUB-CONTRACTING REPORT

CONTACT : MR K.W. FAN WORK ORDER : HK2045301

CLIENT : ENVIROTECH SERVICES CO.

ADDRESS : RM113, 1/F, MY LOFT, 9 HOI WING ROAD, SUB-BATCH : 1

TUEN MUN, N.T. HONG KONG

DATE RECEIVED : 24-NOV-2020

DATE OF ISSUE : 30-NOV-2020

PROJECT : --- NO. OF SAMPLES : 1

CLIENT ORDER :---

General Comments

 Sample(s) was/ were submitted by client. Sample(s) arrived laboratory in ambient condition. The result(s) related only to the item(s) tested.

- Sample information (Project name, Sample ID, Sampling date/time, etc., if any) is provided by client.
- Calibration was subcontracted to and analysed by Action United Enviro Services.

Signatories

This document has been signed by those names that appear on this report and are the authorised signatories

Signatories Position

Richard Fung

Managing Director

This is the Final Report and supersedes any preliminary report with this batch number.

All pages of this report have been checked and approved for release.

: HK2045301 WORK ORDER

SUB-BATCH

: 1 : ENVIROTECH SERVICES CO. CLIENT

PROJECT



ALS Lab	ALS Lab Client's Sample ID		Sample Date	External Lab Report No.	
ID		Туре			
HK2045301-001	S/N: 245833	Equipments	24-Nov-2020	S/N: 245833	

Equipment Verification Report (TSP)

Equipment Calibrated:

Type: Laser Dust monitor

Manufacturer: Sibata LD-3B

Serial No. 245833

Equipment Ref: Nil

Job Order HK2045301

Standard Equipment:

Standard Equipment: Higher Volume Sampler (TSP)

Location & Location ID: AUES office (calibration room)

Equipment Ref: HVS 018

Last Calibration Date: 8 October 2020

Equipment Verification Results:

Verification Date: 26 November 2020

Hour	Time	Mean Temp °C	Mean Pressure (hPa)	Concentration in mg/m³ (Standard Equipment)	Total Count (Calibrated Equipment)	Count/Minute (Total Count/min)
2hr01min	09:18 ~ 11:19	24.0	1019.3	0.041	4525	37.3
2hr	11:22 ~ 13:22	24.0	1019.3	0.034	3430	28.6
2hr01min	13:25 ~ 15:26	24.0	1019.3	0.044	5196	42.9

0.05 0.045

0.04

0.035

0.025

0.015

0.01 0.005 y = 0.0011x + 0.0011

 $R^2 = 0.9865$

20

Linear Regression of Y or X

Slope (K-factor): 0.0011

Correlation Coefficient 0.9932

Date of Issue 30 November 2020

Remarks:

- 1. **Strong** Correlation (R>0.8)
- 2. Factor 0.0011 should be applied for TSP monitoring

*If R<0.5, repair or re-verification is required for the equipment

Operator : _____ Fai So Signature : _____ Date : ____ 30 November 2020

QC Reviewer : Ben Tam Signature : Date : 30 November 2020

ALS Technichem (HK) Pty Ltd

ALS Laboratory Group





SUB-CONTRACTING REPORT

CONTACT : MR K.W. FAN WORK ORDER : HK2045304

CLIENT : ENVIROTECH SERVICES CO.

ADDRESS : RM113, 1/F, MY LOFT, 9 HOI WING ROAD, SUB-BATCH : 1

TUEN MUN, N.T. HONG KONG

DATE RECEIVED : 24-NOV-2020

DATE OF ISSUE : 30-NOV-2020

PROJECT : --- NO. OF SAMPLES : 1

CLIENT ORDER :---

General Comments

 Sample(s) was/ were submitted by client. Sample(s) arrived laboratory in ambient condition. The result(s) related only to the item(s) tested.

- Sample information (Project name, Sample ID, Sampling date/time, etc., if any) is provided by client.
- Calibration was subcontracted to and analysed by Action United Enviro Services.

Signatories

This document has been signed by those names that appear on this report and are the authorised signatories

Signatories Position

Richard Fung

Managing Director

This is the Final Report and supersedes any preliminary report with this batch number.

All pages of this report have been checked and approved for release.

: HK2045304 WORK ORDER

SUB-BATCH

: 1 : ENVIROTECH SERVICES CO. CLIENT

PROJECT



ALS Lab	Client's Sample ID	_	Sample Date	External Lab Report No.
ID		Туре		
HK2045304-001	S/N: 276015	Equipments	24-Nov-2020	S/N: 276015

Equipment Verification Report (TSP)

Equipment Calibrated:

Type: Laser Dust monitor

Manufacturer: Sibata LD-3B

Serial No. 276015

Equipment Ref: Nil

Job Order HK2045304

Standard Equipment:

Standard Equipment: Higher Volume Sampler (TSP)

Location & Location ID: AUES office (calibration room)

Equipment Ref: HVS 018

Last Calibration Date: 8 October 2020

Equipment Verification Results:

Verification Date: 26 November 2020

Hour	Time	Mean Temp °C	Mean Pressure (hPa)	Concentration in mg/m³ (Standard Equipment)	Total Count (Calibrated Equipment)	Count/Minute (Total Count/min)
2hr01min	09:18 ~ 11:19	24.0	1019.3	0.041	4541	37.5
2hr	11:22 ~ 13:22	24.0	1019.3	0.034	3443	28.7
2hr01min	13:25 ~ 15:26	24.0	1019.3	0.044	5211	43.0

Linear Regression of Y or X

Slope (K-factor): 0.0011

Correlation Coefficient 0.9933

Date of Issue 30 November 2020

0.05 0.045 0.04 0.035 0.03 0.025 0.02 y = 0.0011x + 0.0011 0.015 $R^2 = 0.9867$ 0.01 0.005 0 10 20 40 50

Remarks:

1. **Strong** Correlation (R>0.8)

2. Factor 0.0011 should be applied for TSP monitoring

*If R<0.5, repair or re-verification is required for the equipment

Operator : _____ Fai So Signature : _____ Date : ____ Date : ____ 30 November 2020

QC Reviewer : Ben Tam Signature : Date : 30 November 2020



Sun Creation Engineering Limited Calibration & Testing Laboratory

Certificate of Calibration 校正證書

Certificate No.:

C210001

證書編號

ITEM TESTED / 送檢項目 (Job No. / 序引編號: IC20-2688)

Date of Receipt / 收件日期: 18 December 2020

Description / 儀器名稱

Precision Acoustic Calibrator

Manufacturer / 製造商

LARSON DAVIS

Model No. / 型號

CAL200

Serial No./編號

11334

Supplied By / 委託者

Envirotech Services Co.

Room 113, 1/F, My Loft, 9 Hoi Wing Road, Tuen Mun,

New Territories, Hong Kong

TEST CONDITIONS / 測試條件

Temperature / 溫度 :

 $(23 \pm 2)^{\circ}$ C

Relative Humidity / 相對濕度 :

 $(50 \pm 25)\%$

Line Voltage / 電壓 :

TEST SPECIFICATIONS / 測試規範

Calibration check

DATE OF TEST / 測試日期

2 January 2021

TEST RESULTS / 測試結果

The results apply to the particular unit-under-test only.

The results do not exceed manufacturer's specification & user's specified acceptance criteria.

The results are detailed in the subsequent page(s).

The test equipment used for calibration are traceable to National Standards via:

- The Government of The Hong Kong Special Administrative Region Standard & Calibration Laboratory
- The Bruel & Kjaer Calibration Laboratory, Denmark
- Agilent Technologies / Keysight Technologies

- Fluke Everett Service Center, USA

Tested By 測試

Assistant Engineer

Certified By

核證

K C Lee Engineer

Date of Issue 簽發日期

4 January 2021

The test equipment used for calibration is traceable to the National Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書面批准。

Sun Creation Engineering Limited - Calibration & Testing Laboratory c/o 4/F, 1 Hing On Lane, Tuen Mun, New Territories, Hong Kong 輝創工程有限公司 - 校正及檢測實驗所 c/o 香港新界屯門興安里 號四樓

Fax/傳真: (852) 2744 8986 Tel/電話: (852) 2927 2606

E-mail/電郵: callab@suncreation.com

Website/網址: www.suncreation.com



Sun Creation Engineering Limited Calibration & Testing Laboratory

Certificate of Calibration 校正證書

Certificate No.: C210001

證書編號

1. The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 12 hours before the commencement of the test.

Measuring Amplifier

2. The results presented are the mean of 3 measurements at each calibration point.

3. Test equipment:

Equipment ID CL130 CL281 TST150A <u>Description</u>
Universal Counter
Multifunction Acoustic Calibrator

C203952 CDK1806821 C201309

Certificate No.

4. Test procedure: MA100N.

5. Results:

5.1 Sound Level Accuracy

UUT	Measured Value	User's Spec.	Uncertainty of Measured Value
Nominal Value	(dB)	(dB)	(dB)
94 dB, 1 kHz	93.7	± 0.5	± 0.2
114 dB, 1 kHz	113.7		

5.2 Frequency Accuracy

UUT Nominal Value	Measured Value	Mfr's	Uncertainty of Measured Value (Hz)
(kHz)	(kHz)	Spec.	
1	1.000	1 kHz ± 1 %	± 1

Remarks: - The user's specified acceptance criteria (user's spec.) is a customer pre-defined operating tolerance of the UUT, suitable for one's own intended use.

- The uncertainties are for a confidence probability of not less than 95 %.

Note:

Only the original copy or the laboratory's certified true copy is valid.

The values given in this Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environment changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Sun Creation Engineering Limited shall not be liable for any loss or damage resulting from the use of the equipment.

The test equipment used for calibration is traceable to the National Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書面批准。



Sun Creation Engineering Limited

Calibration & Testing Laboratory

Certificate of Calibration 校正證書

Certificate No.: C213255

證書編號

· ITEM TESTED / 送檢項目 (Job No. / 序引編號: IC21-1016)

Date of Receipt / 收件日期: 24 May 2021

Description / 儀器名稱

Sound Level Meter

Manufacturer / 製造商 Model No. / 型號

Rion

Serial No./編號

NL-52 00131627

Supplied By / 委託者

Envirotech Services Co.

Room 113, 1/F, My Loft, 9 Hoi Wing Road, Tuen Mun,

New Territories, Hong Kong

TEST CONDITIONS / 測試條件

Temperature / 溫度 : Line Voltage / 電壓 :

 $(23 \pm 2)^{\circ}$ C

Relative Humidity / 相對濕度 : $(50 \pm 25)\%$

TEST SPECIFICATIONS / 測試規範

Calibration check

DATE OF TEST / 測試日期

4 June 2021

TEST RESULTS / 測試結果

The results apply to the particular unit-under-test only.

The results do not exceed manufacturer's specification.

The results are detailed in the subsequent page(s).

The test equipment used for calibration are traceable to National Standards via:

- The Government of The Hong Kong Special Administrative Region Standard & Calibration Laboratory
- Agilent Technologies / Keysight Technologies
- Fluke Everett Service Center, USA

Tested By 測試

K P Cheuk

Project Engineer

Certified By 核證

K Lee Engineer Date of Issue

9 June 2021

簽發日期

The test equipment used for calibration is traceable to the National Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書面批准。

Sun Creation Engineering Limited - Calibration & Testing Laboratory c/o 4/F, 1 Hing On Lane, Tuen Mun, New Territories, Hong Kong 輝創工程有限公司 - 校正及檢測實驗所 c/o 香港新界屯門興安里 -號四樓 Tel/電話: (852) 2927 2606 Fax/傳真: (852) 2744 8986 E-mail/電郵: callab@suncreation.com



Sun Creation Engineering Limited

Calibration & Testing Laboratory

Certificate of Calibration 校正證書

Certificate No.: C213255

證書編號

- The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 12 hours, and switched on to , 1. warm up for over 10 minutes before the commencement of the test.
 - 2. Self-calibration was performed before the test.
 - 3. The results presented are the mean of 3 measurements at each calibration point.
 - 4. Test equipment:

Equipment ID

Description

Certificate No.

CL280 CL281

40 MHz Arbitrary Waveform Generator Multifunction Acoustic Calibrator

C210084

AV210017

- 5. Test procedure: MA101N.
- 6. Results:
- 6.1 Sound Pressure Level

6.1.1 Reference Sound Pressure Level

UUT Setting				Applied Value		UUT	IEC 61672
Range	Function	Frequency	Time	Level	Freq.	Reading	Class 1 Spec.
(dB)		Weighting	Weighting	(dB)	(kHz)	(dB)	(dB)
30 - 130	L_{Δ}	A	Fast	94.00	1	94.2	± 1.1

6.1.2 Linearity

	UUT Setting				d Value	UUT
Range (dB)	Function	Frequency Weighting	Time Weighting	Level (dB)	Freq. (kHz)	Reading (dB)
30 - 130	L_A	A	Fast	94.00	1	94.2 (Ref.)
				104.00		104.2
				114.00		114.2

IEC 61672 Class 1 Spec. : \pm 0.6 dB per 10 dB step and \pm 1.1 dB for overall different.

6.2 Time Weighting

	UUT Setting			Applie	d Value	UUT	IEC 61672
Range (dB)	Function	Frequency Weighting	Time Weighting	Level (dB)	Freq. (kHz)	Reading (dB)	Class 1 Spec. (dB)
30 - 130	L _A	A	Fast	94.00	1	• 94.2	Ref.
			Slow			94.2	± 0.3

The test equipment used for calibration is traceable to the National Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書面批准。



Sun Creation Engineering Limited

Calibration & Testing Laboratory

Certificate of Calibration 校正證書

Certificate No.: C213255

證書編號

· 6.3 Frequency Weighting

6.3.1 A-Weighting

The second secon	UUT Setting		Applied Value		UUT	IEC 61672	
Range (dB)	Function	Frequency Weighting	Time Weighting	Level (dB)	Freq.	Reading (dB)	Class 1 Spec. (dB)
30 - 130	L_A	A	Fast	94.00	63 Hz	68.0	-26.2 ± 1.5
					125 Hz	78.0	-16.1 ± 1.5
		,			250 Hz	85.5	-8.6 ± 1.4
					500 Hz	91.0	-3.2 ± 1.4
					1 kHz	94.2	Ref.
					2 kHz	95.4	$+1.2 \pm 1.6$
					4 kHz	95.2	$+1.0 \pm 1.6$
					8 kHz	93.2	-1.1 (+2.1; -3.1)
					16 kHz	86.2	-6.6 (+3.5 ; -17.0)

6.3.2 C-Weighting

	UUT	Setting		Applied Value		UUT	IEC 61672
Range (dB)	Function	Frequency Weighting	Time Weighting	Level (dB)	Freq.	Reading (dB)	Class 1 Spec. (dB)
30 - 130	L _C	C	Fast	94.00	63 Hz	93.3	-0.8 ± 1.5
	200				125 Hz	94.0	-0.2 ± 1.5
					250 Hz	94.2	0.0 ± 1.4
					500 Hz	94.2	0.0 ± 1.4
					1 kHz	94.2	Ref.
					2 kHz	94.0	-0.2 ± 1.6
					4 kHz	93.4	-0.8 ± 1.6
					8 kHz	91.3	-3.0 (+2.1; -3.1)
				June Victoria Company	16 kHz	84.3	-8.5 (+3.5 ; -17.0)

The test equipment used for calibration is traceable to the National Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書面批准。



Sun Creation Engineering Limited

Calibration & Testing Laboratory

Certificate of Calibration 校正證書

Certificate No.: C213255

證書編號

Remarks: - UUT Microphone Model No.: UC-59 & S/N: 10446

- Mfr's Spec. : IEC 61672 Class 1

- Uncertainties of Applied Value : 94 dB : 63 Hz - 125 Hz : \pm 0.35 dB

 $16 \text{ kHz} \qquad : \pm 0.70 \text{ dB}$

104 dB : 1 kHz : $\pm 0.10 \text{ dB}$ (Ref. 94 dB) 114 dB : 1 kHz : $\pm 0.10 \text{ dB}$ (Ref. 94 dB)

Website/網址: www.suncreation.com

Note:

Only the original copy or the laboratory's certified true copy is valid.

The values given in this Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environment changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Sun Creation Engineering Limited shall not be liable for any loss or damage resulting from the use of the equipment.

The test equipment used for calibration is traceable to the National Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書面批准。


⁻ The uncertainties are for a confidence probability of not less than 95 %.

Appendix G. Monitoring Data and Graphical Plots (Air Quality and Noise)

Data for 1-hour TSP Monitoring at Station AMS1 during the Reporting Month

Date	Start Time	Finish Time	Weather	Wind Speed (m/s)	Wind Direction (deg)	1-hour TSP (μg/m³)
2-Jul-21	9:07	10:07	Cloudy	2.8	171	60
2-Jul-21	10:07	11:07	Cloudy	2.8	206	49
2-Jul-21	11:07	12:07	Cloudy	4.2	219	48
8-Jul-21	9:57	10:57	Fine	5.3	112	59
8-Jul-21	10:57	11:57	Fine	4.4	120	65
8-Jul-21	11:57	12:57	Fine	4.4	115	71
14-Jul-21	9:08	10:08	Sunny	1.4	120	35
14-Jul-21	10:08	11:08	Sunny	2.8	139	30
14-Jul-21	11:08	12:08	Sunny	3.3	126	29
20-Jul-21	9:27	10:27	Fine	1.1	172	31
20-Jul-21	10:27	11:27	Fine	5.3	67	27
20-Jul-21	11:27	12:27	Fine	1.1	131	29
26-Jul-21	9:10	10:10	Sunny	2.8	242	70
26-Jul-21	10:10	11:10	Sunny	2.8	234	68
26-Jul-21	11:10	12:10	Sunny	1.4	241	61
30-Jul-21	9:05	10:05	Cloudy	0.3	328	60
30-Jul-21	10:05	11:05	Cloudy	0.0	Variable	66
30-Jul-21	11:05	12:05	Cloudy	0.3	213	72


Graphical Presentation for 1-hour TSP Monitoring at AMS1

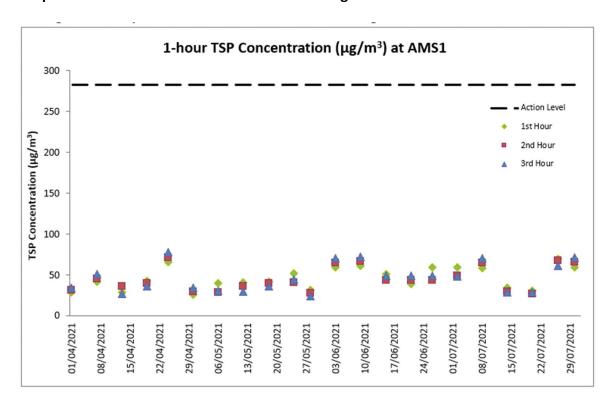

Data for 1-hour TSP Monitoring at Station AMS2 during the Reporting Month

Date	Start Time	Finish Time	Weather	Wind Speed (m/s)	Wind Direction (deg)	1-hour TSP (μg/m³)
2-Jul-21	8:19	9:19	Fine	2.2	181	55
2-Jul-21	9:19	10:19	Fine	1.9	178	51
2-Jul-21	10:19	11:19	Fine	3.9	233	57
8-Jul-21	9:05	10:05	Cloudy	1.1	169	57
8-Jul-21	10:05	11:05	Cloudy	1.7	160	62
8-Jul-21	11:05	12:05	Cloudy	2.2	185	68
14-Jul-21	8:25	9:25	Sunny	1.1	105	31
14-Jul-21	9:25	10:25	Sunny	1.7	135	29
14-Jul-21	10:25	11:25	Sunny	3.1	131	35
20-Jul-21	8:43	9:43	Cloudy	5.8	82	40
20-Jul-21	9:43	10:43	Cloudy	1.7	153	35
20-Jul-21	10:43	11:43	Cloudy	3.3	48	30
26-Jul-21	8:22	9:22	Sunny	2.5	248	55
26-Jul-21	9:22	10:22	Sunny	3.1	239	60
26-Jul-21	10:22	11:22	Sunny	2.8	230	62
30-Jul-21	8:45	9:45	Cloudy	2.5	296	59
30-Jul-21	9:45	10:45	Cloudy	0.8	278	65
30-Jul-21	10:45	11:45	Cloudy	0.0	Variable	71


Graphical Presentation for 1-hour TSP Monitoring at AMS2

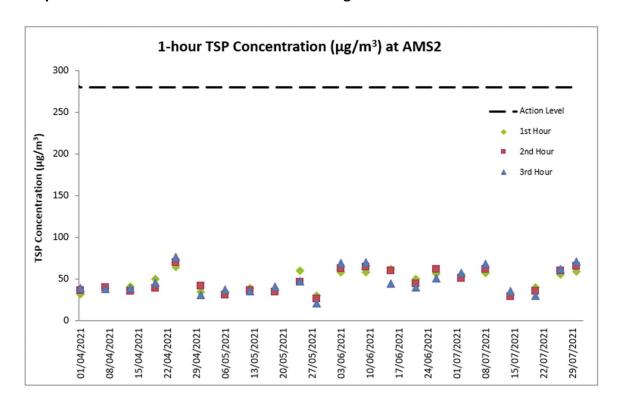

Data for Noise Monitoring at Station NMS1 during the Reporting Month

Date	Time	Weather	L _{eq(5min)}	L ₁₀	L ₉₀	Measured L _{eq(30min)}
2-Jul-21	9:10	Cloudy	68.7	70.9	66.8	
2-Jul-21	9:15	Cloudy	69.2	71.0	67.7	
2-Jul-21	9:20	Cloudy	67.1	69.2	65.3	68.2
2-Jul-21	9:25	Cloudy	67.4	69.3	65.5	00.2
2-Jul-21	9:30	Cloudy	68.4	70.5	66.6	
2-Jul-21	9:35	Cloudy	68.2	70.4	66.6	
8-Jul-21	9:55	Fine	69.3	72.4	64.5	
8-Jul-21	10:00	Fine	71.3	73.8	65.3	
8-Jul-21	10:05	Fine	70.7	73.3	64.9	70.7
8-Jul-21	10:10	Fine	70.3	73.3	65.5	70.7
8-Jul-21	10:15	Fine	71.9	73.4	64.2	
8-Jul-21	10:20	Fine	69.9	72.4	66.0	
14-Jul-21	9:10	Sunny	69.6	71.4	67.5	
14-Jul-21	9:15	Sunny	68.7	70.4	66.3	
14-Jul-21	9:20	Sunny	70.6	72.4	68.2	60.7
14-Jul-21	9:25	Sunny	70.8	72.1	68.5	69.7
14-Jul-21	9:30	Sunny	69.0	71.9	67.3	
14-Jul-21	9:35	Sunny	69.2	71.4	67.6	
20-Jul-21	9:30	Cloudy	71.6	73.7	68.8	
20-Jul-21	9:35	Cloudy	72.9	74.6	69.5	
20-Jul-21	9:40	Cloudy	70.3	72.4	67.2	74.5
20-Jul-21	9:45	Cloudy	70.4	72.5	67.6	71.5
20-Jul-21	9:50	Cloudy	72.2	74.1	69.0	
20-Jul-21	9:55	Cloudy	71.2	73.4	68.7	
26-Jul-21	9:12	Sunny	69.5	71.3	67.1	
26-Jul-21	9:17	Sunny	70.2	72.6	68.4	
26-Jul-21	9:22	Sunny	71.1	73.0	69.5	70.7
26-Jul-21	9:27	Sunny	71.5	73.1	69.9	70.7
26-Jul-21	9:32	Sunny	70.6	72.7	68.6	
26-Jul-21	9:37	Sunny	70.8	72.0	68.6	


Graphical Presentation for Noise Monitoring at NMS1

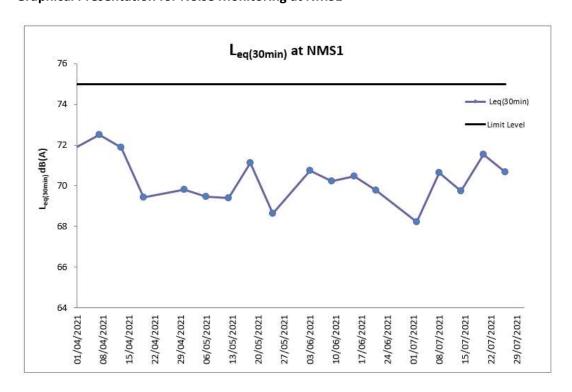


Data for Noise Monitoring at Station NMS2 during the Reporting Month


Date	Time	Weather	L _{eq(5min)}	L ₁₀	L ₉₀	Measured L _{eq(30min)}
2-Jul-21	8:22	Cloudy	67.5	69.7	65.4	
2-Jul-21	8:27	Cloudy	68.6	70.5	66.3	
2-Jul-21	8:32	Cloudy	67.1	69.2	65.4	67.6
2-Jul-21	8:37	Cloudy	66.4	68.2	64.8	07.0
2-Jul-21	8:42	Cloudy	67.7	69.0	65.9	
2-Jul-21	8:47	Cloudy	68.1	70.6	66.5	
8-Jul-21	9:08	Fine	70.0	72.3	66.2	
8-Jul-21	9:13	Fine	70.3	72.2	66.6	
8-Jul-21	9:18	Fine	70.5	72.4	67.0	70.1
8-Jul-21	9:23	Fine	70.2	71.7	66.5	70.1
8-Jul-21	9:28	Fine	69.4	72.0	65.8	
8-Jul-21	9:33	Fine	69.9	72.6	66.6	
14-Jul-21	8:28	Sunny	68.7	70.0	66.6	
14-Jul-21	8:33	Sunny	67.1	69.2	65.4	
14-Jul-21	8:38	Sunny	68.1	70.2	66.3	68.5
14-Jul-21	8:43	Sunny	69.3	71.9	67.8	68.5
14-Jul-21	8:48	Sunny	69.2	71.4	67.3	
14-Jul-21	8:53	Sunny	68.5	70.6	66.7	
20-Jul-21	8:45	Cloudy	70.7	72.5	67.3	
20-Jul-21	8:50	Cloudy	71.6	73.5	68.4	
20-Jul-21	8:55	Cloudy	69.1	71.3	66.7	70.6
20-Jul-21	9:00	Cloudy	70.2	72.8	67.4	70.6
20-Jul-21	9:05	Cloudy	70.2	72.0	67.9	
20-Jul-21	9:10	Cloudy	71.1	73.5	68.6	
26-Jul-21	8:25	Sunny	67.6	69.7	65.8	
26-Jul-21	8:30	Sunny	68.6	70.5	66.9	
26-Jul-21	8:35	Sunny	69.4	71.5	67.6	60.2
26-Jul-21	8:40	Sunny	69.4	71.3	67.2	69.3
26-Jul-21	8:45	Sunny	70.2	72.1	68.9	
26-Jul-21	8:50	Sunny	70.1	72.0	68.2	


Graphical Presentation for Noise Monitoring at NMS2

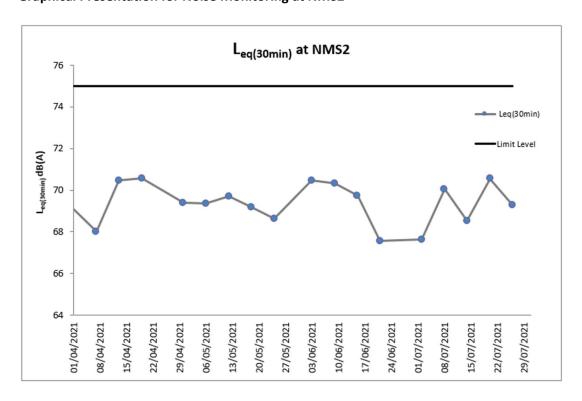



Appendix H. Wind Data

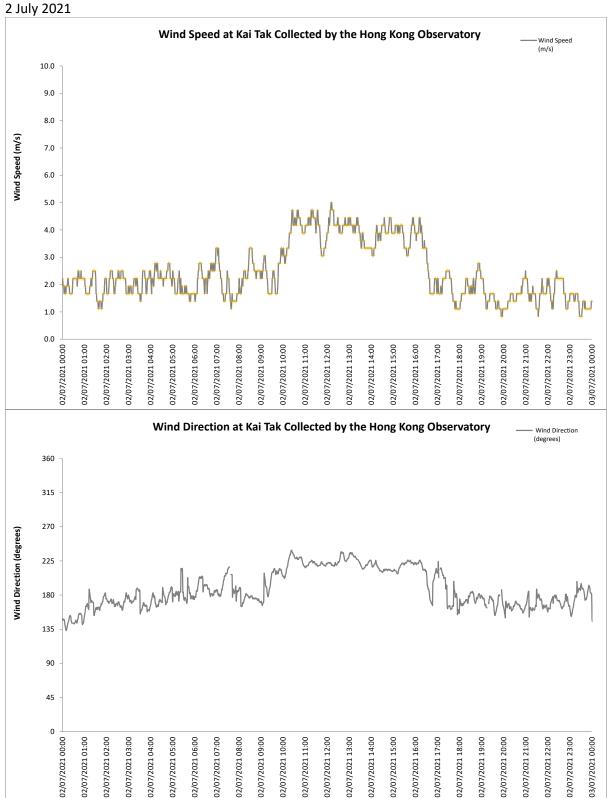


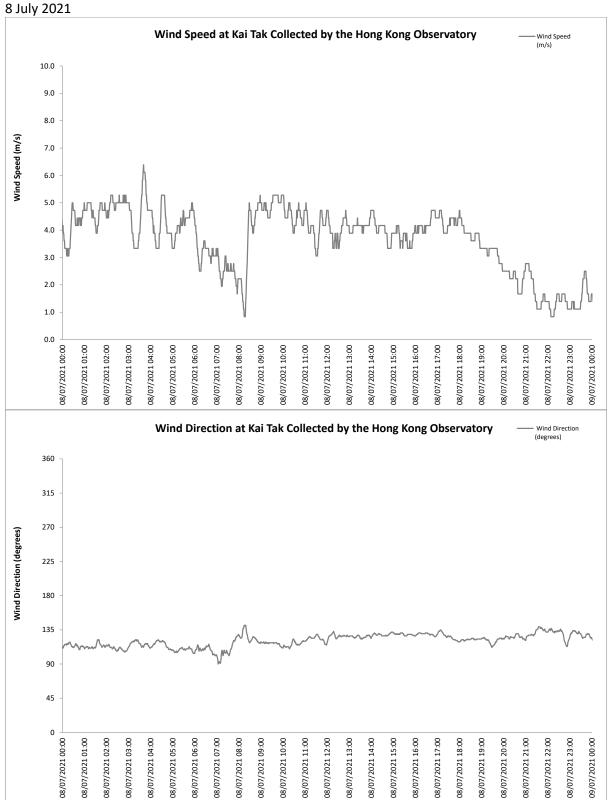

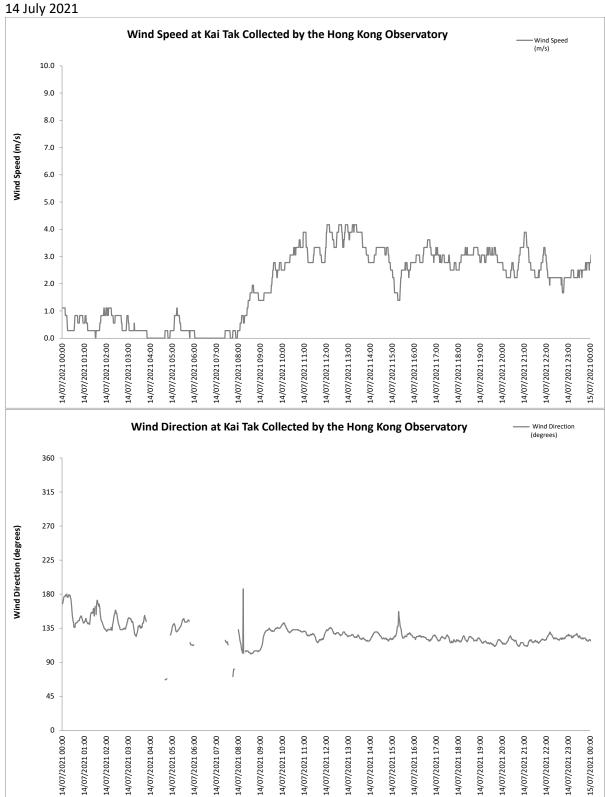

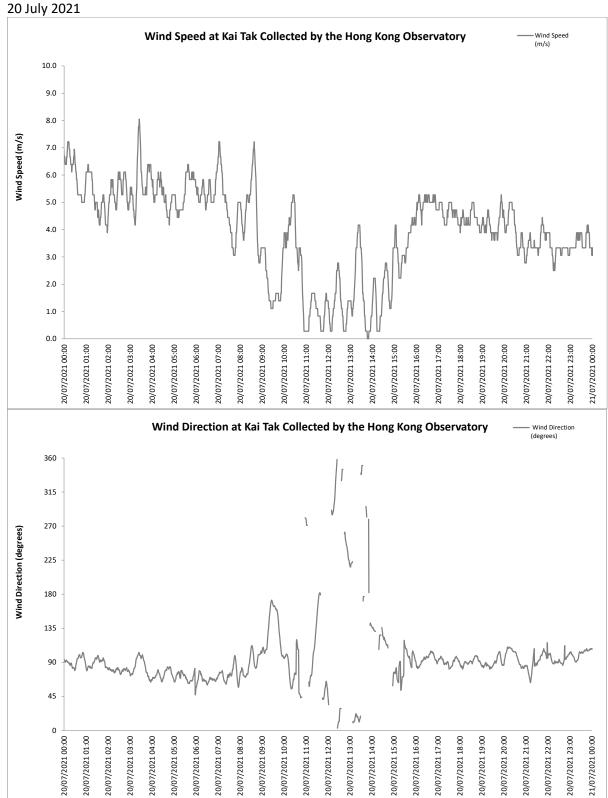

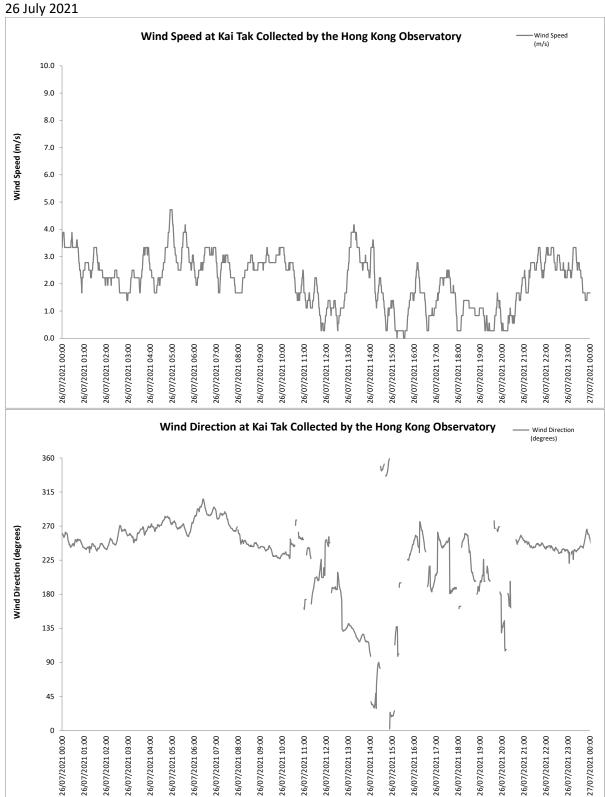

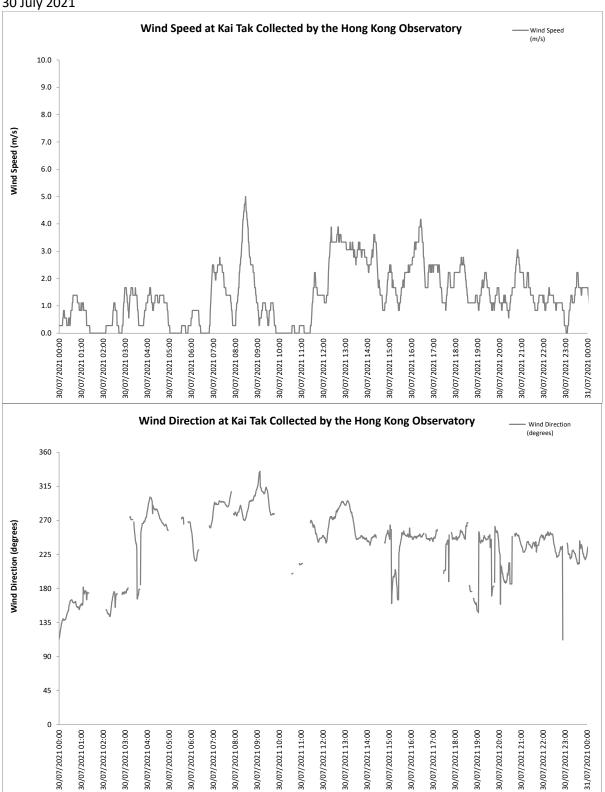

Appendix I. Waste Flow Table

Project: Kai Tak Sport Park
Contract No.: HAB/ KTSP/ 01

Contract Title: Design, Construction and Operation of the Kai Tak Sports Park at Kai Tak, Kowloon City District, Hong Kong

Year of Record: 2019-2021

Monthly Waste Flow Table



Month	Total Quantity	Total		Ad	ctual Quantitie	s of Inert C&D	Materials Ge	nerated Montl	hlv		Actu	ıal Quantitie	es of C&D M	laterials Ge	nerated Moi	nthly	Remarks
	Generated	Quantity	Fxc	cavated Mater		 		excavated Mat			Metals	Metals	Paper /	Plastics	Chemical	Other.	
		Generated (Excluded Excavated Material)	Disposed in Public Fill	Disposed in Sorting Facilities	Others (e.g Reused in the Contract / Other Projects)	Broken Concrete or Construction Waste Collected by Recycled Company	Reused in the Contract	Reused in other Projects	Disposed in Public Fill	Disposed in Sorting Facilities	(steel bar / metal strip) ⁽¹⁾	(aluminum can) ⁽¹⁾	cardboard packaging ⁽¹⁾	(1) & (4)	waste (wasted lubricant oil/ oil container)	e.g. general refuse	
	(in '000kg)	(in '000kg)	(in '000kg)	(in '000kg)	(in '000kg)	(in '000kg)	(in '000kg)	(in '000kg)	(in '000kg)	(in '000kg)	(in '000kg)	(in '000kg)	(in '000kg)	(in '000kg)	(in '000kg)	(in '000kg)	
	a1	a2	b	b	b	С	d	е	f	g	h	i	j	k	1	m	ĺ
Jan-19																	
Feb-19	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	
Mar-19	4960.89	4741.39	219.50	0.00	0.00	0.00	0.00	0.00	0.00	0.00	11.84	0.00	0.00	0.00	0.00	4729.55	
Apr-19	1218.47	1211.81	6.66	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.06	0.00	1211.75	
May-19	87.29	87.29	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.01	0.00	87.28	
Jun-19	80.77	80.77	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.67	0.00	0.08	0.42	0.00	79.61	
Jul-19	2302.16	614.79	1687.37	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.30	0.95	0.00	613.54	
Aug-19	3619.81	280.59	3339.22	0.00	0.00	0.00	0.00	0.00	0.00	0.00	1.77	0.00	0.00	1.29	0.60	276.93	
Sep-19	9840.16	349.65	9490.51	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	1.04	0.60	348.01	
Oct-19	11505.06	543.69	10961.37	0.00	0.00	0.00	0.00	0.00	0.00	0.00	81.95	0.00	1.43	1.15	0.00	459.16	
Nov-19	4718.13	313.84	4404.29	0.00	0.00	0.00	0.00	0.00	0.00	0.00	69.84	0.00	0.24	1.37	0.00	242.39	
Dec-19	5185.14	102.48	5082.66	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	1.63	0.80	100.05	
Jan-20	12107.08	127.05	11980.03	0.00	0.00	0.00	0.00	0.00	0.00	0.00	16.32	0.00	0.57	1.36	0.00	108.80	
Feb-20	18104.96	100.58	13459.32	0.00	4545.06	0.00	0.00	0.00	0.00	0.00	23.64	0.00	0.00	0.96	0.00	75.98	
Mar-20	35699.19	235.99	6615.03	0.00	28848.17	0.00	0.00	0.00	0.00	0.00	90.73	0.00	0.50	1.33	0.80	142.63	
Apr-20	42587.03	137.90	0.00	0.00	42449.13	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	1.10	0.00	136.80	
May-20	64506.51	218.89	0.00	0.00	64287.62	0.00	0.00	0.00	0.00	0.00	47.41	0.00	0.40	1.61	0.00	169.47	
Jun-20	44983.53	337.20	6519.25	0.00	38127.08	0.00	0.00	0.00	0.00	0.00	171.56	0.00	0.58	2.55	0.80	161.71	
Jul-20	43468.97	602.89	0.00	0.00	42866.08	0.00	0.00	0.00	0.00	0.00	377.41	0.01	1.03	2.16	0.00	222.28	
Aug-20	61609.05	1121.82	3771.32	0.00	56715.91	0.00	0.00	0.00	0.00	0.00	861.33	0.35	1.58	2.35	0.00	256.21	
Sep-20	111046.04	730.59	0.00	0.00	110315.45	0.00	0.00	0.00	0.00	0.00	443.46	0.01	1.39	1.87	0.00	283.86	
Oct-20	109678.75	712.61	0.00	0.00	108966.14	0.00	0.00	0.00	0.00	0.00	385.68	0.02	1.00	1.64	0.00	324.27	
Nov-20	135055.14	852.56	0.00	0.00	134202.58	0.00	0.00	0.00	0.00	0.00	362.36	0.01	0.86	2.12	0.60	486.61	
Dec-20	132183.00	1163.51	6981.13	0.00	124038.36	0.00	0.00	0.00	0.00	0.00	390.22	0.08	2.19	1.66	0.00	769.36	
Jan-21	78129.57	1315.84	4253.06	0.00	72560.67	0.00	0.00	0.00	0.00	0.00	393.38	0.05	2.68	1.96	0.00	917.77	
Feb-21	70013.03	912.17	10767.60	0.00	58333.26	0.00	0.00	0.00	0.00	0.00	386.46	0.07	1.24	0.64	0.00	523.76	
Mar-21	51743.65	1314.82	18740.08	0.00	31688.75	0.00	0.00	0.00	0.00	0.00	320.13	0.12	2.08	2.45	0.00	990.03	
Apr-21	16431.34	1411.19	0.00	0.00	15020.15	0.00	0.00	0.00	0.00	0.00	467.54	0.02	1.84	1.70	0.00	940.09	
May-21	39675.06	1610.42	0.00	0.00	38064.64	0.00	0.00	0.00	0.00	0.00	442.35	0.00	1.31	2.81	0.00	1163.95	
Jun-21	56589.31	1812.39	0.00	0.00	54776.92	0.00	0.00	0.00	0.00	0.00	353.07	0.02	1.10	1.37	0.00	1456.83	
Jul-21	18260.59	2540.62	0.00	0.00	15719.97	0.00	0.00	0.00	0.00	0.00	383.64	0.00	0.00	1.31	0.00	2155.67	
Total	1185389.66	25585.33	118278.40	0.00	1041525.94	0.00	0.00	0.00	0.00	0.00	6082.76	0.75	22.41	40.87	4.20	19434.35	

Total C&D waste generated

Total C&D waste generated (excluding excavated materials)

Total recycled C&D waste

Notes:

% of recycled C&D waste for BEAM Plus MA10 or MA11

(1) Metal, paper & plastic were collected by recycler.

- (2) The performance target of waste recycling are specified in the Contract.
- (3) The waste flow table shall also include C&D materials that are specified in the Contract to be imported for use at the Site.
- (4) Plastics refer to plastic bottles/ containers, plastic/ foam from packaging material.
- (5) Broken concrete for recycling into aggregates.
- (6) Excavated materials/waste will NOT be considered as part of construction waste. It should be excluded in the calculation.
- (7) Disposal of inert waste to public fill or sorting facilities will NOT be considered as recycled waste.
- (8)Disposal record for June 2021 and July 2021 have been updated according to the latest information from contractor in July 2021.
- (9) Recycling record for metals, papers and plastics have been updated according to the latest information from contractor in July 2021.

1185389.66 tonne a1=b+c+d+e+f+g+h+i+j+k+l+m 25585.33 tonne a2=c+d+e+f+g+h+i+j+k+l+m 6146.78 tonne a3=c+d+e+h+i+j+k 24.02 % a4=a3/a2 x 100%

Contract No. BD3/4091/19

Proposed Composite Development at N.K.I.L. 6607 Shing Kai Road, Kai Tak, Kowloon



Monthly Summary Waste Flow Table for 2020

			Act	ual Quantities	s of Inert C&I	O Materials G	enerated Mor	nthly						Actual Quant	ities of C&D	Wastes Gene	rated Monthly	<i>y</i>		
Month	ll .	Quantity erated		Concrete Vote 2)	Reuse Con	d in the tract		in other jects		sed as ic Fill	Me	etals	Paper / c	ardboard aging		stics Note 1)	Chemic	al Waste		her, eral refuse
	(in '0	00 m ³)	(in '00	00 m ³)	(in '0	00 m ³)	(in '0	00 m ³)	(in '00	00 m ³)	(in '0	00 kg)	(in '0	00 kg)	(in '0	00 kg)	(in '0	00 m ³)	(in '0	00 m ³)
	Est.	Act.	Est.	Act.	Est.	Act.	Est.	Act.	Est.	Act.	Est.	Act.	Est.	Act.	Est.	Act.	Est.	Act.	Est.	Act.
Jan																				
Feb																				
Mar																				
Apr									\setminus					\setminus						
May									\setminus					\setminus						
Jun																				
Sub-total	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
Jul	-	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
Aug	-	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
Sep	0.20	0.11	0.00	0.00	0.00	0.00	0.00	0.00	0.20	0.11	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
Oct	0.80	0.99	0.00	0.00	0.00	0.00	0.00	0.00	0.80	0.99	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
Nov	0.80	1.63	0.00	0.00	0.00	0.00	0.00	0.00	0.80	1.63	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
Dec	0.80	1.83	0.00	0.00	0.00	0.00	0.00	0.00	0.80	1.83	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
Total	2.60	4.56	0.00	0.00	0.00	0.00	0.00	0.00	2.60	4.56	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00

Notes:

- (1) Plastics refer to plastic bottles / container, plastic sheets / foam from packaging material.
- (2) Broken concrete for recycling into aggregates.

Contract No. BD3/4091/19

Proposed Composite Development at N.K.I.L. 6607 Shing Kai Road, Kai Tak, Kowloon



Monthly Summary Waste Flow Table for 2021

			Act	ual Quantities	of Inert C&I	O Materials G	enerated Mor	nthly						Actual Quant	ities of C&D	Wastes Gene	rated Monthly	ý		
Month	Total Q Gene		Broken (see N	Concrete lote 2)	Reuseo Con	d in the tract	1	in other jects	Dispo Publi	sed as	Me	etals	Paper / c pack	ardboard aging		stics Note 1)	(incld. AC	al Waste CM, DCM, at oil)		her, ral refuse
	(in '00	00 m ³)	(in '00	00 m ³)	(in '00	00 m ³)	(in '00	00 m ³)	(in '00	00 m ³)	(in '0	00 kg)	(in '00	00 kg)	(in '00	00 kg)	(in '0	00 m ³)	(in '0	00 m ³)
	Est.	Act.	Est.	Act.	Est.	Act.	Est.	Act.	Est.	Act.	Est.	Act.	Est.	Act.	Est.	Act.	Est.	Act.	Est.	Act.
Jan	0.80	1.32	0.00	0.00	0.00	0.00	0.00	0.00	0.80	1.32	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
Feb	0.80	1.10	0.00	0.00	0.00	0.00	0.00	0.00	0.80	1.10	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
Mar	0.80	0.76	0.00	0.00	0.00	0.00	0.00	5.63	0.80	0.76	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
Apr	17.10	9.30	0.00	0.00	0.00	0.00	0.00	7.97	17.10	1.32	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
May	17.10	18.87	0.00	0.00	0.00	0.00	0.00	18.87	17.10	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
Jun	18.10	20.37	0.00	0.00	0.00	0.00	0.00	19.06	18.10	1.30	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
Sub-total	54.70	51.71	0.00	0.00	0.00	0.00	0.00	51.53	54.70	5.80	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
Jul	17.10	13.75	0.00	0.00	0.00	0.00	0.00	11.75	17.10	2.01	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
Aug		\setminus	\setminus	\setminus	\setminus	\setminus				\setminus				\setminus						
Sep				\setminus																
Oct				\setminus										\setminus						
Nov		\backslash			\backslash															
Dec																				
Total	71.80	65.46	0.00	0.00	0.00	0.00	0.00	63.28	71.80	7.81	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00

Notes:

- (1) Plastics refer to plastic bottles / container, plastic sheets / foam from packaging material.
- (2) Broken concrete for recycling into aggregates.
- (3) All quantity of "Disposed to Public Fill" in June 2021 are Cat. L Marine Deposit under Dumping Permit EP/MD/21-078.
- (4)The quantity of "Disposed to Public Fill" in July 2021 included 1.25 ("000m3") Cat. L Marine Deposit under Dumping Permit EP/MD/21-078.

Appendix J. Environmental Licences and Permits

Table J.1: Summary of Environmental Licences and Permits Status (KTSP)

Item No.	Type of Permit / Licence	Reference No.	Application Date	Valid from	Valid until	Remark
1	Environmental Permit under EIAO	EP-544/2017	21 Aug 2017	8 Sep 2017	N/A	Issued
2	Construction Dust Notification under APCO	441733	25 Jan 2019	29 Jan 2019	N/A	N/A
3	Construction Waste Disposal Account (Main)	7033182	12 Feb 2019	12 Feb 2019	N/A	N/A
4	Construction Waste Disposal Account (Vessel)	7033555	1 Apr 2021	13 Apr 2021	11 Aug 2021	Issued
5	Registration as a Chemical Waste Producer	WPN5213- 286-H3906- 02	29 Jan 2019	12 Feb 2019	N/A	N/A
6	Discharge Licence under WPCO	WT00034082 -2019	12 Jun 2019	26 Jun 2019	30 Jun 2024	Issued
7	Construction Noise Permit (Percussive Piling)	PP-RE0015- 21	13 May 2021	3 Jun 2021	23 Nov 2021	Issued
8	Construction Noise Permit (Construction Works, Shing Kai Road)	GW-RE0365- 21	24 Mar 2021	19 Apr 2021	16 Jul 2021	Superseded by GW- RE0598-21 on 16 Jul 2021
9	Construction Noise Permit (Construction Works, Barging Point)	GW-RE0378- 21	12 Apr 2021	21 May 2021	10 Nov 2021	Issued
10	Construction Noise Permit (Construction Works, Northern Site)	GW-RE0441- 21	19 Apr 2021	11 May 2021	2 Nov 2021	Issued
11	Construction Noise Permit (Construction Works, Southern Site)	GW-RE0444- 21	19 Apr 2021	11 May 2021	2 Nov 2021	Issued
12	Construction Noise Permit (Construction Works, Shing Kai Road)	GW-RE0598- 21	1 Jun 2021	16 Jul 2021	13 Oct 2021	Issued

Table J.2: Summary of Environmental Licences and Permits Status (H/O Development)

Item No.	Type of Permit / Licence	Reference No.	Application Date	Valid from	Valid until	Remark
1	Environmental Permit under EIAO	EP-544/2017	21 Aug 2017	8 Sep 2017	N/A	Issued
2	Construction Dust Notification under APCO	458255	17 Jul 2020	17 Jul 2020	N/A	N/A
3	Construction Waste Disposal Account (Main)	7037993	5 Aug 2020	5 Aug 2020	N/A	N/A
4	Registration as a Chemical Waste Producer	WPN5113- 286-C1286- 03	17 Jul 2020	10 Sep 2020	N/A	N/A
5	Discharge Licence under WPCO	N/A	17 Jul 2020	22 Mar 2021	31 Mar 2026	Issued
6	Marine Dumping Permit under DASO	EP/MD/21- 087	23 Nov 2020	5 Jul 2021	4 Aug 2021	Issued

Appendix K. Environmental Mitigation Measures Implementation Status

Air Quality - Recommended Mitigation Measures

Air Quality Mitigation Measures during construction		entation itus
	KTSP	H/O
Good housekeeping to minimize dust generation, e.g. by properly handling and storing dusty materials	✓	✓
 Store cement in shelter with 3 sides and the top covered by impervious materials if the stack exceeds 20 bags 	Р	✓
 Cement delivered in bulk should be stored in a closed silo fitted with an audible high level alarm which is interlocked with the material filling line and no overfilling is allowed 	N/A	N/A
 Loading, unloading, transfer, handling or storage of bulk cement should be carried out in a totally enclosed system or facility, and any vent or exhaust should be fitted with an effective fabric filter or equivalent air pollution control system 	✓	N/A
 Dusty materials (e.g. debris) should be wetted by misting / water-spraying before any loading, unloading, transfer or transport operation 	✓	✓
 Any skip hoist for material transport should be fully enclosed by impervious sheeting 	✓	✓
 Surfaces where any pneumatic or power-driven drilling, cutting, polishing or other mechanical breaking operation takes place should be sprayed with water or a dust suppression chemical continuously 	✓	✓
 Any area that involves demolition activities should be sprayed with water or a dust suppression chemical immediately prior to, during and immediately after the activities to maintain the entire surface wet 	✓	✓
Excavation area should be minimized as far as possible	✓	✓
 Stockpile of dusty materials should not be extended beyond the pedestrian barriers, fencing or traffic cones 	✓	✓
 Excavated or stockpile of dusty material should be covered entirely by impervious sheeting or sprayed with water to maintain the entire surface wet, and then removed, backfilled or reinstated where practicable within 24 hours of the excavation or unloading 	Р	✓
 Dusty materials remaining after a stockpile is removed should be wetted with water and cleared from the surface of roads 	✓	✓
Properly fitted side and tail boards are necessary for any vehicle with open load area	✓	✓
 While transporting materials that potentially create dust (e.g. debris), materials should not be loaded higher than side and tail boards, and should be fully covered by tarpaulin or similar materials which extent at least 300 mm over the edges of the side and tail boards to prevent leakage. 	✓	✓
Limit the maximum vehicle speed within the site to 10km/hr	✓	✓
Haulage and delivery vehicles should be confined to designated roads	✓	✓
Every main haul road should either be1.) paved with concrete and kept clear of dusty materials, or2.) sprayed or watered to maintain the entire road surface wet	✓	✓
All on-site unpaved roads should be compacted and kept free of lose materials as possible	✓	✓
 Provide vehicle washing (e.g. wheel washing bay & high pressure water jet where practicable) at every vehicle exit point for cleaning vehicle body and wheels 	✓	✓
 The vehicle washing area and the road between washing area and site exit should be paved with concrete, bituminous or other hardcores 	✓	✓
 The portion of any road leading only to construction site that is within 30m of a vehicle entrance or exit should be kept clear of dusty materials. 	✓	✓
 Dusty materials on every vehicle's body and wheels should be removed in washing area before leaving the site 	✓	✓

Regular maintenance of all plant equipment	✓	✓
Throttle down or switch off unused machines or machine in intermittent use	✓	✓
 If the site is adjacent to area where accessible to the public (e.g. road and service lane etc.), hoarding of not less than 2.4 m high from ground level should be erected along the adjoining the entire length of that portion of the site boundary, except for a site entrance or exit. The hoarding should be well maintained throughout the construction period. 	✓	✓
 Where a scaffolding is erected around the perimeter of a building under construction, effective dust screens, sheeting or netting should be provided to enclose the scaffolding from the ground floor level of the building, or a canopy should be provided from the first floor level up to the highest level of the scaffolding 	✓	N/A
 Exposed earth should be properly treated by compaction, turfing, hydroseeding, vegetation planting or sealing with latex, vinyl, bitumen, shortcrete or other suitable surface stabiliser within six months after the last construction activity on the construction site or part of the construction site where the exposed earth lies 	✓	✓
Carry out air quality monitoring throughout the construction period	✓	✓
Carry out weekly site inspection to audit the implementation of mitigation measures	✓	✓
 Regular watering once per hour on exposed worksites and haul road with an equivalent intensity of not less than 1.3L/m3 to achieve 91.7% dust removal efficiency. 	✓	✓
 Provision of electrical vehicle (EV) charging facilities in at least one-third of the car parking spaces for private cars. Provision of EV charging enabling facilities in all car parking spaces provided for private cars. 	✓	N/A
Non-Road Mobile Machinery (NRMMs)		
 All NRMMs operated on-site are approved or exempted (as the case may be) and affixed with the requisite approval/exemption labels under the Air Pollution Control (Non-road Mobile Machinery) (Emission) Regulation or are in the process of application for such approval/exemption during the relevant grace period. 	Р	√

Noise - Recommended Mitigation Measures

Noise Mitigation Measures during construction	Implementatio Status		
	KTSP	H/O	
 Adopt good site practice, such as throttle down or switch off equipment unused or intermittently used between works 	✓	✓	
Regular maintenance of equipment to prevent noise emission due to impair	✓	✓	
 Position mobile noisy equipment in locations away from NSRs and point the noise sources to directions away from NSRs 	✓	✓	
Use silencer or muffler for equipment	✓	✓	
Make good use structures for noise screening	✓	✓	
 Use Quality Powered Mechanical Equipment (QPME) and quiet equipment which produces lower noise level. 	✓	✓	
Erect movable noise barrier of 3m height to shed large plant equipment (e.g. breaker, backhoe & mobile crane) or hand-held items (e.g. poker, wood saw, power rammer & compactor) near low-rise NSR. Where necessary, special design (e.g. with noise absorbing material or bend top) should be adopted. The barrier's length should be at least five times greater than its height, and the minimum surface density is 10 kg/m2. Alternatively, acoustic shed, enclosure or silencer (for generator, air compressor and concrete pump) or acoustic mat (for piling) can be adopted.	Р	N/A	
Carry out regular site inspection to audit the implementation of mitigation measures	✓	✓	
Carry out noise monitoring throughout the construction period	✓	✓	

Water Quality - Recommended Mitigation Measures

Water Quality Mitigation Measures during co	ter Quality Mitigation Measures during construction		ntation us
		KTSP	H/O
Practices outlined in ProPECC PN 1/94 Constructi	on Site Drainage should be adopted.	✓	Р
 Install perimeter channels in the works areas to int commencement of any earthwork 	ercept runoff from boundary prior to the	✓	✓
 To prevent storm runoff from washing across expo provided. 	sed soil surfaces, intercepting channels should be	✓	✓
 Drainage channels are required to convey site run of regular cleaning and maintenance to ensure the construction period. 		√	✓
 Any practical options for the diversion and realignmental requirements 	nent of drainage should comply with both	✓	✓
 Minimum distances of 100 m should be maintained runoff and the existing WSD saltwater intake and E 		✓	✓
 The following good site measures should be adopt operated by the MTR SCL Project: - All vessels sh maintained between vessels and the seabed in all generated by turbulence from vessel movement or - All hopper barges should be fitted with tight fitting of material. 	ould be sized so that adequate clearance is tide conditions, to ensure that undue turbidity is not propeller wash.	N/A	N/A
- Construction activities should not cause foam, oil to be present on the water within the site.	grease, scum, litter or other objectionable matter		
 Loading of barges and hoppers should be control surrounding water. 	led to prevent splashing of material into the		
 Barges or hoppers should not be filled to a level t water during loading or transportation. Whole cons 	•		
 The runoff and wastewater generated from the wordstandards listed in the TM-DSS. 	ks areas should be treated so that it satisfies all the	✓	✓
Reuse and recycling of the treated effluent from containing the second sec	onstruction site runoff.	✓	✓
Weekly site audit should be carried out to check the implementation status of the recommended water quality impact mitigation measures throughout construction period.		✓	✓
 The construction programme should be properly p seasons. 	lanned to minimise soil excavation, if any, in rainy	✓	✓
 Any exposed soil surfaces should be properly prote 	ected to minimise dust emission.	✓	
In areas where a large amount of exposed soils ex	ist, earth bunds or sand bags should be provided.		✓
In areas where a large amount of exposed soils ex	iot, carar barrae or carra bage erroara be provided.	✓	✓ ✓
		√	
 Exposed stockpiles should be covered with tarpau The stockpiles of materials should be placed at loc 	in or impervious sheets at all times.		✓
 Exposed stockpiles should be covered with tarpau The stockpiles of materials should be placed at loc avoid releasing materials into the water bodies. 	in or impervious sheets at all times. ations away from any stream courses so as to	✓	√ √
 Exposed stockpiles should be covered with tarpau The stockpiles of materials should be placed at loc avoid releasing materials into the water bodies. Final surfaces of earthworks should be compacted 	in or impervious sheets at all times. ations away from any stream courses so as to and protected by permanent work.	✓	√ √ √
 Exposed stockpiles should be covered with tarpau The stockpiles of materials should be placed at loc avoid releasing materials into the water bodies. Final surfaces of earthworks should be compacted Haul roads should be paved with concrete and the 	in or impervious sheets at all times. ations away from any stream courses so as to and protected by permanent work. temporary access roads protected using crushed site exits to ensure that earth, mud and debris	✓ ✓	√ √ √
 Exposed stockpiles should be covered with tarpau The stockpiles of materials should be placed at loc avoid releasing materials into the water bodies. Final surfaces of earthworks should be compacted Haul roads should be paved with concrete and the stone or gravel, wherever practicable. Wheel washing facilities should be provided at all 	in or impervious sheets at all times. ations away from any stream courses so as to and protected by permanent work. temporary access roads protected using crushed site exits to ensure that earth, mud and debris icles.	✓ ✓ ✓	
 Exposed stockpiles should be covered with tarpau The stockpiles of materials should be placed at loc avoid releasing materials into the water bodies. Final surfaces of earthworks should be compacted Haul roads should be paved with concrete and the stone or gravel, wherever practicable. Wheel washing facilities should be provided at all would not be carried out of the works areas by veh Good site practices should be adopted to keep the 	in or impervious sheets at all times. ations away from any stream courses so as to and protected by permanent work. temporary access roads protected using crushed site exits to ensure that earth, mud and debris icles. e site dry and tidy, such as clean the rubbish and		\(\) \(\) \(\) \(\) \(\) \(\)
 Exposed stockpiles should be covered with tarpau The stockpiles of materials should be placed at loc avoid releasing materials into the water bodies. Final surfaces of earthworks should be compacted Haul roads should be paved with concrete and the stone or gravel, wherever practicable. Wheel washing facilities should be provided at all would not be carried out of the works areas by veh Good site practices should be adopted to keep the litter on the construction sites. Adequate temporary site drainage and pumping s Provide sufficient temporary toilets in the works ar 	in or impervious sheets at all times. ations away from any stream courses so as to and protected by permanent work. temporary access roads protected using crushed site exits to ensure that earth, mud and debris icles. e site dry and tidy, such as clean the rubbish and hould be provided, if necessary.		

 Contractor must register as a chemical waste producer if chemical wastes would be produced from the construction activities. The Waste Disposal Ordinance (Cap 354) and its subsidiary regulations in particular the Waste Disposal (Chemical Waste) (General) Regulation should be observed and complied with for control of chemical wastes. 	√	√
 Any service shop and maintenance facilities should be located on hard standings within a bunded area, and sumps and oil interceptors should be provided. Maintenance of vehicles and equipment involving activities with potential for leakage and spillage should only be undertaken within the areas appropriately equipped to control these discharges. 	√	N/A
Clean the construction sites on a regular basis.	✓	✓
 Oil interceptor in car parking area shall be designed and constructed according to Practice Note for Authorized Persons, Registered Structural Engineers and Registered Geotechnical Engineers, APP- 46 (PNAP 124) 	N/A	N/A
 Provide two sequential storage tanks to contain surface water with residual fertilizers and pesticides and third holding tank for incidental rainstorm 	N/A	N/A
Sewerage and Sewage Treatment Implications		
 Implementation of Sewer No. 1 and Sewer No.2 as proposed in Sections 7.2.2 - 7.2.3 of the EIA Report 	✓	✓

Waste Management - Recommended Mitigation Measures

Waste Management Mitigation Measures during construction	Implementation Status	
	KTSP	H/O
 Inert C&D materials (or public fills) will be used to form the ramps and other filling area as far as civil engineering design permits. 	✓	✓
 The contractor should formulate waste management measures on waste minimization, storage, handling and disposal in a Waste Management Plan as part of Environmental Management Plan. 	✓	✓
 Adopt good site practice as follows: Provide training to workers on site cleanliness, waste management (waste reduction, reuse and recycle) and chemical handling procedures Provide sufficient waste collection points and regular removal Cover waste materials with tarpaulin or in enclosure during transportation Maintain drainage systems, sumps and oil interceptors Sort out chemical waste for proper handling and treatment onsite or offsite 	Р	√
 Adopt waste reduction measures as follows: - Allocate area/containers for sorting, recovering and storing waste for reuse, recycle or disposal (e.g. demolition debris and excavated materials, general refuse like aluminium cans.) Remove waste from the Site for sorting once generated if no suitable space can be identified. - Allocate area for proper storage of construction materials to prevent contamination - Minimize wastage through careful planning and avoiding over-purchase of construction materials 	√	√
 Store waste materials properly as follows: Avoid contamination by proper handling and storing waste Prevent erosion by covering waste Apply water spray on excavated materials Maintain and clean storage area regularly Sort and stockpile different materials at designated location to enhance reuse 	Р	√
 Apply for relevant waste disposal permits in accordance with the Waste Disposal Ordinance (Cap. 354), Waste Disposal (Charges for Disposal of Construction Waste) Regulation (Cap. 345) and the Land (Miscellaneous Provisions) Ordinance (Cap. 28), Dumping at Sea Ordinance (Cap. 466). 	√	✓
 Hire licensed waste disposal contractors for waste collection and removal. Dispose waste at licensed waste disposal facilities. 	✓	✓
 Implement trip-ticket system for recording the amount of waste generated, recycled and disposed, including chemical wastes 	✓	✓
 Reduce water content in wet spoil generated from piling work by mixing with dry materials. Only dispose treated spoil with less than 25% dry density to Public Fill Reception Facilities 	✓	✓

Dispose dry waste or waste with less than 70% water content by weight to landfill		✓
 Follow the Code of Practice on the Packaging, Labelling and Storage of Chemical Waste as follows: Store chemical wastes with suitable containers. Seal and maintain the container to avoid leakage or spillage during storage, handling and transport Label chemical waste containers in both English and Chinese with instructions in accordance to Schedule 2 of the Waste Disposal (Chemical Waste) (General) Regulation The container capacity should be smaller than 450 litres unless agreed by the EPD 	√	√
Comply with the requirement of the chemical storage area:	Р	✓
- Store only chemical waste and label clearly the chemical characters of the waste		
- Have at least 3 sides enclosed and protected from rainfall with cover		
- Provide sufficient ventilation		
- Have impermeable floor and has bunds to contain 110% of the capacity of the largest container or 20% of the total volume of the stored waste in the area, whichever is larger		
- Adequately spaced incompatible materials		
 Transfer used lubricants, waste oils and other chemicals to oil recycling companies, if possible, and empty oil drums for reuse or refill. No direct or indirect discharge is permitted 	✓	✓
 Hire licensed chemical waste disposal contractors for waste collection and removal. Dispose chemical waste at the approved Chemical Waste Treatment Centre at Tsing Yi or other licensed facility 	✓	✓
 Hire reputable waste collector to separately collect and dispose general refuse from other wastes. Cover the waste to prevent being blown away 	✓	✓
 The hauling of C&D materials shall follow established environmental mitigation measures as stated in Practice Note for Registered Contractors No. 17 "Control of Environmental Nuisance from Construction Sites" issued by the Buildings Department 	✓	✓
 Provide recycling bins for sorting out recyclables for collection by recycling companies. Non- recyclables should be removed to designated landfills every day by licensed collectors to prevent environmental and health nuisance. 	✓	✓
 Organize training and reminders to site staff on waste minimization through avoidance and reduction, reusing and recycling 	✓	✓
 Bentonite slurry which will not be reused shall be disposed of from the Site as soon as possible. Residual used dewatered bentonite slurry should be disposed to a public filling area and liquid bentonite slurry if mixed with inert fill material should be disposed to a public filling area. 	N/A	N/A
• If chemical wastes were to be produced at the construction site, the Contractor would be required to register with the EPD as a Chemical Waste Producer, and to follow the guidelines stated in the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes. Good quality containers compatible with the chemical wastes should be used, and incompatible chemicals should be stored separately. Appropriate labels should be securely attached on each chemical waste container indicating the corresponding chemical characteristics of the waste such as explosive, flammable, oxidizing, irritant, toxic, harmful, corrosive, etc. The Contractor shall use a licensed collector to transport the chemical wastes.	√	√
 The licensed collector shall deliver the waste to the Chemical Waste Treatment Centre at Tsing Yi, or other licensed facility, in accordance with the Waste Disposal (Chemical Waste) (General) Regulation 		
Carry out weekly site inspection to check the implementation status of the recommended waste management measures.	✓	✓
 The barging of C&DM for this Project shall use the existing Kai Tak Barging Facility (KTBF), or otherwise approved by the Director. 	N/A	N/A

Ecology – Recommended Mitigation Measures

Ecology Mitigation Measures during construction		Implementation Status	
	KTSP	H/O	
Erection of hoarding, fencing or provision of clear demarcation of work zone	✓	✓	
 Designate areas for placement of equipment, building materials and wastes away from drainage channels 	✓	✓	

 Carry out weekly site inspection to check the implementation status and the effectiveness of the proposed mitigation measures 	✓	✓	
andscape and Visual – Recommended Mitigation Measures			
andscape and Visual Mitigation Measures during construction		Implementation Status	
	KTSP	H/O	
 Construction Lighting Control All security floodlights for construction sites should be equipped with adjustable shields, frosted diffusers and reflective covers, and be controlled to minimize light pollution and night-time glare to the visual sensitive receivers (VSRs). 	✓	N/A	
 Temporary Landscape Treatments Including vertical greening, pot planting and application of green roofing to site offices, Hydroseeding of site formation areas and short term greening of site boundaries and land not immediately developed. 	√	N/A	
 Decoration of Hoarding Erection of screen hoardings should be designed appropriately to be compatible with the existing urban context, either brightly and imaginatively or with visually unobtrusive design and colours where more appropriate. 	✓	✓	
 All security floodlights for construction sites shall be equipped with adjustable shield, frosted diffusers and reflective covers, and be carefully controlled to minimize light pollution and night-time glare to nearby receivers 	✓	N/A	
Site inspection should be undertaken once every two weeks.	✓	✓	
 Compensatory Tree Planting A new parkland area is created in the project development to be used for the implementation of compensatory tree planting to offset the net loss of key landscape resources. It is recommended that 340 trees be planted in this regard and a compensatory tree planting proposal outlining the locations of tree compensation will be submitted separately in seeking relevant government department's approval in accordance with DEVB TC No.7/2015. 	N/A	N/A	

Other - Recommended Mitigation Measures

• Relevant environmental permits/licences should be posted at all vehicle entrances/exits.

Legend:

Implemented Not implemented Partially implemented Not applicable

Appendix L. Statistics on Environmental Complaints, Notification of Summons and Successful Prosecutions

Table L.1: Statistics on Environmental Complaints, Notifications of Summons and Successful Prosecutions

Reporting Period	Complaints	Notifications of Summons	Successful Prosecutions
This reporting period (Jul 2021)	0	0	0
From commencement data of construction to end of reporting month	16	0	0