

**Contract No. SS M333**

**Reprovisioning of Diamond Hill  
Crematorium**

**Monthly EM&A Report for March 2005**

April 2005

*Florence Yuen*  
Reviewed by (PM):

*Tom Kong*  
Checked by:

*[Signature]*  
Approved by:  
Environmental Team Leader

Report Version: <u>Revision 0</u>	Date of Submission: <u>13 April 2005</u>
-----------------------------------	--


The information contained in this report is, to the best of our knowledge, correct at the time of printing. The interpretation and recommendations in the report are based on our experience, using reasonable professional skill and judgment, and based upon the information that was available to us. These interpretations and recommendations are not necessarily relevant to any aspect outside the restricted requirements of our brief. This report has been prepared for the sole and specific use of our client and MEMCL accepts no responsibility for its use by others.


This report is copyright and may not be reproduced in whole or in part without prior written permission.

**MAUNSELL ENVIRONMENTAL MANAGEMENT CONSULTANTS LTD**

11/F, Grand Central Plaza, Tower 2, 138 Shatin Rural Committee Road, Shatin, NT, Hong Kong

Tel: (852) 2893 1551 Fax: (852) 2891 0305 Email: [mem@maunsell.aecom.com](mailto:mem@maunsell.aecom.com)



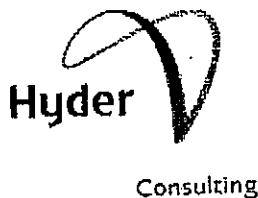

安誠工程顧問有限公司  
香港灣仔  
皇后大道東163號  
合和中心47樓

Hyder Consulting Limited  
47/F Hopewell Centre,  
183 Queen's Road East,  
Wan Chai, Hong Kong

電話: (852) 2911 2233  
圖文傳真: (852) 2805 5028  
電子郵件: hyder@hyder.com.hk  
網址: www.hyderconsulting.com

Tel : (852) 2911 2233  
Fax : (852) 2805 5028  
Email: hyder@hyder.com.hk  
Website: www.hyderconsulting.com

Hyder Consulting Limited is incorporated in Hong Kong with limited liability.  
COI Number 126012

13 April 2005

Architectural Services Department  
Queensway Government Offices  
66 Queensway  
Hong Kong

**BY POST & FAX (2524 8194)**

Your  
Ref:

Our 1148-06/E05-26534  
Ref:

For attention of: Mr Michael Mak

Dear Michael

**Reprovisioning of Diamond Hill Crematorium  
Monthly EM&A Report for March 2005 (Revision 0)**

We refer to the email on 7 April 2005 from MEMCL copied to us enclosing the draft monthly EM&A Report for March 2005 (Revision 0) and subsequent emails on 13 April 2005 from MEMCL enclosing the revised EM&A Report.

We have no further comment and hereby verified the captioned EM&A report.

Should you have any queries, please do not hesitate to contact the undersigned on 2911 2719 or Adi Lee on 2911 2729.

Yours sincerely

Coleman Ng  
Independent Environmental Checker  
HYDER CONSULTING LIMITED

cc MEMCL – Mr. Y. T. Tang/Ms Florence Yuen  
CRCCL – Mr. Eric To

(Fax: 2891 0305)  
(Fax: 2827 2921)

CN/AL





## TABLE OF CONTENTS

EXECUTIVE SUMMARY .....	III
1. INTRODUCTION.....	1
Background .....	1
Scope of Report .....	1
Project Organisation.....	1
Environmental Status in the Reporting Month .....	1
Summary of EM&A Requirements.....	1
2. AIR QUALITY .....	2
Monitoring Requirements .....	2
Monitoring Equipment.....	2
Monitoring Parameters, Frequency and Duration .....	2
Monitoring Locations.....	2
Monitoring Methodology .....	3
Results and Observations.....	4
3. NOISE .....	5
Monitoring Requirements .....	5
Monitoring Equipment.....	5
Monitoring Parameters, Frequency and Duration .....	5
Monitoring Locations.....	5
Monitoring Methodology .....	6
Results and Observations.....	6
4. ENVIRONMENTAL SITE INSPECTION.....	7
Site Inspections.....	7
Review of Environmental Monitoring Procedures.....	7
Advice on Waste Management Status .....	7
Status Environmental Licences and Permits .....	8
Implementation Status of Environmental Mitigation Measures .....	8
Summary of Exceedances of Environmental Quality Performance Limit.....	9
Summary of Environmental Complaints, Notifications of Summons and Successful Prosecutions .....	9
5. FUTURE KEY ISSUES .....	9
Key Issues for Coming Month .....	9
Environmental Monitoring and Audit Schedule for the Coming Months .....	9
6. CONCLUSIONS AND RECOMMENDATIONS .....	9
Conclusions.....	9
Recommendations .....	10

### List of Tables

Table 2.1	Air Quality Monitoring Equipment .....	2
Table 2.2	Air Quality Monitoring Parameters, Frequency and Duration .....	2
Table 2.3	Locations of Air Quality Monitoring Stations .....	2
Table 2.4	Summary of Impact 1-hour TSP Monitoring Results.....	4
Table 2.5	Summary of Impact 24-hour TSP Monitoring Results.....	5
Table 3.1	Noise Monitoring Equipment .....	5
Table 3.2	Noise Monitoring Parameters, Frequency and Duration.....	5
Table 3.3	Locations of Noise Monitoring Stations.....	6
Table 3.4	Summary of Impact Noise Monitoring Results during 07:00 – 19:00 on Normal Weekdays ...	7
Table 4.1	Summary of Waste Disposal in The Month.....	8

### List of Figures

Figure 1.1	Project Organisation for Environmental Management
Figure 1.2	Layout of Work Site
Figure 2.1	Locations of Air Quality Monitoring Stations
Figure 3.1	Locations of Construction Noise Monitoring Stations
Figure 4.1	Complaint Flow Diagram

### Appendices

Appendix A	Key Contacts of Environmental Personnel
Appendix B	Construction Programme
Appendix C	Environmental Action and Limit Levels
Appendix D	Environmental Monitoring and Audit Schedules
Appendix E	Calibration Details
Appendix F	Air Quality Monitoring Results and Graphical Presentation
Appendix G	Noise Monitoring Results and Graphical Presentation
Appendix H	Summary of Weekly Environmental Site Inspection Observations
Appendix I	Status of Environmental Permits/Licences
Appendix J	Implementation Schedule of Mitigation Measures
Appendix K	Event and Action Plans

## EXECUTIVE SUMMARY

### Introduction

Maunsell Environmental Management Consultants Limited (MEMCL) is the designated Environmental Team (ET) for "Reprovisioning of Diamond Hill Crematorium" (The Project). This is the fifth monthly Environmental Monitoring and Audit (EM&A) report prepared by MEMCL for the Project. The EM&A programme for the Project commenced on 29 October 2004. This report documents the findings of EM&A Works conducted in the month of March 2005 (1 to 31 March 2005).

As informed by the Contractor, construction activities in the reporting period were:

- Hoarding erection;
- Underground utilities construction;
- Backfilling and concreting of road slab and pavement;
- Power changeover of the new temporary transformer room; and
- Demolition of pavilion, toilet and superstructure of existing transformer room.

A summary of monitoring and audit activities conducted in the reporting period is listed below:

1-hour TSP monitoring	15 sessions
24-hour TSP monitoring	6 sessions
Daytime noise monitoring	4 sessions
Environmental site inspection	5 sessions

### Breaches of Action and Limit Levels

#### *Air Quality*

All 1-hour and 24-hour TSP monitoring results recorded in the month complied with the Action and Limit Levels.

#### *Construction Noise*

All noise monitoring results recorded in the month complied with the Action and Limit Levels.

### Implementation Status of Environmental Mitigation Measures

In general, the Contractor satisfactorily implemented all the required mitigation measures and was reasonably responsive to the ET's recommendations on any discrepancy observed during the weekly environmental site inspection.

### Environmental Complaints, Notification of Summons and Successful Prosecutions

No environmental complaint, notification of summons or successful prosecution was received or made against this Project in the month.

### Reporting Changes

No reporting change was required in the month.

### Future Key Issues

Key issues to be considered in the coming month include:

- Generation of dust from activities on-site;
- Noise impact from operating equipment and machinery on-site;
- Generation of site surface runoffs and wastewater from activities on-site;
- Storage and disposal of general refuse and construction waste from activities on-site;

- Management of chemicals and avoidance of oil spillage.

## 摘要

## 簡介

茂盛環境管理顧問有限公司乃「重置鑽石山火葬場」[下稱(工程項目)]的指定環境小組。本冊是茂盛為工程項目製作的第五份每月環境監察及審核報告。工程項目的環境監察及審核由二零零四年十月廿九日開始、本報告記錄了二零零五年三月份(二零零五年三月一日至三月三十一日)所進行的環境監察及審核工作。

根據承建商的資料，本月有以下的建築活動：

- 豎立圍街板
- 建造地下公共事業設備
- 路面及人行道的回填及混凝土澆灌
- 新臨時變壓房的電力轉換
- 拆毀涼亭, 洗手間及現存變壓房

本月有下列幾項的監察及審核活動：

一小時總懸浮粒子監察	15次
廿四小時總懸浮粒子監察	6次
日間噪音監察	4次
環境巡查	5次

## 違反監察標準

### 空氣質素

本月所有一小時與廿四小時總懸浮粒子監測結果皆符合行動水平和極限水平。

### 建築噪音

本月所有噪音監測結果皆符合行動水平和極限水平。

## 環境影響緩和措施

承建商大致上完成所需的緩和措施，同時已對環境小組在每週的環境巡查中的建議作出合理的回應及跟進。

## 有關環境的投訴，傳票及檢控

本月沒有收到有關環境的投訴，傳票及檢控。

## 報告修訂

本月並沒有修訂報告。

## 預計要注意的事項

下月要注意事項包括：

- 工程活動所產生的塵埃
- 操作中儀器及機器產生的噪音影響
- 工程活動所產生的污水
- 普通廢物與建築廢物的暫貯及棄置
- 化學品的管理及防止意外漏油



## 1. INTRODUCTION

### Background

- 1.1 Maunsell Environmental Management Consultants Limited (MEMCL) (hereinafter called the "ET") was appointed by China Resources Construction Company Limited (CRC) (hereinafter called the "Contractor") to undertake Environmental Monitoring and Audit for "Reprovisioning of Diamond Hill Crematorium" (hereinafter called the "Project"). Under the requirements of Section 4 of Environmental Permit EP-179/2004, EM&A programme as set out in the approved EM&A Manual is required to be implemented. In accordance with the approved EM&A Manual, environmental monitoring of air quality and noise and environmental site inspections are required for the Project.

### Scope of Report

- 1.2 The EM&A programme for the Project commenced on 29 October 2004. This report presents a summary of the environmental monitoring and audit works, list of activities, and mitigation measures for the Project in March 2005 (from 1 to 31 March 2005).

### Project Organisation

- 1.3 The organisation of the environmental management team is shown in Figure 1.1. Key personnel contacts are presented in Appendix A.

### Environmental Status in the Reporting Month

- 1.4 The construction programme of the Project is provided in Appendix B. In the month, the following activities took place for the construction of the Project:
- Hoarding erection;
  - Underground utilities construction;
  - Backfilling and concreting of road slab and pavement;
  - Power changeover of the new temporary transformer room; and
  - Demolition of pavilion, toilet and superstructure of existing transformer room.
- 1.5 Layout plan of the Project work site is provided in Figure 1.2.

### Summary of EM&A Requirements

- 1.6 The description and detailed locations of sensitive receivers and monitoring stations for air quality and noise are shown in Figures 2.1 and 3.1 respectively and relevant sections of this Report.
- 1.7 The EM&A programme require environmental monitoring for air quality and noise and environmental site inspections for air quality, noise, water quality, landscape and visual, and waste management. The EM&A requirements for each parameter described in the following sections include:
- All monitoring parameters
  - Action and Limit levels for all environmental parameters
  - Event and Action Plans
  - Environmental mitigation measures, as recommended in the project final EIA report
  - Environmental requirements in contract documents.

1.8 The advice on the implementation status of environmental protection and pollution control/mitigation measures is summarised in Appendix J of the Report.

## 2. AIR QUALITY

### Monitoring Requirements

- 2.1 1-hour and 24-hour TSP levels at two designated monitoring stations were monitored in the month in accordance with the EM&A Manual. Appendix C shows the established Action and Limit Levels for the environmental monitoring works.
- 2.2 The monitoring schedule for month is shown in Appendix D. Air quality monitoring stations for 24-hour and 1-hour TSP measurements are shown in Figure 2.1.

### Monitoring Equipment

- 2.3 Portable dust meter was used to carry out 1-hour TSP monitoring. High volume sampler (HVS - Model GMWS-2310 Accu-Vol) completed with the appropriate sampling inlets was installed for 24-hour TSP sampling. The HVS meet all the requirements as specified in the approved EM&A Manual. Table 2.1 summarised the equipment that were used in the dust-monitoring programme.

**Table 2.1 Air Quality Monitoring Equipment**

Equipment	Model
Dust Meter (for 1-hour TSP measurement)	Laser Dust Monitor – Model LD-1/LD-3
HVS (for 24-hour TSP measurement)	GMWS 2310 Accy-Vol system
Calibration Kit (for HVS)	GMW 25

### Monitoring Parameters, Frequency and Duration

- 2.4 Table 2.2 summarised the monitoring parameters, frequency and duration of impact air quality monitoring.

**Table 2.2 Air Quality Monitoring Parameters, Frequency and Duration**

Parameter	Duration	Frequency
1-hour TSP	1 hour	3 times every six days
24-hour TSP	24 hours	Once every six days

### Monitoring Locations

- 2.5 In accordance with the EM&A Manual, two air quality monitoring stations, as shown in Figure 2.1 were selected for 24-hour and 1-hour TSP sampling. Table 2.3 describes the location of the air quality monitoring stations.

**Table 2.3 Locations of Air Quality Monitoring Stations**

Monitoring Station	Identity / Description	Level
ASR8	Po Leung Kuk Grandmont Primary School	Roof top level of 7 storey building
ASR17	Staff Quarter for Diamond Hill Crematorium	Roof top level of 1 storey building

## Monitoring Methodology

### 1-hour TSP Monitoring

#### Monitoring Procedure

2.6 The measuring procedures of 1-hour TSP by a portable dust meter are in accordance with the Manufacturer's Instruction Manual as follows:

- Set POWER to "ON", push BATTERY button, make sure that the meter's indicator is in the range with a red line and allow the instrument to stand for about 3 minutes (Then, the air sampling inlet has been capped).
- Push the knob at MEASURE position.
- Push "O-ADJ" button. (Then meter's indication is 0).
- Push the knob at SENSI ADJ position and set the meter's indication to S value described on the Test Report using the trimmer for SENSI ADJ.
- Pull out the knob and return it to MEASURE position.
- Push "START" button.

#### Maintenance and Calibration

- The 1-hour TSP dust meters are verified at 1-year intervals throughout all stages of the impact air quality monitoring.
- Calibration details for the dust meters are provided in Appendix E.

### 24-hour TSP Monitoring

#### Installation

2.7 The HVSs were installed in the vicinity of the air sensitive receivers. The following criteria were considered in the installation of the HVSs:

- A horizontal platform with appropriate support to secure the samplers against gusty wind was provided.
- The distance between the HVS and any obstacles, such as buildings, was at least twice the height that the obstacle protrudes above the HVS.
- A minimum of 2 meters separation from walls, parapets and penthouses was provided for rooftop sampler.
- No furnace or incinerator flues were nearby.
- Airflow around the sampler was unrestricted.
- Permission was obtained to set up the sampler and to obtain access to the monitoring stations.
- A secure supply of electricity was obtained to operate the sampler.

#### Preparation of Filter papers

- Glass fibre filters, G810 were labelled and sufficient filters that were clean and without pinholes were selected.
- All filters were equilibrated in the conditioning environment for 24 hours before weighing. The conditioning environment temperature was around 25 °C and not variable by more than  $\pm 3$  °C; the relative humidity (RH) was < 50% and not variable by more than  $\pm 5$ %. A convenient working RH was 40%.
- *ALS Technichem (HK) Pty Ltd.* is a HOKLAS accredited laboratory which has comprehensive quality assurance and quality control programmes.

#### Monitoring Procedures

- The power supply was checked to ensure the HVSs work properly.
- The filter holder and the area surrounding the filter were cleaned.

- The filter holder was removed by loosening the four bolts and a new filter, with stamped number upward, on a supporting screen was aligned carefully.
- The filter was properly aligned on the screen so that the gasket formed an airtight seal on the outer edges of the filter.
- The swing bolts were fastened to hold the filter holder down to the frame. The pressure applied should be sufficient to avoid air leakage at the edges.
- Then the shelter lid was closed and secured with the aluminum strip.
- The HVSs were warmed-up for about 5 minutes to establish run-temperature conditions.
- A new flowrate record sheet was set into the flow recorder.
- The flow rate of the HVS was checked and adjusted at around 1.1 m<sup>3</sup>/min. The range was between 0.6-1.7 m<sup>3</sup>/min.
- The programmable timer was set for a sampling period of 24 hrs ± 1 hr, and the starting time, weather condition and the filter number were recorded.
- The initial elapsed time was recorded.
- At the end of sampling, the sampled filter was removed carefully and folded in half length so that only surfaces with collected particulate matter were in contact.
- It was then be placed in a clean plastic envelope and sealed.
- All monitoring information was recorded on a standard data sheet.
- Filters were sent to *ALS Technichem (HK) Pty Ltd.* for analysis.

**Maintenance and Calibration**

- The HVSs and their accessories were maintained in good working condition, such as replacing motor brushes routinely and checking electrical wiring to ensure a continuous power supply.
- HVSs are calibrated at bi-monthly intervals using GMW-25 Calibration Kit throughout all stages of the impact air quality monitoring.
- Calibration details for the HVSs are provided in Appendix E.

**Results and Observations**

2.8 Dust monitoring was conducted for both 1-hr TSP and 24-hr TSP at all designated monitoring stations in the month. Air quality monitoring results and graphical presentations are provided in Appendix F.

**1-hour TSP Monitoring**

2.9 All measured 1-hour TSP levels complied with the Action and Limit Levels in the month. A summary of 1-hour TSP monitoring results is presented in Table 2.4.

**Table 2.4 Summary of Impact 1-hour TSP Monitoring Results**

Monitoring Station	1-hour TSP (µg/m <sup>3</sup> )	Action Level (µg/m <sup>3</sup> )	Limit Level (µg/m <sup>3</sup> )	No. of Exceedance	
	Range			Action	Limit
ASR8	30.8 – 160.4	408.1	500.0	Nil	Nil
ASR17	20.5 – 142.0	408.4	500.0	Nil	Nil

**24-hour TSP Monitoring**

2.10 All measured 24-hour TSP levels complied with the Action and Limit Levels in the month. A summary of 24-hour TSP monitoring results is presented in Table 2.5.

**Table 2.5 Summary of Impact 24-hour TSP Monitoring Results**

Monitoring Station	24-hour TSP ( $\mu\text{g}/\text{m}^3$ )	Action Level ( $\mu\text{g}/\text{m}^3$ )	Limit Level ( $\mu\text{g}/\text{m}^3$ )	No. of Exceedance	
	Range			Action	Limit
ASR8	16.4 – 115.1	195.0	260.0	Nil	Nil
ASR17	14.5 – 105.6	174.1	260.0	Nil	Nil

### 3. NOISE

#### Monitoring Requirements

- 3.1 Noise levels at three designated monitoring stations were monitored in the month in accordance with the EM&A Manual. Appendix C shows the established Action and Limit Levels for the environmental monitoring works.
- 3.2 The monitoring schedule for the month is shown in Appendix D. Noise monitoring stations are shown in Figure 3.1.

#### Monitoring Equipment

- 3.3 Integrating Sound Level Meter was employed for noise monitoring. They were Type 1 sound level meters capable of giving a continuous readout of the noise level readings including equivalent continuous sound pressure level ( $L_{eq}$ ) and percentile sound pressure level ( $L_x$ ). They comply with International Electrotechnical Commission Publications 651:1979 (Type 1) and 804:1985 (Type 1). Portable electronic wind speed indicator capable of measuring wind speed in m/s was employed to check the wind speed. Table 3.1 details the noise monitoring equipment used.

**Table 3.1 Noise Monitoring Equipment**

Equipment	Model
Integrating Sound Level Meter	Rion NL-18/31
Calibrator	Rion NC-73

#### Monitoring Parameters, Frequency and Duration

- 3.4 Table 3.2 summarised the monitoring parameters, period, frequency and duration of impact noise monitoring.

**Table 3.2 Noise Monitoring Parameters, Frequency and Duration**

Time Period	Parameters	Duration (min)	Frequency
Daytime (0700 to 1900 on normal weekdays)	$L_{eq}$	30	Once per week

#### Monitoring Locations

- 3.5 In accordance with the EM&A Manual, three noise monitoring stations, as shown in Figure 3.1 were selected for noise monitoring. Table 3.3 describes the location of this monitoring station.

**Table 3.3 Locations of Noise Monitoring Stations**

Monitoring Station	Identity / Description	Level
SR3	International Christian Quality Music Secondary and Primary School	Roof top level of 7 storey building
SR4	Po Leung Kuk Grandmont Primary School	Roof top level of 7 storey building
SR6	Staff Quarter for Diamond Hill Crematorium	Roof top level of 1 storey building

### Monitoring Methodology

#### Monitoring Procedures

- The Sound Level Meter was set on a tripod at a height of 1.2 m above the ground.
- Façade measurements were made at all three monitoring locations.
- The battery condition was checked to ensure the correct functioning of the meter.
- Parameters such as frequency weighting, the time weighting and the measurement time were set as follows:
  - frequency weighting: A
  - time weighting: Fast
  - time measurement:  $L_{eq}$ (30 minutes) during non-restricted hours i.e. between 07:00 and 19:00 on normal weekdays
- Prior to and after each noise measurement, the meter was calibrated using a Calibrator for 94 dB at 1000 Hz. If the difference in the calibration level before and after measurement was more than 1 dB(A), the measurement would be considered invalid and repeat of noise measurement would be required after re-calibration or repair of the equipment.
- The wind speed was frequently checked with a portable wind meter.
- During the monitoring period, the  $L_{eq}$ ,  $L_{10}$  and  $L_{90}$  were recorded. In addition, site conditions and noise sources were recorded on a standard record sheet.
- Noise measurement was paused during periods of high intrusive noise (e.g. dog barking, helicopter noise) if possible. Observations were recorded when intrusive noise was unavoidable.
- Noise monitoring was cancelled in the presence of fog, rain, wind with a steady speed exceeding 5 m/s, or wind with gusts exceeding 10 m/s.

#### Maintenance and Calibration

- The microphone head of the sound level meter and calibrator is cleaned with soft cloth at quarterly intervals.
- The meter and calibrator are sent to the supplier or HOKLAS laboratory to check and calibrate at yearly intervals.
- Calibration details for the sound level meter and calibrator are provided in Appendix E.

### Results and Observations

- 3.6 Noise monitoring was conducted at all designated monitoring stations as scheduled in the month. Noise monitoring results and graphical presentations are provided in Appendix G.
- 3.7 All measured noise levels complied with the Action and Limit Levels in the month. A summary of noise monitoring results is presented in Table 3.4.

**Table 3.4 Summary of Impact Noise Monitoring Results during 07:00 – 19:00 on Normal Weekdays**

Monitoring Station	Measured Noise Level, dB(A) <i>L<sub>eq</sub></i> (30 min)	Calculated Construction Noise Level, dB(A)	Limit Level	No. of Exceedance	
	Average and Range	Average and Range		Action*	Limit
SR3	67.2 (64.5 – 68.7)	# (# - 66.2)	70/65 <sup>##</sup>	Nil	Nil
SR4	66.1 (63.7 – 67.7)	# (# - 63.5)	70/65 <sup>##</sup>	Nil	Nil
SR6	60.4 (57.5 – 62.2)	# (# - #)	75	Nil	Nil

\* - Action Level is triggered by receipt of a noise complaint  
 # - Measured noise level is less than the baseline noise level  
 ## - reduce to 70dB(A) for schools and 65dB(A) during school examination periods

#### 4. ENVIRONMENTAL SITE INSPECTION

##### Site Inspections

- 4.1 Site inspection was carried out on a weekly basis to monitor the timely implementation of proper environmental pollution control and mitigation measures for the Project. In the month, five site inspections were carried out in the month. The summary of weekly environmental site inspections observations and environmental site inspection checklists are attached in Appendix H.

##### Review of Environmental Monitoring Procedures

- 4.2 The monitoring works conducted by the Environmental Team were inspected regularly. Observations have been recorded for the monitoring works as follows:

##### *Air Quality Monitoring*

- The monitoring team recorded the observations around the monitoring stations within and outside of the construction site.
- The monitoring team recorded the temperature and general weather condition on the monitoring day.

##### *Noise Monitoring*

- The monitoring team recorded the observations around the monitoring stations, which might affect the results.
- Major noise sources were identified and recorded.

##### Advice on Waste Management Status

- 4.3 The actual quantities of inert C&D materials and non-inert C&D wastes generated by activities of the Project in the month are provided in Table 4.1. Trip ticket system was implemented for all offsite waste disposal.

**Table 4.1 Summary of Waste Disposal in The Month**

Type of Waste Material		Disposed Quantity	Destination
Inert C&D materials		582m <sup>3</sup>	Kai Tak Public Fill Barging Point
Non-inert C&D waste	Metals	Nil	Not Applicable
	Paper/cardboard packaging	Nil	Not Applicable
	Plastics	Nil	Not Applicable
	Chemical waste	Nil	Not Applicable
	Others, e.g. general refuse	154m <sup>3</sup>	SENT Landfill

**Status Environmental Licences and Permits**

4.4 The status of all permits/licences obtained/in-use in the month is summarised in Appendix I.

**Implementation Status of Environmental Mitigation Measures**

4.5 An updated summary of the Environmental Mitigation Implementation Schedule (EMIS) is presented in Appendix J.

4.6 During the weekly site inspection conducted by the Environmental Team in the month, the following observations and recommendations were made.

**Water Quality**

- The Contractor indicated that application for effluent discharge license was in progress. The effluent discharge license was available for inspection by mid-March.
- A small amount of dried vegetation and refuse was noted in the surface channel near the sub-contractor's site office. Sandbags were provided for desilting. The Contractor was reminded to maintain the channel regularly. Dried vegetation and refuse were removed by the next weekly site inspection.
- Tarpaulin cover was provided for the stockpile of soil at the temporary stockpiling area. The Contractor was reminded to enlarge the covered surface of the stockpile to prevent surface runoff. Surface runoff was no longer observed by the next weekly site inspection. The Contractor was further reminded to cover the stockpile entirely to prevent surface runoff during rainy days. Sandbag barriers were provided to prevent silty water from entering the drainage system directly.
- Relocation of the wheel wash bay was in progress. Temporary wheel wash facilities were provided. The Contractor indicated that wheel wash water would be collected and treated by the wastewater treatment system prior to discharge. Temporary vehicle washing facilities were used and sandbags were used as silt removal facility by the next weekly site inspection. The Contractor was recommended to erect more sandbags during rainy season.
- The Contractor was reminded to clean the drainage channel near the stockpiling area regularly.

**Air Quality**

- The Contractor was reminded to provide water spray for dust generating activities such as road compaction to prevent fugitive dust generation.

**Noise**

- No particular observations and recommendations were made during the weekly site inspections in the month.

**Waste or Chemical Management**

- The concrete debris at roadside was removed.
- A lubricant oil container was placed on ground without drip tray. The Contractor was reminded to store the chemical properly to avoid oil leakage or spillage. Oil container was stored properly to avoid oil leakage or spillage by the next weekly site inspection.



- Two chemical drums were not provided with drip trays. The Contractor was reminded to store the chemical properly. Chemical drums were stored properly by the next weekly site inspection.
- The Contractor was reminded to cover the skip for general refuse during rainy days.

#### ***Landscape and Visual***

- No particular observations and recommendations were made during the weekly site inspections in the month.

#### ***Others***

- No particular observations and recommendations were made during the weekly site inspections in the month.

#### **Summary of Exceedances of Environmental Quality Performance Limit**

- 4.7 The Event and Action Plans for air quality and noise are presented in Appendix K.
- 4.8 No exceedance of Action and Limit Levels for 1-hour and 24-hour TSP and noise levels was recorded in the month.

#### **Summary of Environmental Complaints, Notifications of Summons and Successful Prosecutions**

- 4.9 Figure 4.1 presents the environmental complaint flow diagram of the Project.
- 4.10 No environmental complaint, notification of summons and prosecution was received or made against the Project in the month.

### **5. FUTURE KEY ISSUES**

#### **Key Issues for Coming Month**

- 5.1 Key issues to be considered in the coming month include:
- Generation of dust from activities on-site;
  - Noise impact from operating equipment and machinery on-site;
  - Generation of site surface runoffs and wastewater from activities on-site;
  - Storage and disposal of general refuse and construction waste from activities on-site; and
  - Management of chemicals and avoidance of oil spillage;

#### **Environmental Monitoring and Audit Schedule for the Coming Months**

- 5.2 The tentative schedules for environmental monitoring and audit for the next three months are provided in Appendix D.

### **6. CONCLUSIONS AND RECOMMENDATIONS**

#### **Conclusions**

- 6.1 Environmental monitoring and audit was performed in March 2005. All monitoring and audit results in the month were checked and reviewed.
- 6.2 All 1-hour and 24-hour TSP monitoring results recorded in the month complied with the Action and Limit Levels.
- 6.3 All noise monitoring results recorded in the month complied with the Action and Limit Levels.

- 6.4 In general, the Contractor satisfactorily implemented all the required mitigation measure and was reasonably responsive to the ET's recommendations on any discrepancy observed during the weekly environmental site inspection.
- 6.5 No environmental complaint, notification summons or successful prosecution was received or made against this Project in the month

**Recommendations**

- 6.6 According to results of weekly environmental site inspections performed in the month and the construction programme for the coming month, recommendations for air quality, construction noise, water quality and waste and chemical management are detailed in Section 5.1.


---

---


FIGURES

---

---

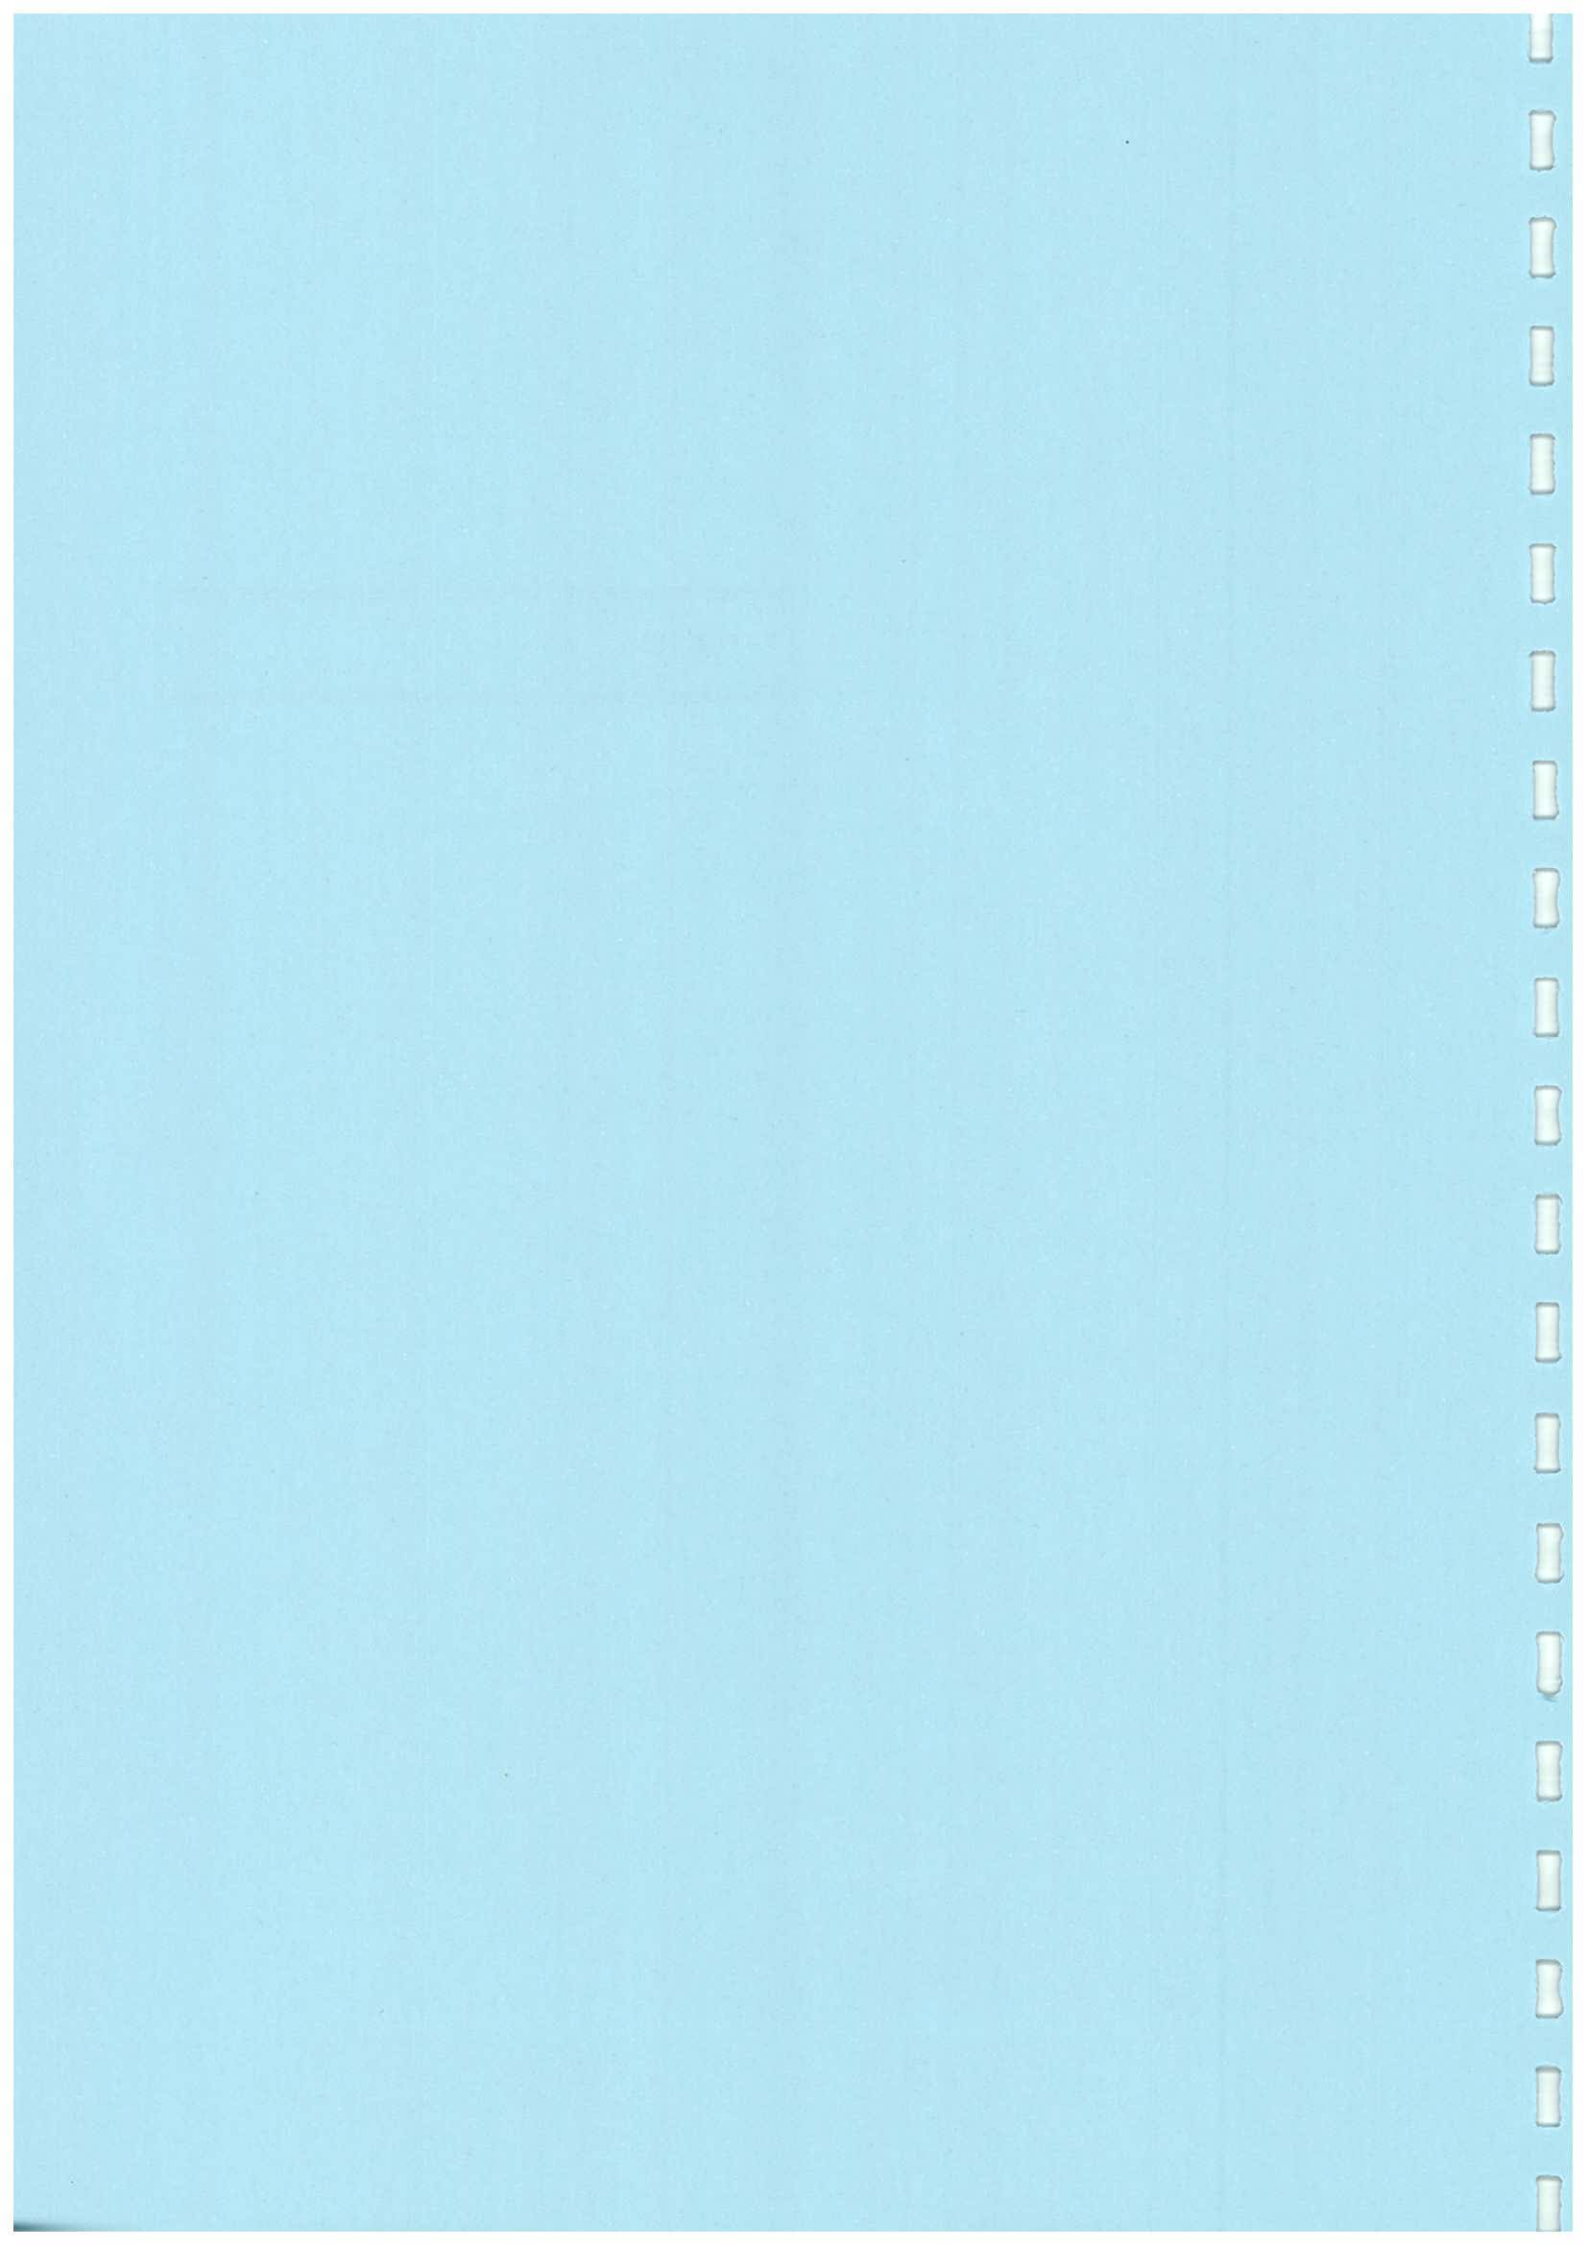

# PROJECT ORGANIZATION FOR ENVIRONMENTAL MANAGEMENT

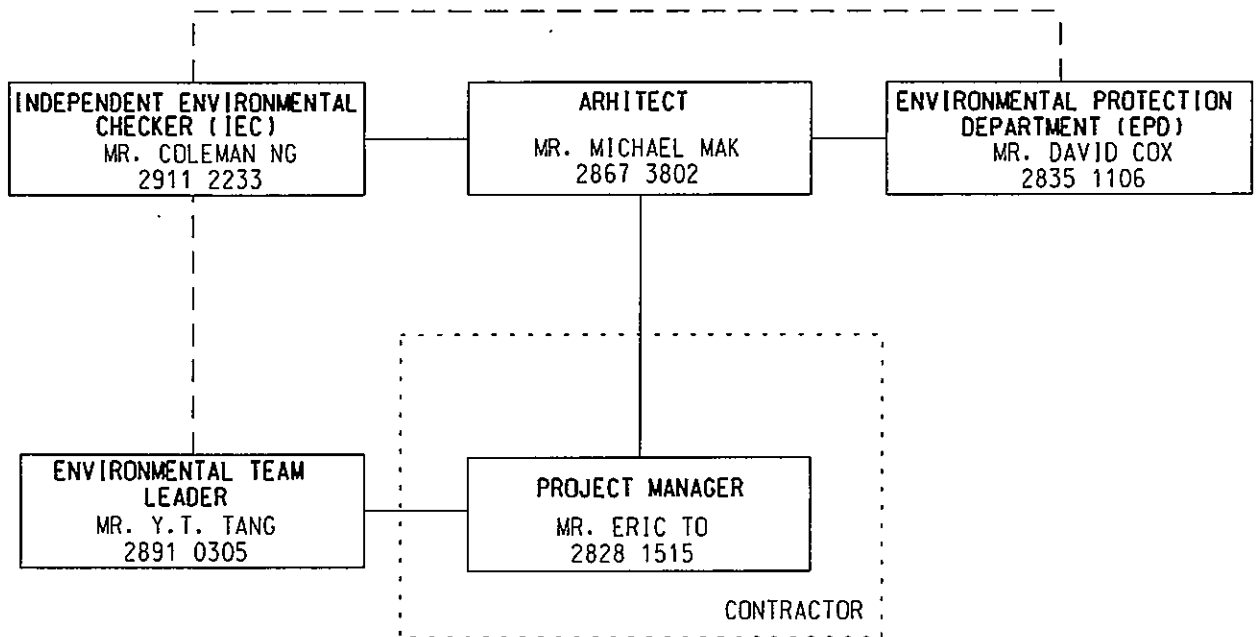


**LEGEND:**


—— DIRECT COMMUNICATION

- - - LIAISON

<b>MAUNSELL   AECOM</b>	CONTRACT NO: SS M333 - REPROVISIONING OF DIAMOND HILL CREMATORIUM  <b>PROJECT ORGANIZATION FOR ENVIRONMENTAL MANAGEMENT</b>	SCALE	N.T.S.	DATE	2005
		CHECK	FSYY	DRAWN	AHCM
		JOB No.	S07904	DRAWING No.	1.1

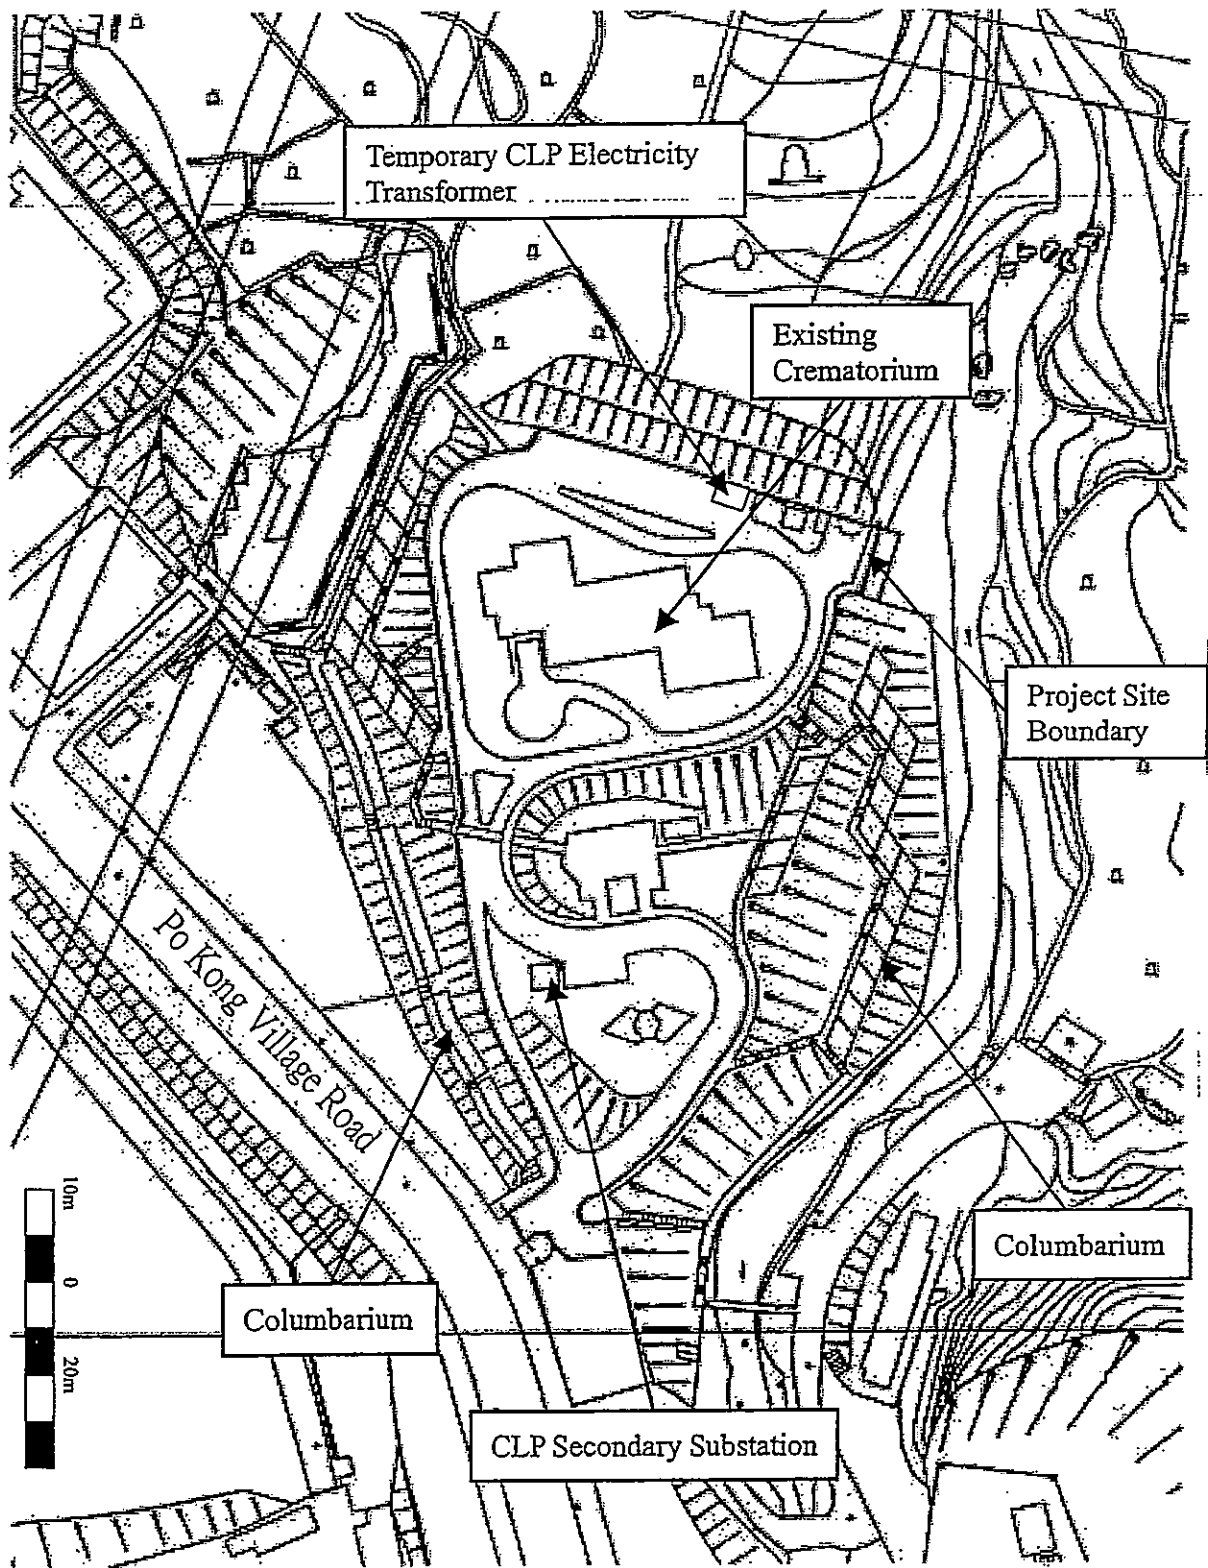


<b>MAUNSELL   AECOM</b>	CONTRACT NO: SS M333 - REPROVISIONING OF DIAMOND HILL CREMATORIUM			SCALE	N. T. S.	DATE	2005
	<b>LAYOUT OF WORK SITE</b>			CHECK	FSYY	DRAWN	AHCM
				JOB No.	S07904	DRAWING No.	1.2

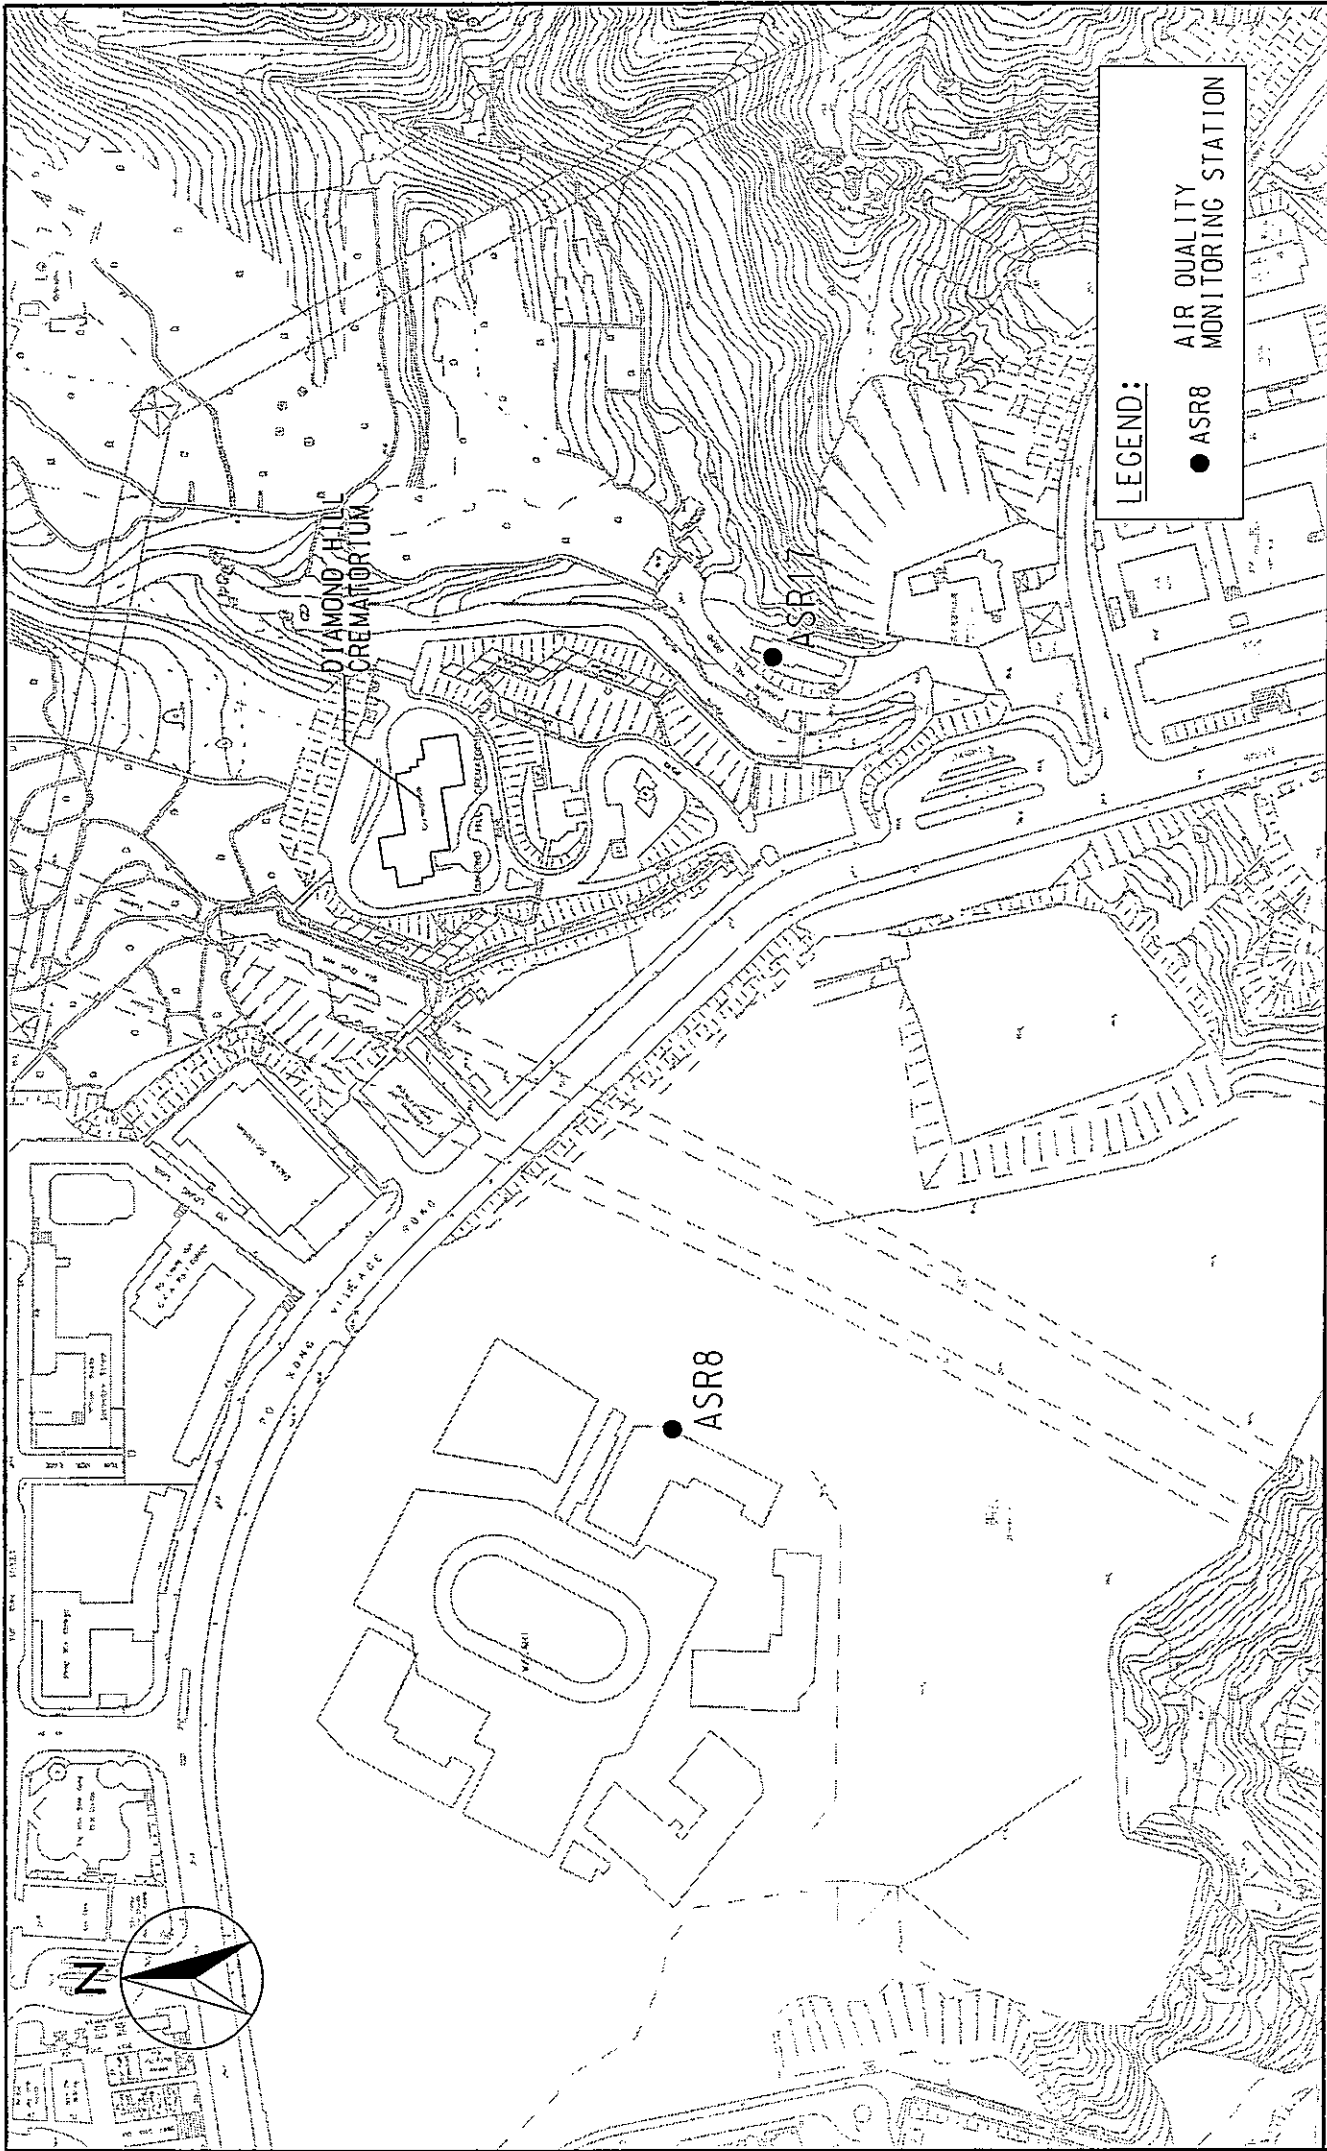

**LEGEND:**  
 ● ASR8  
 ● AIR QUALITY MONITORING STATION

<b>MAUNSELL</b>	<b>AECOM</b>	CONTRACT NO: SS M333		SCALE	A4 1:3000	DATE	2005
		REPROVISIONING OF DIAMOND HILL CREMATORIUM		CHECK	FSYY	DRAWN	AHCM
LOCATIONS OF AIR QUALITY MONITORING STATIONS		JOB NO.	S07904	DRAWING NO.	2.1	REV	-



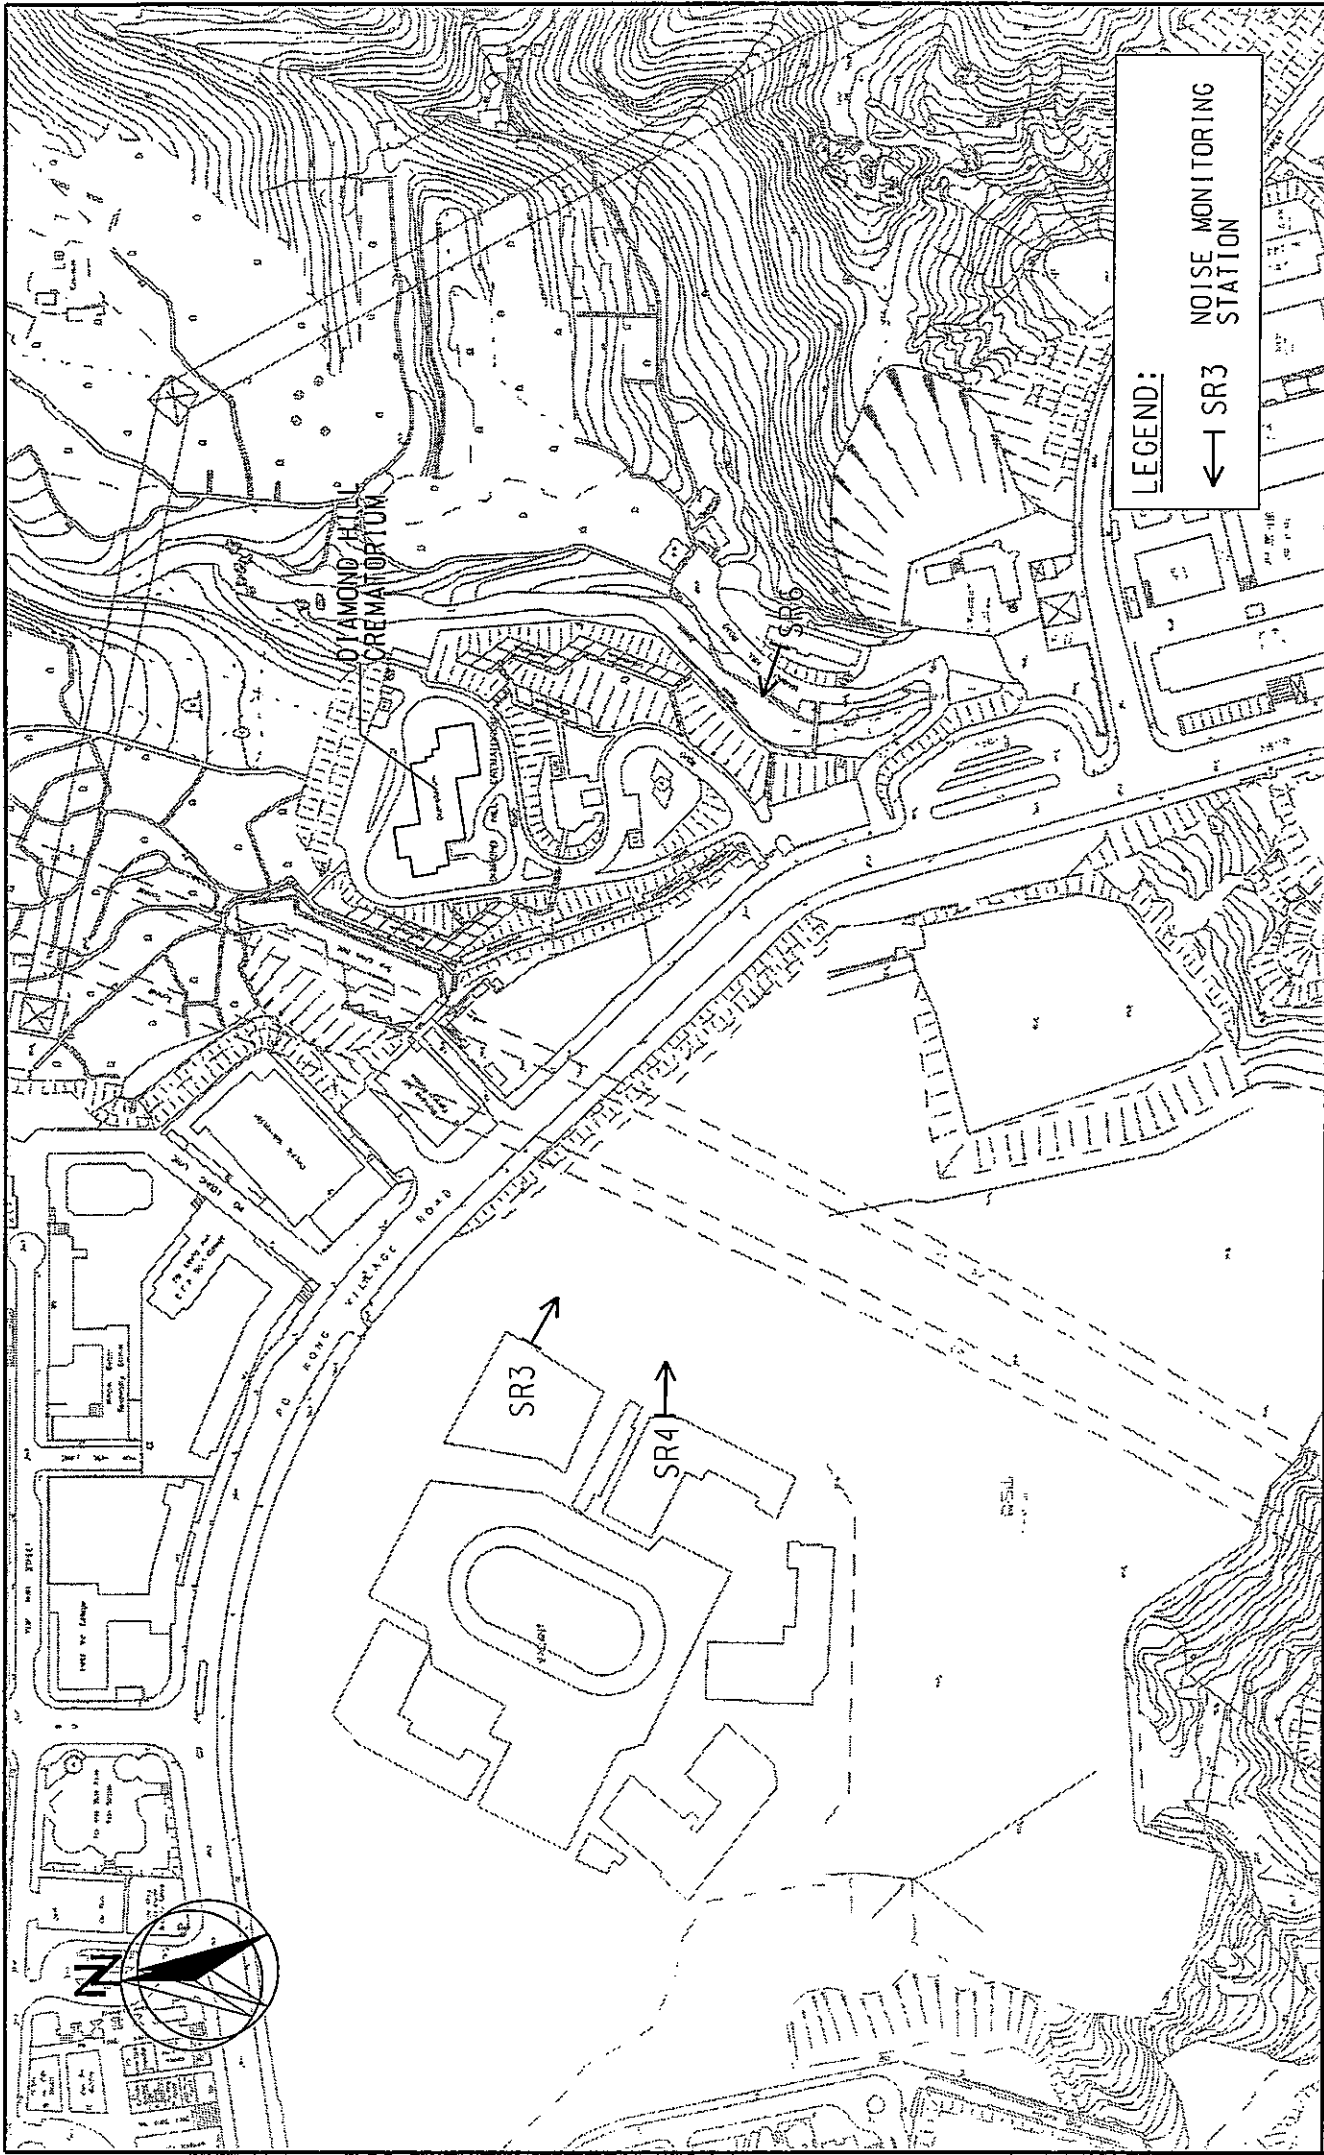


CONTRACT NO: SS M333  
 REPROVISIONING OF DIAMOND HILL CREMATORIUM  
 LOCATIONS OF CONSTRUCTION NOISE  
 MONITORING STATIONS

SCALE	A4 1:3000	DATE	2005
CHECK	FSYY	DRAWN	AHCM
JOB NO.	S07904	DRAWING NO.	3.1
REV			

**MAUNSELL** | **AECOM**



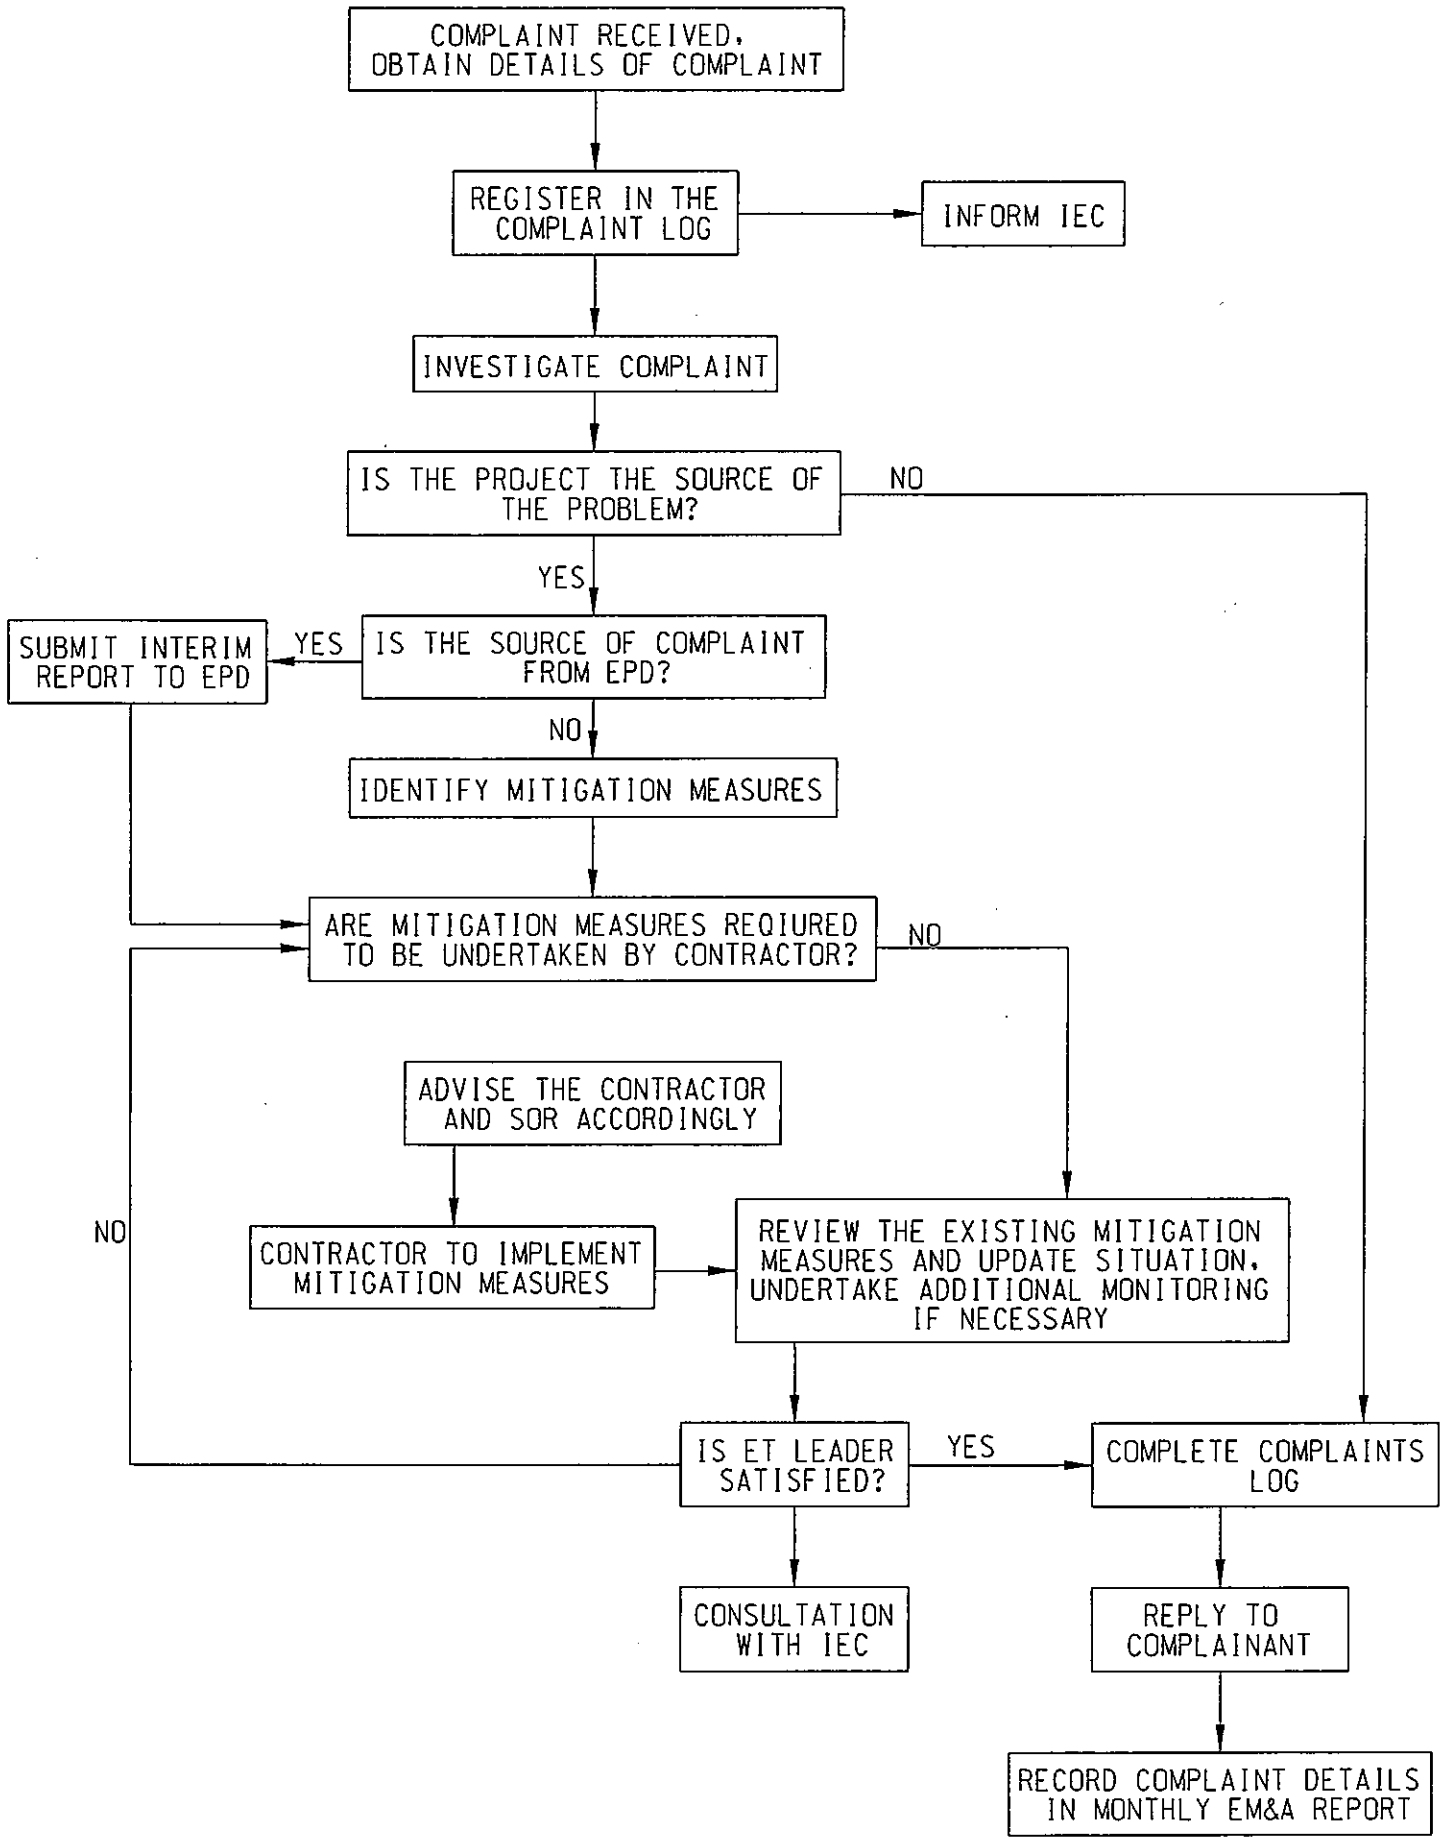


MAUNSELL   AECOM	CONTRACT NO: SS M333 - REPROVISIONING OF DIAMOND HILL CREMATORIUM	SCALE	N.T.S.	DATE	2005	
	COMPLAINT FLOW DIAGRAM	CHECK	FSYY	DRAWN	AHCM	
		JOB No.	S07904	DRAWING No.	4.1	REV
						-



---

APPENDIX A  
KEY CONTACTS OF ENVIRONMENTAL  
PERSONNEL

---

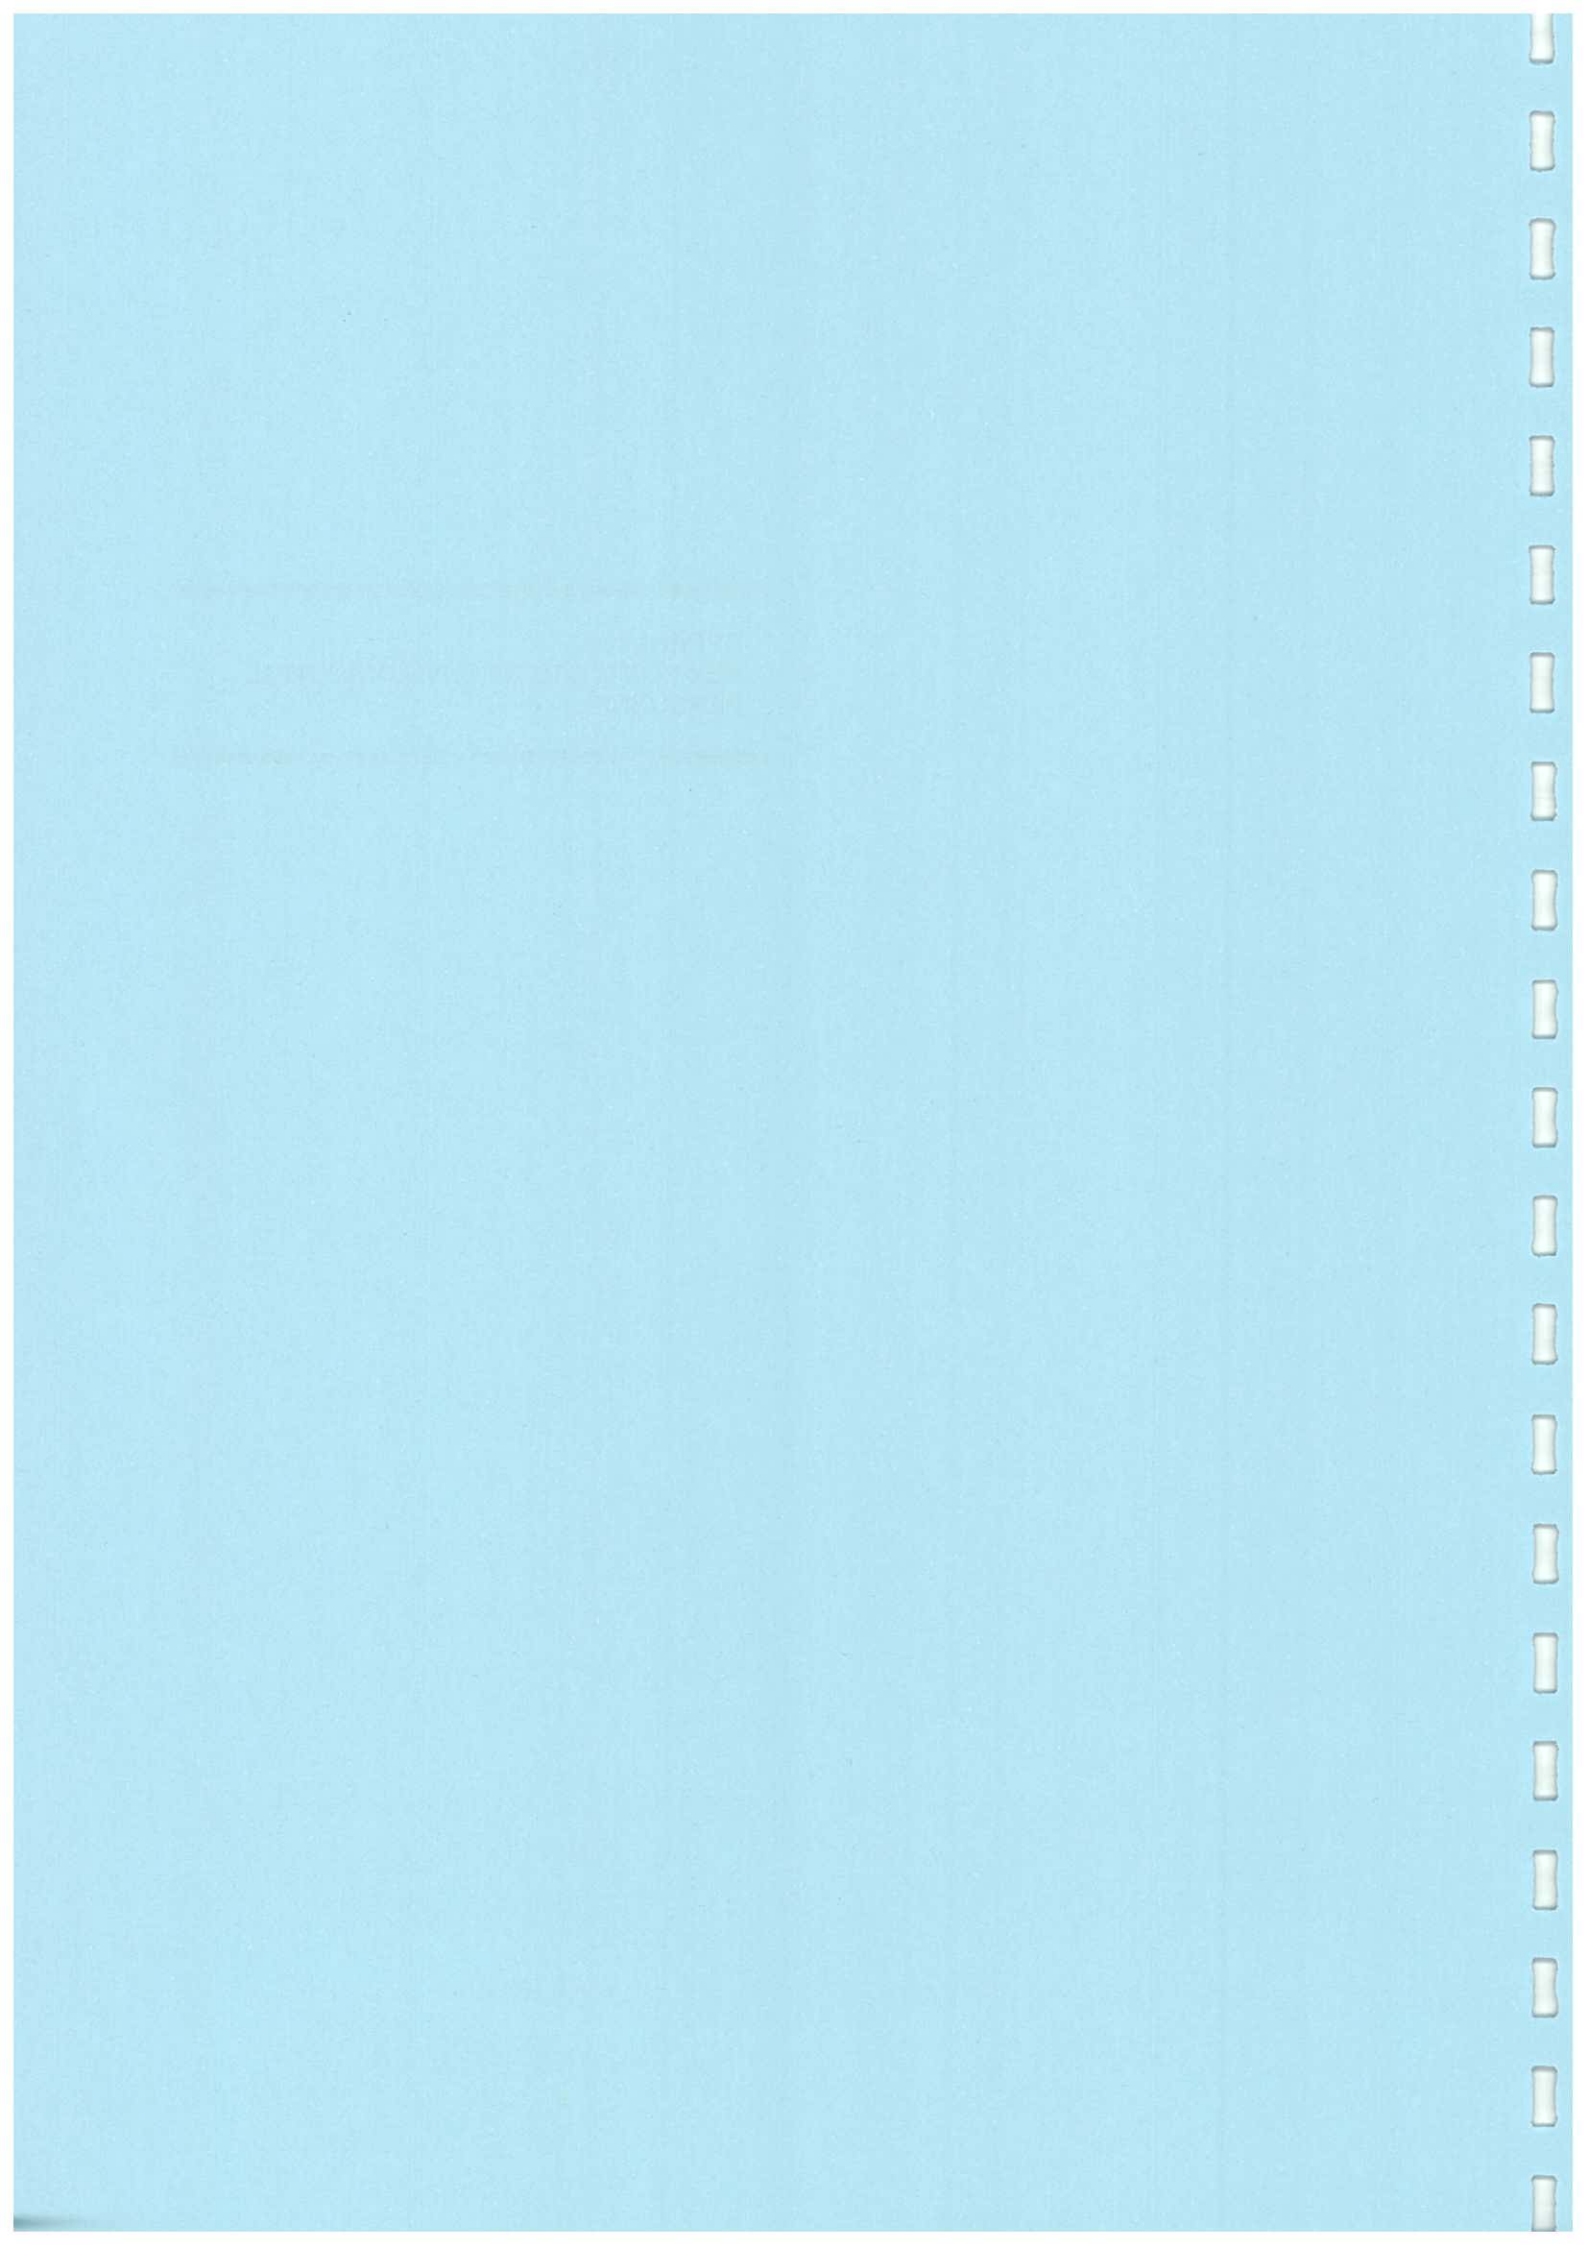

## Appendix A Key Contacts of Environmental Personnel

Party	Name	Telephone No.	Fax No.
<b>Environmental Protection Department</b>			
SEPO	Mr. David Cox	2835 1106	2591 0558
EPO	Ms. Marlene Ho	2835 1186	2591 0558
EPO (LCO)	Mr. Charles Wu	2117 7540	2756 8588
<b>Architect</b>			
Architectural Services Department			
Project Architect	Mr. Michael Mak	2867 3802	2524 8194
Assistant Architect	Mr. Johnson Lee	2867 4135	2524 8194
<b>Independent Environmental Checker</b>			
Hyder Consulting Limited			
IEC	Mr. Coleman Ng	2911 2233	2805 5028
Assistant to IEC	Mr. Adi Lee	2911 2233	2805 5028
<b>Contractor</b>			
China Resources Construction Company Limited			
Project Manager	Mr. Eric To	2828 1515	2827 2921
<b>Environmental Team</b>			
Maunsell Environmental Management Consultants Limited			
ET Leader	Mr. Y.T. Tang	2893 1551	2891 0305
Audit Team Leader	Ms. Florence Yuen	2893 1551	2891 0305
Monitoring Team Leader	Mr. Thomas Chan	2893 1551	2891 0305




---

**APPENDIX B  
CONSTRUCTION PROGRAMME**

---



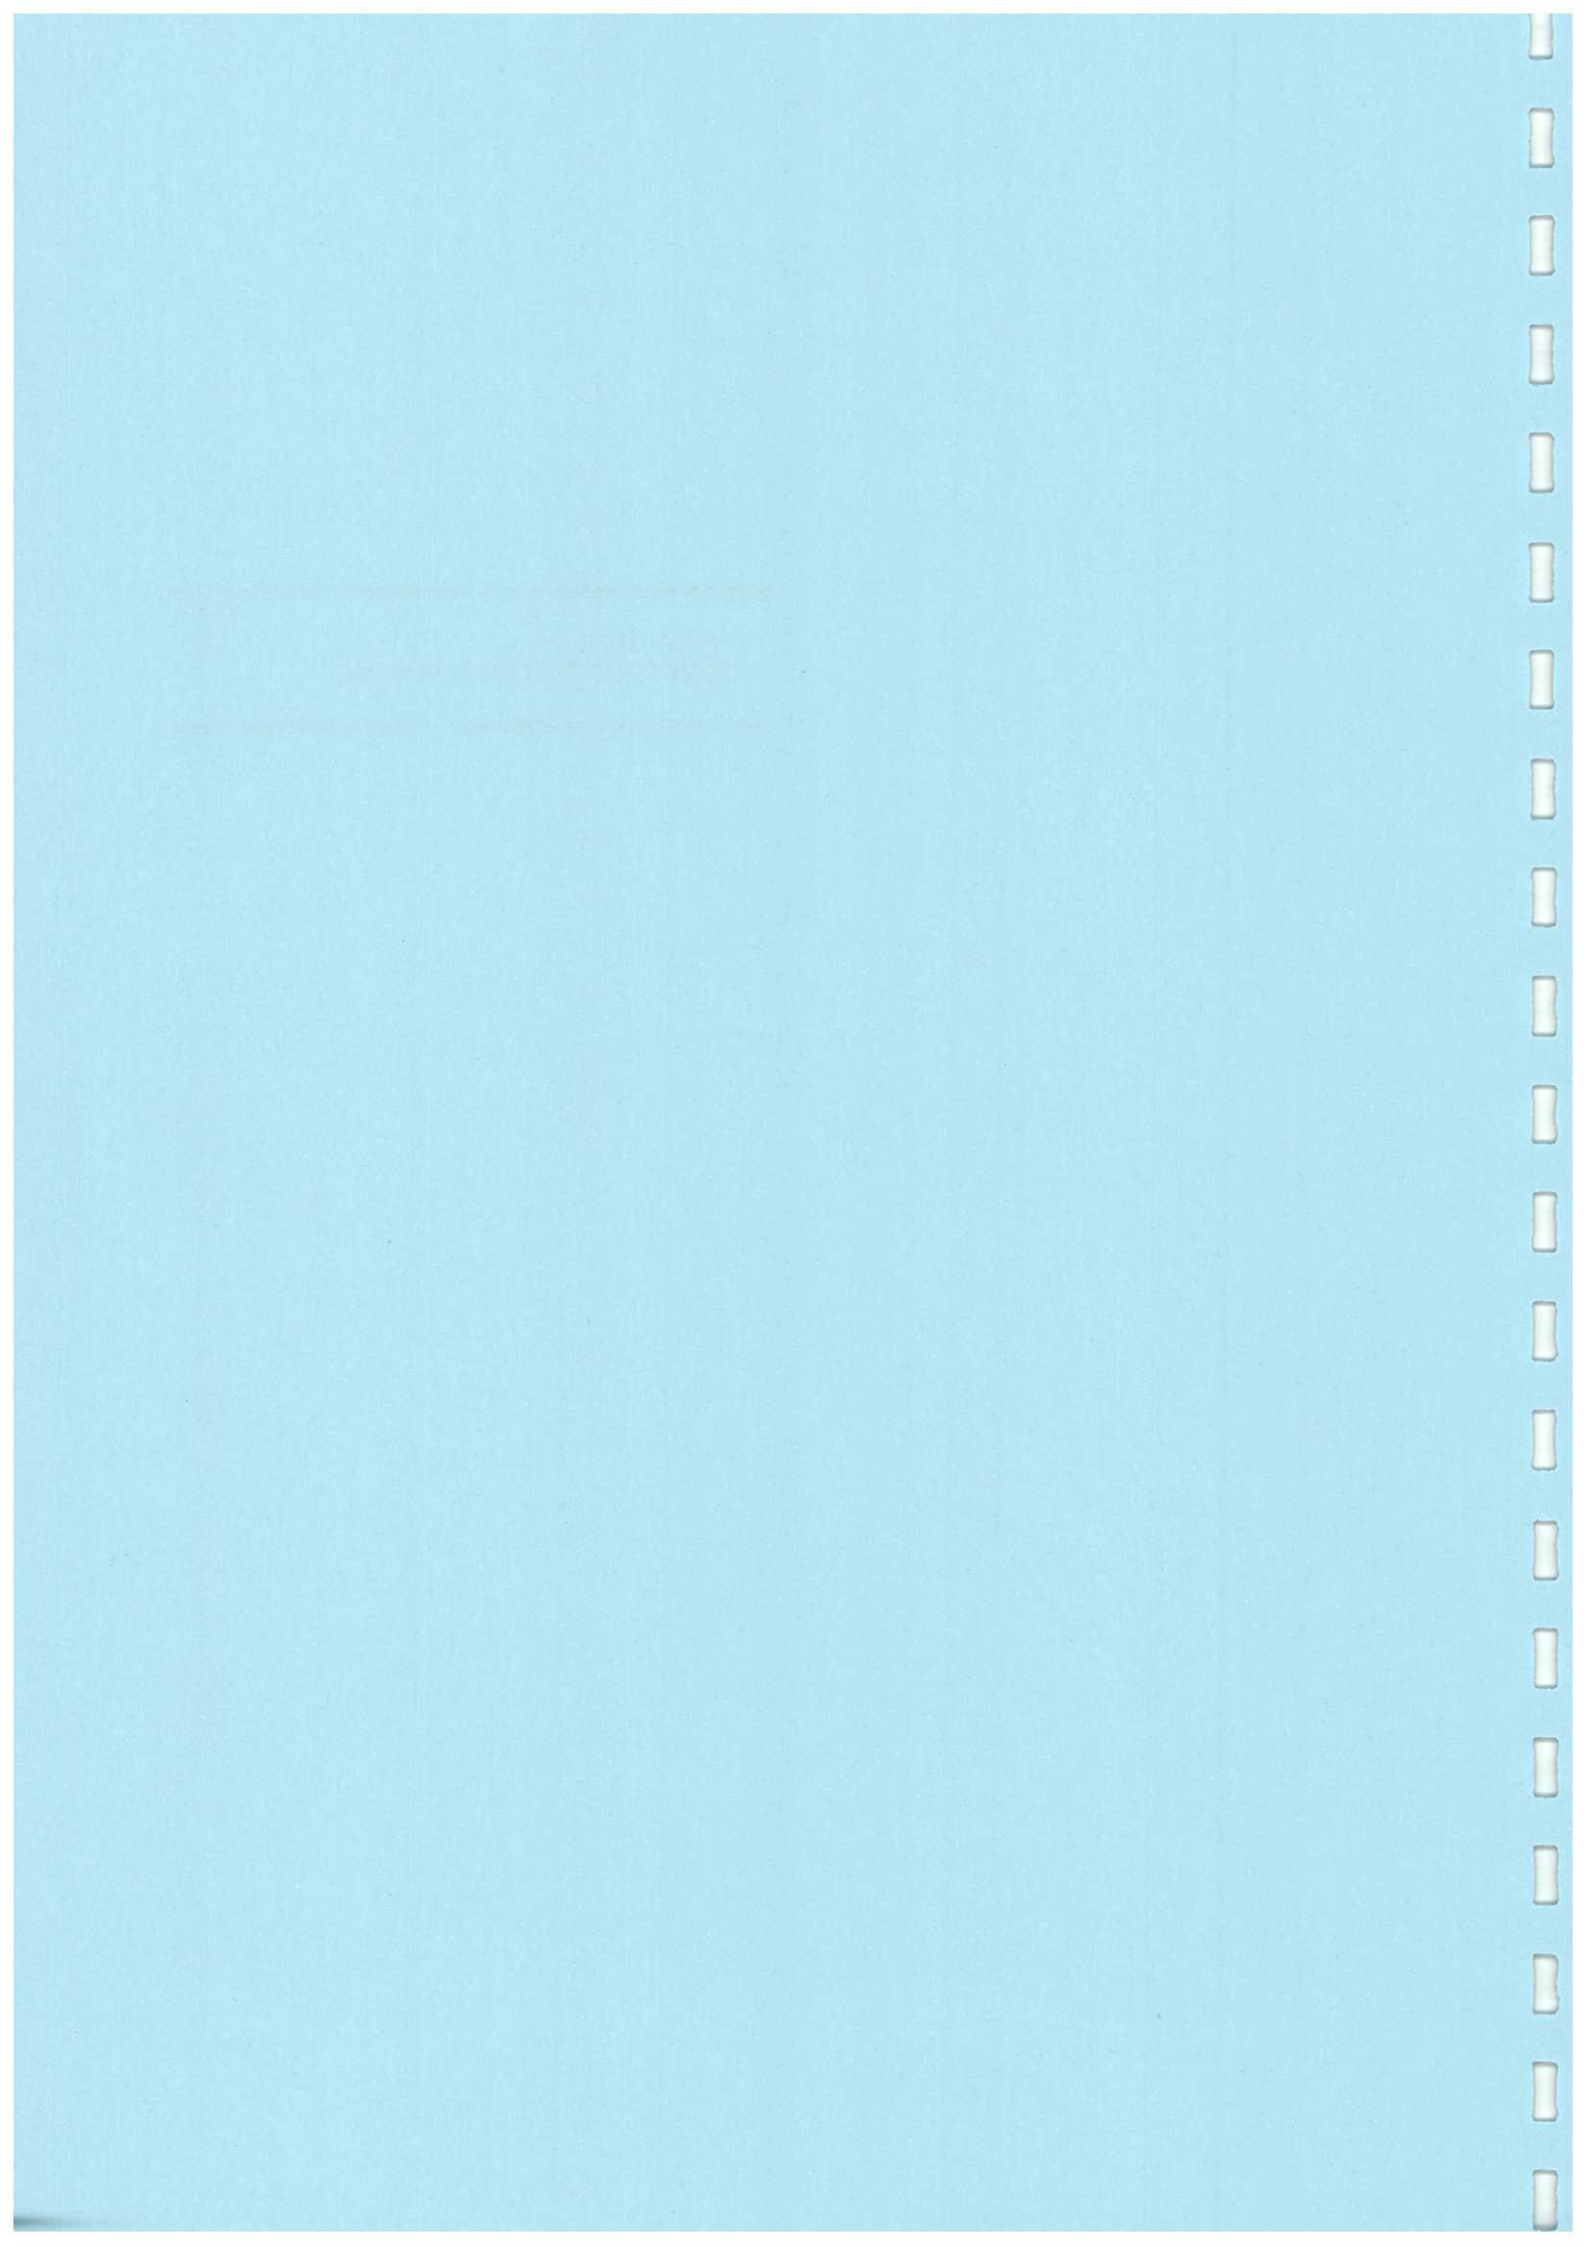



ID	Task	Duration	Start	Finish	Jan	Feb	Mar	Apr	May	Jun	Jul	Aug	Sep	Oct	Nov	Dec
1	Site Investigation (Section 1)	1 day	19/01/2025	20/01/2025												
2	Mobilisation	7 days	19/01/2025	26/01/2025												
3	Initial Survey	16 days	19/01/2025	04/02/2025												
4	Site Office Set Up	30 days	19/01/2025	18/02/2025												
5	Tree Survey Report	31 days	19/01/2025	19/02/2025												
6	Subsoil Waste Management Plan	1 day	19/01/2025	19/01/2025												
7	Approval of WILP	1 day	19/01/2025	19/01/2025												
8	Flooding Evaluation	123 days	19/01/2025	19/05/2025												
9	Area B (Type 1)	51 days	19/01/2025	09/03/2025												
10	Section 1 (Type 1)	14 days	19/01/2025	03/02/2025												
11	Section 1 (Remediation Type 1)	9 days	19/01/2025	28/01/2025												
12	CSD for UHG Utilities Diversion	61 days	19/01/2025	19/03/2025												
13	Revised UHG P&ID Drawings from ASD	13 days	19/01/2025	01/02/2025												
14	Revised UHG P&ID Pipework Drawings from ASD	1 day	19/01/2025	19/01/2025												
15	Revised UHG P&ID Pipework Layout from ASD	4 days	19/01/2025	23/01/2025												
16	Revised UHG P&ID Cable Ducts from ASD	1 day	19/01/2025	19/01/2025												
17	Approval of Incoming Cable Ducts Error Fix Routing by CLP	1 day	19/01/2025	19/01/2025												
18	Simulation of CSD (Preliminary)	1 day	19/01/2025	19/01/2025												
19	Simulation of CSD (Final)	5 days	19/01/2025	24/01/2025												
20	Approval of CSD	7 days	19/01/2025	26/01/2025												
21	Asset Examination & IAT Utilities Diversion	9 days	19/01/2025	28/01/2025												
22	Area A - Hammer Head (Disturbed)	0 days	19/01/2025	19/01/2025												
23	Area C	0 days	19/01/2025	19/01/2025												
24	Area C1 (Other Section 1)	0 days	19/01/2025	19/01/2025												
25	Site Clearance	9 days	19/01/2025	28/01/2025												
26	Recreate Site Block (REID)	2 days	19/01/2025	21/01/2025												
27	Demolish Edge Paved Pavement	2 days	19/01/2025	21/01/2025												
28	Tarmac Road Paving	1 day	19/01/2025	19/01/2025												
29	Hoarding Erection	19 days	19/01/2025	07/02/2025												
30	Break Up Existing Pavement	15 days	19/01/2025	03/02/2025												
31	Lay Water Pipes	10 days	19/01/2025	29/01/2025												
32	Lay Soil & Waste Pipes	59 days	19/01/2025	17/03/2025												
33	Area C2 (Near New Tx Room)	69 days	19/01/2025	17/03/2025												
34	Demolish Pavement & Repave	3 days	19/01/2025	22/01/2025												
35	Hoarding Erection	19 days	19/01/2025	07/02/2025												
36	Break Up Existing Pavement	13 days	19/01/2025	02/02/2025												
37	Drainage & Cable Ducts	23 days	19/01/2025	11/02/2025												
38	Backfilling & Tarmac Area C1 & C2	22 days	19/01/2025	10/02/2025												
39	Area B	66 days	19/01/2025	18/03/2025												
40	Break Up Edge Road Paving	15 days	19/01/2025	03/02/2025												
41	Demolish Edge Barrier & Backfill	18 days	19/01/2025	06/02/2025												
42	Construct Lamp Pole Footing	8 days	19/01/2025	27/01/2025												
43	Construct Cable Duct / Draw Pit	9 days	19/01/2025	28/01/2025												
44	Reconstruct Cable Pit & Surface Channel	20 days	19/01/2025	08/02/2025												
45	Construct New Walkway (1.6m Width)	14 days	19/01/2025	02/02/2025												
46	Construct & Lay UHG Services Pipework	25 days	19/01/2025	13/02/2025												
47	Draw Pit & Cable Ducts	17 days	19/01/2025	05/02/2025												
48	Drainage Pipe & Manhole	17 days	19/01/2025	05/02/2025												
49	Watermain	16 days	19/01/2025	04/02/2025												
50	Backfill & Concrete Road Slab	14 days	19/01/2025	03/02/2025												
51	Handover of Draw Pit & Cable Duct	1 day	19/01/2025	19/01/2025												
52	Cable Laying by CLP	15 days	19/01/2025	03/02/2025												
53	Cable Installation to New Tx Room	2 days	19/01/2025	21/01/2025												
54	Diversion of FCCW Cable	25 days	19/01/2025	13/02/2025												
55	Set Up Traffic Control Point for Section 1	6 days	19/01/2025	25/01/2025												

Planned by: Mr. Eric To  
 Version: v1.0  
 Date: 20 JAN 2025

Milestone Summary  
 Task Progress  
 Rollled Up Task  
 Rollled Up Milestone

Project Summary  
 Estimated Tasks  
 Rollled Up Progress  
 Rollled Up Milestone

Scope By Summary  
 Project Summary

Milestone Progress for Reprofitting of Diamond Hill Crematorium at To Keng Village Road, Kowloon, Hong Kong

ID	Task	Duration	Start	Finish	Col Nov	Dec	Jan	Feb	Mar	Apr	May	June	July	Aug	Sept	Oct	Nov	Dec
36	B.S. Installation in New Temp TX Room (V.D.)	92 days	Tue 21/04/05	Tue 04/05/05														
37	Confirm & Issue Design Details of TX Room & Main Switch Room	1 day	Wed 15/04/04	Wed 15/04/04														
38	Submission & Approval of Main Equipment	15 days	Tue 21/04/05	Tue 21/04/05														
39	Equipment Ordering & Delivery	39 days	Tue 21/04/05	Fri 28/05/05														
40	B.S. Installation Work in TX Room	28 days	Tue 21/04/05	Fri 28/05/05														
41	Handover of TX Room to CLP	8 days	Tue 18/04/05	Tue 25/04/05														
42	Installation Work by CLP	27 days	Tue 20/04/05	Sun 20/05/05														
43	Excavate Near Temp TX Room (CLP)	1 day	Mon 17/04/05	Mon 17/04/05														
44	Installation of LV Main Switch Board	7 days	Sat 29/04/05	Fri 4/05/05														
45	Site Test of LV Main Switch Board	1 day	Sat 29/04/05	Sat 29/04/05														
46	CLP inspection of LV Main Switch Board	1 day	Fri 18/04/05	Tue 18/04/05														
47	Outgoing LUG Job by CLP	5 days	Fri 18/04/05	Tue 22/04/05														
48	Cable Termination at LV Main Switch Board	2 days	Wed 24/04/05	Tue 24/04/05														
49	Power suspension for change of lead and resume power	2 days	Mon 24/04/05	Tue 25/04/05														
50	SCA for Existing TX Room	177 days	Mon 21/04/05	Tue 17/05/05														
51	Submit Sampling and Analysis Test	1 day	Mon 22/04/05	Mon 22/04/05														
52	Submit SCA Report	1 day	Tue 17/04/05	Tue 17/04/05														
53	Demolition Works	222 days	Fri 22/04/05	Tue 21/05/05														
54	Submit Demolition Plan	1 day	Fri 22/04/05	Fri 22/04/05														
55	Approval of Demolition Plan	85 days	Sat 30/04/05	Sat 30/04/05														
56	Temporary Hoarding	8 days	Wed 16/04/05	Wed 23/04/05														
57	Reinforce top soil from existing structure of Membrane	1 day	Sat 16/04/05	Sat 16/04/05														
58	Demolish Pavement	5 days	Thu 24/04/05	Mon 28/04/05														
59	Demolish Ties & Flatness	10 days	Thu 24/04/05	Sat 30/04/05														
60	Demolish Existing TX Room	62 days	Thu 24/04/05	Mon 21/05/05														
61	Demolish Superstructure	5 days	Thu 21/04/05	Mon 25/04/05														
62	Soil Test & Report	21 days	Tue 26/04/05	Mon 16/05/05														
63	Submission & Approval by ERD	31 days	Tue 17/04/05	Tue 16/05/05														
64	Demolish Floor Slab	5 days	Fri 17/04/05	Tue 21/04/05														
65	VEP Submission & Approval	31 days	Fri 22/04/05	Sun 21/05/05														
66	Prep 61/2 Sheet File	46 days	Sun 03/05/05	Wed 06/06/05														
67	Site Investigation (incl. Demolish retaining wall)	85 days	Thu 14/04/05	Tue 30/05/05														
68	Foundation Work	66 days	Thu 14/04/05	Sun 31/05/05														
69	UG service pipework & drainage (outside building)	60 days	Fri 17/04/05	Mon 13/06/05														
70	LAG boxes installation	31 days	Tue 16/04/05	Tue 15/05/05														
71	Mock-up wall for Fin face Concrete Wall Panel	61 days	Fri 17/04/05	Tue 21/05/05														
72	Preparation of Mock-up sample	30 days	Fri 17/04/05	Sat 30/04/05														
73	Superstructure	31 days	Sun 03/05/05	Tue 21/05/05														
74	LCR/GRF	122 days	Fri 16/04/05	Sun 19/06/05														
75	GRF/MP	31 days	Sun 16/04/05	Tue 19/05/05														
76	Level 91.35-102.52	30 days	Wed 16/04/05	Tue 19/05/05														
77	Level 91.35-102.52	31 days	Fri 16/04/05	Sun 19/05/05														
78	External finishing	282 days	Mon 10/04/05	Tue 19/07/05														
79	Plastering & Tiling	197 days	Sun 16/04/05	Sun 30/06/05														
80	Spall Patch	122 days	Sun 16/04/05	Tue 19/07/05														
81	Blockwork	30 days	Sat 30/04/05	Sat 16/05/05														
82	Callings Plaster	77 days	Wed 16/04/05	Tue 21/05/05														
83	Wall Plaster	90 days	Thu 17/04/05	Tue 22/05/05														
84	Wall Tiling	90 days	Sat 17/04/05	Fri 21/05/05														
85	Floor Screed	90 days	Mon 16/04/05	Sat 15/05/05														
86	Floor Tiling	85 days	Wed 16/04/05	Sun 30/06/05														
87	Carpanity & Joinery	237 days	Wed 16/04/05	Mon 19/07/05														
88	Door Frame Installation	71 days	Wed 16/04/05	Fri 21/05/05														
89	Door Installation	31 days	Mon 19/04/05	Wed 19/05/05														

Monthly: Mr. Eric Tu  
 Programme ref: DRCH/SLX01 Rev.C  
 Dated: 26 JAN 2005

Approved by: \_\_\_\_\_  
 Release: \_\_\_\_\_  
 Summary: \_\_\_\_\_

Task Progress: \_\_\_\_\_  
 Rolled Up Task: \_\_\_\_\_  
 Rolled Up Milestone: \_\_\_\_\_  
 Milestone: \_\_\_\_\_  
 Summary: \_\_\_\_\_

External Tasks: \_\_\_\_\_  
 Project Summary: \_\_\_\_\_


Group By: Summary

Master Programme for Repaving of Diamond Hill Crematorium at Po Seng Village Road, Kowloon, Hong Kong

ID	任務名稱	Duration	Start	Finish	Dec	Nov	Dec	Jan	Feb	Mar	Apr	May	Jun	Jul	Aug	Sept	Oct	Nov	Dec
111	Interim report	13 days	Tue 16/04/06	Tue 15/04/06															
112	Cabinet, Vandy Top & Reception Counter	107 days	Tue 16/04/06	Fri 30/06/06															
113	Lockers, Access Panel etc	87 days	Sat 15/04/06	Sat 10/07/06															
114	Tablet Pedestal	19 days	Fri 10/04/06	Tue 28/04/06															
115	Steel & Metalwork	214 days	Mon 12/10/05	Mon 10/07/06															
116	Internal & External	181 days	Tue 11/10/05	Sun 30/04/06															
117	Steel Door Frame	61 days	Mon 12/10/05	Fri 01/12/05															
118	Steel Door Installation	30 days	Sat 16/04/06	Mon 15/05/06															
119	Roller Shutter Installation	71 days	Wed 12/04/06	Wed 10/05/06															
120	Steel & Metal Work	80 days	Sat 17/04/06	Mon 10/07/06															
121	Suspended Ceiling Installation	213 days	Fri 10/12/05	Tue 14/07/06															
122	Gypsum Board Ceiling	46 days	Mon 12/10/05	Tue 15/05/06															
123	Acoustic false ceiling grid	31 days	Wed 12/04/06	Fri 31/07/06															
124	Acoustic false ceiling panel	10 days	Sat 17/04/06	Mon 10/07/06															
125	Acoustic Wall Panel	91 days	Sat 18/04/06	Fri 10/05/06															
126	Carpet Flooring	15 days	Sat 17/04/06	Sat 13/07/06															
127	PVC'S, Steel Tactile	15 days	Sat 17/04/06	Sat 13/07/06															
128	Floor Mat	7 days	Wed 12/04/06	Tue 10/07/06															
129	Painting	214 days	Fri 10/12/05	Tue 14/07/06															
130	External Finishing	396 days	Sun 12/05/06	Wed 31/08/06															
131	Alteration Window & Composite Windows	362 days	Sun 12/05/06	Fri 28/09/06															
132	Shop Drawing Submission & Approval	76 days	Sun 12/05/06	Fri 13/07/06															
133	Manufacturing & Delivery	64 days	Sat 17/04/06	Tue 13/09/06															
134	Window frame and web	31 days	Wed 12/04/06	Fri 31/07/06															
135	Glazing & Scaffolding	107 days	Fri 10/12/05	Tue 14/07/06															
136	External Wall Finishing	74 days	Mon 30/10/05	Tue 14/09/06															
137	External Wall Finishing	59 days	Tue 21/04/06	Sat 20/04/06															
138	External Wall Finishing	49 days	Mon 27/04/06	Tue 11/04/06															
139	Metal Lattice Installation	396 days	Sun 12/05/06	Wed 31/08/06															
140	Glass Canopy Installation	92 days	Sun 12/05/06	Wed 31/08/06															
141	Shop Drawing Submission & Approval	61 days	Mon 12/05/06	Fri 30/08/06															
142	Preparation of Mock Up Sample	31 days	Sat 17/04/06	Mon 31/08/06															
143	Visual Inspection & Approval	92 days	Tue 21/04/06	Tue 31/07/06															
144	Manufacturing & Delivery	89 days	Sat 17/04/06	Wed 11/09/06															
145	Site Installation	33 days	Tue 10/04/06	Mon 15/05/06															
146	Slight Installation	92 days	Tue 10/04/06	Mon 15/05/06															
147	Shop Drawing Submission & Approval	51 days	Fri 16/04/06	Tue 19/11/06															
148	Preparation of Mock Up Sample	30 days	Wed 16/04/06	Tue 19/11/06															
149	Performance Test	46 days	Tue 16/04/06	Wed 15/05/06															
150	Site Installation	13 days	Mon 12/05/06	Mon 15/05/06															
151	Field Test	30 days	Sat 16/04/06	Wed 31/05/06															
152	Shop Drawing Submission & Approval	92 days	Sat 16/04/06	Sat 19/07/06															
153	Preparation of Mock Up Sample	31 days	Sun 16/04/06	Tue 19/11/06															
154	Visual Inspection & Approval	90 days	Mon 16/04/06	Sat 13/09/06															
155	Manufacturing & Delivery	46 days	Sun 16/04/06	Wed 31/05/06															
156	Site Installation	17 days	Fri 16/04/06	Tue 20/04/06															
157	Roofing	34 days	Fri 16/04/06	Tue 20/04/06															
158	Concrete & Steel Steel	37 days	Fri 16/04/06	Tue 20/04/06															
159	Waterproofing	30 days	Mon 16/04/06	Tue 20/04/06															
160	Water Test / Infra Red Scanning	30 days	Mon 16/04/06	Tue 20/04/06															
161	Insulation Board	39 days	Mon 27/04/06	Tue 22/04/06															
162	Steel Tile	39 days	Mon 27/04/06	Tue 22/04/06															

Prepared by: Ms. Eric To  
 Prepared at: D:\PROJECTS\0001 Rev.C  
 Date: 28 JAN 2006

Approved by: \_\_\_\_\_  
 Milestone Summary  
 Task Progress  
 Rolled Up Progress  
 Rolled Up Milestone  
 Rolled Up Task  
 Rolled Up Milestone  
 External Tasks  
 External Summary  
 Group By Summary  
 Task Summary

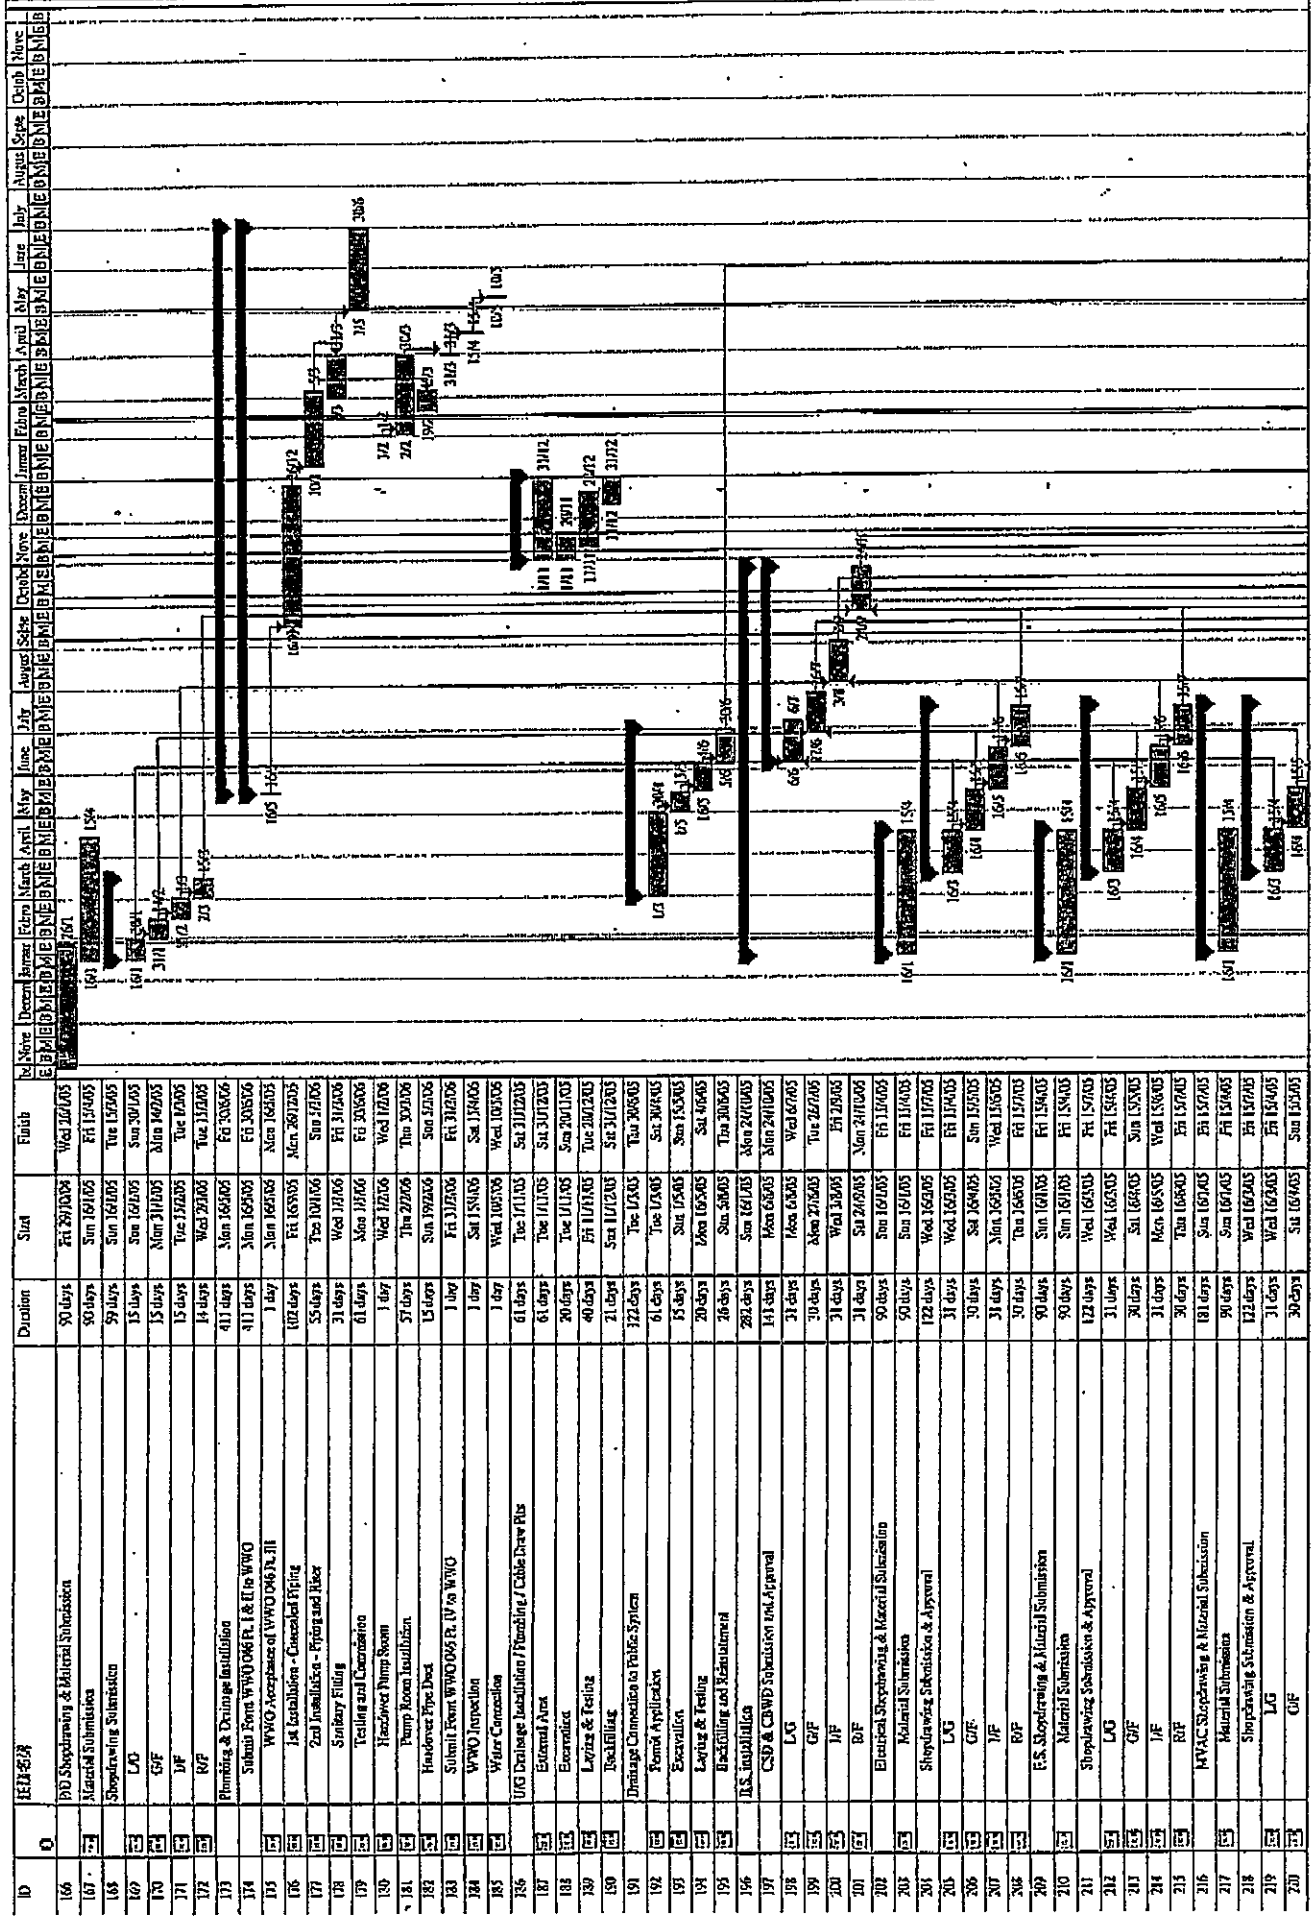

ID	Task Name	Duration	Start	Finish
166	PD Shopdrawing & Material Submittals	30 days	Fri 13/11/09	Wed 17/12/09
167	Material Submittals	30 days	Fri 13/11/09	Fri 13/11/09
168	Shopdrawing Submittals	30 days	Sun 16/11/09	Tue 16/11/09
169	LAG	15 days	Sun 16/11/09	Sun 29/11/09
170	GPF	15 days	Mon 22/11/09	Mon 16/12/09
171	J/F	15 days	Tue 17/11/09	Tue 16/12/09
172	R/F	14 days	Wed 24/11/09	Tue 15/12/09
173	Plumbing & Draining Installation	411 days	Mon 16/11/09	Fri 30/12/09
174	Submit Form WWO046 R, I & II to WWO	1 day	Mon 16/11/09	Fri 30/12/09
175	WWO Acceptance of WWO046 R, II	107 days	Mon 16/11/09	Mon 16/01/10
176	1st Installation - Conceptal Piping	55 days	Tue 17/11/09	Sun 14/12/09
177	Sanitary Filling	31 days	Wed 24/11/09	Fri 18/12/09
178	Testling and Commissioning	61 days	Mon 16/11/09	Fri 30/12/09
179	Headwater Pump Room	1 day	Wed 17/11/09	Wed 17/11/09
181	Pump Room Installation	57 days	Thu 25/11/09	Thu 30/12/09
182	Headwater Pipe Deck	15 days	Sun 14/12/09	Sun 14/12/09
183	Submit Form WWO005 R, IV to WWO	1 day	Fri 18/12/09	Fri 18/12/09
184	WWO Installation	1 day	Sat 19/12/09	Sat 19/12/09
185	Water Connection	1 day	Wed 10/01/10	Wed 10/01/10
186	U/G Drainage Installation / Pounding of Cable Drawl Ris	61 days	Tue 17/11/09	Sat 31/12/09
187	Excavation	61 days	Tue 17/11/09	Sat 31/12/09
188	Laying & Testing	20 days	Sun 29/11/09	Sat 19/12/09
189	Backfilling and Reinforcement	26 days	Sun 29/11/09	Tue 22/12/09
190	I.S.S. Installation	282 days	Sun 29/11/09	Mon 22/01/10
191	CSD & CBWD Submittals and Approval	144 days	Mon 22/11/09	Sun 29/12/09
192	LAG	31 days	Mon 22/11/09	Wed 10/12/09
193	GPF	31 days	Mon 22/11/09	Wed 10/12/09
194	J/F	31 days	Mon 22/11/09	Wed 10/12/09
195	R/F	31 days	Mon 22/11/09	Wed 10/12/09
196	Electrical Shopdrawing & Material Submittals	90 days	Sun 15/11/09	Fri 11/12/09
197	Material Submittals	50 days	Sun 15/11/09	Fri 11/12/09
198	Shopdrawing Submittals & Approval	122 days	Wed 10/12/09	Fri 11/01/10
199	LAG	31 days	Wed 10/12/09	Fri 11/01/10
200	GPF	31 days	Wed 10/12/09	Fri 11/01/10
201	J/F	31 days	Wed 10/12/09	Fri 11/01/10
202	R/F	31 days	Wed 10/12/09	Fri 11/01/10
203	Material Submittals	90 days	Sun 15/11/09	Fri 11/12/09
204	Shopdrawing Submittals & Approval	122 days	Wed 10/12/09	Fri 11/01/10
205	LAG	31 days	Wed 10/12/09	Fri 11/01/10
206	GPF	31 days	Wed 10/12/09	Fri 11/01/10
207	J/F	31 days	Wed 10/12/09	Fri 11/01/10
208	R/F	31 days	Wed 10/12/09	Fri 11/01/10
209	MVAC Shopdrawing & Material Submittals	81 days	Sun 15/11/09	Fri 11/12/09
210	Material Submittals	90 days	Sun 15/11/09	Fri 11/12/09
211	Shopdrawing Submittals & Approval	122 days	Wed 10/12/09	Fri 11/01/10
212	LAG	31 days	Wed 10/12/09	Fri 11/01/10
213	GPF	31 days	Wed 10/12/09	Fri 11/01/10
214	J/F	31 days	Wed 10/12/09	Fri 11/01/10
215	R/F	31 days	Wed 10/12/09	Fri 11/01/10
216	MVAC Shopdrawing & Material Submittals	81 days	Sun 15/11/09	Fri 11/12/09
217	Material Submittals	90 days	Sun 15/11/09	Fri 11/12/09
218	Shopdrawing Submittals & Approval	122 days	Wed 10/12/09	Fri 11/01/10
219	LAG	31 days	Wed 10/12/09	Fri 11/01/10
220	GPF	30 days	Sun 14/01/10	Sun 14/01/10


Filtered by: Milestone Summary  
 Task Progress  
 Rolled Up Progress  
 External Tasks  
 Project Summary  
 Group By: Summary  
 Master Programme for Expediting of Diamond Hill Crematorium at Po Kwoi Uddape Road, Kowloon, Hong Kong  
 5/8/10

ID	任務名稱	Duration	Start	Finish	Jan	Feb	Mar	Apr	May	June	July	Aug	Sept	Oct	Nov	Dec	Jan	Feb	Mar	Apr	May	June	July	Aug	Sept	Oct	Nov	Dec
21	LF	31 days	Mon 16/05/03	Wed 15/06/03																								
22	RF	30 days	Tue 16/05/03	Fri 15/06/03																								
23	Electrical Installation	288 days	Fri 16/05/03	Fri 15/06/03																								
24	Let Filing - Conduit & Wiring	107 days	Fri 16/05/03	Sat 31/07/03																								
25	Concealed Conduit Installation	92 days	Fri 16/05/03	Fri 16/06/03																								
26	LG - GF	31 days	Fri 16/05/03	Sun 10/06/03																								
27	GF - RF	50 days	Mon 17/05/03	Tue 13/06/03																								
28	GF - RF	31 days	Wed 18/05/03	Fri 19/06/03																								
29	Wiring Works for ELY & Feed Sub-circuit	56 days	Sun 01/06/03	Sat 30/07/03																								
30	LV	14 days	Sun 01/06/03	Sat 30/07/03																								
31	GF	14 days	Sun 01/06/03	Sat 30/07/03																								
32	GF	14 days	Sun 01/06/03	Sat 30/07/03																								
33	GF	14 days	Sun 01/06/03	Sat 30/07/03																								
34	2nd Fixing - Fittings	46 days	Tue 11/06/03	Sun 15/06/03																								
35	Lit Filing, Filing (ELV) Installation	42 days	Tue 11/06/03	Mon 27/06/03																								
36	LG	14 days	Tue 11/06/03	Mon 27/06/03																								
37	GF	14 days	Tue 11/06/03	Mon 27/06/03																								
38	RF	14 days	Tue 11/06/03	Mon 27/06/03																								
39	GF	14 days	Tue 11/06/03	Mon 27/06/03																								
40	GF	14 days	Tue 11/06/03	Mon 27/06/03																								
41	GF	14 days	Tue 11/06/03	Mon 27/06/03																								
42	GF	14 days	Tue 11/06/03	Mon 27/06/03																								
43	GF	14 days	Tue 11/06/03	Mon 27/06/03																								
44	GF	14 days	Tue 11/06/03	Mon 27/06/03																								
45	GF	14 days	Tue 11/06/03	Mon 27/06/03																								
46	GF	14 days	Tue 11/06/03	Mon 27/06/03																								
47	GF	14 days	Tue 11/06/03	Mon 27/06/03																								
48	GF	14 days	Tue 11/06/03	Mon 27/06/03																								
49	GF	14 days	Tue 11/06/03	Mon 27/06/03																								
50	GF	14 days	Tue 11/06/03	Mon 27/06/03																								
51	GF	14 days	Tue 11/06/03	Mon 27/06/03																								
52	GF	14 days	Tue 11/06/03	Mon 27/06/03																								
53	GF	14 days	Tue 11/06/03	Mon 27/06/03																								
54	GF	14 days	Tue 11/06/03	Mon 27/06/03																								
55	GF	14 days	Tue 11/06/03	Mon 27/06/03																								
56	GF	14 days	Tue 11/06/03	Mon 27/06/03																								
57	GF	14 days	Tue 11/06/03	Mon 27/06/03																								
58	GF	14 days	Tue 11/06/03	Mon 27/06/03																								
59	GF	14 days	Tue 11/06/03	Mon 27/06/03																								
60	GF	14 days	Tue 11/06/03	Mon 27/06/03																								
61	GF	14 days	Tue 11/06/03	Mon 27/06/03																								
62	GF	14 days	Tue 11/06/03	Mon 27/06/03																								
63	GF	14 days	Tue 11/06/03	Mon 27/06/03																								
64	GF	14 days	Tue 11/06/03	Mon 27/06/03																								
65	GF	14 days	Tue 11/06/03	Mon 27/06/03																								
66	GF	14 days	Tue 11/06/03	Mon 27/06/03																								
67	GF	14 days	Tue 11/06/03	Mon 27/06/03																								
68	GF	14 days	Tue 11/06/03	Mon 27/06/03																								
69	GF	14 days	Tue 11/06/03	Mon 27/06/03																								
70	GF	14 days	Tue 11/06/03	Mon 27/06/03																								
71	GF	14 days	Tue 11/06/03	Mon 27/06/03																								
72	GF	14 days	Tue 11/06/03	Mon 27/06/03																								
73	GF	14 days	Tue 11/06/03	Mon 27/06/03																								
74	GF	14 days	Tue 11/06/03	Mon 27/06/03																								
75	GF	14 days	Tue 11/06/03	Mon 27/06/03																								

Issued by: Mr. Eric To  
 prepared at: D:\CHAMP\1001 Rev.C  
 and: 26 JAN 2003  
 approved by:

Task Progress Summary  
 Addressed Summary  
 Rolled Up Task  
 Rolled Up Progress Summary  
 External Tasks  
 Project Summary  
 Group By Summary

Master Programme for Representing of Dimensions of Construction at Po Kong Village Road, Kowloon, Hong Kong

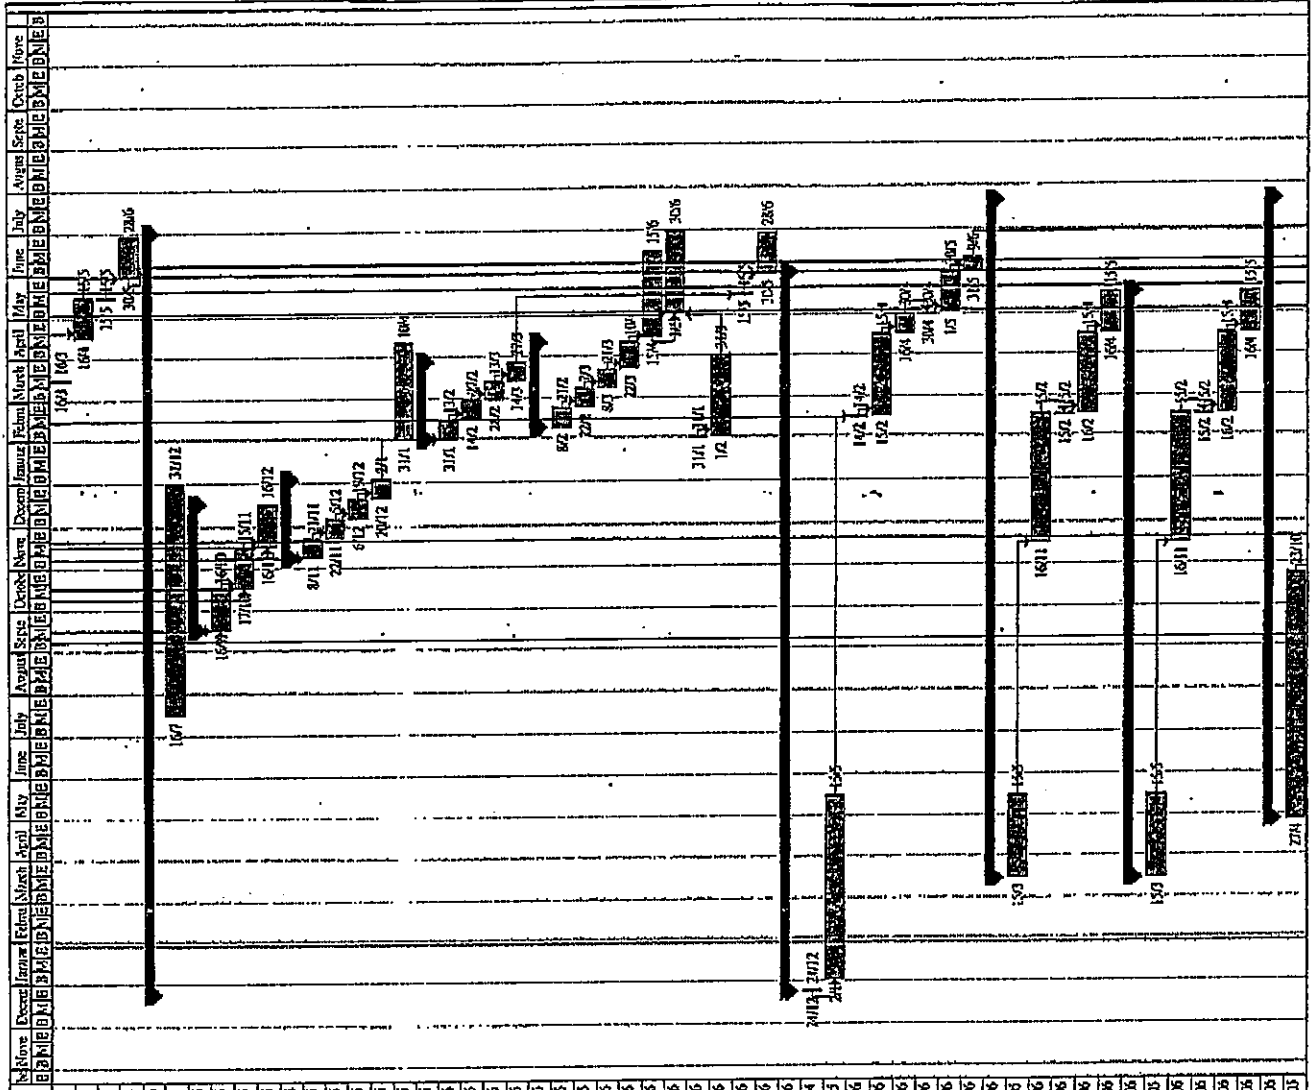

ID	Description	Duration	Start	Finish
276	Submit Form WFO 246 R.I.V to WFO	1 day	Tue 16/12/04	Tue 16/12/04
277	Testing and Commission	20 days	Sun 16/12/04	Mon 16/01/05
278	Form 501	1 day	Mon 15/01/05	Mon 15/01/05
279	E.S. Inspection	30 days	Tue 16/01/05	Wed 23/02/05
280	HVAC Installation	55 days	Thu 20/01/05	Thu 18/03/05
281	Final Filing - Consent & Wiring	169 days	Sat 16/01/05	Sat 31/12/05
282	Consent Certificate Installation	31 days	Fri 16/01/05	Fri 16/01/05
283	LAG - GRF	30 days	Mon 17/01/05	Tue 15/01/05
284	JF - RIF	31 days	Wed 16/01/05	Fri 16/01/05
285	Code Writing	56 days	Tue 16/01/05	Mon 21/02/05
287	LXP	14 days	Tue 16/01/05	Mon 21/01/05
288	GRF	34 days	Tue 22/01/05	Mon 21/02/05
289	JF	14 days	Tue 16/01/05	Mon 17/01/05
290	RIF	14 days	Tue 16/01/05	Mon 17/01/05
291	2nd Filing - Air Ducts, Ventilation Fan and A.C. Units	20 days	Tue 20/01/05	Mon 21/02/05
292	Duct Work & Epowork Installation	36 days	Tue 20/01/05	Mon 14/02/05
293	LAG	14 days	Tue 20/01/05	Mon 14/02/05
294	GRF	14 days	Tue 16/01/05	Mon 17/01/05
295	JF	14 days	Tue 22/01/05	Mon 17/01/05
296	RIF	14 days	Tue 16/01/05	Mon 17/01/05
297	SFD Type System, VRV Fan & Ventilation Fan Installation	62 days	Wed 27/01/05	Mon 14/03/05
298	LAG	14 days	Wed 27/01/05	Mon 14/03/05
299	GRF	14 days	Wed 27/01/05	Tue 27/01/05
300	JF	14 days	Wed 27/01/05	Tue 27/01/05
301	RIF	20 days	Wed 27/01/05	Mon 14/02/05
302	Final Filing Diffusers Checks etc	62 days	Sat 13/01/05	Tue 15/02/05
303	Testing and Commission	61 days	Mon 15/01/05	Fri 23/02/05
304	Handover of AHU Plant Room (GRF)	1 day	Tue 27/01/05	Tue 27/01/05
305	Plant Room Installation	1 day	Wed 17/01/05	Fri 17/01/05
306	Form 501	1 day	Mon 15/01/05	Mon 15/01/05
307	Ventilation Inspection	30 days	Tue 20/01/05	Wed 23/02/05
308	Lift Installation	52 days	Fri 20/01/05	Tue 22/02/05
309	Removal of LRV NSC (to be confirmed)	1 day	Fri 20/01/05	Fri 20/01/05
310	Scaffolding and Material Submittals & Approval	134 days	Sun 21/01/05	Sun 15/03/05
311	Handover Lift Machine Room & Shaft	1 day	Tue 19/01/05	Tue 19/01/05
312	Lift Installation	60 days	Wed 19/01/05	Sat 15/02/05
313	Testing and Commission	13 days	Sat 16/01/05	Sun 20/01/05
314	Floor 5	1 day	Sun 20/01/05	Sun 20/01/05
315	EHSO Inspection	30 days	Mon 15/01/05	Tue 22/02/05
316	Lift Certificate	10 days	Wed 17/01/05	Fri 19/01/05
317	Emergency Gen Set Installation	493 days	Tue 15/01/05	Tue 20/02/05
318	Shop Drawing and Material Submittals & Approval	62 days	Tue 15/01/05	Sun 15/03/05
319	Delivery of Material / Equipment	92 days	Wed 17/01/05	Wed 15/02/05
320	Handover of EECN Set Room (GRF)	1 day	Wed 17/01/05	Wed 17/01/05
321	Gen Set Installation	59 days	Wed 17/01/05	Wed 15/02/05
322	Testing and Commissioning	30 days	Tue 16/01/05	Sat 15/02/05
323	Fabrication System	427 days	Tue 15/01/05	Mon 15/03/05
324	Shop Drawing and Material Submittals & Approval	62 days	Tue 15/01/05	Sun 15/03/05
325	Delivery of Material / Equipment	92 days	Wed 17/01/05	Wed 15/02/05
326	Handover of Filtration Plant Room (GRF)	1 day	Wed 17/01/05	Wed 17/01/05
327	Filtration Installation & Filtration Plant Installation	59 days	Tue 16/01/05	Sat 15/02/05
328	Testing and Commissioning	30 days	Sun 16/01/05	Mon 15/02/05
329	Crosser Plant Installation (PSSC)	158 days	Wed 27/01/05	Tue 20/02/05
330	Shop Drawing & Equipment Submittals and approval	180 days	Wed 27/01/05	Sun 20/02/05

Approved by: Mr. Eric To  
 Programme ref: DHC/MS/J001 Rev.C  
 Prod 28 JAN 2005

Task Progress

Released Up Progress Split

Released Up Track Released Up Milestone

Group By Summary

External Tasks Project Summary

Master Programme for Reprovisioning of Diamond Hill Crematorium at To Kong Village Road, Kowloon, Hong Kong








---

**APPENDIX C  
ENVIRONMENTAL ACTION AND LIMIT  
LEVELS**

---

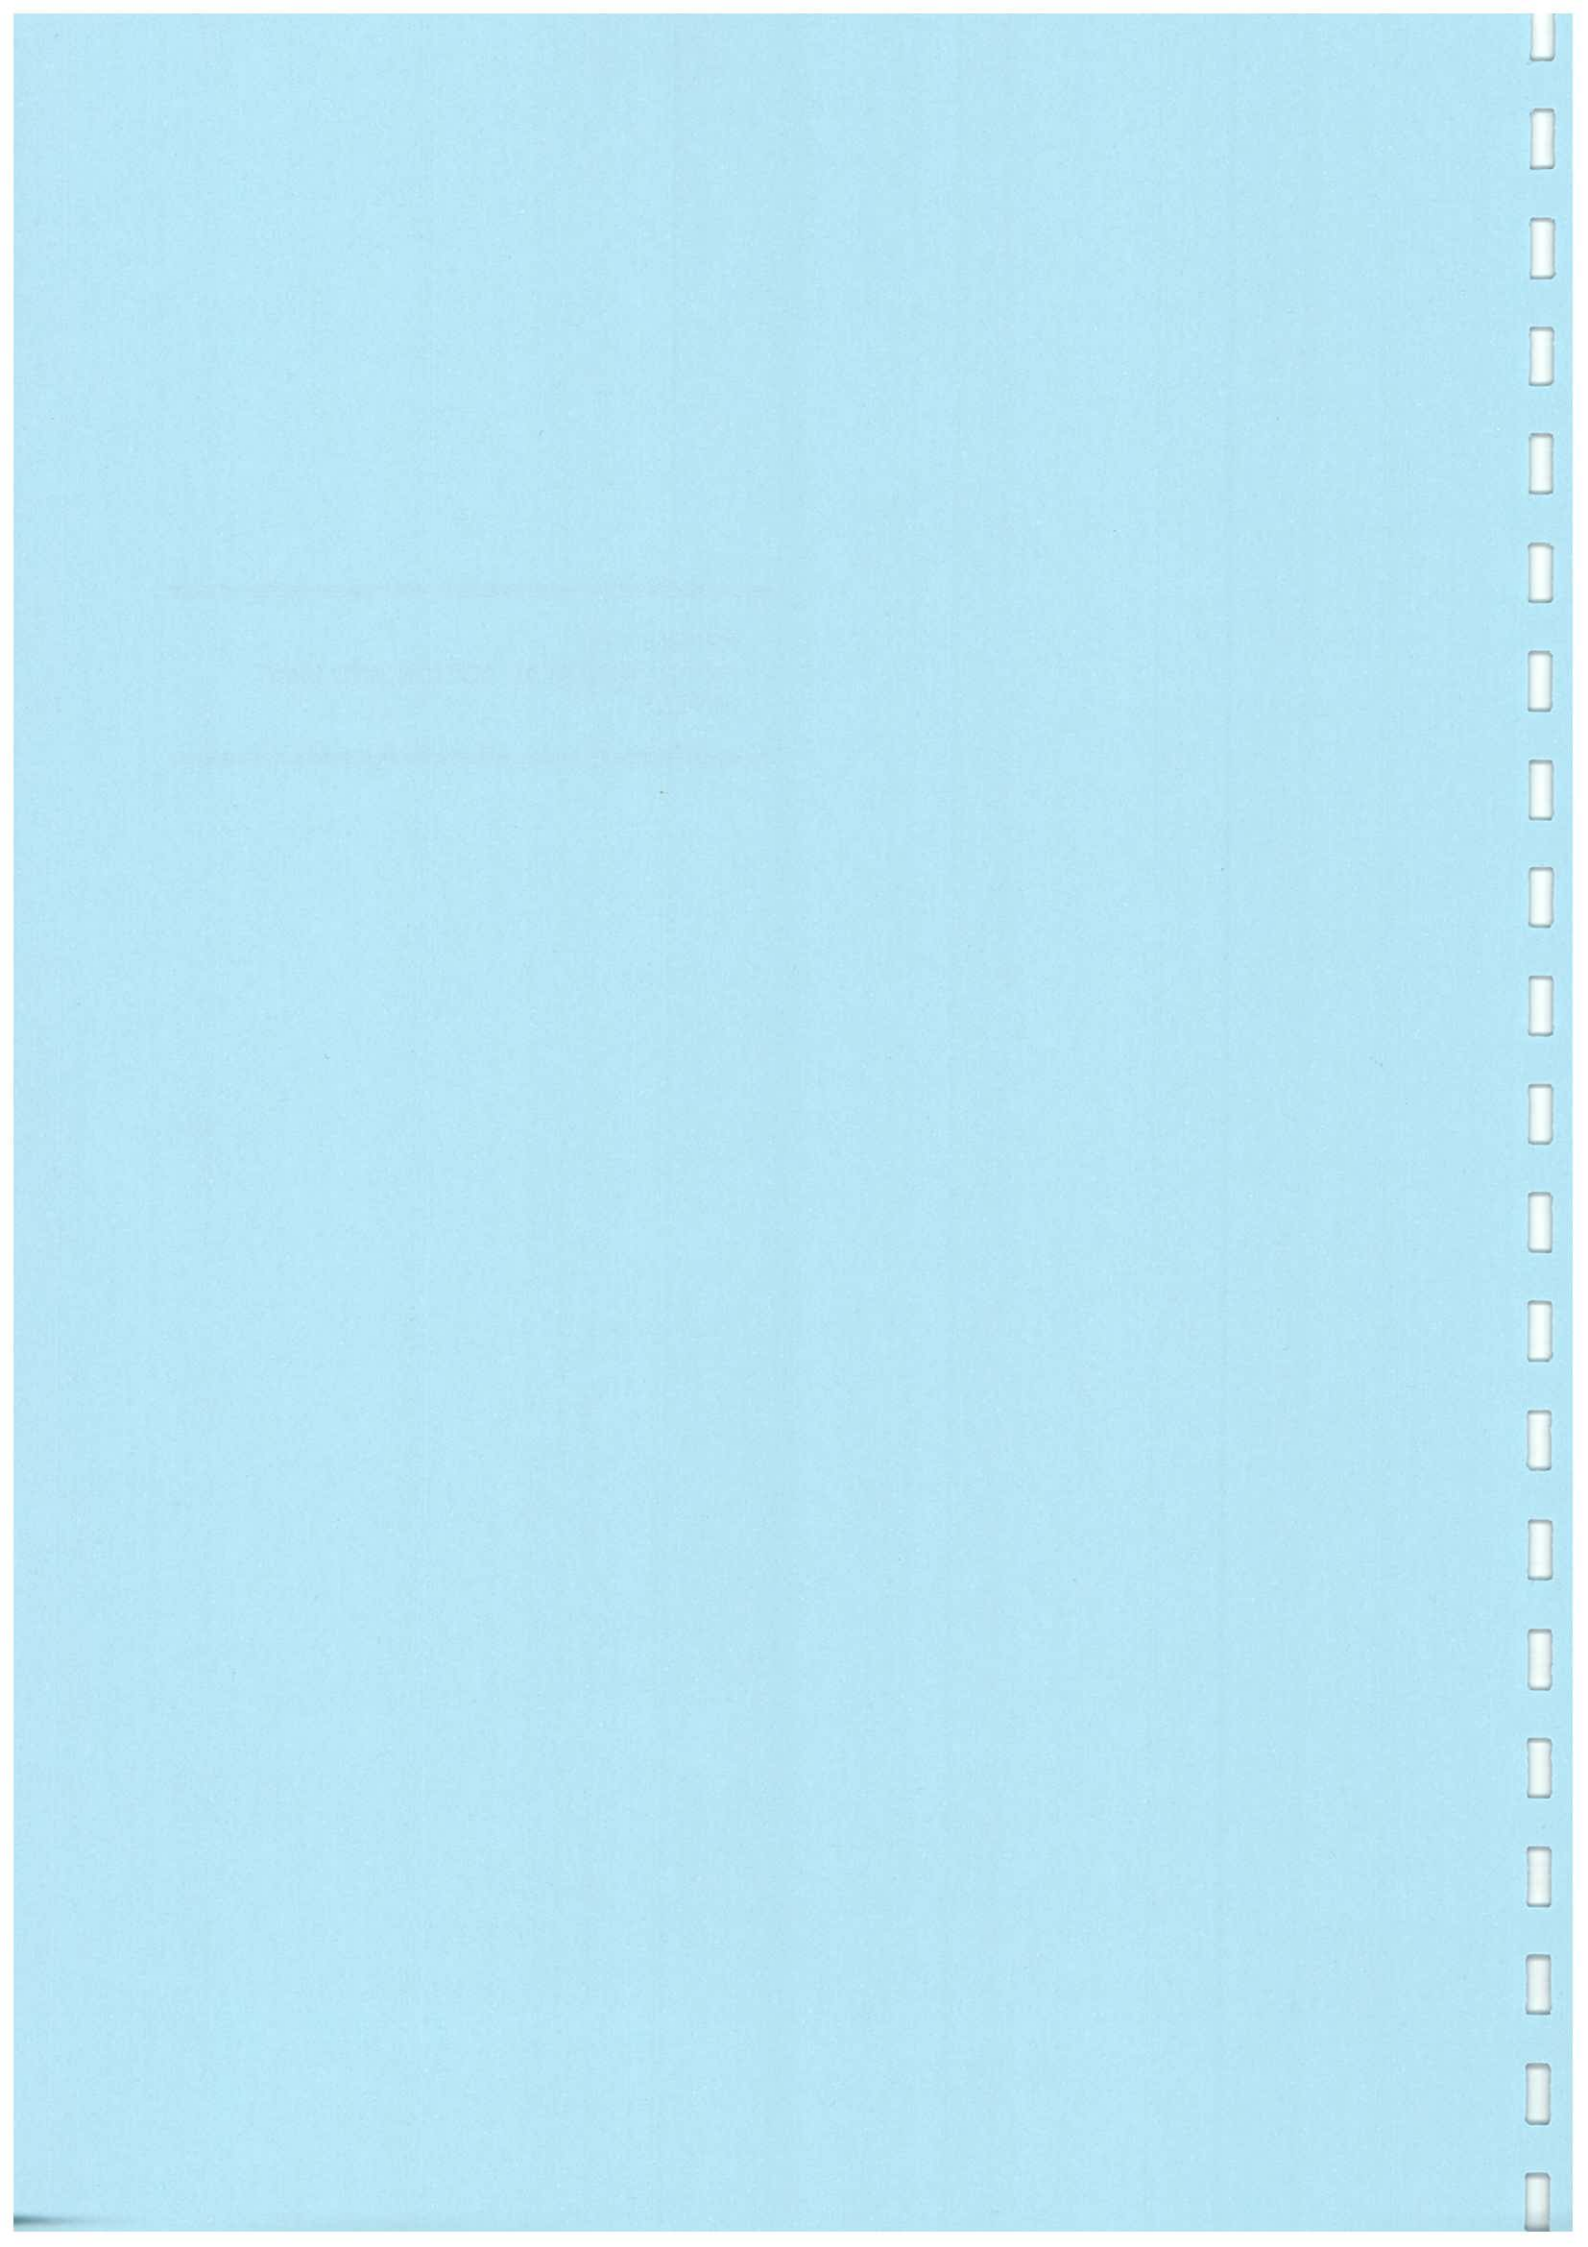

## Appendix C Environmental Action and Limit Levels

### Action and Limit Levels for 24-hour TSP

Monitoring Station	Action Level ( $\mu\text{g}/\text{m}^3$ )	Limit Level ( $\mu\text{g}/\text{m}^3$ )
ASR8	195.0	260
ASR17	174.1	260


### Action and Limit Levels for 1-hour TSP

Monitoring Station	Action Level ( $\mu\text{g}/\text{m}^3$ )	Limit Level ( $\mu\text{g}/\text{m}^3$ )
ASR8	408.1	500
ASR17	408.4	500

### Action and Limit Levels ( $L_{eq}$ ) for Construction Noise

Time Period	Action Level	Limit Level		
		SR3	SR4	SR6
0700 – 1900 hours on normal weekdays	When one documented complaint is received from any one of the sensitive receivers	70/65*	70/65*	75
0700 – 2300 hours on public holidays including Sundays and 1900 – 2300 hours on all days		Subject to requirements stipulated in future Construction Noise Permits		
2300 – 0700 on all days				


\*reduce to 70dB(A) for schools and 65dB(A) during school examination periods



---

**APPENDIX D  
ENVIRONMENTAL MONITORING AND  
AUDIT SCHEDULES**

---

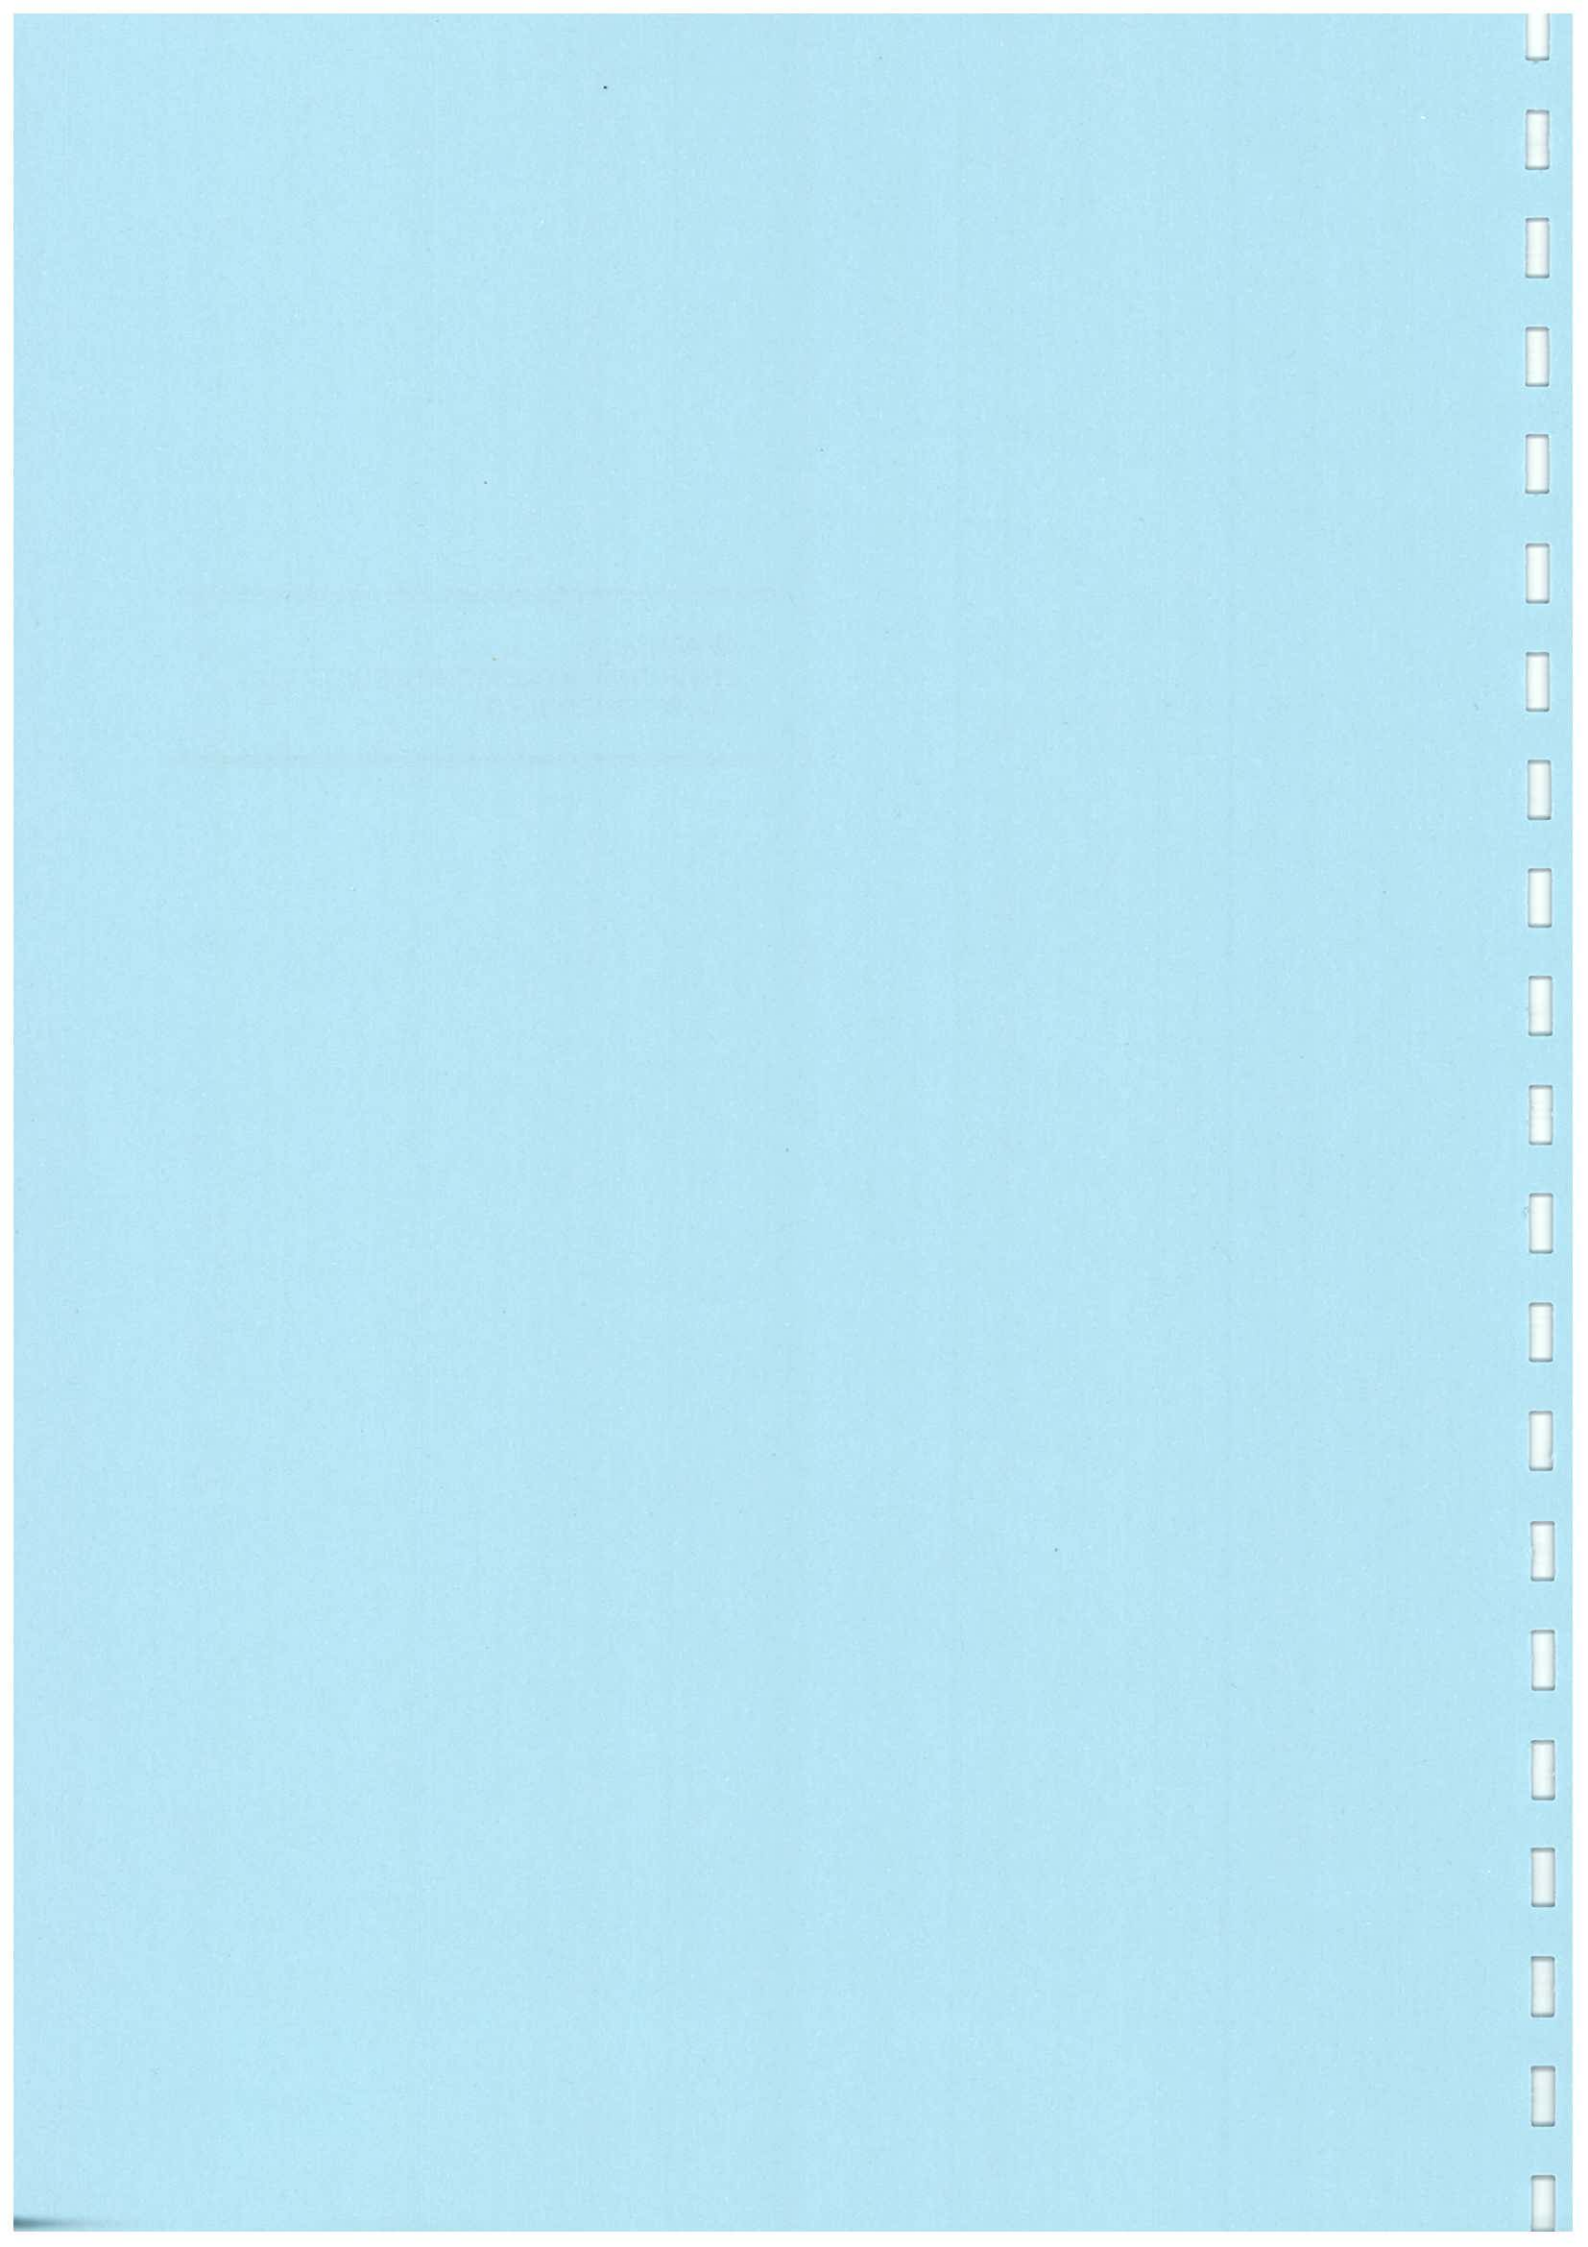



**Reprovisioning of Diamond Hill Crematorium  
Impact Air Quality and Noise Monitoring and Audit Schedule for March 2005**

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
		01-Mar	02-Mar	03-Mar	04-Mar	05-Mar
			24-hour TSP	1-hour TSP Noise		
06-Mar	07-Mar	08-Mar	09-Mar	10-Mar	11-Mar	12-Mar
		24-hour TSP	Site Environmental Audit			
			1-hour TSP Noise		Site Environmental Audit	
13-Mar	14-Mar	15-Mar	16-Mar	17-Mar	18-Mar	19-Mar
	24-hour TSP	1-hour TSP Noise				24-hour TSP
			Site Environmental Audit			
20-Mar	21-Mar	22-Mar	23-Mar	24-Mar	25-Mar	26-Mar
				24-hour TSP 1-hour TSP		
	1-hour TSP Noise		Site Environmental Audit			
27-Mar	28-Mar	29-Mar	30-Mar	31-Mar		
			Site Environmental Audit	24-hour TSP		
			Site Environmental Audit			

The schedule is subject to change due to unforeseeable circumstances (adverse weather, etc)

**Reprovisioning of Diamond Hill Crematorium  
Tentative Impact Air Quality and Noise Monitoring and Audit Schedule for April 2005**

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
					01-Apr	02-Apr
					1-hour TSP Noise	
03-Apr	04-Apr	05-Apr	06-Apr	07-Apr	08-Apr	09-Apr
			24-hour TSP	1-hour TSP Noise Site Environmental Audit		
10-Apr	11-Apr	12-Apr	13-Apr	14-Apr	15-Apr	16-Apr
		24-hour TSP	1-hour TSP Noise Site Environmental Audit			
17-Apr	18-Apr	19-Apr	20-Apr	21-Apr	22-Apr	23-Apr
	24-hour TSP	1-hour TSP Noise	Site Environmental Audit			24-hour TSP
24-Apr	25-Apr	26-Apr	27-Apr	28-Apr	29-Apr	30-Apr
	1-hour TSP Noise		Site Environmental Audit		24-hour TSP	
			Site Environmental Audit			1-hour TSP

The schedule is subject to change due to unforeseeable circumstances (adverse weather, etc)



**Reprovisioning of Diamond Hill Crematorium  
Tentative Impact Air Quality and Noise Monitoring and Audit Schedule for May 2005**

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
01-May	02-May	03-May	04-May	05-May	06-May	07-May
			Site Environmental Audit	24-hour TSP	1-hour TSP Noise	
08-May	09-May	10-May	11-May	12-May	13-May	14-May
			24-hour TSP	1-hour TSP Noise		
15-May	16-May	17-May	18-May	19-May	20-May	21-May
		24-hour TSP	Site Environmental Audit			
22-May	23-May	24-May	25-May	26-May	27-May	28-May
	24-hour TSP		1-hour TSP Noise Site Environmental Audit			24-hour TSP
29-May	30-May	31-May				
	1-hour TSP Noise		Site Environmental Audit			

The schedule is subject to change due to unforeseeable circumstances (adverse weather, etc)

**Reprovisioning of Diamond Hill Crematorium  
Tentative Impact Air Quality and Noise Monitoring and Audit Schedule for June 2005**


Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
			01-Jun	02-Jun	03-Jun	04-Jun
			Site Environmental Audit		24-hour TSP	1-hour TSP Noise
05-Jun	06-Jun	07-Jun	08-Jun	09-Jun	10-Jun	11-Jun
			Site Environmental Audit	24-hour TSP	1-hour TSP Noise	
12-Jun	13-Jun	14-Jun	15-Jun	16-Jun	17-Jun	18-Jun
			Site Environmental Audit	24-hour TSP	1-hour TSP Noise	
19-Jun	20-Jun	21-Jun	22-Jun	23-Jun	24-Jun	25-Jun
		24-hour TSP	Site Environmental Audit			
26-Jun	27-Jun	28-Jun	29-Jun	30-Jun		
	24-hour TSP	1-hour TSP Noise	Site Environmental Audit			

The schedule is subject to change due to unforeseeable circumstances (adverse weather, etc)

---

**APPENDIX E  
CALIBRATION DETAILS**

---

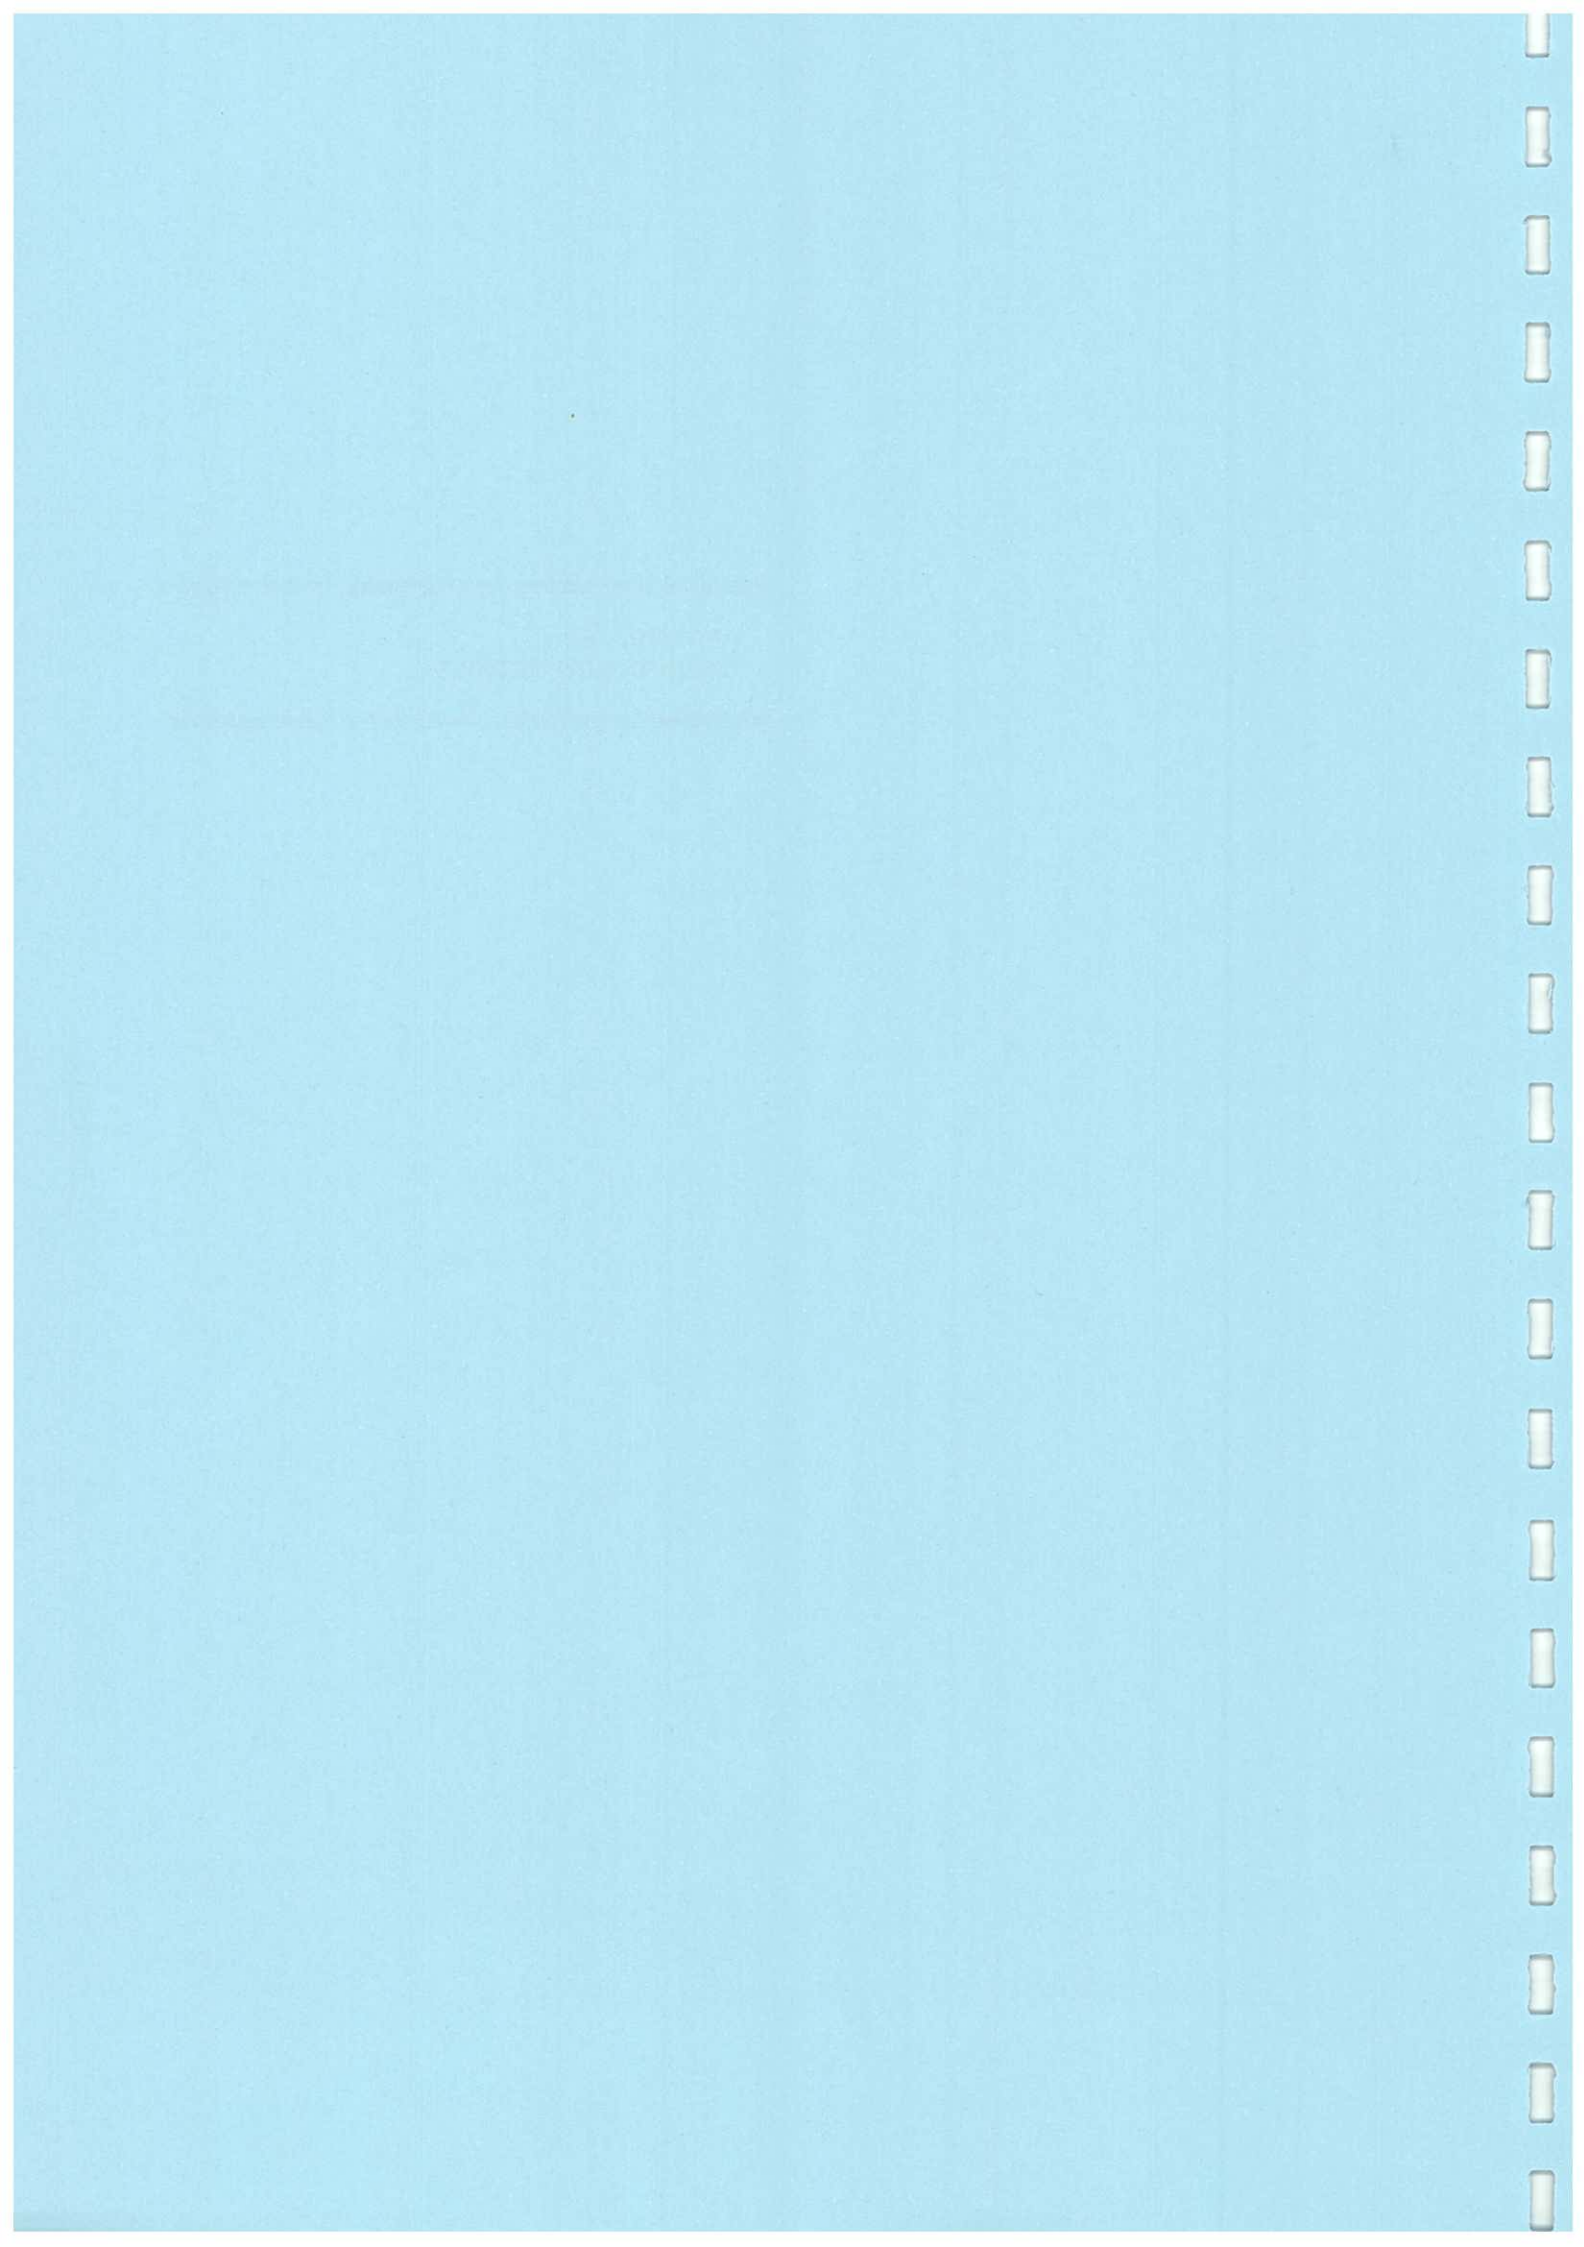

**Maunsell Environmental Management Consultants Ltd.**  
**TSP High Volume Sampler**  
**Field Calibration Report**

Station Po Leung Kuk Grandmont Primary School (ASR8) Operator: Porky Chu  
 Cal. Date: 19-Feb-05 Next Due Date: 19-Apr-05  
 Equipment No.: A-001-69T Serial No. 0716

Ambient Condition			
Temperature, Ta (K)	283	Pressure, Pa (mmHg)	768.0

Orifice Transfer Standard Information					
Equipment No.:	A-003-03	Slope, mc	2.01571	Intercept, bc	-0.02096
Last Calibration Date:	03-Dec-04	$mc \times Qstd + bc = [DH \times (Pa/760) \times (298/Ta)]^{1/2}$			
Next Calibration Date:	02-Dec-05	$Qstd = \{[DH \times (Pa/760) \times (298/Ta)]^{1/2} - bc\} / mc$			

Calibration of TSP Sampler					
Resistance Plate No.	Orifice			HVS Flow Recorder	
	DH (orifice), in. of water	$[DH \times (Pa/760) \times (298/Ta)]^{1/2}$	Qstd (m <sup>3</sup> /min) X-axis	Flow Recorder Reading (CFM)	Continuous Flow Recorder Reading IC (CFM) Y-axis
18	12.5	3.65	1.82	50.0	51.58
13	10.0	3.26	1.63	46.0	47.45
10	7.7	2.86	1.43	38.0	39.20
7	5.0	2.31	1.15	30.0	30.95
5	2.5	1.63	0.82	20.0	20.63

By Linear Regression of Y on X  
 Slope, mw = 31.6681 Intercept, bw = -5.4443  
 Correlation Coefficient\* = 0.9959  
 \*If Correlation Coefficient < 0.990, check and recalibrate.

**Set Point Calculation**

From the TSP Field Calibration Curve, take Qstd = 1.30m<sup>3</sup>/min  
 From the Regression Equation, the "Y" value according to

$$mw \times Qstd + bw = IC \times [(Pa/760) \times (298/Ta)]^{1/2}$$

Therefore, Set Point; IC =  $(mw \times Qstd + bw) \times [(760 / Pa) \times (Ta / 298)]^{1/2} =$  34.63

Remarks: \_\_\_\_\_  
 \_\_\_\_\_

QC Reviewer: Thomas Chen Signature: [Signature] Date: 21/02/05

**Maunsell Environmental Management Consultants Ltd.**  
**TSP High Volume Sampler**  
**Field Calibration Report**

Station Staff Quarter For Diamond Hill Crematorium (ASR17) Operator: Porky Chu  
 Cal. Date: 19-Feb-04 Next Due Date: 19-Apr-05  
 Equipment No.: A-001-21T Serial No. 10278

Ambient Condition			
Temperature, Ta (K)	283	Pressure, Pa (mmHg)	768.0

Orifice Transfer Standard Information					
Equipment No.:	A-003-03	Slope, mc	2.01571	Intercept, bc	-0.02096
Last Calibration Date:	03-Dec-04	$mc \times Qstd + bc = [DH \times (Pa/760) \times (298/Ta)]^{1/2}$			
Next Calibration Date:	02-Dec-05	$Qstd = \{ [DH \times (Pa/760) \times (298/Ta)]^{1/2} - bc \} / mc$			

Calibration of TSP Sampler					
Resistance Plate No.	Orifice			HVS Flow Recorder	
	DH (orifice), in. of water	$[DH \times (Pa/760) \times (298/Ta)]^{1/2}$	Qstd (m <sup>3</sup> /min) X-axis	Flow Recorder Reading (CFM)	Continuous Flow Recorder Reading IC (CFM) Y-axis
18	12.0	3.57	1.78	53.0	54.67
13	9.6	3.20	1.60	45.0	46.42
10	7.2	2.77	1.38	39.0	40.23
7	5.3	2.37	1.19	31.0	31.98
5	3.0	1.79	0.90	23.0	23.73

By Linear Regression of Y on X  
 Slope, mw = 34.8178 Intercept, bw = -8.2819  
 Correlation Coefficient\* = 0.9940  
 \*If Correlation Coefficient < 0.990, check and recalibrate.

**Set Point Calculation**

From the TSP Field Calibration Curve, take Qstd = 1.30m<sup>3</sup>/min  
 From the Regression Equation, the "Y" value according to

$$mw \times Qstd + bw = IC \times [(Pa/760) \times (298/Ta)]^{1/2}$$

Therefore, Set Point; IC =  $(mw \times Qstd + bw) \times [(760 / Pa) \times (Ta / 298)]^{1/2} =$  35.85

Remarks: \_\_\_\_\_

QC Reviewer: Thomas Chen Signature: [Signature] Date: 21/02/05

# EQUIPMENT CALIBRATION RECORD

WILSON

Type: Laser Dust Monitor  
 Manufacturer/Brand: SIBATA  
 Model No.: LD-1  
 Equipment No.: A.005.05a  
 Sensitivity Adjustment Scale Setting: 510 CPM  
 Operator: Eddie Yang (EWNY)

**Standard Equipment**

Equipment: Rupprecht & Patashnick TEOM®  
 Venue: Cyberport (Pui Ying Secondary School)  
 Model No.: Series 1400AB  
 Serial No.: Control: 140AB219899803  
 Sensor: 1200C143659803 K<sub>o</sub>: 12500  
 Last Calibration Date\*: 17 June 2004

\*Remarks: Recommended interval for hardware calibration is 1 year

**Calibration Result**

Sensitivity Adjustment Scale Setting (Before Calibration): 510 CPM  
 Sensitivity Adjustment Scale Setting (After Calibration): 510 CPM

Hour	Date (dd-mm-yy)	Time	Ambient Condition		Concentration <sup>1</sup> (mg/m <sup>3</sup> ) Y-axis	Total Count <sup>2</sup>	Count/ Minute <sup>3</sup> X-axis
			Temp (°C)	R.H. (%)			
1	07-08-04	10:00 - 11:00	29	69	0.02442	1360	22.67
2	07-08-04	12:00 - 13:00	30	68	0.03482	1720	28.67
3	07-08-04	14:00 - 15:00	30	70	0.03421	1694	28.23
4	07-08-04	16:00 - 17:00	29	72	0.04043	1961	32.68

Note: 1. Monitoring data was measured by Rupprecht & Patashnick TEOM®  
 2. Total Count was logged by Laser Dust Monitor  
 3. Count/minute was calculated by (Total Count/60)

By Linear Regression of Y or X  
 Slope (K-factor): 0.0012  
 Correlation coefficient: 0.9286

Validity of Calibration Record: 7 August 2005

Remarks:

QC Reviewer: Thomas Chan Signature: Thomas Chan Date: 27/08/04

# EQUIPMENT CALIBRATION RECORD

Type: Laser Dust Monitor  
 Manufacturer/Brand: SIBATA  
 Model No.: LD-3  
 Equipment No.: A.005.07a  
 Sensitivity Adjustment Scale Setting: 557 CPM

Operator: Eddie Yang (EWNY)

## Standard Equipment

Equipment: Rupprecht & Patashnick TEOM®  
 Venue: Cyberport (Pui Ying Secondary School)  
 Model No.: Series 1400AB  
 Serial No: Control: 140AB219899803  
 Sensor: 1200C143659803 K<sub>o</sub>: 12500  
 Last Calibration Date\*: 17 June 2004

\*Remarks: Recommended interval for hardware calibration is 1 year

## Calibration Result

Sensitivity Adjustment Scale Setting (Before Calibration): 557 CPM  
 Sensitivity Adjustment Scale Setting (After Calibration): 557 CPM

Hour	Date (dd-mm-yy)	Time	Ambient Condition		Concentration <sup>1</sup> (mg/m <sup>3</sup> ) Y-axis	Total Count <sup>2</sup>	Count/ Minute <sup>3</sup> X-axis
			Temp (°C)	R.H. (%)			
1	19-06-04	12:00 - 13:00	31	80	0.02767	762	12.70
2	19-06-04	13:00 - 14:00	31	80	0.02698	727	12.12
3	19-06-04	14:00 - 15:00	30	79	0.02574	704	11.73
4	19-06-04	16:00 - 17:00	29	78	0.02939	819	13.65

Note: 1. Monitoring data was measured by Rupprecht & Patashnick TEOM®  
 2. Total Count was logged by Laser Dust Monitor  
 3. Count/minute was calculated by (Total Count/60)

By Linear Regression of Y or X

Slope (K-factor): 0.0022  
 Correlation coefficient: 0.9345

Validity of Calibration Record: 1 July 2005

Remarks:

QC Reviewer: Thomas Chan

Signature: Thomas Chan

Date: 20 June 2004





# CERTIFICATE OF CALIBRATION

Certificate No.: 04CA0519 02-02 Page: 1 of 2 Pages

## Item tested

Description:	Integrating Sound Level Meter;	Microphone;	Preamplifier
Manufacturer:	RION Co., Ltd.	RION Co., Ltd;	RION Co., Ltd.
Type/Model No.:	NL-31;	UC-53A;	NH-20
Serial/Equipment No.:	00320528;	102439;	84131
Adaptors used:	-		

## Item submitted by

Client: Maunsell Environmental Management Consultants Ltd.  
Request No.: 04CA0519 02-02  
Date of request: 18/05/2004

Date of test: 20/05/2004

## Reference equipment used in the calibration

Description:	Model:	Serial No.	Expiry Date:	Traceable to:
Multi function sound calibrator	B&K 4226	2288444	05/01/2005	NIM, China
Measuring amplifier	B&K 2610	2346941	10/12/2004	NIM
Signal generator	DS 360	33873	14/11/2004	NIM
Audio analyzer	8903B	GB41300350	09/12/2004	NIM
Digital multi-meter	34401A	US36087050	23/12/2004	SCM
Digital barometer	CST2001B	RR163	20/08/2007	NIM

## Ambient conditions

Temperature: (23 ± 3) °C  
Relative humidity: (50 ± 15) %  
Air pressure: (1010 ± 10) hPa

## Test specifications

- The Sound Level Meter has been calibrated in accordance with the requirements as specified in BS 7580: Part 1: 1997 and the lab calibration procedure SMTP004-CA-152.
- The electrical tests were performed using an electrical signal substituted for the microphone which was removed and replaced by an equivalent capacitance within a tolerance of ±20%.
- The acoustic calibration was performed using an B&K 4226 sound calibrator.

## Test results

This is to certify that the Sound Level Meter conforms to BS 7580: Part 1: 1997 for the Type 1 for the conditions under which the test was performed.


Details of the performed measurements are presented on page 2 of this certificate.

Approved Signatory:

Huang Jian Min/Qian Xing

Date: 20/05/2004

Company Chop:

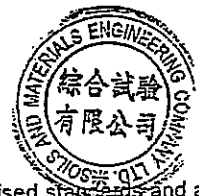

The standard(s) and equipment used in the calibration are traceable to national or international recognised standards and are calibrated on a schedule to maintain the required accuracy level.



## CERTIFICATE OF CALIBRATION

Certificate No.: 05CA0119 01-01

Page: 1 of 2

### Item tested

Description: Sound Level Calibrator  
Manufacturer: RION, Tokyo, Japan  
Type/Model No.: NC-73  
Serial/Equipment No.: N.004.09 *(SN: 1018643)*  
Adaptors used: -

### Item submitted by

Client: Maunsell Consultants Asia Ltd.  
Request No.: 05CA0119 01  
Date of request: 19-Jan-2005

Date of test: 19-Jan-2005

### Reference equipment used in the calibration

Description:	Model:	Serial No.	Expiry Date:	Traceable to:
Lab standard microphone	B&K 4180	2341427	10-Nov-2005	NIM
Preamplifier	B&K 2673	2239857	09-Nov-2005	NIM
Measuring amplifier	B&K 2610	2346941	09-Nov-2005	NIM
Signal generator	DS 360	33873	09-Nov-2005	NIM
Digital multi-meter	34401A	US36087050	22-Nov-2005	SCM
Audio analyzer	8903B	GB41300350	08-Nov-2005	NIM
Universal counter	53132A	MY40003662	12-Nov-2005	NIM

### Ambient conditions

Temperature: 23 ± 2 °C  
Relative humidity: 50 ± 15 %  
Air pressure: 1013 ± 15 hPa

### Test specifications

- The Sound Calibrator has been calibrated in accordance with the requirements as specified in IEC 60942 1997 Annex B and the lab calibration procedure SMTP004-CA-156.
- The calibrator was tested with its axis vertical facing downwards at the specific frequency using equivalent insert voltage technique.
- The results are rounded to the nearest 0.01 dB and 0.1 Hz and have not been corrected for variations from a reference pressure of 1013.25 hectoPascals as the maker's information indicates that the instrument is insensitive to pressure changes.

### Test results

This is to certify that the sound calibrator conforms to the requirements of annex B of IEC 60942: 1997 for the Class 1 for the conditions under which the test was performed, with sound pressure level 94 dB and frequency 1000 Hz. This does not imply that the sound calibrator meets IEC 60942 under any other conditions.


Details of the performed measurements are presented on page 2 of this certificate.

Approved Signatory:

*(Signature)*  
Huang Jian Min/Qian Xing

Date: 19-Jan-2005

Company Chop:

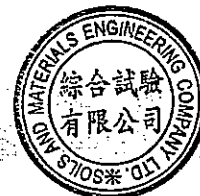

The standard(s) and equipment used in the calibration are traceable to national or international recognised standards and are calibrated on a schedule to maintain the required accuracy level.



## CERTIFICATE OF CALIBRATION

Certificate No.: 05CA0304 02-01 Page 1 of 2

### Item tested

Description:	Integrating Sound Level Meter;	Microphone;	Preamp
Manufacturer:	RION Co., Ltd.	RION Co., Ltd.;	RION Co., Ltd.
Type/Model No.:	NL-18;	UC-53A;	NH-19
Serial/Equipment No.:	00570446	76066;	75883
Adaptors used:	-		

### Item submitted by

Client: Maunsell Environmental Management Consultants Ltd.  
Request No.: 05CA0304 02-01  
Date of request: 01-Mar-2005

Date of test: 04-Mar-2005

### Reference equipment used in the calibration

Description:	Model:	Serial No.	Expiry Date:	Traceable to:
Multi function sound calibrator	B&K 4226	2288444	11/Jan/2006	NIM
Measuring amplifier	B&K 2610	2346941	09/Nov/2005	NIM
Signal generator	DS 360	33873	09/Nov/2005	NIM
Audio analyzer	Agilent 8903B	GB41300350	08/Nov/2005	NIM
Digital multi-meter	Agilent 34401A	US36087050	21/Nov/2005	SCM

### Ambient conditions

Temperature: (21 ± 1) °C  
Relative humidity: (50 ± 10) %  
Air pressure: (1013 ± 15) hPa


### Test specifications

- The Sound Level Meter has been calibrated in accordance with the requirements as specified in BS 7580: Part 1: 1997 and the lab calibration procedure SMTP004-CA-152.
- The electrical tests were performed using an electrical signal substituted for the microphone which was removed and replaced by an equivalent capacitance within a tolerance of ±20%.
- The acoustic calibration was performed using an B&K 4226 sound calibrator and corrections was applied for the difference between the free-field and pressure responsiveness of the Sound Level Meter.

### Test results


This is to certify that the Sound Level Meter conforms to BS 7580: Part 1: 1997 for the Type 1 for the conditions under which the test was performed.

Details of the performed measurements are presented on page 2 of this certificate.

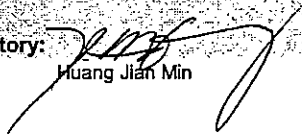Approved Signatory:   
Huang Jian Min

Date: 04-Mar-2005

Company Chop:

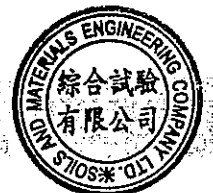


Comments: The results reported in this certificate refer to the condition of the instrument on the date of calibration and carry no implication regarding the long-term stability of the instrument.



---

**APPENDIX F  
AIR QUALITY MONITORING RESULTS AND  
GRAPHICAL PRESENTATION**

---

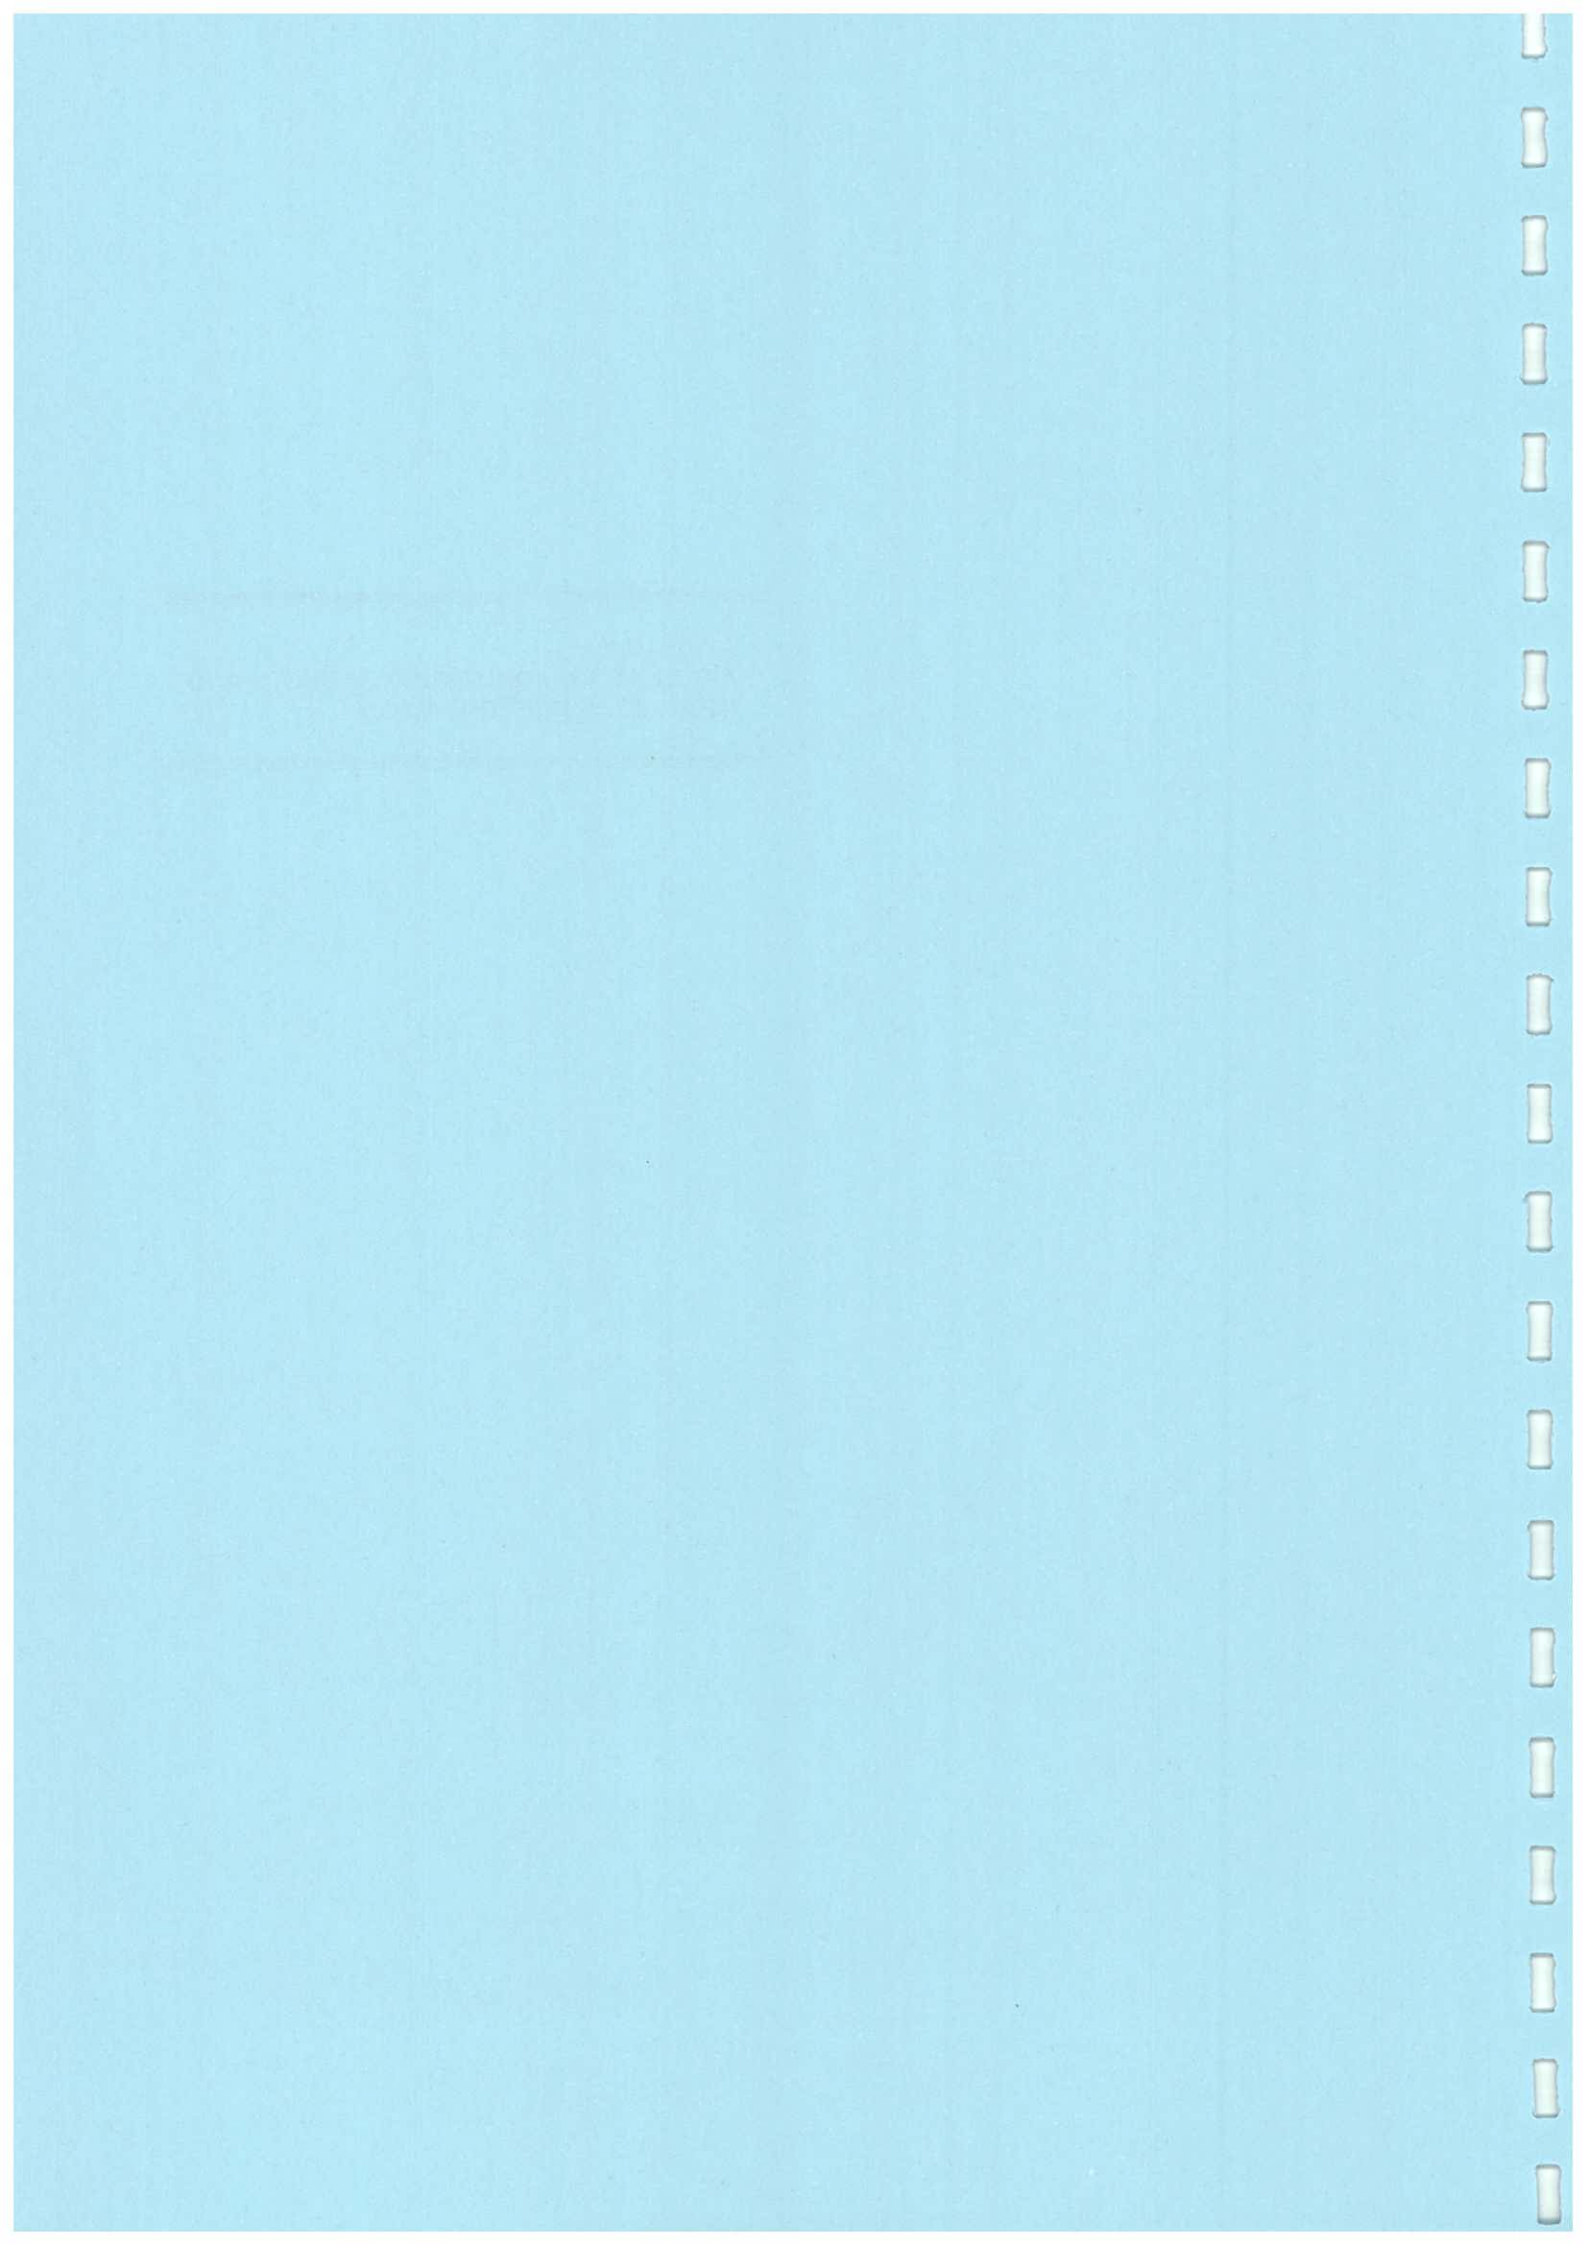

## APPENDIX F: Air Quality Monitoring Results

### 1-hour TSP Monitoring Results at Station ASR8

Date	Starting Time	Concentration, $\mu\text{g}/\text{m}^3$			
		1st	2nd	3rd	Average
3-Mar-05	10:20	124.6	130.8	135.6	130.3
9-Mar-05	10:20	34.3	30.8	31.3	32.1
15-Mar-05	7:00	153.7	160.4	152.9	155.7
21-Mar-05	9:45	121.9	113.4	112.3	115.9
24-Mar-05	7:00	34.3	33.2	34.9	34.1
Min.					30.8
Max.					160.4
Average					93.6

### 1-hour TSP Monitoring Results at Station ASR17

Date	Starting Time	Concentration, $\mu\text{g}/\text{m}^3$			
		1st	2nd	3rd	Average
3-Mar-05	7:00	112.9	119.5	124.4	118.9
9-Mar-05	10:10	20.5	22.1	22.5	21.7
15-Mar-05	7:00	142.0	139.3	141.2	140.8
21-Mar-05	10:05	32.8	34.0	35.5	34.1
24-Mar-05	7:00	26.9	25.7	28.0	26.9
Min.					20.5
Max.					142.0
Average					68.5

Remark:      **Bold value indicated an Action level exceedance**  
                  **Bold & Italic value indicated an Limit level exceedance**

# APPENDIX F: Air Quality Monitoring Results

## 24-hour TSP Monitoring Results at Station ASR8

Date	Filter Weight (g)		Flow Rate (m <sup>3</sup> /min.)		Elapse Time		Sampling Time(hrs.)	Conc. (µg/m <sup>3</sup> )	Weather Condition	Particulate weight(g)	Av. flow (m <sup>3</sup> /min)	Total vol. (m <sup>3</sup> )
	Initial	Final	Initial	Final	Initial	Final						
2-Mar-05	3.5272	3.5804	1.28	1.28	639.9	663.9	24.0	28.9	Rainy	0.05	1.28	1838.9
8-Mar-05	3.4917	3.6341	1.31	1.31	663.9	687.9	24.0	75.5	Sunny	0.14	1.31	1885.0
14-Mar-05	3.4021	3.5359	1.31	1.31	735.8	759.8	24.0	71.0	Fine	0.13	1.31	1885.0
19-Mar-05	3.5703	3.7873	1.31	1.31	759.8	783.8	24.0	115.1	Cloudy	0.22	1.31	1885.0
24-Mar-05	3.5686	3.7544	1.31	1.31	783.8	807.8	24.0	98.6	Fine	0.19	1.31	1885.0
31-Mar-05	3.5381	3.5682	1.28	1.28	854.4	878.4	24.0	16.4	Fine	0.03	1.28	1838.9

Min	16.4
Max	115.1
Average	67.6




## 24-hour TSP Monitoring Results at Station ASR17

Date	Filter Weight (g)		Flow Rate (m <sup>3</sup> /min.)		Elapse Time		Sampling Time(hrs.)	Conc. (µg/m <sup>3</sup> )	Weather Condition	Particulate weight(g)	Av. flow (m <sup>3</sup> /min)	Total vol. (m <sup>3</sup> )
	Initial	Final	Initial	Final	Initial	Final						
2-Mar-05	3.5266	3.5788	1.27	1.27	14795.3	14819.2	24.0	28.5	Rainy	0.05	1.27	1828.6
8-Mar-05	3.5103	3.6055	1.33	1.33	14861.5	14885.5	24.0	49.7	Sunny	0.10	1.33	1913.8
14-Mar-05	3.3987	3.5147	1.21	1.21	14855.5	14879.5	24.0	66.4	Fine	0.12	1.21	1748.2
19-Mar-05	3.5353	3.7113	1.16	1.16	14879.5	14903.5	24.0	105.6	Cloudy	0.18	1.16	1666.1
24-Mar-05	3.5836	3.7392	1.16	1.16	14903.5	14927.5	24.0	93.4	Fine	0.16	1.16	1666.1
31-Mar-05	3.5568	3.5822	1.21	1.21	14927.5	14951.5	24.0	14.5	Fine	0.03	1.21	1748.2

Min	14.5
Max	105.6
Average	59.7

Remark: **Bold value** indicated an Action level exceedance  
**Bold & Italic value** indicated an Limit level exceedance





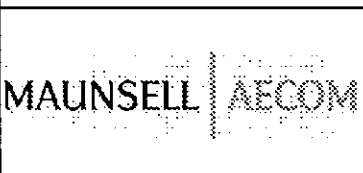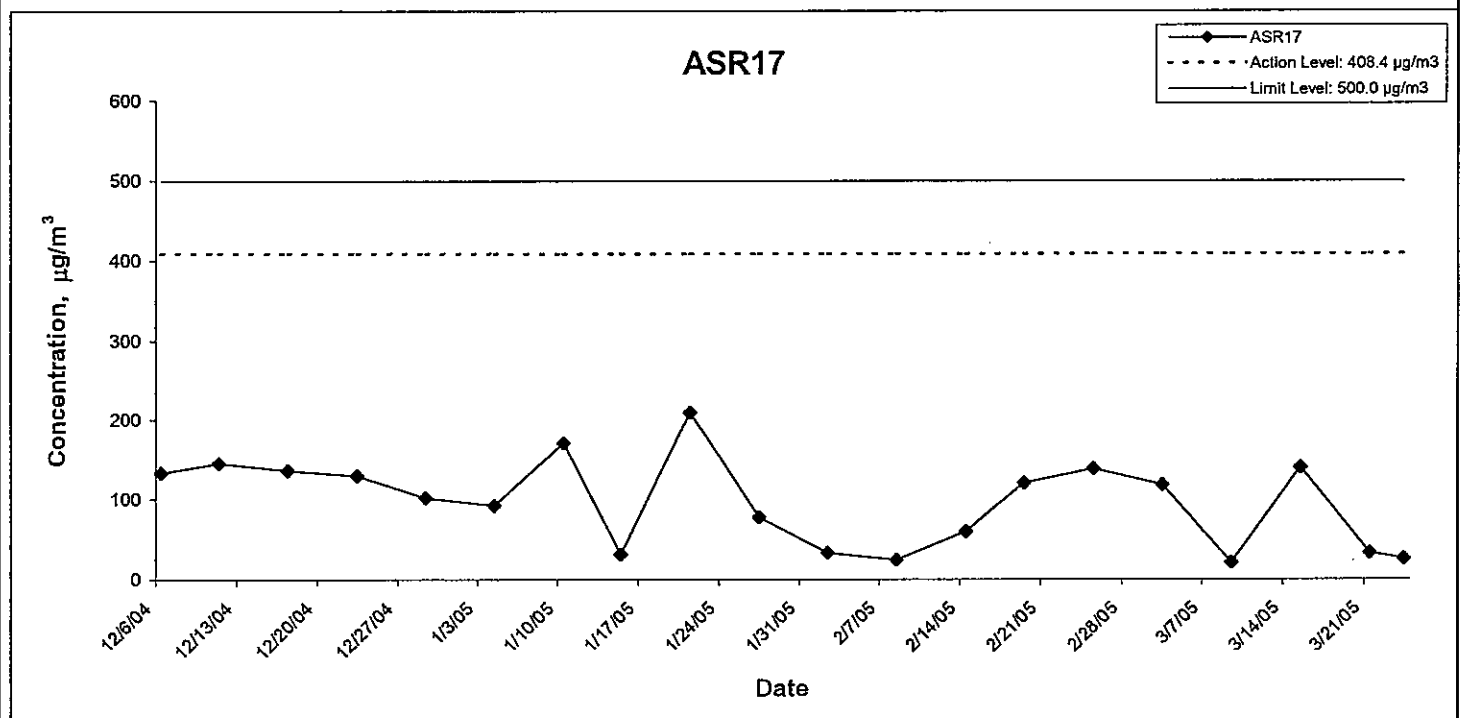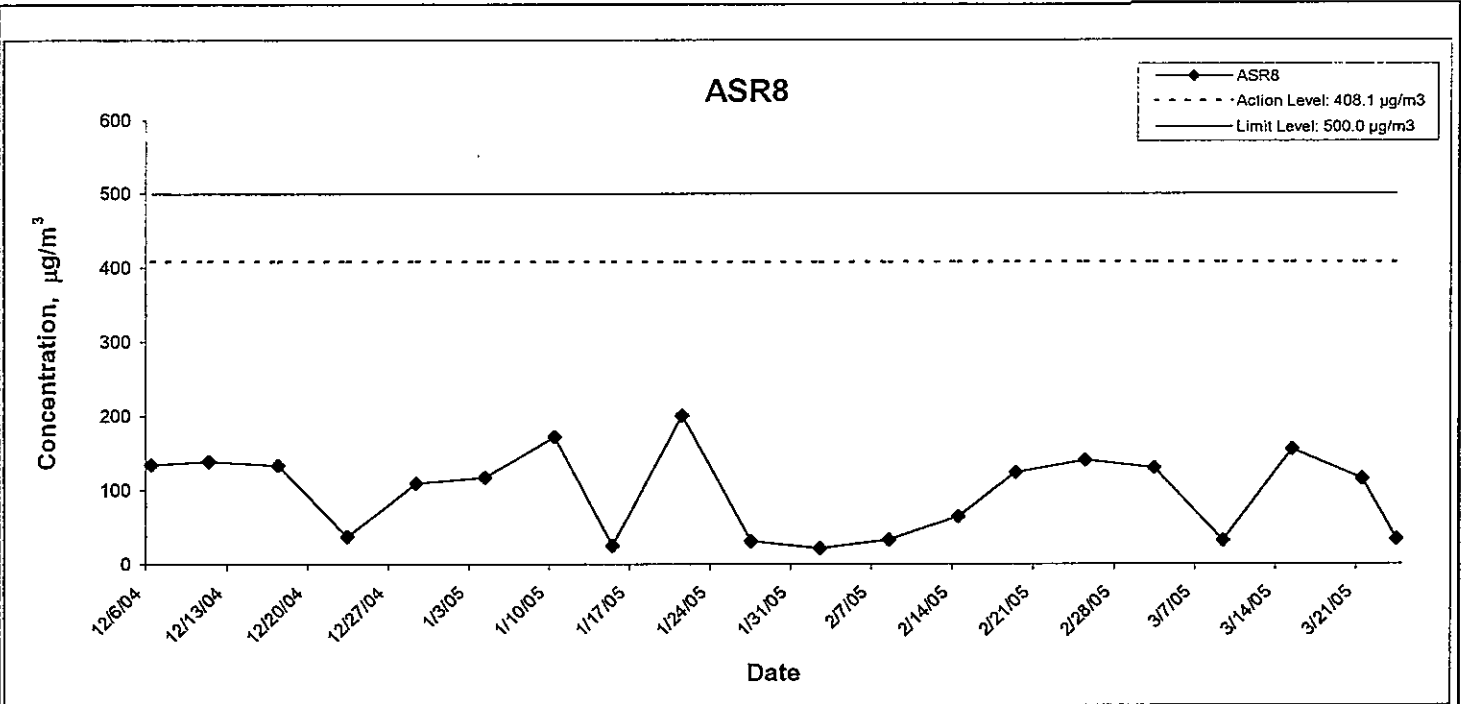

Contract No. SS M333 Reprovisioning of Diamond Hill  
Crematorium

**Graphical Presentation of 1-hour TSP  
Monitoring Results for Location ASR8 and  
ASR17**

SCALE	N.T.S.	DATE	2005
CHECK	FSYY	DRAWN	AMAN
JOB NO.	S07904	DRAWING No.	Appendix F
		Rev	-

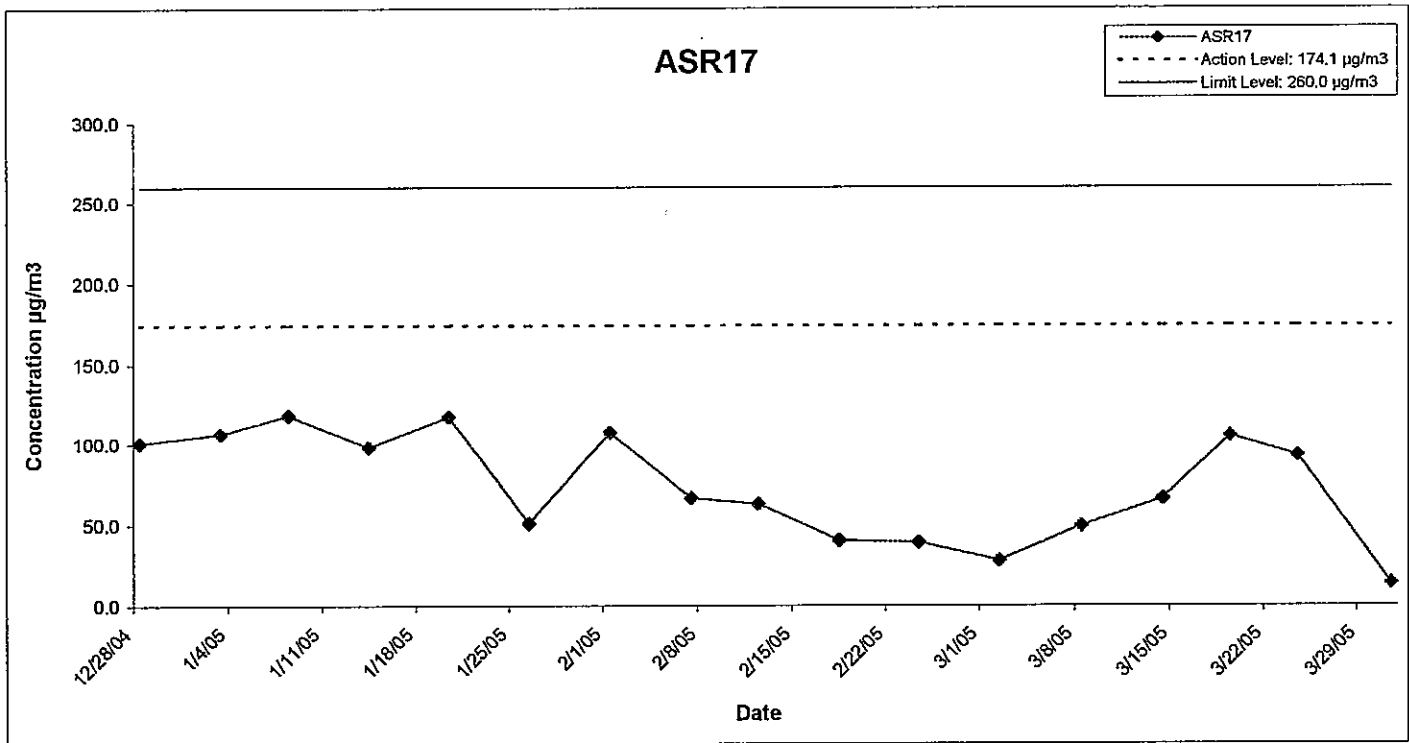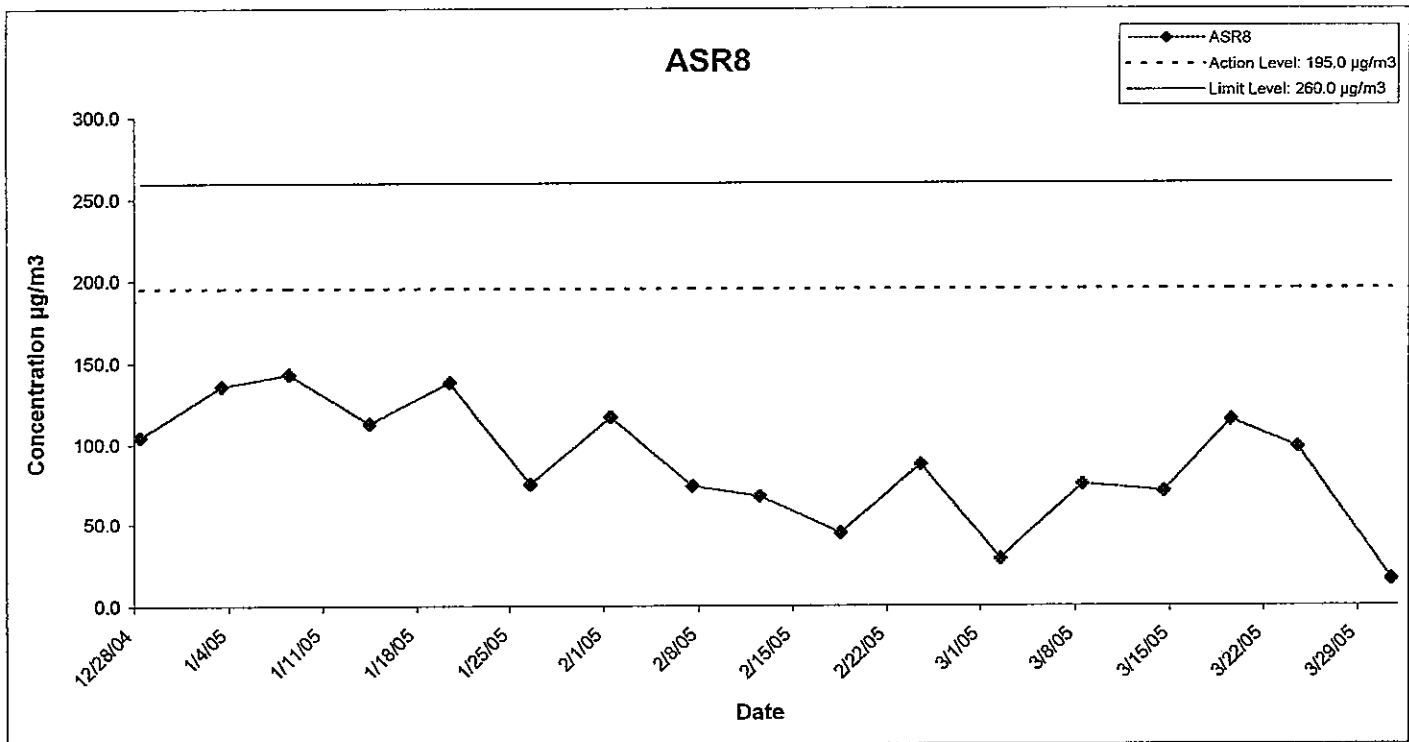


	Contract No. SS M333 Reprovisioning of Diamond Hill Crematorium	SCALE	N.T.S.	DATE	2005
	<b>Graphical Presentation of 24-hour TSP Monitoring Results for Location ASR8 and ASR17</b>	CHECK	FSYY	DRAWN	AMAN
		JOB NO.	S07904	DRAWING No.	Appendix F
					-

---

**APPENDIX G  
NOISE MONITORING RESULTS AND  
GRAPHICAL PRESENTATION**

---

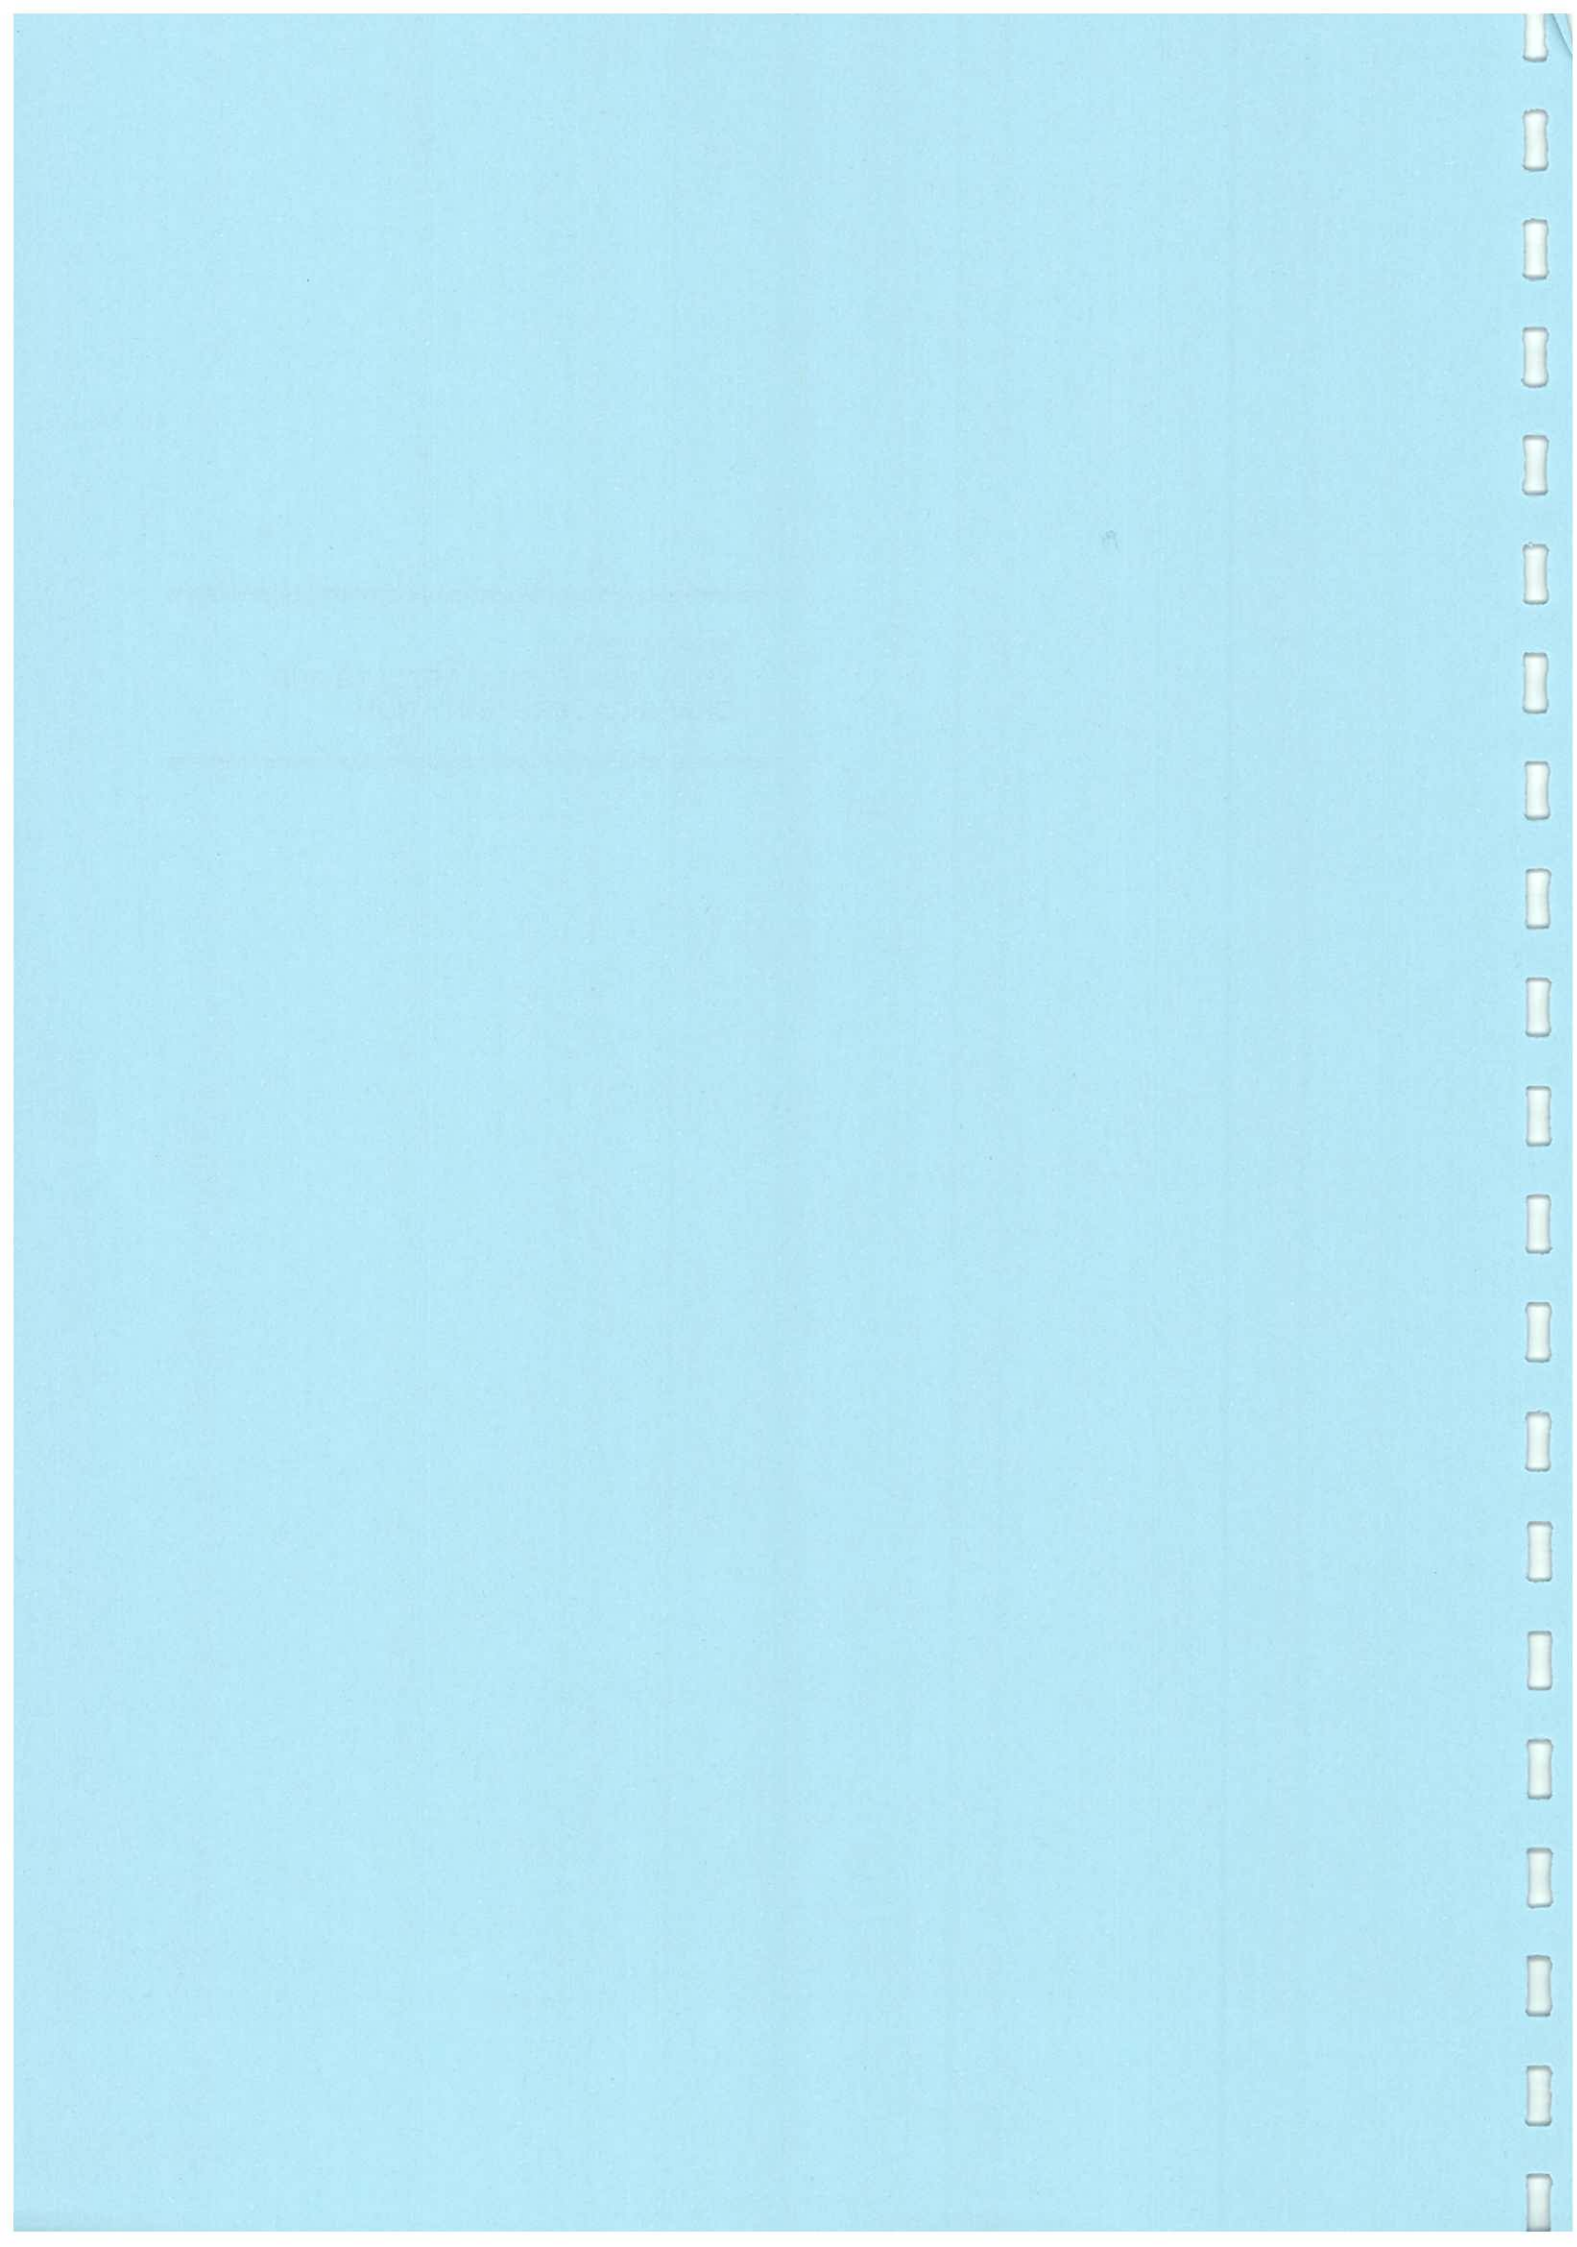

Appendix G Noise Monitoring Results

Daytime Noise Monitoring Results at Station SR3

Date	Weather Condition	Noise Level for 30-min, dB(A)*				Baseline Noise Level, dB(A)	Calculated Construction Noise Level, dB(A)	Limit Level, dB(A)	Exceedance (Y/N)
		Time	L90	L10	Leq				
3-Mar-05	Cloudy	10:33	66.5	70.6	68.5	65.1	65.8	70	N
9-Mar-05	Sunny	13:54	64.5	70.0	68.7	65.1	66.2	70	N
15-Mar-05	Fine	9:30	61.0	66.5	64.5	65.1	*Note	70	N
21-Mar-05	Cloudy	14:45	62.0	68.7	66.9	65.1	62.2	70	N
		Min	61.0	66.5	64.5				
		Max	66.5	70.6	68.7				
		Average	63.5	69.0	67.2				

Daytime Noise Monitoring Results at Station SR4

Date	Weather Condition	Noise Level for 30-min, dB(A)*				Baseline Noise Level, dB(A)	Calculated Construction Noise Level, dB(A)	Limit Level, dB(A)	Exceedance (Y/N)
		Time	L90	L10	Leq				
3-Mar-05	Cloudy	10:20	65.0	69.5	67.7	65.6	63.5	70	N
9-Mar-05	Sunny	13:50	63.5	69.4	67.0	65.6	61.4	70	N
15-Mar-05	9:20	9:20	60.5	66.2	63.7	65.6	*Note	70	N
21-Mar-05	Cloudy	14:38	61.4	68.8	66.0	65.6	55.4	70	N
		Min	60.5	66.2	63.7				
		Max	65.0	69.5	67.7				
		Average	62.6	68.5	66.1				




Daytime Noise Monitoring Results at Station SR6

Date	Weather Condition	Noise Level for 30-min, dB(A)*				Baseline Noise Level, dB(A)	Calculated Construction Noise Level, dB(A)	Limit Level, dB(A)	Exceedance (Y/N)
		Time	L90	L10	Leq				
3-Mar-05	Cloudy	11:15	58.7	63.9	62.0	68.5	*Note	75	N
9-Mar-05	Sunny	13:00	57.7	63.5	62.2	68.5	*Note	75	N
15-Mar-05	Fine	7:00	54.5	59.0	57.5	68.5	*Note	75	N
21-Mar-05	Cloudy	15:37	53.1	63.7	59.7	68.5	*Note	75	N
		Min	53.1	59.0	57.5				
		Max	58.7	63.9	62.2				
		Average	56.0	62.5	60.4				

\* - Façade measurement

Bold & Italic value indicated an Limit level exceedance

Note: Measured noise level is less than the baseline noise level.

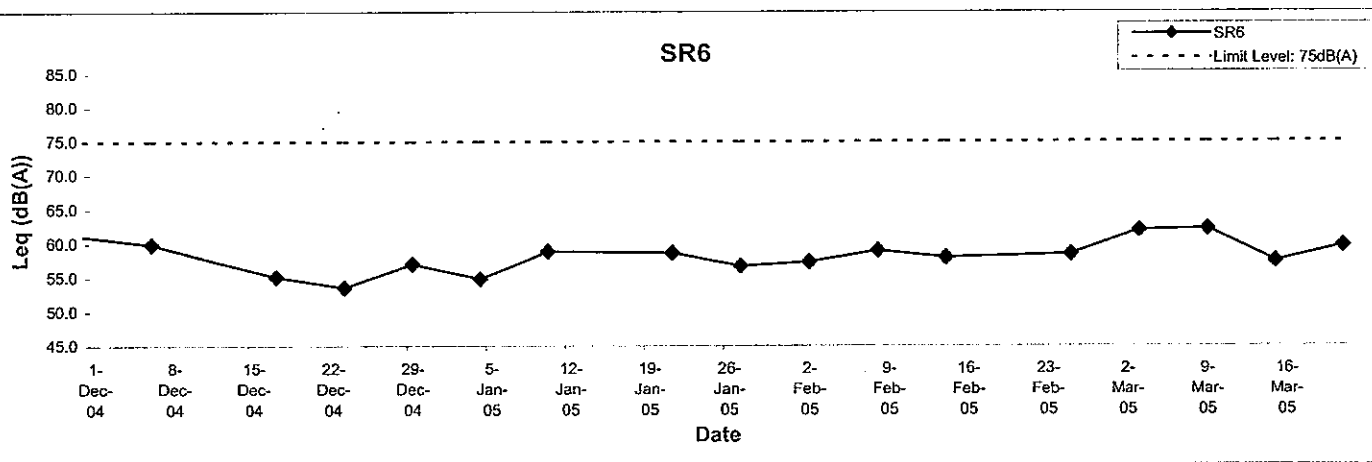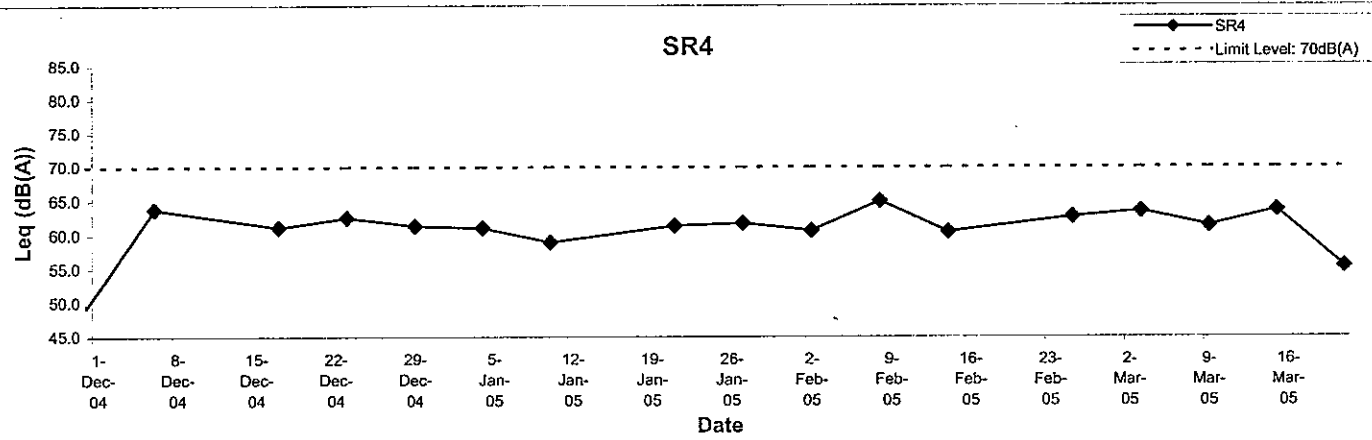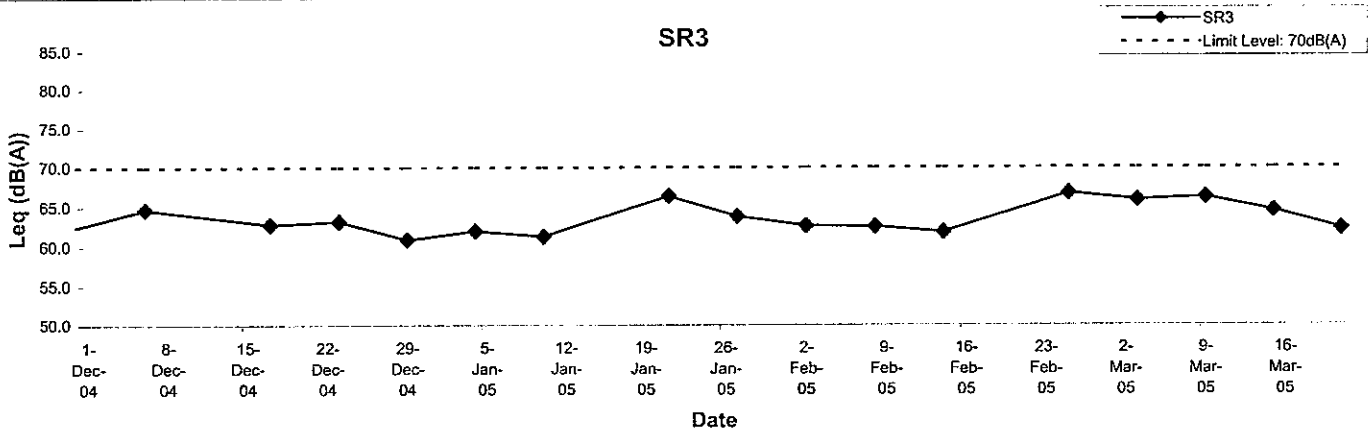

**MAUNSELL** AECOM

Contract No. SS M333 Reprovisioning of Diamond Hill  
Crematorium  
**Graphical Presentation of Noise  
Monitoring Results for Location SR3, SR4  
and SR6**


SCALE	N.T.S.	DATE	2005
CHECK	FSYY	DRAWN	AMAN
JOB NO.	S07904	DRAWING No.	Appendix G

---

**APPENDIX H  
SUMMARY OF WEEKLY ENVIRONMENTAL  
SITE INSPECTION OBSERVATIONS**

---



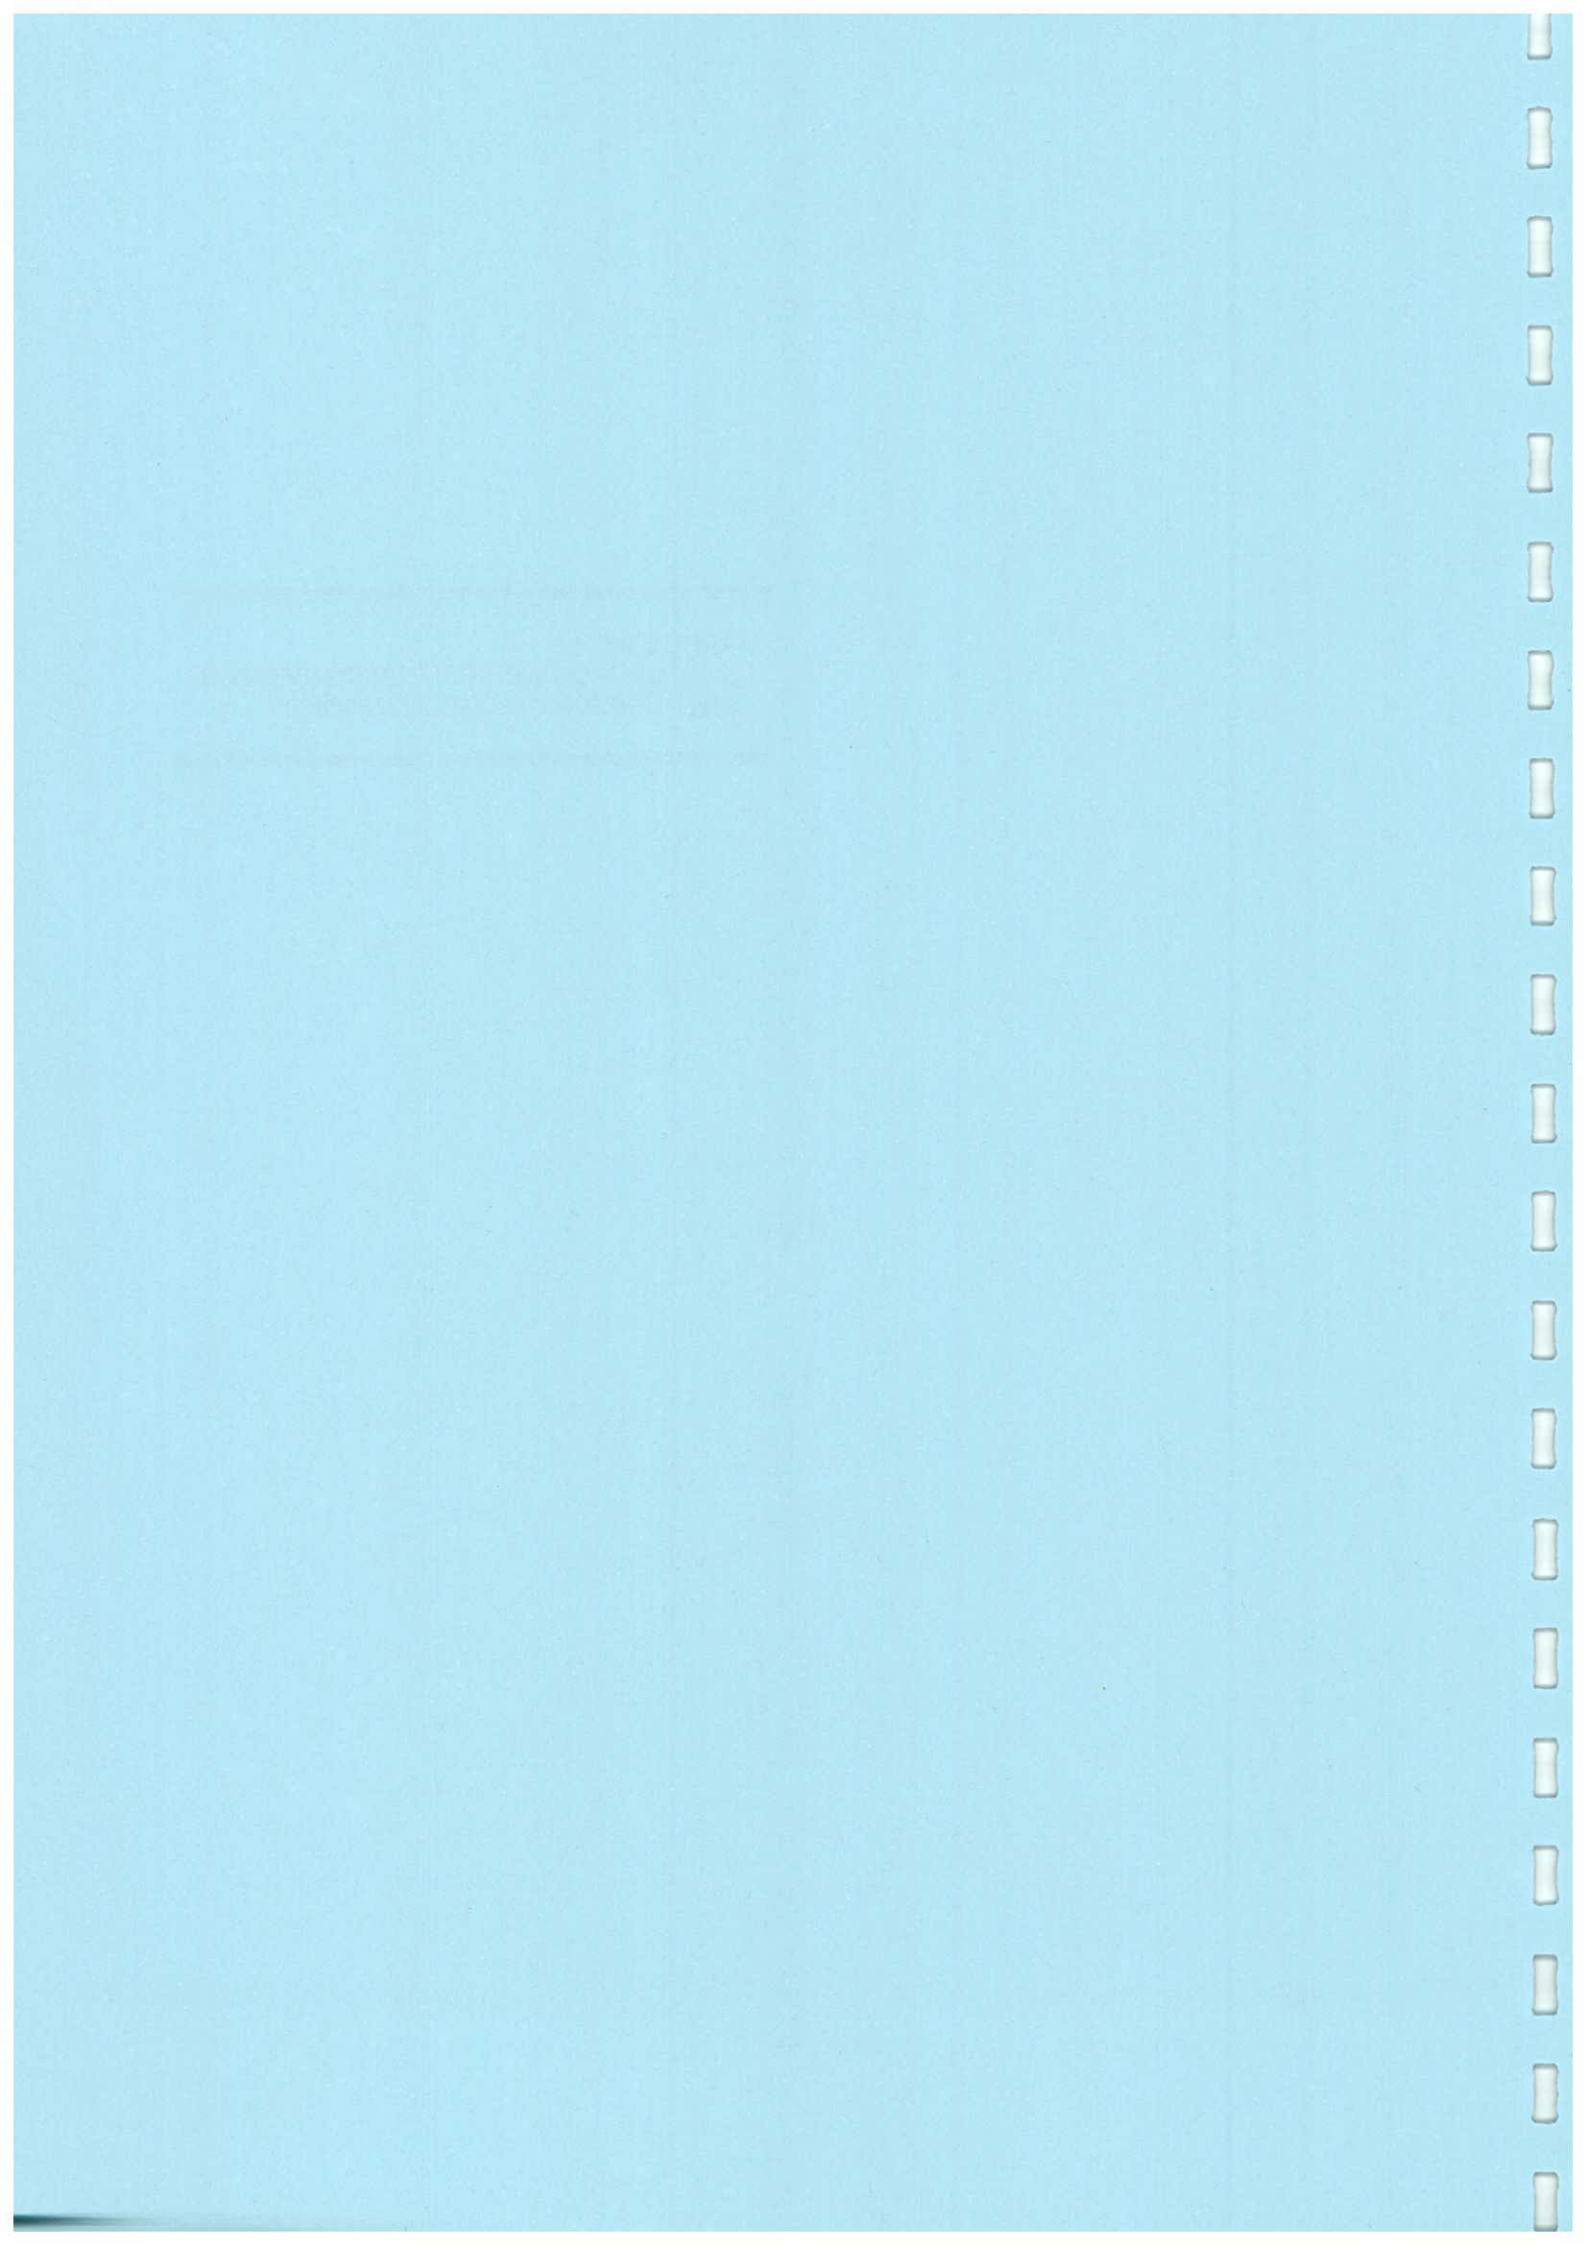



## Appendix H Summary of Weekly Environmental Site Inspection Observations

### Inspection Information

Date	2 March 2005
Time	9:30 – 10:00 a.m.

### Remarks/Observations

#### *Water Quality*

1. The Contractor indicated that application for effluent discharge license was in progress.
2. A small amount of dried vegetation and refuse was noted in the surface channel near the sub-contractors' site office. Sandbags were provided for desilting. The Contractor was reminded to maintain the channel regularly.

#### *Air Quality*

3. No violation was observed in this site inspection.

#### *Noise*

4. No violation was observed in this site inspection.

#### *Waste/Chemical Management*

5. The concrete debris at roadside was removed.
6. A lubricant oil container was placed on ground without drip tray. The Contractor was reminded to store the chemical properly to avoid oil leakage or spillage.

#### *Landscape and Visual*

7. No violation was observed in this site inspection.

#### *Others*

8. No violation was observed in this site inspection.

**Inspection Information**

Date	11 March 2005
Time	14:00 – 14:45

**Remarks/Observations**

*Water Quality*

1. The effluent discharge license was available for inspection.
2. The surface channel near the sub-contractors' site office was cleaned up regularly. No accumulation of refuse was noted.
3. Tarpaulin covering was provided for the stockpile of soil at the temporary stockpiling area. The Contractor was reminded to enlarge the covered surface of the stockpile to prevent surface runoff.

*Air Quality*

4. No violation was observed in this site inspection.

*Noise*

5. No violation was observed in this site inspection.

*Waste/Chemical Management*

6. Oil container was stored properly to avoid oil leakage or spillage.

*Landscape and Visual*

7. No violation was observed in this site inspection.

*Others*

8. No violation was observed in this site inspection.

**Inspection Information**

Date	16 March 2005
Time	14:30 – 15:15

**Remarks/Observations**

<p><i>Water Quality</i></p> <ol style="list-style-type: none"><li>1. The Contractor was reminded to enlarge the covered surface of the stockpile to prevent surface runoff.</li><li>2. Relocation of the wheel-washing bay was in progress. Temporary vehicle washing facilities were provided. Vehicle wash water would be collected and treated by the wastewater treatment system prior to discharge.</li></ol> <p><i>Air Quality</i></p> <ol style="list-style-type: none"><li>3. The Contractor was reminded to provide watering for the dust generating work such as road compaction to prevent fugitive dust generation.</li></ol> <p><i>Noise</i></p> <ol style="list-style-type: none"><li>4. No violation was observed in this site inspection.</li></ol> <p><i>Waste/Chemical Management</i></p> <ol style="list-style-type: none"><li>5. No violation was observed in this site inspection.</li></ol> <p><i>Landscape and Visual</i></p> <ol style="list-style-type: none"><li>6. No violation was observed in this site inspection.</li></ol> <p><i>Others</i></p> <ol style="list-style-type: none"><li>7. No violation was observed in this site inspection.</li></ol>
---

**Inspection Information**

Date	23 March 2005
Time	9:30 – 10:15

**Remarks/Observations**

<p><i>Water Quality</i></p> <ol style="list-style-type: none"><li>1. Stockpile was generally covered. No surface runoff was observed.</li><li>2. Temporary vehicle washing facilities were still used as the new wheel-washing bay was not constructed yet.</li></ol> <p><i>Air Quality</i></p> <ol style="list-style-type: none"><li>3. No dust generating work was observed.</li></ol> <p><i>Noise</i></p> <ol style="list-style-type: none"><li>4. No violation was observed in this site inspection.</li></ol> <p><i>Waste/Chemical Management</i></p> <ol style="list-style-type: none"><li>5. Two chemical drums were not provided with drip trays. The Contractor was reminded to store the chemical properly soon.</li></ol> <p><i>Landscape and Visual</i></p> <ol style="list-style-type: none"><li>6. No violation was observed in this site inspection.</li></ol> <p><i>Others</i></p> <ol style="list-style-type: none"><li>7. No violation was observed in this site inspection.</li></ol>
--

**Inspection Information**

Date	30 March 2005
Time	9:30 – 10:15 a.m.

**Remarks/Observations**

*Water Quality*

1. The Contractor was reminded to cover the stockpile entirely to prevent surface runoff during rainy days. Sandbag barriers were provided to prevent silty water from entering the drainage system directly.
2. Temporary vehicle washing facilities were used. Sandbags were used as silt removal facility. The Contractor was recommended to provide more sandbags during rainy days.
3. The Contractor was reminded to clean the drainage channel near the stockpiling area regularly.

*Air Quality*

4. No violation was observed in this site inspection.

*Noise*

5. No violation was observed in this site inspection.

*Waste/Chemical Management*

6. Chemical drums were stored properly.
7. The Contractor was reminded to cover the skip of the general waste during rainy days.

*Landscape and Visual*

8. No violation was observed in this site inspection.


*Others*

9. No violation was observed in this site inspection.

---

**APPENDIX I  
STATUS OF ENVIRONMENTAL  
PERMITS/LICENCES**

---

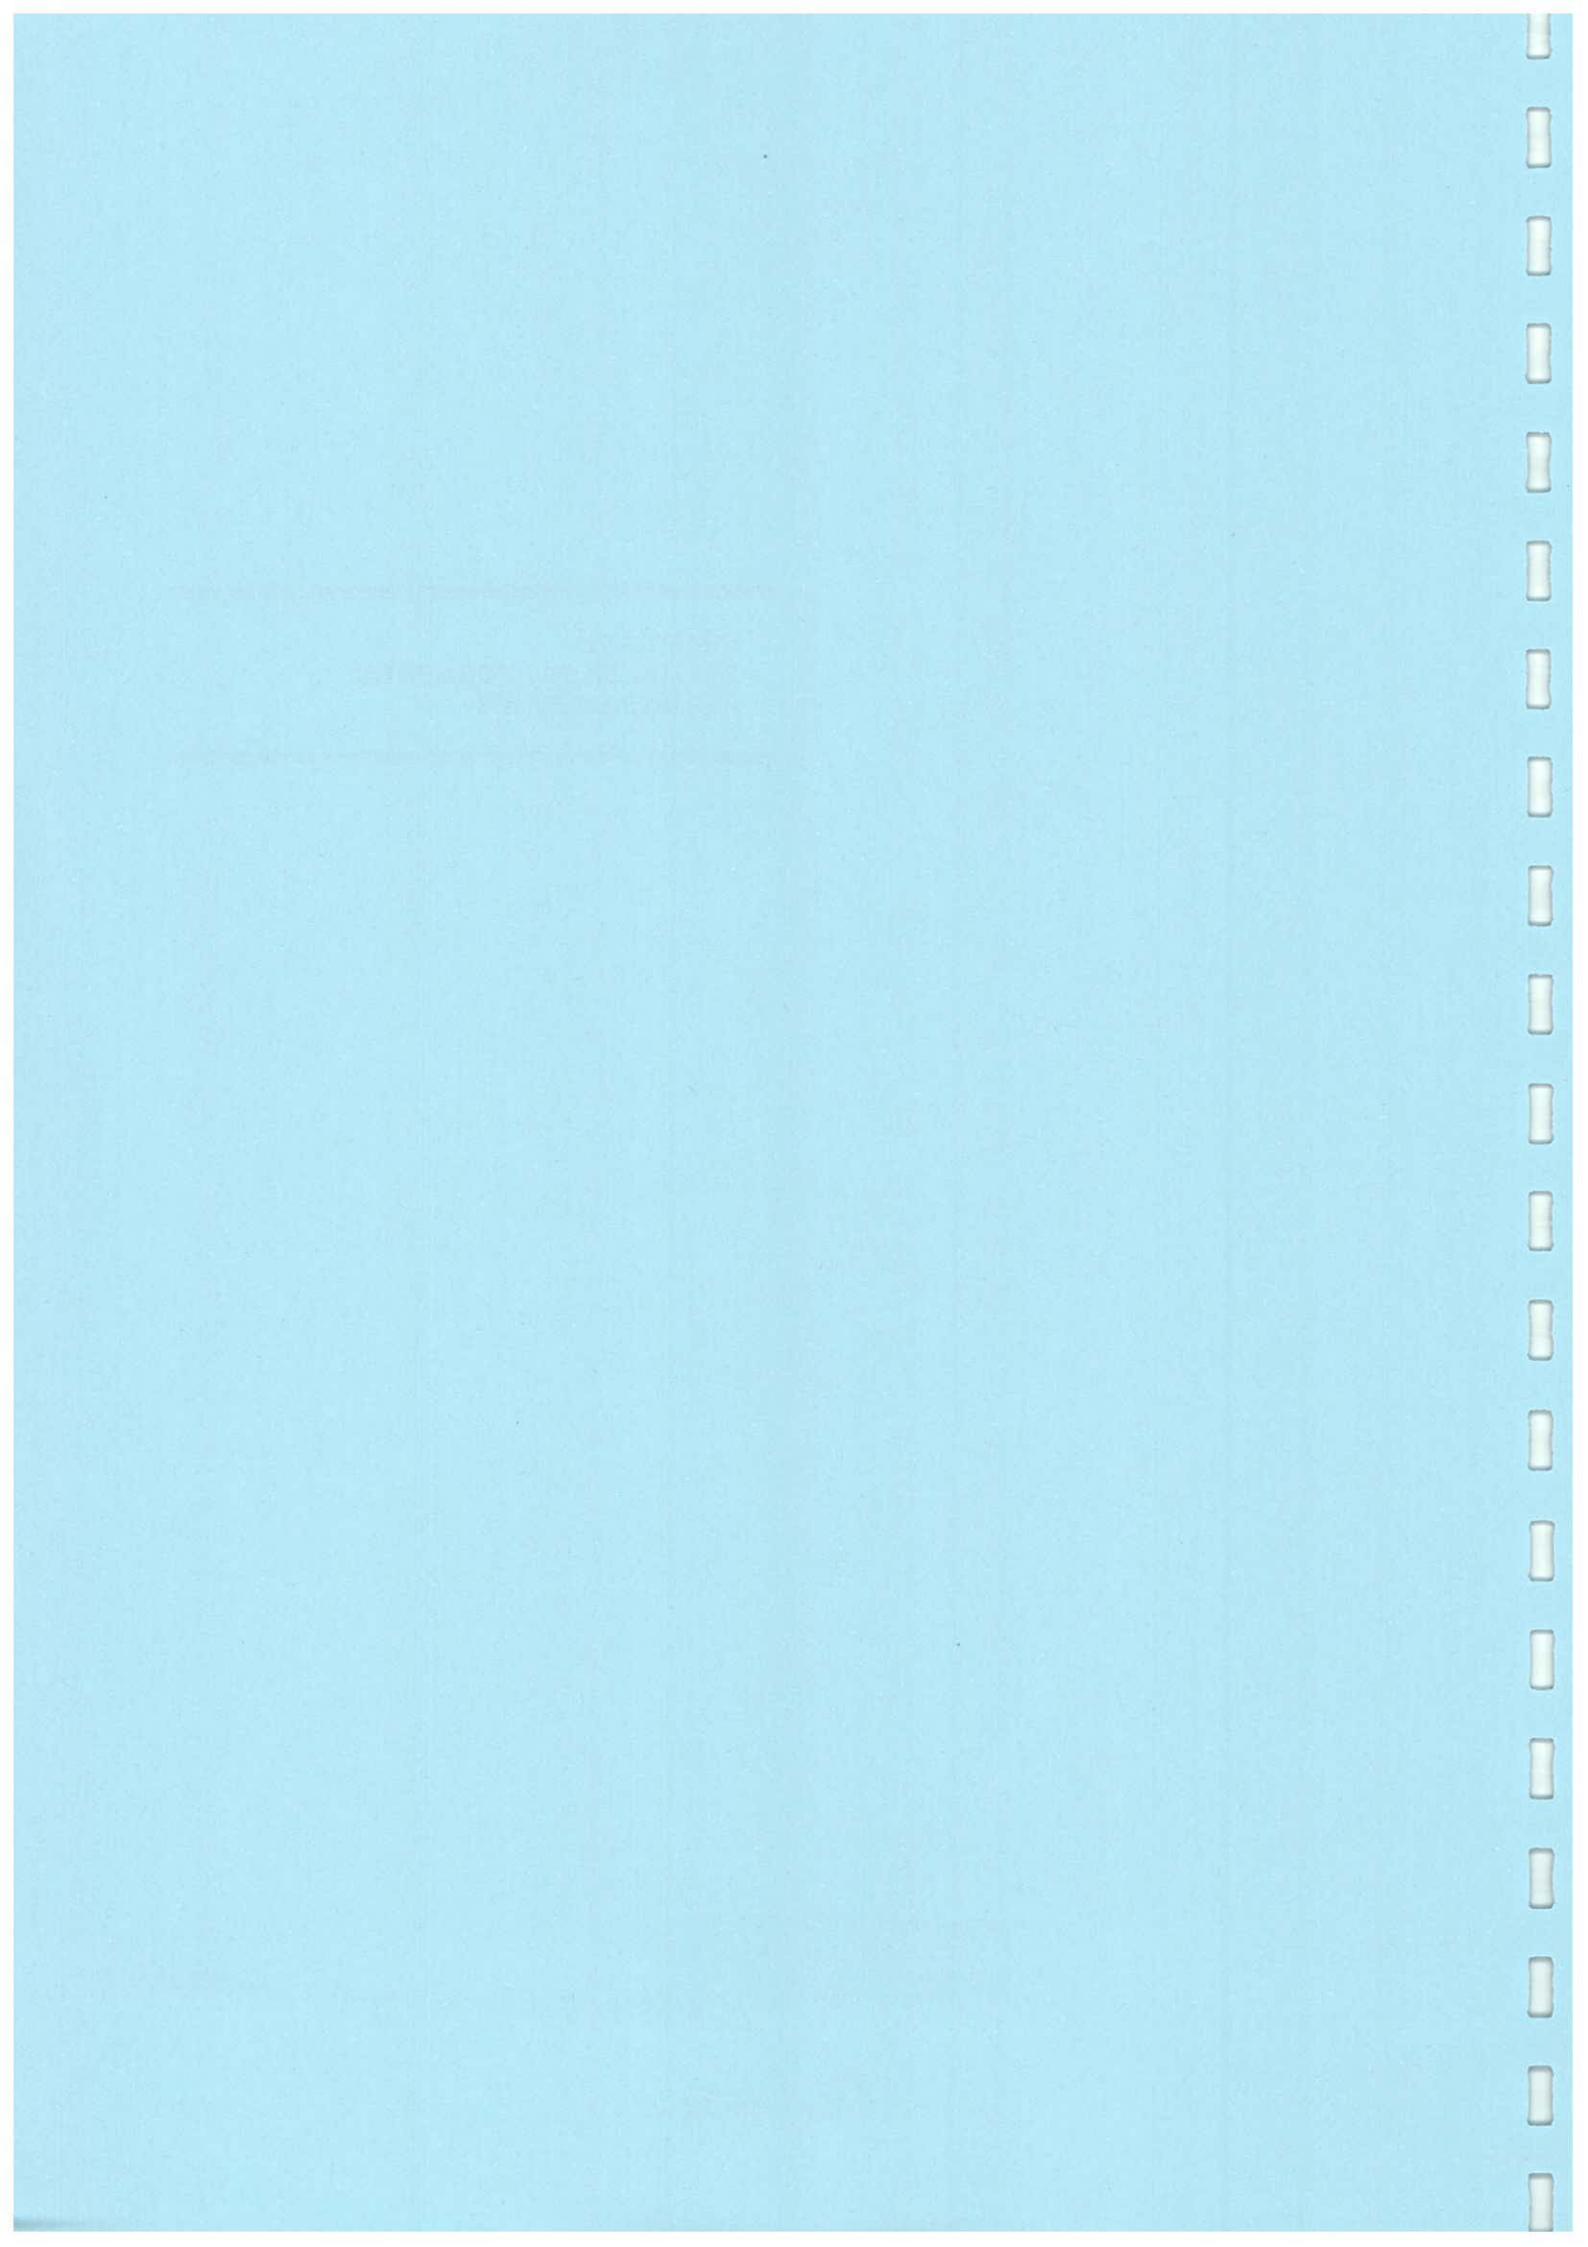

## Appendix I

## Status of Environmental Permits/Licenses

Permit No.	Valid Period		Section	Status
	From	To		
<b>Environmental Permit &amp; Further Environmental Permit</b>				
EP-179/2004/B	14 Feb 2005	N/A	Reprovisioning of Diamond Hill Crematorium	Valid
<b>Registration as a Chemical Waste Producer</b>				
5213-288-C3108-10	6 Dec 2004	N/A	Reprovisioning of Diamond Hill Crematorium	Valid
<b>Water Discharge License</b>				
RE/C0202/288/1	9 Mar 2005	31 Mar 2010	Reprovisioning of Diamond Hill Crematorium	Valid






---

**APPENDIX J  
IMPLEMENTATION SCHEDULE OF  
MITIGATION MEASURES**

---

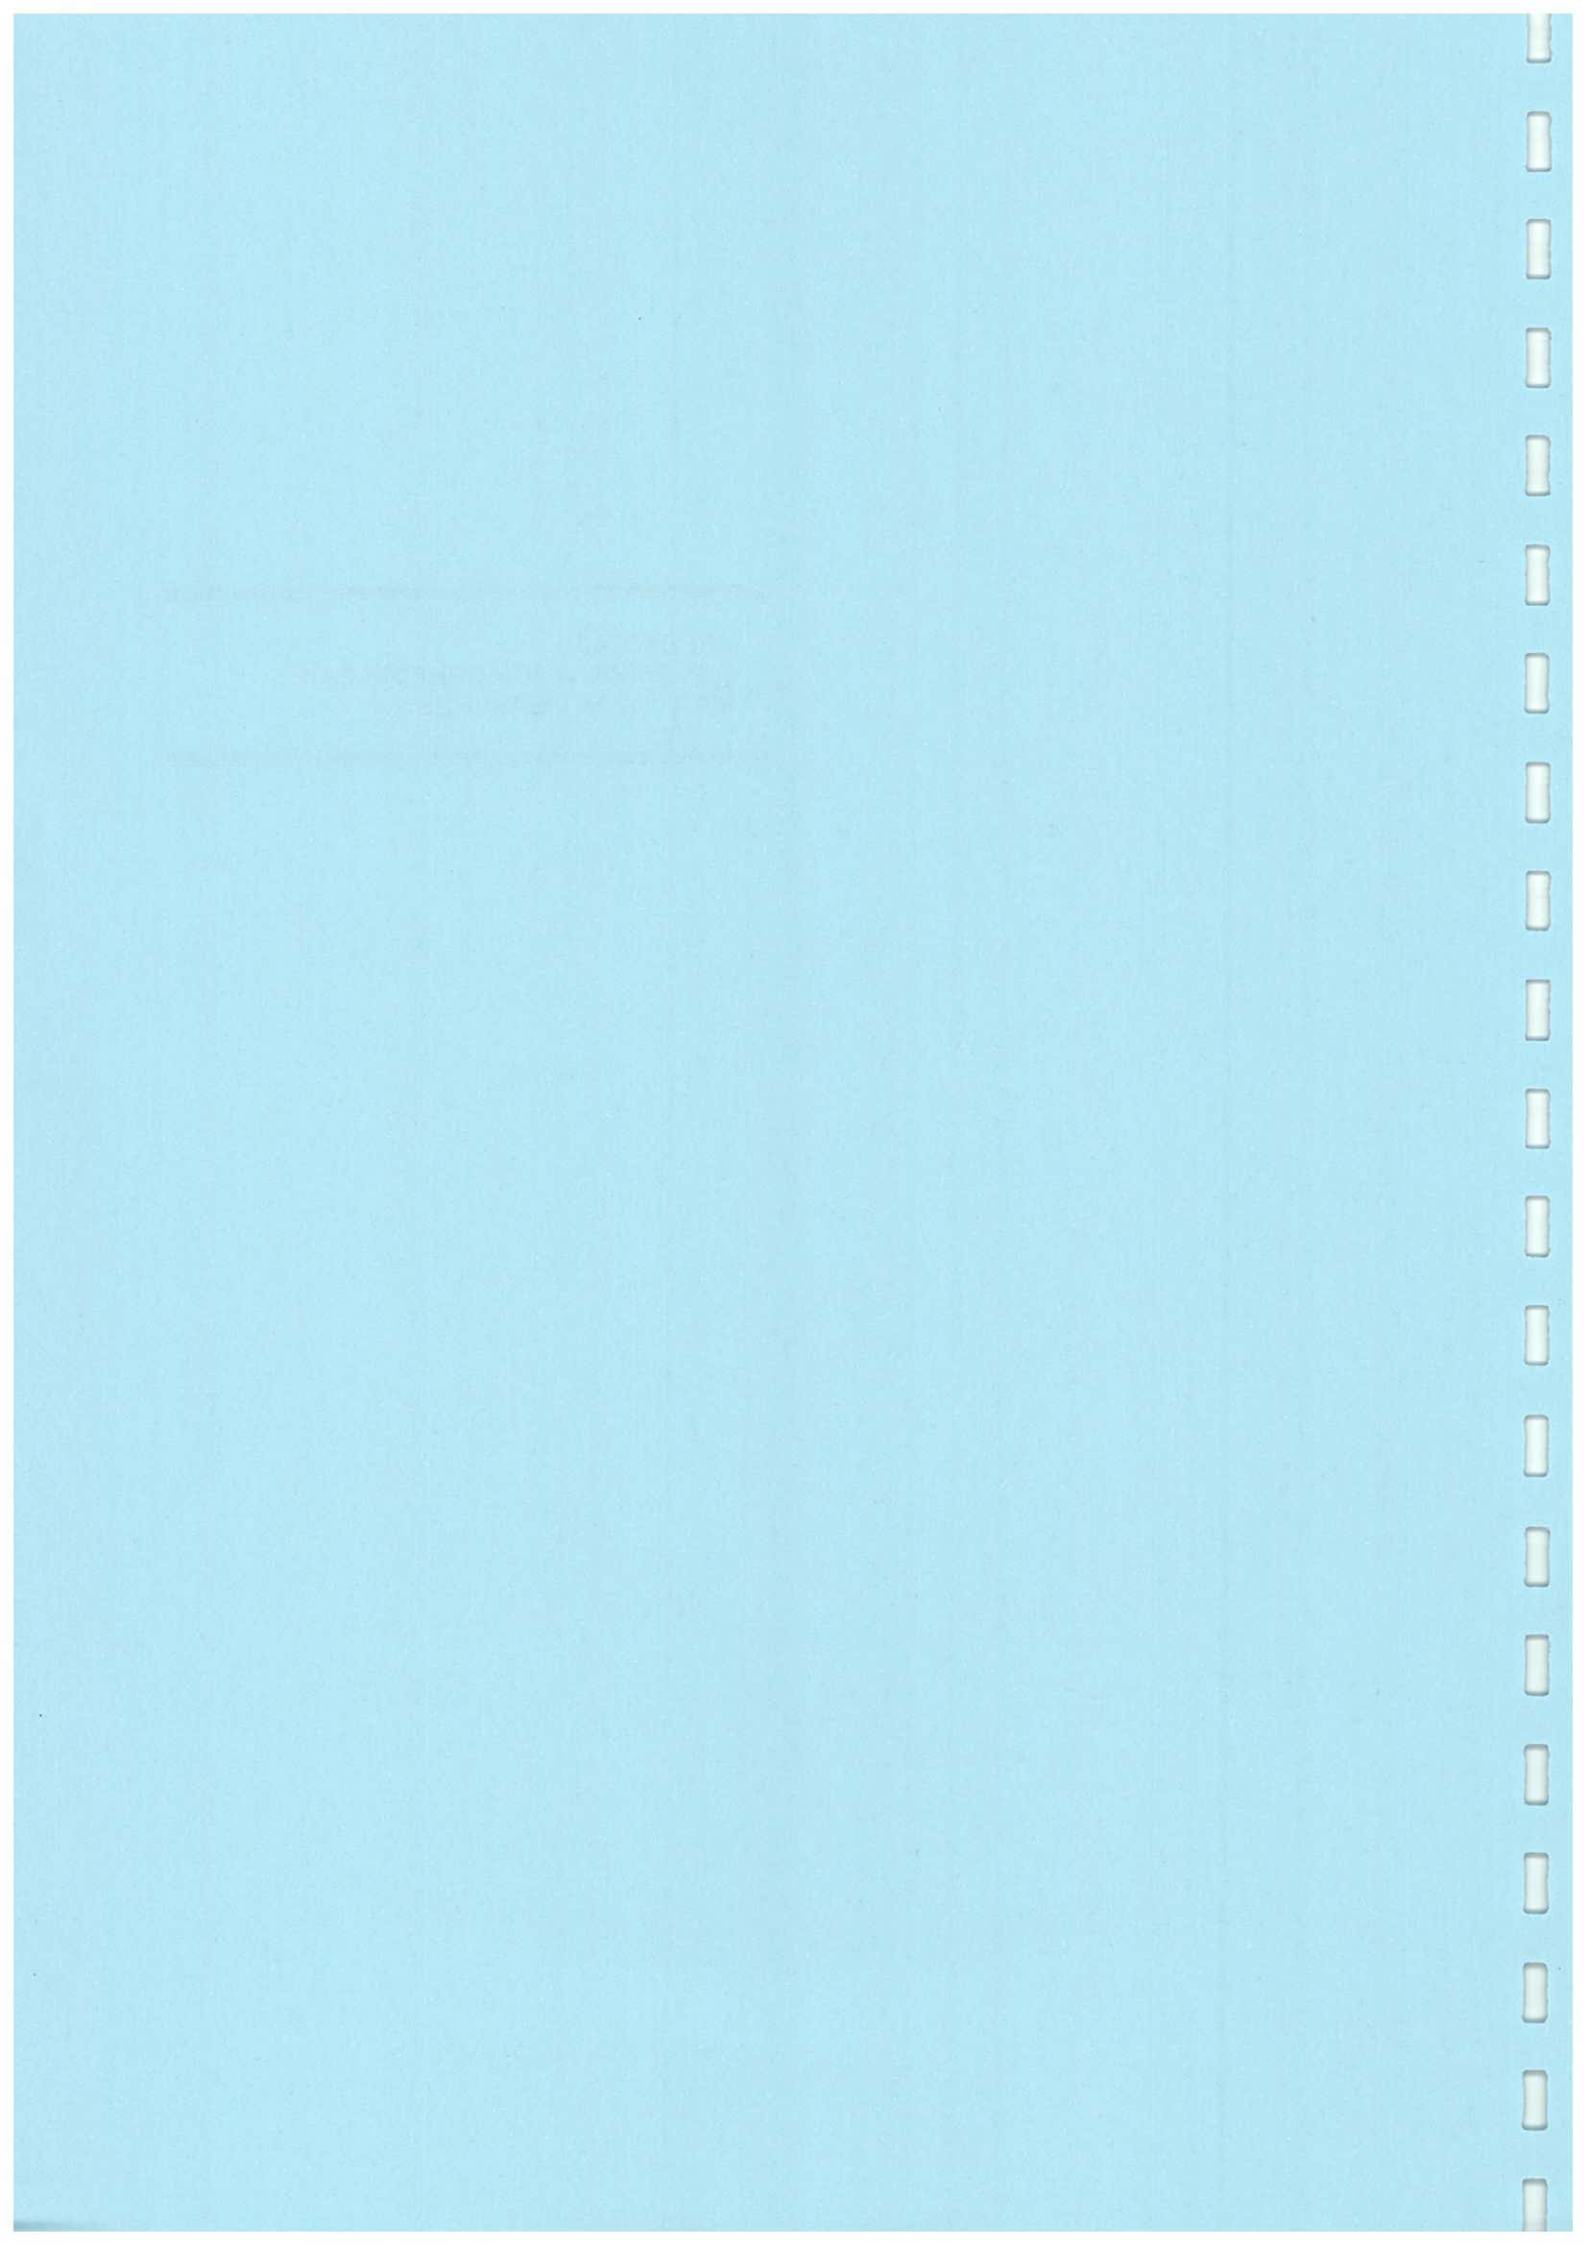

**Appendix J – Environmental Mitigation Implementation Schedule**

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
<b>Air Quality Mitigation Measures</b>					
Special air pollution control systems shall be installed and operate to reduce the emissions of air pollutants to acceptable levels	New cremators in New Crematorium	Arch SD	Design, Construction, Demolition and Operation stage	BPM/APCO	√
FEHD shall apply for a Specified Process License under the APCO	New Cremators in the New Crematorium / prior to operation	FEHD	Construction, Demolition and Operation stage	APCO	N/A
The efflux velocity of chimney shall be at least 15 m/s, the design diameter of the chimneys shall be 0.22 m and 0.30 m, the design chimney height shall be 101mP.D. (28.5m above ground), for 170 kg and 250 kg cremators respectively	Chimney of New Crematorium / design and construction stages	Arch SD	Design and Construction stage	BPM/APCO	N/A
If the interior wall of existing cremators and chimney are confirmed dioxins contaminated, special precautions shall be taken avoid fugitive emissions of dioxin contaminated materials	Cremator room and chimney in Existing Crematorium / demolition	Arch SD/Contractor	Demolition stage		N/A
Sufficient water spraying should be applied during the construction work, the fugitive dust generated from general construction dust would be reduced by 90%	Project site / construction and demolition stages	Arch SD, contractor	Construction and Demolition stage	APCO	x
Carry out a confirmatory test of dioxins in the depositions on chimney wall, flue gas ducting and combustion chambers when the existing Crematorium is shut down	Chimney, flue and cremators in Existing Crematorium / decommissioning	FEHD, Arch SD	Demolition stage		N/A
If the dioxin level of surface deposition is between 1 and 10 ppb I-TEQ, it is classified as moderately contaminated with dioxins. The demolition work site should be covered up to avoid emission of fugitive dust during demolition	Chimney, flue and cremators in Existing Crematorium / decommissioning	Arch SD 3	Demolition stage		

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
If the dioxin level of surface deposition exceeds 10 ppb I-TEQ, it is classified as severely dioxin-contaminated waste. If it is confirmed that the existing facilities are severely contaminated with dioxins, a special decommissioning method – Containment method – would be adopted	Chimney, flue and cremators in Existing Crematorium / decommissioning	Arch SD 3	Demolition stage		N/A
All the demolition waste would be carefully handled, sealed and treated as chemical waste. The waste collector shall be responsible for preventing fugitive dust emission when handling the demolition waste	Chimney, flue and cremators in Existing Crematorium / demolition stage	Arch SD, contractor	Demolition stage		√
Employ a registered asbestos contractor to remove asbestos containing material during the demolition of the existing crematorium building	Cremator room in Existing Crematorium / decommissioning	Arch SD, contractor	Demolition stage	APCO	N/A
Submit a formal AIR and Asbestos Abatement plan signed by a registered asbestos consultant to the Authority for approval under APCO 28 days prior to the start of any asbestos abatement work.	Cremator room in Existing Crematorium / decommissioning	Arch SD, consultant	Demolition stage	APCO	N/A
When removing asbestos containing materials, enclosure of the work area; containment and sealing for the asbestos containing waste; provision of personal decontamination facility; use of personal respiratory/protection equipment; use of vacuum cleaner equipped with high efficiency air particulate (HEPA) filter for cleaning up the work area; and carry out air quality monitoring during the asbestos abatement work	Cremator room in Existing Crematorium / decommissioning	Arch SD, consultant	Demolition stage	APCO	N/A
Appoint qualified personnel to carry out the asbestos containing material removal work, including a registered asbestos contractor to carry out the work; a registered asbestos supervisor to supervise the work; a registered asbestos laboratory to monitor the air quality, and a registered asbestos consultant to supervise and certify the asbestos abatement work.	Cremator room in Existing Crematorium / decommissioning	Arch SD, consultant	Demolition stage	APCO	N/A

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
Erect a site barrier with the height of no less than 2.4m to enclose the construction site Apply frequent water spraying to ensure the surface of the construction site sufficiently wet to reduce fugitive dust due to wind erosion and transportation on unpaved haul road Cover up stockpiles of fill material and dusty material Install a vehicle-cleaning system at the main entrance of the construction site to clean up the vehicles before leaving the site The Air Pollution Control (Construction Dust) Regulation shall be followed for fugitive dust control	Project site / construction and demolition stages	Contractor	Construction and Demolition stage	APCO, Air Pollution Control (Construction Dust) Regulation	•
No more than 6 cremators (including both the existing and new ones) are in operation during commissioning test of new cremators. The commissioning test of each new cremator shall be recorded by a log book	Existing and new cremators in Existing and New Crematorium / text and commissioning	Arch SD/FEHD/ Contractor	Construction stage		N/A
Special air pollution control systems shall be installed and operate to reduce the emissions of air pollutants to acceptable levels	New cremators in New Crematorium / all stages	Arch SD	Design, Construction, Demolition and Operation stage	BPM/APCO	N/A
Conduct baseline and regular 1-hour and 24-hour TSP monitoring.	A8 and A17 / baseline monitoring prior to Phase I & II works and regular monitoring throughout Phase I & II works	Contractor	Construction and Demolition stage	APCO, EM&A Guidelines for Development Projects in Hong Kong	√
When the demolition material is confirmed to have ACM, monitoring for asbestos fibre would be carried out at the boundary of the construction site for reassurance purposes as per the requirement of future	Construction site boundary / demolition	Contractor	Demolition stage	Asbestos Study Report, AIR and AAP to be submitted under	N/A

3

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
license for asbestos abatement, though it is not expected that asbestos fibre would be liberated from the demolition of the Existing Crematorium building.				APCO, future licence for asbestos abatement (if any)	
<b>Noise Mitigation Measures</b>					
Select quiet plant, which is defined as PME with a sound power level lower than that specified in GW-TM. Examples of quiet plant can be referred to those listed in British Standard BS5228.	Project site / construction and demolition stages	Contractor	Construction and Demolition stages	GW-TM	N/A
Where practicable, use movable barriers of 3 to 5 m height with a small cantilevered upper portion and skid footing can be located within a few metres from a stationary plant (e.g. generator, compressor, etc.) and within about 5 m for a mobile equipment (e.g. breaker, excavator, etc.), especially in the vicinity of SR3, SR4 and SR6. The purpose-built noise barriers or screens shall be constructed of appropriate materials with a minimum superficial density of 15kg/m <sup>2</sup> .	Project site / construction and demolition stages	Contractor	Construction and Demolition stages	NCO	N/A
<ul style="list-style-type: none"> <li>Only well-maintained plant should be operated on site and plant should be regularly serviced during the construction works</li> <li>Plant that is used intermittently should be turned off or throttled down when not in active use</li> <li>Plant that is known to emit noise strongly in one direction should be oriented to face away from NSRs</li> <li>Silencers, mufflers and enclosures for plant should be used where possible and maintained adequately throughout the works</li> <li>Where possible mobile plant should be sited away from NSRs</li> </ul>	Project site / construction and demolition stages	Contractor	Construction and Demolition stages	NCO	√

4

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
<ul style="list-style-type: none"> <li>Stockpiles of excavated materials and other structures such as site buildings should be used effectively to screen noise from the works</li> </ul>					
Liaise with the school and the Examination Authority to ascertain the dates and times of examination periods during the course of the construction/ demolition works so as to avoid any noisy activities during these periods. Programme of the on-site works should hence be well programmed such that the noisier construction activities would not be coincided with the examination of the schools.	Project site / construction and demolition stages	Contractor	Demolition stage	NCO	√
Conduct regular noise monitoring.	SR 3, SR 4 and SR 6 / Phase I & II works	Contractor	Demolition stage	NCO, EM&A Guidelines for Development Projects in Hong Kong	√
<b>Land Contamination Mitigation Measures</b>					
Additional site investigations in areas of the site that are currently in use and cannot be readily accessed. These investigations will be carried out once the existing facility has been decommissioned. The additional site investigations are required in the vicinity of the existing CLP secondary substation, and around the cremators and flues inside the crematorium building. Once access to these areas is available, a sampling and analysis plan will be prepared for approval by EPD, additional investigations will take place, and the need for remedial works will be determined. Any remedial works required will be in addition to those described in this current report.	CLP secondary substation and cremator room/ demolition stage (Phase I – CLP secondary substation; Phase II – cremator room)	Contractor	Demolition stage	ProPECC PN 3/94	√
Once the Existing Crematorium has ceased operating during Phase II, confirmatory surface	Locations S1 to S6 specified in the	Contractor	Demolition stage	ProPECC PN 3/94	N/A

5

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
samples will be taken from the samples points S1 to S6 at a depth of 0.1m, and these samples will be analysed for the same suite of determinands (i.e. dioxins, metals and PAH) in order to confirm that no further contamination has occurred. The Remediation Action Plan will be revised on the basis of these results.	CAP/demolition				
The underground fuel storage tank and associated pipework will be removed as part of the site formation works. The base of the excavations will be inspected during and after tank removal by a suitably experienced environmental specialist in order to determine whether there is any visual or olfactory evidence of fuel contamination. If such contamination is suspected, then confirmatory soil sampling will be carried out, and the samples analysed for TPH.	Underground fuel storage tank/during and after tank removal	Contractor	Demolition stage	ProPECC PN 3/94 and Guidance Notes for Investigation and Remediation of Contaminated Sites of Petrol Filling Stations, Boatyards and Car Repair / Dismantling Workshops	N/A
<b>Summary of remediation works at locations S3 and S5:</b>					
1. Mark out 5m radius around S3 and S5 2. Excavate to depth of 0.5m 3. Transport to landfill site for final disposal 4. Take 4 samples from edges of excavation and one sample from base of excavation, analyse for lead and tin 5. If the results exceed Dutch B Levels, extend excavation to a further 5 m radius and 0.5 m depth in the quadrant where the contaminated samples is encountered and repeat steps 3 and 4 6. If the results less than Dutch B Levels, then remediation completed.	Locations S3 and S5 specified in CAP/demolition	Contractor	Demolition stage	ProPECC PN3/94	N/A

6

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
During removal of the underground fuel storage tank, appropriate precautions should be taken to avoid contamination. All fuel tanks and associated pipework should be emptied prior to any demolition work being undertaken. Any remaining sludge or sediment in the tanks or pipework should be removed and disposed of as chemical waste in accordance with the appropriate regulations for disposal of such material.	Underground fuel storage tank / Phase II demolition	Agent Contractor	Demolition stage	ProPECC PN 3/94 and Guidance Notes for Investigation and Remediation of Contaminated Sites of Petrol Filling Stations, Boatyards and Car Repair / Dismantling Workshops	N/A
Should contamination be encountered beneath the fuel tank or the CLP secondary substation, further remedial work will be required. Such potential contamination would consist of either TPH (in the case of the fuel tank) or PCBs (in the case of the CLP secondary substation). As a realistic worst-case estimate, the PCB contaminated soil at CLP secondary substation may require stabilisation with cement prior to disposal to landfill. A realistic worst case estimate is that the volume of TPH contaminated soil at underground storage tank would require landfill disposal.	CLP secondary substation /Phase I demolition and underground fuel tank / Phase II demolition	Contractor	Demolition stage	ProPECC PN 3/94 and Guidance Notes for Investigation and Remediation of Contaminated Sites of Petrol Filling Stations, Boatyards and Car Repair / Dismantling Workshops	N/A
<b>Health and Safety Precautions during Remedial Works</b>					
The site workers engaged in the remedial works should be provided with adequate personal protective equipment, which should include: <ul style="list-style-type: none"> <li>• Protective footwear;</li> <li>• Gloves; • Dust masks; and • Overalls.</li> </ul> A clean area should be provided, equipped with washing facilities. Eating, drinking and smoking should only be permitted within designated "clean" areas after washing. Excavated material should not be stockpiled, but should immediately be treated/transported to landfill on a daily basis ..	All areas requiring remedial works in Project site / demolition during Phases I and II	Contractor	Demolition stage	ProPECC PN 3/94 and Guidance Notes for Investigation and Remediation of Contaminated Sites of Petrol Filling Stations, Boatyards and Car Repair / Dismantling	N/A

7

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
Avoidance of Impacts on Water Quality during Remedial Works In order to avoid impacts on water quality during remedial works, care will be taken to minimise the mobilisation of sediment during excavation and transport. Measures to be adopted will be based on the recommendations set out in Practice Note for Professional Persons ProPECC PN1/94 "Construction Site Drainage". The results of the site investigation suggest that there is unlikely to be any requirement for dewatering of excavations, since groundwater was not encountered in any of the exploratory holes. The contractor carrying out the remedial works will be required to submit a method statement detailing the measures to be taken to avoid water quality impacts. Typical measures would include: <ul style="list-style-type: none"> <li>• Carry out the works during the dry season (i.e. October to March) if possible;</li> <li>• Use bunds or perimeter drains to prevent run-off water entering excavations;</li> <li>• Sheet or otherwise cover excavations whenever rainstorms are expected to occur;</li> <li>• Minimise the requirements for stockpiling of material and ensure any stockpiles are covered;</li> <li>• Temporary on-wit stockpiling of contaminated materials should be avoided, and all excavated contaminated soils/materials should be disposed of on a daily basis;</li> <li>• Ensure that any discharges to storm drains pass through an appropriate silt trap.</li> </ul>	All areas requiring remedial works in Project site / demolition during Phases I and II	Agent Contractor	Demolition stage	Workshops ProPECC PN 3/94, ProPECC PN1/94 and Guidance Notes for Investigation and Remediation of Contaminated Sites of Petrol Filling Stations, Boatyards and Car Repair / Dismantling Workshops	N/A
<b>Waste Disposal Requirements during Remedial Works</b>					
An application for permission to dispose of excavated material should be made to the Facilities Management Group of EPD three months prior to disposal. A "trip-ticket" system should be implemented. Each load of contaminated soil despatched to landfill should be	All areas requiring remedial works in Project site / demolition during Phases I and II	Contractor	Demolition stage	ProPECC PN 3/94, Waste Disposal Ordinance (Cap. 354), WBTC No. 21/2002 and	N/A

8

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
accompanied by an admission ticket. Vehicles leaving the site should be adequately sheeted to prevent dispersion of contaminated material during transport. The wheels of vehicles should be cleaned prior to leaving site, to prevent contaminated material leaving site on the wheels of vehicles.				Guidance Notes for Investigation and Remediation of Contaminated Sites of Petrol Filling Stations, Boatyards and Car Repair / Dismantling Workshops	
<b>Compliance Report for Remedial Works</b>					
Following completion of remediation works, a Remediation Report should be compiled and submitted, to demonstrate that the remediation works have been carried out in accordance with the Remediation Action Plan. The Remediation Report should include details of the excavation works carried out, records of material taken to landfill, and results of confirmatory testing, and should be submitted to EPD for approval before the commencement of building works.	All areas requiring remedial works in Project site / after completion of remediation works	Agent Contractor	Demolition stage	ProPECC PN 3/94 and Guidance Notes for Investigation and Remediation of Contaminated Sites of Petrol Filling Stations, Boatyards and Car Repair / Dismantling Workshops	N/A
<b>Land Contamination Mitigation Measures</b>					
Conduct supplementary site investigation for TPH and PCB in soil samples.	CLP substation / after decommissioning but prior to demolition during Phase I work	Contractor	Demolition stage	CAR, RAP, future sampling and analysis plan	√
Conduct confirmatory testing of PAH, dioxins and metals (the "Dutch List") in soil samples.	S1 to S6 / Phase II work	Contractor	Construction and Demolition stages	CAR, RAP, future sampling and analysis plan	N/A
If fuel contamination underneath the underground fuel tank is suspected, confirmatory soil sampling will be carried out for analysis of TPH.	Underneath the underground fuel tank / Phase II	Contractor	Demolition stages	CAR, RAP, future sampling and analysis plan	N/A
Conduct confirmatory testing of tin and lead in soil	S3 and S5 / during	Contractor	Construction and	CAR, RAP, future	N/A

9

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
samples to confirm all contaminated soil has been excavated.	Phase II work following excavation at each location		Demolition stages	sampling and analysis plan	
<b>Waste Management Mitigation Measures</b>					
<p><b>Good Site Practice</b></p> <ul style="list-style-type: none"> <li>• Obtain relevant waste disposal permits from the appropriate authorities, in accordance with the Waste Disposal Ordinance (Cap. 354), Waste Disposal (Chemical Waste) (General) Regulation (Cap. 354) and the Land (Miscellaneous Provision) Ordinance (Cap. 28)</li> <li>• Prepare a Waste Management Plan approved by the Engineers / Supervising Officer of the Project in accordance with Environment, Transport and Works Bureau Technical Circular (Works) (ETWBTC(W)) 15/2003, Waste Management On Construction Sites</li> <li>• Nominate an approved person, such as site manager, to be responsible for good site practice, arrangements for collection and effective disposal of all types of wastes generated on-site to appropriate facility</li> <li>• Use waste hauler authorized or licensed to collect specific category of waste</li> <li>• Establish trip ticket system as contractual requirement (with reference to Works Branch Technical Circular (WBTC) No. 21/2002) for monitoring of public fill and C&amp;D waste at public filling facilities and landfills. Such activities should be monitored by the Environmental Team</li> <li>• Provide training to site staff in terms of proper waste management and chemical waste handling procedures</li> <li>• Separate chemical wastes for special handling and dispose them at licensed facility for treatment</li> <li>• Establish routine cleaning and maintenance programme for drainage systems, sumps and oil interceptors</li> <li>• Provide sufficient waste disposal points and regular</li> </ul>	Project site/ design, construction and demolition stages	Contractor	Design, Construction and Demolition stages	Waste Disposal Ordinance (Cap. 354), Waste Disposal (Chemical Waste) (General) Regulation (Cap. 354) Land (Miscellaneous Provision) Ordinance (Cap. 28) WDO, ETWBTC(W) 15/2003, WBTC No. 21/2002	√

10

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
collection for disposal <ul style="list-style-type: none"> <li>Adopt measures to minimize windblown litter and dust during transportation of waste, such as covering trucks or transporting wastes in enclosed containers</li> <li>Establish recording system for the amount of wastes generated, recycled and disposed of (including the disposal sites)</li> </ul>					
Waste Management Plan The contractor should submit the Waste Management Plan to Engineer/Supervising Officer of the Project for approval. The Waste Management Plan should describe the arrangements for avoidance, reuse, recovery and recycling, storage, collection, treatment and disposal of different categories of waste to be generated from the activities of the Project and indicate the disposal location(s) of all waste. A trip ticket system shall be included in the Waste Management Plan.	Project site / design, construction and demolition stages	Contractor	Design, Construction and Demolition stages	Waste Disposal Ordinance (Cap. 354)	√
Waste Reduction Measures - Minimize the damage or contamination of construction material by proper storage and site practices <ul style="list-style-type: none"> <li>Plan and stock construction materials carefully to minimize amount of waste generated and avoid unnecessary generation of waste</li> <li>Prior to disposal of C&amp;D waste, wood, steel and other metals should be separated for reuse and / or recycling to minimize the quantity of waste to be disposed of to landfill</li> <li>Minimize use of wood and reuse non-limber formwork to reduce the amount of C&amp;D waste</li> <li>Recycle any unused chemicals or those with remaining functional capacity as far as practicable</li> <li>As far as practicable, segregate and store different types of waste in different containers, skips or stockpiles to enhance reuse or recycling of materials and their proper disposal</li> <li>Encourage collection of aluminium cans, plastic bottles and packaging material (e.g. carton boxes) and office paper by individual collectors, separate labeled</li> </ul>	Project site / construction and demolition stages	Agent Contractor	Construction and Demolition stages	WBTC No. 32/92, 5/98 and 19/99	√

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
bins should be provided to help segregate this waste from other general refuse generated by the work force					
Excavated Material Rock and soil generated from excavation should be reused for site formation as far as possible. In addition, excavated material from foundation work can be reused for landscaping as far as practicable to avoid disposal off-site.	Project site / construction and demolition stages	Contractor	Construction and Demolition stages	WBTC 12/2000	√
Construction and Demolition Material Careful design, planning and good site management can minimize over-ordering and generation of waste materials such as concrete, mortar and cement grouts. Standard formwork should be used as far as practicable, wooden formwork should be replaced by metal ones whenever possible. Alternatives such as plastic fencing and reusable site office structures can also minimize C&D waste generation. The contractor should recycle as much as possible of the C&D material on-site. Public fill and C&D waste should be segregated and stored in different containers or skips to enhance reuse or recycling of materials and their proper disposal. Materials such as concrete and masonry can be crushed and used as fill and steel reinforcing bar can be used by scrap steel mills. Different areas of sites should be designated for such segregation and storage. To maximize landfill life, government policy discourages the disposal of C&D materials with more than 20% inert material by volume (or 30% inert material by weight) at landfill. Inert C&D material (public fill) should be directed to an approved public filling area, where it has the added benefit of offsetting the need for removal of materials from borrow areas for reclamation purposes.	Project site / construction and demolition stages	Contractor	Design, Construction and Demolition stages	WBTC 5/98 and 19/99	√
Contaminated Material – Further Contamination	CLP secondary	Contractor	Demolition	ProPECC PN	N/A



Recommended Mitigation Measures			Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
Location	Investigation Parameter	Investigation Period					
Cremators/ flue/chimney and surrounding areas	Asbestos (building structure)	Phase II					
CLP secondary substation	PCB, TPH (soil samples)	Phase I					
Cremators/ flue/chimney and surrounding areas	Dioxins, heavy metals, PAH (ash waste)	Phase II					
Surface soil around Existing Crematorium	Dioxins, heavy metals, PAH (soil sample)	Phase II					
Further contamination investigation shall provide information on the extent of contamination at cremators /flues / chimney as well as the quantity of contaminated materials requiring treatment and disposal.							

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
Samples of ash/particulate matters should be collected from within the cremators (including the bottom ash), chimney walls, flues and surrounding area of the Existing Crematorium for analysis of dioxin, heavy metals and PAHs by a HOKLAS accredited laboratory. A consultant experienced in the abatement of chemical wastes particularly the handling of DCM, should be appointed in order to assist with the evaluation of the information and prepare an abatement plan for the ash waste. Such a plan shall be submitted to EPD and the Labour Department (LD) to establish an acceptable and safe method for these potentially hazardous wastes. The abatement plan should identify the method of abatement, the performance criteria for the protection of workers and the environment and any emergency procedures and contingency measures required.					
It must be ensured that the treatment of ash wastes will comply with all routine construction site safety procedures would apply as well as statutory requirements under the Occupational Safety and Health Ordinance and Factories and Industrial Undertakings Ordinance. Due to the difficulties in establishing permanent and effective engineering controls, the protection of workers is likely to be at the worker level. A safe system of work must be provided, and training and suitable personal protective equipment as well as hygienic decontamination facilities should be provided. It is recommended that the methods to be adopted by the contractor for disposal of the ash waste should be agreed with LD and EPD.	Cremator room in Existing Crematorium / before demolition and after decommission	Contractor	Demolition stage	ProPECC PN 3/94	N/A
Sufficient time should be allocated to abate all ash waste with DCM/HMCM/PAHCM. The contractor should ensure the implications of dust				ProPECC PN 3/94 Code of Practice on	N/A

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
containing DCM/HMCM on air quality and workers health during the clean up work are mitigated. Since DCM is chemically related to Polychlorinated Biphenyl (PCB) wastes, the requirements of the <i>Code of Practice on the Handling, Transportation and Disposal of (PCB) Wastes</i> should be referenced when developing the abatement plan.				the Handling, Transportation and Disposal of (PCB) Wastes	
A land contamination site investigation was carried out under this EIA to determine disposal requirements for contaminated soil. Further site investigation on soil around CLP secondary substation is needed when decommissioned, which will be during Phase I of the works. In addition, confirmatory testing on DCM level in locations S1 to S6 will be required to identify the appropriate remediation and disposal requirements during Phase II of the works.	Locations S1 to S6 in CAP / prior to Phase II demolition		Demolition stage		N/A
Asbestos Containing Materials (ACM) Further asbestos assessment should be carried out when access to the crematorium /flue /chimney is accessible after decommissioning and before demolition. An AMP should be prepared. The AAP should be prepared and submitted to EPD for approval prior to commencement of demolition works in accordance to the APCO. It is preferable to remove all ACM before actual demolition. A registered asbestos removal contractor should be employed to remove all ACM in accordance with the approved AAP which will be prepared in due course in accordance with the <i>Code of Practice (COP) on Asbestos Control for Safe Handling of Low Risk ACM and Asbestos Work Using Full Containment or Mini Containment Method</i> published by EPD. A registered asbestos consultant should also be employed to	Cremator room in Existing Crematorium / before demolition and after decommission	Contractor	Demolition stage	Code of Practice (COP) on Asbestos Control for Safe Handling of Low Risk ACM and Asbestos Work Using Full Containment or Mini Containment Method COP on Handling, Transportation and Disposal of Asbestos Waste under the Waste Disposal	N/A

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status												
supervise abatement works. For the disposal of ACM, the contractor should observe the <i>COP on Handling, Transportation and Disposal of Asbestos Waste under the Waste Disposal (Chemical Waste) (General) Regulation</i> .				(Chemical Waste) (General) Regulation APCO													
Dioxin Containing Materials (DCM) / Heavy Metal Containing Materials (HMCM) / Polyaromatic Hydrocarbon Containing Materials (PAHCM) from Demolition of the Existing Crematorium Proposed Contamination Classification for Ash Waste with DCM/HMCM	Cremator room in Existing Crematorium / before demolition and after decommission	Contractor	Demolition	ProPECC PN3/94 USEPA dioxin assessment criterion	N/A												
<table border="1"> <thead> <tr> <th>Classification of Contamination</th> <th>Dioxin Level in Ash Waste</th> <th>Heavy Metal Level in Ash Waste</th> </tr> </thead> <tbody> <tr> <td>Low/Non Contaminated by DCM / HMCM / PAHCM</td> <td>&lt; 1 ppb TEQ</td> <td>&lt; Dutch "B" List</td> </tr> <tr> <td>Moderately/ Severely Contaminated HMCM / PAHCM</td> <td>&lt; 1 ppb TEQ</td> <td>≥ Dutch "B" List</td> </tr> <tr> <td>Moderately Contaminated DCM</td> <td>≥ 1 and &lt;10 ppb TEQ</td> <td>Any level</td> </tr> </tbody> </table>	Classification of Contamination	Dioxin Level in Ash Waste	Heavy Metal Level in Ash Waste	Low/Non Contaminated by DCM / HMCM / PAHCM	< 1 ppb TEQ	< Dutch "B" List	Moderately/ Severely Contaminated HMCM / PAHCM	< 1 ppb TEQ	≥ Dutch "B" List	Moderately Contaminated DCM	≥ 1 and <10 ppb TEQ	Any level					
Classification of Contamination	Dioxin Level in Ash Waste	Heavy Metal Level in Ash Waste															
Low/Non Contaminated by DCM / HMCM / PAHCM	< 1 ppb TEQ	< Dutch "B" List															
Moderately/ Severely Contaminated HMCM / PAHCM	< 1 ppb TEQ	≥ Dutch "B" List															
Moderately Contaminated DCM	≥ 1 and <10 ppb TEQ	Any level															

Recommended Mitigation Measures			Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
Severely Contaminated DCM	≥10 ppb TEQ	Any level					
<p><i>Demolition, Handling, Treatment and Disposal of Low/Non-Contaminated DCM/HMCM / PAHCM from Demolition of Existing Crematorium</i> Where the ash waste contains low/non contaminated DCM/HMCM/PAHCM, the contractor should avoid ash waste becoming airborne during demolition. General dust suppression measures mentioned in Section 4 should be followed. All such ash waste can be directly disposal of at landfill. Subject to the findings of the further asbestos investigation, building structures where such ash waste is found but contaminated with asbestos should be dealt in accordance to 7.7.16.</p>			Cremator room in Existing Crematorium / demolition	Contractor	Demolition stage	APCO	N/A
<p><i>Demolition, Handling, Treatment and Disposal of Moderately Contaminated DCM and Moderately/Severely Contaminated HMCM / PAHCM from Demolition of the Existing Crematorium</i> Procedure on demolition, handling, treatment and disposal of Moderately Contaminated DCM and Moderately/Severely Contaminated HMCM / PAHCM is listed below</p>			Cremator room in Existing Crematorium / demolition	Contractor	Demolition stage	Waste Disposal (Chemical Waste) (General) Regulation	N/A
Item	Procedure						

Recommended Mitigation Measures		Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
Site Preparation	<p>The contractor should ensure the impacts of dust containing dioxin and/or heavy metals on air quality and workers health during the handling and transportation of the contaminated materials are mitigated. Except the cremators/flue/chimney, all removable items where moderately contaminated DCM or moderately/severely contaminated HMCM / PAHCM is identified should be removed as far as practicable to avoid obstructing the decontamination activities. Preliminary site decontamination of all debris shall be carried out using HEPA vacuum cleaner. The top portion of the chimney above the roof shall be enclosed by a chamber with three layers of polyethene sheets. At the entrance to the cremators /flues /chimney, a 3-chamber decontamination unit shall be constructed for entry and exit from the work area. The 3-chamber decontamination unit shall comprise a dirty room, a shower room and a clean room of at least 1m x 1m base each with 3 layers of fire retardant polyethene sheet where all workers shall carry out decontamination procedures before leaving the work area. Warning signs in both Chinese and English should be put up in conspicuous areas.</p>					

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
All workers shall wear full protective equipment, disposable protective coverall (such as Tyvek) (with hood and shoe covers), nitrile gloves, rubber boots (or boot covers), and full-face positive pressure respirators equipped with a combination cartridge that filters particulate and removes organic vapour. The organic vapour protection is an added protection against the unlikely exposure to any vapour.					
If ACM is identified in building structures where moderately contaminated DCM or moderately/severely contaminated HMCM / PAHCM is found, relevant abatement measures for building structures described in the AAP (see 7.7.16) should be implemented prior to the above site preparation.					
Decontamination, demolition and handling The cremators/flue/chimney shall be removed from top down starting from the chimney. Any ash or residues attached to the cremators/flue/chimney or any other building structures shall be removed by scrubbing and HEPA vacuuming. Wastes generated from the containment or decontamination unit including the protection clothing of the workers such as the coverall, nitrile glove, rubber boots and materials used for wet wiping shall be disposed of at landfill site.	Cremator room in Existing Crematorium / demolition	Contractor	Demolition stage	Waste Disposal (Chemical Waste) (General) Regulation	N/A

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
After completion of removal, decontaminate all surfaces by HEPA vacuum.					
If ACM is identified in building structures where moderately contaminated DCM or moderately/severely contaminated HMCM / PAHCM is found, relevant abatement measures for building structures described in the AAP (see 7.7.16) should be implemented prior to the above decontamination, demolition and handling measures.					
Treatment The ash waste contains dioxin/heavy metals and in its untreated state would be classified as a chemical waste under the <i>Waste Disposal (Chemical Waste) (General) Regulation</i> . While the quantity of DCM/HMCM is not expected to be significant, the levels of dioxin and heavy metals would affect the treatment option. Immobilization of the contaminated materials by mixing with cement followed by disposal at landfill (if landfill disposal criteria can be met) would be the most preferable option.					
Rather than treating the already incinerated ash waste by incineration, the ash waste with moderately contaminated					

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
<p>DCM or moderately/severely contaminated HMCM / PAHCM should be collected and stabilized to meet landfill disposal criteria of the Facilities Management Group (FMG) of EPD. In this case it is envisaged that the process would involve collection and mixing of the ash waste with cement. Pilot mixing and TCLP tests should be carried out to establish the appropriate ratio of cement to ash waste to the satisfaction of EPD. It is envisaged that the pilot tests would involve the mixing of say 5%, 10% and 15% ratios of cement to ash waste and three replicate of 300 mm cube blocks for each ratio. TCLP tests should then be used to establish the correct ratio of cement to ash waste to the satisfaction of EPD.</p>					

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
<p>Disposal</p> <p>After immobilization of the ash waste by mixing with cement in the correct ratio as determined by the pilot mixing and TCLP test, the waste materials should be placed inside polyethylene lined steel drums for disposal at landfill. Transparent plastic sheeting of 0.15 mm thickness low-density polyethylene or PVC should be employed. The drums should be 16 gauge steel or thicker and fitted with double bung fixed ends adequately sealed and well labelled in new or good condition. The drums should be clearly marked "DANGEROUS CHEMICAL WASTE" in English and Chinese. Prior agreement of the disposal criteria from the FMG of EPD and agreement to disposal from the landfill operator must be obtained.</p> <p>As a fall back option, if the landfill disposal criteria cannot be met after immobilization of the ash waste, disposal at the CWTC should be considered.</p> <p>The building structures will be disposal of at landfill.</p>	<p>Cremator room in Existing Crematorium / demolition</p>	<p>Contractor</p>	<p>Demolition stage</p>	<p>Waste Disposal (Chemical Waste) (General) Regulation</p>	<p>N/A</p>

Recommended Mitigation Measures		Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
	If ACM is identified in building structures where moderately contaminated DCM or moderately/severely contaminated HMCM / PAHCM is found, relevant disposal measures for building structures described in the AAP (see 7.7.16) should be implemented instead.					
<i>Demolition, Handling, Treatment and Disposal of Severely Contaminated DCM from Demolition of the Existing Crematorium</i> Procedure for demolition, handling, treatment and disposal of Severely Contaminated DCM is listed below		Cremator room in Existing Crematorium / demolition	Contractor	Demolition stage	Waste Disposal (Chemical Waste) (General) Regulation	N/A
<b>Item</b>	<b>Procedure</b>					
Site Preparation	Except the cremators/flue/chimney, all removable items where severely contaminated DCM is identified should be removed from the cremator room as far as practicable to avoid obstructing the decontamination activities. Preliminary site decontamination of all debris shall be carried out using HEPA vacuum cleaner. The walls, floor and ceiling of the cremator room where severely contaminated DCM located shall be lined with 3 layers of fire retardant polyethene sheets. The top portion of the chimney above the roof shall be enclosed by a chamber with three layers of polyethene sheets. At the entrance to the cremators/flues/chimney, a 3-chamber					

Recommended Mitigation Measures		Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
	decontamination unit shall be constructed for entry and exit from the work area. The 3-chamber decontamination unit shall comprise a dirty room, a shower room and a clean room of at least 1m x 1m base each with 3 layers of fire retardant polyethene sheet where all workers shall carry out decontamination procedures before leaving the work area. Warning signs in both Chinese and English should be put up in conspicuous areas.					
	Air movers should be installed at the cremator room, and at the bottom of the chimney to exhaust air from the work area. A stand-by air mover shall also be installed with each of the air movers. Sufficient air movement shall be maintained to give a minimum of 6 air changes per hour to the work area, and maintain a negative pressure of 0.05-0.15 inches of water within the work area throughout the entire course of the decommissioning works. A pressure monitor with printout records and audible alarm shall be installed at an easily accessible location to demonstrate that negative pressure is maintained. New pre-filters and HEPA filters shall be used on the air movers.					
	A copy of the maintenance records of					

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
the air movers should be kept on site for inspection upon request. The appointed contractor shall also check the differential pressure of the air mover to make sure the filter is not blocked. A differential pressure above 0.2 inches of water indicates that the filters would need to be changed.					
Smoke Test: before commencement of the decommissioning work, a smoke test with non-toxic smoke shall be carried out to ensure the air-tightness of the containment. Also check whether there are stagnant air pockets indicated by an aggregate of smoke that cannot effectively be extracted. After a successful test, switch on the air mover to exhaust smoke from the containment and to give a minimum of 6 air changes per hour, and check visually to see that the filters screen out the smoke effectively and if the pressure gauges read normal. If not, the air mover shall be sealed up and returned to the supplier workshop for necessary servicing, and replaced by a tested air mover. The normal reading pressure range for maintaining 6 air changes per hour shall be 1.5-4 mm/0.05-0.15 inches of water or equivalent	Cremator room in Existing Crematorium / demolition	Contractor	Demolition stage	Waste Disposal (Chemical Waste) (General) Regulation	N/A

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
(negative pressure). The audible alarm's integrity should also be checked and the trigger shall be at <1.5 mm/0.05 inches of water (negative pressure). Otherwise securely seal up all openings before switching off the air mover.					
Treatment of Waste/Workers Safety Protection: the contractor shall be required to register as a Chemical Waste Producer. All workers shall wear full protective equipment, disposable protective coverall (such as Tyvek) (with hood and shoe covers), nitrile gloves, rubber boots (or boot covers), and full-face positive pressure respirators equipped with a combination cartridge that filters particulate and removes organic vapour. The organic vapour protection is an added protection against the unlikely exposure to any vapour as a necessary measure.					
If ACM is identified in building structures where severely contaminated DCM is found, relevant abatement measures for building structures described in the AAP (see 7.7.16) should be implemented prior to the above site preparation.					

Recommended Mitigation Measures		Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
Decontamination, demolition and handling	The cremators/flue/chimney shall be removed from top down starting from the chimney. Any ash or residues attaching to the cremators/flue/chimney or any other building structures shall be removed by scrubbing and HEPA vacuuming. The detached sections of the building structures where severely contaminated DCM is located shall be wrapped with 2 layers of fire retardant polyethylene sheets. A third layer shall then be wrapped and secured with duct tape. Decontaminate the outer layer of the wrapped flue sections by wet wiping.	Cremator room in Existing Crematorium / demolition.	Contractor	Demolition stage	Waste Disposal (Chemical Waste) (General) Regulation	N/A
	Wastes generated from the containment or decontamination unit including the fire retardant polyethylene sheets, protection clothing of the workers such as the coverall, nitrile glove, rubber boots and materials used for wet wiping shall be disposed of at landfill site.	Cremator room in Existing Crematorium / demolition	Contractor	Demolition stage	Waste Disposal (Chemical Waste) (General) Regulation	N/A

Recommended Mitigation Measures		Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
	The quantity of wastewater generated from the decontaminated process will be very small but the contractor should take precautionary measures as to minimize the quantity of contaminated water arising. Nevertheless, if any contaminated wastewater needs to be discharged out of the site, it has to be properly treated to WPCO requirements with prior agreement from EPD on discharge standards.					
	After completion of removal, decontaminate the surface where severely contaminated DCM was located, including the wrapped incinerator furnace and flue sections left within the containment, by wet wiping and HEPA vacuum. Then spray the innermost layer of the fire retardant polyethylene sheet covering the wall, ceiling and floor with PVA. Upon drying, peel off this innermost layer of the polyethylene sheet covering the containment and dispose of at landfill site.					



Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
Repeat the above decontamination procedure for the second innermost layer of fire retardant polyethene sheet by wet wiping and HEPA vacuuming. After spraying with PVA, peel off this second innermost layer of the polyethene sheet covering the wall, ceiling and floor and dispose of at landfill site. Finally, the last layer of polyethene sheet shall then be taken down after spraying with PVA and be disposed as contaminated wastes.					
If ACM is identified in building structures where severely contaminated DCM is found, relevant abatement measures for building structures described in the AAP (see 7.7.16) should be implemented prior to the above decontamination, demolition and handling measures.					
Treatment and disposal Waste to be disposed to CWTC: all contaminated ash waste with severely contaminated DCM removed and the used HEPA filters shall be sent to CWTC in Tsing Yi. The total volume should be confirmed by further site investigation.	Cremator room in Existing Crematorium / demolition	Contractor	Demolition stage	Waste Disposal (Chemical Waste) (General) Regulation	N/A

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
Waste to be Disposed of at Landfill: other wastes including the building structures and its associated panels as well as wastes generated from this decommissioning works are also considered as contaminated waste and shall be disposed of at a designated landfill. Wastes generated from this decommissioning works refer to the polyethene wrapping sheets for the building structures, waste generated from the dismantlement of the containment and decontamination units, and cloth used in wet wrapping, etc. as previously described in this section. They shall be placed into appropriate containers such as drums, jerricans, or heavy duty and leak-proof plastic as a prudent approach. A disposal permit has to be obtained from the Authority. The disposal trip ticket is required to be made available as record after disposal.					
If ACM is identified in building structures where severely contaminated DCM is found, relevant disposal measures for building structures described in the AAP (see 7.7.16) should be implemented in prior to the above disposal measures.					

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
<i>Dioxin Containing Materials (DCM) / Heavy Metal Containing Materials (HMCM) / Polyaromatic Hydrocarbon Containing Materials (PAHCM) / Total Petroleum Hydrocarbon Containing Materials (TPHCM) / Polychlorinated Biphenyls Containing Materials (PCBCM) from Soil Remediation at the Project Site</i>					
According to the CAR and RAP, less than 100 m3 of soil would require disposal at landfill. Relevant health and safety procedure, waste disposal requirements and compliance report are as detailed in Figure 6.3. Mitigation measures to avoid fugitive dust emission mentioned in S.4.7.2 should also be observed.	Locations S3 and S5 of CAP / demolition	Contractor	Demolition stage	ProPECC PN3/94 APCO	N/A
In addition, after decommissioning but before demolition of the Existing Crematorium, further investigations during Phase I of the works at the vicinity of CLP secondary substation should also be carried out to determine if additional remediation (in addition to the current RAP) is required. Confirmatory test on levels of DCM, HMCM and PAHCM in locations S1 to S6 during Phase II of the works is also required to determine any further remediation /treatment/disposal. In addition, the ash waste in cremator/chimney/flues should also be collected for the testing of DCM/HMCM/PAHCM during Phase II of the works. The sampling and analysis plan should be prepared and submitted to EPD for approval.	CLP secondary substation / after decommission and before demolition	Contractor	Demolition stage	ProPECC PN3/94	N/A
All the aforementioned ACM / DCM / HMCM / PAHCM / TPHCM / PCBCM are classified as chemical waste. In addition to the measures mentioned above, the packaging, labelling and storage practices of chemical waste as stipulated in the following paragraphs should also be applied to these contaminated materials.	Project site / demolition	Contractor	Demolition stage	Waste Disposal (Chemical Waste) (General) Regulation	N/A

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
<b>Chemical Waste</b> All the chemical waste should be handled according to the <i>Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes</i> . The Contractor should register as a chemical waste producer. The chemical waste should be stored and collected by an approved contractor for disposal at a licensed facility in accordance with the <i>Waste Disposal (Chemical Waste) (General) Regulation</i> . Containers used for the storage of chemical waste should:	Project site / demolition	Contractor	Demolition stage	Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes. Waste Disposal (Chemical Waste) (General) Regulation.	√
<ul style="list-style-type: none"> <li>Be suitable for the substance they are holding, resistant to corrosion, maintained in good condition, and securely closed;</li> <li>Have a capacity of less than 450 L unless the specifications have been approved by the EPD; and</li> <li>Display a label in English and Chinese in accordance with instructions prescribed in Schedule 2 of the <i>Waste Disposal (Chemical Waste) (General) Regulation</i>.</li> </ul>					
The storage area for chemical waste should:					
<ul style="list-style-type: none"> <li>Be clearly labeled and used solely for the storage of chemical waste;</li> <li>Be enclosed on at least 3 sides;</li> <li>Have an impermeable floor and bunding, of capacity to accommodate 110% of the volume of the largest container or 20% by volume of the chemical waste stored in that area, whichever is the greatest;</li> <li>Have adequate ventilation;</li> <li>Be covered to prevent rainfall from entering (water collected within the bund must be tested and disposal as chemical waste if necessary); and</li> <li>Be properly arranged so that incompatible</li> </ul>					

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
materials are adequately separated.					
The chemical waste should be disposed of by: <ul style="list-style-type: none"> <li>• A licensed waste collector;</li> <li>• A facility licensed to receive chemical waste, such as the CWTC at Tsing Yi, which offers chemical waste collection service and can supply the necessary storage containers; and/or</li> <li>• A waste recycling plant as approved by EPD.</li> </ul>	Project site / demolition	Contractor	Demolition stage	Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes. Waste Disposal (Chemical Waste) (General) Regulation.	N/A
<b>General Refuse</b> General refuse should be stored in enclosed bins or compaction units separated from C&D and chemical wastes. A reliable waste collector should be employed by the contractor to remove general refuse from the site, separately from C&D and chemical wastes, on a daily or every second day basis to minimize odour, pest and litter impacts. The burning of refuse on construction sites is prohibited by law. Aluminum cans are often recovered from the waste stream by individual collectors if they are segregated or easily accessible. Therefore, separately labeled bins for deposit of these cans should be provided if feasible. Similarly, plastic bottles and carton package material generated on-site should be separated for recycling as far as practicable. Site office waste should be reduced through recycling of paper if volumes are large enough to warrant collection. Participation in a local collection scheme should be considered if one is available.	Project site / construction and demolition stages	Contractor	Construction and Demolition stage		*
Conduct supplementary site investigation for asbestos in building structures and for dioxins, metals (the "Dutch List") and PAH in ash/particular	Around existing cremators, chimney and flues	Contractor	Demolition stage	AIR, AMP/AAP to be submitted under	N/A

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
matter samples.	inside cremator room / after decommissioning but prior to demolition during Phase II work			APCO, future supplementary site investigation plan	
<b>Landscape and Visual Mitigation Measures</b>					
The identification of the landscape and visual impacts will highlight those sources of conflict requiring design solutions or modifications to reduce the impacts and, if possible, blend the development with the surrounding landscape. The proposed landscape mitigation measures will be described and illustrated by means of site plans and photomontage and take into account factors including: <ul style="list-style-type: none"> <li>• Screen planting</li> <li>• Transplanting of mature trees with good amenity value where appropriate</li> <li>• Conservation of topsoil for reuse</li> <li>• Sensitive alignment of structures to minimise disturbance to surrounding vegetation</li> <li>• Reinstatement of areas disturbed during construction</li> <li>• The design and finishes / colours of architectural and engineering structures such as terminals and pylons</li> <li>• Existing views, views of the development with no mitigation, views with mitigation at day one of operation and after 10 years of operation</li> </ul>	Project site / design, construction and demolition stages	Contractor/FEH D/Arch SD	Construction and Demolition stage	EIAO-TM	N/A
Tree transplanting: The tree survey has identified the trees which will be affected by the development and which could be considered for	Project site / construction and demolition as well	Contractor/Arch SD	Construction and Demolition stage	WBTC 7/2002, WBTC 14/2002, EIAO-TM	N/A

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
transplanting prior to commencement of construction work. Felling is considered as a last resort and every effort should be made to transplant the many good trees of high amenity value to either nearby suitable sites within the cemetery or to available space in FEHD's Wo Hop Shek Crematorium pending identification of an alternative site. The feasibility of transplanting will depend on a number of factors such as size, health and species of the tree. Adequate time (a minimum of 4 months) should be allowed for preparing trees for transplanting. Weekly inspection of tree protection measures as well as monitoring of tree transplant operations during both phases should be implemented. Particular care should be taken to save the 9 nos. mature and semi-mature protected tree species and 12 nos. protected shrub and immature tree species identified. To give the protected species the best possible chance of survival it is recommended that they are relocated to sheltered and well maintained planted areas within the cemetery. The following measures for tree transplanting should be adopted: (a) Appoint a landscape contractor for the establishment and maintenance of the transplanted trees as well as any new tree planting for 12 months upon completion of the works. (b) Careful co-ordination of Phase I and II works to allow tree transplanting from Phase II site directly to Phase I site.	as operation stages				
Tree protection; Trees to be retained adjacent to works areas will be carefully protected by strong hoarding and if necessary additional protection to individual tree trunks to avoid damage by machinery. The hoarding will also prevent	Project site / construction and demolition stages	Arch SD	Construction and Demolition stage	WBTC 7/2002, WBTC 14/2002, EIAO-TM	N/A

35

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
contractors from compacting soil around tree roots or dumping materials. Reference should be made to the guidelines for tree protection in the Government publication "Tree Planting and Maintenance in Hong Kong".					
Topsoil conservation: Any topsoil excavated during construction will be carefully saved and stored to one side of the works area for reuse upon completion.	Project site / upon completion of construction works for each phase	Arch SD	Construction and Demolition stage	WBTC 7/2002, WBTC 14/2002, EIAO-TM	N/A
Replanting: Upon completion planting of ornamental trees and shrubs will be provided to the periphery of the new crematorium building to help screen and soften the overall appearance of the structure. In addition, a reprovisioned memorial garden with a lotus pond and ornamental planting will be incorporated in the deck area of the building. Since the majority of the new planting will be on the deck structure the selection of species will be more limited with emphasis on smaller trees and ornamental shrubs to comply with loading restrictions. Notwithstanding this site constraint on tree selection, a minimum of 1.2m soil depth will be provide for tree planting on the podium / roof structure for healthy establishment of the new tree planting.	Project site / upon completion of construction works for each phase	Arch SD	Construction and Demolition stage	WBTC 7/2002, WBTC 14/2002, EIAO-TM	N/A
Weekly inspections of tree protection measures as well as monitoring of tree transplant operations.	Project site / Phase I & II works	Project Landscape Architect	Construction and Demolition stage	Landscape Master Plan, Tree Planting and Maintenance in Hong Kong	N/A
<b>Water Quality Mitigation Measures</b>					
Construction and Demolition Phases – General To safeguard the water quality of the WSRs potentially affected by the Project works, the	Project site / construction and demolition stages	Contractor	Construction and Demolition stage	ProPECC PN 1/94	✓

36

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
contractor should implement appropriate mitigation measures with reference to the <i>Practice Note for Professional Persons, Construction Site Drainage (ProPECC PN 1/94)</i> published by EPD. Such measures are highlighted as follows.					
<p>Construction and Demolition Phases - Construction and Demolition Run-off and Drainage</p> <p>Exposed soil areas should be minimized to reduce the potential for increased siltation, contamination of run-off and erosion. Any effluent discharge from the Project site is subject to the control of Water Pollution Control Ordinance (WPCO) discharge license and should be treated to meet the discharge standard set out in the relevant license. In addition, no site run-off should enter the stream on the eastern side of the Project site. Run-off impacts associated with the construction and demolition activities can be readily controlled through the use of appropriate mitigation measures, which include:</p> <ul style="list-style-type: none"> <li>• Temporary ditches should be provided to facilitate run-off discharge into appropriate watercourses, via a silt retention pond</li> <li>• Boundaries of earthworks should be marked and surrounded by dykes</li> <li>• Open material storage stockpiles should be covered with tarpaulin or similar fabric to prevent material washing away</li> <li>• Exposed soil areas should be minimized to reduce the potential for increased siltation and contamination of run-off</li> <li>• Earthwork final surfaces should be well compacted and subsequent permanent work should be immediately performed</li> <li>• Use of sediment traps wherever necessary</li> </ul>	Project site / construction and demolition stages	Contractor	Construction and Demolition stage	ProPECC PN 1/94	√

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
<ul style="list-style-type: none"> <li>• Maintenance of drainage systems to prevent flooding and overflow</li> </ul>					
All temporary drainage pipes and culverts provided to facilitate run-off discharge should be adequately designed to facilitate rapid discharge of storm flows. All sediment traps should be regularly cleaned and maintained. The temporarily diverted drainage should be reinstated to its original condition, when the construction/demolition work is completed.					•
Sand and silt in wash water from wheel washing facilities should be settled out and removed from discharge into temporary drainage pipes or culverts. A section of the haul road between the wheel washing bay and the public road should be paved with backfall to prevent wash water or other site run-off from entering public road drains.					•
Oil interceptors should be provided in the drainage system downstream of any significant oil and grease sources. They should be regularly maintained to prevent the release of oil and grease into the storm water drainage system after accidental spillage. The interceptor should have a bypass to prevent flooding during periods of heavy rain, as specified in <i>ProPECC PN 1/94</i> .	Project site / construction and demolition stages	Contractor	Construction and Demolition stage	ProPECC PN 1/94	N/A
<p>Construction and Demolition Phases - General Construction and Demolition Activities</p> <p>All the solid waste and chemical waste generated on site should be collected, handled and disposed of properly to avoid affecting the water quality of the nearby WSRs. The proper waste management measures are detailed in S.7.7.5-S.7.7.6.</p>	Project site / construction and demolition stages	Contractor	Construction and Demolition stage	ProPECC PN 1/94	√
Construction and Demolition Phases - Sewage Generated from On-site Workforce	Project site / construction and	Contractor	Construction and Demolition stage	ProPECC PN 1/94	√

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
The sewage from construction work force is expected to be handled by portable chemical toilets if the existing toilets in the Project site are not adequate. Appropriate and adequate portable toilets should be provided by licensed contractors who will be responsible for appropriate disposal and maintenance of these facilities.	demolition stages				
Construction and Demolition Phases - Soil Remediation Activities Mitigation measures will need to be implemented during the currently identified soil remediation activities. If further land contamination investigation results (at CLP secondary substation during Phase I and at locations S1 to S6 during Phase II) confirm the needs for further soil remediation prior to demolition of the Existing Crematorium, relevant water quality mitigation measures (in addition to the current RAP) will need to be identified and implemented by the contractor. In addition, the mitigation measures recommended for minimizing water quality impacts for construction and demolition run-off and drainage as well as for general construction and demolition activities should also be adopted where applicable. In order to avoid impacts on water quality during further remedial works, care will be taken to minimise the mobilisation of sediment during excavation and transport. Measures to be adopted will be based on the recommendations set out in <i>Practice Note for Professional Persons ProPECC PN1/94 "Construction Site Drainage"</i> . The results of the site investigation suggest that there is unlikely to be any requirement for dewatering of	Project site / construction and demolition stages	Contractor	Construction and Demolition stage	ProPECC PN 1/94	√


Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
excavations, since groundwater was not encountered in any of the exploratory holes. The contractor carrying out the remedial works will be required to submit a method statement detailing the measures to be taken to avoid water quality impacts. Typical measures would include: Carry out the works during the dry season (i.e. October to March) if possible Use bunds or perimeter drains to prevent run-off water entering excavations Sheet or otherwise cover excavations whenever rainstorms are expected to occur Minimise the requirements for stockpiling of material and ensure any stockpiles are covered Temporary on-site stockpiling of contaminated materials should be avoided, all excavated contaminated soils/materials should be disposed of on a daily basis Ensure that any discharges to storm drains pass through an appropriate silt trap					

- Note:
- √ Compliance of mitigation measure
  - x Non-compliance of mitigation measures
  - Non-compliance but rectified by the contractor
  - N/A Not applicable

---

**APPENDIX K  
EVENT AND ACTION PLANS**

---

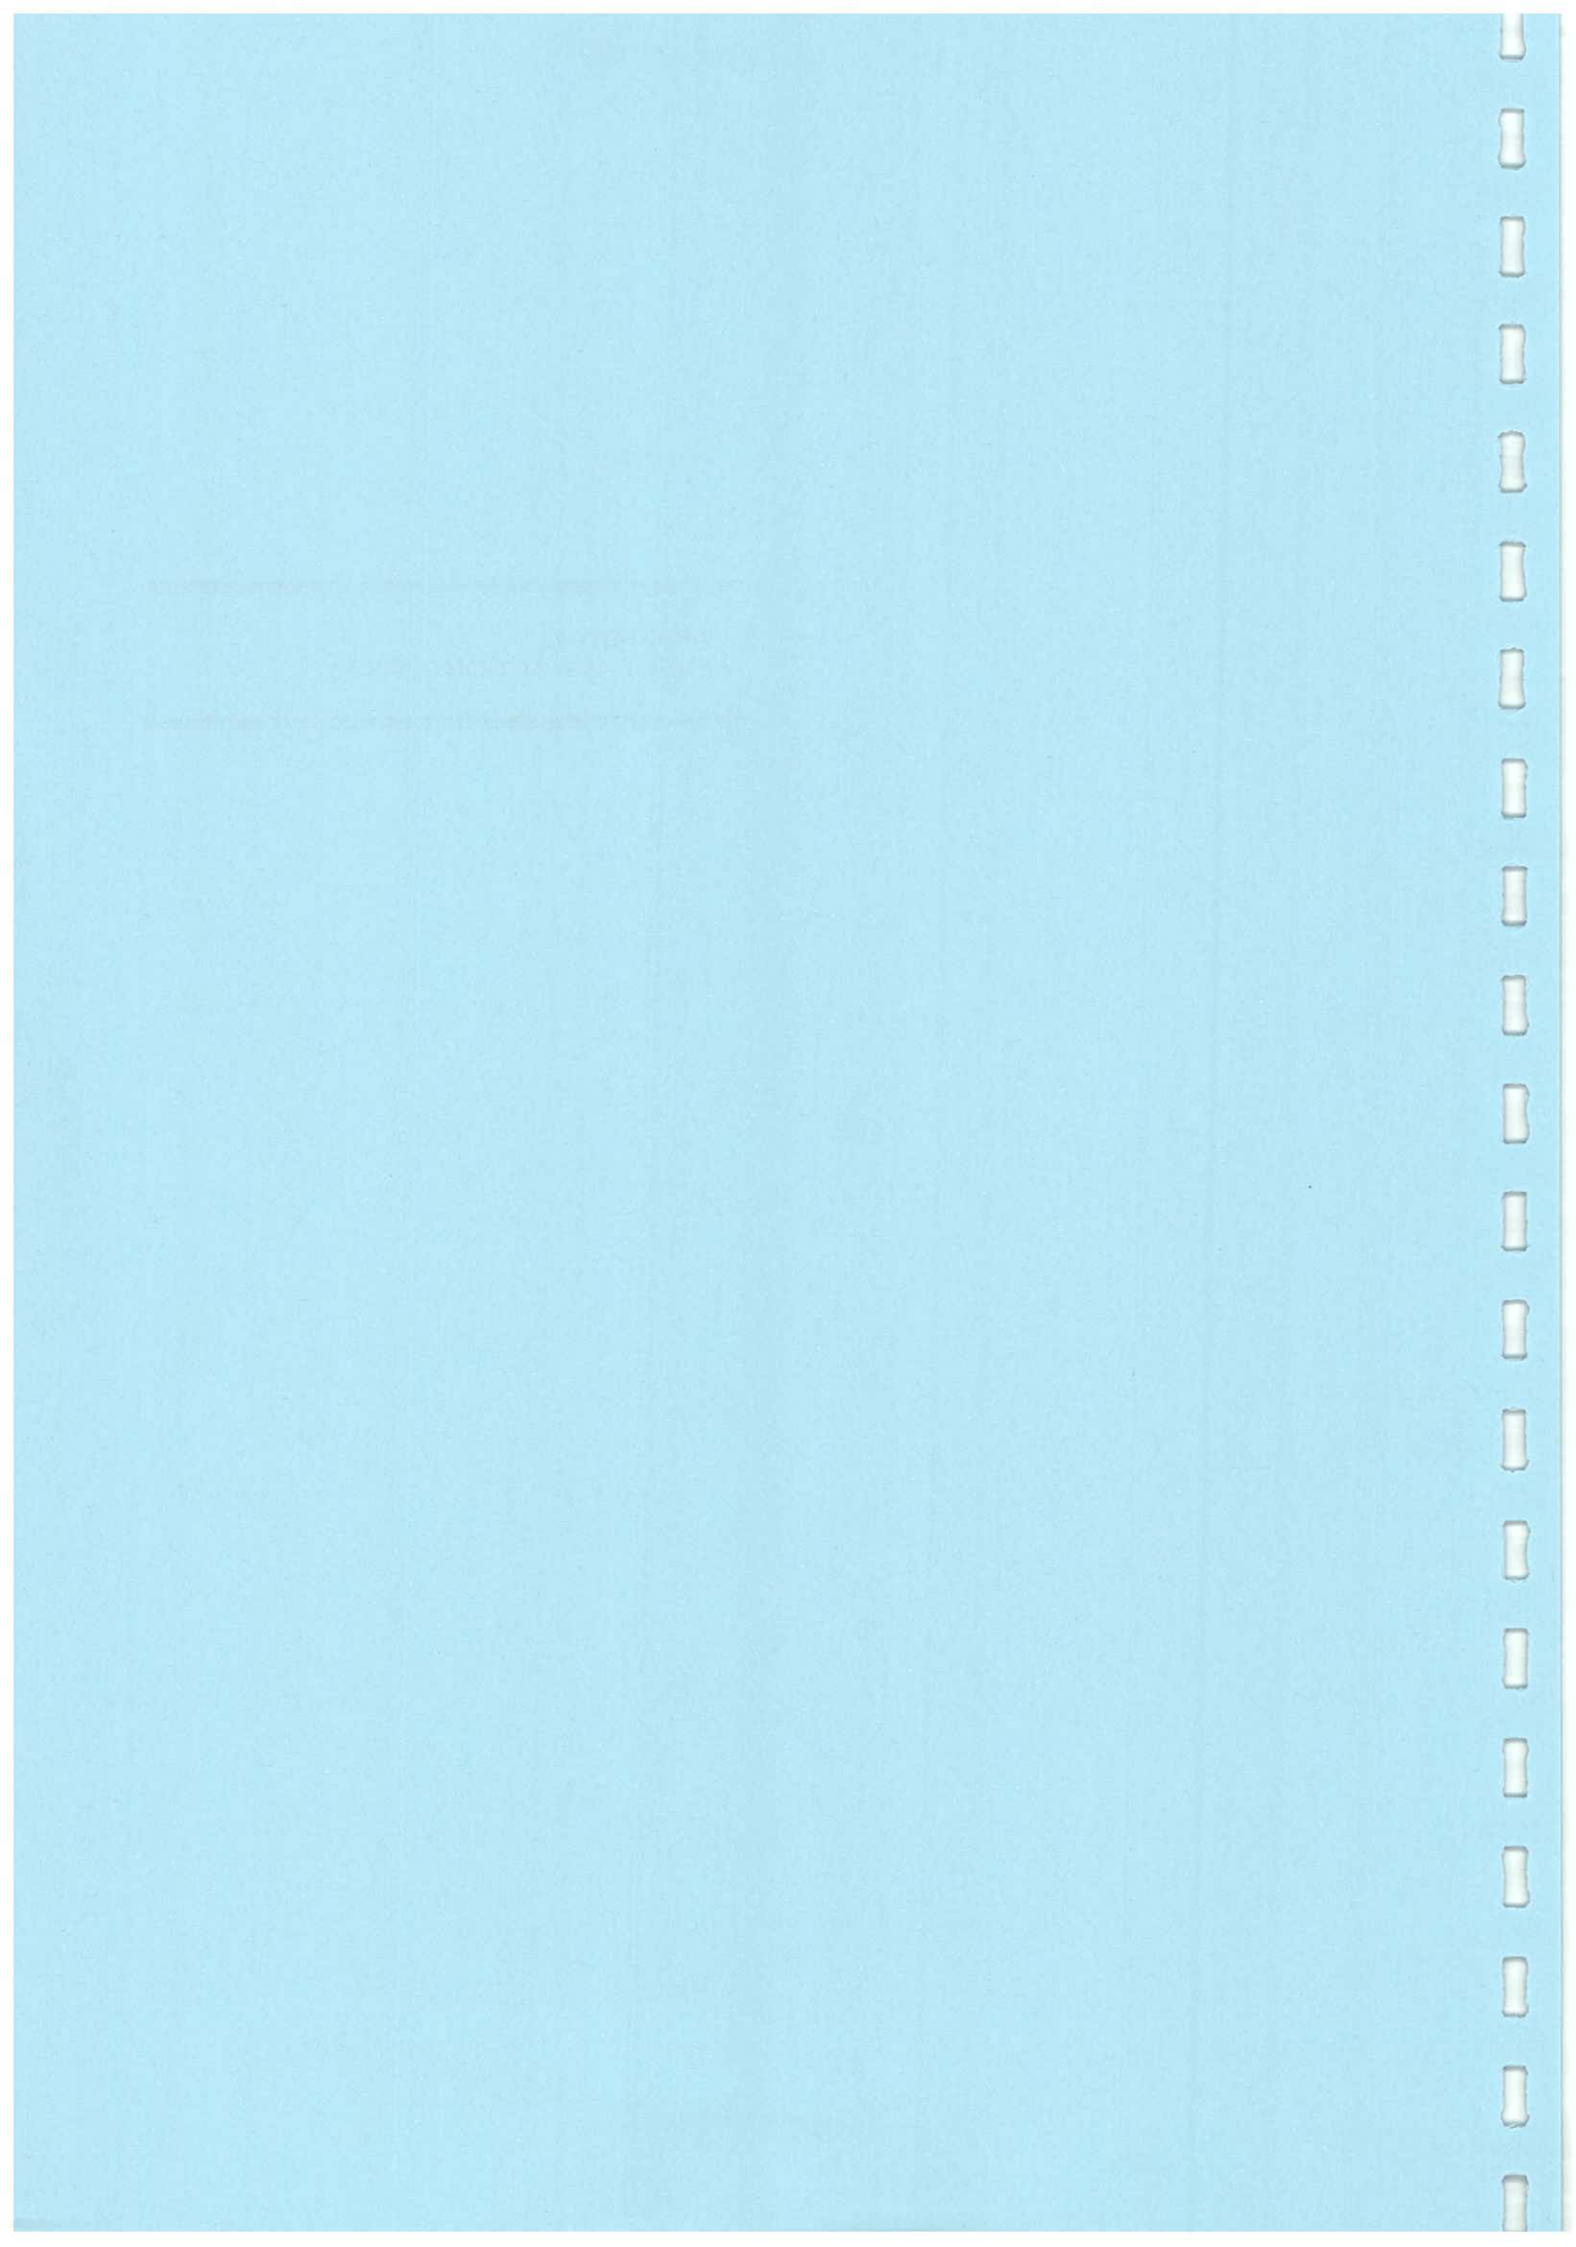



## Appendix K Event and Action Plans

Table K.1 Event and Action Plan for Air Quality

EVENT		ACTION			CONTRACTOR
		ET	IEC	AR	
<b>ACTION LEVEL</b>					
1. Exceedance for one sample	<ol style="list-style-type: none"> <li>Identify source, investigate the cause of exceedance and propose remedial measures; Inform IEC and AR;</li> <li>Repeat measurement to confirm finding;</li> <li>Increase monitoring frequency to daily, if ET assessment indicates that exceedance is due to contractor's construction works.</li> </ol>	<ol style="list-style-type: none"> <li>Check monitoring data submitted by ET;</li> <li>Check Contractor's working method.</li> </ol>	<ol style="list-style-type: none"> <li>Notify Contractor.</li> </ol>	<ol style="list-style-type: none"> <li>Rectify any unacceptable practice;</li> <li>Amend working methods if appropriate.</li> </ol>	
2. Exceedance for two or more consecutive samples	<ol style="list-style-type: none"> <li>Identify source, investigate the cause of exceedance and propose remedial measures; Inform IEC and AR;</li> <li>Repeat measurements to confirm findings;</li> <li>Increase monitoring frequency to daily, if ET assessment indicates that exceedance is due to contractor's construction works;</li> <li>Discuss with IEC and Contractor on remedial actions required;</li> <li>If exceedance continues, arrange meeting with IEC and AR;</li> <li>If exceedance stops, cease additional monitoring.</li> </ol>	<ol style="list-style-type: none"> <li>Check monitoring data submitted by ET;</li> <li>Check Contractor's working method;</li> <li>Discuss with ET and Contractor on possible remedial measures;</li> <li>Advise the AR on the effectiveness of the proposed remedial measures;</li> <li>Supervise implementation of remedial measures.</li> </ol>	<ol style="list-style-type: none"> <li>Confirm receipt of notification of exceedance in writing;</li> <li>Notify Contractor;</li> <li>Ensure remedial measures properly implemented.</li> </ol>	<ol style="list-style-type: none"> <li>Submit proposals for remedial actions to IEC within three working days of notification;</li> <li>Implement the agreed proposals;</li> <li>Amend proposal if appropriate.</li> </ol>	
<b>LIMIT LEVEL</b>					
1. Exceedance for one sample	<ol style="list-style-type: none"> <li>Identify source, investigate the cause of exceedance and propose remedial measures; Inform IEC, AR and EPD;</li> <li>Repeat measurement to confirm finding;</li> <li>Increase monitoring frequency to daily, if ET assessment indicates that exceedance is due to contractor's construction works;</li> <li>Assess effectiveness of Contractor's remedial actions and keep IEC, AR and EPD informed of the results.</li> </ol>	<ol style="list-style-type: none"> <li>Check monitoring data submitted by ET;</li> <li>Check Contractor's working method;</li> <li>Discuss with ET and Contractor on possible remedial measures;</li> <li>Advise the AR on the effectiveness of the proposed remedial measures;</li> <li>Supervise implementation of remedial measures.</li> </ol>	<ol style="list-style-type: none"> <li>Confirm receipt of notification of exceedance in writing;</li> <li>Notify Contractor;</li> <li>Ensure remedial measures properly implemented.</li> </ol>	<ol style="list-style-type: none"> <li>Take immediate action to avoid further exceedance;</li> <li>Submit proposals for remedial actions to IEC within three working days of notification;</li> <li>Implement the agreed proposals;</li> <li>Amend proposal if appropriate.</li> </ol>	
2. Exceedance for two or more consecutive samples	<ol style="list-style-type: none"> <li>Notify Contractor, IEC, AR and EPD;</li> <li>Identify source, investigate the cause of exceedance and propose remedial measures;</li> <li>Repeat measurement to confirm findings;</li> <li>Increase monitoring frequency to daily, if ET assessment indicates that exceedance is due to contractor's construction works;</li> </ol>	<ol style="list-style-type: none"> <li>Discuss amongst AR, ET, and Contractor on the potential remedial actions;</li> <li>Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the AR accordingly;</li> </ol>	<ol style="list-style-type: none"> <li>Confirm receipt of notification of exceedance in writing;</li> <li>Notify Contractor;</li> <li>In consultation with the IEC, agree with the Contractor on the remedial</li> </ol>	<ol style="list-style-type: none"> <li>Take immediate action to avoid further exceedance;</li> <li>Submit proposals for remedial actions to IEC within three working days of notification;</li> </ol>	

ACTION				
EVENT	ET	IEC	AR	CONTRACTOR
	<p>assessment indicates that exceedance is due to contractor's construction works;</p> <p>5. Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented;</p> <p>6. Arrange meeting with IEC and AR to discuss the remedial actions to be taken;</p> <p>7. Assess effectiveness of Contractor's remedial actions and keep IEC, AR and EPD informed of the results;</p> <p>8. If exceedance stops, cease additional monitoring.</p>	<p>3. Supervise the implementation of remedial measures.</p>	<p>measures to be implemented;</p> <p>4. Ensure remedial measures properly implemented;</p> <p>5. If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated.</p>	<p>3. Implement the agreed proposals;</p> <p>4. Resubmit proposals if problem still not under control;</p> <p>5. Stop the relevant portion of works as determined by the AR until the exceedance is abated.</p>

Table K.2 Event and Action Plan for Construction Noise

EVENT	ACTION				CONTRACTOR
	ET	IEC	AR	AR	
Action Level	<ol style="list-style-type: none"> <li>1. Notify Contractor and IEC;</li> <li>2. Carry out investigation;</li> <li>3. Report the results of investigation to the IEC and Contractor;</li> <li>4. Discuss with the Contractor and formulate remedial measures;</li> <li>5. Increase monitoring frequency to check mitigation effectiveness, if ET assessment indicates that exceedance is due to contractor's construction work.</li> </ol>	<ol style="list-style-type: none"> <li>1. Review the analysed results submitted by the ET;</li> <li>2. Review the proposed remedial measures by the Contractor and advise the AR accordingly;</li> <li>3. Supervise the implementation of remedial measures.</li> </ol>	<ol style="list-style-type: none"> <li>1. Confirm receipt of notification of exceedance in writing;</li> <li>2. Notify Contractor;</li> <li>3. Require Contractor to propose remedial measures for the analysed noise problem;</li> <li>4. Ensure remedial measures are properly implemented.</li> </ol>	<ol style="list-style-type: none"> <li>1. Confirm receipt of notification of failure in writing;</li> <li>2. Notify Contractor;</li> <li>3. Require Contractor to propose remedial measures for the analysed noise problem;</li> <li>4. Ensure remedial measures properly implemented;</li> <li>5. If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated.</li> </ol>	<ol style="list-style-type: none"> <li>1. Submit noise mitigation proposals to IEC;</li> <li>2. Implement noise mitigation proposals.</li> </ol>
Limit Level	<ol style="list-style-type: none"> <li>1. Notify Contractor, IEC, AR and EPD;</li> <li>2. Identify source;</li> <li>3. Repeat measurement to confirm findings;</li> <li>4. Increase monitoring frequency, if ET assessment indicates that exceedance is due to contractor's construction work;</li> <li>5. Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented;</li> <li>6. Inform IEC, AR and EPD the causes and actions taken for the exceedances;</li> <li>7. Assess effectiveness of Contractor's remedial actions and keep IEC, AR and EPD informed of the results;</li> <li>8. If exceedance stops, cease additional monitoring.</li> </ol>	<ol style="list-style-type: none"> <li>1. Discuss amongst AR, ET, and Contractor on the potential remedial actions;</li> <li>2. Review Contractors remedial actions whenever necessary to assure their effectiveness and advise the AR accordingly;</li> <li>3. Supervise the implementation of remedial measures.</li> </ol>	<ol style="list-style-type: none"> <li>1. Confirm receipt of notification of failure in writing;</li> <li>2. Notify Contractor;</li> <li>3. Require Contractor to propose remedial measures for the analysed noise problem;</li> <li>4. Ensure remedial measures properly implemented;</li> <li>5. If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated.</li> </ol>	<ol style="list-style-type: none"> <li>1. Take immediate action to avoid further exceedance;</li> <li>2. Submit proposals for remedial actions to IEC within 3 working days of notification;</li> <li>3. Implement the agreed proposals;</li> <li>4. Resubmit proposals if problem still not under control;</li> <li>5. Stop the relevant portion of works as determined by the AR until the exceedance is abated.</li> </ol>	

