China Resources Construction Company Limited

Contract No. SS M333

Reprovisioning of Diamond Hill Crematorium

Monthly EM&A Report for October 2008

November 2008

	Name	Signature
Prepared & Checked:	Jackel Law	farled
Reviewed & Approved:	YTTang	agysti

Version: Revision 0 Date: 14 November 2008

The information contained in this report is, to the best of our knowledge, correct at the time of printing. The interpretation and recommendations in the report are based on our experience, using reasonable professional skill and judgment, and based upon the information that was available to us. These interpretations and recommendations are not necessarily relevant to any aspect outside the restricted requirements of our brief. This report has been prepared for the sole and specific use of our client and ENSR Asia (HK) Ltd. accepts no responsibility for its use by others.

This report is copyright and may not be reproduced in whole or in part without prior written permission.

ENSR Asia (HK) Ltd.

11/F, Grand Central Plaza, Tower 2, 138 Shatin Rural Committee Road, Shatin, NT, Hong Kong Tel: (852) 2893 1551 Fax: (852) 2891 0305 Email: ensrhk@ensr.aecom.com www.maunsell.aecom.com

TABLE OF CONTENTS

EXE	CUTIVE SUMMARY	
1.	INTRODUCTION	1
	Background	1
	Scope of Report	
	Project Organisation	
	Environmental Status in the Reporting Month	
	Summary of EM&A Requirements	
2.	AIR QUALITY	2
	Monitoring Requirements	2
	Monitoring Equipment	
	Monitoring Parameters, Frequency and Duration	
	Monitoring Locations	
	Monitoring Methodology	
	Results and Observations	4
3.	NOISE	5
	Monitoring Requirements	5
	Monitoring Equipment	
	Monitoring Parameters, Frequency and Duration	
	Monitoring Locations	
	Monitoring Methodology	
	Results and Observations	
4.	ENVIRONMENTAL SITE INSPECTION	7
	Site Inspections	7
	Review of Environmental Monitoring Procedures	
	Advice on Waste Management Status	7
	Status Environmental Licences and Permits	7
	Implementation Status of Environmental Mitigation Measures	7
	Summary of Exceedances of Environmental Quality Performance Limit	8
	Summary of Environmental Complaints, Notifications of Summons and Successful Prosecutions	8
5.	FUTURE KEY ISSUES	0
J.		
	Key Issues and Recommendations for Coming Month	
	Environmental Monitoring and Audit Schedule for the Coming Months	9
6.	CONCLUSIONS AND RECOMMENDATIONS	10
	Conclusions	10
	Recommendations	



List of Tables

Table 2.1	Air Quality Monitoring Equipment	2
Table 2.2	Air Quality Monitoring Parameters, Frequency and Duration	
Table 2.3	Locations of Air Quality Monitoring Stations	
Table 2.4	Summary of Impact 1-hour TSP Monitoring Results	
Table 2.5	Summary of Impact 24-hour TSP Monitoring Results	
Table 3.1	Noise Monitoring Equipment	
Table 3.2	Noise Monitoring Parameters, Frequency and Duration	
Table 3.3	Locations of Noise Monitoring Stations	
Table 3.4	Summary of Impact Noise Monitoring Results during 07:00 - 19:00 on Normal Weekdays	
Table 4.1	Summary of Waste Disposal in the Month	
Table 4.2	Summary Of Environmental Complaints And Prosecutions	

List of Figures

Figure 1.1	Project Organisation for Environmental Management
Figure 1.2	Layout of Work Site
Figure 2.1	Locations of Air Quality Monitoring Stations
Figure 3.1	Locations of Construction Noise Monitoring Stations
Figure 4.1	Complaint Flow Diagram

Key Contacts of Environmental Personnel

Appendices

Appendix A

Appendix B Appendix C Appendix D Appendix E Appendix F Appendix G Appendix H Appendix I Appendix J	Construction Programme Environmental Action and Limit Levels Environmental Monitoring and Audit Schedules Calibration Details Air Quality Monitoring Results and Graphical Presentation Noise Monitoring Results and Graphical Presentation Summary of Weekly Environmental Site Inspection Observations Status of Environmental Permits/Licences Implementation Schedule of Mitigation Measures
• •	
Appendix K	Event and Action Plans

EXECUTIVE SUMMARY

Introduction

ENSR Asia (HK) Limited (formerly Maunsell Environmental Management Consultants Limited) is the designated Environmental Team (ET) for "Reprovisioning of Diamond Hill Crematorium" (The Project). This is the forty-seventh monthly Environmental Monitoring and Audit (EM&A) report prepared by ENSR Asia (HK) Limited for the Project. The EM&A programme for the Project commenced on 29 October 2004. This report documents the findings of EM&A Works conducted in the month of October 2008 (1 to 31 October 2008).

As informed by the Contractor, construction activities in the reporting period were:

- Construction for Lily pond no.3 & 4, U/G services, soil backfilling;
- · Construction for EMSD store room.

A summary of monitoring and audit activities conducted in the reporting period is listed below:

1-hour TSP monitoring	18 sessions
24-hour TSP monitoring	5 sessions
Daytime noise monitoring	5 sessions
Environmental site inspection	4 sessions

Breaches of Action and Limit Levels

Air Quality

All 1-hour and 24-hour TSP monitoring results recorded in the month complied with the Action and Limit Levels.

Construction Noise

All noise monitoring results recorded in the month complied with the Action and Limit Levels.

Implementation Status of Environmental Mitigation Measures

In general, the Contractor satisfactorily implemented all the required mitigation measures and was reasonably responsive to the ET's recommendations on any discrepancy observed during the weekly environmental site inspection.

Environmental Complaints, Notification of Summons and Successful Prosecutions

No environmental complaint, notification of summons or successful prosecution was received or made against this Project in the month.

Reporting Changes

No reporting change was required in the month.

Future Key Issues

Key issues to be considered in the coming month include:

- Generation of dust from activities on-site;
- Noise impact from operating equipment and machinery on-site;
- Generation of site surface runoffs and wastewater from activities on-site;
- Storage and disposal of general refuse and construction waste from activities on-site;
- Management of chemicals and avoidance of oil spillage.

摘要

簡介

安社亞洲(香港)有限公司(前茂盛環境管理顧問有限公司)乃「重置鑽石山火葬場」[下稱(工程項目)] 的指定環境 小組。本冊是安社爲工程項目製作的第四十七份每月環境監察及審核報告。工程項目的環境監察及審核由二零 零四年十月廿九日開始、本報告記錄了二零零八年十月份(二零零八年十月一日至十月三十一日)所進行的環境 監察及審核工作。

根據承建商的資料,本月有以下的建築活動:

- 3 號及 4 號蓮花池建設、地下工程、回填泥土
- 機電工程署貯存室建設

本月有下列幾項的監察及審核活動:

一小時總懸浮粒子監察

18次

计四小時總懸浮粒子監察

5次

日間噪音監察

5次

環境巡查

4次

違反監察標準

空氣質素

本月所有一小時與廿四小時總懸浮粒子監測結果皆符合行動水平和極限水平。

建築噪音

本月所有噪音監測結果皆符合行動水平和極限水平。

環境影響緩和措施

承建商大致上完成所需的緩和措施,同時已對環境小組在每週的環境巡查中的建議作出合理的回應及跟進。

有關環境的投訴,傳票及檢控

本月沒有收到有關環境的投訴,傳票及檢控。

報告修訂

本月並沒有修訂報告。

預計要注意的事項

下月要注意事項包括:

- 工程活動所產生的塵埃
- 操作中儀器及機器產生的噪音影響
- 工程活動所產生的污水
- 普通廢物與建築廢物的暫貯及棄置
- 化學品的管理及防止意外漏油

1. INTRODUCTION

Background

1.1 ENSR Asia (HK) Limited (formerly Maunsell Environmental Management Consultants Limited) (hereinafter called the "ET") was appointed by China Resources Construction Company Limited (CRC) (hereinafter called the "Contractor") to undertake Environmental Monitoring and Audit for "Reprovisioning of Diamond Hill Crematorium" (hereinafter called the "Project"). Under the requirements of Section 7 of Environmental Permit EP-179/2004/C, EM&A programme as set out in the approved EM&A Manual is required to be implemented. In accordance with the approved EM&A Manual, environmental monitoring of air quality and noise and environmental site inspections are required for the Project.

Scope of Report

1.2 The EM&A programme for the Project commenced on 29 October 2004. This report presents a summary of the environmental monitoring and audit works, list of activities, and mitigation measures for the Project in October 2008 (from 1 to 31 October 2008).

Project Organisation

1.3 The organisation of the environmental management team is shown in Figure 1.1. Key personnel contacts are presented in Appendix A.

Environmental Status in the Reporting Month

- 1.4 The construction programme of the Project is provided in Appendix B. In the month, the following activities took place for the construction of the Project:
 - Construction for Lily Pond no.3 & 4, U/G services, soil backfilling;
 - Construction for EMSD store room.
- 1.5 Layout plan of the Project work site is provided in Figure 1.2.

Summary of EM&A Requirements

- 1.6 The description and detailed locations of sensitive receivers and monitoring stations for air quality and noise are shown in Figures 2.1 and 3.1 respectively and relevant sections of this Report.
- 1.7 The EM&A programme requires environmental monitoring for air quality and noise and environmental site inspections for air quality, noise, water quality, landscape and visual, and waste management. The EM&A requirements for each parameter described in the following sections include:
 - · All monitoring parameters
 - · Action and Limit Levels for all environmental parameters
 - Event and Action Plans
 - Environmental mitigation measures, as recommended in the project final EIA report
 - Environmental requirements in contract documents.
- 1.8 The advice on the implementation status of environmental protection and pollution control/mitigation measures is summarised in Appendix J of the Report.

2. AIR QUALITY

Monitoring Requirements

- 2.1 1-hour TSP and 24-hour TSP levels at two designated monitoring stations were monitored in the month in accordance with the EM&A Manual. Appendix C shows the established Action and Limit Levels for the environmental monitoring works.
- 2.2 The monitoring schedule for the month is shown in Appendix D. Air quality monitoring stations for 24-hour TSP and 1-hour TSP measurements are shown in Figure 2.1.

Monitoring Equipment

2.3 Portable dust meter was used to carry out 1-hour TSP monitoring. High volume sampler (HVS - Model GMWS-2310 Accu-Vol) completed with the appropriate sampling inlets was installed for 24-hour TSP sampling. The HVS meet all the requirements as specified in the approved EM&A Manual. Table 2.1 summarises the equipment that was used in the dust-monitoring programme.

Table 2.1 Air Quality Monitoring Equipment

Equipment	Model
Dust Meter (for 1-hour TSP measurement	Laser Dust Monitor - Model LD-3
HVS (for 24-hour TSP measurement)	GMWS 2310 Accy-Vol system
Calibration Kit (for HVS)	TISCH

Monitoring Parameters, Frequency and Duration

2.4 Table 2.2 summarises the monitoring parameters, frequency and duration of the impact air quality monitoring.

Table 2.2 Air Quality Monitoring Parameters, Frequency and Duration

Parameter	Duration	Frequency
1-hour TSP	1 hour	3 times every six days
24-hour TSP	24 hours	Once every six days

Monitoring Locations

2.5 In accordance with the EM&A Manual, two air quality monitoring stations, as shown in Figure 2.1 were selected for 24-hour TSP and 1-hour TSP sampling. Table 2.3 describes the location of the air quality monitoring stations.

Table 2.3 Locations of Air Quality Monitoring Stations

Monitoring Station	Identity / Description	Level	
ASR8	Po Leung Kuk Grandmont Primary School	Roof top level of 7-storey building	
ASR17	Staff Quarter for Diamond Hill Crematorium	Roof top level of 1-storey building	

Monitoring Methodology

1-hour TSP Monitoring

Monitoring Procedure

2.6 The measuring procedures of 1-hour TSP by a portable dust meter are in accordance with the Manufacturer's Instruction Manual as follows:

- Set POWER to "ON", push BATTERY button, make sure that the meter's indicator is in the range with a red line and allow the instrument to stand for about 3 minutes (Then, the air sampling inlet has been capped).
- Push the knob at MEASURE position.
- Push "O-ADJ" button. (Then meter's indication is 0).
- Push the knob at SENSI ADJ position and set the meter's indication to S value described on the Test Report using the trimmer for SENSI ADJ.
- Pull out the knob and return it to MEASURE position.
- Push "START" button.

Maintenance and Calibration

- The 1-hour TSP dust meters are verified at 1-year intervals throughout all stages of the impact air quality monitoring.
- Calibration details for the dust meters are provided in Appendix E.

24-hour TSP Monitoring

Installation

- 2.7 The HVSs were installed in the vicinity of the air sensitive receivers. The following criteria were considered in the installation of the HVSs:
 - A horizontal platform with appropriate support to secure the samplers against gusty wind was provided.
 - The distance between the HVS and any obstacles, such as buildings, was at least twice the height that the obstacle protrudes above the HVS.
 - A minimum of 2 meters separation from walls, parapets and penthouses was provided for rooftop sampler.
 - No furnace or incinerator flues were nearby.
 - Airflow around the sampler was unrestricted.
 - Permission was obtained to set up the sampler and to obtain access to the monitoring stations.
 - A secure supply of electricity was obtained to operate the sampler.

Preparation of Filter papers

- Glass fibre filters, G810 were labelled and sufficient filters that were clean and without pinholes were selected.
- All filters were equilibrated in the conditioning environment for 24 hours before weighing. The
 conditioning environment temperature was around 25 °C and not variable by more than ±3 °C;
 the relative humidity (RH) was < 50% and not variable by more than ±5%. A convenient working
 RH was 40%.
- ALS Technichem (HK) Pty Ltd. is a HOKLAS accredited laboratory which has comprehensive quality assurance and quality control programmes.

Monitoring Procedures

- The power supply was checked to ensure the HVSs work properly.
- The filter holder and the area surrounding the filter were cleaned.
- The filter holder was removed by loosening the four bolts and a new filter, with stamped number upward, on a supporting screen was aligned carefully.
- The filter was properly aligned on the screen so that the gasket formed an airtight seal on the outer edges of the filter.
- The swing bolts were fastened to hold the filter holder down to the frame. The pressure applied should be sufficient to avoid air leakage at the edges.
- Then the shelter lid was closed and secured with the aluminum strip.
- The HVSs were warmed-up for about 5 minutes to establish run-temperature conditions.
- A new flowrate record sheet was set into the flow recorder.

- The flow rate of the HVS was checked and adjusted at around 1.1 m³/min. The range was between 0.6-1.7 m³/min.
- The programmable timer was set for a sampling period of 24 hrs \pm 1 hr, and the starting time, weather condition and the filter number were recorded.
- The initial elapsed time was recorded.
- At the end of sampling, the sampled filter was removed carefully and folded in half length so that only surfaces with collected particulate matter were in contact.
- It was then be placed in a clean plastic envelope and sealed.
- All monitoring information was recorded on a standard data sheet.
- Filters were sent to ALS Technichem (HK) Pty Ltd. for analysis.

Maintenance and Calibration

- The HVSs and their accessories were maintained in good working condition, such as replacing motor brushes routinely and checking electrical wiring to ensure a continuous power supply.
- HVSs are calibrated at bi-monthly intervals using GMW-25 Calibration Kit throughout all stages
 of the impact air quality monitoring.
- Calibration details for the HVSs are provided in Appendix E.

Results and Observations

2.8 Dust monitoring was conducted for both 1-hour TSP and 24-hour TSP at all designated monitoring stations in the month. Air quality monitoring results and graphical presentations are provided in Appendix F.

1-hour TSP Monitoring

2.9 All measured 1-hour TSP levels complied with the Action and Limit Levels in the month. A summary of 1-hour TSP monitoring results is presented in Table 2.4.

Table 2.4 Summary of Impact 1-hour TSP Monitoring Results

Monitoring Station	1-hour TSP (μg/m³)	Action Level	Limit Level		o. of edance
	Range	(μ g/m ³)	(µg/m³)	Action	Limit
ASR8	70.2 – 87.3	408.1	500	Nil	Nil
ASR17	61.2 – 89.5	408.4	500	Nil	Nil

24-hour TSP Monitoring

2.10 All measured 24-hour TSP levels complied with the Action and Limit Levels in the month. A summary of 24-hour TSP monitoring results is presented in Table 2.5.

Table 2.5 Summary of Impact 24-hour TSP Monitoring Results

Monitoring Station	24-hour TSP (μg/m³)	Action Level	Limit Level		. of dance
	Range	(μg/m³)	(µg/m³)	Action	Limit
ASR8	25.3 - 81.6	195.0	260	Nil	Nil
ASR17	14.9 – 88.1	174.1	260	Nil	Nil

NOISE

Monitoring Requirements

- 3.1 Noise levels at three designated monitoring stations were monitored in the month in accordance with the EM&A Manual. Appendix C shows the established Action and Limit Levels for the environmental monitoring works.
- 3.2 The monitoring schedule for the month is shown in Appendix D. Noise monitoring stations are shown in Figure 3.1.

Monitoring Equipment

3.3 Integrating Sound Level Meter was employed for noise monitoring. They were Type 1 sound level meters capable of giving a continuous readout of the noise level readings including equivalent continuous sound pressure level (L_{eq}) and percentile sound pressure level (L_x). They comply with International Electrotechnical Commission Publications 651:1979 (Type 1) and 804:1985 (Type 1). Portable electronic wind speed indicator capable of measuring wind speed in m/s was employed to check the wind speed. Table 3.1 details the noise monitoring equipment used.

Table 3.1 Noise Monitoring Equipment

Equipment	Model
Integrating Sound Level Meter	Rion NL-31
Calibrator	Rion NC-73

Monitoring Parameters, Frequency and Duration

3.4 Table 3.2 summarises the monitoring parameters, period, frequency and duration of the impact noise monitoring.

Table 3.2 Noise Monitoring Parameters, Frequency and Duration

Time Period	Parameters	Duration (min)	Frequency
Daytime (0700 to 1900 on normal weekdays)	L _{eq}	30	Once per week

Monitoring Locations

In accordance with the EM&A Manual, three noise monitoring stations, as shown in Figure 3.1 were selected for noise monitoring. Table 3.3 describes the location of these monitoring stations.

Table 3.3 Locations of Noise Monitoring Stations

Monitoring Station	Identity / Description	Level
SR3	International Christian Quality Music Secondary and Primary School	Roof top level of 7- storey building
SR4	Po Leung Kuk Grandmont Primary School	Roof top level of 7- storey building
SR6	Staff Quarter for Diamond Hill Crematorium	Roof top level of 1- storey building

Monitoring Methodology

Monitoring Procedures

- The Sound Level Meter was set on a tripod at a height of 1.2 m above the ground.
- Façade measurements were made at all three monitoring locations.

- The battery condition was checked to ensure the correct functioning of the meter.
- Parameters such as frequency weighting, the time weighting and the measurement time were set as follows:
 - frequency weighting: A
 - time weighting: Fast
 - time measurement: L_{eq}(30 minutes) during non-restricted hours i.e. between 07:00 and 19:00 on normal weekdays
- Prior to and after each noise measurement, the meter was calibrated using a Calibrator for 94 dB at 1000 Hz. If the difference in the calibration level before and after measurement was more than 1.0 dB(A), the measurement would be considered invalid and repeat of noise measurement would be required after re-calibration or repair of the equipment.
- The wind speed was frequently checked with a portable wind meter.
- During the monitoring period, the L_{eq}, L₁₀ and L₉₀ were recorded. In addition, site conditions and noise sources were recorded on a standard record sheet.
- Noise measurement was paused during periods of high intrusive noise (e.g. dog barking, helicopter noise) if possible. Observations were recorded when intrusive noise was unavoidable.
- Noise monitoring was cancelled in the presence of fog, rain, wind with a steady speed exceeding 5 m/s, or wind with gusts exceeding 10 m/s.

Maintenance and Calibration

- The microphone head of the sound level meter and calibrator is cleaned with soft cloth at quarterly intervals.
- The meter and calibrator are sent to the supplier or HOKLAS laboratory to check and calibrate at yearly intervals.
- Calibration details for the sound level meter and calibrator are provided in Appendix E.

Results and Observations

- 3.6 Noise monitoring was conducted at all designated monitoring stations as scheduled in the month. Noise monitoring results and graphical presentations are provided in Appendix G.
- 3.7 All measured noise levels complied with the Action and Limit Levels in the month. A summary of noise monitoring results is presented in Table 3.4.

Table 3.4 Summary of Impact Noise Monitoring Results during 07:00 – 19:00 on Normal Weekdays

Monitoring Station	Measured Noise Level, dB(A) L _{eg (30 min)}	Calculated Construction Noise Level, dB(A)	Limit Level	No. Exceed	
	Average and Range	Average and Range		Action*	Limit
SR3	67 (67 – 69)	(* - *)	70/65***	Nil	Nil
SR4	66 (65 – 68)	(# - #)	70/65##	Nil	Nil
SR6	60 (59 – 62)	(" - ")	75	Nil	Nil

^{* -} Action Level is triggered by receipt of a noise complaint

^{# -} Measured noise level is less than the baseline noise level

^{**-} reduce to 70dB(A) for schools and 65dB(A) during school examination periods

4. ENVIRONMENTAL SITE INSPECTION

Site Inspections

Site inspection was carried out on a weekly basis to monitor the timely implementation of proper environmental pollution control and mitigation measures for the Project. In the month, four site inspections were carried out. The summary of weekly environmental site inspection observations and environmental site inspection checklists are attached in Appendix H.

Review of Environmental Monitoring Procedures

The monitoring works conducted by the Environmental Team were inspected regularly. Observations have been recorded for the monitoring works as follows:

Air Quality Monitoring

- The monitoring team recorded the observations around the monitoring stations within and outside of the construction site.
- The monitoring team recorded the temperature and general weather condition on the monitoring day.

Noise Monitoring

- The monitoring team recorded the observations around the monitoring stations, which might affect the results.
- Major noise sources were identified and recorded.

Advice on Waste Management Status

According to the information provided by the Contractor, actual quantities of inert C&D materials and non-inert C&D wastes generated by activities of the Project in the month are provided in Table 4.1. Trip ticket system was implemented for all offsite waste disposal.

Table 4.1 Summary of Waste Disposal in the Month

Type of Waste Material		Disposed Quantity	Destination
Inert C&D mater	ials	117.54 m ³	Kai Tak Public Fill Barging Point
Non-inert C&D	Metals	Nil	Not Applicable
waste	Paper/cardboard packaging	Nil	Not Applicable
	Plastics	Nil	Not Applicable
	Chemical waste	Nil	Not Applicable
	Wood	Nil	Recycler
	Others, e.g. general refuse	27.38 m ³	SENT Landfill

Status Environmental Licences and Permits

The status of all permits/licences obtained/in-use in the month is summarised in Appendix I.

Implementation Status of Environmental Mitigation Measures

An updated summary of the Environmental Mitigation Implementation Schedule (EMIS) is presented in Appendix J.

During the weekly site inspection conducted by the Environmental Team in the month, the following observations and recommendations were made.

Water Quality

• Stagnant waters were accumulated in several site areas. The Contractor was reminded to clean up the stagnant water more frequently to prevent accumulation.

Air Quality

- No proper dust mitigation was provided for excavated materials. The Contractor was reminded to spray the excavated materials with water during handling.
- Stockpile of sands were placed near Hall 4 without proper dust mitigation measure. The Contractor was reminded to provide proper duct mitigation measure for all stockpiles.
- Opened cement bags were placed on site without proper dust mitigation measure. The Contractor was reminded to cover the cement bags after use.

Noise

 No particular observations and recommendations were made during the weekly site inspections in the month.

Waste or Chemical Management

• Unsorted C&D wastes were accumulated in the site areas. The Contractor was reminded to sort the C&D wastes properly and remove the C&D wastes regularly.

Landscape and Visual

 No particular observations and recommendations were made during the weekly site inspections in the month.

Others

 No particular observations and recommendations were made during the weekly site inspections in the month.

Summary of Exceedances of Environmental Quality Performance Limit

The Event and Action Plans for air quality and noise are presented in Appendix K.

No exceedance of Action and Limit Levels for 1-hour and 24-hour TSP and noise was recorded in the month.

Summary of Environmental Complaints, Notifications of Summons and Successful Prosecutions

Figure 4.1 presents the environmental complaint flow diagram of the Project and Table 4.2 presents the statistics of complaints, notification of summons and successful prosecution since the commencement of the Project.

Table 4.2 Summary of Environmental Complaints and Prosecutions

Complain	ts logged	Summor	is served	Successful	Prosecution
Oct 2008	Cumulative	Oct 2008	Cumulative	Oct 2008	Cumulative
0	1	0	0	0	0

No environmental complaint, notification of summons and prosecution was received or made against the Project in the month.

5. FUTURE KEY ISSUES

Key Issues and Recommendations for Coming Month

Key issues to be considered in the coming month include:

- Generation of dust from activities on-site;
- Noise impact from operating equipment and machinery on-site;
- Generation of site surface runoffs and wastewater from activities on-site;
- · Storage and disposal of general refuse and construction waste from activities on-site; and
- Management of chemicals and avoidance of oil spillage.

Recommendations for the coming month include:

- Stagnant water should be avoided through proper design and maintenance of drainage system;
- Drip trays should be maintained properly;
- Provide water spray to haul roads and unpaved areas;
- · Provide regular maintenance to wheel wash facilities on-site;
- Cover the stockpiles on-site entirely;
- Store all chemicals on site in the chemical storage area;
- · Ensure general refuse are sorted, recycled and disposed properly; and
- Ensure construction wastes are disposed off-site properly and regularly.

Environmental Monitoring and Audit Schedule for the Coming Months

The tentative schedules for environmental monitoring and audit for the next three months are provided in Appendix D.

6. CONCLUSIONS AND RECOMMENDATIONS

Conclusions

Environmental monitoring and audit was performed in October 2008. All monitoring and audit results in the month were checked and reviewed.

All 1-hour and 24-hour TSP monitoring results recorded in the month complied with the Action and Limit Levels.


All noise monitoring results recorded in the month complied with the Action and Limit Levels.

In general, the Contractor satisfactorily implemented all the required mitigation measure and was reasonably responsive to the ET's recommendations on any discrepancy observed during the weekly environmental site inspection.

No environmental complaint, notification summons or successful prosecution was received or made against this Project in the month.

Recommendations

According to results of weekly environmental site inspections performed in the month and the construction programme for the coming month, recommendations for air quality, construction noise, water quality and waste and chemical management are detailed in Sections 5.1 and 5.2.

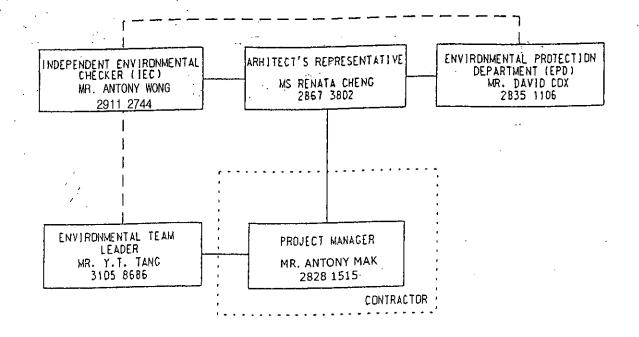


LEGEND:

----- DIRECT COMMUNICATION

- - LIAISON


		CONTRACT NO: SS NG33 - REPROVISIONING DF DIAMOND HILL CREMATORIUM	SCALE	N.T.S.	DATE	200	8
ENICD	15001		DIE DE	PTPM	PRAWN	լլտ	
ENSK	AECOM	PROJECT ORGANIZATION FOR ENVIRONMENTAL MANAGEMENT	JOB HD.	60016796	DRAWING	1.1	AEY -

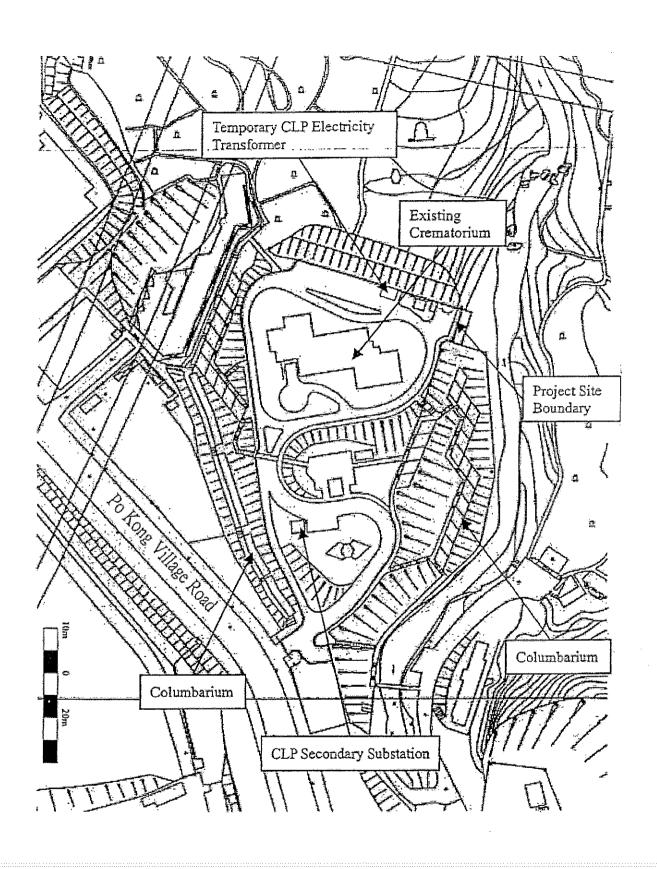



	**************************************		4, 7 7	Marine
	CONTRACT NO: SS N333 - REPROVISIONING OF OR	SCALE	N.T.S.	M D∓∈
FNCD	ರಾಜಕಾಗಿದ್ದ ೧೯೯೭ ಕಿಲ್ಲಾಣಕು ಮಾರ್ತಿಯ	CHECK	FSYY	Der &
ENSR AECOM	LAYOUT OF WORK SITE	JGB No.	S07904	Office
3		1	. 3 (7) ~ () 3 ~ (

2005 LLMC

1.2

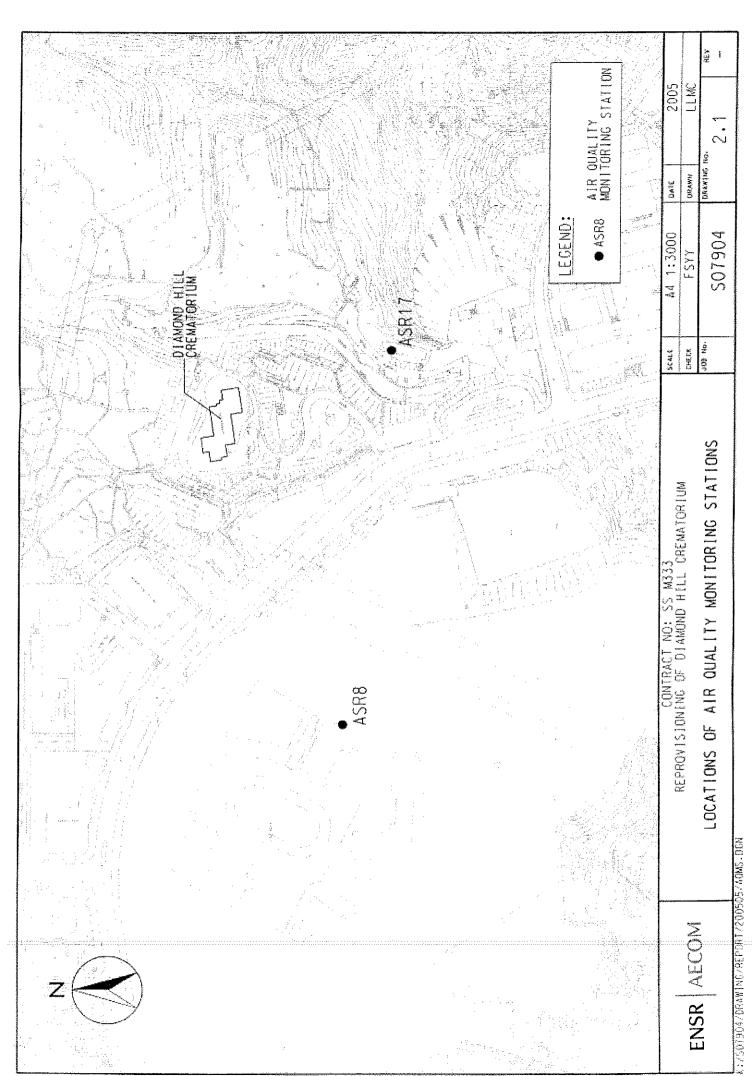

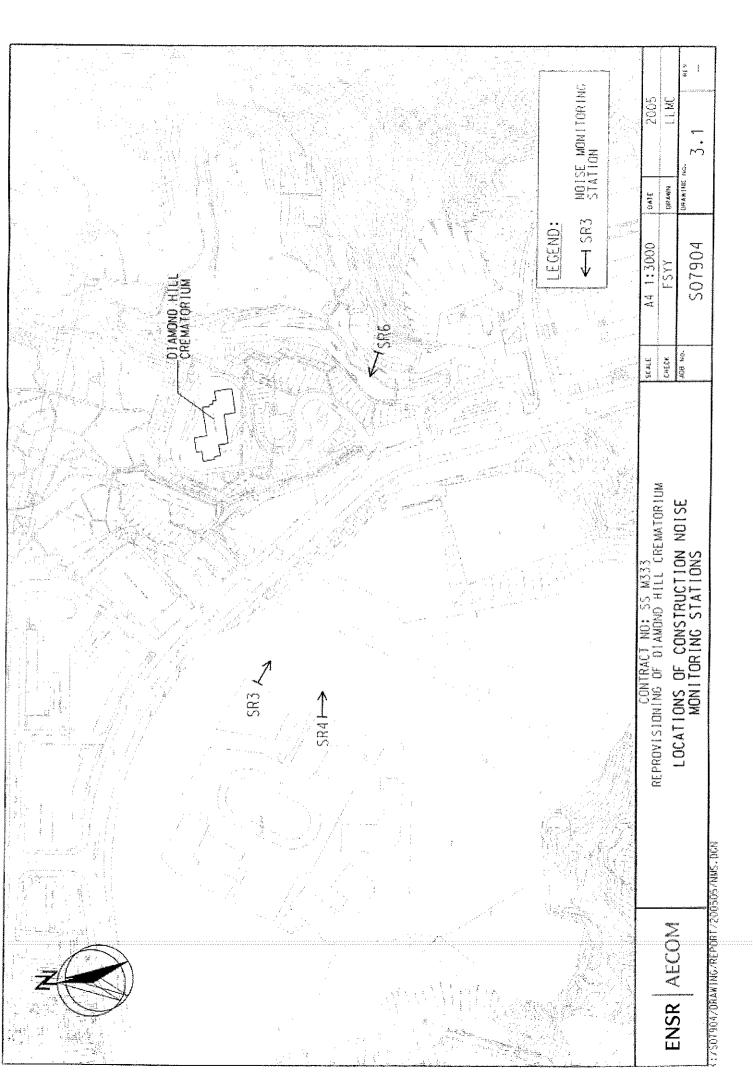

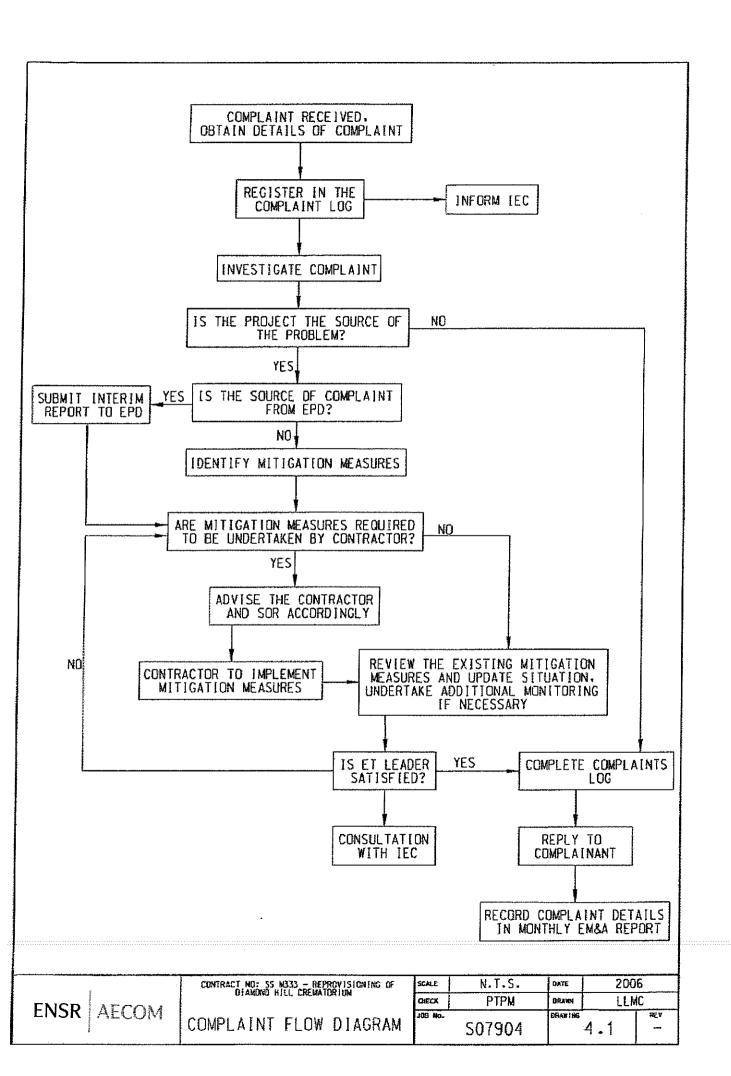

Appendix A Key Contacts of Environmental Personnel


Party	Name	Telephone No.	Fax No.
Environmental Protection D	epartment		
SEPO	Mr. David Cox	2835 1106	2591 0558
EPO	Ms. Marlene Ho	2835 1186	2591 0558
EPO (ECD)	Mr. Charles Wu	2117 7540	2756 8588
Architect			
Architectural Services Departr	ment		
Project Architect	Ms. Renata Cheng	2867 3802	2524 8194
Independent Environmental	Checker		
Hyder Consulting Limited			
IEC	Mr. Antony Wong	2911 2744	2805 5028
Assistant to IEC	Ms. Winnie Ma	2911 2912	2805 5028
Contractor			
China Resources Construction	n Company Limited		
Project Manager	Mr. Antony Mak	2828 1515	2827 2921
Environmental Team			
ENSR Asia (HK) Limited (form	nerly Maunsell Environr	nental Management	Consultants Ltd)
ET Leader	Mr. Y.T. Tang	3105 8686	2891 0305
Audit Team Leader	Mr. Jackel Law	3105 8686	2891 0305
Monitoring Team Leader	Mr. Fung Yiu Wah	3105 8544	2891 0305

15 15 15 15 15 15 15 15	1001年7半月 14月 17月 17月 14日 20日 6次河(20日本)
E. Section of control of Contro	的自然的现在分词,但是一个一个一个一个一个一个一个一个一个一个一个一个一个一个一个一个一个一个一个
Expension of Section Continued by 19 19 19 19 19 19 19 1	
E. Yamazinon'd Sakipal	
Execution of the content and accordance 12 days 12	
No.	
Equation of Utility and State of States 11 days 14 days 15	
Existing building plets ACM residency 39 days 13 days 21 days 21 days 21 days 21 days 22 days 22 days 23 days 24 days 23 d	
Exhibite building plots ACM pertion) and BVA read(zone B) 78 days 1 Aquil 1007 19 May 2007 10 days 20 decellar and the set the heuse utilities at zone AAC , 11 days 11 days 11 Aquil 2007 19 May 2007 10 days 20 day	•
	•
1	•
	· • -
Authorized to Active the Active to	· · · · · · · · · · · · · · · · · · ·
Company Recent respectively Company Recent response of the respect of Texas Recommend Recent response of the respect of Texas Recommend Recompany Recomp	
Sample analysis prepare and submit test report and contaminated material lovestiguides reports call submit test report and contaminated material lovestiguides reports call submit test report and contaminated material lovestiguides The state of submitted and report and contaminated material lovestiguides The state of submitted and report and contaminated material lovestiguides Contamination of report (28 Calender days) Collect (6 nos of submitted of submitted and report of submitted and submitted a	
report (CA(HF) to EPD Lyse tryon value in the types and continuated material tryonic (CA(HF) to EPD Target reproved date by EPD Cullect 6 toos of substrations soil samples outside main boilding Target reproved date by EPD Cullect 6 toos of substrations soil samples outside main boilding Sharps 17 days 18 April 2001 Sharps 2001 Sharps 2007 Target transvel and confirmed by ellent removed the sunk field investigation and soil somuch collecting removed the sunk field investigation and soil somuch collecting removed the sunk field investigation and soil somuch collecting removed the sunk field investigation and soil somuch collecting removed the sunk field investigation and soil somuch collecting sharps 2007 Sharps 2007 Sharps 2007 Target 2007	
EPO endersorment of report (78 Calendar days) 12 days 13 days 14 May 1007 15 days 18 April 2007 29 days 19 Fine 2007 29 days 19 April 2007 29 days 29 fine 2007 29 days 29 fine 2007 29 days 29 fine 2007 29 days 20 days 20 days 21 days 21 days 22 days 23 days 24 days 24 days 25 days 26 days 27 days 27 days 28 days 29 fine 2007 20 days 21 days 21 days 22 days 23 days 24 days 24 days 25 days 26 days 27 days 27 days 27 days 28 days 29 fine 2007 20 days 21 days 21 days 21 days 21 days 22 days 23 days 24 days 24 days 25 days 26 days 27 days 27 days 28 days 28 days 29 days 29 days 29 days 29 days 20 days 20 days 20 days 21 days 21 days 21 days 22 days 23 days 24 days 24 days 25 days 26 days 27 days 28 days	٠
EPO endercounces of report (18 Calendor days) Target typerord date by EPO cultect 6 nos of substrations soil tempics outside main bailiday cultect 6 nos of substrations soil tempics outside main bailiday substration date substration date substration date Sunboo scalibiding traction white protection embrance to Chlomery ACM removed and days of also confirmation date ACM removed and days of also confirmation date and confirmation of also confirmation date and confirmation of also confirmation date and confirmation of also removed the sunk field investigation and soil anneals collecting analysis to EPD confirmation to collecting analysis to EPU confirmation analysis to EPU analysis analysis to EPU analysis analysis analysis analysis an	STATE .
The pet type and delic by EPD cultect 6 mas of substances soil samples outside main boilding cultect 6 mas of substances soil samples outside main boilding substances described soil samples outside main boilding substances described soil samples outside main boilding ALM removed and degree of faite confirmation of ACM been cleaved ALM removed the tank remaind cupted and pargod the tank and pipelling by client removed the tank field invaripation and soil sample collection removed the tank field invaripation and soil sample collection and pass to EPD confirmation 1 days 1 that 2007 14 days 1 that 2007 1 that 2	
cultact 6 mos of substation soft integers outlice main college 1 4 days 18 April 2007 22 substantial analysis report to EPD 14 days 21 April 2007 24 substantial days report to EPD 14 days 21 April 2007 24 substantial days report to EPD 14 days 21 April 2007 24 days 21 April 2007 25 repare and substation date and purple of site 2007 25 repare and substantial by ellent 2007 25 days 21 April 2007	986
3 days 18 Arril 2007 22 days 21 Arril 2007 22 days 22	-
submission of the EPO 14 days 21 Acril 2001 submission of the EPO 6 days 8 big 21001 submission date from the EPO 6 days 8 big 21001 days 8 bi	
submission date Bamboo scaliniding recolors with projection embrance to Chilomey 7 days 8 king 11001 ACTM removed and disposed off sites entiring UVD fact tank tentoral result fact tank tank tank tentoral result fact tank tank tank tank tentoral result fact tank tank tank tank tank tank t	
ACTA transvel and disposed off site ACTA transvel and disposed off site existing UAT text and seed at site seed of site seed of site seed of a site seed o	
ACTM removed and disposed of files existing UVD text tank removed the lank and pipelline by elicant removed the tank and soil annufac collections find investigation and soil annuface collections find investigation and soil annuface ann	· .
endeling the tenth bein chaired endeling UVII fact lank centured by client reaptived and purgod the lank and glocaline by client reaptived and purgod the lank and glocaline by client reaptived and purgod the lank and glocaline by client reaptived and purgod the lank and glocaline by client reaptived and purgod the lank and glocaline by client reaptive and submit the report of Tetal Penerhamn Hydrocateban (TPH) 1 days 15 Any 2007 1 days 15 Any 2007 1 days 16 Any 2007 26 Ang 2007 1 days 19 Any 2007 27 Any 2007 28 Ang 2007 28 Ang 2007 28 Ang 2007 29 Ang 2007 20 Ang 2007 20 Ang 2007 20 Ang 2007 20 Ang 2007 21 Ang 2007 22 Ang 2007 23 Ang 2007 24 Ang 2007 25 Ang 2007 26 Ang 2007 27 Ang 2007 28 Ang 2007 28 Ang 2007 28 Ang 2007 29 Ang 2007 20 Ang 20	
estiting UND feet tank temoral to feet the state of the s	
confeded and purpod the tank and pripaline by client 1 days 1 thirp 2001 ready flot treatment and centificated by client 0 days 7 thirp 2001 removed the tank flot treatment of cell other 1 days 8 hisy 2001 field invertisation and soil smurfle cell other 1 days 1 thirp 2001 propers and submit the report of Tetal Paicolaum Hydroratean (TPH) 14 days 10 Histy 2001 compellating the report of Tetal Paicolaum Hydroratean (TPH) 14 days 10 Histy 2001 compellating the response of Tetal Paicolaum Hydroratean (TPH) 14 days 10 Histy 2001 compellating the response of Tetal Paicolaum Hydroratean (TPH) 14 days 10 Histy 2001 compellating the response of Tetal Paicolaum Hydroratean (TPH) 14 days 10 Histy 2001 compellating the response of Tetal Paicolaum Hydroratean (TPH) 14 days 10 Histy 2001 compellating the response of Tetal Paicolaum Hydroratean (TPH) 14 days 10 Histy 2001 compellating the response of Tetal Paicolaum Hydroratean (TPH) 14 days 10 Histy 2001 compellating the response of Tetal Paicolaum Hydroratean (TPH) 14 days 10 Histy 2001 compellating the response of Tetal Paicolaum Hydroratean (TPH) 14 days 10 Histy 2001 compellating the response of Tetal Paicolaum Hydroratean (TPH) 14 days 10 Histy 2001 compellating the response of Tetal Paicolaum Hydroratean (TPH) 14 days 10 Histy 2001 compellating the response of Tetal Paicolaum Hydroratean (TPH) 14 days 10 Histy 2001 compellating the response of Tetal Paicolaum Hydroratean (TPH) 14 days 10 Histy 2001 compellating the response of Tetal Paicolaum Hydroratean (TPH) 1 Hydroratean 1 Hydrora	Mary Mary
reuly for creamil and confirmed by ellent 0 days 7.007 removed the sunk field investigation and soil sometic collection 1 days 8 blay 2007 removed the sunk field investigation and soil sometic collection 1 days 1 days 1 days 10 days requere and submit the report of Tetal Peicoleum Hydrocuban (TPH) 14 days 10 Hy 7207 removed the submit to element 1 days 10 days 1 days 1 days 1 days 10 day	
removed the tunk field investigation and soil sample collection 1 days 15 May 2007 really RHU 15 May 2007 15 May 2007 really RHU 15 May 2007 15 May 2007 15 May 2007 requere and schedil the report of Tetal Petroleum Hydroriaban (TPH) 14 days 19 May 2007 removed fearofiliment works completed 1 days 6 funt 1007 removed fearofiliment works completed 0 days 13 funt 2007	
field inversipation and soid sounce collecting 1 thy 15 Noy 2007 public Hely public Hely analysis to Hely report of Tetal Pelrobum Hydronizban (TPH) N. days analysis to Hely concluding that is, element reported descriptionary descriptional.	
mulify Hift) sample for the control Tead Paleobarn Hydroniadon (TPH) landinida to EPD concluding that it is aloment removal februatishment works completed Octys 13 lune ILO?	
prepare and submit the report of Tetal Peleokum Hydroriaben (1PH) 14 days 19thly 7LOT analysis to EPD canolishing the re-celebrate completed 0 days 6 lune 2LOT report of descriptions in works completed 0 days 13 lune 2LOT	٠.
consolidate the confidence of	
removal/derudihmani warka sampletal 0 days . 13 lune 2007	· · ·
1	

中国 中	外的型包焊
n FEETHER 1810	
10 } 1448 (10)	


and the second of the second o


.

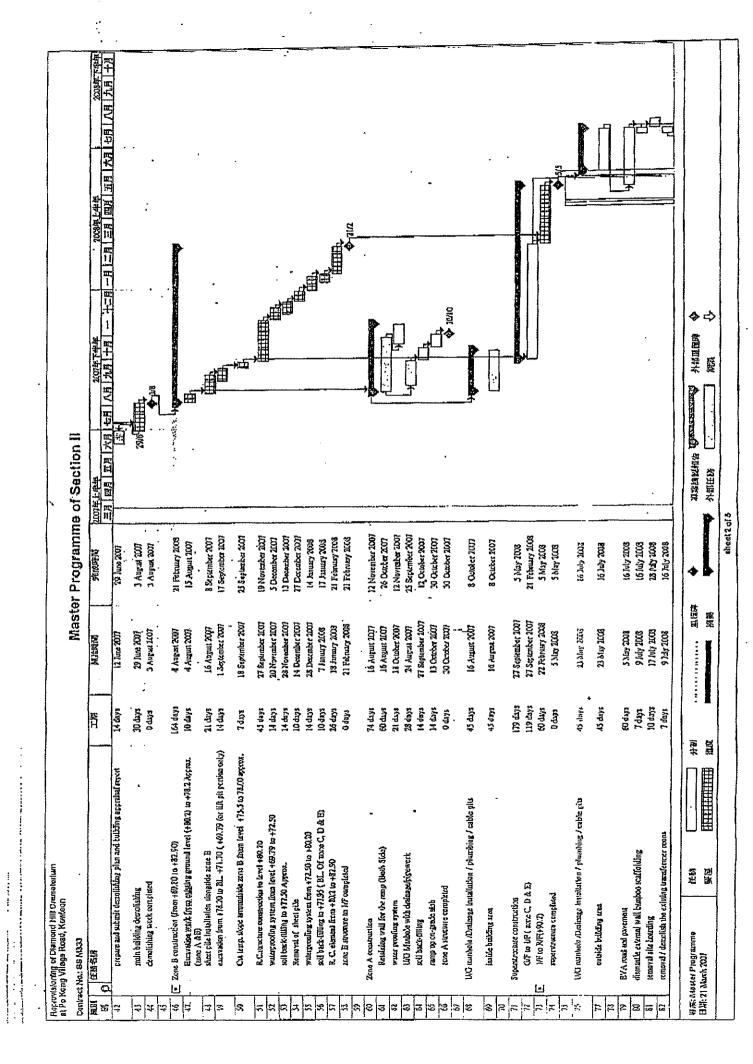

March	G 15	ai Po Kong Village Road, Kowloon Contract No.: 65 M333		Ma	ster Programm	Master Programme of Section II
Comparison	超量	0	野刀	以	医超声	2000年 五月 六月 七月 八月 八月 十月 一十二月 二月 三月 四月 五月 八月 七月 八月 九月 九月 九月 九月 九月 九月 九
The control of the	æ æ		EC CAST	١.	1 . 25 July trocks	-
The control of the	56	Part	30 days	15 May 2008	19 June 2008	
The content 1	2		7 days	15 May 2008	22 May 2008	
March Marc	S 4		2 days	15 May 2008	72 hlay 24.08	
State of the production Other 19 half 2004 State 20	8 25	1	30 days	15 May 2003	19 June 2008	
State Stat	32	, T	0.0473	15 May 2008	15 May 2008	
1	5	· 	Makys	15 May 2008	19 June 2008	
The control of the	× 5	3	21 days 0 days	2 stay 2008.	ET June 2008	
December Control Con	: 2	,	21 days	23.764.2338	TANK TO	
State Stat	ድ	Ē	45 (5)21	15 htay 2003	11 July 2008	
State Compared C	8	П	· (O day)	15 May 2003	25 July 2EC3	
1 April 2004 1	<u>ج</u> و	-	30 days	15 May 2008	19 June 2008	
Final Horse	3 3	- 1	4) days	ZJ April ACG	17 June 2003	
## Shared to the fine that the	12	,	10 duxs .	5 M4 2013	16 July 2008	
2	≅	T	•			
1	107	單	73 days	13 May 2008	18 August 2003	
Comparison Com	2		28 days	BOOK ATHY EC.	26 June 2033	
13 king 2000 13 k	₫ ;		45 days	26 hem XXX3	13 Angust 2008	
1		_	Tides	Mary and Con-	Dank street 14	
1	5	1	23 days	15 May 2008	17 Free 2018	
1 doys 25 lace 2003 21 leby 20	E	1	21 033	10 July 2038	4 July 2008	
14 days 25 haz 2008 21 hby 2008 21 hby 2008 21 hby 2008 21 hby 2008 22 haz 2008 23 h	2	1	21 days	26 /чес. 2003	21 Feb 2008	
1 days	2		21 days	76 haze 200H	21 7414 2003	
1 plans compty systems (Arcy drawling approved) 13 days 14 king NAB 29 lady 2008 19 la		-	21 days	23 July 1008	14 August 2008	
14 color			14 days	14 July 2003	29 July 2668	
1	<u>.</u>		700	6007 BHILL 04	SOTTE FINE ST	
1			21 4305	26 June 2003	21 144 2003	
# 5 5 427			7 4433	77 Inly 21C8	29 July 2003	
19 days 23 hisy 1108 17 kms 708 18 hisy 1108 17 kms 708 18 hisy 1108 17 kms 708 19 hisy 1108			55 62.25	Manager	50 Tale 1008	
13 days 10 lane (103 4 hay 203 12 lay 203 14 days 12 lay 203 14 days 12 lay 203 14 days 12 lay 203 12 lay 203 14 days 12 lay 203 12 lay 203 13 lay 203 14 days 14 days 15 lay 203 15 lay 20	=	т	2 th	23 May 21CS	17 June 2008	
He will be completed 14 days 25 faly 2003 12 laly 2003 13 laly 2003 13 laly 2003 14 lalarh 2003 14 lalarh 2003 14 lalarh 2003 14 lalarh 2003 15 laly	Ξ.	· ·	21 days	10 June 2003	4 hiy 2003	
Hand the content Hand the c	2	<u>.</u>	7 42,53	No lan Don	4 July 2013	
19 19 19 19 19 19 19 19	<u>=</u>		14 daya	76 June 2008	12 July 2008	
December of the growth of the control of the control of the property of the control of the	22	,	21 days	5 fely 203	29 July 2008	
al of the planking and material 23 days 14 March 2003 18 April 2008 18 Apri	2 2		0 days	मार्थ भीत हो।	29 July 2108	
al of the p drawing and material 22 days 14 Narch 2008 18 April 2008 1	2		108 427	14 March 2103	23 July 2008	
任44日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4日本4<th>≋</th><td></td><td>zich EZ</td><td>14 March 2008</td><td>1इ तेज्ञरा २००८</td><td></td>	≋		zich EZ	14 March 2008	1इ तेज्ञरा २००८	
対応 (日本日本日本日本日本日本日本日本日本日本日本日本日本日本日本日本日本日本日本	3	-				the state of the s
10 mm 1 m	: SE	対解	が思		_	大学 は 一
	L					

The state of the s

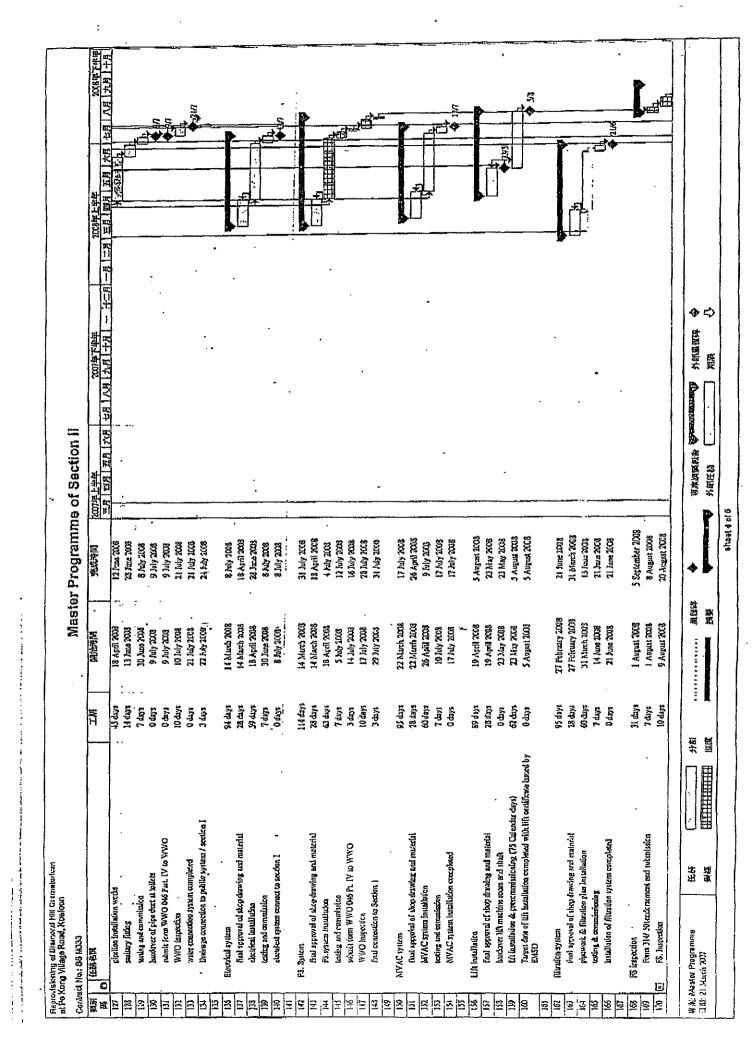

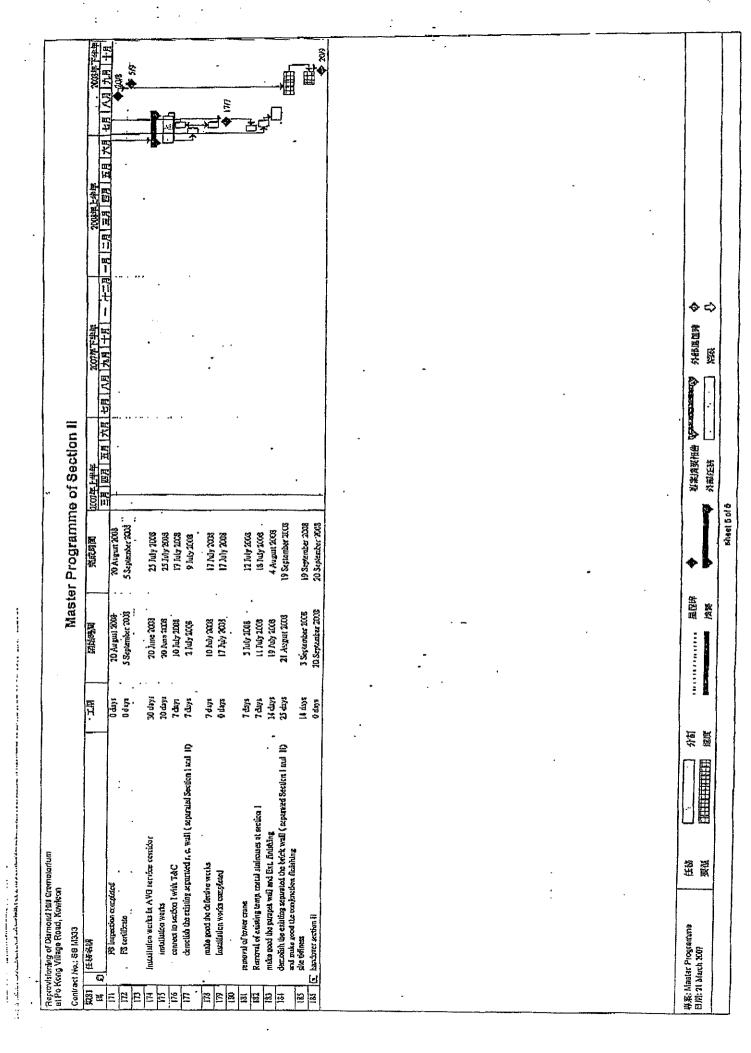

Appendix C Environmental Action and Limit Levels

Action and Limit Levels for 24-hour TSP

Monitoring Station	Action Level (ng/m³)	Limit Level (mg/m³)
ASR8	195.0	260
ASR17	174.1	260

Action and Limit Levels for 1-hour TSP

Monitoring Station	Action Level (ng/m³)	Limit Level (mg/m³)
ASR8	408.1	500
ASR17	408.4	500

Action and Limit Levels (L_{eq}) for Construction Noise

Time Period	Action Level	Limit Level			
		SR3	SR4	SR6	
0700 – 1900 hours on normal weekdays	When one documented complaint is received	70/65*	70/65*	75	
0700 – 2300 hours on public holidays including Sundays and	from any one of the sensitive receivers	Subject to requirements stipulated in future			
1900 - 2300 hours on all days		Construction Noise Permits			
2300 - 0700 on all days					

^{*}reduce to 70dB(A) for schools and 65dB(A) during school examination periods

Reprovisioning of Diamond Hill Crematorium

	Impact Air	 Quality and Noise 	Impact Air Quality and Noise Monitoring and Audit Schedule for October 2008	it Schedule for Octo	ober 2008	
Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
28-Sep		30-Sep		2-Oct	3-Oct	4-Oct
				1-hour TSP Noise		
5-Oct	6-Oct	7-Oct	8-Oct	9-Oct	10-Oct	11-Oct
	24-hour TSP		1-hour TSP Noise Site Environmental Audit			
12-Oct	13-Oct	14-Oct		16-Oct	17-Oct	18-Oct
	24-hour TSP Site Environmental Audit	1-hour TSP Noise				24-hour TSP
19-Oct	20-Oct	21-Oct	22-Oct	23-Oct	24-Oct	25-Oct
	1-hour TSP Noise Site Environmental Audit				24-hour TSP	1-hour TSP
26-Oct	27-Oct	28-Oct	29-Oct	30-Oct	31-Oct	1-Nov
	Site Environmental Audit			24-hour TSP	1-hour TSP Noise	

Reprovisioning of Diamond Hill Crematorium

6-Dec 15-Nov 1-Nov 8-Nov 22-Nov 29-Nov 24-hour TSP 1-hour TSP Saturday 28-Nov 7-Nov 5-Dec 31-Oct 14-Nov 21-Nov Tentative Impact Air Quality and Noise Monitoring and Audit Schedule for November 2008 24-hour TSP 1-hour TSP 1-hour TSP Noise Noise 27-Nov 6-Nov 4-Dec 30-Oct 13-Nov 20-Nov 24-hour TSP 24-hour TSP 1-hour TSP Thursday Noise 5-Nov Site Environmental Audit 3-Dec 29-Oct 12-Nov 19-Nov 26-Nov Wednesday 24-hour TSP 1-hour TSP Noise 4-Nov 2-Dec 28-Oct 25-Nov 11-Nov 18-Nov 24-hour TSP 1-hour TSP Tuesday Noise 17-Nov Site Environmental Audit Site Environmental Audit 27-Oct Site Environmental Audit Site Environmental Audit Site Environmental Audit 3-Nov 24-Nov 1-Dec 24-hour TSP 1-hour TSP Monday Noise 9-Nov 23-Nov 30-Nov 26-Oct 16-Nov Sunday

The schedule is subject to change due to unforeseeable circumstances (adverse weather, etc)

Reprovisioning of Diamond Hill Crematorium

20-Dec 27-Dec 6-Dec 3-Jan 13-Dec 24-hour TSP 1-hour TSP Saturday 5-Dec 2-Jan 12-Dec 19-Dec 26-Dec Tentative Impact Air Quality and Noise Monitoring and Audit Schedule for December 2008 24-hour TSP 1-hour TSP Noise 4-Dec 1-Jan 11-Dec 18-Dec 25-Dec 24-hour TSP 1-hour TSP Thursday Noise 17-Dec 3-Dec 10-Dec 24-Dec 31-Dec 24-hour TSP Wednesday 1-hour TSP Noise 23-Dec 30-Dec 2-Dec 9-Dec 16-Dec 24-hour TSP 1-hour TSP Tuesday Noise 1-Dec Site Environmental Audit Site Environmental Audit Site Environmental Audit Site Environmental Audit 8-Dec Site Environmental Audit 22-Dec 29-Dec 15-Dec 24-hour TSP 1-hour TSP Monday 14-Dec 28-Dec 30-Nov 21-Dec Sunday

The schedule is subject to change due to unforeseeable circumstances (adverse weather, etc)

Reprovisioning of Diamond Hill Crematorium

Tentative Impact Air Quality and Noise Monitoring and Audit Schedule for January 2009

	i elitative illipa	remanye impaci Ali Kuality aliu iv	ld Noise Monnig and Addit Scheddle for January 2009	Addit Scriedare for	Jaildal y 2009	
Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
28-Dec	29-Dec	30-Dec	31-Dec	1-Jan	2-Jan	3-Jan
	1-hour TSP				24-hour TSP	1-hour TSP
	Noise Site Environmental Audit					
4-Jan	5-Jan	6-Jan	7-Jan	8-Jan	9-Jan	10-Jan
				24-hour TSP	1-hour TSP	
	Site Environmental Audit				Noise	
11-Jan	12-Jan	13-Jan	14-Jan	15-Jan	16-Jan	17-Jan
			24-hour TSP	1-hour TSP Noise		
	Site Environmental Audit					
18-Jan	19-Jan	20-Jan	21-Jan	22-Jan	23-Jan	24-Jan
		24-hour TSP	1-hour TSP			
	Site Environmental Audit		Noise			
25-Jan	26-Jan	27-Jan	28-Jan	29-Jan	30-Jan	31-Jan
	24-hour TSP	1-hour TSP				
	Site Environmental Audit	Noise				

The schedule is subject to change due to unforeseeable circumstances (adverse weather, etc)

Station Po Leung Kuk Grandmont Primary School (ASR8) Operator: Shum Kam Yuen								
Cal. Date:	25-Aug-08	**************************************		Next Due Date: 25-Oct-08			, -	
Equipment No.:	A-001-69T (GM	WS 2310 Accy-V	ol system)	Serial No	**************)716	₩	
	hali mara mara da kana				the state of the s	and the second s	-	
	· · · · · · · · · · · · · · · · · · ·	namenamininganinganingan mengapung	Ambier	nt Condition		the state of the s	thirtee from mountain	
Lemperati	ure, Ta (K)	305	Pressure	Pa (mmHg)		756.5		
A STATE OF THE STA			Delflag Tránsfer	Standard Informati				
Seria	l No:	843	Slope, mc	2,02026			l	
Last Calibra		22-Ocl-07	oropo, mo			cept, be	-0.03	
Next Calibra	ation Date:	22-Oct-08			(Pal760) x (298/Ta)			
	the state of the s	e comment are comment from allegare of taken comments are comments as the comments are comments as the comments are comments as the comments are comments are comments.	ON THE PROPERTY OF THE PROPERT	design (freely)	(a) 40/ X (200/14)	1 -00//110	**************************************	
		***************************************	Calibration	of TSP Sampler	~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~	-	-	
Resistance Plate	والمواسات والمساول المساول والماسان والمساول وال	0	rfice		нν	S Flow Recorder		
No.	DH (orifice), in. of water	[DH x (Pa/76	0) x (298/Ta)] ^{1/2}	Qstd (m³/min) X - axis	Flow Recorder Reading (CFM)	Continuous Flow Reading IC (CFN		
18	10,4	(3.18	1.59	50,0	49.31		
13	8.0	2.79		1.40	44.0	43,39	************	
10	6.1	2.44		1.22	38.0	37.47	·····	
7	4.0	1.97		0.99	30,0	29.59		
5	2.5	1	.56	0.79	22.0	21.70		
By Linear Regres Slope , mw ≈ Correlation Coeff of Correlation Coe	34.3957 clent* =	0.99		Intercept, bw =	-4,90	395		
	COMMENT OF THE PROPERTY OF THE	The same and the s	Set Point (Calculation	and a second day of the second se	No 31 dec-habit-solutions provings became any beautiful accommodation of the solutions.	4	
rom the TSP Fletc	Calibration Curv	e, take Qstd = 1.0		**************************************	respectively a series of the second s	in the state of th		
		Y" value accordin				•		
		mw x (Qstd + bw = IC x	[(Pa/760) x (298/Ta)]1/12			
erefore, Set Poin	it; IC ≈ (mw x Qs	td + bw) x ((760 /	/Pa)x(Ta/298)] ^{1/2} =	White	40.30		
rerelore, Set Pom	r; IC ≈ (mw x Qs	td + bw) x ((760)	/Pa)x(Ta/298)) ^{M2} =-	when	40.30	Walderson, marries y	
emarks:	^r^#***************************	·	**************************************					
سونيو				and an extension of the state o	Annual Maries parties of the second Annual Section Section Section Section Section Section Section Section Sec	***************************************	40 to 40	
	VI La			.A			***************************************	
Reviewer:	7 W [an)Siqu	rature:	1	De	10 76/fry :	· <i>X</i>	

Station	Po Leung Kuk Gi	andmont Primar	ry School (ASR8)	Operator:	Shum Ka	am Yuen	
Cal. Date:	20-Oct-08			Next Due Date:	20-D	ec-08	
Equipment No.:	A-001-69T (GMV	VS 2310 Accy-Vo	ol system)	Serial No. 0716		16	
			Ambient	Condition			
Temperati	ure, Ta (K)	303	· · · · · · · · · · · · · · · · · · ·	Pa (mmHg) 759.3			

			Orifice Transfer S	tandard Informatio	on		
Seria	al No:	843	Slope, mc	2.02026		ept, bc -0.03609	
Last Calibr	ation Date:	22-Oct-07			= [DH x (Pa/760) x		
Next Calibr	ration Date:	22-Oct-08		Qstd = {[DH x (Pa/760) x (298/Ta)]	^{1/2} -bc} / mc	
				f TSP Sampler			
n di e ni		, (Orfice		HV	S Flow Recorder	
Resistance Plate No.	DH (orifice), in. of water	[DH x (Pa/7	(60) x (298/Ta)] ^{1/2}	Qstd (m ³ /min) X - axis	Flow Recorder Reading (CFM)	Continuous Flow Recorder Reading IC (CFM) Y-axis	
18	10.3		3.18	1.59	48.0	47.58	
13	8.1		2.82 1.41 42.0		41.63		
10	6.2	2.47		1.24	36.0 [,]	35.69	
7	3.9	1.96		0.99	30.0	29.74	
5	2.6	***************************************	1.60	0.81	22.0	21.81	
By Linear Regression of Y on X Slope , mw = 31.6727 Correlation Coefficient* = 0.9920 *If Correlation Coefficient < 0.990, check and recalibrate.			Intercept, bw = _	-2.9	B66		
			Set Point	Calculation			
From the TSP Fi	eld Calibration Cu	ve. take Qstd =			1474-1111 AND STATE OF THE STAT		
	ssion Equation, the						
· 10111 1110 1 10g1 00			3				
	÷	mw	x Qstd + bw = IC	x [(Pa/760) x (298/ĭ	"a)] ^{1/2}		
Therefore, Set P	oint; IC = (mw x C)std + bw) x [(7	60 / Pa) x (Ta / 29	8)] ^{1/2} =	-	38.52	
			raman asan sa ar wasanin nimbira sa ali sa arai in da A			£4	
Remarks:	-	HAPOTON TO ATTO THE AND	and the state of t				
			*C************************************		-		
~~ .			0.	100		Date: 21 Of of	
QC Reviewer:	\sim 168 $>$	じほ	Signature:	100		Date: (.X.)(.f.)</td	

Station	Staff Quarter Fo	r Diamond HIII Crematorium (ASR ²	17) Operator	: Shum l	Kam Yuen	
Cal. Date:	25-Aug-08	The second s	Next Due Date	25-(
Equipment No.:	A-001-49T (GMWS 2310 Accy-Vol system)	Serial No.	7	175	
-				and the state of t		na di didawa da
And the same of th	esercial annia construction	militari markitari m	t Condition	***		
1emperal	ure, Ta (K)	305 Pressure,	Pa (mmHg)	<u> </u>	756.5	-
		Orifice Transfer	Standard Informati	••••••••••••••••••••••••••••••••••••••	مستعد المراجعة والمراجعة المراجعة المستديقة معارضة والمراجعة والمراجعة والمراجعة والمراجعة والمراجعة والمراجعة	***********
Seria	al No:	843 Slope, mc	2.02026	*****	ept, bc	-0.03609
Last Calibr	ation Date:	22-Oct-07		:= [DH x (Pa/760) x	**************************************	L
Next Calib	ration Date:	22-Oct-08		(Pa/760) x (298/Ta)		
	Trainer (TEA) and Special Colors (Colors Colors Col	The state of the s	Salahan and and an		**************************************	
	Suspensessianiensessa	والمارية والمارية والمراوية والمراوي	of TSP Sampler		وروز به در	والمدال الماران
Resistance Plate	<u></u>	Orlice	~ 	HV	S Flow Recorder	بوي پرة دوست سيفت عمرماه مسمد المعمر
No.	DH (orifice), in. of water	[DH x (Pa/760) x (298/Ta)] ^{1/2}	Qstd (m³/min) X - axis	Flow Recorder Reading (CFM)	Continuous Flow Reading IC (CFA	•
18	10.8	3.24	1.62	50.0	49.31	
13	8.0	2.79	1,40	42.0	0 41.42	
10	5.7	2.35	1.18	34.0	33,53	
7	4.0	1.97	0,99	28.0	27.61	
5	2.6	1.59	0.80	22.0	21.70	********************
By Linear Regre Slope , mw ≈	33.9101		Intercept, bw =	-5.91	992	
Correlation Coef	#700 F	0.9987	••			
ii Correlation Col	enicient < 0.990, d	heck and recalibrate.				
an and an annihila annihila (annihila (annihila (annihila (annihila (annihila (annihila (annihila (annihila (a	والمراجع والمراجع المراجع	Set Point	Calculation		ويوسيد ويليدون فرود ودود ودود ودود ودود ودود ودود ودود	trong who was one of the decidence.
rom the TSP Fie	ld Calibration Cur	ve, take Qstd = 1.30m³/min	The first and the second section of the second	والمراوية	erfelderfender der seis slottendet flette filde fil fild ha fremminnen men	James and State of the State of
From the Regress	ion Equation, the	'Y" value according to				
		mw x Qstd + bw ≂ IC x	- Hのal76A) v (2007.	ojr†/2		
		104 × 48500 + 104 × 10 ×	(4. 9), oo) x (x39) (4	a)] .		
herefore, Set Pol	int; IC = (mw x Qs	ld + bw) x [(760 / Pa) x (Ta / 296	3)] ⁴¹² =		38.62	
**************************************	774-7-1-7-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-	er endanderet him et forste forste forste de visit en vermonere van et som en med en pedap mende, dende indep g	ماران که به برای به دو به داره که با به دو با داره که با داره که داره در به در به در به در به در به در به در ب	مناهد والمناهد والم والمناهد والمناهد والمناهد والمناهد والمناهد والمناهد والمناهد و	n-drovennacish-karabshirashkakkanasyana.	
Remarks:						
V-1	**************************************		a de arte parategratur area e que arte esta esta esta esta esta esta esta es	*************************************	······································	dradichter Mathibhancaceae
B-107	16/19	۸۶	And the second s	and British Landing by Conference on the Property of	76 Au.	n.R
C Reviewer:	(Colony	Signature;	<u> </u>	D	ate: 26 Aug	0()
	J.	Y				

Station	Staff Quarter Fo	r Diamond Hill Cr	ematorium (ASR17) Operator:	Shum K	am Yuen	_
Cal. Date:	20-Oct-08				20-D	ec-08	-
Equipment No.:	A-001-49T (GMWS 2310 Acc	cy-Vol system)	ol system) Serial No.		7175	
			Ambiant	Condition	***************************************		
Temperatu	re Ta (K)	303	Pressure, F			759.3	
- remperatu	iie, ra (iv)	000	11000010,1	o (
		<u> </u>	Orifice Transfer S	tandard Informatio	ρ'n		***************************************
Serial	l No:	843	Slope, mc	2.02026		ept, bc	-0.03609
Last Calibra	ation Date:	22-Oct-07			= [DH x (Pa/760) x		
Next Calibra	ation Date:	22-Oct-08		Qstd = {{DH x (Pa/760) x (298/Ta)]	^{1/2} -bc} / mc	غوية السياريين والإناسية والإروانيين.
			Calibration o	f TSP Sampler			##-0
			Orfice	r Tor Gumpler	HV	S Flow Recorder	
Resistance Plate No.	DH (orifice), in. of water		(60) x (298/Ta)] ^{1/2}	Qstd (m³/min) X - axis	Flow Recorder Reading (CFM)	Continuous Flow Reading IC (CFI	
18	10.6		3.23		50.0	49.56	
13	7.9		2.79		42.0	41,63	
10	5.5	2.32		1.17	34.0,	33.70	
7	4.0	1.98		1.00	28.0	27.76	
5	2.8		1.66	0.84 22.0		21.81	
By Linear Regression of Y on X Slope , mw = 35.5578							
n correlation co	emoleric volucio,	Oncon and room	DI GCO.				
				Calculation			
From the TSP Fig							
From the Regres	sion Equation, th	e "Y" value accor	ding to				
	-	mw	x Qstd + bw = IC	к [(Pa/760) x (298/	ra)] ^{1/2}		
Therefore, Set Po	oint; IC = (mw x	Qstd + bw) x [(7	60 / Pa) x (Ta / 29	8)] ^{1/2} =		38.65	
Remarks:							
				<u> </u>			
OC Davisson	A.9	<i>.</i> (.,	Signatura:	070		Date: 21 (It of



TISCH ENVIROMENTAL, INC. 145 SOUTH MIAMI AVE. VILLAGE OF GLEVES, OH 45002 513.467.9000 677.263.7610 YOLL FREK 513.467.9009 FAX WWW.TISCH-EHV.COM

AIR POLLUTION MONITORING EQUIPMENT

ORIFICE TRANSFER STANDARD CERTIFICATION WORKSHEET TE-5025A

		/ Rootameter		833620	Ta (K) ~	295
Operator	Tisch	Orifice I.	D	0843	Pa (mm)	- 753.11
24 25 49 43 25 25 25 25 25 25 25 25 25 25 25 25 25	**********	***********	****	***********	*******	医复数性性性性性炎
,	_				METER	ORFICE
PLATE	VOLUME	VOLUME	DIFF	DIFF	DIFF	DIFF
OR	START	STOP	AOTOME	TIME	Нq	H2O
Run #	(m3)	(m3).	(m3)	(min)	(mm)	(in.)
	~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~		~~~~~~~			
1.	NA .	NA	1.00	1.3860	3,1	2.00
5	NA	NA	1.00	0.9850	6.3	4.00
3	NA	NA	1.00	0.8800	7.8	5.00
4	NA	NY	1.00	0.8410	8.6	5.50
5	AN	NA	1.00	0.6930	12.6	8.00
ľ					1	
•	,	'		,	,	•

DATA TABULATION

Vstd	(x axis) Ostd	(y axis)		Va	(x axis) Qa	(y axis)
0.9969 0.9926 0.9905 0.9895 0.9842	0.7192 1.0078 1.1256 1.1766 1.4202	1.4149 2.0010 2.2372 2.3464 2.8299	·	0.9959 0.9916 0.9895 0.9885 0.9832	0.7185 1.0067 1.1245 1.1754 1.4188	0.8851 1.2517 1.3995 1.4678 1.7702
Qstd slop intercept coefficie	(b) = ent (r) =	2.02026 ~0.03609 0.99996 —————————————————————————————————	`a)]	Qa slope intercept coefficie	(b) ≈	1.26505 -0.02258 0.99996

Vstd = Diff. Vol[(Pa-Diff. Hg)/760](298/Ta) Qstd = Vstd/Time

Va = Diff Vol [(Pa-Diff Hg)/Pa]

CALCULATIONS

Qa = Va/Time


For subsequent flow rate calculations:

Qstd = $1/m\{ [SQRT (H2O (Pa/760) (298/Ta))] - b \}$ Qa = $1/m\{ [SQRT H2O (Ta/Pa)] - b \}$



Tisch Enwromental, Inc. 145 South Miami Ave. Village of Cleves, OB 45002 513.467.9000 877.263.7610 toll free 513.467.9009 pax www.tisch-env.com

Air Pollution Monitoring Equipment

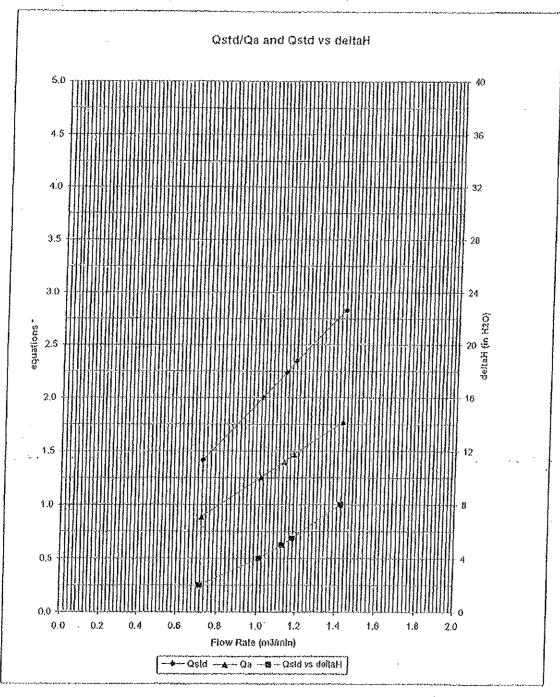

* y-axis equations:

Ostd series:

$$\sqrt{\Delta H \left(\frac{Pa}{Pstd}\right) \left(\frac{Tstd}{Ts}\right)}$$

Qa series:

$$\sqrt{(\Delta H (To/Po))}$$

#0843

EQUIPMENT CALIBRATION RECORD

Type Mani	: ufacturer/Brand:		Laser SIBAT	Dust Moi	nítor		
	el No.:		1.D-3	М	I to the second		
	oment No.:		Transporting at Charles	40.			
	itívity Adjustmen	t Scale Setting:	A.005, 753 C		a ett tille og skillet til en skille til skillet skille til skillet skillet skillet skillet skillet skillet sk I skillet skil		
Opera	ator:		Mike S	hek (MSK	(M)		
Standa	ard Equipment	and the second s		en and an array of the second section of proper	er engan ann gen en ange første til handernette anninge plenningen.		
	oment:	Rupprocht &	Patashnici	k TEOM®			
Venu		_Cyberport (P	ut Ying Soc	condary S	School)	recording	
Mode	l No.:	Series 1400/		ter terresensk methoder og se	e de la marcia de la companya de la filia de la companya de la companya de la companya de la companya de la com	/	
Serial	l No:	Control:	140AB219	899803	The Control of the State of the Control of the State of t	والمستوان والمراجع والمستوان والمستو	~~~~
			1200C143(K ₆ : 1250	0	er yw yspaetig
Last (Calibration Date*				10 /6//	Commence of the contract of th	no en monocomo.
*Remar	ks: Recommend	led interval for hardv	varé calibra	ation is 1	year		
Calibra	tion Result		liga na amang 1 - iliyog na ng laga na na dingsa gana	رود پر درسان و دست ماهاد داده در	and the second state of the second se	TO A POSSESSE STATE STAT	To graph 2000 by high and resident community of
Sensit	livity Adiustment	Scale Setting (Before	ro Calibrati	only	759 01	**************************************	
Sensit	livity Adiustment	Scale Setting (After	Calibration	οπ). Δ-	ر در پارتور و در د و بها به مندمهم به است	ΣM.	
CASTRON	· ·	Some Setting (Alter	Санланог	1):	753 CI	⁵ M	
Hour	Date	Time	Am	bient	Concentration	Total	Count/
	(dd-mm-yy)		Con	dition	(rng/m³)	Count ²	Minute ³
]			Temp	1 n.H.	Y-axis		X-axis
			(°C)	(%)	, tillo		A GAIS
1	19-07-08	11:00 - 12:00		73	0.03363	1345	22.42
2	19-07-08	12:00 - 13:00		73	0.03605	1442	24.03
3	19-07-08	14:00 ~ 15:00	-m-deren errore en misse	75	0.04118		
4	19-07-08	15:00 - 16:00		74	0.02957	1647	27.45
Note:		ala was measured b			V. U.COO7	1107	18.45
	2. Total Count	was logged by Laser	y mappied: Duet Mes	n a raia	SHRICK FEOM"		
	3. Count/minute	e was calculated by	Total Cou	11/60)			
			, ,	.,, 007			
	r Regression of	·					
	K-factor);	0.0015					
Correla	ition coefficient:	0.9573					
Validity	of Calibration R	ecord: 18July 2	009	n todorony od og toe			
Romarks	•						
3311411(0	Fig.	رو في م و د خار د مر او چار و د در سرد مرد مرد د د د د د د د د د د د د د د د د ستون م		and the state of t	t dig stratistics to reduce the construction of the strategic and the strategic and the strategic and strategic and the	or force of the same of the same	
						4	
	months and an experience of the second progressy	ري دري د و در	ALABAT PROPERTY OF THE STREET		and the control of th		
				1			
QC Rev	ilewer: Mike S	hek Signa	ture:	Hiko	Date:	W.	80 . phil
		- visiting	74.00mm		Date:	X	SM3: CY)

EQUIPMENT CALIBRATION RECORD

Type Man	e: ulacturer/Brand:			Laser I SIBAT	Dust Moi	nitor		
	el No.:			LD-3	4 ************************************	N. P. C.		
	pment No.:			A.005.		and the state of the second of the state of		
	sitivity Adjustmer	it Scale Set	ting:	799 C		and the state of t		
Оре	rator:			Mike SI	rek (MSK	(M)		
Stand	ard Equipment			en en light en derletting ville trap automore average alle and a a a	the distance of the control of the c	and the second seco	entre transition of the first transition out and a second of the second	ر سال در در در که در ده هود دستان ساز در سازد معاده ساف
Eauir	oment:	Dun	produt e m	alaaba!al	real	TO MARKET TO A STATE OF THE STA		The real resources in May have
Venu		Cyly	precht & P. erport (Pui	Visa Coa	I E CIVI		e terroteur. Turk oranizator urruppet, the spury	Carriery a system of
	el No.:	Sorie	3s 1400AB	ning sec	ondary s	school)	· · · · · · · · · · · · · · · · · · ·	As and A
Seria		Cont		10AB2198	200000	en de la companya de	- V- Variot de la de consequence de la consequence della consequen	
.,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,	. 140,	Sens	101, 14	000C1436	199003 10000	e constitution and an area of the constitution and an area of the constitution and an area of the constitution and area of the const		
Last (Galibration Date*		uno 2008	0001430	59803	K ₆ : 1250	0	
'Bema	rks: Becommend	led interval	for hárdwa	ıra calibre	ition is 1		TO THE OWNER OF THE PARTY OF TH	num gargana.
	ntion Result	~~~~		CO ORGANIST C	1101115	year	and the second seco	
Cambre	iuon riesuji			***************************************		the transfer of the company of the contract of	·	
Sensi	tivity Adjustment	Santa Catti	an (Dalara	Oalthant		erita esta de la companya della companya della companya de la companya della comp		
Sanei	iivity Adjustment tivity Adjustment	Cools Couls	a (version	Calibration	on):	** *** ********************************	PM	
OGHOL	avity Aujustinerit	Scale Seal	if (viter C	anbration):	<i>799</i> CI	PM	
Hour	Date	Tin	ne	T Ami	oiont	Concentration		75.05.00.00.00.00.00.00
	(dd-mm-yy)				dition	(mg/m ³)	Total	Count/
	` '''			Temp	R.H.	Y-axis	Count ²	Minute ³
1				(°C)	(%)	1 "dXIS	1	X-axis
1	06-07-08	10:00 -	11:00	29.9	81	0.01680	704	d -1 -2 1
2	06-07-08	11:00 -	12:00	29.8	80	0.01748	704	11.74
3	06-07-08	12:00	13:00	29.6	80	0.01537	738	12.30
4	06-07-08	13:00 -	14:00	29.6	80	0.01688	659	10.98
Note:	1. Monitoring d					chald TECAM®	730	12.17
	2. Total Count	was logged	by Lasor f	i rajipi eci Just Moni	n ox i ata: tor	SUBJECT COM		
	3. Count/minute	e was calcul	lated by (T	otal Cour	it/60}			
			,		,			
3y t.inea	r Regression of							
	(K-factor);	10.0	0.0014	~				-
Correla	ition coefficient:	****	0.9275	er mores deres sones.				
Validity	of Calibration Re	ecord;	5 July 2009	9	la normania de la compa	•		
Remarks	i:							
***************************************			an and the second deposition of the American			e dynamicky from the Control of the Burk and the State of	e	
						-		
	* TOPPOT #\$ Visited to History # March	···	and the transport of the state of the state of			endere e no e e in de holosia de obre se como e e questa assessamente.		<u> </u>
					ţ			
QC Rev	iewer: <i>Mike S</i> .	hek	Signatu	re'	Hilo	Data	9 1.d. 0/	300
	2.		Si matti		UU	Date:	7 July 20	JUB



SOILS & MATERIALS ENGINEERING CO., LTD.

'G#, O#, 19E, 19E & 20E, Leader Contre, 37 Worm Chirk Hang Road, Aberdeen, Hong Kong. 香港黄竹坑道37號和途中心地下・9線・12機・13機及20核 E-mail: strac@cigismec.com Website: www.cigismec.com

Tel : (852) 2873 6860 Fax: (052) 2555 7533



CERTIFICATE OF CALIBRATION

Certificate No.:	08CA0603 01			Page	1	of	2
Item tested	the first of the constant above and a second property of the paper and a second		,	er en neue d'allement accompany des estates accompany			ara da sa mara ay da ay ay ay ay ay
Description; Manufacturer: Type/Model No.: Scrial/Equipment No.: Adaptors used;	Sound Level Mete RION CO., LTD. NL-31 00320528 / N.007	•	1 2 7	Microphone RION CO., LTD. UC-53A 88783			
Item submitted by	renteren en euro destronomo en en el electronomo en	er engen entre en er grytende er givengeren gest bed	· ·				A security to a general constant
Customer Name: Address of Customer: Request No.; Date of request;	ENSR ASIA (HK) I Room 1213-1219, Gran - 03-Jun-2008	.TD. d Central Plaza, Tower 2,	, 138 Sha	tin Rurø Committee Rd,S	ihe Tin	Now Terri	loúes,HK
Date of test:	12-Jun-2008		er communica.		******		
Reference equipment	used in the calibr	ation					**************************
Description: Multi function sound calibrator Signal generator Signal generator	Model: B&K 4226 DS 360 DS 360	Serial No. 2288444 39073 61227		Expiry Date: 11-Jan-2009 06-Dec-2008 13-Jun-2008	6	fraceabl DGISMEC DEPREI DEPREI	
Ambient conditions	The forest of the second secon	~ ###	na n	the second of the second commence of the second sec			an garante de la proposition de la constante d
Temperature; Relative humidity: Air pressure:	(23 ± 2) °C (60 ± 15) % (1000 ± 10) bPa						

Test specifications

- The Sound Level Meter has been calibrated in accordance with the requirements as specified in BS 7580; Part 1: 1997 1, and the lab calibration procedure SMTP004-CA-152.
- The electrical tests were performed using an electrical signal substituted for the microphone which was removed and 2, replaced by an equivalent capacitance within a tolerance of $\pm 20\%$.
- The acoustic calibration was performed using an B&K 4226 sound calibrator and corrections was applied for the difference 3, between the free-field and pressure responsess of the Sound Level Motor.

Test results

This is to certify that the Sound Level Meter conforms to BS 7580; Part 1: 1997 for the conditions under which the test was performed.

Details of the performed measurements are presented on page 2 of this certificate.

Actual Measurement data are documented on workshoets.

Huang Jian Mid Feng Jun Qi

Company Chop:

The results reported in this certificate refer to the condition of the instrument on the date of calibration and carry no implication regarding the long-term stability of the instrument.

© Soils & Materiats Engineering Co., v.lo.

Form No.CARP152-1/Issue 1/Rov.C/01/02/2007



SOILS & MATERIALS ENGINEERING CO., LTD.

G.C., 9.F., 12.F., 13.F. & 20.F., Leader Centre, 37 Wong Cluk Hang Road, Aberdeen, Hong Rong 音波黃竹坑道37號利簽中心地下,9樓,12樓,13樓及20樓 E-mail: smec@cigismec.com Wabsite: www.cigismec.com

Tet : (852) 2873 6860 Fax : (852) 2555 7533



CERTIFICATE OF CALIBRATION

Certificate No.;	08CA0312 01-0	1	Page:	1	of 2
Item tested	, a , a , a , a , a , a , a , a , a , a	er englise en regular per est en			
Doscription: Manufacturer; Type/Model No.: Serial/Equipment No.: Adaptors usad;	Acoustical Calib Rion Co. Ltd. NG-73 10186482 / N.00				
Item submitted by	terran realiza de medica de la composição de españos de la composição de españos de la composição de españos de la composição	er i a tampère i qui a distance a company e proprié de la company e proprié de la company e proprié de la comp	the contract contract is a property of the contract of the con		phonon and an arrangement of the second and an arrangement
Curstomer: Address of Customer: Request No.; Date of request:	11-Mar-2008	and Central Plaza, Tower 2,	138 Shalia Rural Committee f	kd,Sha T	io, New Temtodos, H
Date of test:	12-Mar-2008	at Marin and at a special country to the special speci			
Reference equipment	used in the calit	ration	National or - 1,544 (5 %) - 1 (10 %) - 1 (10 %) - 1 (10 %) - 1 (10 %) - 1 (10 %) - 1 (10 %) - 1 (10 %) - 1 (10 %)	······································	toda a sum entretona da la sua esta a su su esta esta esta esta esta esta esta esta
Description: ab standard microphono Preamplifier Measuring amplifier ignal generator utilital multi-metor utilio analyzer Iniversal counter	Model: B&K 4180 B&K 2673 B&K 2610 DS 360 34401A 8903B 53132A	Sorial No. 2412867 2239857 2346941 61227 US36087050 GB41300350 MY40003662	Explry Date: 27-Jul-2008 12-Dec-2008 15-Dec-2008 06-Dec-2008 30-Nov-2008 06-Dec-2008 15-Jun-2008	\$ \$ \$ \$ \$ \$	Faceable to: SCL SEPREI SEPREI SEPREI SIGISMEC SEPREI SEPREI
Imbient conditions		and the commence of the control of t	ally and and and and and and and and and and	Kirken	**************************************
emporature: elativo humidity: ir pressure:	22 ± 1 °C 60 ± 10 % 1000 ± 16 hPa				

Test specifications

- The Sound Calibrator has been calibrated in accordance with the requirements as specified in IEC 60942 1997 Annex B and the lab calibration procedure SMTP004-CA-166.
- 2, The calibrator was tested with its axis vertical facing downwards at the specific frequency using insert voltage technique.
- The results are rounded to the nearest 0.01 dB and 0.1 Hz and have not been corrected for variations from a reference
 pressure of 10:13.25 hectoPascals as the maker's information indicates that the instrument is insensitive to pressure
 changes.

Test results

This is to certify that the sound calibrator conforms to line requirements of annex B of IEC 80942; 1997 for the conditions under which the test was performed. This does not imply that the sound calibrator meets IEC 60942 under any other conditions.

Details of the performed measurements are presonted on page 2 of this corlificate.

Approved Signatory:

Huang dien Min Feng Jun Qi

Date: 17-Mar-2008

Company Chop:

Comments: The results reported in this continue refer to the condition of the instrument on the date of calibration and carry no implication regarding the long-term stability of the instrument.

O Sails & Maturials Engineering Co., Ltd.

Form No.CARP 156-Missue 1/Rev.D/04/03/2007

APPENDIX F: Air Quality Monitoring Results

1-hour TSP Monitoring Results at Station ASR8

Date	Starting		Concentra	tion, μg/m3	
	Time	1st	2nd	3rd	Average
02-Oct-08	9:54	73.2	71.1	73.6	72.6
08-Oct-08	9:26	70.2	73.7	71.4	71.8
14-Oct-08	9:14	73.7	72.1	74.7	73.5
20-Oct-08	9:15	75.0	77.9	73.4	75.4
25-Oct-08	9:27	85.6	86.6	87.3	86.5
31-Oct-08	9:14	78.9	75.4	74.2	76.2
				Min.	70.2
				Max.	87.3
				Average	76.0

1-hour TSP Monitoring Results at Station ASR17

		9			
Date	Starting		Concentra	tion, µg/m3	
	Time	1st	2nd	3rd	Average
02-Oct-08	9:33	74.8	71.6	69.9	72.1
08-Oct-08	9:09	71.4	72.1	68.6	70.7
14-Oct-08	9:43	61.2	63.8	66.6	63.9
20-Oct-08	9:38	70.4	68.5	70.2	69.7
25-Oct-08	9:38	88.8	87.7	89.5	88.7
31-Oct-08	9:34	72.5	72.1	73.5	72.7
				Min.	61.2
				Max.	89.5
				Average	73.0

Remark: Bold value indicated an Action level exceedance

Bold & Italic value indicated an Limit level exceedance

APPENDIX F: Air Quality Monitoring Results

24-hour TSP Monitoring Results at Station ASR8

Date	Filter W	eight (g)	Flow Rate	(m³/min.)	Elapse	e Time	Sampling	Conc.	Weather	Particulate	Av. flow	Total vol.
	Initial	Final	Initial	Final	Initial	Final	Time(hrs.)	(µg/m³)	Condition	weight(g)	(m ³ /min)	(m ³)
06-Oct-08	3.7299	3.7780	1.32	1.32	8259.5	8283.5	24.0	25.3	Sunny	0.05	1.32	1903.7
13-Oct-08	3.7154	3.8225	1.34	1.34	8283.5	8307.5	24.0	55.5	Sunny	0.11	1.34	1931.0
18-Oct-08	3.7046	3.8386	1.34	1.34	8307.5	8331.5	24.0	69.4	Sunny	0.13	1.34	1931.0
24-Oct-08	3.7276	3.8851	1.34	1.34	8331.5	8355.5	24.0	81.6	Sunny	0.16	1.34	1931.0
30-Oct-08	3.7196	3.8772	1.34	1.34	8355.5	8379.5	24.0	81.6	Sunny	0.16	1.34	1931.0

 Min
 25.3

 Max
 81.6

 Average
 62.7


24-hour TSP Monitoring Results at Station ASR17


Date	Filter W	eight (g)	Flow Rate	e (m³/min.)	Elapse	e Time	Sampling	Conc.	Weather	Particulate	Av. flow	Total vol.
	Initial	Final	Initial	Final	Initial	Final	Time(hrs.)	(μg/m³)	Condition	weight(g)	(m ³ /min)	(m ³)
06-Oct-08	3.7241	3.7524	1.32	1.32	21269.9	21293.9	24.0	14.9	Sunny	0.03	1.32	1896.5
13-Oct-08	3.7177	3.8897	1.36	1.36	21293.9	21317.9	24.0	88.1	Sunny	0.17	1.36	1952.6
18-Oct-08	3.7110	3.7638	1.32	1.32	21317.9	21341.9	24.0	27.7	Sunny	0.05	1.32	1906.6
24-Oct-08	3.6223	3.6806	1.33	1.33	21341.9	21365.9	24.0	30.3	Sunny	0.06	1.33	1921.0
30-Oct-08	3.7219	3.8386	1.33	1.33	21365.9	21389.9	24.0	60.8	Sunny	0.12	1.33	1921.0

Min 14.9 Max 88.1 Average 44.4

Remark: Bold value indicated an Action level exceedance

Bold & Italic value indicated an Limit level exceedance

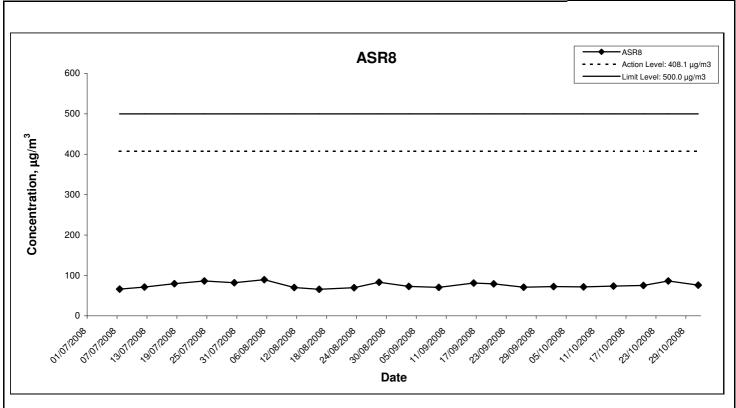

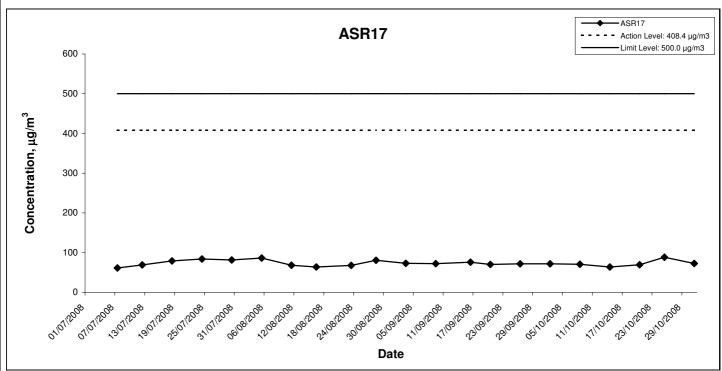



ENSR AECOM

Contract No. SS M333 Reprovisioning of Diamond Hill Crematorium

Graphical Presentation of 1-hour TSP Monitoring Results for Location ASR8 and ASR17

SCALE	N.T.S.	DATE		2008	3
CHECK	JCHL	DRAWN		PNW	Υ
JOB NO.		APPENDI:	K		Rev
	60016796		F		-

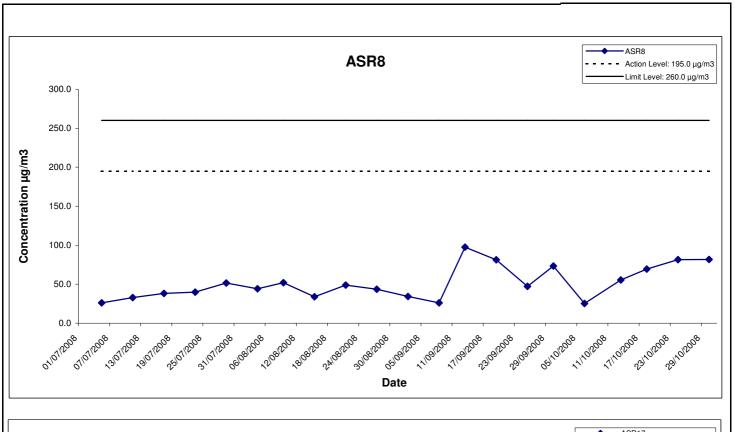

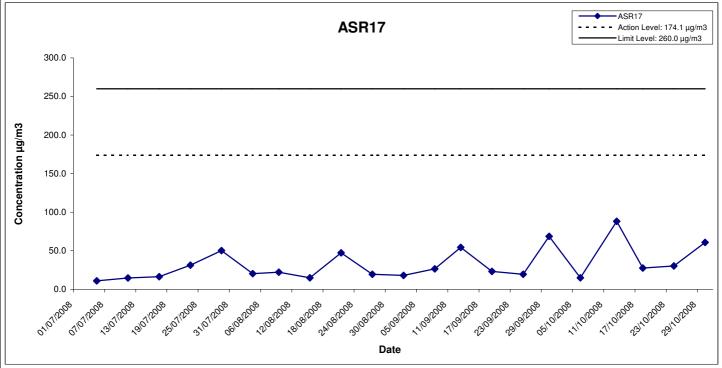

ENSR | AECOM

Contract No. SS M333 Reprovisioning of Diamond Hill Crematorium

Graphical Presentation of 24-hour TSP Monitoring Results for Location ASR8 and ASR17

SCALE	N.T.S.	DATE	2008	8
CHECK	JCHL	DRAWN	PNW	Υ
JOB NO.	60016796	APPENDIX	F	Rev -

Appendix G Noise Monitoring Results

Daytime Noise Monitoring Results at Station SR3

Date	Weather	Noise	Level for	30-min, d	B(A) ⁺	Baseline Noise	Calculated Construction Noise	Limit Level,	Exceedance
Date	Condition	Time	L90	L10	Leq	Level, dB(A)	Level, dB(A)	dB(A)	(Y/N)
02-Oct-08	Sunny	10:28	64.9	72.0	68.8	65.1	*Note	70	N
08-Oct-08	Sunny	9:57	62.5	70.4	66.8	65.1	*Note	70	N
14-Oct-08	Sunny	10:03	58.4	69.1	67.0	65.1	*Note	70	N
20-Oct-08	Sunny	10:03	60.3	69.5	67.4	65.1	*Note	70	N
31-Oct-08	Sunny	10:05	61.1	69.0	66.7	65.1	*Note	70	N
		Min	58.4	69.0	66.7				
		Max	64.9	72.0	68.8				
		Average	61.4	70.0	67.3				

Daytime Noise Monitoring Results at Station SR4

Date	Weather	Noise	e Level for	30-min, d	B(A) ⁺	Baseline Noise	Calculated Construction Noise	Limit Level,	Exceedance
Bato	Condition	Time	L90	L10	Leq	Level, dB(A)	Level, dB(A)	dB(A)	(Y/N)
02-Oct-08	Sunny	9:28	64.0	70.9	67.7	65.6	*Note	70	N
08-Oct-08	Sunny	9:11	59.5	67.2	65.4	65.6	*Note	70	N
14-Oct-08	Sunny	9:18	56.7	68.6	66.1	65.6	*Note	70	N
20-Oct-08	Sunny	9:08	59.6	68.0	65.7	65.6	*Note	70	N
31-Oct-08	Sunny	9:19	61.0	68.8	66.2	65.6	*Note	70	N
		Min	56.7	67.2	65.4				
		Max	64.0	70.9	67.7				
		Average	60.2	68.7	66.2				

Daytime Noise Monitoring Results at Station SR6

Date	Weather	Noise Level for 30-min, dB(A) ⁺			Baseline Noise	Calculated Construction Noise	Limit Level,	Exceedance	
Condition		Time	L90	L10	Leq	Level, dB(A)	Level, dB(A)	dB(A)	(Y/N)
02-Oct-08	Sunny	11:19	56.6	64.1	62.2	68.5	*Note	75	N
08-Oct-08	Sunny	10:37	55.0	62.5	59.8	68.5	*Note	75	N
14-Oct-08	Sunny	10:49	54.4	60.1	58.5	68.5	*Note	75	N
20-Oct-08	Sunny	10:57	57.5	62.7	60.1	68.5	*Note	75	N
31-Oct-08	Sunny	10:54	57.7	62.6	60.3	68.5	*Note	75	N
		Min	54.4	60.1	58.5	_			
		Max	57.7	64 1	62.2				

60.2


62.4

+ - Façade measurement

Bold & Italic value indicated an Limit level exceedance

Note: Measured noise level is less than the baseline noise level.

Average

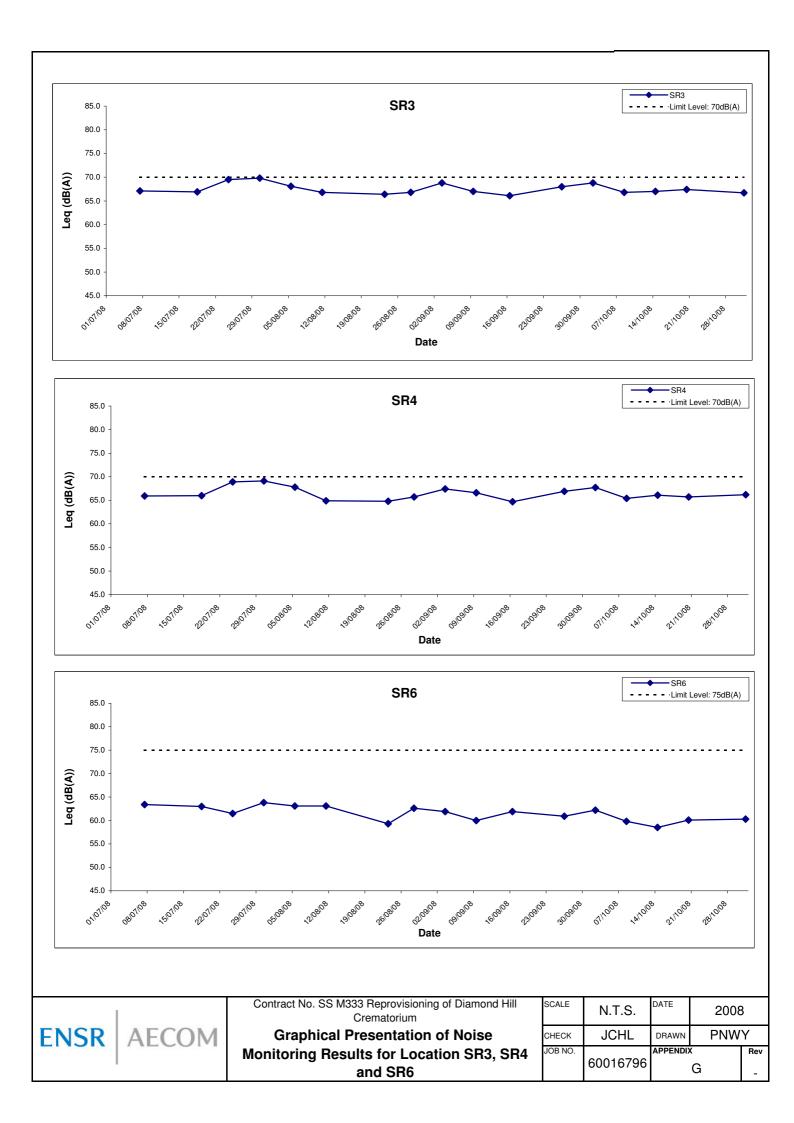

Inspection Information

Date	8 Oct 2008
Time	9:45 am

Remarks/Observations

Water Quality

1. Stagnant water was accumulated on site. The Contractor was reminded to clean up the stagnant water regularly to prevent accumulation.

Air Quality

2. No proper mitigation measure was provided for excavated materials. The Contractor was reminded to spray the excavated materials with water during handling.

Noise

No violation was observed in this site inspection.

Waste/Chemical Management

No violation was observed in this site inspection.

Others

No violation was observed in this site inspection.

Inspection Information

Date	13 Oct 2008
Time	9:30 am

Remarks/Observations

Water Quality

1. Stagnant water was accumulated on site. The Contractor was reminded to clean up the stagnant water regularly to prevent accumulation.

Air Quality

2. No proper mitigation measure was provided for excavated materials. The Contractor was reminded to spray the excavated materials with water during handling.

Noise

No violation was observed in this site inspection.

Waste/Chemical Management

3. Unsorted C&D wastes were accumulated in the site areas. The Contractor was reminded to sort the C&D wastes properly and remove the C&D wastes regularly.

Others

No violation was observed in this site inspection.



Inspection Information

Date	20 Oct 2008
Time	9:35 am

Remarks/Observations

Water Quality

1. Stagnant waters were accumulated on site. The Contractor was reminded to clean up the stagnant water regularly to prevent accumulation.

Air Quality

- 2. Following up the previous audit, the excavated materials were removed in this site inspection.
- 3. Stockpile of sands were placed near Hall 4 without proper dust mitigation measure. The Contractor was reminded to provide proper dust mitigation measure for all stockpiles.
- 4. Opened cement bags were placed on site without proper dust mitigation measure. The Contractor was reminded to cover the cement bags after use.

Noise

No violation was observed in this site inspection.

Waste/Chemical Management

The Contractor was reminded to sort the C&D wastes properly and remove the C&D wastes regularly.

Others

No violation was observed in this site inspection.

Inspection Information

Date	27 Oct 2008
Time	9:30 am

Remarks/Observations

Water Quality

1. Stagnant water was accumulated near EVA road. The Contractor was reminded to clean up the stagnant water regularly to prevent accumulation.

Air Quality

2. No proper mitigation measure was provided for excavated materials. The Contractor was reminded to spray the excavated materials with water during handling.

Noise

No violation was observed in this site inspection.

Waste/Chemical Management

3. Following up the previous audit, C&D wastes were sorted on designated area on site in this inspection.

Others

No violation was observed in this site inspection.



Appendix I Status of Environmental Permits/Licenses

Permit No.	Valid Period		Section				Status	
Permit No.	From	То		ecuc)11		Status	
Environmental Permit & Further Environmental Permit								
EP-179/2004/C	5 Dec 2007	N/A	Reprovisioning Crematorium	of	Diamond	Hill	Valid	
Registration as a C	Registration as a Chemical Waste Producer							
5213-288-C3108-	6 Dec	N/A	Reprovisioning	of	Diamond	Hill	Valid	
10	2004		Crematorium					
Water Discharge Li	cense							
RE/C0202/288/2	16 Oct	31 Mar	Reprovisioning	of	Diamond	Hill	Valid	
	2007	2010	Crematorium					
Construction Noise	Construction Noise Permit							
GW-RE0262-08	19 Sep	15 Dec	Reprovisioning	of	Diamond	Hill	Valid	
	2008	2008	Crematorium					

Appendix J – Environmental Mitigation Implementation Schedule

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
Air Quality Mitigation Measures					
Special air pollution control systems shall be installed and operate to reduce the emissions of air pollutants to acceptable levels	New cremators in New Crematorium	Arch SD	Design, Construction, Demolition and Operation stage	BPM/APCO	V
FEHD shall apply for a Specified Process License under the APCO	New Cremators in the New Crematorium / prior to operation	FEHD	Construction, Demolition and Operation stage	APCO	N/A
The efflux velocity of chimney shall be at least 15 m/s, the design diameter of the chimneys shall be 0.22 m and 0.30 m, the design chimney height shall be 101mP.D. (28.5m above ground), for 170 kg and 250 kg cremators respectively	Chimney of New Crematorium / design and construction stages	Arch SD	Design and Construction stage	BPM/APCO	N/A
If the interior wall of existing cremators and chimney are confirmed dioxins contaminated, special precautions shall be taken avoid fugitive emissions of dioxin contaminated materials	Cremator room and chimney in Existing Crematorium / demolition	Arch SD/Contractor	Demolition stage		N/A
Sufficient water spraying should be applied during the construction work, the fugitive dust generated from general construction dust would be reduced by 90%	Project site / construction and demolition stages	Arch SD, contractor	Construction and Demolition stage	APCO	V
Carry out a confirmatory test of dioxins in the depositions on chimney wall, flue gas ducting and combustion chambers when the existing Crematorium is shut down	Chimney, flue and cremators in Existing Crematorium / decommissioning	FEHD, Arch SD	Demolition stage		N/A
If the dioxin level of surface deposition is between 1 and 10 ppb I-TEQ, it is classified as moderately contaminated with dioxins. The demolition work site should be covered up to avoid emission of fugitive dust during demolition	Chimney, flue and cremators in Existing Crematorium / decommissioning	Arch SD 3	Demolition stage		N/A

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
If the dioxin level of surface deposition exceeds 10 ppb I-TEQ, it is classified as severely dioxin-contaminated waste. If it is confirmed that the existing facilities are severely contaminated with dioxins, a special decommissioning method – Containment method – would be adopted	Chimney, flue and cremators in Existing Crematorium / decommissioning	Arch SD 3	Demolition stage		N/A
All the demolition waste would be carefully handled, sealed and treated as chemical waste. The waste collector shall be responsible for preventing fugitive dust emission when handling the demolition waste	Chimney, flue and cremators in Existing Crematorium / demolition stage	Arch SD, contractor	Demolition stage		V
Employ a registered asbestos contractor to remove asbestos containing material during the demolition of the existing crematorium building	Cremator room in Existing Crematorium / decommissioning	Arch SD, contractor	Demolition stage	APCO	N/A
Submit a formal AIR and Asbestos Abatement plan signed by a registered asbestos consultant to the Authority for approval under APCO 28 days prior to the start of any asbestos abatement work.	Cremator room in Existing Crematorium / decommissioning	Arch SD, consultant	Demolition stage	APCO	N/A
When removing asbestos containing materials, enclosure of the work area; containment and sealing for the asbestos containing waste; provision of personal decontamination facility; use of personal respiratory/protection equipment; use of vacuum cleaner equipped with highefficiency air particulate (HEPA) filter for cleaning up the work area; and carry out air quality monitoring during the asbestos abatement work	Cremator room in Existing Crematorium / decommissioning	Arch SD, consultant	Demolition stage	APCO	N/A
Appoint qualified personnel to carry out the asbestos containing material removal work, including a registered asbestos contractor to carry out the work; a registered asbestos supervisor to supervise the work; a registered asbestos laboratory to monitor the air quality, and a registered asbestos consultant to supervise and certify the asbestos abatement work.	Cremator room in Existing Crematorium / decommissioning	Arch SD, consultant	Demolition stage	APCO	N/A

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
Erect a site barrier with the height of no less than 2.4m to enclose the construction site Apply frequent water spraying to ensure the surface of the construction site sufficiently wet to reduce fugitive dust due to wind erosion and transportation on unpaved haul road Cover up stockpiles of fill material and dusty material Install a vehicle-cleaning system at the main entrance of the construction site to clean up the vehicles before leaving the site The Air Pollution Control (Construction Dust) Regulation shall be followed for fugitive dust control	Project site / construction and demolition stages	Contractor	Construction and Demolition stage	APCO, Air Pollution Control (Construction Dust) Regulation	•
No more than 6 cremators (including both the existing and new ones) are in operation during commissioning test of new cremators. The commissioning test of each new cremator shall be recorded by a log book	Existing and new cremators in Exiting and New Crematorium / text and commissioning	Arch SD/FEHD/ Contractor	Construction stage		N/A
Special air pollution control systems shall be installed and operate to reduce the emissions of air pollutants to acceptable levels	New cremators in New Crematorium / all stages	Arch SD	Design, Construction, Demolition and Operation stage	BPM/APCO	N/A
Conduct baseline and regular 1-hour and 24-hour TSP monitoring.	A8 and A17 / baseline monitoring prior to Phase I & II works and regular monitoring throughout Phase I & II works	Contractor	Construction and Demolition stage	APCO, EM&A Guidelines for Development Projects in Hong Kong	V
When the demolition material is confirmed to have ACM, monitoring for asbestos fibre would be carried out at the boundary of the construction site for reassurance purposes as per the requirement of future	Construction site boundary / demolition	Contractor	Demolition stage	Asbestos Study Report, AIR and AAP to be submitted under	N/A

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
license for asbestos abatement, though it is not expected that asbestos fibre would be liberated from the demolition of the Existing Crematorium building.				APCO, future licence for asbestos abatement (if any)	
Noise Mitigation Measures					
Select quiet plant, which is defined as PME with a sound power level lower than that specified in GW-TM. Examples of quiet plant can be referred to those listed in British Standard BS5228.	Project site / construction and demolition stages	Contractor	Construction and Demolition stages	GW-TM	√
Where practicable, use movable barriers of 3 to 5 m height with a small cantilevered upper portion and skid footing can be located within a few metres from a stationary plant (e.g. generator, compressor, etc.) and within about 5 m for a mobile equipment (e.g. breaker, excavator, etc.), especially in the vicinity of SR3, SR4 and SR6. The purpose-built noise barriers or screens shall be constructed of appropriate materials with a minimum superficial density of 15kg/m2.	Project site / construction and demolition stages	Contractor	Construction and Demolition stages	NCO	N/A
 Only well-maintained plant should be operated on site and plant should be regularly serviced during the construction works Plant that is used intermittently should be turned off or throttled down when not in active use Plant that is known to emit noise strongly in one direction should be oriented to face away from NSRs Silencers, mufflers and enclosures for plant should be used where possible and maintained adequately throughout the works Where possible mobile plant should be sited away from NSRs 	Project site / construction and demolition stages	Contractor	Construction and Demolition stages	NCO	V

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
Stockpiles of excavated materials and other structures such as site buildings should be used effectively to screen noise from the works					
Liaise with the school and the Examination Authority to ascertain the dates and times of examination periods during the course of the construction/ demolition works so as to avoid any noisy activities during these periods. Programme of the on-site works should hence be well programmed such that the noisier construction activities would not be coincided with the examination of the schools.	Project site / construction and demolition stages	Contractor	Demolition stage	NCO	1
Conduct regular noise monitoring.	SR 3, SR 4 and SR 6 / Phase I & II works	Contractor	Demolition stage	NCO, EM&A Guidelines for Development Projects in Hong Kong	٧
Land Contamination Mitigation Measures					
Additional site investigations in areas of the site that are currently in use and cannot be readily accessed. These investigations will be carried out once the existing facility has been decommissioned. The additional site investigations are required in the vicinity of the existing CLP secondary substation, and around the cremators and flues inside the crematorium building. Once access to these areas is available, a sampling and analysis plan will be prepared for approval by EPD, additional investigations will take place, and the need for remedial works will be determined. Any remedial works required will be in addition to those described in this current report.	CLP secondary substation and cremator room/ demolition stage (Phase I – CLP secondary substation; Phase II – cremator room)	Contractor	Demolition stage	ProPECC PN 3/94	V
Once the Existing Crematorium has ceased operating during Phase II, confirmatory surface	Locations S1 to S6 specified in the	Contractor	Demolition stage	ProPECC PN 3/94	N/A

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
samples will be taken from the samples points S1 to S6 at a depth of 0.1m, and these samples will be analysed for the same suite of determinands (i.e. dioxins, metals and PAH) in order to confirm that no further contamination has occurred. The Remediation Action Plan will be revised on the basis of these results.	CAP/demolition				
The underground fuel storage tank and associated pipework will be removed as part of the site formation works. The base of the excavations will be inspected during and after tank removal by a suitably experienced environmental specialist in order to determine whether there is any visual or olfactory evidence of fuel contamination. If such contamination is suspected, then confirmatory soil sampling will be carried out, and the samples analysed for TPH.	Underground fuel storage tank/during and after tank removal	Contractor	Demolition stage	ProPECC PN 3/94 and Guidance Notes for Investigation and Remediation of Contaminated Sites of Petrol Filling Stations, Boatyards and Car Repair / Dismantling Workshops	N/A
Summary of remediation works at locations S3 and S5:					
1. Mark out 5m radius around S3 and S5 2. Excavate to depth of 0.5m 3. Transport to landfill site for final disposal4. Take 4 samples from edges of excavation and one sample from base of excavation, analyse for lead and tin 5. If the results exceed Dutch B Levels, extend excavation to a further 5 m radius and 0.5 m depth in the quadrant where the contaminated samples is encountered and repeat steps 3 and 4 6. If the results less than Dutch B Levels, then remediation completed.	Locations S3 and S5 specified in CAP/demolition	Contractor	Demolition stage	ProPECC PN3/94	N/A

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
During removal of the underground fuel storage tank, appropriate precautions should be taken to avoid contamination. All fuel tanks and associated pipework should be emptied prior to any demolition work being undertaken. Any remaining sludge or sediment in the tanks or pipework should be removed and disposed of as chemical waste in accordance with the appropriate regulations for disposal of such material.	Underground fuel storage tank / Phase II demolition	Agent Contractor	Demolition stage	ProPECC PN 3/94 and Guidance Notes for Investigation and Remediation of Contaminated Sites of Petrol Filling Stations, Boatyards and Car Repair / Dismantling Workshops	N/A
Should contamination be encountered beneath the fuel tank or the CLP secondary substation, further remedial work will be required. Such potential contamination would consist of either TPH (in the case of the fuel tank) or PCBs (in the case of the CLP secondary substation). As a realistic worst-case estimate, the PCB contaminated soil at CLP secondary substation may require stabilisation with cement prior to disposal to landfill. A realistic worst case estimate is that the volume of TPH contaminated soil at underground storage tank would require landfill disposal.	CLP secondary substation /Phase I demolition and underground fuel tank / Phase II demolition	Contractor	Demolition stage	ProPECC PN 3/94 and Guidance Notes for Investigation and Remediation of Contaminated Sites of Petrol Filling Stations, Boatyards and Car Repair / Dismantling Workshops	N/A
Health and Safety Precautions during Remedial Works					
The site workers engaged in the remedial works should be provided with adequate personal protective equipment, which should include: • Protective footwear; • Gloves; • Dust masks; and • Overalls. A clean area should be provided, equipped with washing facilities. Eating, drinking and smoking should only be permitted within designated "clean" areas after washing. Excavated material should not be stockpiled, but should immediately be treated/transported to landfill on a daily basis	All areas requiring remedial works in Project site / demolition during Phases I and II	Contractor	Demolition stage	ProPECC PN 3/94 and Guidance Notes for Investigation and Remediation of Contaminated Sites of Petrol Filling Stations, Boatyards and Car Repair / Dismantling	N/A

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
Avoidance of Impacts on Water Quality during Remedial Works In order to avoid impacts on water quality during remedial works, care will be taken to minimise the mobilisation of sediment during excavation and transport. Measures to be adopted will be based on the recommendations set out in Practice Note for Professional Persons ProPECC PN1/94 "Construction Site Drainage". The results of the site investigation suggest that there is unlikely to be any requirement for dewatering of excavations, since groundwater was not encountered in any of the exploratory holes. The contractor carrying out the remedial works will be required to submit a method statement detailing the measures to be taken to avoid water quality impacts. Typical measures would include; • Carry out the works during the dry season (i.e. October to March) if possible; • Use bunds or perimeter drains to prevent run-off water entering excavations; • Sheet or otherwise cover excavations whenever rainstorms are expected to occur; • Minimise the requirements for stockpiling of material and ensure any stockpiles are covered; • Temporary on-wit stockpiling of contaminated materials should be avoided, and all excavated contaminated soils/materials should be disposed of on a daily basis; • Ensure that any discharges to storm drains pass through an appropriate silt trap.	All areas requiring remedial works in Project site / demolition during Phases I and II	Agent Contractor	Demolition stage	Workshops ProPECC PN 3/94, ProPECC PN1/94 and Guidance Notes for Investigation and Remediation of Contaminated Sites of Petrol Filling Stations, Boatyards and Car Repair / Dismantling Workshops	N/A
Waste Disposal Requirements during Remedial Works					
An application for permission to dispose of excavated material should be made to the Facilities Management Group of EPD three months prior to disposal. A "tripticket" system should be implemented. Each load of contaminated soil despatched to landfill should be	All areas requiring remedial works in Project site / demolition during Phases I and II	Contractor	Demolition stage	ProPECC PN 3/94, Waste Disposal Ordinance (Cap. 354), WBTC No. 21/2002 and	N/A

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
accompanied by an admission ticket. Vehicles leaving the site should be adequately sheeted to prevent dispersion of contaminated material during transport. The wheels of vehicles should be cleaned prior to leaving site, to prevent contaminated material leaving site on the wheels of vehicles.				Guidance Notes for Investigation and Remediation of Contaminated Sites of Petrol Filling Stations, Boatyards and Car Repair / Dismantling Workshops	
Compliance Report for Remedial Works				·	
Following completion of remediation works, a Remediation Report should be compiled and submitted, to demonstrate that the remediation works have been carried out in accordance with the Remediation Action Plan. The Remediation Report should include details of the excavation works carried out, records of material taken to landfill, and results of confirmatory testing, and should be submitted to EPD for approval before the commencement of building works.	All areas requiring remedial works in Project site / after completion of remediation works	Agent Contractor	Demolition stage	ProPECC PN 3/94 and Guidance Notes for Investigation and Remediation of Contaminated Sites of Petrol Filling Stations, Boatyards and Car Repair / Dismantling Workshops	N/A
Land Contamination Mitigation Measures		_			,
Conduct supplementary site investigation for TPH and PCB in soil samples.	CLP substation / after decommissioning but prior to demolition during Phase I work	Contractor	Demolition stage	CAR, RAP, future sampling and analysis plan	V
Conduct confirmatory testing of PAH, dioxins and metals (the "Dutch List") in soil samples.	S1 to S6 / Phase II work	Contractor	Construction and Demolition stages	CAR, RAP, future sampling and analysis plan	N/A
If fuel contamination underneath the underground fuel tank is suspected, confirmatory soil sampling will be carried out for analysis of TPH.	Underneath the underground fuel tank / Phase II	Contractor	Demolition stages	CAR, RAP, future sampling and analysis plan	N/A
Conduct confirmatory testing of tin and lead in soil	S3 and S5 / during	Contractor	Construction and	CAR, RAP, future	N/A

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
samples to confirm all contaminated soil has been excavated.	Phase II work following excavation at each location		Demolition stages	sampling and analysis plan	
Waste Management Mitigation Measures					
Good Site Practice Obtain relevant waste disposal permits from the appropriate authorities, in accordance with the Waste Disposal Ordinance (Cap. 354), Waste Disposal (Chemical Waste) (General) Regulation (Cap. 354) and the Land (Miscellaneous Provision) Ordinance(Cap. 28) Prepare a Waste Management Plan approved by the Engineers / Supervising Officer of the Project in accordance with Environment, Transport and Works Bureau Technical Circular (Works) (ETWBTC(W)) 15/2003, Waste Management On Construction Sites Nominate an approved person, such as site manager, to be responsible for good site practice, arrangements for collection and effective disposal of all types of wastes generated on-site to appropriate facility Use waste haulier authorized or licensed to collect specific category of waste Establish trip ticket system as contractual requirement (with reference to Works Branch Technical Circular (WBTC) No. 21/2002) for monitoring of public fill and C&D waste at public filling facilities and landfills. Such activities should be monitored by the Environmental Team Provide training to site staff in terms of proper waste management and chemical waste handling procedures Separate chemical wastes for special handling and dispose them at licensed facility for treatment Establish routine cleaning and maintenance programme for drainage systems, sumps and oil interceptors Provide sufficient waste disposal points and regular	Project site/ design, construction and demolition stages	Contractor	Design, Construction and Demolition stages	Waste Disposal Ordinance (Cap. 354), Waste Disposal(Chemical Waste) (General) Regulation(Cap. 354) Land(Miscellaneou s Provision) Ordinance(Cap. 28) WDO, ETWBTC(W) 15/2003, WBTC No. 21/2002	

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
collection for disposal • Adopt measures to minimize windblown litter and dust during transportation of waste, such as covering trucks or transporting wastes in enclosed containers • Establish recording system for the amount of wastes generated, recycled and disposed of (including the disposal sites)					
Waste Management Plan The contractor should submit the Waste Management Plan to Engineer/Supervising Officer of the Project for approval. The Waste Management Plan should describe the arrangements for avoidance, reuse, recovery and recycling, storage, collection, treatment and disposal of different categories of waste to be generated from the activities of the Project and indicate the disposal location(s) of all waste. A trip ticket system shall be included in the Waste Management Plan.	Project site / design, construction and demolition stages	Contractor	Design, Construction and Demolition stages	Waste Disposal Ordinance (Cap. 354)	1
Waste Reduction Measures • Minimize the damage or contamination of construction material by proper storage and site practices • Plan and stock construction materials carefully to minimize amount of waste generated and avoid unnecessary generation of waste • Prior to disposal of C&D waste, wood, steel and other metals should be separated for reuse and / or recycling to minimize the quantity of waste to be disposed of to landfill • Minimize use of wood and reuse non-timber formwork to reduce the amount of C&D waste • Recycle any unused chemicals or those with remaining functional capacity as far as practicable • As far as practicable, segregate and store different types of waste in different containers, skips or stockpiles to enhance reuse or recycling of materials and their proper disposal • Encourage collection of aluminium cans, plastic bottles and packaging material (e.g. carton boxes) and office paper by individual collectors, separate labeled	Project site / construction and demolition stages	Agent Contractor	Construction and Demolition stages	WBTC No. 32/92, 5/98 and 19/99	1

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
bins should be provided to help segregate this waste from other general refuse generated by the work force					
Excavated Material Rock and soil generated from excavation should be reused for site formation as far as possible. In addition, excavated material from foundation work can be reused for landscaping as far as practicable to avoid disposal off-site.	Project site / construction and demolition stages	Contractor	Construction and Demolition stages	WBTC 12/2000	7
Construction and Demolition Material Careful design, planning and good site management can minimize over-ordering and generation of waste materials such as concrete, mortar and cement grouts. Standard formwork should be used as far as practicable, wooden formwork should be replaced by metal ones whenever possible. Alternatives such as plastic fencing and reusable site office structures can also minimize C&D waste generation. The contractor should recycle as much as possible of the C&D material on-site. Public fill and C&D waste should be segregated and stored in different containers or skips to enhance reuse or recycling of materials and their proper disposal. Materials such as concrete and masonry can be crushed and used as fill and steel reinforcing bar can be used by scrap steel mills. Different areas of sites should be designated for such segregation and storage. To maximize landfill life, government policy discourages the disposal of C&D materials with more than 20% inert material by volume (or 30% inert material by weight) at landfill. Inert C&D material (public fill) should be directed to an approved public filling area, where it has the added benefit of offsetting the need for removal of materials from borrow areas for reclamation purposes.	Project site / construction and demolition stages	Contractor	Design, Construction and Demolition stages	WBTC 5/98 and19/99	V
Contaminated Material – Further Contamination	CLP secondary	Contractor	Demolition	ProPECC PN	N/A

Recommended Mitigation Measures		Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status	
Location	Investigation Parameter	Investigation Period	_				
Cremators/ flue/chimney and surrounding areas	Asbestos (building structure)	Phase II					
CLP secondary substation	PCB, TPH (soil samples)	Phase I					
Cremators/ flue/chimney and surrounding areas	Dioxins, heavy metals, PAH (ash waste)	Phase II					
Surface soil around Existing Crematorim	Dioxins, heavy metals, PAH (soil sample)	Phase II					
information on at cremators / contaminated	Crematorim sample) Further contamination investigation shall provide information on the extent of contamination at cremators /flues / chimney as well as the quantity of contaminated materials requiring treatment and disposal.						

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
Samples of ash/particulate matters should be collected from within the cremators (including the bottom ash), chimney walls, flues and surrounding area of the Existing Crematorium for analysis of dioxin, heavy metals and PAHs by a HOKLAS accredited laboratory. A consultant experienced in the abatement of chemical wastes particularly the handling of DCM, should be appointed in order to assist with the evaluation of the information and prepare an abatement plan for the ash waste. Such a plan shall be submitted to EPD and the Labour Department (LD) to establish an acceptable and safe method for these potentially hazardous wastes. The abatement plan should identify the method of abatement, the performance criteria for the protection of workers and the environment and any emergency procedures and contingency measures required.	Cramator room in	Contractor	Domalition stage	DroDECC DN 2/04	N/A
It must be ensured that the treatment of ash wastes will comply with all routine construction site safety procedures would apply as well as statutory requirements under the Occupational Safety and Health Ordinance and Factories and Industrial Undertakings Ordinance. Due to the difficulties in establishing permanent and effective engineering controls, the protection of workers is likely to be at the worker level. A safe system of work must be provided, and training and suitable personal protective equipment as well as hygienic decontamination facilities should be provided. It is recommended that the methods to be adopted by the contractor for disposal of the ash waste should be agreed with LD and EPD.	Cremator room in Existing Crematorium / before demolition and after decommission	Contractor	Demolition stage	ProPECC PN 3/94	N/A
Sufficient time should be allocated to abate all ash waste with DCM/HMCM/PAHCM. The contractor should ensure the implications of dust				ProPECC PN 3/94 Code of Practice on	N/A

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
containing DCM/HMCM on air quality and workers health during the clean up work are mitigated. Since DCM is chemically related to Polychlorinated Biphenyl (PCB) wastes, the requirements of the Code of Practice on the Handling, Transportation and Disposal of (PCB) Wastes should be referenced when developing the abatement plan.				the Handling, Transportation and Disposal of (PCB) Wastes	
A land contamination site investigation was carried out under this EIA to determine disposal requirements for contaminated soil. Further site investigation on soil around CLP secondary substation is needed when decommissioned, which will be during Phase I of the works. In addition, confirmatory testing on DCM level in locations S1 to S6 will be required to identify the appropriate remediation and disposal requirements during Phase II of the works.	Locations S1 to S6 in CAP / prior to Phase II demolition		Demolition stage		N/A
Asbestos Containing Materials (ACM) Further asbestos assessment should be carried out when access to the cremators /flue /chimney is accessible after decommissioning and before demolition. An AMP should be prepared. The AAP should be prepared and submitted to EPD for approval prior to commencement of demolition works in accordance to the APCO. It is preferable to remove all ACM before actual demolition. A registered asbestos removal contractor should be employed to remove all ACM in accordance with the approved AAP which will be prepared in due course in accordance with the Code of Practice (COP) on Asbestos Control for Safe Handling of Low Risk ACM and Asbestos Work Using Full Containment or Mini Containment Method published by EPD. A registered asbestos consultant should also be employed to	Cremator room in Existing Crematorium / before demolition and after decommission	Contractor	Demolition stage	Code of Practice (COP) on Asbestos Control for Safe Handling of Low Risk ACM and Asbestos Work Using Full Containment or Mini Containment Method COP on Handling, Transportation and Disposal of Asbestos Waste under the Waste Disposal	N/A

Recommend	led Mitigation Meas	ures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
the contracto on Handling, Waste under	supervise abatement works. For the disposal of ACM, he contractor should observe the COP on Handling, Transportation and Disposal of Asbestos Waste under the Waste Disposal (Chemical Waste) (General) Regulation.					(Chemical Waste) (General) Regulation APCO	
Dioxin Conta Containing M Polyaromatic (PAHCM) fro Crematorium Proposed Co with DCM/HM	ining Materials (DCM laterials (HMCM) / Hydrocarbon Contain Demolition of the Entamination Classification) / Heavy Metal ning Materials Existing ation for Ash Waste	Cremator room in Existing Crematorium / before demolition and after decommission	Contractor	Demolition	ProPECC PN3/94 USEPA dioxin assessment criterion	N/A
Classificati on of Contamina tion	Dioxin Level in Ash Waste	Heavy Metal Level in Ash Waste					
Low/Non Contaminat ed by DCM / HMCM / PAHCM	< 1 ppb TEQ	< Dutch "B" List					
Moderately/ Severely Contaminat ed HMCM / PAHCM	< 1 ppb TEQ	≥ Dutch "B" List					
Moderately Contaminat ed DCM	≥ 1 and <10 ppb TEQ	Any level					

Recommend	Recommended Mitigation Measures		Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
Severely Contaminat ed DCM _	≥10 ppb TEQ	Any level					
Low/Non-Con PAHCM from Where the asl DCM/HMCM/I should avoid a demolition. Go measures me All such ash v disposal of at Subject to the investigation, ash waste is f	Demolition, Handling, Treatment and Disposal of Low/Non-Contaminated DCM /HMCM / PAHCM from Demolition of Existing Crematorium Where the ash waste contains low/non contaminated DCM/HMCM/PAHCM, the contractor should avoid ash waste becoming airborne during demolition. General dust suppression measures mentioned in Section 4 should be followed. All such ash waste can be directly disposal of at landfill. Subject to the findings of the further asbestos investigation, building structures where such ash waste is found but contaminated with asbestos should be dealt in accordance to 7.7.16.		Cremator room in Existing Crematorium / demolition	Contractor	Demolition stage	APCO	N/A
Moderately/So Moderately/So from Demolition Crematorium Procedure on disposal of Mo	,	nd d HMCM / PAHCM , treatment and	Cremator room in Existing Crematorium / demolition	Contractor	Demolition stage	Waste Disposal (Chemical Waste) (General) Regulation	N/A

Recommend	Recommended Mitigation Measures		Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
Site Preparation	The contractor should ensure the impacts of dust containing dioxin and/or heavy metals on air quality and workers health during the handling and transportation of the contaminated materials are mitigated. Except the cremators/flue/chimney, all removable items where moderately contaminated DCM or moderately/severely contaminated HMCM / PAHCM is identified should be removed as far as practicable to avoid obstructing the decontamination activities. Preliminary site decontamination of all debris shall be carried out using HEPA vacuum cleaner. The top portion of the chimney above the roof shall be enclosed by a chamber with three layers of polyethene sheets. At the entrance to the cremators /flues /chimney, a 3-chamber decontamination unit shall be constructed for entry and exit from the work area. The 3-chamber decontamination unit shall comprise a dirty room, a shower room and a clean room of at least 1m x 1m base each with 3 layers of fire retardant polyethene sheet where all workers shall carry out decontamination procedures before leaving the work area. Warning signs in both Chinese and English should be put up in conspicuous areas.					

Recommend	ed Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
	All workers shall wear full protective equipment, disposable protective coverall (such as Tyvek) (with hood and shoe covers), nitrile gloves, rubber boots (or boot covers), and full-face positive pressure respirators equipped with a combination cartridge that filters particulate and removes organic vapour. The organic vapour protection is an added protection against the unlikely exposure to any vapour. If ACM is identified in building structures where moderately contaminated DCM or moderately/severely contaminated HMCM / PAHCM is found, relevant abatement measures for building structures described in the AAP (see 7.7.16) should be implemented prior to the above site preparation.					
Decontamin ation, demolition and handling	The cremators/flue/chimney shall be removed from top down starting from the chimney. Any ash or residues attached to the cremators/flue/chimney or any other building structures shall be removed by scrubbing and HEPA vacuuming. Wastes generated from the containment or decontamination unit including the protection clothing of the workers such as the coverall, nitrile glove, rubber boots and materials used for wet wiping shall be disposed of at landfill site.	Cremator room in Existing Crematorium / demolition	Contractor	Demolition stage	Waste Disposal (Chemical Waste) (General) Regulation	N/A

Recommended Mitigation Measures		Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
	After completion of removal, decontaminate all surfaces by HEPA vacuum.					
Treatment	If ACM is identified in building structures where moderately contaminated DCM or moderately/severely contaminated HMCM / PAHCM is found, relevant abatement measures for building structures described in the AAP (see 7.7.16) should be implemented prior to the above decontamination, demolition and handling measures. The ash waste contains dioxin/heavy					
	metals and in its untreated state would be classified as a chemical waste under the Waste Disposal (Chemical Waste) (General) Regulation. While the quantity of DCM/HMCM is not expected to be significant, the levels of dioxin and heavy metals would affect the treatment option. Immobilization of the contaminated materials by mixing with cement followed by disposal at landfill (if landfill disposal criteria can be met) would be the most preferable option.					
	Rather than treating the already incinerated ash waste by incineration, the ash waste with moderately contaminated					

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
DCM or moderately/severely contaminated HMCM / PAHCM should be collected and stabilized to meet landfill disposal criteria of the Facilities Management Group (FMG) of EPD. In this case it is envisaged that the process would involve collection and mixing of the ash waste with cement. Pilot mixing and TCLP tests should be carried out to establish the appropriate ratio of cement to ash waste to the satisfaction of EPD. It is envisaged that the pilot tests would involve the mixing of say 5%, 10% and 15% ratios of cement to ash waste and three replicate of 300 mm cube blocks for each ratio. TCLP tests should then be used to establish the correct ratio of cement to ash waste to the satisfaction of EPD.					

Recommended Mitigation Measures		Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
Disposal	After immobilization of the ash waste by mixing with cement in the correct ratio as determined by the pilot mixing and TCLP test, the waste materials should be placed inside polyethene lined steel drums for disposal at landfill. Transparent plastic sheeting of 0.15 mm thickness low-density polyethene or PVC should be employed. The drums should be 16 gauge steel or thicker and fitted with double bung fixed ends adequately sealed and well labelled in new or good condition. The drums should be clearly marked "DANGEROUS CHEMICAL WASTE" in English and Chinese. Prior agreement of the disposal criteria from the FMG of EPD and agreement to disposal from the landfill operator must be obtained. As a fall back option, if the landfill disposal criteria cannot be met after immobilization of the ash waste, disposal at the CWTC should be considered. The building structures will be disposal of at landfill.	Cremator room in Existing Crematorium / demolition	Contractor	Demolition stage	Waste Disposal (Chemical Waste) (General) Regulation	N/A

Recommende	ed Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
	If ACM is identified in building structures where moderately contaminated DCM or moderately/severely contaminated HMCM / PAHCM is found, relevant disposal measures for building structures described in the AAP (see 7.7.16) should be implemented instead.					
Severely Con Demolition of Procedure for	andling, Treatment and Disposal of taminated DCM from the Existing Crematorium demolition, handling, treatment and everely Contaminated DCM	Cremator room in Existing Crematorium / demolition	Contractor	Demolition stage	Waste Disposal (Chemical Waste) (General) Regulation	N/A
Item	Procedure					
Site Preparation	Except the cremators/flue/chimney, all removable items where severely contaminated DCM is identified should be removed from the cremator room as far as practicable to avoid obstructing the decontamination activities. Preliminary site decontamination of all debris shall be carried out using HEPA vacuum cleaner. The walls, floor and ceiling of the cremator room where severely contaminated DCM located shall be lined with 3 layers of fire retardant polyethene sheets. The top portion of the chimney above the roof shall be enclosed by a chamber with three layers of polyethene sheets. At the entrance to the cremators/flues/chimney, a 3-chamber					

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
decontamination unit shall be constructed for entry and exit from the work area. The 3-chamber decontamination unit shall comprise a dirty room, a shower room and a clean room of at least 1m x 1m base each with 3 layers of fire retardant polyethene sheet where all workers shall carry out decontamination procedures before leaving the work area. Warning signs in both Chinese and English should be put up in conspicuous areas.					
Air movers should be installed at the cremator room, and at the bottom of the chimney to exhaust air from the work area. A stand-by air mover shall also be installed with each of the air movers. Sufficient air movement shall be maintained to give a minimum of 6 air changes per hour to the work area, and maintain a negative pressure of 0.05-0.15 inches of water within the work area throughout the entire course of the decommissioning works. A pressure monitor with printout records and audible alarm shall be installed at an easily accessible location to demonstrate that negative pressure is maintained. New pre-filters and HEPA filters shall be used on the air movers.					

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
the air movers should be kept on site for inspection upon request. The appointed contractor shall also check the differential pressure of the air mover to make sure the filter is not blocked. A differential pressure above 0.2 inches of water indicates that the filters would need to be changed.					
Smoke Test: before commencement of the decommissioning work, a smoke test with non-toxic smoke shall be carried out to ensure the air-tightness of the containment. Also check whether there are stagnant air pockets indicated by an aggregate of smoke that cannot effectively be extracted. After a successful test, switch on the air mover to exhaust smoke from the containment and to give a minimum of 6 air changes per hour, and check visually to see that the filters screen out the smoke effectively and if the pressure gauges read normal. If not, the air mover shall be sealed up and returned to the supplier workshop for necessary servicing, and replaced by a tested air mover. The normal reading pressure range for maintaining 6 air changes per hour shall be 1.5-4 mm/0.05-0.15 inches of water or equivalent	Cremator room in Existing Crematorium / demolition	Contractor	Demolition stage	Waste Disposal (Chemical Waste) (General) Regulation	N/A

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
(negative pressure). The au alarm's integrity should also be che the trigger shall be at <1.5 inches of water (negative pressure Otherwise securely seal up openings before switching off the air mover.	ecked and mm/0.05 e).				
Treatment of Waste/Worke Protection: the contractor's required to register as a Chemical W Producer. All workers shall protective equipment, disposable protective and shoe covers), nitrile gloves, rubb boot covers), and full-face pressure respirators equipper combination cartridge that it particulate and removes on vapour. The organic vapour is an added protection against the exposure to any vapour as necessary measure.	vaste Vaste Wear full tective vith hood er boots (or positive ped with a filters ganic r protection ee unlikely				
If ACM is identified in buildi structures where severely contaminated DCM is found, relevant abatement for building structures described AAP (see 7.7.16) should be implemented prior to the abatement of the abat	nt measures rribed in the				

Recommend	ed Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
Decontamin ation, demolition and handling	The cremators/flue/chimney shall be removed from top down starting from the chimney. Any ash or residues attaching to the cremators/flue/chimney or any other building structures shall be removed by scrubbing and HEPA vacuuming. The detached sections of the building structures where severely contaminated DCM is located shall be wrapped with 2 layers of fire retardant polyethene sheets. A third layer shall then be wrapped and secured with duct tape. Decontaminate the outer layer of the wrapped flue sections by wet wiping.	Cremator room in Existing Crematorium / demolition	Contractor	Demolition stage	Waste Disposal (Chemical Waste) (General) Regulation	N/A
	Wastes generated from the containment or decontamination unit including the fire retardant polyethene sheets, protection clothing of the workers such as the coverall, nitrile glove, rubber boots and materials used for wet wiping shall be disposed of at landfill site.	Cremator room in Existing Crematorium / demolition	Contractor	Demolition stage	Waste Disposal (Chemical Waste) (General) Regulation	N/A

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
The quantity of wastewater generated from the decontaminated process will be very small but the contractor should take precautionary measures as to minimize the quantity of contaminated water arising. Nevertheless, if any contaminated wastewater needs to be discharged out of the site, it has to be properly treated to WPCO requirements with prior agreement from EPD on discharge standards. After completion of removal, decontaminate the surface where severely contaminated DCM was located, including the wrapped incinerator furnace and flue sections left within the containment, by wet wiping and HEP vacuum. Then spray the innermost layer of the fire retardant polyethene sheet covering the wall, ceiling and floor with PVA. Upon drying, peel off this innermost layer of the polyethene sheet covering the containment and dispose of at landfill site.	A A				

Recommende	ed Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
	Repeat the above decontamination procedure for the second innermost layer of fire retardant polyethene sheet by wet wiping and HEPA vacuuming. After spraying with PVA, peel off this second innermost layer of the polyethene sheet covering the wall, ceiling and floor and dispose of at landfill site. Finally, the last layer of polyethene sheet shall then be taken down after spaying with PVA and be disposed as contaminated wastes.					
Treatment and disposal	If ACM is identified in building structures where severely contaminated DCM is found, relevant abatement measures for building structures described in the AAP (see 7.7.16) should be implemented prior to the above decontamination, demolition and handling measures. Waste to be disposed to CWTC: all contaminated ash waste with severely contaminated DCM removed and the used HEPA filters shall be sent to	Cremator room in Existing Crematorium / demolition	Contractor	Demolition stage	Waste Disposal (Chemical Waste) (General) Regulation	N/A
	CWTC in Tsing Yi. The total volume should be confirmed by further site investigation.	domonium			regulation	

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
Waste to be Disposed of at Landfill: other wastes including the building structures and its associated panels as well as wastes generated from this decommissioning works are also considered as contaminated waste and shall be disposed of at a designated landfill. Wastes generated from this decommissioning works refer to the polyethene wrapping sheets for the building structures, waste generated from the dismantlement of the containment and decontamination units, and cloth used in wet wrapping, etc. as previously described in this section. They shall be placed into appropriate containers such as drums, jerricans, or heavy duty and leak-proof plastic as a prudent approach. A disposal permit has to be obtained from the Authority. The disposal trip ticket is required to be made available as record after disposal. If ACM is identified in building structures where severely contaminated DCM is found, relevant disposal measures for building structures described in the AAP (see 7.7.16) should be implemented in prior to the above disposal measures.					

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
Dioxin Containing Materials (DCM) / Heavy Metal Containing Materials (HMCM) /Polyaromatic Hydrocarbon Containing Materials (PAHCM) / Total Petroleum Hydrocarbon Containing Materials (TPHCM) / Polychlorinated Biphenyls Containing Materials (PCBCM) from Soil Remediation at the Project Site					
According to the CAR and RAP, less than 100 m3 of soil would require disposal at landfill. Relevant health and safety procedure, waste disposal requirements and compliance report are as detailed in Figure 6.3. Mitigation measures to avoid fugitive dust emission mentioned in S.4.7.2 should also be observed.	Locations S3 and S5 of CAP / demolition	Contractor	Demolition stage	ProPECC PN3/94 APCO	N/A
In addition, after decommissioning but before demolition of the Existing Crematorium, further investigations during Phase I of the works at the vicinity of CLP secondary substation should also be carried out to determine if additional remediation (in addition to the current RAP) is required. Confirmatory test on levels of DCM, HMCM and PAHCM in locations S1 to S6 during Phase II of the works is also required to determine any further remediation /treatment/disposal. In addition, the ash waste in cremator/chimney/flues should also be collected for the testing of DCM/HMCM/PAHCM during Phase II of the works. The sampling and analysis plan should be prepared and submitted to EPD for approval.	CLP secondary substation / after decommission and before demolition	Contractor	Demolition stage	ProPECC PN3/94	N/A
All the aforementioned ACM / DCM / HMCM / PAHCM / TPHCM / PCBCM are classified as chemical waste. In addition to the measures mentioned above, the packaging, labelling and storage practices of chemical waste as stipulated in the following paragraphs should also be applied to these contaminated materials.	Project site / demolition	Contractor	Demolition stage	Waste Disposal (Chemical Waste) (General) Regulation	N/A

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
Chemical Waste All the chemical waste should be handled according to the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes. The Contractor should register as a chemical waste producer. The chemical waste should be stored and collected by an approved contractor for disposal at a licensed facility in accordance with the Waste Disposal (Chemical Waste) (General) Regulation. Containers used for the storage of chemical waste should:	Project site / demolition	Contractor	Demolition stage	Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes. Waste Disposal (Chemical Waste) (General) Regulation.	•
 Be suitable for the substance they are holding, resistant to corrosion, maintained in good condition, and securely closed; 					
 Have a capacity of less than 450 L unless the specifications have been approved by the EPD; and 					
Display a label in English and Chinese in accordance with instructions prescribed in Schedule 2 of the Waste Disposal (Chemical Waste) (General) Regulation.					
The storage area for chemical waste should:					
 Be clearly labeled and used solely for the storage of chemical waste; 					
Be enclosed on at least 3 sides;					
 Have an impermeable floor and bunding, of capacity to accommodate 110% of the volume of the largest container or 20% by volume of the chemical waste stored in that area, whichever is the greatest; 					
Have adequate ventilation;					
Be covered to prevent rainfall from entering (water collected within the bund must be tested and disposal as chemical waste if necessary); and					
Be properly arranged so that incompatible					

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
materials are adequately separated.					
 The chemical waste should be disposed of by: A licensed waste collector; A facility licensed to receive chemical waste, such as the CWTC at Tsing Yi, which offers chemical waste collection service and can supply the necessary storage containers; and/or A waste recycling plant as approved by EPD. 	Project site / demolition	Contractor	Demolition stage	Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes. Waste Disposal (Chemical Waste)	N/A
				(General) Regulation.	
General Refuse General refuse should be stored in enclosed bins or compaction units separated from C&D and chemical wastes. A reliable waste collector should be employed by the contractor to remove general refuse from the site, separately from C&D and chemical wastes, on a daily or every second day basis to minimize odour, pest and litter impacts. The burning of refuse on construction sites is prohibited by law. Aluminum cans are often recovered from the waste stream by individual collectors if they are segregated or easily accessible. Therefore, separately labeled bins for deposit of these cans should be provided if feasible. Similarly, plastic bottles and carton package material generated on-site should be separated for recycling as far as practicable. Site office waste should be reduced through recycling of paper if volumes are large enough to warrant collection. Participation in a local collection scheme should be considered if one is available.	Project site / construction and demolition stages	Contractor	Construction and Demolition stage		•
Conduct supplementary site investigation for asbestos in building structures and for dioxins, metals (the "Dutch List") and PAH in ash/particular	Around existing cremators, chimney and flues	Contractor	Demolition stage	AIR, AMP/AAP to be submitted under	N/A

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
matter samples.	inside cremator room / after decommissioning but prior to demolition during Phase II work			APCO, future supplementary site investigation plan	
Landscape and Visual Mitigation Measures					
The identification of the landscape and visual impacts will highlight those sources of conflict requiring design solutions or modifications to reduce the impacts and, if possible, blend the development with the surrounding landscape. The proposed landscape mitigation measures will be described and illustrated by means of site plans and photomontage and take into account factors including:	Project site / design, construction and demolition stages	Contractor/FEH D/Arch SD	Construction and Demolition stage	EIAO-TM	N/A
Screen planting					
 Transplanting of mature trees with good amenity value where appropriate 					
Conservation of topsoil for reuse					
 Sensitive alignment of structures to minimise disturbance to surrounding vegetation 					
Reinstatement of areas disturbed during construction					
 The design and finishes / colours of architectural and engineering structures such as terminals and pylons 					
Existing views, views of the development with no mitigation, views with mitigation at day one of operation and after 10 years of operation					
Tree transplanting: The tree survey has identified the trees which will be affected by the development and which could be considered for	Project site / construction and demolition as well	Contractor/Arch SD	Construction and Demolition stage	WBTC 7/2002, WBTC 14/2002, EIAO-TM	N/A

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
transplanting prior to commencement of construction work. Felling is considered as a last resort and every effort should be made to transplant the many good trees of high amenity value to either nearby suitable sites within the cemetery or to available space in FEHD's Wo Hop Shek Crematorium pending identification of an alternative site. The feasibility of transplanting will depend on a number of factors such as size, health and species of the tree. Adequate time (a minimum of 4 months) should be allowed for preparing trees for transplanting. Weekly inspection of tree protection measures as well as monitoring of tree transplant operations during both phases should be implemented. Particular care should be taken to save the 9 nos. mature and semi-mature protected tree species and 12 nos. protected shrub and immature tree species identified. To give the protected species the best possible chance of survival it is recommended that they are relocated to sheltered and well maintained planted areas within the cemetery. The following measures for tree transplanting should be adopted: (a) Appoint a landscape contractor for the establishment and maintenance of the transplanted trees as well as any new tree planting for 12 months upon completion of the works. (b) Careful co-ordination of Phase I and II works to allow tree transplanting from Phase II site directly to Phase I site.	as operation stages				
Tree protection: Trees to be retained adjacent to works areas will be carefully protected by strong hoarding and if necessary additional protection to individual tree trunks to avoid damage by machinery. The hoarding will also prevent	Project site / construction and demolition stages	Arch SD	Construction and Demolition stage	WBTC 7/2002, WBTC 14/2002, EIAO-TM	N/A

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
contractors from compacting soil around tree roots or dumping materials. Reference should be made to the guidelines for tree protection in the Government publication "Tree Planting and Maintenance in Hong Kong".					
Topsoil conservation: Any topsoil excavated during construction will be carefully saved and stored to one side of the works area for reuse upon completion.	Project site / upon completion of construction works for each phase	Arch SD	Construction and Demolition stage	WBTC 7/2002, WBTC 14/2002, EIAO-TM	N/A
Replanting: Upon completion planting of ornamental trees and shrubs will be provided to the periphery of the new crematorium building to help screen and soften the overall appearance of the structure. In addition, a reprovisioned memorial garden with a lotus pond and ornamental planting will be incorporated in the deck area of the building. Since the majority of the new planting will be on the deck structure the selection of species will be more limited with emphasis on smaller trees and ornamental shrubs to comply with loading restrictions. Notwithstanding this site constraint on tree selection, a minimum of 1.2m soil depth will be provide for tree planting on the podium / roof structure for healthy establishment of the new tree planting.	Project site / upon completion of construction works for each phase	Arch SD	Construction and Demolition stage	WBTC 7/2002, WBTC 14/2002, EIAO-TM	N/A
Weekly inspections of tree protection measures as well as monitoring of tree transplant operations.	Project site / Phase I & II works	Project Landscape Architect	Construction and Demolition stage	Landscape Master Plan, Tree Planting and Maintenance in Hong Kong	N/A
Water Quality Mitigation Measures					
Construction and Demolition Phases – General To safeguard the water quality of the WSRs potentially affected by the Project works, the	Project site / construction and demolition stages	Contractor	Construction and Demolition stage	ProPECC PN 1/94	٧

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
contractor should implement appropriate mitigation measures with reference to the <i>Practice</i> Note for Professional Persons, Construction Site Drainage (ProPECC PN 1/94) published by EPD. Such measures are highlighted as follows.					
Construction and Demolition Phases - Construction and Demolition Run-off and Drainage Exposed soil areas should be minimized to reduce the potential for increased siltation, contamination of run-off and erosion. Any effluent discharge from the Project site is subject to the control of Water Pollution Control Ordinance (WPCO) discharge license and should be treated to meet the discharge standard set out in the relevant license. In addition, no site run-off should enter the stream on the eastern side of the Project site. Run-off impacts associated with the construction and demolition activities can be readily controlled through the use of appropriate mitigation measures, which include:	Project site / construction and demolition stages	Contractor	Construction and Demolition stage	ProPECC PN 1/94	
 Temporary ditches should be provided to facilitate run-off discharge into appropriate watercourses, via a silt retention pond 					
Boundaries of earthworks should be marked and surrounded by dykes					
Open material storage stockpiles should be covered with tarpaulin or similar fabric to prevent material washing away					
Exposed soil areas should be minimized to reduce the potential for increased siltation and contamination of run-off					
Earthwork final surfaces should be well compacted and subsequent permanent work should be immediately performed					
Use of sediment traps wherever necessary					

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
Maintenance of drainage systems to prevent flooding and overflow					
All temporary drainage pipes and culverts provided to facilitate run-off discharge should be adequately designed to facilitate rapid discharge of storm flows. All sediment traps should be regularly cleaned and maintained. The temporarily diverted drainage should be reinstated to its original condition, when the construction/demolition work is completed.					V
Sand and silt in wash water from wheel washing facilities should be settled out and removed from discharge into temporary drainage pipes or culverts. A section of the haul road between the wheel washing bay and the public road should be paved with backfall to prevent wash water or other site run-off from entering public road drains.					√
Oil interceptors should be provided in the drainage system downstream of any significant oil and grease sources. They should be regularly maintained to prevent the release of oil and grease into the storm water drainage system after accidental spillage. The inceptor should have a bypass to prevent flooding during periods of heavy rain, as specified in <i>ProPECC PN</i> 1/94.	Project site / construction and demolition stages	Contractor	Construction and Demolition stage	ProPECC PN 1/94	N/A
Construction and Demolition Phases - General Construction and Demolition Activities All the solid waste and chemical waste generated on site should be collected, handled and disposed of properly to avoid affecting the water quality of the nearby WSRs. The proper waste management measures are detailed in S.7.7.5-S.7.7.6.	Project site / construction and demolition stages	Contractor	Construction and Demolition stage	ProPECC PN 1/94	V
Construction and Demolition Phases - Sewage Generated from On-site Workforce	Project site / construction and	Contractor	Construction and Demolition stage	ProPECC PN 1/94	V

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
The sewage from construction work force is expected to be handled by portable chemical toilets if the existing toilets in the Project site are not adequate. Appropriate and adequate portable toilets should be provided by licensed contractors who will be responsible for appropriate disposal and maintenance of these facilities.	demolition stages				
Construction and Demolition Phases - Soil Remediation Activities Mitigation measures will need to be implemented during the currently identified soil remediation activities. If further land contamination investigation results (at CLP secondary substation during Phase I and at locations S1 to S6 during Phase II) confirm the needs for further soil remediation prior to demolition of the Existing Crematorium, relevant water quality mitigation measures (in addition to the current RAP) will need to be identified and implemented by the contractor. In addition, the mitigation measures recommended for minimizing water quality impacts for construction and demolition run-off and drainage as well as for general construction and demolition activities should also be adopted where applicable. In order to avoid impacts on water quality during further remedial works, care will be taken to minimise the mobilisation of sediment during excavation and transport. Measures to be adopted will be based on the recommendations set out in <i>Practice Note for Professional Persons ProPECC PN1/94 "Construction Site Drainage"</i> . The results of the site investigation suggest that there is unlikely to be any requirement for dewatering of	Project site / construction and demolition stages	Contractor	Construction and Demolition stage	ProPECC PN 1/94	

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
excavations, since groundwater was not encountered in any of the exploratory holes. The contractor carrying out the remedial works will be required to submit a method statement detailing the measures to be taken to avoid water quality impacts. Typical measures would include: Carry out the works during the dry season (i.e. October to March) if possible See bunds or perimeter drains to prevent run-off water entering excavations Sheet or otherwise cover excavations whenever rainstorms are expected to occur Minimise the requirements for stockpiling of material and ensure any stockpiles are covered Temporary on-site stockpiling of contaminated materials should be avoided, all excavated contaminated soils/materials should be disposed of on a daily basis Ensure that any discharges to storm drains pass through an appropriate silt trap					

Note:

Compliance of mitigation measure Non-compliance of mitigation measures Non-compliance but rectified by the contractor Not applicable ×

N/A

Appendix K Event and Action Plans

Table K.1 Event and Action Plan for Air Quality

EVENT	ACTION					
EVENT	ET	IEC	AR	CONTRACTOR		
ACTION LEVEL						
Exceedance for one sample	Identify source, investigate the cause of exceedance and propose remedial measures; Inform IEC and AR; Repeat measurement to confirm finding; Increase monitoring frequency to daily, if ET assessment indicates that exceedance is due to contractor's construction works.	Check monitoring data submitted by ET; Check Contractor's working method.	Notify Contractor.	Rectify any unacceptable practice; Amend working methods if appropriate.		
Exceedance for two or more consecutive samples	Identify source, investigate the cause of exceedance and propose remedial measures; Inform IEC and AR; Repeat measurements to confirm findings; Increase monitoring frequency to daily, if ET assessment indicates that exceedance is due to contractor's construction works; Discuss with IEC and Contractor on remedial actions required; If exceedance continues, arrange meeting with IEC and AR; If exceedance stops, cease additional monitoring.	Check monitoring data submitted by ET; Check Contractor's working method; Discuss with ET and Contractor on possible remedial measures; Advise the AR on the effectiveness of the proposed remedial measures; Supervise Implementation of remedial measures.	Confirm receipt of notification of exceedance in writing; Notify Contractor; Ensure remedial measures properly implemented.	Submit proposals for remedial actions to IEC within three working days of notification; Implement the agreed proposals; Amend proposal if appropriate.		
LIMIT LEVEL						
Exceedance for one sample	Identify source, investigate the cause of exceedance and propose remedial measures; Inform IEC, AR and EPD; Repeat measurement to confirm finding; Increase monitoring frequency to daily, if ET assessment indicates that exceedance is due to contractor's construction works; Assess effectiveness of Contractor's remedial actions and keep IEC, AR and EPD informed of the results.	Check monitoring data submitted by ET; Check Contractor's working method; Discuss with ET and Contractor on possible remedial measures; Advise the AR on the effectiveness of the proposed remedial measures; Supervise implementation of remedial measures.	Confirm receipt of notification of exceedance in writing; Notify Contractor; Ensure remedial measures properly implemented.	Take immediate action to avoid further exceedance; Submit proposals for remedial actions to IEC within three working days of notification; Implement the agreed proposals; Amend proposal if appropriate.		
Exceedance for two or more consecutive samples	Notify Contractor, IEC, AR and EPD; Identify source, investigate the cause of exceedance and propose remedial measures; Repeat measurement to confirm findings; Increase monitoring frequency to daily, if ET	Discuss amongst AR, ET, and Contractor on the potential remedial actions; Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the AR accordingly;	Confirm receipt of notification of exceedance in writing; Notify Contractor; In consultation with the IEC, agree with the Contractor on the remedial	Take immediate action to avoid further exceedance; Submit proposals for remedial actions to IEC within three working days of notification;		

EVENT	ACTION					
EVENI	ET IEC		AR	CONTRACTOR		
	assessment indicates that exceedance is due to contractor's construction works; 5. Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented; 6. Arrange meeting with IEC and AR to discuss the remedial actions to be taken; 7. Assess effectiveness of Contractor's remedial actions and keep IEC, AR and EPD informed of the results; 8. If exceedance stops, cease additional monitoring.	Supervise the implementation of remedial measures.	measures to be implemented; 4. Ensure remedial measures properly implemented; 5. If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated.	Implement the agreed proposals; Resubmit proposals if problem still not under control; Stop the relevant portion of works as determined by the AR until the exceedance is abated.		

Table K.2 Event and Action Plan for Construction Noise

EVENT	ACTION					
	ET	IEC	AR	CONTRACTOR		
Action Level	 Notify Contractor and IEC; Carry out investigation; Report the results of investigation to the IEC and Contractor; Discuss with the Contractor and formulate remedial measures; Increase monitoring frequency to check mitigation effectiveness, if ET assessment indicates that exceedance is due to contractor's construction work. 	Review the analysed results submitted by the ET; Review the proposed remedial measures by the Contractor and advise the AR accordingly; Supervise the implementation of remedial measures.	Confirm receipt of notification of exceedance in writing; Notify Contractor; Require Contractor to propose remedial measures for the analysed noise problem; Ensure remedial measures are properly implemented.	Submit noise mitigation proposals to IEC; Implement noise mitigation proposals.		
Limit Level	 Notify Contractor, IEC, AR and EPD; Identify source; Repeat measurement to confirm findings; Increase monitoring frequency, if ET assessment indicates that exceedance is due to contractor's construction work; Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented; Inform IEC, AR and EPD the causes and actions taken for the exceedances; Assess effectiveness of Contractor's remedial actions and keep IEC, AR and EPD informed of the results; If exceedance stops, cease additional monitoring. 	 Discuss amongst AR, ET, and Contractor on the potential remedial actions; Review Contractors remedial actions whenever necessary to assure their effectiveness and advise the AR accordingly; Supervise the implementation of remedial measures. 	Confirm receipt of notification of failure in writing; Notify Contractor; Require Contractor to propose remedial measures for the analysed noise problem; Ensure remedial measures properly implemented; If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated.	Take immediate action to avoid further exceedance; Submit proposals for remedial actions to IEC within 3 working days of notification; Implement the agreed proposals; Resubmit proposals if problem still not under control; Stop the relevant portion of works as determined by the AR until the exceedance is abated.		