QUARTERLY ENVIRONMENTAL MONITORING & AUDIT REPORT

Hip Hing - Ngo Kee Joint Venture

Hong Kong Convention and Exhibition Centre Expansion Project:

Quarterly Environmental Monitoring and Audit Report

(Aug 2008 - Oct 2008)

November 2008

Environmental Resources Management

21/F Lincoln House 979 King's Road Taikoo Place Island East, Hong Kong Telephone: (852) 2271 3000 Facsimile: (852) 2723 5660 E-mail: post.hk@erm.com http://www.erm.com

QUARTERLY ENVIRONMENTAL MONITORING & AUDIT REPORT

Hip Hing - Ngo Kee Joint Venture

Hong Kong Convention and Exhibition Centre Expansion Project:

Quarterly Environmental Monitoring and Audit Report (Aug 2008 - Oct 2008)

November 2008

Reference 0050690

For and on behalf of	
Environmental Resources Management	
Approved by: Dr. Andrew H. Jackson Signed:	
orgined.	
Position: Managing Director	•
Certified by:	
(Environmental Team Leader – Marcus Ip)	
Date: 28 November 2008	

This report has been prepared by Environmental Resources Management the trading name of 'ERM Hong-Kong, Limited', with all reasonable skill, care and diligence within the terms of the Contract with the client, incorporating our General Terms and Conditions of Business and taking account of the resources devoted to it by agreement with the client.

We disclaim any responsibility to the client and others in respect of any matters outside the scope of the above.

This report is confidential to the client and we accept no responsibility of whatsoever nature to third parties to whom this report, or any part thereof, is made known. Any such party relies on the report at their own risk.



NATURE & TECHNOLOGIES (HK) LIMITED 科技環保(香港)有限公司

Unit 2 & 3, 4/F., Wellborne Commercial Centre, 8 Java Road, North Point, Hong Kong. 香港北角渣華道8號威邦商業中心4樓2及3室 Tel電話:(852) 2877 3122 Fax傳真:(852) 2511 0922 Email電郵: enquiry@nt.com.hk Web page網址: http://www.nt.com.hk

Our Ref: 3.16/014/2006/it

27 November 2008

Maunsell Consultants Asia Ltd Grand Central Plaza, Tower 2 138 Shatin Rural Committee Road Shatin, N.T., Hong Kong

Attn: Ms Vera Chan

Dear Sir/Madam,

Hong Kong Convention Center Expansion Project

Quarterly Environmental Monitoring and Audit Report for August 2008 to October 2008
(Environmental Permit No. EP-239/2006/B)

With reference to the captioned document concerning the Quarterly EM&A report for August 2008 to October 2008 received from ERM dated 27 November 2008, we are pleased to provide our verification for the document pursuant to condition 3 of the Environmental Permit (EP) No. EP-239/2006/B.

Yours faithfully, Nature & Technologies (HK) Limited

Ir Dr Gabriel C K Lam Managing Director

cc: - Hong Kong Trade Development Council (Attn: Mr. K. F. Chan)

Hip Hing Ngo Kee Joint Venture (Attn: Mr. Eric Lau & Mr. William Tam)

- ERM (Attn: Mr. Marcus Ip)

CONTENTS

	EXECUTIVE SUMMARY	1
1	INTRODUCTION	1
1.1	PURPOSE OF THE REPORT	1
1.2	STRUCTURE OF THE REPORT	1
2	PROJECT INFORMATION	3
2.1	BACKGROUND	3
2.2	SITE DESCRIPTION	4
2.3	CONSTRUCTION ACTIVITIES	4
2.4	PROJECT ORGANISATION	4
2.5	STATUS OF ENVIRONMENTAL APPROVAL DOCUMENTS	4
3	ENVIRONMENTAL MONITORING METHODOLOGY	6
3.1	AIR QUALITY MONITORING	6
3.2	WATER QUALITY MONITORING	9
4	IMPLEMENTATION STATUS OF ENVIRONMENTAL PROTECTION REQUIREMENTS	ON 11
4.1	Environmental Site Auditing	11
4.2	EFFLUENT DISCHARGE SAMPLING	11
4.3	LANDSCAPE AND VISUAL MONITORING	11
4.4	EFFECTIVENESS OF MITIGATION MEASURES AND MONITORING	11
5	MONITORING RESULTS	13
5.1	AIR QUALITY	13
5.2	Water Quality	13
5.3	WASTE MANAGEMENT	13
6	ENVIRONMENTAL NON-CONFORMANCE	15
6.1	SUMMARY OF ENVIRONMENTAL EXCEEDANCE	15
6.2	SUMMARY OF ENVIRONMENTAL NON-COMPLIANCE	15
6.3	SUMMARY OF ENVIRONMENTAL COMPLAINT	15
6.4	SUMMARY OF ENVIRONMENTAL SUMMONS AND PROSECUTION	15
7	REVIEW OF THE EM&A DATA AND EIA PREDICTIONS	16
7.1	AIR QUALITY	16
7.2	WATER QUALITY	16
7.3	Waste Management	16
7.4	CONCLUSION OF REVIEW	17
8	CONCLUSION	18

1 INTRODUCTION

ERM-Hong Kong, Limited (ERM) was appointed by Hip Hing – Ngo Kee Joint Venture as the Environmental Team (ET) to implement the Environmental Monitoring and Audit (EM&A) programme for Hong Kong Convention and Exhibition Centre Expansion (previously known as HKCEC Atrium Link Extension) (the Project).

1.1 PURPOSE OF THE REPORT

This is the ninth quarterly EM&A report which summarizes the impact monitoring results and audit findings for the EM&A programme during the reporting period from 1 August 2008 to 31 October 2008.

1.2 STRUCTURE OF THE REPORT

The structure of the report is as follows:

Section 1: Introduction

details the scope and structure of the report.

Section 2: Project Information

summarizes background and scope of the Project, site description, project organization and contact details, construction programme, the construction works undertaken and the status of Environmental Permits/Licences during the reporting period.

Section 3: Environmental Monitoring Requirement

summarizes the monitoring parameters, monitoring programmes, monitoring methodologies, monitoring frequency, monitoring locations, Action and Limit Levels and Event / Action Plans.

Section 4: **Implementation Status on Environmental Mitigation Measures** summarizes the implementation of environmental protection measures during the reporting period.

Section 5: Monitoring Results

summarizes the monitoring results obtained in the reporting period.

Section 6: Environmental Non-conformance

summarizes any environmental exceedance, environmental complaints and environmental summons received within the reporting period.

Section 7: Review of EM&A Data and EIA Predictions compares and contrasts the EM&A data in the reporting period with the EIA predictions and annotates with explanation for any discrepancies.

Section 8: Conclusion

PROJECT INFORMATION

2.1 BACKGROUND

2

The Hong Kong Trade Development Council (HKTDC) is expanding its existing facilities to provide additional space for Hong Kong's leading trade fairs to be held at the Hong Kong Convention and Exhibition Centre (HKCEC). The Project is located in North Wan Chai and will occupy the aerial space between Phase I and Phase II of the HKCEC. The new Atrium Link Extension (ALE) will span across the water channel between Phase I and Phase II of the HKCEC to accommodate 3 main levels of Exhibition Hall Extensions. The level of the main roof of the Extension will be of similar height as that of the podium roof of the Phase I building. A northern row of permanent supporting columns will be located on land close to Expo Drive Central and similarly a southern row will land near to Convention Avenue. There will be no permanent intermediate columns in the waterway.

The major works activities for the ALE will comprise the following:

- Construction and demolition of the temporary footbridge;
- Demolition of the existing Atrium Link;
- Construction and demolition of a temporary working platform;
- Construction of foundations and pile caps for the ALE; and
- Construction of superstructure for the ALE.

The potential environmental impacts of the Project have been studied in the "Hong Kong Convention and Exhibition Centre, Atrium Link Extension – Environmental Impact Assessment Report" (EIAO Register No: AEIAR-100/2006). The EIA was approved on 21 April 2006 under the Environmental Impact Assessment Ordinance (EIAO). An Environmental Permit (EP-239/2006) for the works was granted on 12 May 2006. An application for variation of the Environmental Permit was made on 25 January 2007, an amended Environmental Permit (EP-239/2006/A) was granted on 12 February 2007. An application for further variation of the Environmental Permit was made on 18 April 2008, and an amended Environmental Permit (EP-239/2006/B) was granted on 12 May 2008. Under the requirements of Condition 3.1 of Environmental Permit EP-239/2006/B, an EM&A programme as set out in the EM&A Manual and its supplement is required to be implemented.

The construction works commenced on 1 August 2006 and are scheduled to be completed by March 2009.

2.2 SITE DESCRIPTION

The works areas of the Project are illustrated in *Annex A*.

2.3 CONSTRUCTION ACTIVITIES

A summary of the major construction activities undertaken in this quarter is shown in *Table 2.1*. The locations of the construction activities are presented in *Annex B*.

Table 2.1 Summary of Construction Activities Undertaken

Construction Activities Undertaken

- Transfer Truss Installation
- Roof Truss A Assembly
- Roof Truss B Assembly
- Roof Truss C Assembly
- Roof Truss D Assembly
- Roof Truss E Assembly
- Floor Structure (L2, L3, L5, L6, L7 & R/F)
- Concreting for Floor Slab (L2, L3, L5, L6, L7, L7M & R/F)
- Removal of Façade for Linkbridge Connection
- Linkbridge Corbel Installation
- Removal of Stage 1 Tunnel and Temporary Deck
- Construction of Stage 2A Tunnel
- Steel Post Erection for Façade
- Builder's work & BS Installation for Transformer Room
- Removal of West Façade Truss (L2 L7)
- Steel Post Erection for Façade (West)
- Steel Post Erection for Façade (East)

2.4 PROJECT ORGANISATION

The Project organisation chart and contact details are shown in *Annex C*.

2.5 STATUS OF ENVIRONMENTAL APPROVAL DOCUMENTS

A summary of the relevant permits, licences, and/or notifications on environmental protection for this Project since August 2006 is presented in *Table 2.2*.

Table 2.2 Summary of Environmental Licensing, Notification and Permit Status

Permit/ Licenses/ Notification	Reference	Validity Period	Remarks
Environmental Permit	EP-239/2006/B	Throughout the Contract -	Environmental Permit (EP) EP-239/2006 granted originally on 12 May 2006. Since then the EP have been varied twice. The latest revised EP was issued on 12 May 2008
Notification of Construction Works under Air Pollution Control (Construction Dust) Regulation			Notification on 23 June 2006
Discharge Licence under Water Pollution Control Ordinance	EP860/W10/XY 0145	N/A	-
Chemical Waste Producer Registration	WPN5213-134- H3125-01	N/A	Chemical waste types: spent paint, acid, alkaline, adhesive, diesel fuel, lubricating oil and bitumen.
Valid Construction Noise Permit for area inside the Atrium	GW-RS0220-08	Valid from 15 April to 15 October 2008	
Link	GW-RS0228-08	Valid from 15 April to 14 October 2008	
	GW-RS0273-08	Valid from 01 May to 30 October 2008	
	GW-RS0382-08	Valid from 11 June to 30 September 2008	
	GW-RS0343-08	Valid from 29 May to 30 October 2008	
	GW-RS0383-08	Valid from 10 June to 29 September 2008	
	GW-RS00385-08	Valid from 10 June to 31 August 2008	
	GW-RS0658-08	Valid from 20 September to 27 October 2008	
	GW-RS0680-08	Valid from 30 September to 31	
	GW-RS0759-08	October 2008 Valid from 31 October to 31 December 2008	

3

3.1 AIR QUALITY MONITORING

3.1.1 Monitoring Location

In accordance with the EM&A Manual, sampling for 24-hour and 1-hour Total Suspended Particulates (TSP) levels were conducted at the designated monitoring stations listed in *Table 3.1*. Map and photographs showing the monitoring stations are presented in *Annex D*.

Table 3.1 Air Monitoring Stations

Monitoring Station	Description
AM1	Pedestrian Plaza
AM2	Renaissance Harbour View Hotel Hong Kong

3.1.2 Monitoring Parameters, Frequency and Programme

Air quality monitoring was conducted in accordance with the requirements stipulated in the EM&A Manual (*Table 3.2*).

Table 3.2 TSP Monitoring Parameter and Frequency

Parameter	Frequency
24-hour TSP	Once per every 6 days
1-hour TSP	3 times per every 6 days

3.1.3 Action and Limit Levels

The Action and Limit levels were established in accordance with the EM&A Manual and are presented in *Table 3.3*.

Table 3.3 Action and Limit Levels for Air Quality

Parameter	Air Monitoring Station	Action Level (µgm ⁻³)	Limit Level (μgm ⁻³)
24-hour TSP	AM1	161	260
	AM2	168	260
1-hour TSP	AM1	327	500
	AM2	329	500

3.1.4 Monitoring Equipment

Continuous 24-hour and 1-hour TSP monitoring were performed using High Volume Samplers (HVS) with appropriate sampling inlets installed, located at the designated monitoring station. The performance specification of HVS complies with the standard method "Determination of Suspended Particulate Matter in the Atmosphere (High Volume Method)" as stipulated in US EPA Standard Title 40, Code of Federation Regulations Chapter 1 (Part 50 Appendix B).

Table 3.4 summarizes the equipment that was used in the 24-hour and 1-hour TSP monitoring.

Table 3.4 TSP Monitoring Equipment

Monitoring Station	Equipment	Model (HVS, Calibration Kit)
AM1 (for 24-hr TSP)	HVS, Calibration Kit	GMW-9503, Tisch TE-5025A
AM2 (for 24-hr TSP)	HVS, Calibration Kit	GMW-9795, Tisch TE-5025A
AM1 (for 1-hr TSP)	HVS, Calibration Kit	GMW-9864, Tisch TE-5025A
AM2 (for 1-hr TSP)	HVS, Calibration Kit	GMW-8115, Tisch TE-5025A

3.1.5 *Monitoring Methodology*

Installation

The HVSs at AM1 and AM2 were placed at about 1.3 m above local ground level and about 4.3 m above local ground respectively. All of the HVSs were free-standing with no obstruction.

The following criteria were considered in the installation of the HVSs:

- horizontal platform with appropriate support to secure the samplers against gusty wind were provided at AM1 & AM2;
- a minimum of 2 m separation from walls, parapets and penthouses was required for rooftop samplers;
- no furnace or incinerator flues were nearby;
- airflow around the sampler was unrestricted; and
- permission was obtained to set up the samplers and to gain access to the monitoring stations.

Preparation of Filter Papers by ETS-Test Consultant Ltd

- glass fibre filters were labeled and sufficient filters that were clean and without pinholes were selected;
- all filters were equilibrated in the conditioning environment for 24 hours before weighing. The conditioning environment temperature was around 25 °C and not variable by more than \pm 3 °C; the relative humidity (RH) was 40%; and
- ETS-Test Consultant Ltd, a HOKLAS accredited laboratory, implements comprehensive quality assurance and quality control programmes.

Field Monitoring

- the power supply was checked to ensure that the HVSs were working properly;
- the filter holder and the area surrounding the filter were cleaned;

- the filter holder was removed by loosening the foul bolts and a new filter, with stamped number upward, on a supporting screen was aligned carefully;
- the filter was properly aligned on the screen so that the gasket formed an airtight seal on the outer edges of the filter;
- the swing bolts were fastened to hold the filter holder down to the frame. The pressure applied should be sufficient to avoid air leakage at the edges;
- then the shelter lid was closed and secured with the aluminum strip;
- the HVSs were warmed-up for about 5 minutes to establish runtemperature conditions;
- a new flowrate record sheet was set into the flow recorder;
- the flow rate of the HVSs was checked and adjust at around 0.6 -1.44 m³/min. The range specified in the EM&A Manual was between 0.6 1.7 m³/min;
- the programmable timer was set for a sampling period of 24 hours \pm 1 hour, and the starting time, weather condition and the filter number were recorded;
- the initial elapsed time was recorded;
- at the end of sampling, the sampled filter was removed carefully and folded in half length so that only surfaces with collected particulate matter were in contact;
- it was then placed in a clean plastic envelope and sealed;
- all monitoring information was recorded on a standard data sheet; and
- filters were sent to ETS-Test Consultant Ltd for analysis.

3.1.6 *Maintenance and Calibration*

The HVSs and their accessories were maintained in good working condition, such as replacing motor brushes routinely and checking electrical wiring to ensure a continuous power supply.

The flow rate of each HVS with mass flow controller was calibrated using an orifice calibrator. Initial calibration of the dust monitoring equipments was conducted upon installation and prior to commissioning. Five-point calibration was carried out for HVSs using Tisch TE-5025A Calibration Kit. The calibration records for the HVSs are given in the respective monthly reports.

3.2 WATER QUALITY MONITORING

3.2.1 Water Quality during Installation and Removal of Marine Piles

In accordance with the EM&A Manual, the marine water quality monitoring should be conducted at three designated monitoring stations during the installation and removal of temporary marine piles. The installation of temporary marine piles was completed on 23 April 2007 and therefore water quality monitoring for marine pile installation works was not conducted during this quarter.

4 IMPLEMENTATION STATUS OF ENVIRONMENTAL PROTECTION REQUIREMENTS

4.1 ENVIRONMENTAL SITE AUDITING

Weekly site inspections were carried out by the ET. Thirteen site inspections were conducted on 7, 14, 21 and 28 August 2008; 4, 11, 18 and 25 September 2008, and 2, 9, 17, 23 and 30 October 2008 respectively. The major construction activities undertaken in the reporting period were the transfer and of trusses and works for supporting infrastructures. The Contractor has implemented environmental mitigation measures and requirements as stated in the EIA Report, the Environmental Permit and EM&A Manual. There was no non-compliance event recorded in the reporting period. The implementation status of environmental mitigation and status of relevant required submissions under the EP were reported as part of the monthly EM&A reports⁽¹⁾. Relevant submissions made on these measures and requirements during these reporting periods are summarized in *Annex E*.

4.2 EFFLUENT DISCHARGE SAMPLING

In accordance with the discharge licence issued under WPCO, water sampling should be conducted at least quarterly to ensure the quality of treated effluent at operating discharge points complies with the requirements of discharge license. During the reporting period, effluent sample monitoring was conducted at Discharge Point 2 and 3 on 18 September 2008. The results show that the effluent discharged from the project was in compliance with the discharge limit stipulated in the Water Discharge Licence.

4.3 LANDSCAPE AND VISUAL MONITORING

In accordance with *Section 6.7* of the EM&A Manual, bi-weekly landscape and visual monitoring is required to ensure that the design, implementation and maintenance of landscape and visual mitigation measures are fully achieved. The monitoring has commenced since January 2007 and is conducted by Earthasia Limited. Landscape and visual mitigation measures were implemented by the Contractor and the implementation status is given in *Annex E*.

4.4 EFFECTIVENESS OF MITIGATION MEASURES AND MONITORING

The mitigation measures recommended in the EIA report and required by the EP are considered effective in minimizing environmental impacts.

⁽¹⁾ The Monthly EM&A Reports for August 2008, September 2008 and October 2008 were submitted to the EPD on 17 September 2008, 17 October 2008 and 20 November 2008 respectively.

The EM&A for the Project was conducted as scheduled during the reporting period. No non-compliance events were observed during site audits and no exceedances were recorded during this quarter. The EM&A programme is considered effective.

5.1 AIR QUALITY

The monitoring data at AM1 and AM2 were provided by ETS-Testconsult Ltd. 15 sets of 24-hour and 47 sets of 1-hour TSP monitoring were carried out at the designated monitoring stations (AM1 & AM2) during this quarter. The monitoring data for 24-hour TSP and 1-hour TSP with weather conditions and graphical presentations are presented in *Annex F*.

The weather condition during the monitoring period varied from sunny to rainy. The local impacts observed near the monitoring stations were mainly vehicle emissions along Convention Avenue and Fleming Road.

No exceedance of Action and Limit Levels of 24-hour and 1-hour TSP was recorded at the monitoring stations during this quarter. The measured 24-hr TSP ranged from 23 - 158 μ gm⁻³ at AM1 and from 14 - 161 μ gm⁻³ at AM2.

5.2 WATER QUALITY

Water quality monitoring was not conducted at the designated monitoring stations (W3, W4 and W5) subsequent to the completion of installation of marine piles on 23 April 2007.

5.3 WASTE MANAGEMENT

Waste generated from this Project includes inert construction and demolition (C&D) materials and non-inert C&D wastes. Reference has been made on the Monthly Summary Waste Flow Table prepared by Hip Hing – Ngo Kee Joint Venture (*Annex G*).

With reference to relevant handling records and trip tickets of this Project, the quantities of different types of waste generated in the reporting period are summarized in *Table 5.1*.

Table 5.1 Quantities of Waste Generated from the Project

		Quantity	
Month / Year	C&D Materials (inert) (a)	C&D Wastes (non-inert) (b)	Chemical Waste
August 2008	217.5 tonnes	318.05 tonnes (excluding 60 tonnes of steel materials which were collected and recycled)	0
September 2008	9.0 tonnes	253.25 tonnes (excluding 50 tonnes of steel materials which were collected and recycled)	0

		Quantity	
Month / Year	C&D Materials (inert) (a)	C&D Wastes (non-inert) (b)	Chemical Waste
October 2008	15.0 tonnes	133.55 tonnes (excluding 10 tonnes of steel materials which were collected and recycled)	0
Total	241.5 tonnes	704.85 tonnes (excluding 120 tonnes steel material which were collected and recycled)	0

Notes:

- (a) Inert C&D materials include bricks, concrete, building debris, rubble and excavated soil. No inert C&D materials were reused in this Project. Non-reused inert C&D materials were disposed at the public fill barging point at Quarry Bay.
- (b) C&D wastes include steel materials generated from demolition of footbridge, the existing Atrium Link and working platform, paper / cardboard packaging waste, chemical waste and other wastes such as general refuse. A total of 120 tonnes of steel material were sent to recycler and the remaining C&D wastes other than general refuse were disposed of at SENT Landfill / Tseung Kwan O Area 137 temporary construction waste sorting facility.

A total of 241.5 tonnes of inert C&D materials and 704.85 tonnes of C&D wastes were generated during the reporting period. The C&D wastes and inert C&D materials generated from the Project were disposed of at SENT Landfill / Tseung Kwan O Area 137 temporary construction waste sorting facility and the public fill barging point at Quarry Bay respectively. A total of 120 tonnes of steel materials from works were generated and recycled in this quarter. No chemical waste was collected during the reporting period by licensed chemical waste collector.

6 ENVIRONMENTAL NON-CONFORMANCE

6.1 SUMMARY OF ENVIRONMENTAL EXCEEDANCE

No exceedance of the Action and Limit Levels of 24-hour and 1-hour TSP was recorded at monitoring stations during this quarter.

6.2 SUMMARY OF ENVIRONMENTAL NON-COMPLIANCE

No non-compliance event was recorded during this quarter.

6.3 SUMMARY OF ENVIRONMENTAL COMPLAINT

No complaint was received during this quarter.

6.4 SUMMARY OF ENVIRONMENTAL SUMMONS AND PROSECUTION

There was no summons or prosecution on environmental matters during this quarter.

7

7.1 AIR QUALITY

Since qualitative assessment of dust impact was conducted during construction phase in the EIA, a comparison was made against monitoring results and the Hong Kong Air Quality Objectives (HKAQO) (*Table 7.1*).

Table 7.1 Comparison of the HKAQO and Air Quality Monitoring Results

Month	Monitoring Stations	Corresponding ASR in EIA	HKAQO, μgm ⁻³	Measured 24 I Monitoring R	hour TSP esults, μgm ^{-3 (a) (b)}
			24 hour (a)	Average	Range ⁽²⁾
August 2008	AM1	AM8	260	77	23 - 145
	AM2	AM6	260	68	14 - 145
September 2008	AM1	AM8	260	78	23 - 145
	AM2	AM6	260	69	14 - 145
October 2008	AM1	AM8	260	78	23 - 158
	AM2	AM6	260	70	14 - 161

Notes:

The monitoring results show that the average and range of 24-hour TSP levels measured since the commencement of the construction works were well below the 24-hour TSP criterion in the HKAQO. Recommended mitigation measures in *Section 4.24* of EIA were implemented throughout the construction period and were considered effective.

7.2 WATER QUALITY

Water quality monitoring was not conducted at the designated monitoring stations (W3, W4 and W5) subsequent to the completion of installation of marine piles on 23 April 2007. No data was therefore presented for this quarter.

7.3 WASTE MANAGEMENT

The estimated amount of waste generated in this project and the accumulated quantities of waste generated up to the reporting period are presented in *Table 7.2*. Recommended mitigation measures in *Sections 6.35* to *6.41* of the EIA report are implemented during the reporting period. These measures are regarded as effective.

⁽a) 24-hour TSP criterion under HKAQOs was used.

⁽b) Average and range of data were calculated for the period of monitoring between the commencement of the construction works and this quarter.

Table 7.2 Comparison of the Estimated Amount and the Actual Amount of Waste Generated

Type of Material	Estimated Amount of C&D Materials in EIA (inert & non- inert)	Accumulated Actual Amount of C&D Materials Recorded ^(a) (inert & non- inert)
Demolition of temp. footbridge	585 tonnes	0 tonne
Demolition of existing Atrium	4,680 tonnes	2675.5 tonnes
Link		
Demolition of temp. working	390 tonnes	0 tonne
platform		
Construction of foundations and	20,000 tonnes	22533.3 tonnes
pile caps		
General Refuse	Insignificant	1433.4 tonnes
Chemical Waste	Small	288 Litres
Notes		

Note:

7.4 CONCLUSION OF THE REVIEW

The EIA predictions and the monitoring results since the commencement of construction works have been reviewed. The EIA concluded that the Project would not pose adverse impacts to the environment, and the monitoring results also indicated that the construction of the Project did not pose adverse impacts to the environment. Recommendations given in the EIA are also considered to be adequate and effective for minimising the environmental impacts.

⁽a) The actual amount of C&D Materials was recorded since the commencement of construction works in August 2006.

8 CONCLUSIONS

This Ninth Quarterly Environmental Monitoring and Audit (EM&A) Report presents the EM&A work undertaken during the period from 1 August 2008 to 31 October 2008 in accordance with the EM&A Manual and the requirement under EP-239/2006B.

Fifteen sets of 24-hour and forty-seven sets of 1-hour TSP monitoring were carried out at the designated monitoring stations (AM1 & AM2) and no exceedance of Action and Limit Levels was recorded at the monitoring stations during this quarter.

No non-compliance event was recorded during this quarter.

No complaint and summons/prosecution was received during this quarter.

Water sampling was conducted at Discharge Point 2 and 3 on 18 September 2008 to ensure the quality of treated effluent at operating discharge points complies with the requirements of discharge license. The results show that the effluents were in compliance with the discharge limit stipulated in the Water Discharge Licence.

The ET will keep track of the EM&A programme to ensure compliance of environmental requirements and the proper implementation of all necessary mitigation measures.

LIST OF TABLES

Table 2.1	Summary of Construction Activities Undertaken
Table 2.2	Summary of Environmental Licensing, Notification and Permi
	Status
Table 3.1	Air Monitoring Stations
Table 3.2	TSP Monitoring Parameter and Frequency
Table 3.3	Action and Limit Levels for Air Quality
Table 3.4	TSP Monitoring Equipment
Table 5.1	Summary of Record of Exceedances Recorded During the
	Recording Period
Table 5.2	Quantities of Waste Generated from the Project
Table 7.1	Comparison of the HKAQO and Air Quality Monitoring
	Results
Table 7.2	Comparison of the Estimated Amount and the Actual Amount
	of Waste Generated

LIST OF ANNEXES

Annex A	Location of Works Areas	
Annex B	Location of Construction Activities during the Reporting	
	Quarter	
Annex C	Project Organization Chart and Contact Detail	
Annex D	Locations of Monitoring Stations	
Annex E	Summary of Implementation Status	
Annex F	24-hour and 1-hour TSP Monitoring Results	
Annex G	Waste Flow Table	

EXECUTIVE SUMMARY

The construction works for Hong Kong Convention and Exhibition Centre Expansion (previously known as HKCEC Atrium Link Extension) (EIAO Register No: AEIAR-100/2006) commenced on 1 August 2006. This is the ninth quarterly Environmental Monitoring and Audit (EM&A) report presenting the EM&A work carried out during this period from 1 August 2008 to 31 October 2008 in accordance with the EM&A Manual.

Summary of Construction Works undertaken during the Reporting Period

The major construction works taken during the reporting period include the assembly of roof truss A, B, C, D and E, installation of transfer truss, floor structure and building service work for transformer room, concreting for floor slab, erection of steel post for west and east façade, the removal of façade for linkbridge connection, west façade truss and stage 1 tunnel and temporary deck and the construction of stage 2A tunnel.

Environmental Monitoring and Audit Progress

A summary of the monitoring activities in this reporting period is listed below:

24-hour Total Suspended	15 times
Particulates (TSP) monitoring	
1-hour TSP monitoring	47 times
Joint environmental site auditing	13 times

Air Quality

Fifteen sets of 24-hour and forty-seven sets of 1-hour TSP monitoring were carried out at the designated monitoring stations (AM1 & AM2) and no exceedance was recorded during this quarter.

Water Quality

Water quality monitoring at the designated monitoring stations (W3, W4 and W5) was not conducted subsequent to the completion of installation of marine piles on 23 April 2007.

Construction Waste Management

The major construction activities undertaken in the reporting period were installation of marine pile, construction of marine platform and pedestrian tunnel. A total of 241.5 tonnes of inert C&D materials and 704.85 tonnes of C&D wastes were generated during this quarter. The C&D wastes and inert C&D materials generated from the Project were disposed of at SENT Landfill / Tseung Kwan O Area 137 temporary construction waste sorting facility and the public fill barging point at Quarry Bay respectively. A total of 120 tonnes of steel materials were generated from works over this quarter and sent to

recycler. No chemical waste was collected during the reporting period by licensed chemical waste collector.

Effluent Discharge Sampling

Water sampling was conducted at Discharge Point 2 and 3 on 18 September 2008 to ensure the quality of treated effluent at three designated discharge points complies with the requirements of discharge license. The results show that the effluents were in compliance with the discharge limit stipulated in the Water Discharge Licence.


Environmental Non-conformance

Thirteen weekly joint environmental site audits were carried out by the ET. No non-compliance event is recorded during this quarter.

No environmental complaints or summons were received during this quarter.

Annex A

Location of Works Areas

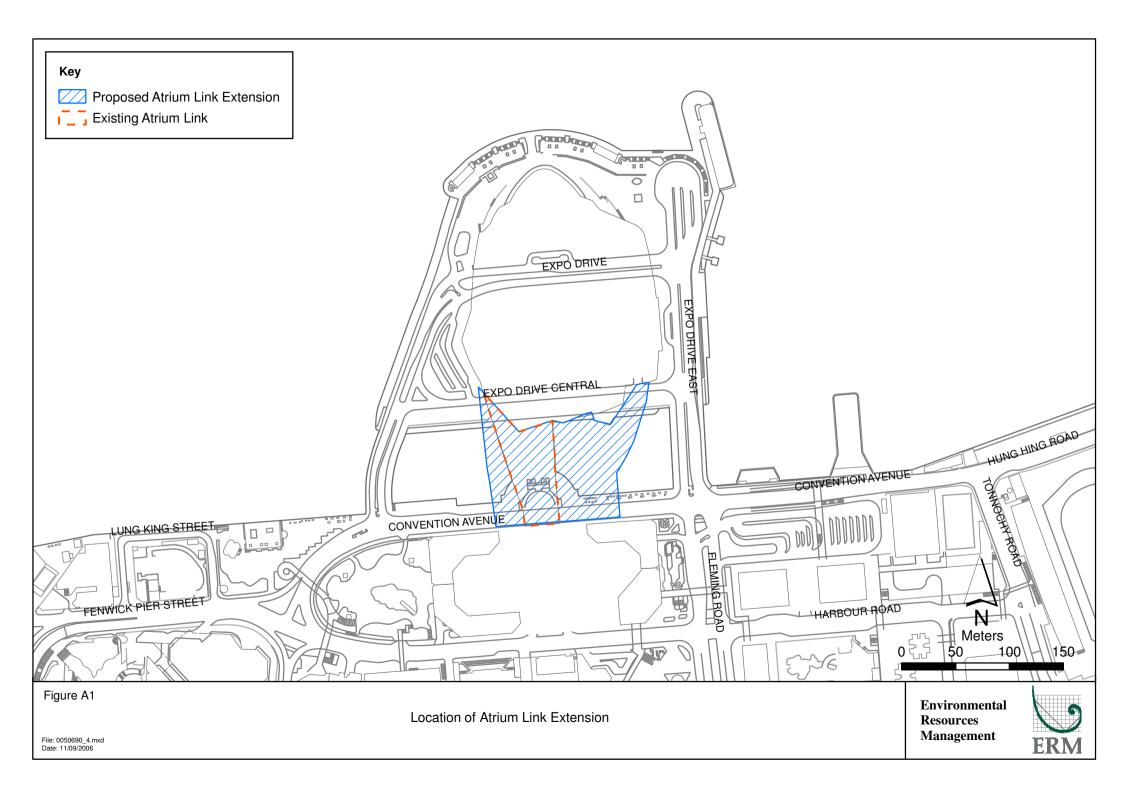

Annex B

Location of Construction Activities during the Reporting Period

Summary of Works for August 2008

Description	Location
Transfer Truss Installation	GridA-B/24
Roof Truss A Assembly	Grid A
Roof Truss B Assembly	Grid B
Roof Truss C Assembly	Grid C
Roof Truss D Assembly	Grid D
Roof Truss E Assembly	Grid D-E
Floor Structure (L3 & L5)	Grid D-E/15-19
Removal of Façade for Linkbridge Connection	Façade Phase I
Linkbridge Corbel Installation	Grid D-E/15-19
Floor Structure (L2)	Grid A1-E
Floor Structure (L5)	Grid A1-E
Floor Structure (L7)	Grid A1-E
Floor Structure (R/F)	Grid A1-E
Removal of West Façade Truss (L2-L7)	Grid A1-A
Removal of Stage 1 Tunnel and Temporary Deck	
Construction of Stage 2A Tunnel	
Steel Post Erection for Façade	
Builder's work & BS Installation for Transformer Room	L3, Grid D-E


Summary of Works for September 2008


Description	Location
Transfer Truss Installation	GridA-B/24
Roof Truss A Assembly	Grid A
Roof Truss B Assembly	Grid B
Roof Truss C Assembly	Grid C
Roof Truss D Assembly	Grid D
Roof Truss E Assembly	Grid D-E
Floor Structure Installation (L2, L3, L5, L6, L7 & R/F)	Grid A1-E
Removal of Façade for Linkbridge Connection	Façade Phase I
Concreting for Floor Slab (L2)	G.L. A1-A
Concreting for Floor Slab (L2)	G.L. A-D
Concreting for Floor Slab (L3)	G.L. D-E
Concreting for Floor Slab (L5)	G.L. A-D
Concreting for Floor Slab (L5)	G.L. D-E
Concreting for Floor Slab (L6)	G.L. D-E
Concreting for Floor Slab (L7)	G.L. A-D
Removal of West Façade Truss (L2 - L7)	G.L. A1-A
Removal of Stage 1 Tunnel & Temporary Deck	-
Construction of Stage 2A Tunnel	-
Steel Post Erection for Façade	West Façade
Steel Post Erection for Façade	East Façade


Builder's work & BS Installation for	L3, Grid D-E
Transformer Room	

Summary of Works for October 2008

Description	Location
Floor Structure Installation (L2, L3, L5, L6, L7 & R/F)	Grid A1-E
Concreting for Floor Slab (L2 & L3)	G.L. A1-A
Concreting for Floor Slab (L2, L3, L5, L7 & R/F)	G.L. A-D
Concreting for Floor Slab (L3, L5, L6, L7& L7M)	G.L. D-E
Removal of West Façade Truss (L2 - L7)	G.L. A1-A
Steel Post Erection for Façade	West Façade
Steel Post Erection for Façade	East Façade

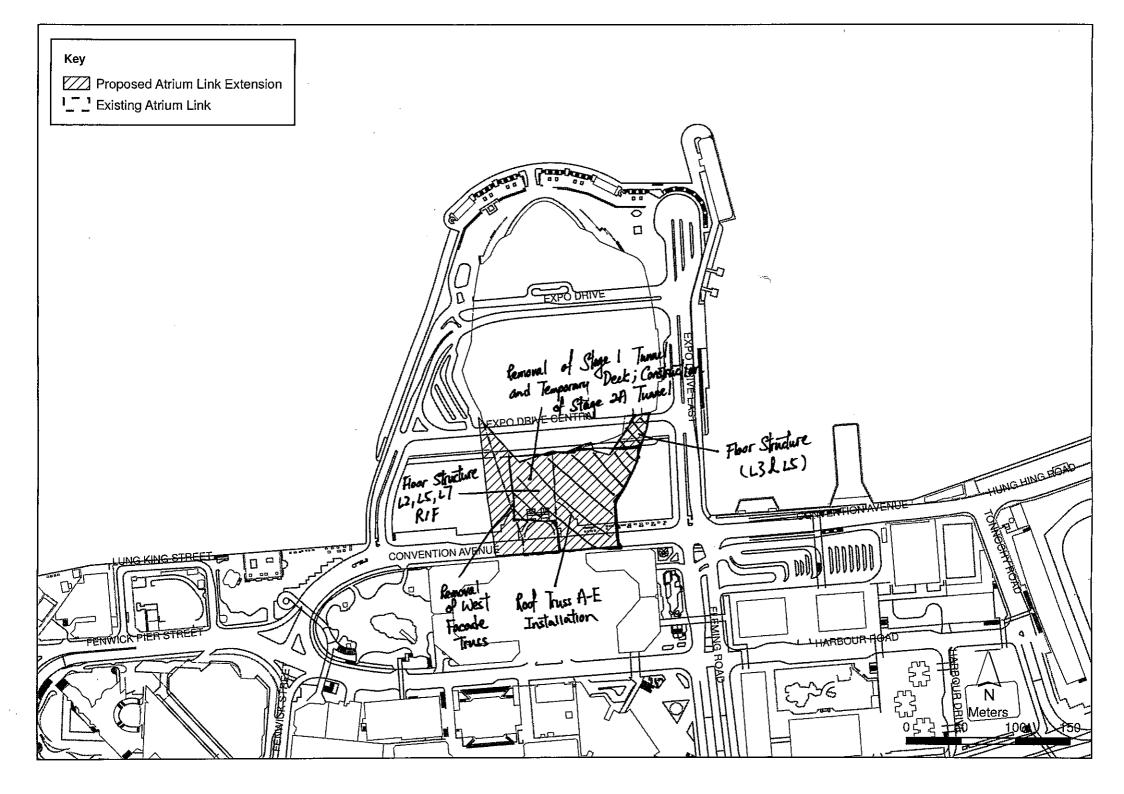

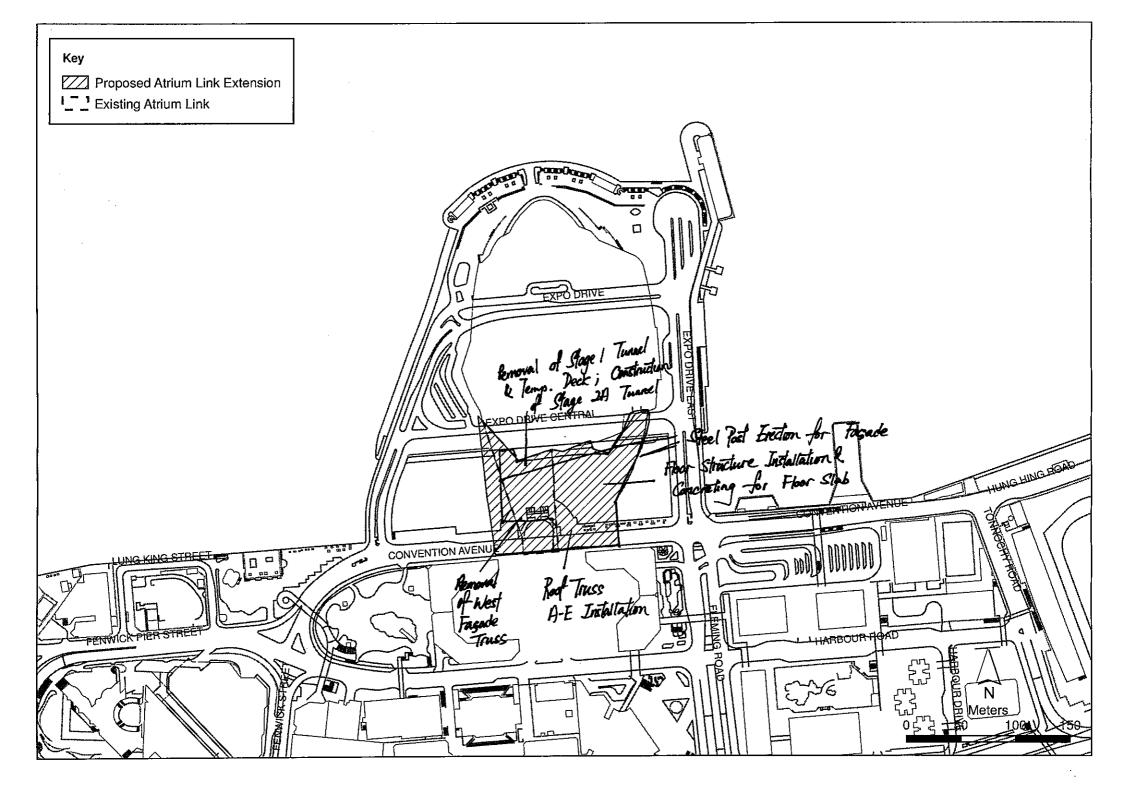


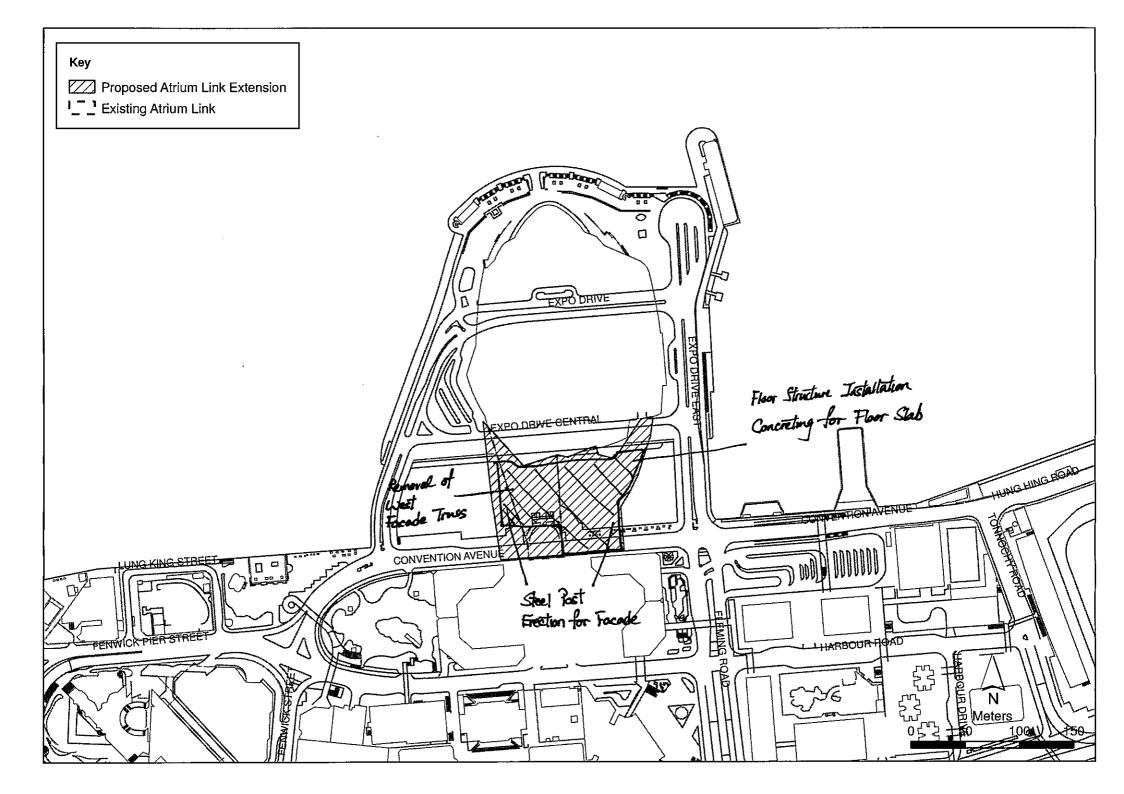

Annex C


Project Organization Chart and Contact Detail


Project Organization (with contact details)

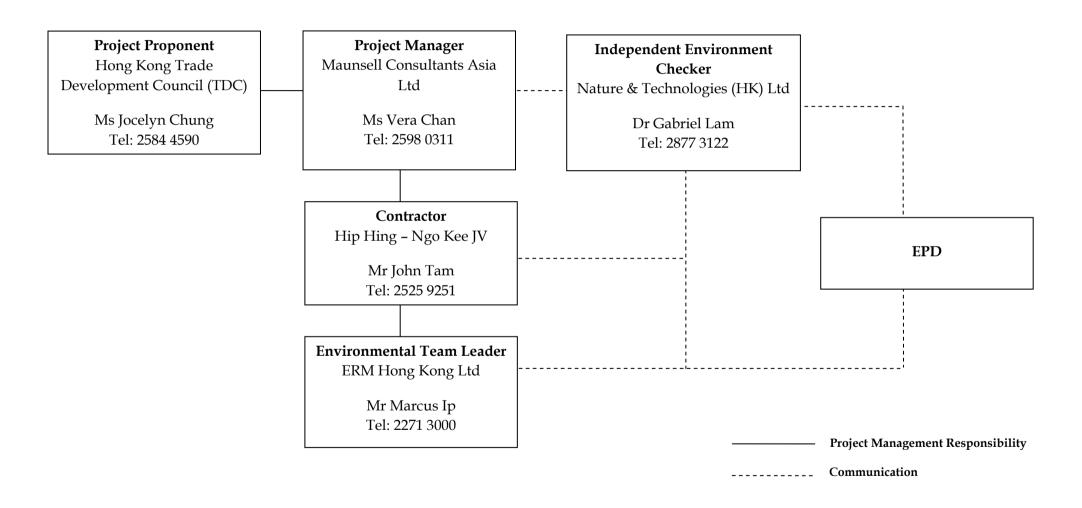

Annex D

Locations of Air and Water Quality Monitoring Stations

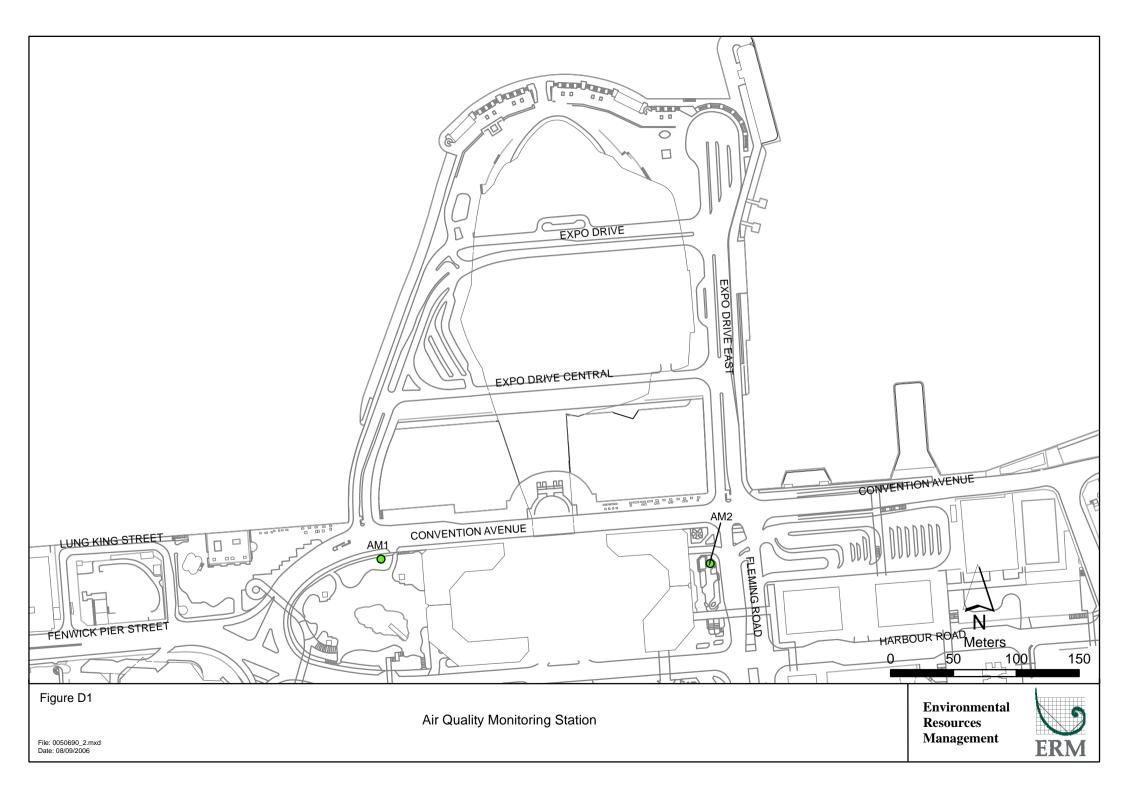

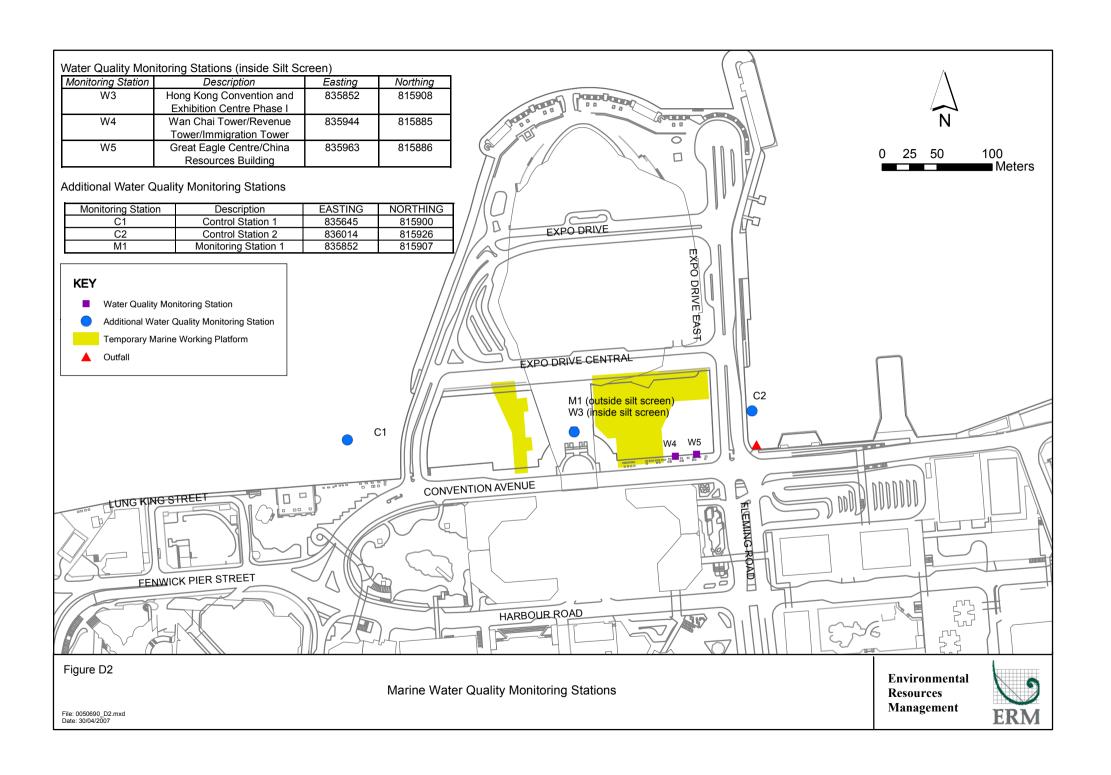




Air Quality Monitoring Station (AM1)




Air Quality Monitoring Station (AM2)

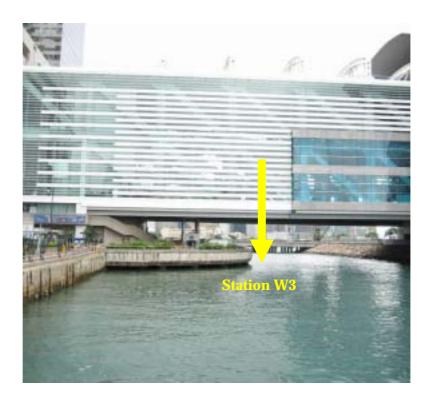

Water Quality Monitoring Location – Station W3



Water Quality Monitoring Location – Stations W4 and W5 $\,$

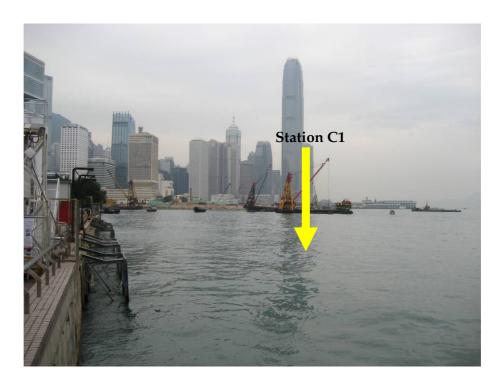

Additional Water Quality Monitoring Location – Station C1



Additional Water Quality Monitoring Location – Station C2



Additional Water Quality Monitoring Location – Station M1

Annex E - Summary of Environmental Protection / Mitigation Activities

Environmental Permit No. EP-239/2006/B

EP Condition	Submission	Action Required by the Permit Holder	Implementation Status
Ref			
	litigating Water Quality Impact		
2.4	Method statement on silt screens for seawater intakes (including design and maintenance requirements)	2 weeks before commencement of marine pile installation works	Method statement was submitted to the EPD on 21/6/06. Method statement (Revision A) was submitted to the EPD on 29/9/06. Method statement (Revision B) and supplementary information was submitted to the EPD on 23/5/07 and 18/6/07 respectively.
2.5	Method statement on silt curtain system for marine piling works (including design and maintenance requirements)	2 weeks before commencement of marine pile installation works	Method statement was submitted to the EPD on 15/9/06.
2.8	Design drawings specifying pile dimension and layout	2 weeks before commencement of marine pile installation works	Marine pile layout (final stage) was submitted to the EPD on 15/2/07.
			Revised marine pile layout (final stage) was submitted to the EPD on $26/3/07$.
Measures for M	litigating Air Quality Impact		
2.9	Design drawings of ventilation facility for fresh air intakes (req'd only before operation of Project)	2 weeks before commencement of installation of ventilation facility	
Measures for M	litigating Landscape and Visual Impact		
2.10	Implementation programme for landscape and visual mitigation measures (for both construction and operational phases of Project)	Within 6 months after commencement of construction of Project	Implementation programme (CM01, CM04 and CM05) was submitted to the EPD on 8/12/06.
2.10	Details of each landscape and visual mitigation measures package (incl plans)	2 weeks before implementation of a particular mitigation package	Proposal on protection and transplantation of existing trees was submitted to the EPD on 8/12/06. Proposal for CM03 was submitted to the EPD on 8/12/06. Proposal for CM01, CM04 and CM05 was submitted to the EPD on 15/12/06. CM01 Rev 1 was submitted to the EPD on 22/1/07. Proposal CM02 was submitted to the EPD on 13/3/07. Proposal for OM01 was submitted to the EPD on 15/11/07.
3.2	Baseline Monitoring Report	One week before the commencement of construction	Report was submitted to the EPD on 24/7/06 and comments from the EPD was received on 3/8/06. Revised report was submitted to EPD on 17/8/06 and no further comments received.

Annex E

Summary of Implementation Status

Type of	Environmental Protection Measures	Location/ Timing	Status			
Impact						
	Construction Phase					
Air Quality	 The Air Pollution Control (Construction Dust) Regulation shall be implemented and good site practices shall be incorporated in the contract clauses to minimize construction dust impact. A number of practical measures are listed below: skip hoist for material transport should be totally enclosed by impervious sheeting; every vehicle should be washed to remove any dusty materials from its body and wheels before leaving a construction site; the area where vehicle washing takes place and the section of the road between the washing facilities and the exit point should be paved with concrete, bituminous materials or hardcores; where a site boundary adjoins a road, streets or other accessible to the public, hoarding of not less than 2.4 m high from ground level should be provided along the entire length except for a site entrance or exit; every stock of more than 20 bags of cement should be covered entirely by impervious sheeting placed in an area sheltered on the top and the 3 sides; all dusty materials should be sprayed with water prior to any loading, unloading or transfer operation so as to maintain the dusty materials wet; the height from which excavated materials dropped should be controlled to a minimum practical height to limit fugitive dust generation from unloading; the load of dusty materials carried by vehicle leaving a construction site should be covered entirely by clean impervious sheeting to ensure dust materials do not leak from the vehicle; and instigation of an environmental monitoring auditing program to monitor the construction process in order to enforce controls and modify method of work if dusty conditions arise. 	Work site / during construction				

Type of	Environmental Protection Measures	Location/ Timing	Status
Impact			
Operational Ph Air Quality	Some fresh air intakes of the Hong Kong Convention and Exhibition Centre Phase I, Renaissance Harbour View Hotel and Grand Hyatt Hotel (ASRs A4, A5 and A6) should be re-diverted to the new air vent shaft provided for Atrium Link Extension where fresh air intake located at +55.8mPD.	Location of ASRs A4, A5 & A6 / Design & Operation Stage (Long-term and Interim Scenario)	Measures not required until commencement of operational phase
Air Quality	Monitoring of NO ₂ concentration underneath the Atrium Link Extension should be conducted.	Underneath the deckover / The first six months upon completion of the ALE.	Measures not required until commencement of operational phase
Construction P	Phase	<u> </u>	
Noise	Good Site Practice: • only well-maintained plant should be operated on-site and plant should be serviced regularly during the construction program; • silencers or mufflers on construction equipment should be utilized and should be properly maintained during the construction program; • mobile plant, if any, should be sited as far from NSRs as possible; • machines and plant (such as trucks) that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum; • plant known to emit noise strongly in one direction should, wherever possible, be orientated so that the noise is directed away from the nearby NSRs; and • material stockpiles and other structures should be effectively utilised, wherever practicable, in screening noise from onsite construction activities; Environmental audit shall be carried out to ensure that appropriate noise control measures would be properly implemented.	Construction work areas / Construction period	

Type of	Environmental Protection Measures	Location/ Timing	Status			
Impact						
	Operational Phase					
Noise	 The following noise reduction measures should be considered as far as practicable during detailed design: choose quieter plant such as those which have been effectively silenced; include noise levels specification when ordering new plant; locate fixed plant away from any NSRs as far as practicable; locate fixed plant in plant rooms with thick walls or specially designed enclosure; locate noisy machines in basement or a completely separate building; and develop and implement a regularly scheduled plant maintenance programme in order to maintain controlled level of noise. 	Plant Room / Design and Operation Stage	Relevant design and plant procurement procedures to commence at a later stage			
Construction	Phase	,				
Water Quality	There should be no permanent structure in the water channel.	At the ALE sea channel / during operational phase	√ 			
Water Quality	No dredging and no reclamation should be carried out for the Project.	At work sites / during construction phase	√			
Water Quality	The marine pile layout as shown in Figure 3 of the Environmental Permit should be adopted. No more than approximately 80 numbers of temporary marine piles should be installed in the ALE sea channel during the construction phase. The dimension of each temporary marine pile should be 800mm nominal diameter. These piles should be driven into position and internal space should not be excavated, i.e. left as soil. No dredging or soil / sediment excavation should be carried out. Marine piles would be removed by reverse driving.	At work sites / during construction phase				
Water Quality	Two layers of silt curtain should be installed around each of the marine piling and pile extraction locations. The proposed silt curtain should be extended to seabed with sinker blocks and regularly inspected and maintained to ensure it is serviceable.	At marine work sites and nearby seawater intakes / during marine piling and marine pile extraction	The installation of temporary marine piles was completed on 23 April 2007.			

Environmental Resources Management

Hip Hing - Ngo Kee Joint Venture

Type of Impact	Environmental Protection Measures	Location/ Timing	Status
	All marine works should be carried out in a controlled manner such that release of sediments into the marine environment would be minimized. All wastewater generated from the piling activities should be collected and be treated before controlled discharge. Spoil should also be properly collected for proper disposal.		
Water Quality	In view of the close vicinity of the seawater intakes to the work site, silt screens are recommended to be deployed at the seawater intakes shown in Figure 5.2 of the EIA report during the whole construction period. Silt screens to be provided at seawater intakes should be regularly checked and maintained to ensure that they are serviceable. Refuse collection vessel should be mobilized on a need basis to collect any floating refuse lost from/trapped at the work site during the construction period.	At seawater intakes / during the whole construction period	The installation of temporary marine piles was completed on 23 April 2007. Silt screens were removed as requested by the intake owners. Silt screens will be reinstalled at seawater intakes prior to the removal of marine piles.
Water Quality	Surface run-off from construction sites should be discharged into storm drains via adequately designed sand/silt removal facilities such as sand traps, silt traps and sedimentation basins. Channels or earth bunds or sand bag barriers should be provided on site to properly direct stormwater to such silt removal facilities. Perimeter channels at site boundaries should be provided where necessary to intercept storm runoff from outside the site so that it will not wash across the site. Catchpits and perimeter channels should be constructed in advance of site formation works and earthworks. Silt removal facilities, channels and manholes should be maintained and the deposited silt and grit should be removed regularly, at the onset of and after each rainstorm to ensure that these facilities are functioning properly at all times. Any practical options for the diversion and re-alignment of drainage should comply with both engineering and environmental requirements in order to ensure adequate hydraulic capacity of all drains. Minimum distances of 100 m should be maintained between the discharge points of construction site runoff and the nearby saltwater intakes.	Works areas / construction period	Δ

Type of Impact	Environmental Protection Measures	Location/ Timing	Status
F			
Water Quality	There is a need to apply to EPD for a discharge license for discharge of effluent from the construction site under the WPCO. The discharge quality must meet the requirements specified in the discharge license. All the runoff and wastewater generated from the works areas should be treated so that it satisfies all the standards listed in the TM-DSS. Reuse and recycling of the treated effluent can minimize water consumption and reduce the effluent discharge volume. The beneficial uses of the treated effluent may include dust suppression, wheel washing and general cleaning. It is anticipated that only a small quantity of wastewater would be generated from the works areas. Any effluent discharge from the construction activities should be diverted away from the sea channel so as to avoid adverse water quality impact. Construction works should be programmed to minimize excavation works in rainy seasons (April to September). If excavation in soil could not be avoided in these months or at any time of year when rainstorms are likely, for the purpose of preventing soil erosion, temporary exposed slope surfaces should be covered e.g. by tarpaulin, and temporary access roads should be protected by crushed stone or gravel, as excavation proceeds. Intercepting channels should be provided (e.g. along the crest / edge of excavation) to prevent storm runoff from washing across exposed soil surfaces. Arrangements should always be in place to ensure that adequate surface protection measures can be safely carried out well before the arrival of a rainstorm.	Works areas / construction period	
Water Quality	Earthworks final surfaces should be well compacted and the subsequent permanent work or surface protection should be carried out immediately after the final surfaces are formed to prevent erosion caused by rainstorms. Appropriate drainage like intercepting channels should be provided where necessary. Measures should be taken to minimize the ingress of rainwater into trenches. If excavation of trenches in wet seasons is	Works areas / construction period	

Type of	Environmental Protection Measures	Location/ Timing	Status
Impact	necessary, they should be dug and backfilled in short sections.		
	Rainwater pumped out from trenches or foundation excavations should be discharged into storm drains via silt removal facilities.		
	Open stockpiles of construction materials (e.g. aggregates, sand and fill material) on sites should be covered with tarpaulin or similar fabric during rainstorms. Measures should be taken to prevent the washing away of construction materials, soil, silt or debris into any drainage system.		
	Manholes (including newly constructed ones) should always be adequately covered and temporarily sealed so as to prevent silt, construction materials or debris from getting into the drainage system, and to prevent storm run-off from getting into foul sewers. Discharge of surface run-off into foul sewers must always be prevented in order not to unduly overload the foul sewerage system.		
Water Quality	Good site practices should be adopted to remove rubbish and litter from construction sites so as to prevent the rubbish and litter from spreading from the site area. It is recommended to clean the construction sites on a regular basis.	Works areas / construction period	Δ
Water Quality	Under normal circumstances, groundwater pumped out of wells, etc. for the lowering of ground water level in basement or foundation construction should be discharged into storm drains after the removal of silt in silt removal facilities.	Works areas / construction period	√ ·
Water Quality	Water used in ground boring and drilling or rock /soil anchoring should as far as practicable be re-circulated after sedimentation. When there is a need for final disposal, the wastewater should be discharged into storm drains via silt removal facilities.	Works areas / construction period	√ ·
Water Quality	Wastewater generated from the washing down of mixing trucks and drum mixers and similar equipment should whenever practicable be recycled. The discharge of wastewater should be	Works areas / construction period	√

Type of Impact	Environmental Protection Measures	Location/ Timing	Status
Ппраст	kept to a minimum.		
	To prevent pollution from wastewater overflow, the pump sump of any water recycling system should be provided with an online standby pump of adequate capacity and with automatic alternating devices.		
	Under normal circumstances, surplus wastewater may be discharged into foul sewers after treatment in silt removal and pH adjustment facilities (to within the pH range of 6 to 10). Disposal of wastewater into storm drains will require more elaborate treatment.		
Water Quality	All vehicles and plant should be cleaned before they leave a construction site to ensure no earth, mud, debris and the like is deposited by them on roads.	Works areas / construction period	Δ
	A wheel washing bay should be provided at every site exit if practicable and wash-water should have sand and silt settled out or removed before discharging into storm drains. The section of construction road between the wheel washing bay and the public road should be paved with backfall to reduce vehicle tracking of soil and to prevent site run-off from entering public road drains.		
Water Quality	Bentonite slurries used in diaphragm wall and bore-pile construction should be reconditioned and reused wherever practicable. If the disposal of a certain residual quantity cannot be avoided, the used slurry may be disposed of at the marine spoil grounds subject to obtaining a marine dumping licence from EPD on a case-by-case basis.	Works areas / construction period	√ ·
	If the used bentonite slurry is intended to be disposed of through the public drainage system, it should be treated to the respective effluent standards applicable to foul sewer, storm drains or the receiving waters as set out in the WPCO Technical Memorandum on Effluent Standards.		

Type of Impact	Environmental Protection Measures	Location/ Timing	Status
	Water used in water testing to check leakage of structures and pipes should be reused for other purposes as far as practicable. Surplus unpolluted water could be discharged into storm drains. Sterilization is commonly accomplished by chlorination. Specific advice from EPD should be sought during the design stage of the works with regard to the disposal of the sterilizing water. The sterilizing water should be reused wherever practicable. Discharge of sterilization effluent should be properly pre-treated for compliance with TM/WPCO requirements, such as but not limited to total residual chlorine.	Works areas / construction period	
Water Quality	Effluent discharges from building construction and other construction site activities are subject to WPCO control. Before commencing any demolition works, all sewer and drainage connections should be sealed to prevent building debris, soil, sand etc. from entering public sewers/drains. Wastewater generated from building construction activities including concreting, plastering, internal decoration, cleaning of works and similar activities should not be discharged into the stormwater drainage system. If the wastewater is to be discharged into foul sewers, it should undergo the removal of settleable solids in a silt removal facility, and pH adjustment as necessary.	Works areas / construction period	Δ
Water Quality	Acidic wastewater generated from acid cleaning, etching, pickling and similar activities should be neutralized to within the pH range of 6 to 10 before discharging into foul sewers. If there is no public foul sewer in the vicinity, the neutralized wastewater should be tinkered off site for disposal into foul sewers or treated to a standard acceptable to storm drains and the receiving waters.	Works areas / construction period	No acidic wastewater will be generated.

Type of Impact	Environmental Protection Measures	Location/ Timing	Status
Water Quality	Wastewater collected from canteen kitchens, including that from basins, sinks and floor drains, should be discharged into foul sewer via grease traps capable of providing at least 20 minutes retention during peak flow. Drainage serving an open oil filling point should be connected to storm drains via a petrol interceptors with peak storm bypass. Vehicle and plant servicing areas, vehicle wash bays and lubrication bays should as far as possible be located within roofed areas. The drainage in these covered areas should be connected to foul sewers via a petrol interceptor. Oil leakage or spillage should be contained and cleaned up immediately. Waste oil should be collected and stored for recycling or disposal in accordance with the Waste Disposal Ordinance.	Works areas / construction period	√ · · · · · · · · · · · · · · · · · · ·
Water Quality	It is recommended to provide sufficient chemical toilets in the works areas. The toilet facilities should be more than 30 m from the seafront or any watercourse. A licensed waste collector should be deployed to clean the chemical toilets on a regular basis. Notices should be posted at conspicuous locations to remind the workers not to discharge any sewage or wastewater into the nearby environment. Regular environmental audit on the construction site can provide an effective control of any malpractices and can encourage continual improvement of environmental performance on site.	Works areas / construction period	√ ·
Water Quality	Contractor must register as a chemical waste producer if chemical wastes would be produced from the construction activities. The Waste Disposal Ordinance (Cap 354) and its subsidiary regulations in particular the Waste Disposal (Chemical Waste) (General) Regulation should be observed and complied with for control of chemical wastes.	Works areas / construction period	√ ·
Water	Any service shop and maintenance facilities should be located on	Works areas / construction period	√

Type of	Environmental Protection Measures	Location/ Timing	Status
Impact			
Quality	hard standings within a bunded area, and sumps and oil interceptors should be provided. Maintenance of vehicles and equipment involving activities with potential for leakage and spillage should only be undertaken within the areas appropriately equipped to control these discharges. Disposal of chemical wastes should be carried out in compliance with the Waste Disposal Ordinance. The Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes published under the Waste Disposal Ordinance details the requirements to deal with chemical wastes. General requirements are given as follows: • suitable containers should be used to hold the chemical wastes to avoid leakage or spillage during storage, handling and transport; • chemical waste containers should be suitably labelled, to notify and warn the personnel who are handling the wastes,		
	 to avoid accidents; and storage area should be selected at a safe location on site and adequate space should be allocated to the storage area. 		
Water Quality	To minimize the potential water quality impacts from the construction works located at or near the storm system or seafront, the following mitigation measures should be adopted: • the use of less or smaller construction plants may be specified to reduce the disturbance to the seabed; • temporary sewerage system should be designed to prevent wastewater from entering the storm system and sea; • temporary storage of materials (e.g. equipment, filling materials, chemicals and fuel) and temporary stockpile of construction materials should be located well away from any water courses during carrying out of the construction works; • stockpiling of construction materials and dusty materials should be covered and located away from any water courses; • construction debris and spoil should be covered up and/or disposed of as soon as possible to avoid being washed into	Works areas / construction period	

Type of	Environmental Protection Measures	Location/ Timing	Status
Impact			
	 the nearby water receivers; construction activities, which generate large amount of wastewater, should be carried out in a distance away from the waterfront, where practicable; mitigation measures to control site runoff from entering the nearby water environment should be implemented to minimize water quality impacts. Surface channels should be provided along the edge of the waterfront within the work sites to intercept the runoff; construction effluent, site run-off and sewage should be properly collected and/or treated; proper shoring may need to be erected in order to prevent soil/mud from slipping into the storm culvert/sea; and supervisory staff should be assigned to station on site to closely supervise and monitor the works. 		
Water Quality	If monitoring of the treated effluent quality from the Works Areas is required during the construction phase of the Project, the monitoring should be carried out in accordance with the WPCO license which is under the ambit of regional office (RO) of EPD. The contractor should submit detailed monitoring programme to EPD for approval before commencement of the construction activities.	Works areas / construction period	√ ·
Water Quality	Monitoring of the water quality at the seawater intakes inside the ALE sea channel should be conducted.	ALE sea channel / Before construction period and during installation and removal of temporary marine piles.	√ ·
Water Quality	All barges should be fitted with tight seals to their bottom opening to prevent leakage of materials. The decks of all vessels should be kept tidy and free of oil or other substances that might be accidentally or otherwise washed overboard. Loading of barges should be controlled to prevent splashing of materials to the surrounding environment and barges should under no circumstances be filled to a level which would cause overflowing of material or sediment laden water during loading and	Works areas / construction period	No barge will be required for the project.

Type of Impact	Environmental Protection Measures	Location/ Timing	Status
	transportation. All barges should maintain adequate clearance between vessels and the seabed at all states of the tide and should operate at a reduced speeds to ensure that undue turbidity is not generated by turbulence from vessel movement or propeller wash.		
Water Quality	Connection of sewage generated from the ALE will be connected to the existing public sewer. For handling, treatment and disposal of other operational stage effluent, the practices outlined in ProPECC PN 5/93 should be adopted where applicable. Consensus from DSD should be sought on technical details of the drainage and sewerage proposals.	Project site / design and construction period	Relevant works have yet to be commenced / completed
Construction	Phase		
Waste	 Recommendations for good site practices during the construction activities include: nomination of an approved person, such as a site manager, to be responsible for good site practices, arrangements for collection and effective disposal to an appropriate facility, of all Wastes generated at the site; training of site personnel in proper waste management and chemical handling procedures; provision of sufficient waste disposal points and regular collection of waste; appropriate measures to minimize windblown litter and dust during transportation of waste by either covering trucks or by transporting wastes in enclosed containers; and regular cleaning and maintenance programme for drainage systems, sumps and oil interceptors. 	Work site / during the construction period	Δ
Waste	Waste reduction is best achieved at the planning and design stage, as well as by ensuring the implementation of good site practices. Recommendations to achieve waste reduction include: • sorting of demolition debris and excavated materials from demolition works to recover reusable/ recyclable portions (ie soil, broken concrete, metal, etc);	Work site / during the construction period	Δ

Environmental Resources Management

Hip Hing - Ngo Kee Joint Venture

Type of Impact	Environmental Protection Measures	Location/ Timing	Status
Пірасі	 segregation and storage of different types of waste in different containers, skips or stockpiles to enhance reuse or recycling of materials and their proper disposal; encourage collection of aluminum cans by individual collectors by providing separate labeled bins to enable this waste to be segregated from other general refuse generated by the work force; proper storage and site practices to minimize the potential for damage to contamination of construction materials; and plan and stock construction materials carefully to minimize amount of waste generated and avoid unnecessary generation of waste. 		
Waste	General Refuse General refuse should be stored in enclosed bins or compaction units separate from C&D material. A reputable waste collector should be employed by the contractor to remove general refuse from the site, separately from C&D material. Preferably an enclosed and covered area should be provided to reduce the occurrence of 'wind blown' light material.	Work site / during the construction period	√
Waste	 Construction and Demolition Material In order to minimize the impact resulting from collection and transportation of C&D material for off-site disposal, the C&D material from the following construction activities should be reused and recycled as far as possible to reduce the net amount of C&D material generated from the Project; a Waste Management Plan should be prepared in accordance with ETWB TCW No. 19/2005; a recording system for the amount of wastes generated, recycled and disposed (including the disposal sites) should be proposed; in order to monitor the disposal of C&D and solid wastes at 	Work site / during the construction period	

Environmental Resources Management

Hip Hing - Ngo Kee Joint Venture

Type of	Environmental Protection Measures	Location/ Timing	Status
Impact	 public filling facilities and landfills and to control fly-tipping, a trip-ticket system should be included. One may make reference to ETWB TCW No.31/2004 for details; the large amount of C&D waste generated is mainly due to the piling works of large diameter piles' excavation at the sea front site. If however marine sediment is found during pile excavation, the handling and disposal of such wastes will be managed in accordance with the requirements of the DASO and the current ETWB Tech. Circular no. 34/2002. 		
Waste	Chemical Wastes are produced at the construction site, the Contractor would be required to register with the EPD as a Chemical Waste Producer and to follow the guidelines stated in the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes. Good quality containers compatible with the chemical wastes should be used, and incompatible chemicals should be stored separately. Appropriate labels should be securely attached on each chemical waste container Indicating the corresponding chemical characteristics of the chemical waste, such as explosives, flammable, oxidizing, irritant, toxic, harmful, corrosive, etc. The Contractor shall use a licensed collector to transport and dispose of the chemical wastes, to either the Chemical Waste Treatment Centre at Tsing Yi, or another licensed facility, in accordance with the Waste Disposal (Chemical Waste) (General) Regulation. For this Project, the amount of chemical wastes produced would be small.	Work site / during the construction period	Δ
Operational I Waste	Ceneral Refuse Similar to the existing situation, the main waste type generated during the operation stage of the Project will be general refuse generated by the public and staff. These include waste paper, food wrappings and beverage containers. The disposal of future	Work site / during the construction period	Measures not required until commencement of operational phase

Type of Impact	Environmental Protection Measures	Location/ Timing	Status
Шраст	waste arisings generated at the HKCEC would follow the existing handling and disposal arrangement. Provided proper arrangements are made with licensed contractors to collect the generated waste, adverse waste-related impact is not anticipated during the operation stage. It is expected that there will be a 5-7% increase ratio in the future operations.		
Construction Ph	i ase		
Landscape & Visual	Due consideration of appearance and view to 'hide' the construction through careful use of: (a) hoarding design; (b) temporary partition walls; (c) screen for hotels; and (d) temporary footbridge.	Entire works area and adjacent hotels	√
Landscape & Visual	Due consideration to protect existing trees.	Entire works area	√
Landscape & Visual	Due consideration of visual impact from construction activities: (a) construction workers access to reach construction areas without passing through hotels and existing HKCEC; and (b) construction light.	Entire works area	√
Operational Pha	se		
Landscape & Visual	Sensitive soft and hard landscape design for exposed rooftop garden and shady covered area underneath the Atrium Link Extension. Maximize greening opportunity via various in-situ planting and potted planting to achieve 30% of the roof area as planting area for the project.	Roof top and area underneath the Atrium Link Extension	Mitigation measures to be implemented during operational phase
Landscape & Visual	Sensitive building architecture to visually reduce the bulkiness of the building structure, to visually break down the scale of the facades, and to create rooftops for greening opportunities.	Building of the Atrium Link Extension	Mitigation measures to be implemented during operational phase

Type of Impact	Environmental Protection Measures	Location/ Timing	Status
Landscape & Visual	Appearance and view considerations: (a) avoid industrial feel of building service elements; (b) interior visual screens for lower levels of the hotels; (c) consider relocation of facilities of interior spaces of hotels; and (d) careful lighting design at roofs and for building façade to avoid night-time glare.	Entire proposed works and adjacent hotels	Mitigation measures to be implemented during operational phase
Landscape & Visual	Transplanting of trees to adjacent locations.	Convention Avenue	Mitigation measures to be implemented during operational phase
Landscape & Visual	Reinstatement of existing waterfront public footpaths along Convention Avenue and the existing open spaces near Fenwick Street.	Convention Avenue and Fenwick Street	Mitigation measures to be implemented during operational phase

Remark:

- √ Compliance of Mitigation Measures
- Compliance of Mitigation but need improvement
- x Non-compliance of Mitigation Measures
- ▲ Non-compliance of Mitigation Measures but rectified by Hip Hing Ngo Kee JV
- Δ Deficiency of Mitigation Measures but rectified by Hip Hing Ngo Kee JV

Annex F

24-hour and 1-hour TSP Monitoring Results

24-hour TSP Monitoring Results

24-hour TSP Monitoring Results at Station AM1 (Nearby The Grand Hyatt)

Date	Filter W	eight (g)	Flow Rate	e (m³/min.)	Elapse	e Time	Sampling	Conc.	Weather	Ave. Air	Particulate	Av. flow	Total vol.
	Initial	Final	Initial	Final	Initial	Final	Time(hrs.)	(µg/m ³)	Condition	Temp. (°C)	weight(g)	(m ³ /min)	(m^3)
8/8/08-9/8/08	2.8339	2.9297	1.1199	1.1199	13869.30	13894.37	25.1	57	Rainy	25.7	0.0958	1.1199	1684.55
12/8/08-13/8/08	2.8000	2.8974	1.0895	1.0895	13896.37	13920.37	24.0	62	Sunny	27.8	0.0974	1.0895	1568.88
18/8/08-19/8/08	2.7658	2.8423	1.0590	1.0590	13923.37	13947.37	24.0	50	Sunny	29.3	0.0765	1.0590	1524.96
23/8/08-24/8/08	2.8398	2.9088	1.2721	1.2721	13950.37	13974.37	24.0	38	Rainy	25.1	0.0690	1.2721	1831.82
29/8/08-30/8/08	2.8091	2.8672	1.2203	1.2203	13977.37	14001.37	24.0	33	Sunny	28.8	0.0581	1.2203	1757.23
					_	_	Min	33	_	_	_		
							Max	62					

Average

24-hour TSP Monitoring Results at Station AM2 (Nearby Renaissance Harbour View Hotel)

Date	Filter W	eight (g)	Flow Rate	Flow Rate (m ³ /min.)		Elapse Time		Conc.	Weather	Ave. Air	Particulate	Av. flow	Total vol.
	Initial	Final	Initial	Final	Initial	Final	Time(hrs.)	(µg/m³)	Condition	Temp. (°C)	weight(g)	(m ³ /min)	(m ³)
8/8/08-9/8/08	2.8863	2.9387	1.3240	1.3240	12198.71	12222.13	23.4	28	Rainy	25.7	0.0524	1.3240	1860.48
12/8/08-13/8/08	2.8170	2.9129	1.3240	1.3240	12224.13	12248.13	24.0	50	Sunny	27.8	0.0959	1.3240	1906.56
18/8/08-19/8/08	2.7862	2.8306	1.2969	1.2969	12251.13	12275.13	24.0	24	Sunny	29.3	0.0444	1.2969	1867.54
23/8/08-24/8/08	2.8226	2.8973	1.4053	1.4053	12278.13	12302.13	24.0	37	Rainy	25.1	0.0747	1.4053	2023.63
29/8/08-30/8/08	2.8052	2.8658	1.0892	1.0892	12305.13	12329.13	24.0	39	Sunny	28.8	0.0606	1.0892	1568.45

Min 24 Max 50 Average 36

48

1-hour TSP Monitoring Results

1-hour TSP Monitoring Results at Station AM1 (Nearby The Grand Hyatt)

Date	Filter W	eight (g)	Flow Rate	(m³/min.)	Elapse	e Time	Sampling	Conc.	Weather	Ave. Air	Particulate	Av. flow	Total vol.
	Initial	Final	Initial	Final	Initial	Final	Time(hrs.)	(µg/m ³)	Condition	Temp. (°C)	weight(g)	(m ³ /min)	(m^3)
01-Aug-08	2.8131	2.8205	1.3330	1.3330	13865.30	13866.30	1.00	93	Sunny	28	0.0074	1.3330	79.98
04-Aug-08	2.8063	2.8194	1.2721	1.2721	13866.30	13867.30	1.00	172	Sunny	29.4	0.0131	1.2721	76.33
06-Aug-08	2.7819	2.7946	1.1504	1.1504	13867.30	13868.30	1.00	184	Rainy	25.7	0.0127	1.1504	69.02
08-Aug-08	2.8670	2.8745	1.1199	1.1199	13868.30	13869.30	1.00	112	Rainy	25.7	0.0075	1.1199	67.19
11-Aug-08	2.7860	2.7990	1.1504	1.1504	13894.37	13895.37	1.00	188	Rainy	25.3	0.0130	1.1504	69.02
12-Aug-08	2.7898	2.7961	1.1504	1.1504	13895.37	13896.37	1.00	91	Sunny	27.8	0.0063	1.1504	69.02
13-Aug-08	2.8441	2.8490	0.9982	0.9982	13920.37	13921.37	1.00	82	Sunny	28.8	0.0049	0.9982	59.89
15-Aug-08	2.8420	2.8497	0.9982	0.9982	13921.37	13922.37	1.00	129	Sunny	28.7	0.0077	0.9982	59.89
18-Aug-08	2.8186	2.8256	0.9982	0.9982	13922.37	13923.37	1.00	117	Sunny	29.3	0.0070	0.9982	59.89
20-Aug-08	2.8508	2.8580	1.0286	1.0286	13947.37	13948.37	1.00	117	Sunny	29.5	0.0072	1.0286	61.72
22-Aug-08	2.8595	2.8622	1.0590	1.0590	13948.37	13949.37	1.00	42	Rainy	26.2	0.0027	1.0590	63.54
23-Aug-08	2.8336	2.8399	1.0590	1.0590	13949.37	13950.37	1.00	99	Rainy	25.1	0.0063	1.0590	63.54
25-Aug-08	2.7712	2.7768	1.1199	1.1199	13974.37	13975.37	1.00	83	Sunny	28.2	0.0056	1.1199	67.19
27-Aug-08	2.7580	2.7661	1.0640	1.0640	13975.37	13976.37	1.00	127	Sunny	28.3	0.0081	1.0640	63.84
29-Aug-08	2.7955	2.8045	1.0953	1.0953	13976.37	13977.37	1.00	137	Sunny	28.8	0.0090	1.0953	65.72

 Min
 42

 Max
 188

 Average
 118

1-hour TSP Monitoring Results at Station AM2 (Nearby Renaissance Harbour View Hotel)

Date	Filter W	eight (g)	Flow Rate	(m³/min.)	Elapse	e Time	Sampling	Conc.	Weather	Ave. Air	Particulate	Av. flow	Total vol.
	Initial	Final	Initial	Final	Initial	Final	Time(hrs.)	(µg/m³)	Condition	Temp. (°C)	weight(g)	(m ³ /min)	(m ³)
01-Aug-08	2.7943	2.8004	1.2969	1.2969	12194.71	12195.71	1.00	78	Sunny	28	0.0061	1.2969	77.81
04-Aug-08	2.7817	2.7970	1.3511	1.3511	12195.71	12196.71	1.00	189	Sunny	29.4	0.0153	1.3511	81.07
06-Aug-08	2.8162	2.8297	1.3240	1.3240	12196.71	12197.71	1.00	170	Rainy	25.7	0.0135	1.3240	79.44
08-Aug-08	2.8907	2.8974	1.3240	1.3240	12197.71	12198.71	1.00	84	Rainy	25.7	0.0067	1.3240	79.44
11-Aug-08	2.8458	2.8600	1.2969	1.2969	12222.13	12223.13	1.00	182	Rainy	25.3	0.0142	1.2969	77.81
12-Aug-08	2.7900	2.7980	1.3240	1.3240	12223.13	12224.13	1.00	101	Sunny	27.8	0.0080	1.3240	79.44
13-Aug-08	2.8758	2.8836	1.3240	1.3240	12248.13	12249.13	1.00	98	Sunny	28.8	0.0078	1.3240	79.44
15-Aug-08	2.8321	2.8409	1.2969	1.2969	12249.13	12250.13	1.00	113	Sunny	28.7	0.0088	1.2969	77.81
18-Aug-08	2.8061	2.8140	1.2969	1.2969	12250.13	12251.13	1.00	102	Sunny	29.3	0.0079	1.2969	77.81
20-Aug-08	2.8194	2.8278	1.2969	1.2969	12275.13	12276.13	1.00	108	Sunny	29.5	0.0084	1.2969	77.81
22-Aug-08	2.8575	2.8604	1.3511	1.3511	12276.13	12277.13	1.00	36	Rainy	26.2	0.0029	1.3511	81.07
23-Aug-08	2.8116	2.8175	1.2698	1.2698	12277.13	12278.13	1.00	77	Rainy	25.1	0.0059	1.2698	76.19
25-Aug-08	2.7905	2.7975	1.2969	1.2969	12302.13	12303.13	1.00	90	Sunny	28.2	0.0070	1.2969	77.81
27-Aug-08	2.7857	2.7923	1.0892	1.0892	12303.13	12304.13	1.00	101	Sunny	28.3	0.0066	1.0892	65.35
29-Aug-08	2.7470	2.7552	1.0892	1.0892	12304.13	12305.13	1.00	125	Sunny	28.8	0.0082	1.0892	65.35
		•											

 Min
 36

 Max
 189

 Average
 110

Meteorological Data Extracted from King's Park Stations of the Hong Kong Observatory

			к	ing's Park Statio	n	
Date	Weather	Average Air Temperature (° C)	Average Relative Humiditiy (%)	Total Rainfall (mm)	Wind Direction (Degree)	Average Wind Speed (km/h)
01-Aug-08	Sunny	28	84	0.0	110	9.9
04-Aug-08	Sunny	29.4	75	0.0	110	8.8
06-Aug-08	Rainy	25.7	92	6.0#	110	25.8
08-Aug-08	Rainy	25.7	95	52.0	100	7.1
11-Aug-08	Rainy	25.3	92	17.0	270	4.9
12-Aug-08	Sunny	27.8	84	0.0	170	7.9
13-Aug-08	Sunny	28.8	78	0.0	280	7.9
15-Aug-08	Sunny	28.7	80	0.0	270	10.0
18-Aug-08	Sunny	29.3	79	0.0	110	10.5
20-Aug-08	Sunny	29.5	77	0.0	270	9.7
22-Aug-08	Rainy	26.2	83	75.5	10	28.8
23-Aug-08	Rainy	25.1	84	42.5	220	14.7
25-Aug-08	Sunny	28.2	83	0.0	170	6.8
27-Aug-08	Sunny	28.3	76	0.0	270	7.3
29-Aug-08	Sunny	28.8	79	0.0	270	7.5

Notes:

- missing (less than 24 hourly observations a day)

NA - not available

24-hour TSP Monitoring Results

24-hour TSP Monitoring Results at Station AM1 (Nearby The Grand Hyatt)

Date	Filter W	eight (g)	Flow Rate	Flow Rate (m ³ /min.)		Elapse Time		Conc.	Weather	Ave. Air	Particulate	Av. flow	Total vol.
	Initial	Final	Initial	Final	Initial	Final	Time(hrs.)	(μg/m³)	Condition	Temp. (°C)	weight(g)	(m³/min)	(m ³)
4/9/08-5/9/08	2.7330	2.8040	1.1891	1.1891	14004.37	14028.37	24.0	41	Sunny	27.9	0.0710	1.1891	1712.30
10/9/08-11/9/08	2.7617	2.8517	1.0953	1.0953	14031.37	14055.37	24.0	57	Sunny	29	0.0900	1.0953	1577.23
16/9/08-17/9/08	2.7546	2.9913	1.0640	1.0640	14058.37	14082.37	24.0	154	Sunny	30.3	0.2367	1.0640	1532.16
22/9/08-23/9/08	2.7754	3.0318	1.1265	1.1265	14085.37	14109.37	24.0	158	Sunny	31.5	0.2564	1.1265	1622.16
27/9/08-28/9/08	2.7627	2.8729	1.1891	1.1891	14112.37	14136.37	24.0	64	Sunny	27.8	0.1102	1.1891	1712.30

 Min
 41

 Max
 158

 Average
 95

24-hour TSP Monitoring Results at Station AM2 (Nearby Renaissance Harbour View Hotel)

Date	Filter W	eight (g)	Flow Rate	Flow Rate (m ³ /min.)		Elapse Time		Conc.	Weather	Ave. Air	Particulate	Av. flow	Total vol.
	Initial	Final	Initial	Final	Initial	Final	Time(hrs.)	(μg/m ³)	Condition	Temp. (°C)	weight(g)	(m³/min)	(m ³)
4/9/08-5/9/08	2.7883	2.8684	1.2038	1.2038	12332.13	12356.13	24.0	46	Sunny	27.9	0.0801	1.2038	1733.47
10/9/08-11/9/08	2.7730	2.8513	1.0510	1.0510	12359.13	12383.13	24.0	52	Sunny	29	0.0783	1.0510	1513.44
16/9/08-17/9/08	2.7799	3.0303	1.2038	1.2038	12386.13	12410.13	24.0	144	Sunny	30.3	0.2504	1.2038	1733.47
22/9/08-23/9/08	2.7787	3.0309	1.0892	1.0892	12413.13	12437.13	24.0	161	Sunny	31.5	0.2522	1.0892	1568.45
27/9/08-28/9/08	2.7347	2.8378	1.0128	1.0128	12440.13	12464.13	24.0	71	Sunny	27.8	0.1031	1.0128	1458.43

Min 46 Max 161 Average 95

1-hour TSP Monitoring Results

1-hour TSP Monitoring Results at Station AM1 (Nearby The Grand Hyatt)

Date	Filter W	eight (g)	Flow Rate	(m³/min.)	Elapse	e Time	Sampling	Conc.	Weather	Ave. Air	Particulate	Av. flow	Total vol.
	Initial	Final	Initial	Final	Initial	Final	Time(hrs.)	(μg/m ³)	Condition	Temp. (°C)	weight(g)	(m³/min)	(m ³)
1-Sep-08	2.8038	2.8078	1.0640	1.0640	14001.37	14002.37	1.00	63	Sunny	29.2	0.0040	1.0640	63.84
3-Sep-08	2.7593	2.7695	1.0327	1.0327	14002.37	14003.37	1.00	165	Rainy	27.7	0.0102	1.0327	61.96
4-Sep-08	2.7815	2.7872	1.0327	1.0327	14003.37	14004.37	1.00	92	Sunny	27.9	0.0057	1.0327	61.96
5-Sep-08	2.7547	2.7618	1.1891	1.1891	14028.37	14029.37	1.00	100	Rainy	27.2	0.0071	1.1891	71.35
8-Sep-08	2.7481	2.7544	1.1578	1.1578	14029.37	14030.37	1.00	91	Sunny	28	0.0063	1.1578	69.47
10-Sep-08	2.7487	2.7553	1.1891	1.1891	14030.37	14031.37	1.00	93	Sunny	29	0.0066	1.1891	71.35
12-Sep-08	2.7730	2.7813	1.0953	1.0953	14055.37	14056.37	1.00	126	Sunny	30.3	0.0083	1.0953	65.72
13-Sep-08	2.7684	2.7789	1.1578	1.1578	14056.37	14057.37	1.00	151	Sunny	30.7	0.0105	1.1578	69.47
16-Sep-08	2.7808	2.7940	1.1578	1.1578	14057.37	14058.37	1.00	190	Sunny	30.3	0.0132	1.1578	69.47
17-Sep-08	2.7869	2.8005	1.0640	1.0640	14082.37	14083.37	1.00	213	Sunny	30.1	0.0136	1.0640	63.84
19-Sep-08	2.7762	2.7951	1.1265	1.1265	14083.37	14084.37	1.00	280	Rainy	28.1	0.0189	1.1265	67.59
22-Sep-08	2.7743	2.7870	1.0953	1.0953	14084.37	14085.37	1.00	193	Sunny	31.5	0.0127	1.0953	65.72
24-Sep-08	2.7633	2.7781	1.0015	1.0015	14109.37	14110.37	1.00	246	Rainy	26.7	0.0148	1.0015	60.09
26-Sep-08	2.7832	2.7927	0.9702	0.9702	14110.37	14111.37	1.00	163	Sunny	28.6	0.0095	0.9702	58.21
27-Sep-08	2.7956	2.8027	1.0953	1.0953	14111.37	14112.37	1.00	108	Sunny	27.8	0.0071	1.0953	65.72
29-Sep-08	2.7278	2.7367	1.1265	1.1265	14136.37	14137.37	1.00	132	Sunny	27.6	0.0089	1.1265	67.59

 Min
 63

 Max
 280

 Average
 150

1-hour TSP Monitoring Results at Station AM2 (Nearby Renaissance Harbour View Hotel)

Date	Filter W	eight (g)	Flow Rate	(m³/min.)	Elapse	e Time	Sampling	Conc.	Weather	Ave. Air	Particulate	Av. flow	Total vol.
	Initial	Final	Initial	Final	Initial	Final	Time(hrs.)	(μg/m ³)	Condition	Temp. (°C)	weight(g)	(m ³ /min)	(m ³)
1-Sep-08	2.7974	2.8030	1.2420	1.2420	12329.13	12330.13	1.00	75	Sunny	29.2	0.0056	1.2420	74.52
3-Sep-08	2.8060	2.8148	1.2038	1.2038	12330.13	12331.13	1.00	122	Rainy	27.7	0.0088	1.2038	72.23
4-Sep-08	2.7465	2.7529	0.8981	0.8981	12331.13	12332.13	1.00	119	Sunny	27.9	0.0064	0.8981	53.89
5-Sep-08	2.7779	2.7849	1.1656	1.1656	12356.13	12357.13	1.00	100	Rainy	27.2	0.0070	1.1656	69.94
8-Sep-08	2.7555	2.7622	1.2802	1.2802	12357.13	12358.13	1.00	87	Sunny	28	0.0067	1.2802	76.81
10-Sep-08	2.7605	2.7649	1.0892	1.0892	12358.13	12359.13	1.00	67	Sunny	29	0.0044	1.0892	65.35
12-Sep-08	2.7191	2.7245	0.8599	0.8599	12383.13	12384.13	1.00	105	Sunny	30.3	0.0054	0.8599	51.59
13-Sep-08	2.7832	2.7968	1.2802	1.2802	12384.13	12385.13	1.00	177	Sunny	30.7	0.0136	1.2802	76.81
16-Sep-08	2.7448	2.7571	1.1656	1.1656	12385.13	12386.13	1.00	176	Sunny	30.3	0.0123	1.1656	69.94
17-Sep-08	2.7782	2.7951	1.1274	1.1274	12410.13	12411.13	1.00	250	Sunny	30.1	0.0169	1.1274	67.64
19-Sep-08	2.7948	2.8035	1.1274	1.1274	12411.13	12412.13	1.00	129	Rainy	28.1	0.0087	1.1274	67.64
22-Sep-08	2.7589	2.7751	1.1274	1.1274	12412.13	12413.13	1.00	239	Sunny	31.5	0.0162	1.1274	67.64
24-Sep-08	2.8043	2.8178	1.0510	1.0510	12437.13	12438.13	1.00	214	Rainy	26.7	0.0135	1.0510	63.06
26-Sep-08	2.8003	2.8070	1.0128	1.0128	12438.13	12439.13	1.00	110	Sunny	28.6	0.0067	1.0128	60.77
27-Sep-08	2.8107	2.8152	0.9364	0.9364	12439.13	12440.13	1.00	80	Sunny	27.8	0.0045	0.9364	56.18
29-Sep-08	2.7284	2.7362	1.0128	1.0128	12464.13	12465.13	1.00	128	Sunny	27.6	0.0078	1.0128	60.77

 Min
 67

 Max
 250

 Average
 137

Meteorological Data Extracted from King's Park Stations of the Hong Kong Observatory

			K	ing's Park Statio	n	
Date	Weather	Average Air Temperature (°C)	Average Relative Humiditiy (%)	Total Rainfall (mm)	Wind Direction (Degree)	Average Wind Speed (km/h)
1-Sep-08	Sunny	29.2	79	0.0	270	8.5
3-Sep-08	Rainy	27.7	85	10.5	270	5.7
4-Sep-08	Sunny	27.9	80	0.0	270	5.7
5-Sep-08	Rainy	27.2	87	28.5	100#	3.5#
8-Sep-08	Sunny	28	75	0.0	110	11.0
10-Sep-08	Sunny	29	72	0.0	100	7.7
12-Sep-08	Sunny	30.3	67	0.0	270	6.9
13-Sep-08	Sunny	30.7	59	0.0	20	7.2
16-Sep-08	Sunny	30.3	65	0.0	270	5.5
17-Sep-08	Sunny	30.1	78	0.0	270	5.3
19-Sep-08	Rainy	28.1	86	27.0	100	8.0
22-Sep-08	Sunny	31.5	71	0.0	260#	8.3#
24-Sep-08	Rainy	26.7	90	47.0	110	24.5
26-Sep-08	Sunny	28.6	78	0.0	100	11.0
27-Sep-08	Sunny	27.8	75	0.0	100	11.7
29-Sep-08	Sunny	27.6	59	0.0	30	9.9

Notes:

- missing (less than 24 hourly observations a day)

NA - not available

24-hour TSP Monitoring Results

24-hour TSP Monitoring Results at Station AM1 (Nearby The Grand Hyatt)

Date	Filter W	eight (g)	Flow Rate (m ³ /min.)		Elapse Time		Sampling	Conc.	Weather	Ave. Air	Particulate	Av. flow	Total vol.
	Initial	Final	Initial	Final	Initial	Final	Time(hrs.)	(µg/m³)	Condition	Temp. (°C)	weight(g)	(m ³ /min)	(m^3)
03 to 04 Oct 08	2.7783	2.8812	1.1265	1.1265	14139.37	14163.37	24.0	63	Rainy	26	0.1029	1.1265	1622.16
09 to 10 Oct 08	2.7795	2.8758	1.1578	1.1578	14166.37	14190.37	24.0	58	Sunny	26	0.0963	1.1578	1667.23
15 to 16 Oct 08	2.7720	2.9530	1.2516	1.2516	14193.37	14217.37	24.0	100	Sunny	26	0.1810	1.2516	1802.30
21 to 22 Oct 08	2.7417	2.8289	1.0953	1.0953	14220.37	14244.37	24.0	55	Sunny	26	0.0872	1.0953	1577.23
27 to 28 Oct 08	2.7450	2.9711	1.0568	1.0568	14247.37	14271.37	24.0	149	Sunny	26	0.2261	1.0568	1521.79
							Min	55					

Min 55 Max 149 Average 85

24-hour TSP Monitoring Results at Station AM2 (Nearby Renaissance Harbour View Hotel)

Date	Filter W	eight (g)	Flow Rate (m ³ /min.)		Elapse Time		Sampling	Conc.	Weather	Ave. Air	Particulate	Av. flow	Total vol.
	Initial	Final	Initial	Final	Initial	Final	Time(hrs.)	(µg/m³)	Condition	Temp. (°C)	weight(g)	(m ³ /min)	(m^3)
03 to 04 Oct 08	2.7780	2.8535	1.0892	1.0892	12467.13	12491.13	24.0	48	Rainy	26	0.0755	1.0892	1568.45
09 to 10 Oct 08	2.8086	2.8880	1.0892	1.0892	12494.13	12518.13	24.0	51	Sunny	26	0.0794	1.0892	1568.45
15 to 16 Oct 08	2.8004	2.9377	0.9746	0.9746	12521.13	12545.13	24.0	98	Sunny	26	0.1373	0.9746	1403.42
21 to 22 Oct 08	2.6947	2.9198	1.0892	1.0892	12548.13	12572.13	24.0	144	Sunny	26	0.2251	1.0892	1568.45
27 to 28 Oct 08	2.7629	2.9135	1.0868	1.0868	12575.13	12599.13	24.0	96	Sunny	26	0.1506	1.0868	1564.99

 Min
 48

 Max
 144

 Average
 87

1-hour TSP Monitoring Results

1-hour TSP Monitoring Results at Station AM1 (Nearby The Grand Hyatt)

Date	Filter W	eight (g)	Flow Rate	(m³/min.)	Elapse	e Time	Sampling	Conc.	Weather	Ave. Air	Particulate	Av. flow	Total vol.
	Initial	Final	Initial	Final	Initial	Final	Time(hrs.)	$(\mu g/m^3)$	Condition	Temp. (°C)	weight(g)	(m ³ /min)	(m ³)
02 Oct 08	2.7709	2.7922	1.1265	1.1265	14137.37	14138.37	1.00	315	Rainy	27	0.0213	1.1265	67.59
03 Oct 08	2.7629	2.7727	1.1265	1.1265	14138.37	14139.37	1.00	145	Rainy	26	0.0098	1.1265	67.59
06 Oct 08	2.7719	2.7790	1.1578	1.1578	14163.37	14164.37	1.00	102	Sunny	24	0.0071	1.1578	69.47
08 Oct 08	2.7975	2.8066	0.9702	0.9702	14164.37	14165.37	1.00	156	Rainy	25	0.0091	0.9702	58.21
09 Oct 08	2.7742	2.7835	1.1578	1.1578	14165.37	14166.37	1.00	134	Sunny	26	0.0093	1.1578	69.47
10 Oct 08	2.8025	2.8159	1.1578	1.1578	14190.37	14191.37	1.00	193	Sunny	27	0.0134	1.1578	69.47
13 Oct 08	2.7868	2.7987	1.0953	1.0953	14191.37	14192.37	1.00	181	Rainy	25	0.0119	1.0953	65.72
15 Oct 08	2.7648	2.7805	1.1265	1.1265	14192.37	14193.37	1.00	232	Sunny	26	0.0157	1.1265	67.59
17 Oct 08	2.7605	2.7668	1.1265	1.1265	14217.37	14218.37	1.00	93	Sunny	26	0.0063	1.1265	67.59
20 Oct 08	2.7414	2.7545	1.0953	1.0953	14218.37	14219.37	1.00	199	Sunny	26	0.0131	1.0953	65.72
21 Oct 08	2.7493	2.7592	1.1578	1.1578	14219.37	14220.37	1.00	143	Sunny	26	0.0099	1.1578	69.47
22 Oct 08	2.7676	2.7850	1.1578	1.1578	14244.37	14245.37	1.00	250	Sunny	26	0.0174	1.1578	69.47
24 Oct 08	2.7515	2.7668	1.0327	1.0327	14245.37	14246.37	1.00	247	Sunny	27	0.0153	1.0327	61.96
27 Oct 08	2.7865	2.8057	1.0885	1.0885	14246.37	14247.37	1.00	294	Sunny	26	0.0192	1.0885	65.31
29 Oct 08	2.7532	2.7668	0.9936	0.9936	14271.37	14272.37	1.00	228	Sunny	26	0.0136	0.9936	59.62
31 Oct 08	2.7494	2.7639	0.9936	0.9936	14272.37	14273.37	1.00	243	Sunny	26	0.0145	0.9936	59.62

 Min
 93

 Max
 315

 Average
 197

1-hour TSP Monitoring Results at Station AM2 (Nearby Renaissance Harbour View Hotel)

Date	Filter W	eight (g)	Flow Rate	(m³/min.)	Elapse	e Time	Sampling	Conc.	Weather	Ave. Air	Particulate	Av. flow	Total vol.
	Initial	Final	Initial	Final	Initial	Final	Time(hrs.)	(µg/m³)	Condition	Temp. (°C)	weight(g)	(m ³ /min)	(m ³)
02 Oct 08	2.7745	2.7879	0.9364	0.9364	12465.13	12466.13	1.00	239	Rainy	27	0.0134	0.9364	56.18
03 Oct 08	2.7870	2.7951	0.8599	0.8599	12466.13	12467.13	1.00	157	Rainy	26	0.0081	0.8599	51.59
06 Oct 08	2.7549	2.7617	1.0128	1.0128	12491.13	12492.13	1.00	112	Sunny	24	0.0068	1.0128	60.77
08 Oct 08	2.7773	2.7831	1.0892	1.0892	12492.13	12493.13	1.00	89	Rainy	25	0.0058	1.0892	65.35
09 Oct 08	2.7684	2.7741	1.0892	1.0892	12493.13	12494.13	1.00	87	Sunny	26	0.0057	1.0892	65.35
10 Oct 08	2.7945	2.8022	1.0892	1.0892	12518.13	12519.13	1.00	118	Sunny	27	0.0077	1.0892	65.35
13 Oct 08	2.7750	2.7816	0.9364	0.9364	12519.13	12520.13	1.00	117	Rainy	25	0.0066	0.9364	56.18
15 Oct 08	2.7584	2.7678	0.9364	0.9364	12520.13	12521.13	1.00	167	Sunny	26	0.0094	0.9364	56.18
17 Oct 08	2.7300	2.7380	0.8599	0.8599	12545.13	12546.13	1.00	155	Sunny	26	0.0080	0.8599	51.59
20 Oct 08	2.7428	2.7516	0.9364	0.9364	12546.13	12547.13	1.00	157	Sunny	26	0.0088	0.9364	56.18
21 Oct 08	2.7816	2.7868	1.0892	1.0892	12547.13	12548.13	1.00	80	Sunny	26	0.0052	1.0892	65.35
22 Oct 08	2.7224	2.7329	0.9364	0.9364	12572.13	12573.13	1.00	187	Sunny	26	0.0105	0.9364	56.18
24 Oct 08	2.7430	2.7564	1.0892	1.0892	12573.13	12574.13	1.00	205	Sunny	27	0.0134	1.0892	65.35
27 Oct 08	2.7871	2.8002	1.1623	1.1623	12574.13	12575.13	1.00	188	Sunny	26	0.0131	1.1623	69.74
29 Oct 08	2.7653	2.7769	1.0868	1.0868	12599.13	12600.13	1.00	178	Sunny	26	0.0116	1.0868	65.21
31 Oct 08	2.7567	2.7713	1.0868	1.0868	12600.13	12601.13	1.00	224	Sunny	26	0.0146	1.0868	65.21


 Min
 80


 Max
 239


 Average
 149


Meteorological Data Extracted from King's Park Stations of the Hong Kong Observatory


			K	ing's Park Statio	on	
Date	Weather	Average Air Temperature (° C)	Average Relative Humiditiy (%)	Total Rainfall (mm)	Wind Direction (Degree)	Average Wind Speed (km/h)
2-Oct-08	Rainy	26.6	78	2.0	100	10.4
3-Oct-08	Rainy	25.9	83	2.0	90	14.6
6-Oct-08	Sunny	24.1	74	0.0	360	12.6
8-Oct-08	Rainy	25.3	77	0.5	100	10.8
9-Oct-08	Sunny	26.4	76	0.0	100	12.7
10-Oct-08	Sunny	27	73	0.0	100	10.2
13-Oct-08	Rainy	24.7	75	0.5	90	12.8
15-Oct-08	Sunny	26.1	73	0.0	100	12.0
17-Oct-08	Sunny	26	82	0.0	100	10.4
20-Oct-08	Sunny	26.4	75	0.0	100	13.9
21-Oct-08	Sunny	25.9	77	0.0	100	11.5
22-Oct-08	Sunny	26.1	80	0.0	100	7.7
24-Oct-08	Sunny	26.8	76	0.0	100	13.4
27-Oct-08	Sunny	26	79	0.0	100	10.2
29-Oct-08	Sunny	25.9	78	0.0	100	10.8
31-Oct-08	Sunny	26.4	82	0.0	100	11.8

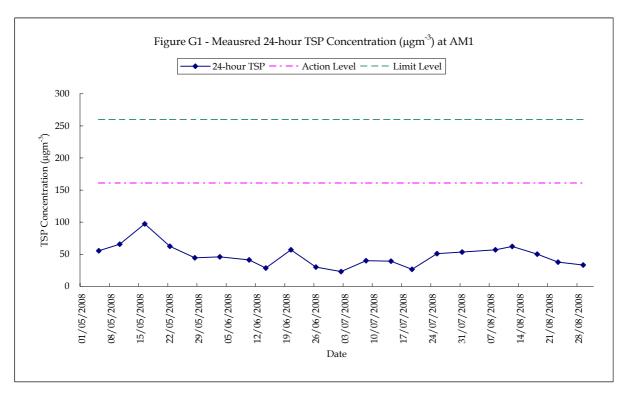


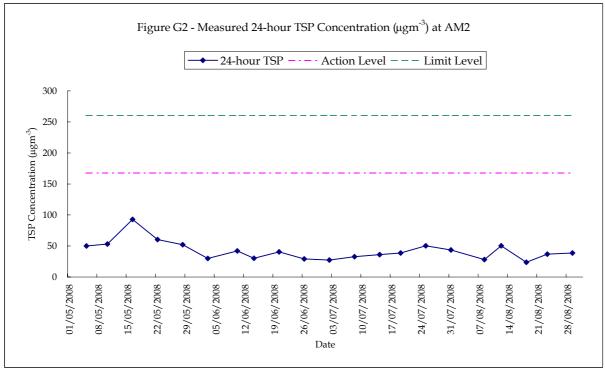


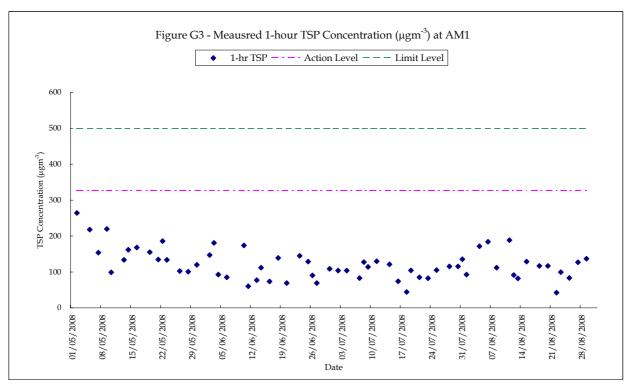


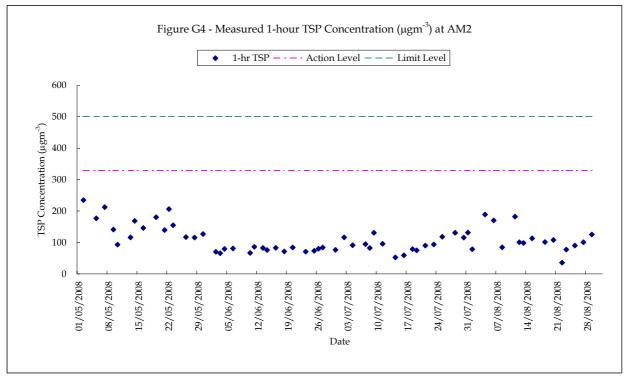


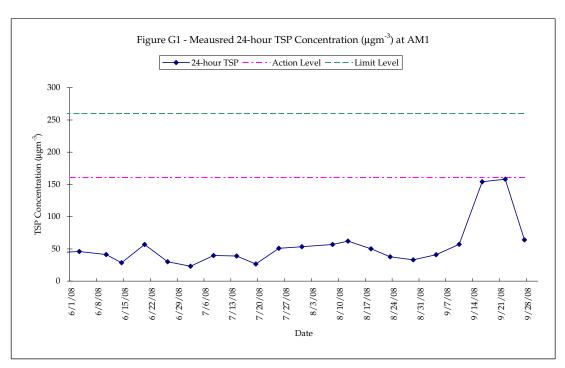


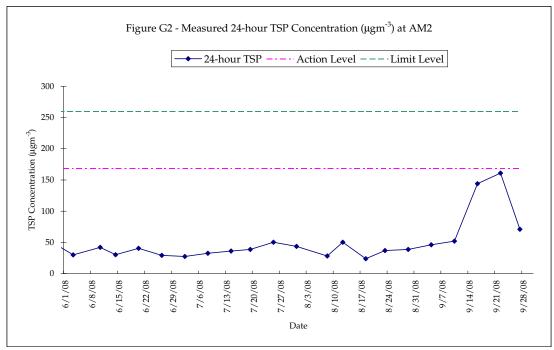


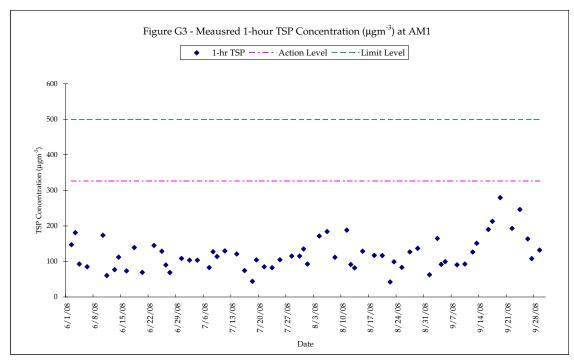


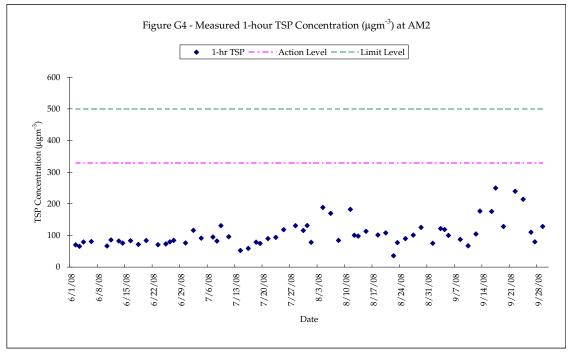

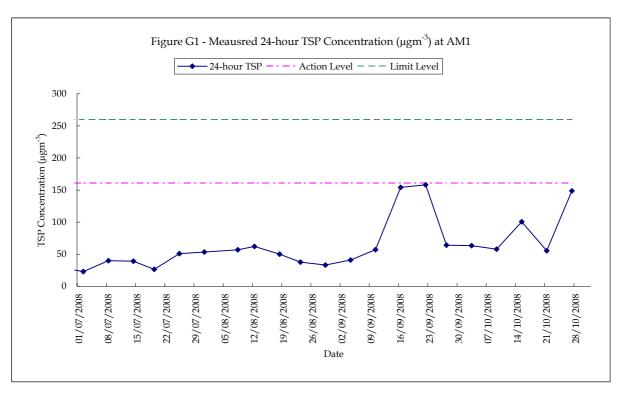

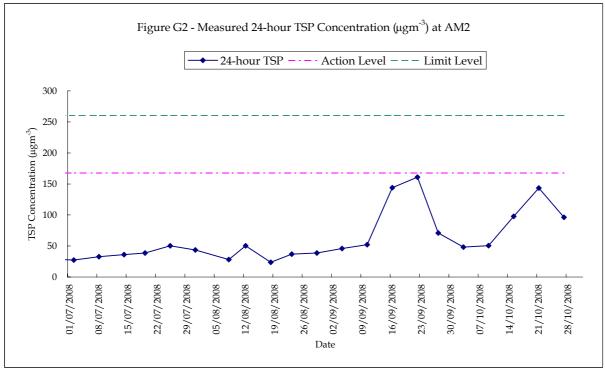

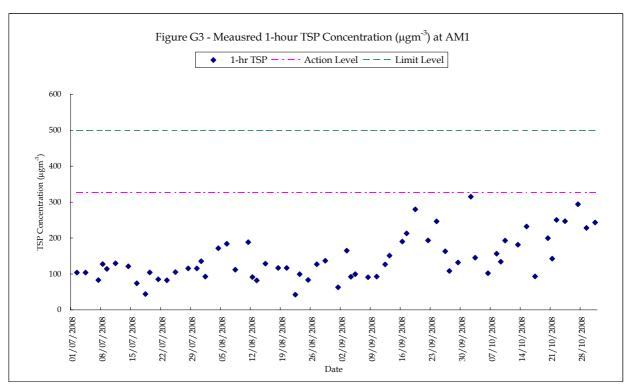

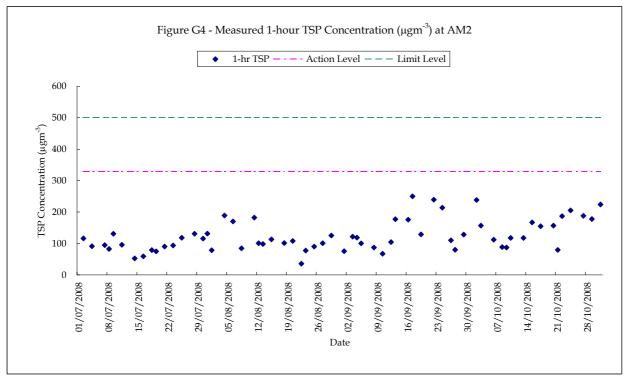

Annex G

Waste Flow Table

HKCEC – Expansion Project

Name of Project Proponent: HKTDC **Project Commencement Date: 1 Aug 2006 Construction Completion Date: March 2009**

Monthly Summary Waste Flow Table for Year 2008

Year	Acti	1 aterials (in 10) ³ Kg) ⁽¹⁾⁽²⁾	Actual Quantities of C&D Wastes (in 10 ³ Kg) ⁽⁴⁾											
	Total Quantity	Broken Concrete (3)	Reused in the	Reused in other Projects	Disposed as Public Fill	Demolition	Stee	l Materials Demolition	of existing		ardboard		al Waste	General refuse	Other waste (6)
	Generated	Concrete	Contract	(3)	T done I iii		m Link		platform	packaging		(L)		Teruse	waste
	(a)	(b)	(c)	(d) (a)-(b)-(c)-(d)		Recycle	Disposal	Recycle	Disposal	Recycle	Disposal	Recycle	Disposal	Disposal	Disposal
January	495	0	0	0	495	10 (5)	0	0	0	0.2	0.04	0	0	30	122
February	539	0	0	0	539	20 (5)	0	0	0	0.5	0.02	0	0	33.4	20
March	485	0	0	0	485	5	0	0	0	0.5	0.02	0	0	20.0	59
April	545	0	0	0	545	1	0	0	0	0.5	0.02	0	0	25.0	80
May	35	0	0	0	35	0	0	0	0	1.0	0.05	0	0	28.0	70
June	40	0	0	0	40	0	0	0	0	1.5	0.05	0	0	44.0	63.3
July	83	0	0	0	83	50	0	0	0	1.5	0.05	0	0	67.0	43.8
August	217.5	0	0	0	217.5	60	0	0	0	2.0	0.05	0	0	59.0	257.0
Sep	9	0	0	0	9	50	0	0	0	2.5	0.05	0	0	74.0	126.7
October	15	0	0	0	15	10	0	0	0	3.0	0.05	0	0	40.0	90.5
November															
December															
Total	2448.5	0	0	0	2448.5	196 ⁽⁵⁾	0	0	0	6.4.2	0.35	0	0	380.4	841.8

Note:

⁽¹⁾ Inert C&D materials include bricks, concrete, building debris, rubble and excavated soil. (2) Inert C&D material mainly generated from demolition of atrium link.

⁽³⁾ Broken concrete fro recycling into aggregates.

⁽⁴⁾ C&D wastes include steel materials generated from demolition, paper / cardboard packaging waste, chemical waste and other wastes such as general refuse. Wastes other than general refuse will be disposed of at Tsueng Kwan O Area 137 temporary construction waste sorting facility.

⁽⁵⁾ Waste from demolition of steel structure at existing Atrium Link of HKCEC (Phase 2).

⁽⁶⁾ Wastes include materials associated with additional and alternation (A&A) works of HKCEC (e.g. demolition of E&M equipment and finishing materials, bamboo scaffolding) and piling works.