

**Agreement No. CE 59/2020 (EP)  
Environmental Monitoring and  
Audit for Disposal Facility to the  
East of Sha Chau (2021-2026)  
– Investigation**

Monthly EM&A Report for  
Contaminated Mud Pits to the East of Sha Chau  
– September 2023

October 2023

Mott MacDonald  
3/F Manulife Place  
348 Kwun Tong Road  
Kwun Tong  
Kowloon  
Hong Kong

T +852 2828 5757  
mottmac.hk

Civil Engineering and  
Development Department  
Fill Management Division  
5/F, Civil Engineering and  
Development Building  
101 Princess Margaret  
Road  
Homantin, Kowloon

# **Agreement No. CE 59/2020 (EP) Environmental Monitoring and Audit for Disposal Facility to the East of Sha Chau (2021-2026) – Investigation**

Monthly EM&A Report for  
Contaminated Mud Pits to the East of Sha Chau  
– September 2023

October 2023

**Dredging, Management and Capping of Contaminated Sediment Disposal**

**Facility at Sha Chau**

**Environmental Certification Sheet**

**Environmental Permit No. EP-312/2008/A**


**Reference Document /Plan**

Document/ <del>Plan</del> to be Certified/ Verified:	Monthly EM&A Report for Contaminated Mud Pits to the East of Sha Chau – September 2023
Date of Report:	9 October 2023
Date prepared by ET:	9 October 2023
Date received by IA:	9 October 2023


**Reference EP Condition**

Environmental Permit Condition:  Condition 3.4 of EP-312/2008/A: 4 hard copies and 1 electronic copy of monthly EM&A Report shall be submitted to the Director within 10 working days after the end of the reporting month. The EM&A Reports shall include a summary of all non-compliance (exceedances) of the environmental quality performance limits (Action and Limit Levels). The submissions shall be verified by the Independent Auditor. Additional copies of the submission shall be provided to the Director upon request by the Director.
--

**ET Certification**

I hereby certify that the above referenced document/ <del>plan</del> complies with the above referenced condition of EP-312/2008/A.	
Ir Thomas Chan, Environmental Team Leader (ETL): 	Date: 9 October 2023

**IA Verification**

I hereby verify that the above referenced document/ <del>plan</del> complies with the above referenced condition of EP-312/2008/A.	
Dr Wang Wen Xiong, Independent Auditor (IA): 	Date: 9 October 2023

# Issue and Revision Record

Revision	Date	Originator	Checker	Approver	Description
A	Oct 2023	Various	Liz Lo	Thomas Chan	Revision A of Submission

**Document reference:** 423134 | 06/05/30 | A

**Information class:** Standard

This document is issued for the party which commissioned it and for specific purposes connected with the above-captioned project only. It should not be relied upon by any other party or used for any other purpose.

We accept no responsibility for the consequences of this document being relied upon by any other party, or being used for any other purpose, or containing any error or omission which is due to an error or omission in data supplied to us by other parties.

This document contains confidential information and proprietary intellectual property. It should not be shown to other parties without consent from us and from the party which commissioned it.

---

# Contents

<b>1</b>	<b>Introduction</b>	<b>1</b>
1.1	Background	1
1.2	Reporting Period	2
1.3	Details of Sampling and Laboratory Testing Activities	2
1.4	Details of Outstanding Sampling or Analysis	2
<b>2</b>	<b>Brief Discussion of Monitoring Results for ESC CMP V</b>	<b>3</b>
2.1	Introduction	3
2.2	Water Column Profiling of ESC CMP Vb – in September 2023	3
2.2.1	In-situ Measurements	3
2.2.2	Laboratory Measurements for Suspended Solids (SS)	3
2.3	Routine Water Quality Monitoring of ESC CMPs – in September 2023	3
2.3.1	In-situ Measurements	4
2.3.2	Laboratory Measurements	4
2.4	Pit Specific Sediment Chemistry of ESC CMP Vb – in September 2023	4
2.5	Sediment Chemistry after a Major Storm of ESC CMP V – in September 2023	5
<b>3</b>	<b>Future Key Issues</b>	<b>7</b>
3.1	Activities Scheduled for the Next Reporting Period	7
3.2	Study Programme	7

## Tables

Table 1.1	Works Schedule for ESC CMP V
-----------	------------------------------

## Figures

Figure 2.1	Routine & Capping Water Quality Sampling Stations (Flood-Tide) for ESC CMPs
Figure 2.2	Pit Specific Sediment Quality Monitoring Stations for CMP V
Figure 2.3	Sediment Chemistry after a Major Storm Monitoring Stations for ESC CMPs
Figure 2.4	Track of Tropical Cyclone Saola

## Appendices

- Appendix A Sampling Schedule
- Appendix B Water Quality Monitoring Results
- Appendix C Graphical Presentations
- Appendix D Study Programme

# 1 Introduction

## 1.1 Background

The Civil Engineering and Development Department (CEDD) is managing a number of marine disposal facilities in Hong Kong waters, including the Contaminated Mud Pits (CMPs) to the East of Sha Chau (ESC) for the disposal of contaminated sediment, and various open-sea disposal grounds located to the South of Cheung Chau (SCC), East of Tung Lung Chau (ETLC) and East of Ninepins (ENP) for the disposal of uncontaminated sediment.

Environmental Permits (EPs) (Ref. No. EP-312/2008/A) was issued by the Environmental Protection Department (EPD) to the CEDD, the Permit Holder, on 28 November 2008 for the Project - Disposal of Contaminated Sediment – Dredging, Management and Capping of Sediment Disposal Facility at Sha Chau.

Under the requirements of the EP, EM&A programmes which encompass water and sediment chemistry, fisheries assessment, tissue and whole body analysis, sediment toxicity and benthic recolonisation studies as set out in the EM&A Manuals are required to be implemented. EM&A programmes have been continuously carried out during the operation of the CMPs at ESC. A review of the collection and analysis of such environmental data from the monitoring programme demonstrated that there had not been any adverse environmental impacts resulting from disposal activities.<sup>1,2</sup> The current programme will assess the impacts resulting from dredging, disposal and capping operations of CMP V.

A proposal on the change of number of sample replication of water quality and sediment monitoring as well as combination of routine water quality monitoring and water quality monitoring during capping operation was submitted to EPD and agreed by EPD on 3 December 2020. The proposed changes have been effective for the EM&A activities since December 2020. In early 2022, after implementing the Phase 1 optimisation for at least one year, a further data review was conducted. The monitoring data has been reviewed and demonstrated that the data robustness and representativeness are maintained. Therefore, a technical note presenting the data review results served as a supplementary information was submitted to EPD and presented that Phase 2 optimization of sample replication of water quality and sediment monitoring for the Project will be implemented in 2022. EPD expressed no comment on the review and note the implementation of Phase 2 optimization of sample replication on 18 May 2022, and thus this optimization has been effective for the EM&A activities since July 2022.

The latest sampling schedule is provided in **Appendix A**.

The present EM&A programme under Agreement No. CE 59/2020 (EP) covers the dredging, disposal and capping operations of the ESC CMP V (see **Appendix A** for the EM&A programme.) Detailed works schedule for ESC CMP V is shown in **Table 1.1**. In September 2023, the following works were undertaken:

- Disposal of contaminated mud at ESC CMP Vb; and
- Capping operations at ESC CMP Vd.

---

<sup>1</sup> ERM (2013) Final Report. Submitted under Agreement No. CE 4/2009 (EP) Environmental Monitoring and Audit for Contaminated Mud Pit at East Sha Chau. For CEDD.

<sup>2</sup> ERM (2017) Final Report. Submitted under Agreement No. CE 23/2012 (EP) Environmental Monitoring and Audit for Contaminated Mud Pits to the South of The Brothers and at East Sha Chau (2012 - 2017). For CEDD.

**Table 1.1: Works Schedule for ESC CMP V**

Pit	Operation	2021			2022			2023			2024			2025			2026									
		Apr	May	Jun	Jul	Aug	Sep	Oct	Nov	Dec	Jan	Feb	Mar	Apr	May	Jun	Jul	Aug	Sep	Oct	Nov	Dec	Jan	Feb	Mar	
ESC CMP V	Dredging																									
	Disposal																									
	Capping																									

## 1.2 Reporting Period

This *Monthly EM&A Report for Contaminated Mud Pits to the East of Sha Chau – September 2023* covers the EM&A activities for the reporting period of September 2023 (from 1 to 30 September 2023).

## 1.3 Details of Sampling and Laboratory Testing Activities

The following monitoring activities were undertaken for ESC CMP V during the reporting period:

- Water Column Profiling of ESC CMP Vb;
- Routine Water Quality Monitoring of ESC CMPs;
- Pit Specific Sediment Chemistry of ESC CMP Vb;
- Sediment Chemistry after a Major Storm of ESC CMP V;

## 1.4 Details of Outstanding Sampling or Analysis

No outstanding sampling remained for the reporting month (September 2023).



## 2 Brief Discussion of Monitoring Results for ESC CMP V

### 2.1 Introduction

This section presents a brief discussion of the results obtained from the following monitoring activities for ESC CMP V during the reporting period:

- Water Column Profiling of ESC CMP Vb;
- Routine Water Quality Monitoring of ESC CMPs;
- Pit Specific Sediment Chemistry of ESC CMP Vb; and
- Sediment Chemistry after a Major Storm of ESC CMP V.

### 2.2 Water Column Profiling of ESC CMP Vb – in September 2023

Water Column Profiling was undertaken at a total of two sampling stations (Upstream and Downstream stations) on 5 September 2023. The monitoring results have been assessed for compliance with the Water Quality Objectives (WQOs) set by Environmental Protection Department (EPD). This consists of a review of the EPD routine water quality monitoring data for the wet season period (April to October) of 2012 – 2021 from stations in the North Western Water Control Zone (WCZ), where the ESC CMPs are located.<sup>3</sup> For Salinity, the averaged value obtained from the Reference (Upstream) station was used for the basis as the WQO. Levels of Dissolved Oxygen (DO) and Turbidity were also assessed for compliance with the Action and Limit Levels (see **Table B1** of **Appendix B** for details).

#### 2.2.1 In-situ Measurements

Analyses of results for September 2023 indicated that levels of Salinity, pH and DO complied with the WQOs at both Downstream and Upstream stations (**Table B2** of **Appendix B**). Levels of DO and Turbidity at all stations complied with the Action and Limit Levels (**Tables B1 and B2** of **Appendix B**).

#### 2.2.2 Laboratory Measurements for Suspended Solids (SS)

Analyses of results for September 2023 indicated that the SS level at both Upstream and Downstream stations complied with the WQO and the Action and Limit Levels (**Tables B1 and B2** of **Appendix B**).

Overall, the monitoring results indicated that the mud disposal operation at ESC CMP Vb did not appear to cause any deterioration in water quality during this reporting period.

### 2.3 Routine Water Quality Monitoring of ESC CMPs – in September 2023

Routine Water Quality Monitoring of ESC CMPs was undertaken on 6 September 2023. The monitoring results have been assessed for compliance with the WQOs (see **Section 2.2** above for details). The monitoring results are shown in **Tables B3, B4 and B5** of **Appendix B** and **Figures 1 to 11** of **Appendix C**. A total of ten (10) monitoring stations were sampled in September 2023 as shown in **Figure 2.1**.

---

<sup>3</sup> <http://epic.epd.gov.hk/EPICRIVER/marine/?lang=en>

### 2.3.1 In-situ Measurements

Graphical presentation of the monitoring results (Temperature, DO, pH, Salinity and Turbidity) is shown in **Figures 1 to 6 of Appendix C**. Analyses of results indicated that the levels of pH and DO complied with the WQOs at all stations in September 2023, except for higher levels of Salinity were recorded at Ma Wan station. The higher Salinities recorded at Ma Wan station are likely to be caused by the larger separation distance to Pearl River Delta mouth, which releases a large amount of freshwater runoff in the area during wet season, when compared to the Reference stations.

The levels of DO and Turbidity complied with the Action and Limit Levels at all stations (**Table B3 of Appendix B; Figures 3 and 6 of Appendix C**).

Overall, *in-situ* measurement results of the Routine Water Quality Monitoring indicated that the disposal and capping operation at ESC CMPs did not appear to cause any unacceptable impacts in water quality in September 2023.

### 2.3.2 Laboratory Measurements

Laboratory analysis of samples obtained during the reporting period indicated that the concentrations of Arsenic, Cadmium, Chromium, Copper, Lead, Mercury, Nickel and Zinc were detected in the samples at some/ all stations and their concentrations were generally similar across stations; except the concentrations of Mercury were slightly higher at Reference (RFF) station. The concentrations of Lead were only detected at Reference (RFF) station. (**Table B4 of Appendix B; Figure 7 and 8 of Appendix C**).

For nutrients, concentrations of Total Inorganic Nitrogen (TIN) were higher than the WQO (0.5 mg/L) at Reference (RFF), Impact (IPF) and Intermediate (INF) stations. (**Table B5 of Appendix B; Figure 9 of Appendix C**). It should be noted that due to the effect of the Pearl River, the North Western WCZ has historically experienced higher levels of TIN.<sup>4</sup> Therefore, the exceedances of TIN WQO at these stations are unlikely to be caused by the disposal operation at ESC CMPs. The concentration of Ammonia Nitrogen (NH<sub>3</sub>-N) were generally similar across all stations. (**Table B5 of Appendix B; Figure 9 of Appendix C**). The concentrations of Biochemical Oxygen Demand (BOD<sub>5</sub>) were below limit of reporting at all stations. (**Table B5 of Appendix B**).

Analyses of results for the reporting period indicated that the SS levels complied with the wet season WQO (11.7 mg/L) and Action and Limit Levels at all stations. (**Tables B1 and B5 of Appendix B; Figure 10 of Appendix C**).

Based on the available results of the Routine Water Quality Monitoring which indicated that the disposal and capping operation at ESC CMPs did not appear to cause any unacceptable deterioration in water quality during the reporting period. Detailed statistical analysis will be presented in the Quarterly EM&A Report to investigate any spatial and temporal trends of potential concern.

## 2.4 Pit Specific Sediment Chemistry of ESC CMP Vb – in September 2023

Monitoring locations for Pit Specific Sediment Chemistry for ESC CMP Vb are shown in **Figure 2.2**. A total of six (6) monitoring stations were sampled on 4 September 2023.

The concentrations of most inorganic contaminants were lower than the Lower Chemical Exceedance Levels (LCELs) at all stations, except for Arsenic. The concentrations of Arsenic were higher than the LCEL at Near-Pit station ESC-NNCA and Pit-Edge station ESC-NECA. (**Figures 11 and 12 of Appendix C**).

---

<sup>4</sup> [https://www.epd.gov.hk/epd/misc/marine\\_quality/1986-2005/eng/08\\_western\\_content.htm](https://www.epd.gov.hk/epd/misc/marine_quality/1986-2005/eng/08_western_content.htm)

Whilst the average concentration of Arsenic in the Earth's crust is generally ~2mg/kg, significantly higher Arsenic concentrations (median = 14 mg/kg) have been recorded in Hong Kong's onshore sediments.<sup>5</sup> It is presumed that the natural concentrations of Arsenic are similar in onshore and offshore sediments,<sup>6</sup> and relatively high Arsenic levels may thus occur throughout Hong Kong. Therefore, the LCEL exceedances of Arsenic are unlikely to be caused by the disposal operations at ESC CMP Vb but rather as a result of naturally occurring deposits.

For organic contaminants, the concentrations of Total Organic Carbon (TOC) were higher at Active-Pit station ESC-NPCB. (**Figure 13 of Appendix C**). The concentrations of Low Molecular Weight Polycyclic Aromatic Hydrocarbons (PAHs) were higher at Active-Pit station ESC-NPCB. (**Figures 14 of Appendix C**).

For High Molecular Weight Polycyclic Aromatic Hydrocarbons (PAHs), the concentrations were higher than LCEL at Active-Pit station ESC-NPCB. (**Figures 14 of Appendix C**). The concentrations of Tributyltin (TBT) was higher at Active Pit station ESC-NPCB (**Figure 15 of Appendix C**).

The concentrations of Total Polychlorinated Biphenyls (PCBs), Total dichloro-diphenyl-trichloroethane (DDT) and 4,4'-dichlorodiphenyldichloroethylene (DDE) were below the limit of reporting at all stations during the reporting period.

Considering that the higher levels (i.e. concentrations higher than LCEL) of High Molecular Weight PAHs are only occurred within Active-Pit station ESC-NPCB only, there is no evidence indicating any unacceptable environmental impacts to sediment quality outside the pit area as a result of the contaminated mud disposal operations at ESC CMP Vb during the reporting period.

Statistical analysis will be undertaken and presented in the corresponding Quarterly EM&A Report to investigate whether there are any unacceptable impacts in the area caused by the contaminated mud disposal.

## 2.5 Sediment Chemistry after a Major Storm of ESC CMP V – in September 2023

Sampling for Sediment Chemistry after a Major Storm Event was conducted at nine (9) monitoring stations (see **Figure 2.3** for the locations of the monitoring stations) on 5 September 2023 after the visit of tropical cyclones Saola, which led to the issue of No. 8 Storm Signal on 1 September 2023. The tracks of Saola are shown in **Figure 2.4**.

---

<sup>5</sup> Sewell RJ (1999) Geochemical Atlas of Hong Kong. Geotechnical Engineering Office, Government of the Hong Kong Special Administrative Region

<sup>6</sup> Whiteside PGD (2000) Natural geochemistry and contamination of marine sediments in Hong Kong. In: The Urban Geology of Hong Kong (ed. Page A & Reels SJ). Geological Society of Hong Kong Bulletin No. 6, p109-121

**Figure 2.4: Track of Tropical Cyclone Saola (Source: Hong Kong Observatory)**



Analyses of results for the Sediment Chemistry after a Major Storm indicated that the concentrations of all inorganic contaminants were below the LCEL in September 2023, except for Arsenic. The concentrations of Arsenic were higher than the LCEL at Near-field station ESC-RNB1, Mid-field stations ESC-RMA and Far-field station ESC-RFB. **(Figures 16 and 17 of Appendix C).**

As discussed in **Section 2.4**, the LCEL exceedances of Arsenic are unlikely to be caused by the disposal operations at ESC CMP Vb but rather as a result of naturally occurring deposits.

Overall, there appeared to be no evidence showing the failure of ESC CMP V in retaining disposed mud or causing contamination of sediments after the major storm event in September 2023.

## 3 Future Key Issues

### 3.1 Activities Scheduled for the Next Reporting Period



The following monitoring activities will be conducted in the next reporting period of October 2023 for ESC CMP V (see **Appendix A** for the sampling schedule):

- Water Column Profiling of ESC CMP Vb;
- Routine Water Quality Monitoring of ESC CMPs; and
- Pit Specific Sediment Chemistry of ESC CMP Vb.

### 3.2 Study Programme

A summary of the Study Programme is presented in **Appendix D**.

# Figures

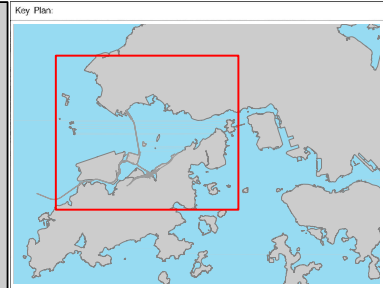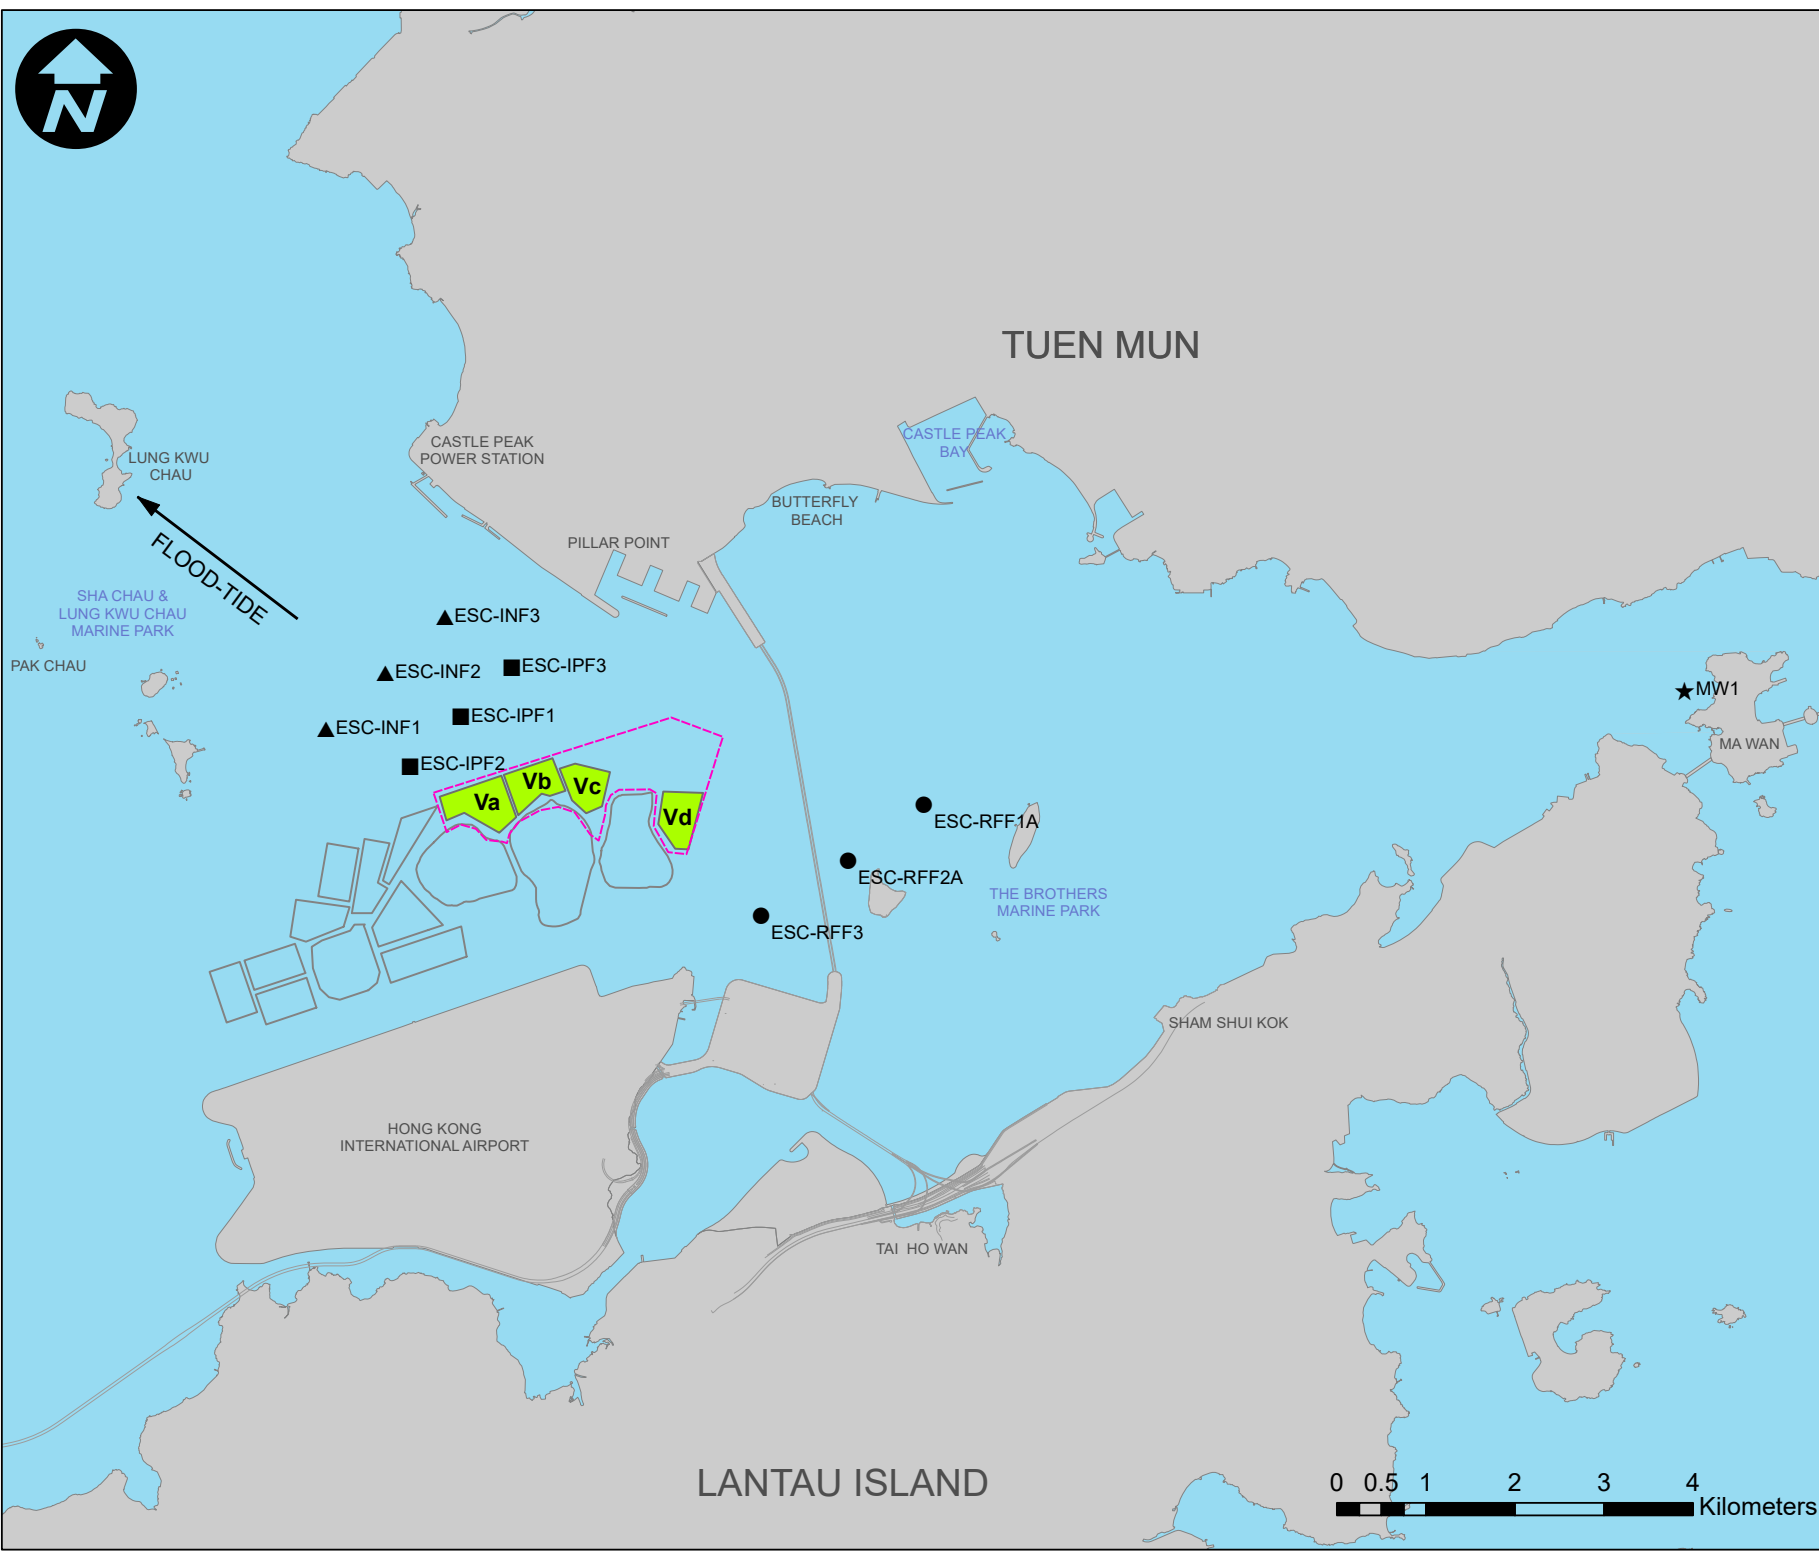

Notes:

Key to symbols:

### LEGEND

- ESC CMP V
- ESC USABLE AREA 1
- WATER QUALITY SAMPLING STATIONS**
- IMPACT STATION
- INTERMEDIATE STATION
- REFERENCE STATION
- MA WAN STATION

Rev	Date	Drawn	Description	Ch'kd	App'd
P1	APR 2021	KN			

**M M**  
MOTT  
MACDONALD

3/F International Trade Tower  
348 Kwun Tong Road  
Kwun Tong, Kowloon  
Hong Kong  
T +852 2828 5757  
F +852 2821823  
W motmac.com

Client


**CEDD** 土木工程拓展署  
Civil Engineering and  
Development Department

Project **AGREEMENT NO. CE 59/2020 (EP)  
ENVIRONMENTAL MONITORING AND AUDIT  
FOR DISPOSAL FACILITY  
TO THE EAST OF SHA CHAU (2021-2026)  
- INVESTIGATION**

**ROUTINE & CAPPING WATER QUALITY  
SAMPLING STATIONS (FLOOD-TIDE)  
FOR ESC CMPS**

Designed		Eng check	
Drawn		Coordination	
Dwg check		Approved	
Scale at A3	Status	Rev	



Drawing Number **FIGURE 2.1**





EBB-TIDE

FLOOD-TIDE

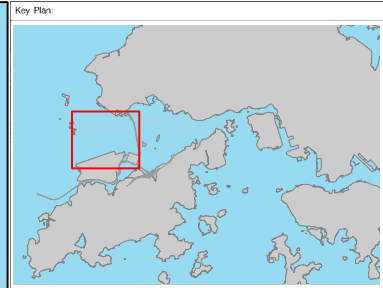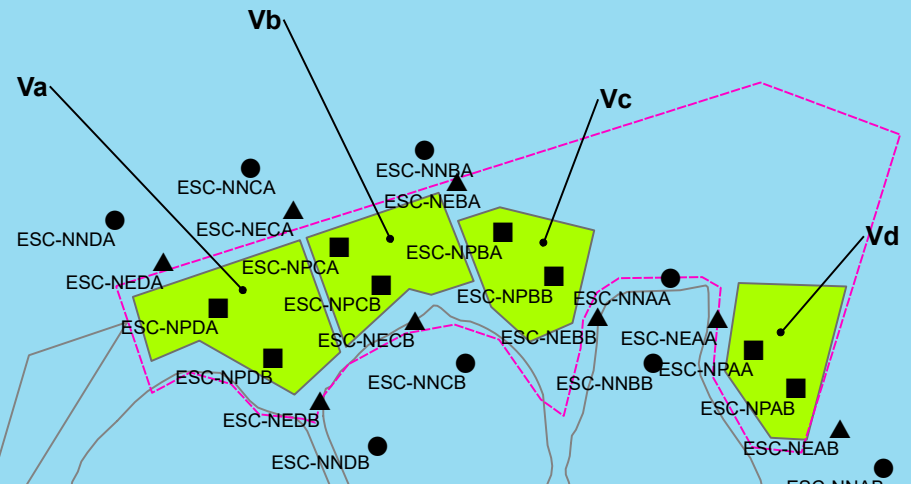

Notes:

Key to symbols:

**LEGEND**

- ESC CMP V
- ESC USABLE AREA 1

**PIT SPECIFIC SEDIMENT MONITORING STATIONS**

- ACTIVE-PIT STATION
- PIT-EDGE STATION
- NEAR-PIT STATION

Rev	Date	Drawn	Description	Ch'kd	App'd
P1	APR 2021	KN			

**M M**  
MOTT  
MACDONALD

3/F International Trade Tower  
348 Kwun Tong Road  
Kwun Tong, Kowloon  
Hong Kong  
T +852 2828 5757  
F +852 2821823  
W motmac.com

Client

**CEDD** 土木工程拓展署  
Civil Engineering and  
Development Department

Project **AGREEMENT NO. CE 59/2020 (EP)  
ENVIRONMENTAL MONITORING AND AUDIT  
FOR DISPOSAL FACILITY  
TO THE EAST OF SHA CHAU (2021-2026)  
- INVESTIGATION**

Title **PIT SPECIFIC SEDIMENT QUALITY  
MONITORING STATIONS FOR CMP V**



Designed		Eng check	
Drawn		Coordination	
Dwg check		Approved	
Scale at A3	Status	Rev	

Drawing Number **FIGURE 2.2**

HONG KONG  
INTERNATIONAL AIRPORT





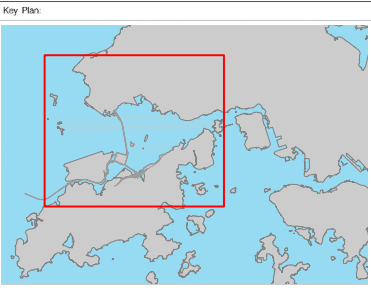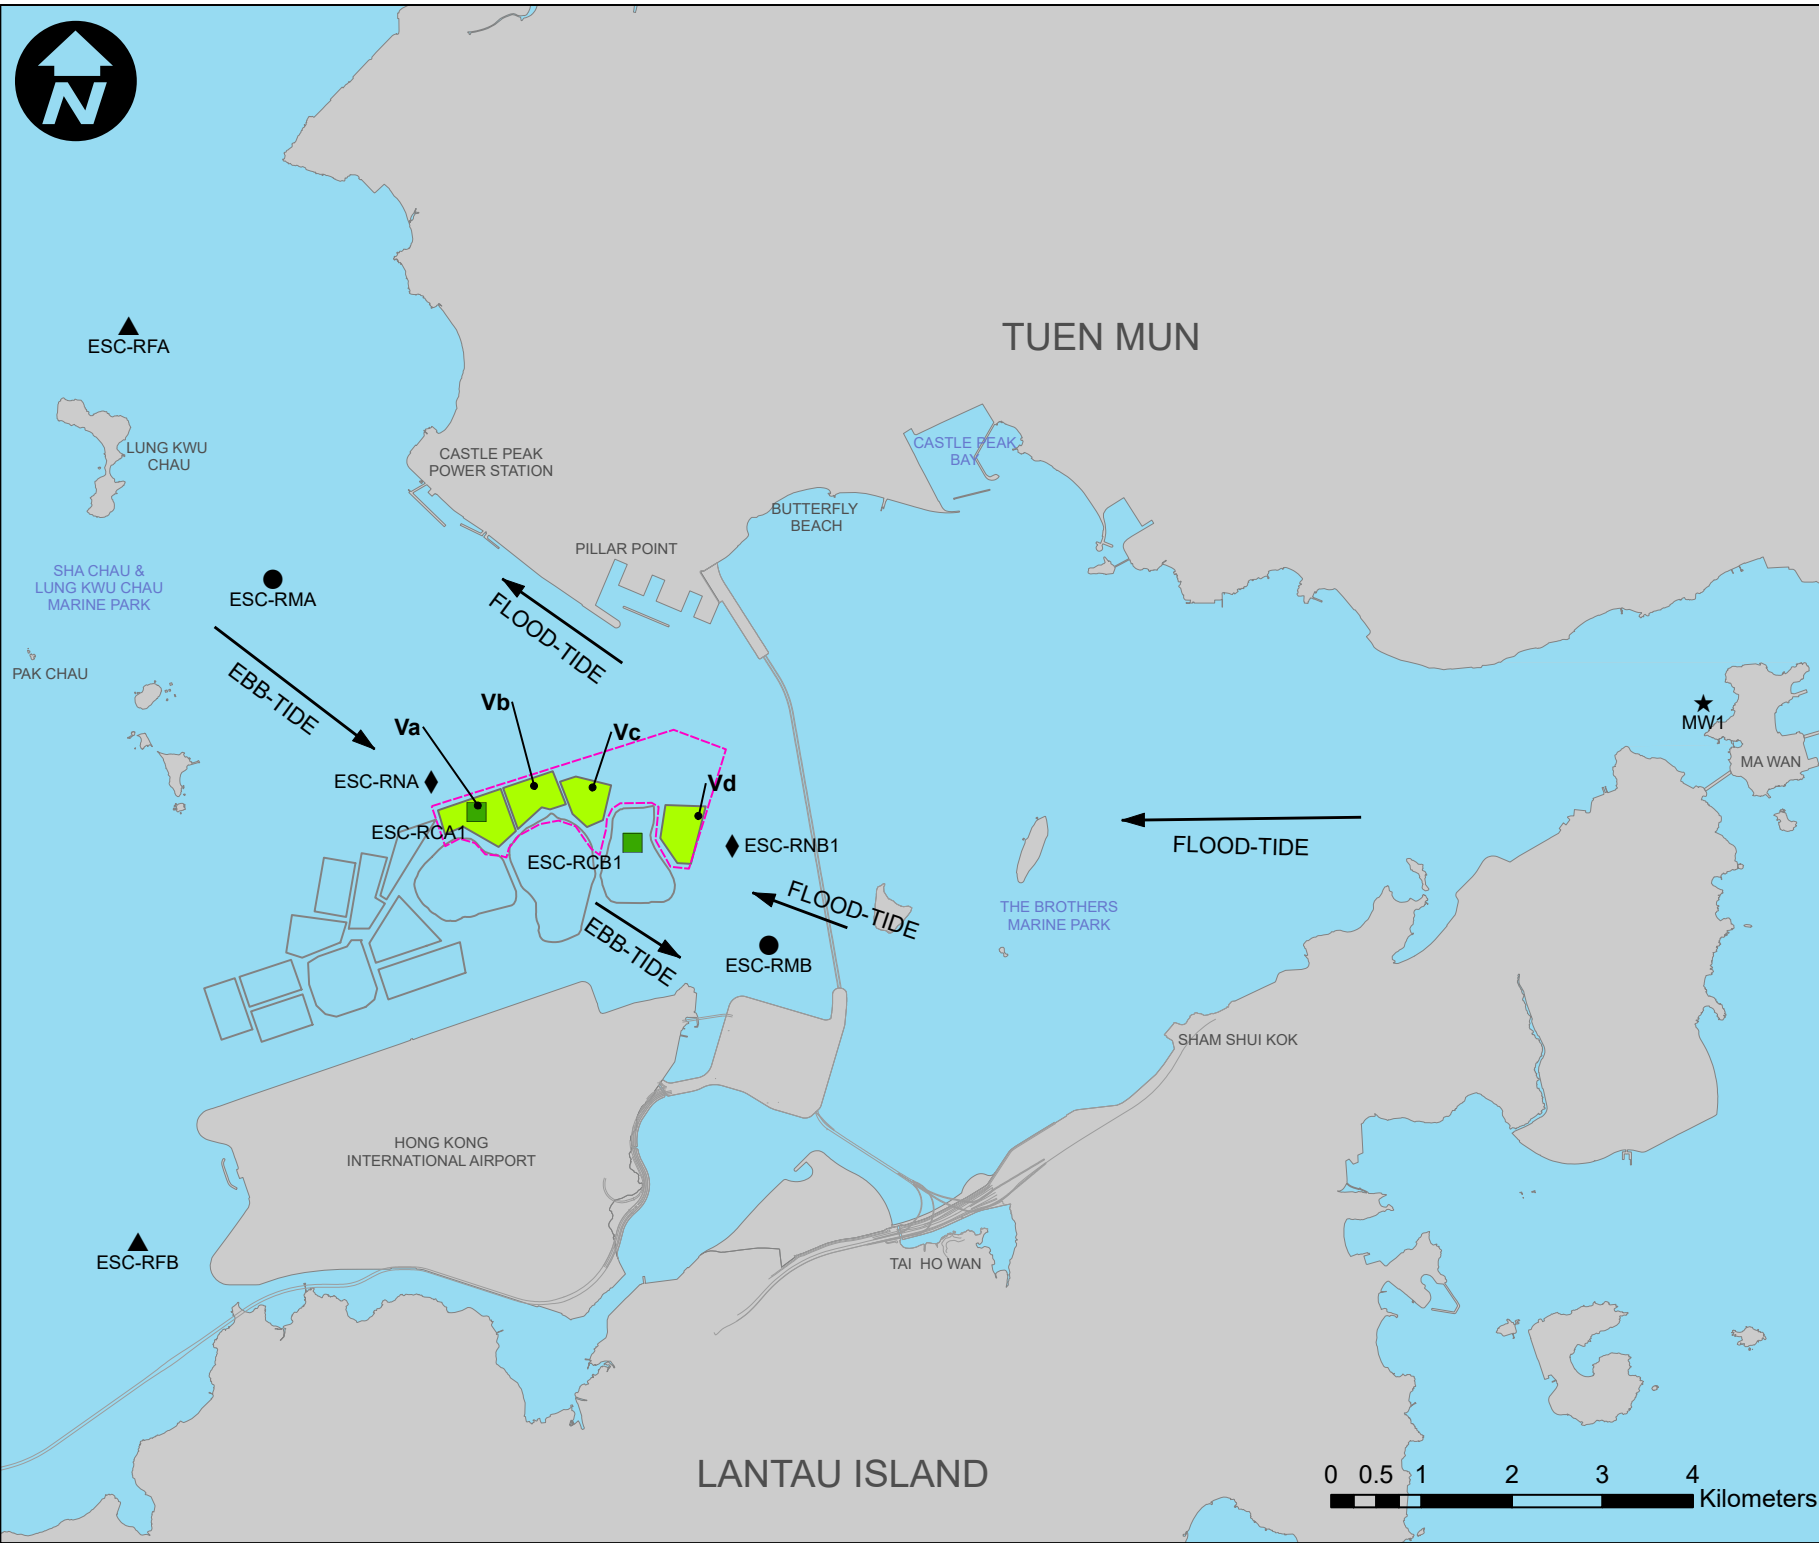

Notes:

### LEGEND

- ESC CMP V
- ESC USABLE AREA 1

### MONITORING STATIONS

- CAPPED PIT STATION
- NEAR-FIELD STATION
- MID-FIELD STATION
- FAR-FIELD STATION
- MA WAN STATION

Rev	Date	Drawn	Description	Ch'kd	App'd
P1	APR 2021	KN			

**MOTT MACDONALD**

3/F International Trade Tower  
348 Kwun Tong Road  
Kwun Tong, Kowloon  
Hong Kong  
T +852 2828 5757  
F +852 2821823  
W mottmac.com

Client

**CEDD** 土木工程拓展署  
Civil Engineering and Development Department

Project **AGREEMENT NO. CE 59/2020 (EP) ENVIRONMENTAL MONITORING AND AUDIT FOR DISPOSAL FACILITY TO THE EAST OF SHA CHAU (2021-2026) – INVESTIGATION**

Title **SEDIMENT CHEMISTRY AFTER A MAJOR STORM MONITORING STATIONS FOR ESC CMPS**

Designed		Eng check	
Drawn		Coordination	
Dwg check		Approved	
Scale at A3	Status	Rev	

Drawing Number **FIGURE 2.3**

# Appendices

- Appendix A Sampling Schedule
- Appendix B Water Quality Monitoring Results
- Appendix C Graphical Presentations
- Appendix D Study Programme

# Appendix A. Sampling Schedule



# Appendix B. Water Quality Monitoring Results

**Table B1: Action and Limit Levels of Water Quality for Dredging, Disposal and Capping Activities at ESC CMP V**

Parameters	Action	Limit
Dissolved Oxygen (DO) in mg L <sup>-1</sup> (Surface, Middle & Bottom) <sup>(1)</sup>	<b>Surface and Middle Depth<sup>(2)</sup></b> 5%-ile of baseline data for surface and middle layer = <b>3.76</b> and Significantly less than the reference station's mean DO (at the same tide of the same day)	<b>Surface and Middle Depth<sup>(2)</sup></b> 1%-ile of baseline data for surface and middle layer = <b>3.11</b> <sup>(3)</sup> and Significantly less than the reference station's mean DO (at the same tide of the same day)
	<b>Bottom</b> 5%-ile of baseline data for surface and middle layer = <b>2.96</b> and Significantly less than the reference station's mean DO (at the same tide of the same day)	<b>Bottom</b> The average of the impact station readings are < <b>2</b> and Significantly less than the reference station's mean DO (at the same tide of the same day)
Suspended Solids (SS) in mg L <sup>-1</sup> (depth-averaged) <sup>(5)</sup>	95%-ile of baseline data for depth-averaged = <b>37.88</b> and 120% of control station's SS at the same tide of the same day	99%-ile of baseline data for depth-averaged = <b>61.92</b> and 130% of control station's SS at the same tide of the same day
Turbidity in NTU (depth-averaged) <sup>(4)(5)</sup>	95%-ile of baseline data = <b>28.14</b> and 120% of control station's Turbidity at the same tide of the same day	99%-ile of baseline data = <b>38.32</b> and 130% of control station's Turbidity at the same tide of the same day

Notes:

- For DO, non-compliance of the water quality limits occurs when monitoring result is lower than the limits.
- Action and Limit Levels for DO for Surface and Middle layers were calculated from the combined pool of baseline surface layer data and baseline middle layer data.
- Given the Action Level for DO for Surface and Middle layers has already been lower than 4 mg L<sup>-1</sup>, it is proposed to set the Limit Level at 3.11 mg L<sup>-1</sup> which is the first percentile of the baseline data.
- "Depth-averaged" is calculated by taking the arithmetic means of reading of all three depths.
- For turbidity and SS, non-compliance of the water quality limits occurs when monitoring result is higher than the limits.

**Table B2: Water Column Profiling Results for ESC CMP Vb in September 2023**

Station	Temp. (°C)	Salinity (ppt)	Turbidity (NTU)	Dissolved Oxygen (%)	(mg L <sup>-1</sup> )	pH	Suspended Solids (mg L <sup>-1</sup> )
WCP 1 (Downstream)	26.95	26.03	4.26	79.63	5.49	7.94	5.5
WCP 2 (Upstream)	26.95	26.14	3.23	79.84	5.50	7.91	4.0
WQO (Wet Season)	N/A	23.53-28.76 <sup>#</sup>	N/A	N/A	>4	6.5-8.5	11.7

Notes:

1. <sup>#</sup> Not exceeding 10% of natural ambient level which is the result obtained from the Reference Station.
2. Cell shaded yellow / red indicates value exceeding the Action/Limit levels.
3. Cell shaded grey indicates value exceeding the WQO.

**Table B3: In-situ Monitoring Results for Routine Water Quality Monitoring of ESC CMPs in September 2023**

Station	Temp. (°C)	Salinity (ppt)	Turbidity (NTU)	Dissolved Oxygen (%)	(mg L <sup>-1</sup> )	pH
RFF (Reference)	26.69	27.40	2.15	75.44	5.18	7.89
IPF (Impact)	26.73	26.98	3.53	76.42	5.26	7.91
INF (Intermediate)	26.81	26.60	2.39	77.01	5.30	7.90
Ma Wan	25.89	30.75	2.56	73.39	5.02	7.93
WQO (Wet Season)	N/A	24.66-30.14 <sup>#</sup>	N/A	N/A	>4	6.5-8.5

Notes:

1. <sup>#</sup> Not exceeding 10% of natural ambient level which is the result obtained from the Reference Station.
2. Cell shaded yellow / red indicates value exceeding the Action/Limit levels.
3. Cell shaded grey indicates value exceeding the WQO.

**Table B4: Laboratory Results for Dissolved Metals and Metalloid in Routine Water Quality Monitoring of ESC CMPs in September 2023**

Station	As (µg/L)	Cd (µg/L)	Cr (µg/L)	Cu (µg/L)	Pb (µg/L)	Hg (µg/L)	Ni (µg/L)	Ag (µg/L)	Zn (µg/L)
RFF	2.21	0.03	0.12	0.74	0.01	0.023	0.74	ND	0.20
IPF	2.20	0.03	0.11	0.62	ND	0.006	0.76	ND	0.35
INF	2.26	0.03	0.13	0.70	ND	0.006	0.87	ND	0.32
Ma Wan	1.99	0.01	0.11	0.58	ND	0.007	0.56	ND	0.10

Note:

1. "ND" indicates the concentrations of metals and metalloids are not detected.

**Table B5: Laboratory Results for Nutrients and Suspended Solid in Routine Water Quality Monitoring of ESC CMPs in September 2023**

Station	NH <sub>3</sub> (mg/L)	TIN (mg/L)	BOD <sub>5</sub> (mg/L)	SS (mg/L)
RFF	0.08	0.62	<LOR	6.3
IPF	0.07	0.62	<LOR	6.8
INF	0.06	0.73	<LOR	3.3
Ma Wan	0.08	0.35	<LOR	7.5

WQO of TIN: 0.5 mg/L

Wet Season WQO of SS: 11.7 mg/L


Notes:

1. "<LOR" indicates the concentrations of contaminants are below the limit of reporting.
2. Cell shaded yellow / red indicates value exceeding the Action/Limit levels.
3. Cell shaded grey indicates value exceeding the WQO.




## Appendix C. Graphical Presentations

### Routine Water Quality Monitoring for ESC CMP V - September 2023

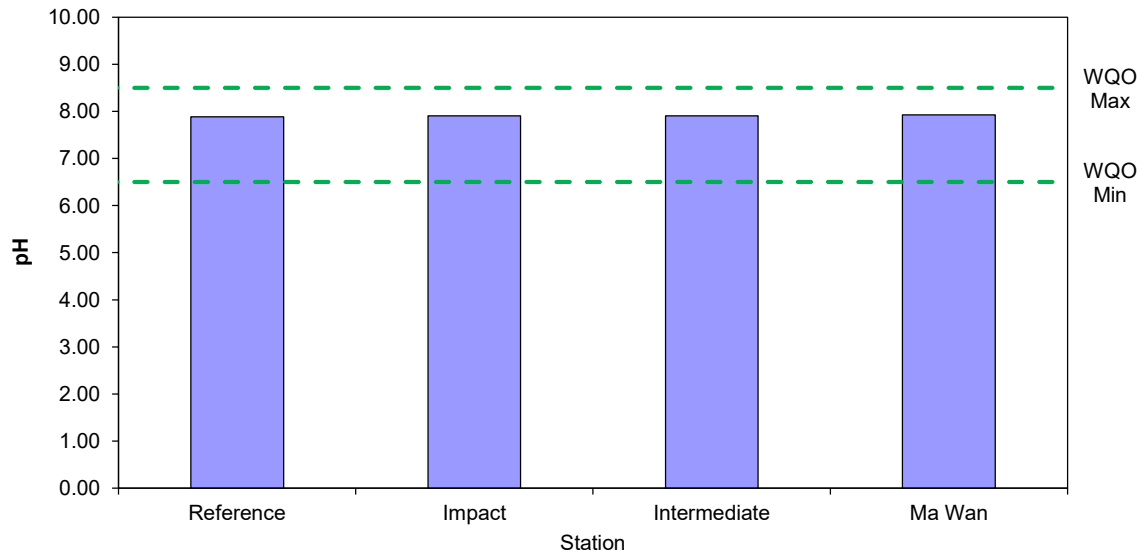

**Figure 1:** Level of pH recorded during Routine Water Quality Monitoring for disposal operations at ESC CMP V in September 2023


### Routine Water Quality Monitoring for ESC CMP V - September 2023

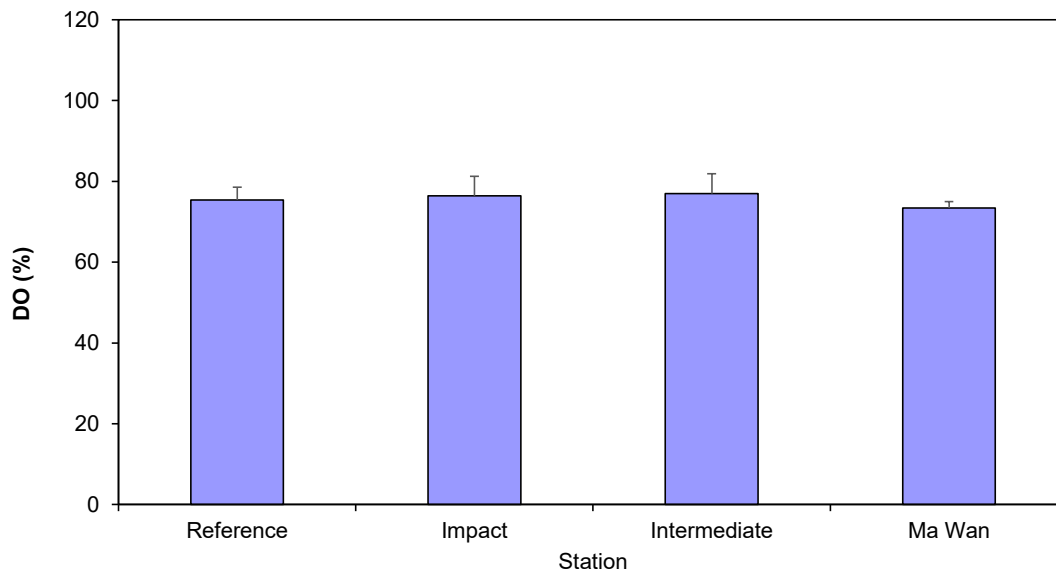

**Figure 2:** Level of Dissolved Oxygen (DO) (% saturation; mean + SD<sup>1</sup>) recorded during Routine Water Quality Monitoring for disposal operations at ESC CMP V in September 2023


<sup>1</sup> The mean and standard deviation (SD) for in-situ data are the mean and SD for water columns within the area.

### Routine Water Quality Monitoring for ESC CMP V - September 2023

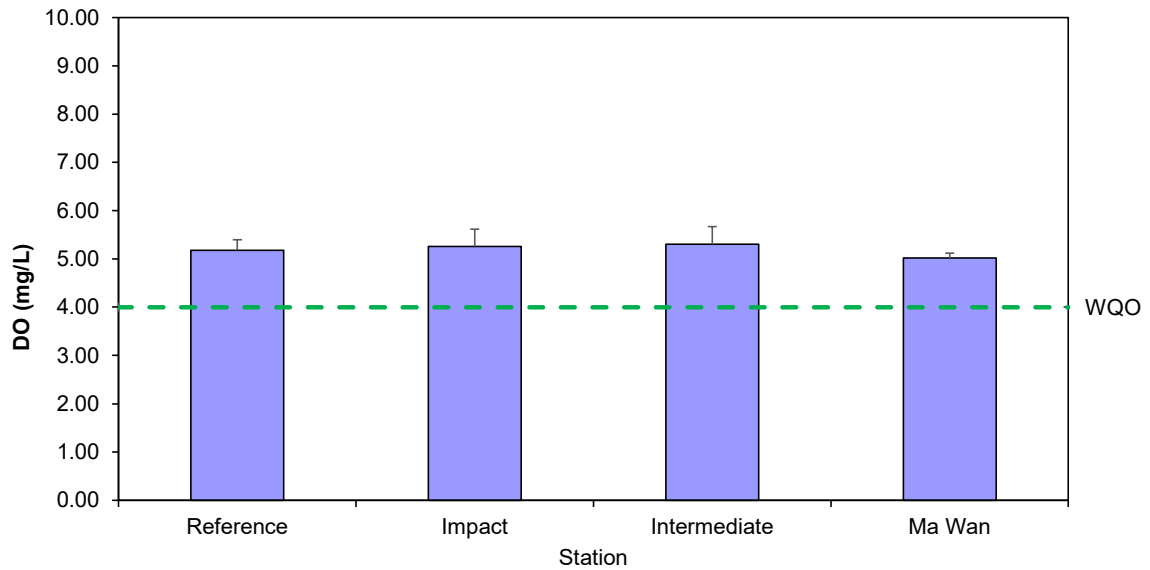

**Figure 3:** Concentration of Dissolved Oxygen (DO) (mg/L; mean + SD<sup>1</sup>) recorded during Routine Water Quality Monitoring for disposal operations at ESC CMP V in September 2023


### Routine Water Quality Monitoring for ESC CMP V - September 2023

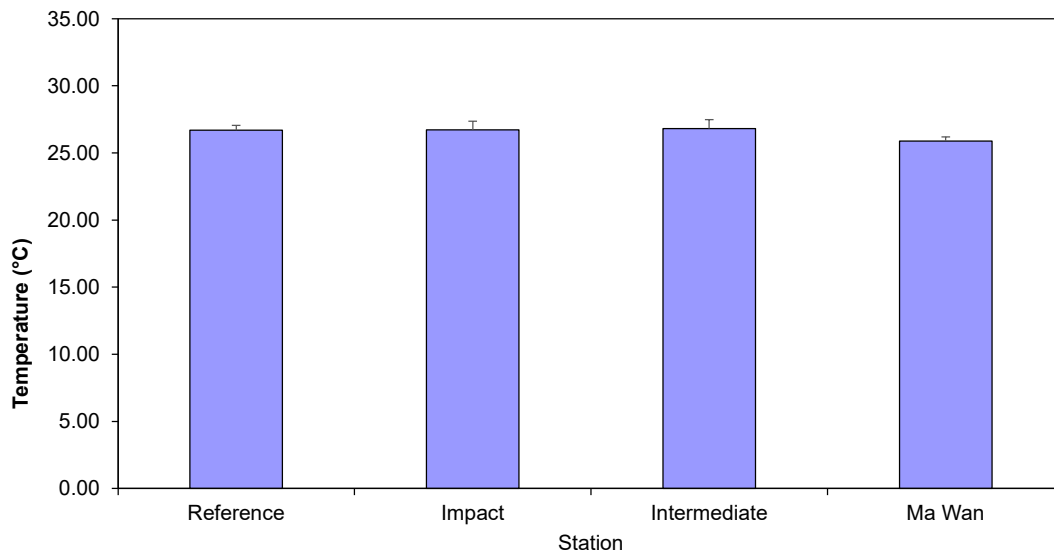

**Figure 4:** Level of Temperature (°C; mean + SD<sup>1</sup>) recorded during Routine Water Quality Monitoring for disposal operations at ESC CMP V in September 2023


<sup>1</sup> The mean and standard deviation (SD) for in-situ data are the mean and SD for water columns within the area.

### Routine Water Quality Monitoring for ESC CMP V - September 2023

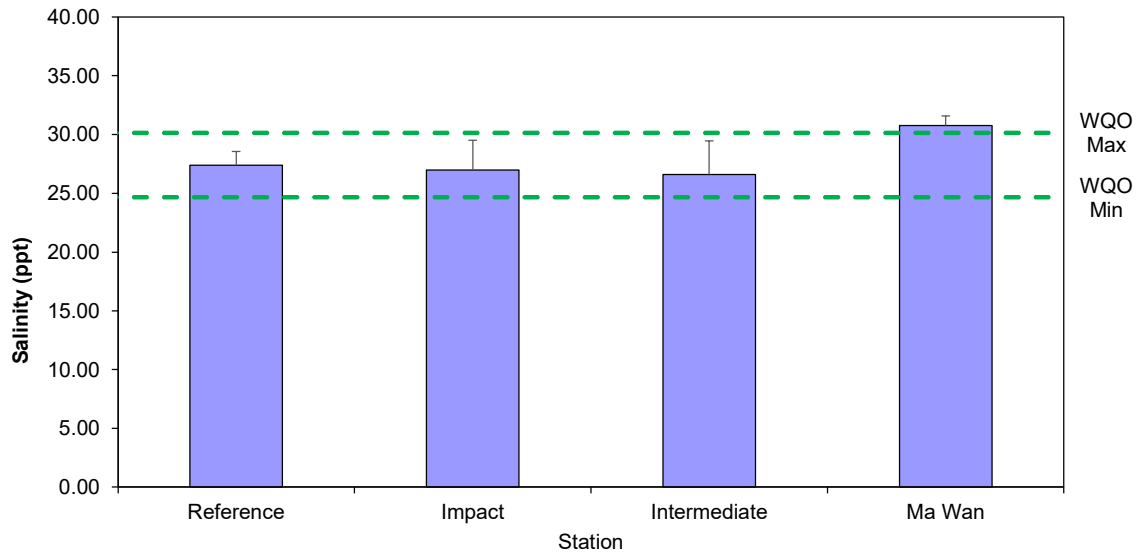

**Figure 5:** Level of Salinity (ppt; mean + SD<sup>1</sup>) recorded during Routine Water Quality Monitoring for disposal operations at ESC CMP V in September 2023


### Routine Water Quality Monitoring for ESC CMP V - September 2023

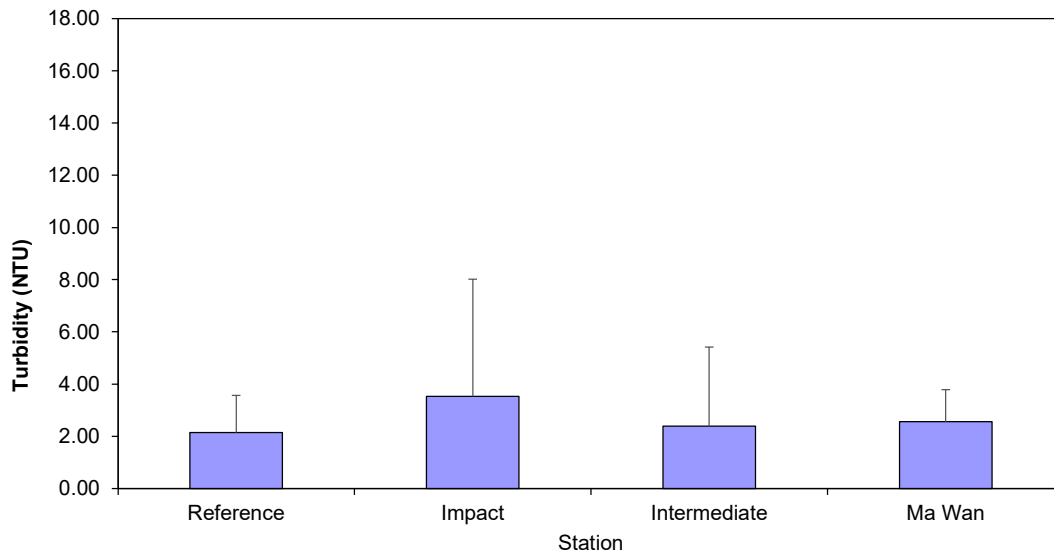

**Figure 6:** Level of Turbidity (NTU; mean + SD<sup>1</sup>) recorded during Routine Water Quality Monitoring for disposal operations at ESC CMP V in September 2023


<sup>1</sup> The mean and standard deviation (SD) for in-situ data are the mean and SD for water columns within the area.

### Routine Water Quality Monitoring for ESC CMP V September 2023

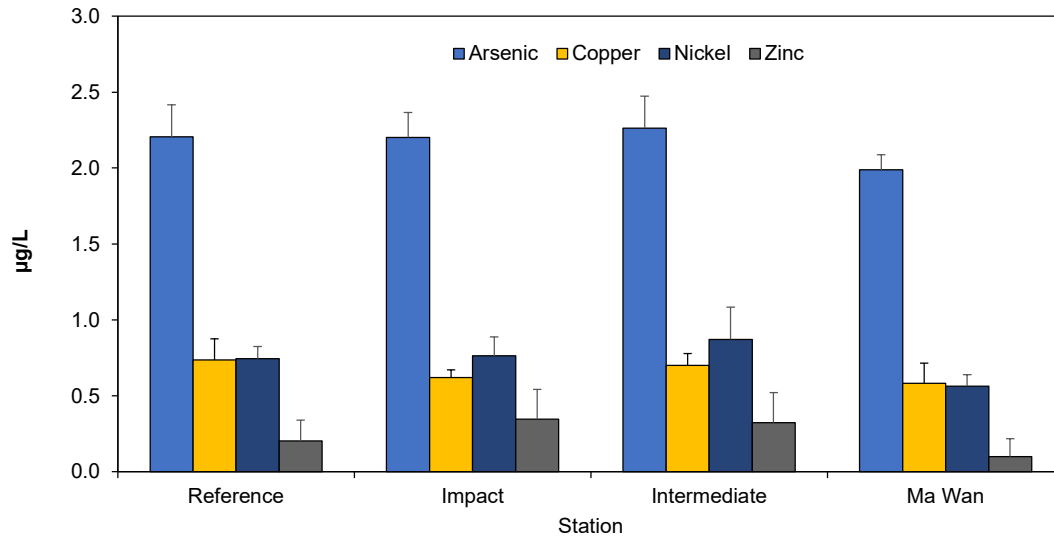


**Figure 7:** Concentration of Arsenic, Copper, Nickel, and Zinc (µg/L; mean + SD) in water samples collected from Routine Water Quality Monitoring for disposal operations at ESC CMP V in September 2023

### Routine Water Quality Monitoring for ESC CMP V September 2023

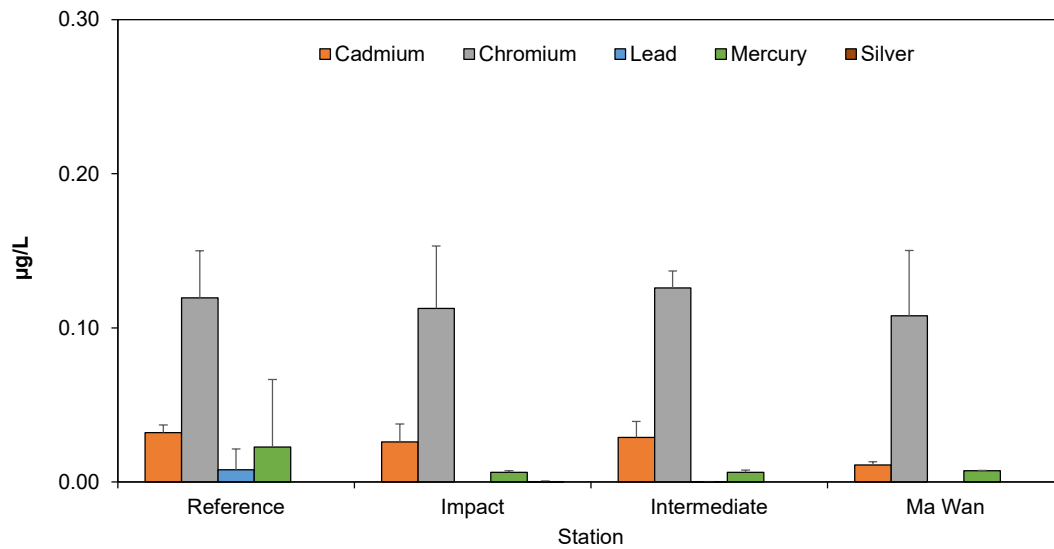


**Figure 8:** Concentration of Cadmium, Chromium, Lead, Mercury and Silver, (µg/L; mean + SD) in water samples collected from Routine Water Quality Monitoring for disposal operations at ESC CMP V in September 2023

### Routine Water Quality Monitoring for Nutrients - September 2023

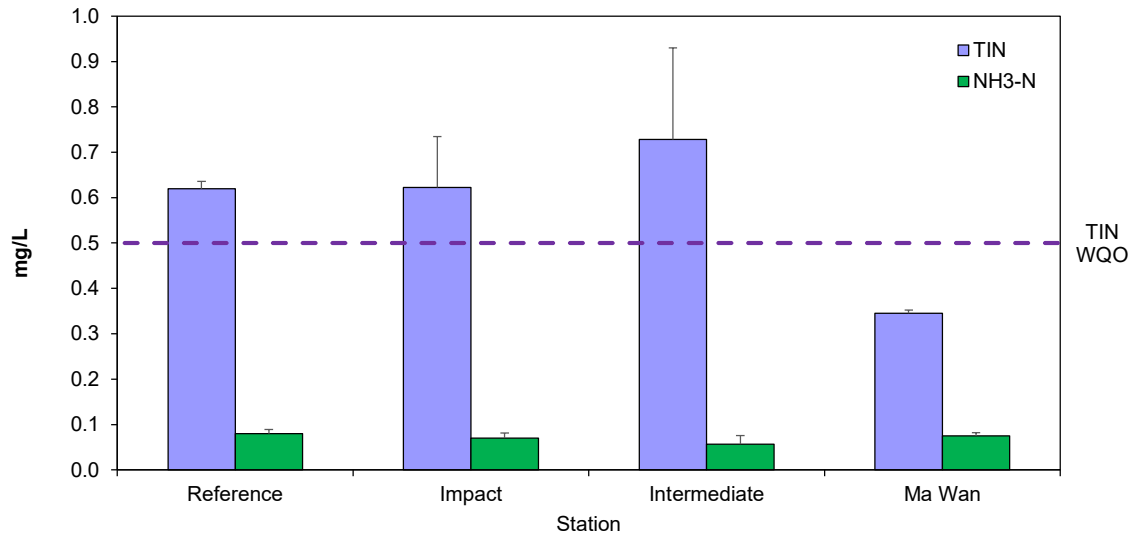


**Figure 9:** Concentration of Total Inorganic Nitrogen (TIN) and Ammonia Nitrogen (NH3-N) (mg/L; mean + SD) in water samples collected from Routine Water Quality Monitoring for disposal operations at ESC CMP V in September 2023

### Routine Water Quality Monitoring for Suspended Solids - September 2023

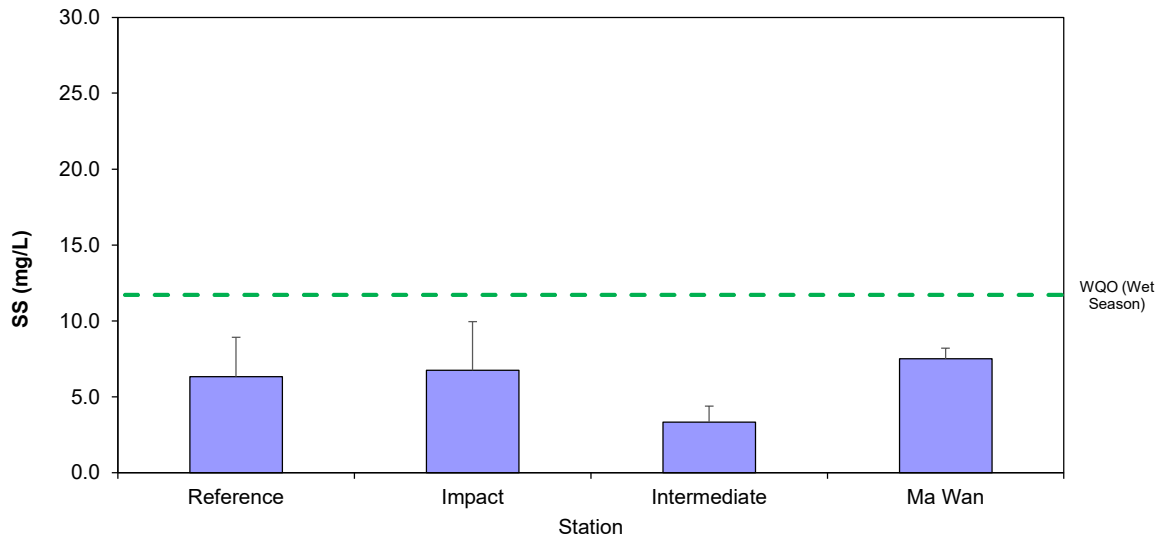


**Figure 10** Concentration of Suspended Solids (SS) (mg/L; mean + SD) in water samples collected from Routine Water Quality Monitoring for disposal operations at ESC CMP V in September 2023

### Pit Specific Sediment Chemistry for Metal and Metalloid Contaminants at ESC CMP Vb - August 2023

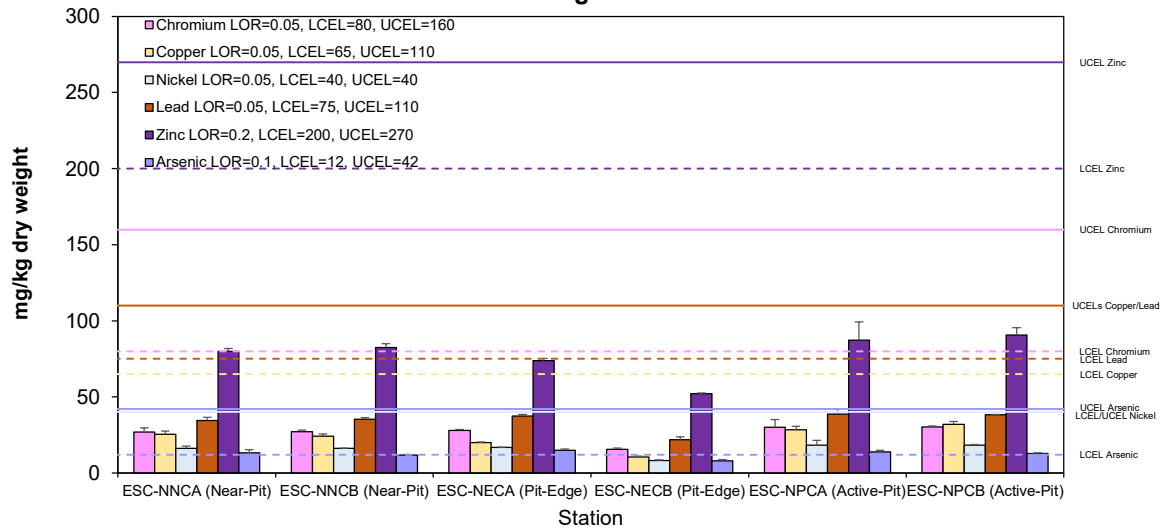


**Figure 11:** Concentration of Metals and Metalloid (Cr, Cu, Ni, Pb, Zn, As; mg/kg dry weight; mean + SD) in sediment samples collected from Pit Specific Sediment Chemistry Monitoring for ESC CMP Vb in August 2023

### Pit Specific Sediment Chemistry for Metal Contaminants at ESC CMP Vb - September 2023

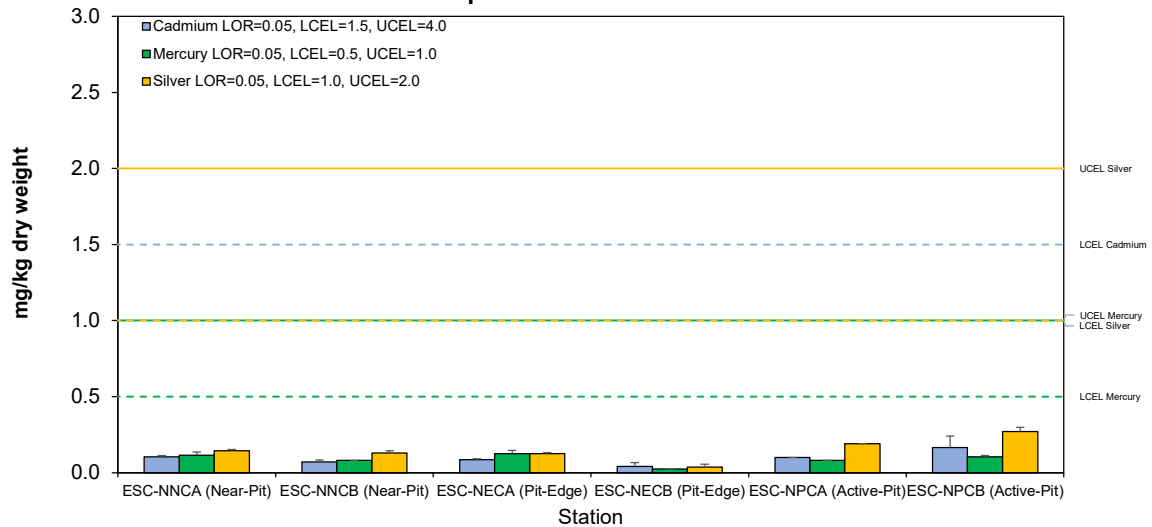


**Figure 12:** Concentration of Metals (Cd, Hg, Ag; mg/kg dry weight; mean + SD) in sediment samples collected from Pit Specific Sediment Chemistry Monitoring for ESC CMP Vb in September 2023

**Pit Specific Sediment Chemistry for Total Organic Carbon (TOC) at ESC CMP Vb - September 2023**

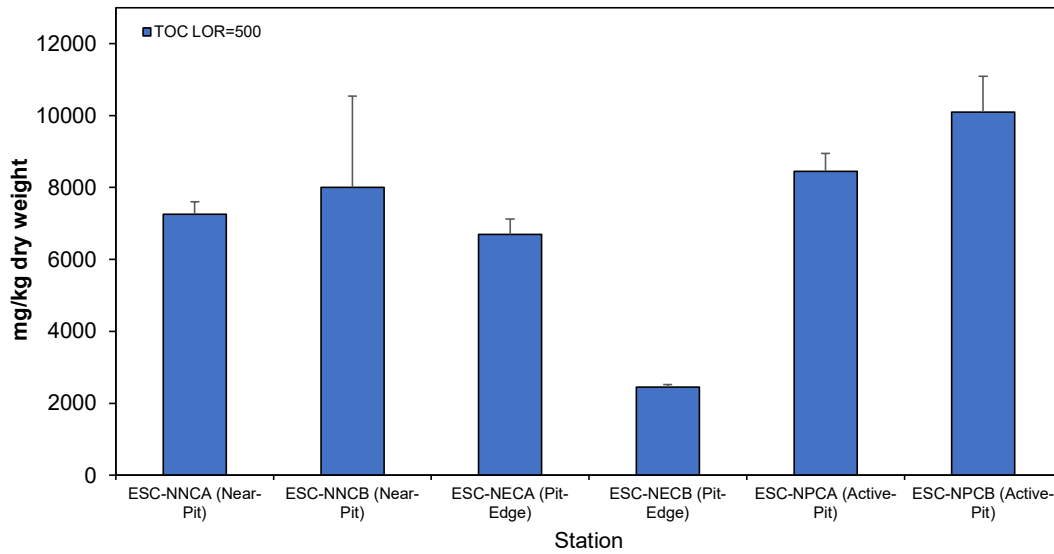

**Figure 13:** Concentration of Total Organic Carbon (TOC) (mg/kg dry weight; mean + SD) in sediment samples collected from Pit Specific Sediment Chemistry Monitoring for ESC CMP Vb in September 2023


**Pit Specific Sediment Chemistry for Low and High Molecular Weight Polycyclic Aromatic Hydrocarbons (PAHs) at ESC CMP Vb - September 2023**

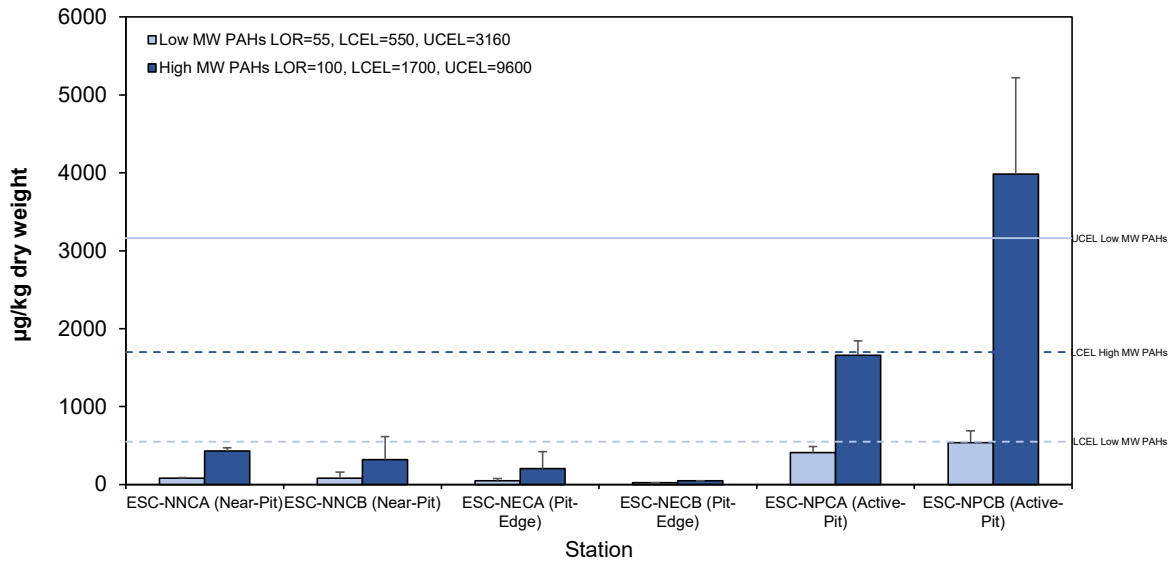

**Figure 14:** Concentration of Low and High Molecular Weight Polycyclic Aromatic Hydrocarbons (µg/kg dry weight; mean + SD) in sediment samples collected from Pit Specific Sediment Chemistry Monitoring for ESC CMP Vb in September 2023




### Pit Specific Sediment Chemistry for Tributyltin (TBT) at ESC CMP Vb - September 2023

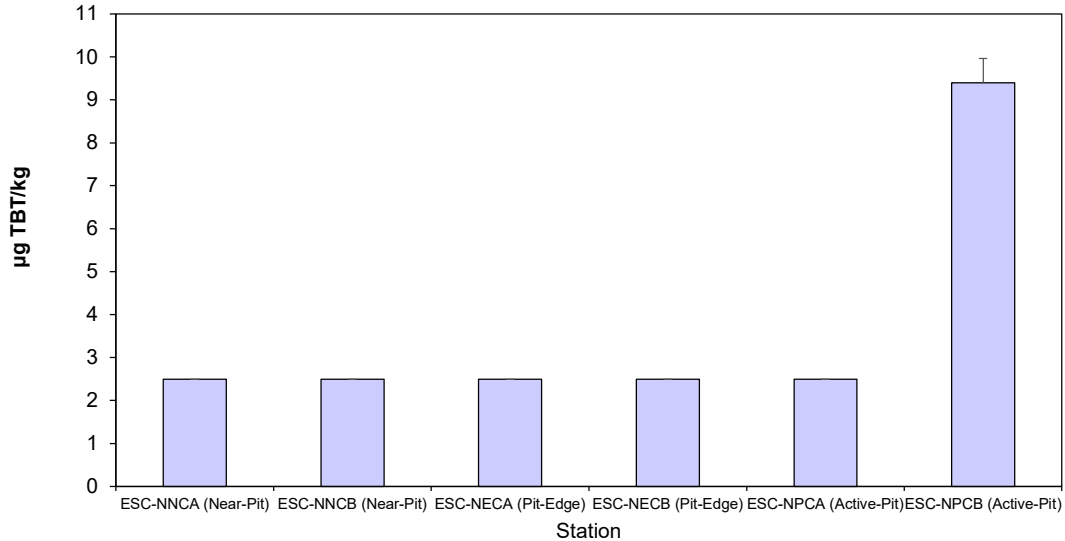


**Figure 15:** Concentration of Tributyltin (TBT) (µg TBT/kg; mean + SD) in sediment samples collected from Pit Specific Sediment Chemistry Monitoring for ESC CMP Vb in September 2023

### Sediment Chemistry after a Major Storm for Metal and Metalloid Contaminants at ESC CMPs - September 2023

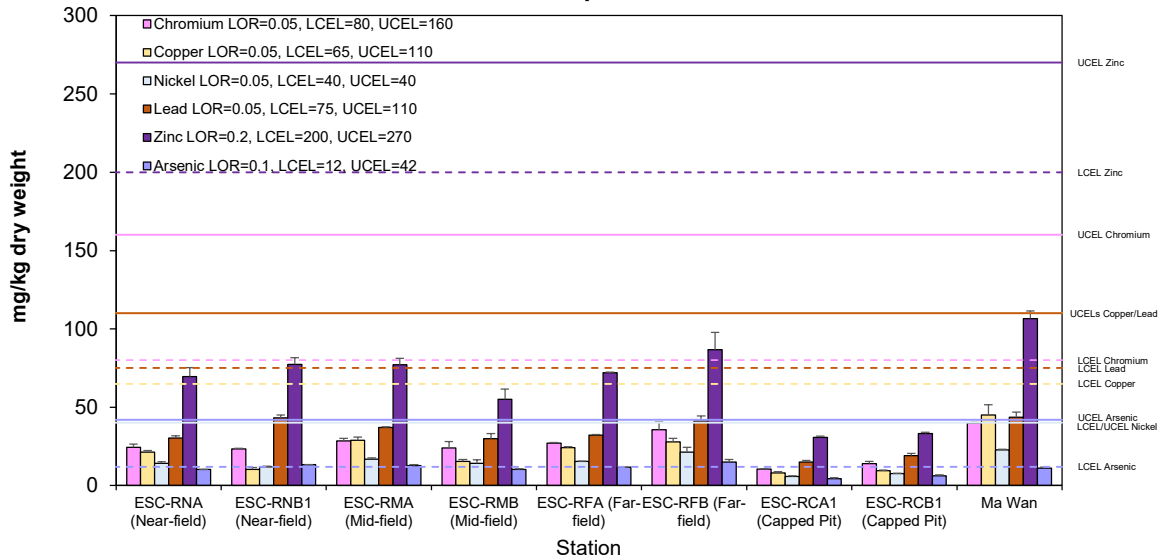

**Figure 16** Concentration of Metals (Cr, Cu, Ni, Pb, Zn, As; mean + SD) in sediment samples collected from Sediment Chemistry after a Major Storm for ESC CMPs in September 2023

### Sediment Chemistry after a Major Storm for Metal Contaminants at ESC CMPs - September 2023

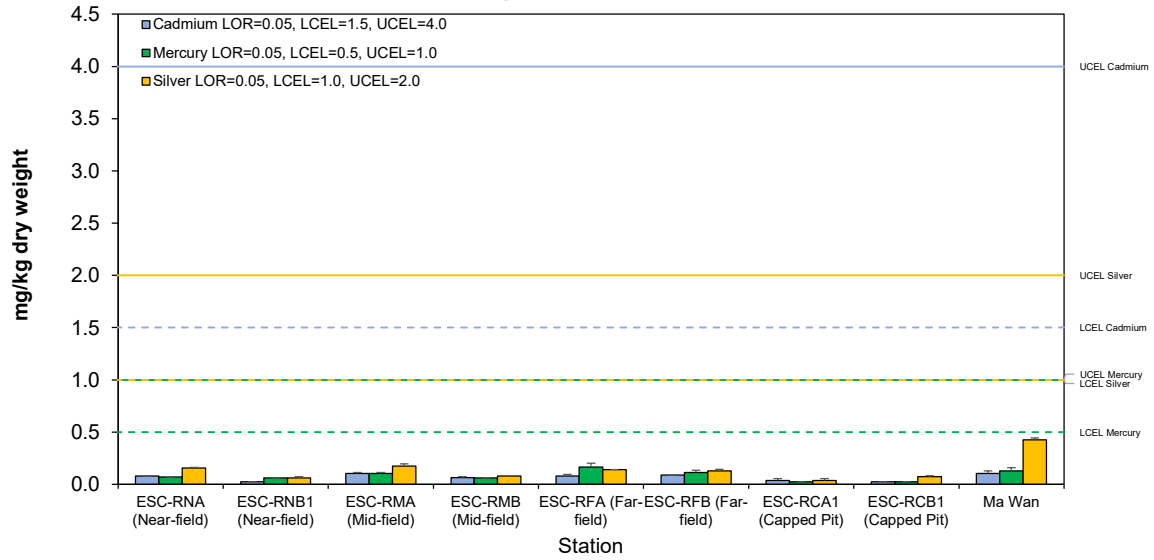

**Figure 17:** Concentration of Metals (Cd, Hg, Ag; mean + SD) in sediment samples collected from Sediment Chemistry after a Major Storm for ESC CMPs in September 2023

# Appendix D. Study Programme

# Study Programme

## Agreement No. CE 59/2020 (EP) Environmental Monitoring and Audit for Disposal Facility to the East of Sha Chau (2021-2026) - Investigation

Mott MacDonald Hong Kong Limited

ID	Task Name	Start	Finish	2021												2022				2023				2024				2025				2026							
				Q1	Q2	Q3	Q4	Q1	Q2	Q3	Q4	Q1	Q2	Q3	Q4	Q1	Q2	Q3	Q4	Q1	Q2	Q3	Q4	Q1	Q2	Q3	Q4	Q1	Q2	Q3	Q4								
1	COMMENCEMENT OF AGREEMENT NO. CE 59/2020 (EP)	01/04/21		◆																																			
2	EAST OF SHA CHAU CONTAMINATED MUD PITS (ESC CMPs) BETWEEN 2021 & 2026	01/04/21	25/06/26	[Blue bar]																																			
3	Draft Report of First Review of EM&A Manual (for ESC CMPs)		30/04/21	◆																																			
4	Final Report of First Review of EM&A Manual (for ESC CMPs)		20/05/21	◆																																			
5	Draft Report of Subsequent Review of EM&A Manual (for ESC CMPs) - annual basis assumed	30/04/22	30/04/25											◇																									
10	Final Report of Subsequent Review of EM&A Manual (for ESC CMPs) - annual basis assumed	20/05/22	20/05/25											◇																									
15	Regular Site Inspections of CMP Contractors	01/04/21	31/03/26	[Red bar]																																			
16	Monthly EM&A Report	14/05/21	14/04/26	◇	◇	◇	◇	◇	◇	◇	◇	◇	◇	◇	◇	◇	◇	◇	◇	◇	◇	◇	◇	◇	◇	◇	◇	◇	◇	◇									
77	Quarterly EM&A Report	30/07/21	30/04/26	◇	◇	◇	◇	◇	◇	◇	◇	◇	◇	◇	◇	◇	◇	◇	◇	◇	◇	◇	◇	◇	◇	◇	◇	◇	◇	◇									
98	Annual EM&A Report	30/01/22	30/01/26											◇																									
104	Annual Risk Assessment Report	31/05/22	31/05/26											◇																									
110	Draft Final Report		30/04/26																										◆										
111	Final Report		04/06/26																										◆										
112	Draft Executive Summary		04/06/26																										◆										
113	Final Executive Summary		25/06/26																										◆										
114	EAST OF TUNG LUNG CHAU (ETLC) DISPOSAL FACILITY (MONITORING PERIOD: SEPTEMBER 2021 & MARCH-APRIL 2022)	23/11/21	31/08/22											[Blue bar]																									
115	Monthly EM&A Report	23/11/21	06/06/22											◇		◇	◇																						
119	Quarterly EM&A Report	15/07/22	15/07/22																										◇										
121	Annual EM&A Report	31/08/22	31/08/22																										◇										

Programme Revision: C Date: 11/05/22	Start/End of ET Services	[Red bar]	Start of Agreement	◆
	Location	[Blue bar]	Submission	◇
	Repeating Task	[Red bar]	Multiple-Occasion Submission	◇