

東業德勤測試顧問有限公司
ETS-TESTCONSULT LIMITED

8/F., Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan Street, Fotan, Hong Kong
Tel : 2695 8318 E-mail : etl@ets-testconsult.com
Fax : 2695 3944 Web site : www.ets-testconsult.com

TEST REPORT

CHINA HARBOUR ENGINEERING CO. LIMITED

**DELIVERY OF RECLAMATION MATERIAL TO
MAINLAND
ENVIRONMENTAL MONITORING AND ADUIT
(CONTRACT NO.: CV/2005/01)**

TUEN MUN AREA 38 FILL BANK

MONTHLY EM&A REPORT

(APRIL 2009)

Prepared by:

LAW, Sau Yee
Senior Environmental Officer

Checked and
Approved by:

LAU, Chi Leung
Environmental Team Leader

MATERIALAB CONSULTANTS LIMITED

Fugro Development Centre Telephone : +852-24508233
 5 Lok Yi Street, 17 M.S. Castle Peak Road, Telefax : +852-24506138
 Tai Lam, Tuen Mun, N.T., Hong Kong. Email : mcl@fugro.com.hk

FAX MESSAGE

Priority	<input type="checkbox"/> normal / <input type="checkbox"/> urgent		
To	<u>ETS – Testconsult Ltd.</u>	Ref. No.	<u>MCLF2388</u>
Country		Fax No.	<u>2695 3944</u>
Attn.	<u>Mr C. L. Lau / Ms Linda Law</u>	Date	<u>16 May 2009</u>
From	<u>Joseph Poon</u>	No. of Pages	<u>1</u> (Incl. this page)
C.c. To	<u>Mr P. Y. Lu / Mr W. T. Chau (CEDD)</u>	Fax No.	<u>2714 0113</u>
	<u>Mr W. F. Lok / Mr Albus Cheung (CHEC)</u>	Fax No.	<u>2247 4108</u>
Subject	<u>Agreement No. CE 9/2005 (EP)</u> <u>Tuen Mun Area 38 Fill Bank –</u> <u>Monthly Environmental Monitoring & Audit Report for April 2009</u>		

We refer to the revised 29th Monthly EM&A Report for April 2009 that we received through email on 15th May 2009 and are pleased to confirm we have no further comment on the report.

Should you require further information, please feel free to contact us.

Best regards,

Joseph Poon
 Independent Environmental Checker

JP/by

CONFIDENTIALITY NOTICE

This facsimile transmission is intended only for the use of the addressee and is confidential. If you are not the addressee it may be unlawful for you to read, copy, disclose or otherwise use the information in this facsimile. If you are not the intended recipient, please telephone or fax us immediately.

(If you do not receive all pages, please fax response or phone +852-24508233.)

TABLE OF CONTENTS

EXECUTIVE SUMMARY

	Page
1.0 INTRODUCTION	1
2.0 PROJECT INFORMATION	
2.1 Construction Programme	1
2.2 Project Organization and Management Structure	1
2.3 Contact Details of Key Personnel	1
3.0 CONSTRUCTION PROGRESS IN THIS REPORTING MONTH	2
4.0 AIR QUALITY MONITORING	
4.1 Monitoring Requirement	2
4.2 Monitoring Equipment	2
4.3 Monitoring Parameters, Frequency and Duration	2
4.4 Monitoring Locations and Schedule	2
4.5 Monitoring Methodology	3
4.6 Action and Limit levels	3
4.7 Event-Action Plans	4
4.8 Results and Observations	4
5.0 MARINE WATER QUALITY MONITORING	
5.1 Monitoring Requirements	4
5.2 Monitoring Locations	4
5.3 Monitoring Parameters and Frequency	4
5.4 Monitoring Methodology and Equipment Used	4 – 6
5.5 Action and Limit Levels	6
5.6 Event and Action Plan	6
5.7 Monitoring Duration and Period in this reporting month	7
5.8 Marine Water Monitoring Results	7
6.0 NOISE MONITORING	
6.1 Monitoring Requirements	7
6.2 Monitoring Equipment	8
6.3 Monitoring Parameters, Duration and Frequency	8
6.4 Monitoring Locations and Period	8
6.5 Monitoring Procedures and Calibration Details	8 – 9
6.6 Action and Limit levels	9
6.7 Event-Action Plans	9
6.8 Results and Observation	9
7.0 ENVIRONMENTAL AUDIT	
7.1 Weekly Site Inspection	9 – 10
7.2 Review of Environmental Monitoring Procedures	11
7.3 Status of Environmental Licensing and Permitting	11
7.4 Implementation Status	11
8.0 LANDSCAPE AND VISUAL	12
9.0 WASTE MANAGEMENT	
9.1 Summary of Waste generated in this month	12
9.2 Advice on the Solid and Liquid Waste Management Status	12
10.0 ENVIRONMENTAL NON-CONFORMANCE	
10.1 Summary of air quality, noise and marine water quality	12 – 13
10.2 Summary of Environmental Complaints	13
10.3 Summary of Notification of Summons and Prosecution	13
11.0 CONCLUSIONS AND RECOMMENDATIONS	13 – 14
12.0 FUTURE KEY ISSUE	14

APPENDIX

- A Organization Chart and Lines of Communication
- B1 Calibration Certificates for Impact Air Quality Monitoring Equipments
- B2 Impact Air Quality Monitoring Results
- B3 Graphical Plots of Impact Air Quality Monitoring Data
- C1 Calibration Certificates for Impact Marine Water Quality Monitoring Equipments
- C2 Impact Marine Water Quality Monitoring Results
- C3 Graphical Plots of Impact Marine Water Quality Monitoring Data
- D1 Calibration Certificates for Impact Noise Monitoring Equipments
- D2 Impact Noise Monitoring Results
- D3 Graphical Plots of Impact Noise Monitoring Data
- E Weather Condition
- F Event-Action Plans
- G Construction Programme
- H Weekly ET's Site Inspection Record
- I Implementation Schedule of Mitigation Measures
- J Site General Layout Plan
- K QA/QC Results of Laboratory Analysis

FIGURES

- Figure 2A Locations of Air Quality Monitoring Stations – Tuen Mun Area 38 Fill Bank
- Figure 3 Locations of Water Quality Monitoring Stations – Tuen Mun Area 38 Fill Bank
- Figure 4 Locations of Noise Quality Monitoring Stations – Tuen Mun Area 38 Fill Bank

TABLES

- 2.1 Contact Details of Key Personnel
- 4.1 Air Quality Monitoring Equipment
- 4.2 Monitoring parameters, duration and frequency of air quality monitoring
- 4.3 Action and Limit levels for 24-hr TSP and 1-hr TSP
- 5.1 Monitoring Parameters and Frequency of the marine water
- 5.2 Summary of testing procedures
- 5.3 Details of Water Quality Monitoring Equipment (In-site measurement)
- 5.4 Water Quality Action and Limit Levels
- 5.5 Time Schedule of Water Quality Monitoring
- 5.6 Summary of Marine Water Quality Exceedances in this reporting month
- 6.1 Noise Monitoring Equipment
- 6.2 Duration, Frequencies and Parameters of Noise Monitoring
- 6.3 Action and Limit Levels for noise monitoring
- 7.1 Summary of environmental licensing and permit status
- 7.2 Summary of Environmental Complaints and Prosecutions
- 9.1 Actual amounts of waste generated in this reporting month

EXECUTIVE SUMMARY

This monthly Environmental Monitoring and Audit (EM&A) report No.29 was prepared by Environmental Team (ET) of ETS-Testconsult Ltd (ETL) for the "Contract No. CV/2005/01 Delivery of Reclamation Material to Mainland – Tuen Mun Area 38 Fill Bank" (The Project).

This report documented the findings of EM&A Works conducted during the operation phase of Fill Bank at Tuen Mun Area 38 in April 2009.

Construction Progress

As informed by the Contractor, the construction activities in this reporting month were as below:

- Removal & delivery of public fill stockpiled material to Mainland
- Operation of the road water lorries and the road sweeper
- Maintenance of haul road within fill bank area
- Operation of the Tipping Halls (B1, B2 & B3)
- Operation at the queuing area for public truck lorries

Environmental Monitoring Progress

The summary of the monitoring activities in this monitoring month is listed below:

- 24-hour TSP Monitoring: 6 Occasions at 2 designated locations
- 1-hour TSP Monitoring: 17 Occasions at 2 designated locations
- Noise, Daytime: 9 Occasions at 2 designated locations
- Marine Water Quality Monitoring: 11 Occasions at 4 designated locations
- Weekly-site inspection: 5 Occasions

Air Monitoring

Since the area for existing air monitoring station TM-A2 near Tipping Hall No.1 was handed over to EcoPark, air monitoring station TM-A2 was cancelled and the air monitoring was carried out at air monitoring station TM-RA2 (refer to Figure 2A attached) from 28 October 2008.

No exceedances of Action and Limit levels were recorded for 24-hr and 1-hr TSP monitoring in the reporting month.

Noise Monitoring

Since Lands Dept did not approve to carry out noise monitoring at their own area where the noise monitoring stations TM-N1 and TM-N2 located due to the security, noise monitoring carried out at two noise monitoring stations TM-RN1 and TM-RN2 (refer to the figure attached) temporarily from 18 December 2007 and before Lands Department's approval.

No exceedances of Action and Limit levels for noise monitoring were recorded in the reporting month.

Marine Water Quality Monitoring

According to the summary of marine water monitoring results, no exceedances of Action and Limit levels were recorded.

Site Inspection

Environmental site inspections conducted in this reporting month are presented as follows:

Concerned Parties

ET Weekly site inspection

IEC site inspection

Dates of Audit / Inspection

02, 07, 16, 23 and 30

18, 23

In general, performance on environmental mitigation measures implemented was found to be satisfactory in this reporting month. The major findings observed during site inspections are presented in the Section 7.0.

Contract No.: CV/2005/01

Delivery of Reclamation Material to Mainland – Tuen Mun Area 38 Fill Bank

ENA90323

Monthly EM&A Report No.29

Environmental Complaints, Notification of summons and successful prosecutions

No complaints, notification of summons and prosecutions with respect to environmental issues were received in this monitoring month.

Future Key Issues

Based on the site inspections and forecast of engineering works in the coming month, key issues to be considered are as follows:

- *Dust generation from activities on site, such as vehicular movements along unpaved area and rock crushing activities;*
- *Noise impact from operating equipment and machinery on site;*
- *Wastewater and surface runoff from the site discharged into nearby water body; and*
- *Storage and usage of chemicals / fuel and chemical waste / waste oil.*

1.0 INTRODUCTION

China Harbour Engineering Company Limited appointed Environmental Team (ET) of ETS-Testconsult Limited (ETL) to undertake the Environmental Monitoring and Audit (EM&A) for the "Contract No. CV/2005/01 Delivery of Reclamation Material to Mainland – Tuen Mun Area 38 Fill Bank" (The Project).

In accordance with the Condition 5 of Part C of Environmental Permit (No.: EP-210/2005/A) (the EP), an EM&A programme as set out in the Project Profile should be implemented.

The EM&A programme requires environmental monitoring for air quality, water quality and environmental site inspections for air quality, water quality, landscape and visual, and waste management. The EM&A requirements for each parameter described in the following sections include:

- All monitoring parameters;
- Monitoring schedules for the reporting month and forthcoming months;
- Action and Limit levels for all environmental parameters;
- Event/Action Plans;
- Environmental mitigation measures, as recommended in the Project Profile; and
- Environmental requirements in contract documents.

Baseline monitoring was completed in May 2003 by Stanger Asia Ltd. Action and Limit Levels were established for air and water quality parameters based on the baseline monitoring results.

This report documented the findings of EM&A Works conducted during the operation phase of Fill Bank at Tuen Mun Area 38 in April 2009.

2.0 PROJECT INFORMATION

2.1 Construction Programme

Details of construction programme are shown in Appendix G.

2.2 Project Organization and Management Structure

The organization chart and lines of communication with respect to the on-site environmental management and monitoring program are shown in Appendix A.

2.3 Contact Details of Key Personnel

The key personnel contact names and telephone numbers are shown in Table 2.1.

Table 2.1 Contact Details of Key Personnel

Organization	Name of Key Staff	Project Role	Tel. No.	Fax No.
CEDD	Mr. W T CHAU Mr. P Y LU	Engineer's Representative	2760 5835	2714 0113
IEC (Materialab)	Mr Joseph Poon	IEC	2450 8238	2450 6138
Contractor (CHEC)	Mr. Wah Fung Lok	Contractor's Agent	9772 7055	2243 4089
ET (ETL)	Mr C. L. Lau	ET Leader	2946 7791	2695 3944

3.0 CONSTRUCTION PROGRESS IN THIS REPORTING MONTH

As informed by the Contractor, the activities in the reporting month include:

- Removal & delivery of public fill stockpiled material to Mainland
- Operation of the road water lorries and the road sweeper
- Maintenance of haul road within fill bank area
- Operation of the Tipping Halls (B1, B2 & B3)
- Operation at the queuing area for public truck lorries

4.0 AIR QUALITY MONITORING

4.1 Monitoring Requirement

1-hr and 24-hr TSP levels were monitored in the reporting month. Table 4.4 shows the Action and Limit Levels for the environmental monitoring works.

4.2 Monitoring Equipment

Both 1-hour and 24-hour TSP air quality monitoring was performed using a GMWS2310 High Volume Air Sampler (HVS) located at each of the designated monitoring station. Table 4.1 summarizes the equipment used in the air quality monitoring programme. A copy of the calibration certificates for the HVS are attached in Appendix B1.

Table 4.1 Air Quality Monitoring Equipment

Equipment	Model and Make
HVS	Greasby GMWS2310
Calibrator	Tisch TE-5025A

4.3 Monitoring Parameters, Frequency and Duration

Table 4.2 summarizes the monitoring parameters, monitoring duration and frequencies of air quality monitoring.

Table 4.2 Monitoring parameters, duration, frequency of air quality monitoring

Parameter	Duration	Frequency
24-hr TSP	24 hr	One per six days
1-hr TSP	1 hr	Three times per six days

4.4 Monitoring Locations and Schedule

In accordance with the Project Profile, two air-quality monitoring stations, namely TM-A1 and TM-A2, were selected for the 1-hr TSP and 24-hr TSP sampling.

Since the area for existing air monitoring station TM-A2 near Tipping Hall No.1 was handed over to EcoPark, air monitoring station TM-A2 was cancelled and the air monitoring was carried out at air monitoring station TM-RA2 (refer to Figure 2A attached) from 28 October 2008.

The locations of monitoring stations are shown in Figure 2A.

During the reporting month, 1-hr and 24-hr TSP monitoring were carried out as the schedule. The details for 24-hr and 1-hr TSP monitoring carried out in this reporting month are summarized in Appendix B2.

4.5 Monitoring Methodology

Both 1-hr and 24-hr air quality monitoring (High Volume Sampler)

Instrumentation

High volume sampler, as HVS, (Greasby GMWS2310) complete with appropriate sampling inlets were employed for both 1-hour and 24-hour TSP monitoring. The sampler is composed of a motor, a filter holder, a flow controller and a sampling inlet and its performance specification complies with that required by USEPA standard Title 40, Code of Federation Regulations Chapter 1 (Part 50).

Installation

The installation of HVS refers to the requirement stated in EM&A Manual.

Operation/Analytical Procedures

Operating/analytical procedures for the operation of HVS are as below:

- Prior to the commencement of the dust sampling, the flow rate of the high volume sampler was properly set (between $0.6\text{m}^3/\text{min}$ and $1.7\text{m}^3/\text{min}$) in accordance with the manufacturer's instruction to within the range recommended in USEPA Standard Title 40, CFR Part 50. The flow rate is indicated on the flow rate chart.
- For TSP sampling, fiberglass filters (GA-55) were used.
- The power supply was checked to ensure the sampler worked properly.
- On sampling, the sampler was operated 5 minutes to establish thermal equilibrium before placing any filter media at designated air monitoring station.
- The filter holding frame was then removed by loosening the four nuts and carefully a weighted and conditioned filter was centered with the stamped number upwards, on a supporting screen.
- The filter was aligned on the screen so that the gasket formed an air-tight seal on the outer edges of the filter. Then the filter holder frame was tightened to the filter holder with swing bolts. The applied pressure should be sufficient to avoid air leakage at the edges.
- The programmable timer will be set for a sampling period of 1 hour / 24 hours. Information was recorded on the record sheet, which included the starting time, the weather condition and the filter number (the initial weight of the filter paper can be found out by using the filter number.).
- After sampling, the filter was transferred from the filter holder of the HVS to a sealed plastic bag and sent to the laboratory for weighting. The elapsed time was also recorded.
- Before weighting, all filters were equilibrated in a desiccator for 24 hour with the temperature of $25^\circ\text{C} \pm 3^\circ\text{C}$ and the relative humidity (RH) $<50\% \pm 5\%$.

Maintenance & Calibration

- The HVS and their accessories should be maintained in good working condition, such as replacing motor brushes routinely and checking electrical wiring to ensure a continuous power supply.
- HVS should be calibrated at bi-monthly intervals.

Wind Data Monitoring

Wind data included wind speed and wind direction were directly extracted from Tuen Mun Station of Hong Kong Observatory during this reporting month. The wind data are presented in Appendix E.

4.6 Action and Limit Levels

Table 4.3 shows the Action and Limit levels for 24-hr TSP and 1-hr TSP monitoring.

Table 4.3 Action and Limit Levels for 24-hr TSP and 1-hr TSP

Monitoring Location	24-hr TSP ($\mu\text{g}/\text{m}^3$)		1-hr TSP ($\mu\text{g}/\text{m}^3$)	
	Action Level	Limit Level	Action Level	Limit Level
TM-A1	192	260	344	500
TM-A2	192	260	344	500

4.7 Event-Action Plans

Please refer to Appendix F for details.

4.8 Results and Observations

Totally 6 occasions of 24-hr TSP monitoring and 17 occasions of 1-hr TSP monitoring were carried out in this reporting period. All monitoring data of both 1-hr and 24-hr TSP monitoring is provided in Appendix B2. Graphical presentation of 1-hr and 24-hr TSP monitoring results for the reporting month is shown in Appendix B3. Wind data, including wind speed and wind direction, are annexed in Appendix E.

No exceedances of Action and Limit Level of both 1-hour and 24-hour TSP monitoring results were recorded during the reporting month.

Generally, the Contractor implemented sufficient dust mitigation measures, including operation of wheel washing facilities and road dampening by water bowsers on the main haul roads and unpaved areas.

5.0 MARINE WATER QUALITY MONITORING

5.1 Monitoring Requirements

In accordance with the Project Profile, impact marine water quality monitoring was conducted three days per week. Measurements were taken at both mid-flood and mid-ebb tides at three depths (i.e. 1m below surface, mid depth and 1m from seabed) at two control monitoring stations (TM-FC1 and TM-FC2) and two impact monitoring stations (TM-FM1 and TM-FM2).

5.2 Monitoring Locations

As stipulated in the EM&A requirement, there were four monitoring stations undertaken during the impact monitoring. Figure 3 shows the locations of the marine water quality monitoring stations.

5.3 Monitoring Parameters and Frequency

Monitoring of the marine water quality parameters and frequency are listed in Table 5.1.

Table 5.1 Monitoring Parameters and Frequency of the marine water

Monitoring Station	Parameter	Frequency	No. of Depths
Control Stations: TM-FC1 and TM-FC2	Depth (m)	3 days/week, 2 tides/day	3 (Surface, mid-depth & bottom)
	Temperature (°C)		
	Dissolved Oxygen (mg/L and % saturation)		
	Turbidity (NTU)		
	Salinity (ppt)		
	Suspended solids (mg/L)		

5.4 Monitoring Methodology and Equipment Used

For Location of the monitoring stations

Global Positioning System (GPS)

A hand-held digital GPS was used to identify the designated monitoring stations prior to water sampling.

For Water Depth measurement

Echo Sounder

A portable, battery-operated echo sounder was used for the determination of water depth at each designated monitoring station.

For In-situ Water Quality Measurement

All in-situ monitoring instruments were checked, calibrated and certified by a laboratory accredited under HOKLAS or any other international accreditation scheme before use, and subsequently re-calibrated at 3 monthly intervals or sometimes longer throughout all stages of the water quality monitoring.

Dissolved Oxygen (DO) and temperature measuring equipment

A portable, weatherproof DO-measuring meter with built-in salinity compensation (YSI model 95) was used in the impact monitoring. It can be capable for measuring:

- a dissolved oxygen level in the range of 0-20 mg/L and 0-200 % saturation; and
- a temperature of 0-45 degree Celsius

This type of DO-measuring meter has a membrane electrode with automatic temperature compensation complete with a 50-feet cable. Wet bulb calibration for a DO meter was carried out before the start of measurement.

Turbidity Measurement Instrument

A portable and weatherproof turbidity meter (HACH model 2100P) was used during impact monitoring. It has a photoelectric sensor capable of measuring turbidity between 0-1000 NTU. Response of the sensor was checked with certified standard Turbidity solutions before the start of measurement.

Salinity Meter

A portable salinity meter capable of measuring salinity in the range 0-40 ppt (YSI Model 30M) was provided for measuring salinity of the water at each monitoring location. It was checked with standard 30 ppt Salinity solutions before the start of measurement.

For Water Sampling and Sample Analysis

In-situ monitoring was carried out at three depths: 1 meter below water surface, at mid-depth and 1 meter above the seabed. At each sampling depth, duplicate readings of dissolved oxygen content and turbidity were taken. The probes were retrieved out of the water after first measurement and then redeployed for the second measurement. The difference between the two readings of each set was more than 25% of the value of the first reading while a third measurement would be conducted to ensure data precision.

Water Sampler

A water sampler comprising a transparent PVC cylinder, with a capacity of not less than 2 liters, was lowered into the water body at the predetermined depth. The both opening ends of the sampler were then closed accordingly by dead weight and water samples were collected.

Water Container

The sample container, made by high-density polythene, was rinsed with a portion of the water sample. The water sample was then transferred to the container, labeled with a unique sample ID and sealed with a screw cap. The water samples were stored in a cool box maintained at 4°C. The water samples were then delivered to a local HOKLAS-accredited laboratory (Environmental Laboratory, ETS-Testconsult Ltd, HOKLAS Registration No. 022) on the same day for analysis.

The summary of testing method of testing parameter as recommended by EIA or required by EPD, with the QA/QC results in accordance with the requirement of HOKLAS or international accredited scheme is shown in Table 5.2. For the QA/QC procedures, one QC sample, one duplicate sample and one sample spike of every batch of 20 samples were analysis. The QA/QC results are summarized in Appendix L.

Table 5.2 Summary of testing procedures

Laboratory Analysis	Testing Procedure	Detection Limit
Total suspended solids	In house method based on APHA 19 th ed 2540D	1.0 mg/L

In-situ measurement

All in-situ monitoring instruments were checked, calibrated and certified by a laboratory accredited under HOKLAS or any other international accreditation scheme before use. Responses of sensors and electrodes were checked with certified standard solutions before each use. Wet bulb calibration for a DO meter was carried out before the start of measurement.

At each measurement/sampling depth, two consecutive measurements of dissolved oxygen (DO), dissolved oxygen saturation (DOS), turbidity and salinity were taken. For turbidity measurement, the sample was collected by using sampler and then transferred to the cell. The reading of turbidity of the sample was directly recorded from the Turbidimeter (HACH 2100P) after inserting the cell to the Turbidimeter. For DO, DOS and Salinity, measurements were conducted three days per week at both mid-ebb and mid-flood tides at three depths (i.e. 1m below surface, mid depth and 1m from seabed). The duplicate measurements were averaged if the difference was not greater than 25%. If the difference is greater than 25%, repeat measurement will be required to be carried out.

Table 5.3 shows the equipment used for in-situ monitoring of water quality. The calibration certificates are attached in Appendix C1.

Table 5.3 Details of Marine Water Quality Monitoring Equipment (In-situ measurement)

Parameter	Model	Date of Calibration	Due Date	Equipment No.
Coordinate of Monitoring stations	MLR GPS Navigator, SP24	----	----	ET/EW/005/01
Dissolved Oxygen (Saturation), Temperature, Salinity	YSI Dissolved Oxygen, Salinity & Temperature Meter, YSI 85	28/02/08	28/05/09	ET/EW/008/002 *
Turbidity	HACH Model 2100P Turbid Meter	09/02/09	08/05/09	ET/0505/006
Water Depth	EAGLE Strata 128 Sonar	----	----	EW/002/02

Remark: (*) indicates the instrument should be calibrated on use.

5.5 Action and Limit Levels

The water quality criteria, namely Action and Limit (A/L) levels are presented in the table below.

Table 5.4 Water Quality Action and Limit Levels

Parameter	Action Level	Limit Level
DO (mg/L)	<u>Surface & Middle</u> <4.78 mg/L (5%-ile of baseline data) <u>Bottom</u> <4.16 mg/L (5%-ile of baseline data)	<u>Surface & Middle</u> <4.00 mg/L (1%-ile of baseline data) <u>Bottom</u> <2.00 mg/L
SS (mg/L) (Depth-averaged)	>120% of the upstream control station's SS at the same tide on the same day	>130% of the upstream control station's SS at the same tide on the same day
Turbidity (NTU) (Depth-averaged)	>120% of the upstream control station's turbidity at the same tide on the same day	>130% of the upstream control station's turbidity at the same tide on the same day

5.6 Event and Action Plan

Please refer to the Appendix F for details.

5.7 Monitoring Duration and Period in this reporting month

Below is the time schedule for the water quality monitoring events that were conducted in this reporting month:

Table 5.5 Time Schedule of Marine Water Quality Monitoring

April 2009						
Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
			1	2 ▼	3	4 Holiday
5	6	7 ▼	8	9 ▼	10 Holiday	11 Holiday
12	13 Holiday	14 ▼	15	16 ▼	17	18 ▼
19	20	21 ▼	22	23 ▼	24	25 ▼
26	27	28 ▼	29	30 ▼		

Remark (▼) : Marine water quality monitoring carried out by ET

The duration of marine water quality monitoring is detailed in Appendix C2.

5.8 Marine Water Quality Monitoring Results

Totally 11 occasions (mid-flood and mid-ebb) of marine water quality monitoring were carried out in this reporting period. The impact water quality measurement results are detailed in Appendix C2. Appendix C3 presents the water quality monitoring data and graphical presentations of monitoring results respectively.

The summary of marine water quality exceedances is shown in Table 5.6.

Table 5.6 Summary of Marine Water Quality Exceedances in this reporting month

Tide	Station	Exceedance Level	DO		Turbidity	SS	Total	
			Surface and Middle	Bottom				
Mid-Ebb	TM-FM1	Action	0	0	0	0	0	
		Limit	0	0	0	0	0	
	TM-FM2	Action	0	0	0	0	0	
		Limit	0	0	0	0	0	
Mid-Flood	TM-FM1	Action	0	0	0	0	0	
		Limit	0	0	0	0	0	
	TM-FM2	Action	0	0	0	0	0	
		Limit	0	0	0	0	0	
Total		Action	0	0	0	0	0	
		Limit	0	0	0	0	0	

According to the summary of marine water monitoring results, no exceedances of Action and Limit levels were recorded for this reporting month.

6.0 Noise Monitoring

6.1 Monitoring Requirements

Noise monitoring was conducted at 2 designated monitoring stations as specified in the Sections 26.10 to 26.12 of the Particular Specification for good site practice.

The equipment, parameter, frequency, duration, methodology, calibration details, results and observations of the noise monitoring for the reporting month are presented in this section.

6.2 Monitoring Equipment

An Integrating Sound Level Meter was used for noise monitoring. It was a Type 1 sound level meter capable of giving a continuous readout of the noise level reading including equivalent continuous sound pressure level (L_{eq}) and percentile sound pressure level (L_x). It complies with International Electro Technical Commission Publications 651:1979 (Type1) and 804:1985 (Type1), and speed in m/s was used to monitor the wind speed.

Table 6.1 summarizes noise monitoring equipment model being used. A copy of the calibration certificate for noise meter and calibrator are attached in Appendix D1.

Table 6.1 Noise Monitoring Equipment

Equipment	Model
Integrating Sound Level Meter	Rion NL-31 Sound Level Meter
Calibrator	Rion NC-73 Sound Level Calibrator
Portable Wind Speed Indicator	TSI Model 8340-M Air Velocity Meter

6.3 Monitoring Parameters, Duration and Frequency

Duration, frequencies and parameters of noise measurement are presented in Table 6.2.

Table 6.2 Duration, Frequencies and Parameters of Noise Monitoring

Time period	Duration/min	Parameters	Frequency
Day-time: 0700-1900 hrs on normal weekday	30	L_{eq} , L_{10} , L_{90}	Twice per week

6.4 Monitoring Locations and Period

Since Lands Dept did not approve to carry out noise monitoring at their own area where the noise monitoring stations TM-N1 and TM-N2 located due to the security, noise monitoring carried out at two noise monitoring stations TM-RN1 and TM-RN2 (refer to the figure attached) temporarily from 18 December 2007 and before Lands Department's approval.

The noise monitoring locations, TM-RN1 and TM-RN2 are shown in Figure 4.

The noise-monitoring period of monitoring stations is summarized in Appendix D2.

6.5 Monitoring Procedures and Calibration Details

Operation/Analysis Procedures

- The Sound Level Meter was set on a tripod at a height of 1.2m above the ground.
- For free field measurement, the meter was positioned away from any nearby reflective surfaces.
- The battery condition was checked to ensure the correct functioning of the meter.
- Parameters such as frequency weighting, the time weighting and the measurement time were set as follows:
 - Frequency weighting: A
 - Time weighting : Fast
 - Time measurement : 30 mins
- Prior to and after each noise measurement, the meter was calibrated using a Calibrator for 94 dB at 1000HZ. If the difference in the calibration level before and after measurement was more than 1dB(A), the measurement would be considered invalid and repeat measurement would be required after re-calibration or repair of the equipment.
- The wind speed was frequently checked with a portable wind meter.
- During the monitoring period, the L_{eq} , L_{10} and L_{90} were recorded. In addition, site conditions and noise sources were recorded on a standard record sheet.
- Free Field correction to the measurements should be made. Correction factor of +3dB(A) should be made to the free Field measurements.
- Noise monitoring would be cancelled in the presence of fog, rain, wind with a steady speed exceeding 5m/s, or wind gusts exceeding 10m/s.

Maintenance and Calibration

- The microphone head of the sound level meter and calibrator are cleaned with soft cloth in quarterly intervals.
- The meter is sent to the supplier or HOKLAS laboratory to check and calibrated in yearly intervals.

6.6 Action and Limit Levels

The Action and Limit levels for noise levels derived as illustrated in Table 6.3.

Table 6.3 Action and Limit Levels for noise monitoring

Time Period	Action *	Limit *
0700-1900 hrs on normal weekdays	When one documented complaint is received	65 dB(A)

Remark (*): The Action and Limit Levels refer to the Table 26.2 – Action and Limit Levels for Noise in the Particular Specification of Contract No.CV/2005/01.

6.7 Event-Action Plans

Please refer to the Appendix F for details.

6.8 Results and Observation

Totally 9 occasions of noise monitoring were carried out in this reporting month.

The detail of the noise monitoring is provided in Appendix D2. Graphical presentation of the monitoring result for the reporting month is shown in Appendix D3.

Since no documented complaints on noise issue were received in this reporting month, no Action Level exceedances were recorded. Besides, no exceedances in Limit Level were recorded according to the result from Day-time noise monitoring.

The major sources of noise pollution observed in this reporting month were noise from the traveling dump trucks and from the operation of site machines.

7.0 ENVIRONMENTAL AUDIT

7.1 Weekly Site Inspection

Weekly site inspections were carried out by ET to monitor the timely implementation of proper environmental pollution control and mitigation measures for the Project. In this reporting month, five weekly site inspections were conducted on 02, 07, 16, 23 and 30 April 2009. Summaries of weekly site inspection observations and recommendations in this month are described as follows:

Air Quality

- The major dust sources were dump truck movement on the unpaved haul roads and loading & unloading activities on various working platforms in the Fill Bank. The Contractor deployed water bowsers to dampen the haul roads and the working platforms;
- Wheel washing facilities were found operating during weekly site inspections. However, the Contractor was reminded to provide notice or manpower at site exit to inform the drivers to limit the vehicle speed and use the wheel washing facilities to wash away any dusty materials before leaving the site;
- The power of the engines of site equipment were off when not in use;
- The tarpaulin sheets and watering system at tipping halls were found provided and operated properly in this reporting month;
- Water trucks served to dampen the haul roads and on the ramp to the stockpiling area;
- The dump trucks were operating below the speed limit in the Fill Bank. There were sufficient speed limit signs on site to advise the drivers;
- The Contractor watered the haul road adequately and hence no fugitive dust was detected during site inspections in this reporting month; and

- No fugitive dust was noted at unpaved areas and public roads in this reporting month. The Contractor was still reminded to improve the water spraying system to dampen unpaved areas and public roads.

Noise

- The major noise source was dump truck traffic in the Fill Bank;
- Compressors and generators were operated with door closed; and
- All site equipment and machinery were well maintained and no noise nuisance was sensed during operating.

Water Quality

- Silt curtain was installed at the main drainage outlet to prevent mud and silt to the marine;
- Follow up action to the outstanding observation in the previous month, mud and silt accumulated inside in the u-channel near CEDD site office were cleaned up during the weekly site inspection on 07 April 2009;
- In the weekly site inspection on 02 April 2009, mud and silt were observed accumulated inside the u-channel at weight bridge No.5. The Contractor was reminded to clean up the mud and silt in order to avoid any blockage of the u-channel. During the subsequent weekly site inspection on 07 April 2009, mud and silt accumulated inside the u-channel at weight bridge No.5 were cleaned up;
- Stagnant water was noted on the ground next to the Contractor's site office during the weekly site inspections on 02, 07 and 16 April 2009. The Contractor was reminded to drain the stagnant water or apply pesticide to avoid mosquito breeding. During the weekly site inspection on 23 April 2009, no stagnant water was noted; and
- Rubbish (e.g. lunch boxes) and vegetation were noted inside the main drainage channel during the weekly site inspection on 07 April 2009. The Contractor was reminded to clean up the rubbish and vegetation in order to avoid any blockage. During the weekly site inspection on 16 April 2009, rubbish and vegetation noted inside the main drainage channel were cleaned up.

Chemical and Waste Management

- The chemical waste was stored in the Chemical Waste Storage Area (CWSA). The Contractor should dispose chemical wastes regularly to avoid over accumulation of chemical waste on site;
- Chemical containers accumulated at chemical waste storage area were collected by the licensed collector regularly;
- Appropriate chemical labels were applied for all chemicals in the chemical waste storage area in this reporting month; and
- Follow up action to the outstanding observation in the previous month, leak oil noted from a crack of a drip tray at chemical waste storage area was cleaned up and no oil leakage was noted during the inspection on 16 April 2009.

Site Practices

- Follow up action to the outstanding observation in the previous month, rubbish and withered vegetation discarded on the ground near the CEDD site office were collected during the weekly site inspection on 07 April 2009;
- Follow up action to the outstanding observation in the previous month, C&D wastes discarded near chemical waste storage area were collected during the last weekly site inspection on 30 April 2009;
- Rubbish and C&D wastes were found on the tussock at dump truck's parking area during the weekly site inspection on 23 April 2009. The Contractor was reminded to collect and dispose them properly. During the last weekly site inspection on 30 April 2009, rubbish and C&D wastes found on the tussock at dump truck's parking area were cleaned up; and
- Four idle tires were discarded near "plants parking area" during the weekly site inspection on 30 April 2009. The Contractor was reminded to collect and dispose the tires properly. Since the observation was noted in the last weekly site inspection, it will be verified in the coming month.

7.2 Review of Environmental Monitoring Procedures

The monitoring works conducted by the ET were inspected internally on a regular basis. The following observations have been recorded for the monitoring works:

Air Quality Monitoring

- The monitoring team recorded the observations around the monitoring stations within and outside of the construction site.
- The monitoring team recorded the temperature, air pressure and general weather condition on the monitoring day.

Water Quality Monitoring

- The monitoring team recorded the observations around the monitoring stations, which might affect the results; and
- Major water pollution sources were identified and recorded.

Noise Monitoring

- The monitoring team recorded the observations around the monitoring station, which might affect the results.
- Major noise sources were identified and recorded.

7.3 Status of Environmental Licensing and Permitting

All permits/licenses valid in this reporting month are summarized in Table 7.1.

Table 7.1 Summary of environmental licensing and permit status

Description	Permit No.	Valid Period		Section
		From	To	
Environmental Permit	EP-210/2005/A	15/12/08	---	Issued
Chemical Waste Producer	5298-421-C1186-07	03/01/07	---	Spent lubricating oil, Petrol, Diesel, Battery and Surplus Paint
Effluent Discharge License	EP760/421/012141/I	19/04/07	30/04/12	Discharge of Industrial Trade Effluent arising from public fill reception facilities

7.4 Implementation Status

7.4.1 Implementation Status of Environmental Mitigation Measures

An updated summary of the Environmental Mitigation Implementation Schedule (EMIS) is presented in Appendix I. Most of the necessary mitigation measures were implemented properly.

7.4.2 Implementation Status of Event and Action Plan

There was no exceedance on air quality, noise and marine water monitoring parameters recorded in this monitoring month. Hence no further actions were required.

7.4.3 Implementation Status of Environmental Complaint, Notifications of Summons and Successful Prosecutions Handling

No complaints, notifications of summons and successful prosecutions were received in this reporting month. A summary of environmental complaints, notifications of summons and successful prosecutions was given in Table 7.2.

Table 7.2 Summary of Environmental Complaints and Prosecutions

Complaints logged		Summons served		Successful Prosecution	
April 2009	Cumulative	April 2009	Cumulative	April 2009	Cumulative
0	1	0	0	0	0

8.0 LANDSCAPE AND VISUAL

Landscape and visual site audit was carried out on a weekly basis to monitor environmental issues in order to ensure that all mitigation measures were implemented timely and properly. The findings in this reporting month were:

- The maximum stockpiling height at the Fill Bank was limited to a maximum of +40 mPD;
- The Contractor hydroseeded the outer slopes of the Fill Bank as far as practicable;
- The Contractor removed the stockpile of public fill in a sequence to allow the outer hydroseeded to be removed later than other portions as far as practicable;
- *Casuarina equisetifolia* were planted as buffer tree along the northern perimeter of the site. The height of *Casuarina equisetifolia* was maintained at least 3000mm above soil level; and
- Lighting was set to minimize night-time glare.

9.0 WASTE MANAGEMENT

9.1 Summary of Waste generated in this month

The actual amounts of different types of waste generated by the activities of the Project in the month are shown in Table 9.1

Table 9.1 Actual amounts of Waste generated in this reporting month

Waste Type	Actual Amount	Disposal Locations
Public Fill	0 m ³	---
C&D Waste (general refuse)	0 m ³	---
Chemical Waste	0 kg	---

9.2 Advice on the Solid and Liquid Waste Management Status

The Contractor should provide sufficient preventive measures during equipment maintenance works so as to avoid oil leakage on the ground. In the event of any oil leakage, the Contractor should clean up the polluted soil and handle all the materials used for this cleaning works as chemical waste.

The drain outlet of all the bunded areas should be plugged properly. Besides, pre-cast drip trays were provided for oil drums at several areas, such as workshop and chemical storage area. The Contractor should collect and dispose of any stagnant water accumulated in the concrete bunding and drip trays and handle them as chemical waste.

The Contractor should use suitable containers with proper labels to store chemical wastes in accordance with Code of Practice on the Packaging, Labeling and Storage of Chemical Waste. The Contractor should also advise their workers of the proper procedures in handling the chemical waste. All the trip tickets for chemical waste disposal should be properly kept in the site office.

The Contractor was reminded to increase the frequency of inspection and cleaning of the site drainage system, including permanent desilting chambers, desilting facilities, oil interceptor bypass tank and all the trapezoidal channels. Moreover, the Contractor should apply approved pesticides in the stagnant water ponds.

All the runoff from the parking area should be pumped to the desilting facilities and oil interceptors to remove suspended solids and oil & grease prior to discharge.

10.0 ENVIRONMENTAL NON-CONFORMANCE

10.1 Summary of air quality, noise and marine water quality

No exceedances of Action and Limit Level of 24-hour and 1-hour TSP monitoring results were recorded during the reporting month.

According to the summary of marine water monitoring results, no exceedances of Action and Limit levels were recorded for this reporting month.

The noise level measured at the monitoring station complied with the Limit Level of 65dB(A). No complaint was received regarding noise issue in this reporting month.

10.2 Summary of Environmental Complaints

No complaint was received in this reporting month.

10.3 Summary of Notification of Summons and Prosecution

There was no notification of summon and prosecution respect to environmental issues registered in this reporting month.

11.0 CONCLUSIONS AND RECOMMENDATIONS

Conclusions

Impact monitoring of air quality, noise and water quality were carried out at designated locations in accordance with the EM&A Manual in this reporting month.

Impact monitoring of air quality were carried out at designated locations in accordance with the Project Profile in this reporting month.

According to the summary of air monitoring results, no exceedances of Action and Limit Level of 1-hour and 24-hour TSP monitoring results were recorded during the reporting month.

According to the summary of marine water monitoring results, no exceedances of Action and Limit levels were recorded in this reporting month.

The noise level measured at the monitoring station complied with the Limit Level of 65dB(A). No complaint was received regarding noise issue in this reporting month.

According to the weekly site inspections carried out in this reporting month, the Contractor generally implemented sufficient dust mitigation measures, including operation of the mist spraying systems and automatic wheel washing facilities, dampening of haul roads and stockpiling areas.

No complaints, prosecutions or notifications of summons were received in this reporting month.

Recommendations

According to the environmental site inspections performed in the reporting month, the following recommendations were provided:

Air Quality

- Ensure the frequency of water spraying on haul roads, unloading areas and stockpiles to be sufficient to suppress the dust sources;
- Provide proper maintenance for the powered mechanical equipment and barges to avoid emission of dark smoke;
- Provide water spraying onto the truckloads during inspection of fill material;
- Conduct road sweeping on all paved haul roads and public roads especially outside and near the site egress by the road sweeper. Undertake water spraying on stockpiling area by water bowers;
- Erect adequate speed limit signs to advise the truck drivers of the speed limit;
- Operate mist spraying systems and automatic water sprinklers in the Fill Bank;
- Implement the dust mitigation measures for the construction activities;
- Designate proper haul roads to ensure effective water spraying; and
- Ensure all vehicles to be washed before leaving the site egress by provision, operation and maintenance of automatic wheel washing facilities.

Noise

- Conduct noisy activities at a farther location from the NSRs.

Water Quality

- Maintain the drainage system, including the trapezoidal channels and permanent desilting chambers regularly; and
- Remove the stagnant water or provide approved pesticides for the stagnant water in the permanent desilting chambers, if any.

Chemical and Waste Management

- Remove waste materials from the site to avoid accumulation regularly;
- Handle and store chemical wastes properly;
- Remove unwanted material in the existing stockpiles and avoid further dumping of such material;
- Provide and maintain sufficient drip trays for diesel drums, chemical containers, chemical waste storage drums and diesel operated generator set;
- Maintain good housekeeping at the workshop area;
- Ensure sufficient tarpaulin sheets are provided to cover drip trays; and
- Avoid soil being polluted during oil filling and equipment maintenance; hence, properly remove and store the contaminated soil, if any.

Landscape and Visual

- Provide hydroseeding on the exposed slopes, on which the final profile has been formed;
- Erect all the site hoarding / chaining fences in accordance with agreed design at proper location; and
- Maintain the hydroseeded slopes properly.

12.0 FUTURE KEY ISSUES

Based on the site inspections and forecast of engineering works in the coming month, key issues to be considered are as follows:

- Dust generation from activities on site, such as vehicular movements along unpaved area and rock crushing activities;
- Noise impact from operating equipment and machinery on site and
- Wastewater and surface runoff from the site discharged into nearby water body.

Appendix A

Organization Chart and Lines of Communication

Contract No. CV/2005/01
Delivery of Reclamation Material to Mainland

Project Director
 Project Number:
 U.S. Stage
 9462 2172

Project Manager
 Project Number:
 U.S. Stage
 9462 4599

Contractor's Agent
 Los Pak Jang
 -MPTA/HK

Stefan Q. S.
 Tel: +852 2172
 9462 0969

Armin Enkemann
 Engineer
 Mr. Cheung Han Hui
 9462 4956

Operations Manager
 Hong Kong Div.
 9462 4620

St. Planning Manager
 C.Y. Wong
 9462 6379

Project Leader
 Tommy Chiu
 9462 3238

Assistant Manager &
Logistic Manager
 Alan Wong
 9462 4646

Administrative Officer
 I.F. Wong, Mrs.
 9462 0969

C. Duncan
 C.W. Wong
 9462 2556

Supervision Manager
 Joe Poon Yuen Chung
 9462 4857

Supervisor
 C.C. Wong
 9462 2213

KT

Foreman
 Wong Chi Kit
 9462 7781

Project Leader
 Wong Chi Kit
 9462 5316

Project Leader
 Wong Chi Kit
 9462 4744

T.A.
 Wong Wing
 9462 4992

Permit
 Wong Yiu
 9462 4859

PW

Foreman
 Wong Yiu
 9462 4859

Project Leader
 Wong Yiu
 9462 4744

Saltier
 Wong Yiu
 9462 4722

Permit
 Wong Yiu
 9462 4859

MW

Foreman
 Wong Yiu
 9462 4859

Project Leader
 Wong Yiu
 9462 4744

Saltier
 Wong Yiu
 9462 4722

Permit
 Wong Yiu
 9462 4859

CW

Foreman
 Wong Yiu
 9462 4859

Project Leader
 Wong Yiu
 9462 4744

Saltier
 Wong Yiu
 9462 4722

Permit
 Wong Yiu
 9462 4859


TRO

Foreman
 Wong Yiu
 9462 4859

Project Leader
 Wong Yiu
 9462 4744


Administrative Officer
 Wong Yiu
 9462 4744

Lines of Communication

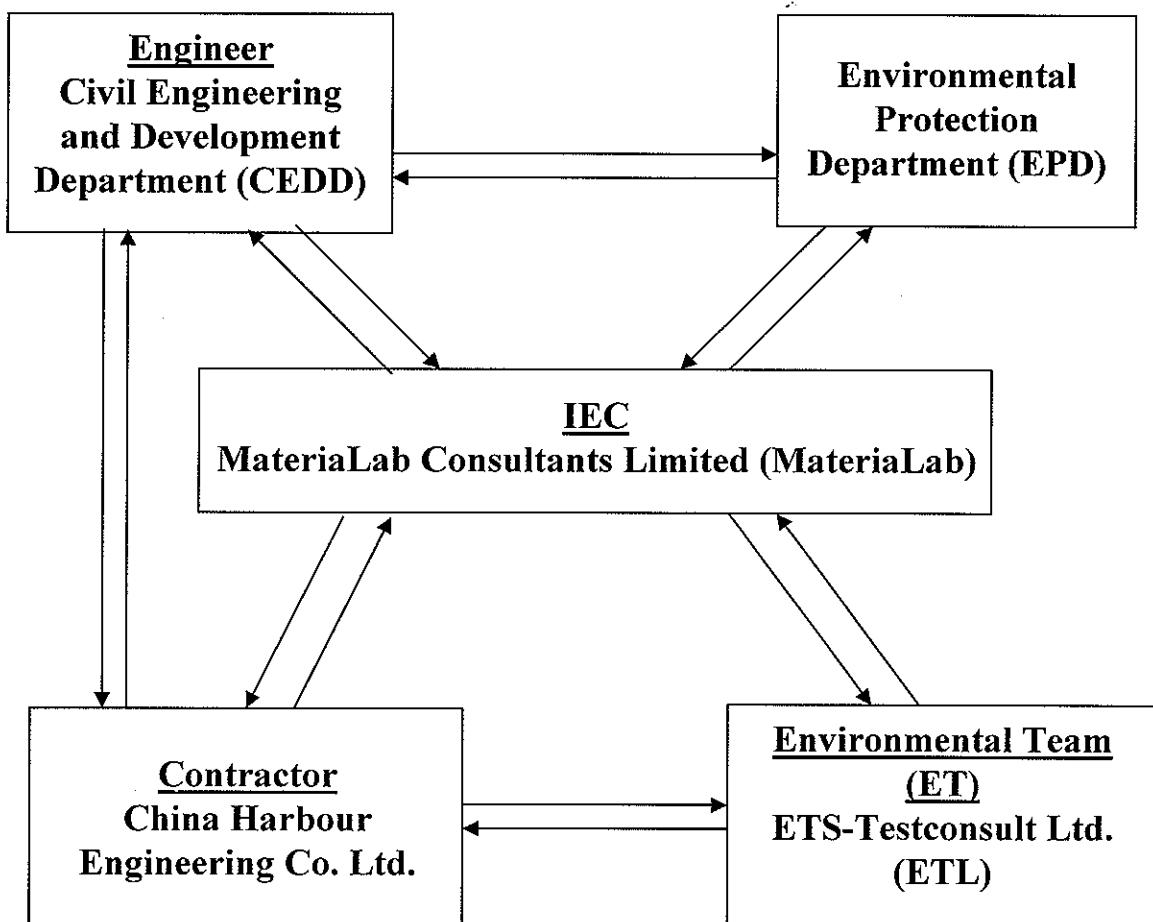

Appendix B1

Calibration Certificates for Impact Air Quality Monitoring Equipments

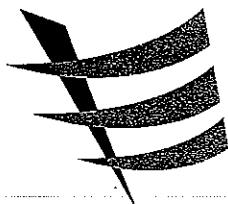

東業德勤測試顧問有限公司
ETS-TESTCONSULT LIMITED


8/F, Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan Street, Fotan, Hong Kong
Tel : 2695 8318 E-mail : etl@ets-testconsult.com
Fax : 2695 3944 Web site : www.ets-testconsult.com

TEST REPORT

**Calibration Report
of
High Volume Air Sampler**

Manufacturer	: Graseby GMW	Date of Calibration	: 12 March 2009																		
Serial No.	: 9503 (ET / EA / 003 / 03)	Calibration Due Date	: 11 May 2009																		
Method	Based on Operations Manual for the 5-point calibration using standard calibration kit manufactured by Tisch TE-5025 A																				
Results	<table border="1"><tr><td>Flow recorder reading (cfm)</td><td>56</td><td>48</td><td>40</td><td>30</td><td>21</td></tr><tr><td>Qstd (Actual flow rate, m³/min)</td><td>1.68</td><td>1.50</td><td>1.30</td><td>1.03</td><td>0.81</td></tr><tr><td>Pressure :</td><td colspan="2">762.06 mm Hg</td><td>Temp. :</td><td colspan="2">292 K</td></tr></table>			Flow recorder reading (cfm)	56	48	40	30	21	Qstd (Actual flow rate, m ³ /min)	1.68	1.50	1.30	1.03	0.81	Pressure :	762.06 mm Hg		Temp. :	292 K	
Flow recorder reading (cfm)	56	48	40	30	21																
Qstd (Actual flow rate, m ³ /min)	1.68	1.50	1.30	1.03	0.81																
Pressure :	762.06 mm Hg		Temp. :	292 K																	

**Sampler 9503 Calibration Curve
Site: Tuen Mun 38 (TM-A1)**

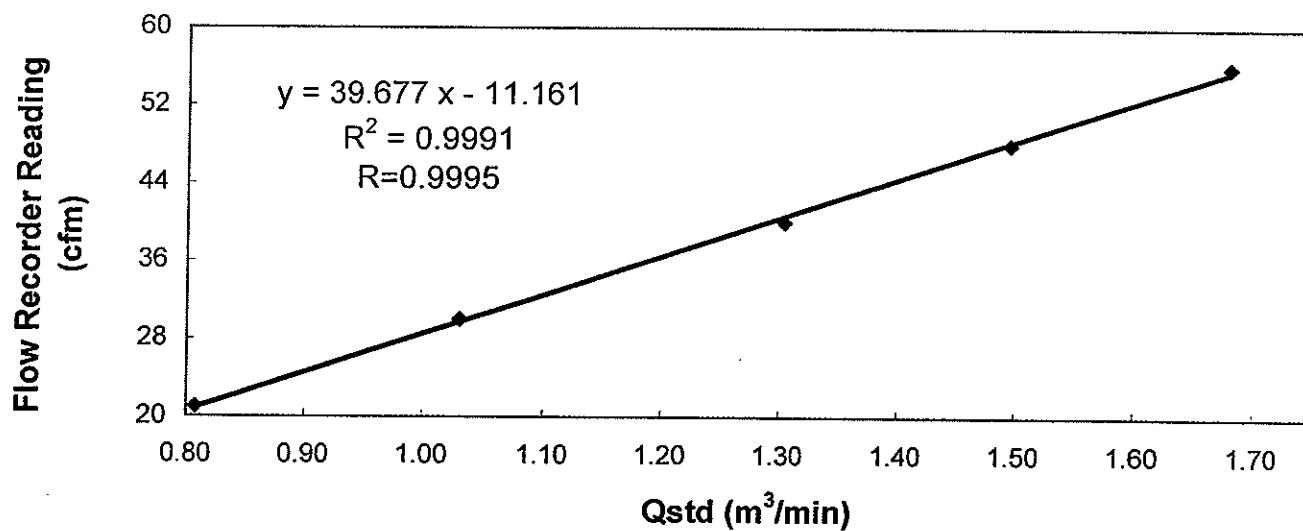


Acceptance Criteria : Correlation coefficient (r) of the calibration curve greater than 0.990 after a 5-point calibration

The high volume sampler complies * / does not comply * with the specified requirements and is deemed acceptable */ unacceptable * for use.

Calibrated by : JCL
LI, Wan Lung
(Technician)

Approved by : SAT
CHOW, Hoi Tat
(Asst. Environmental Officer)

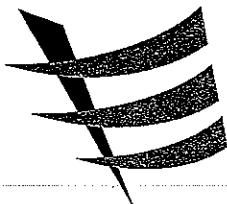

東業德勤測試顧問有限公司
ETS-TESTCONSULT LIMITED


8/F, Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan Street, Fotan, Hong Kong
Tel : 2695 8318 E-mail : etl@ets-testconsult.com
Fax : 2695 3944 Web site : www.ets-testconsult.com

TEST REPORT

Calibration Report
of
High Volume Air Sampler

Manufacturer	:	Graseby GMW	Date of Calibration	:	12 March 2009
Serial No.	:	8115 (ET / EA / 003 / 13)	Calibration Due Date	:	11 May 2009
Method	:	Based on Operations Manual for the 5-point calibration using standard calibration kit manufactured by Tisch TE-5025 A			
Results	:	Flow recorder reading (cfm)	57	49	43
		Qstd (Actual flow rate, m ³ /min)	1.73	1.56	1.37
		Pressure :	762.06 mm Hg	Temp. :	292 K

Sampler 8115 Calibration Curve
Site: Tuen Mun 38 (TM-A2)

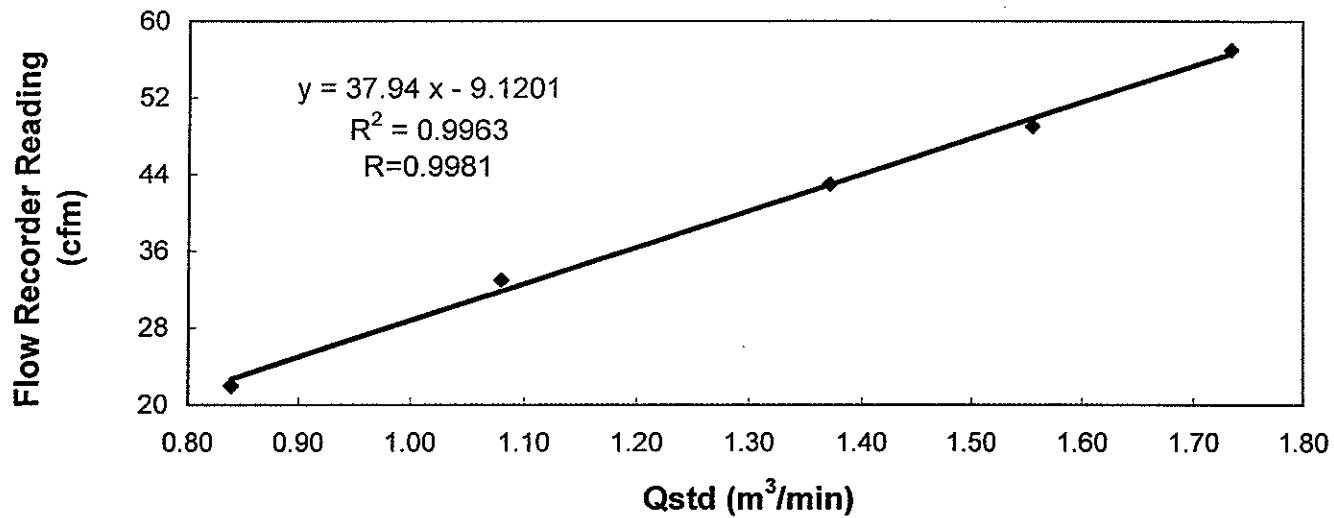

Acceptance Criteria : Correlation coefficient (r) of the calibration curve greater than 0.990 after a 5-point calibration

The high volume sampler complies * / does-not-comply * with the specified requirements and is deemed acceptable */ unacceptable * for use.

Calibrated by :
LI, Wan Lung
(Technician)

Approved by :
CHOW, Hoi Tat
(Asst. Environmental Officer)



TISCH ENVIRONMENTAL, INC.
145 SOUTH MIAMI AVE.
VILLAGE OF CLEVES, OH 45002
513.467.9000
877.263.7610 TOLL FREE
513.467.9009 FAX
WWW.TISCH-ENV.COM

AIR POLLUTION MONITORING EQUIPMENT

ORIFICE TRANSFER STANDARD CERTIFICATION WORKSHEET TE-5025A

Date - May 14, 2008 Rootsmeter S/N 9833620 Ta (K) - 295
Operator Tisch Orifice I.D. - 1172 Pa (mm) - 750.57

PLATE OR Run #	VOLUME START (m ³)	VOLUME STOP (m ³)	DIFF VOLUME (m ³)	DIFF TIME (min)	METER DIFF Hg (mm)	ORFICE DIFF H ₂ O (in.)
1	NA	NA	1.00	1.3800	3.1	2.00
2	NA	NA	1.00	0.9650	6.3	4.00
3	NA	NA	1.00	0.8630	7.9	5.00
4	NA	NA	1.00	0.8230	8.6	5.50
5	NA	NA	1.00	0.6770	12.7	8.00

DATA TABULATION

Vstd	(x axis) Qstd	(y axis)		Va	(x axis) Qa	(y axis)
0.9935	0.7199	1.4125		0.9958	0.7216	0.8866
0.9893	1.0252	1.9976		0.9916	1.0276	1.2538
0.9870	1.1437	2.2334		0.9894	1.1464	1.4018
0.9862	1.1983	2.3424		0.9885	1.2011	1.4703
0.9807	1.4486	2.8251		0.9830	1.4521	1.7732

Qstd slope (m) = 1.94106 Qa slope (m) = 1.21546
intercept (b) = 0.01311 intercept (b) = 0.00823
coefficient (r) = 0.99996 coefficient (r) = 0.99996

y axis = SQRT[H₂O(Pa/760)(298/Ta)] y axis = SQRT[H₂O(Ta/Pa)]

CALCULATIONS

$$Vstd = \text{Diff. Vol}[(Pa - \text{Diff. Hg})/760](298/Ta)$$
$$Qstd = Vstd/\text{Time}$$

$$Va = \text{Diff Vol}[(Pa - \text{Diff Hg})/Pa]$$
$$Qa = Va/\text{Time}$$


For subsequent flow rate calculations:

$$Qstd = 1/m \{ \text{SQRT}(H_2O(Pa/760)(298/Ta)) - b \}$$
$$Qa = 1/m \{ \text{SQRT } H_2O(Ta/Pa) \} - b \}$$



TISCH ENVIRONMENTAL, INC.
145 SOUTH MIAMI AVE.
VILLAGE OF CLEVES, OH 45002
513.467.9000
877.263.7610 TOLL FREE
513.467.9009 FAX
WWW.TISCH-ENV.COM

AIR POLLUTION MONITORING EQUIPMENT

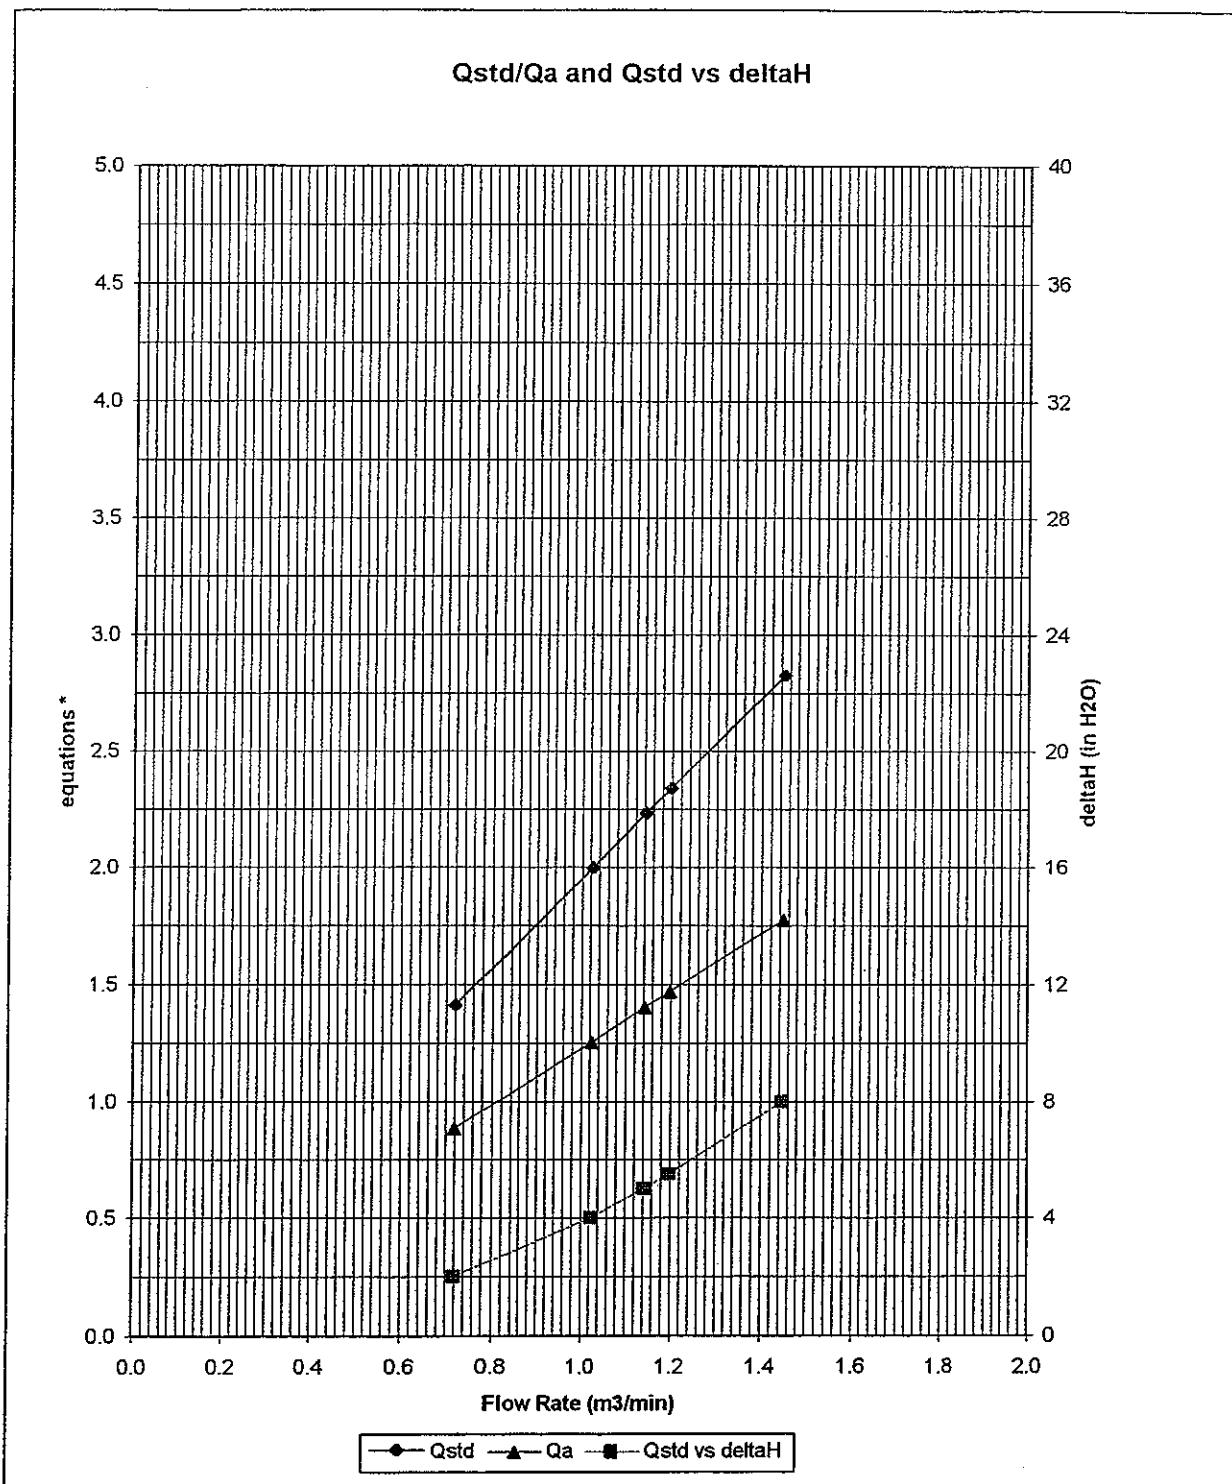

* y-axis equations:

Qstd series:
$$\sqrt{\Delta H \left(\frac{P_a}{P_{std}} \right) \left(\frac{T_{std}}{T_a} \right)}$$

Qa series:
$$\sqrt{(\Delta H (T_a / P_a))}$$

Appendix B2

Impact Air Quality Monitoring Results

Summary of 24-hr TSP Monitoring Results

Monitoring Station : TM-A1

Start Date	Time	Finish Date	Time	Elapsed Time		Sampling Time (hrs)	Flow Rate (m ³ /min.)	Average (m ³ /min.)	Filter Weight (g)	Conc. (µg/m ³)
				Initial	Final					
03/04/09	14:05	04/04/09	14:05	13774.22	13798.22	24.00	1.1130	1.1130	2.8264	3.0267
09/04/09	16:00	10/04/09	16:00	13801.22	13825.22	24.00	1.1130	1.1130	2.7953	3.0022
15/04/09	16:00	16/04/09	16:00	13828.22	13852.22	24.00	1.1130	1.1130	2.7943	3.0086
21/04/09	15:00	22/04/09	15:00	13855.22	13879.22	24.00	1.1130	1.1130	2.8012	3.0194
27/04/09	11:30	28/04/09	11:30	13882.22	13906.22	24.00	1.1130	1.1130	2.8128	3.0388
30/04/09	15:15	01/05/09	15:15	13909.22	13933.22	24.00	1.1130	1.1130	2.7962	2.9485
										95

Monitoring Station : TM-RA2 *

Start Date	Time	Finish Date	Time	Elapsed Time		Sampling Time (hrs)	Flow Rate (m ³ /min.)	Average (m ³ /min.)	Filter Weight (g)	Conc. (µg/m ³)
				Initial	Final					
03/04/09	14:18	04/04/09	14:19	14061.16	14085.17	24.01	1.0575	1.0575	2.8109	3.0592
09/04/09	16:05	10/04/09	16:05	14086.17	14112.17	24.01	1.0575	1.0575	2.8104	3.0631
15/04/09	16:05	16/04/09	16:05	14115.17	14139.17	24.00	1.0575	1.0575	2.8012	3.0633
21/04/09	15:05	22/04/09	15:05	14142.17	14166.17	24.00	1.0575	1.0575	2.8150	3.0848
27/04/09	11:45	28/04/09	11:45	14169.17	14193.17	24.00	1.0575	1.0575	2.8094	3.0820
30/04/09	15:35	01/05/09	15:35	14196.17	14220.17	24.00	1.0575	1.0575	2.8058	2.9916
										122

Remark (*) : Since the area for existing air monitoring station TM-A2 near Tipping Hall No.1 was handed over to EcoPark, air monitoring station TM-A2 was cancelled and the air monitoring was carried out at air monitoring station TM-RA2 (refer to Figure 2A attached) from 28 October 2008.

Summary of 1-hr TSP Monitoring Results

Monitoring Station : TM-A1
Location : Outside CEDD Site Office

Date	Time			Sampling Time (hrs)		Flow Rate (m ³ /min.)		Average (m ³ /min.)	Filter Weight (g)	Conc. (µg/m ³)
	Start	Finish	Initial	Final	Initial	Final				
02/04/09	09:00	10:00	13772.22	13773.22	1.00	1.0878	1.0878	2.8124	2.8298	267
03/04/09	13:00	14:00	13773.22	13774.22	1.00	1.1130	1.1130	2.8309	2.8471	243
07/04/09	09:00	10:00	13798.22	13799.22	1.00	1.1130	1.1130	2.8459	2.8860	225
07/04/09	14:30	15:30	13799.22	13800.22	1.00	1.1130	1.1130	2.8449	2.8421	258
09/04/09	09:00	10:00	13800.22	13801.22	1.00	1.1130	1.1130	2.8129	2.8314	277
14/04/09	09:50	10:50	13825.22	13826.22	1.00	1.1130	1.1130	2.8041	2.8198	235
14/04/09	13:05	14:06	13826.22	13827.24	1.02	1.1130	1.1130	2.7904	2.8067	239
15/04/09	09:00	10:00	13827.22	13828.22	1.00	1.1130	1.1130	2.8212	2.8388	264
16/04/09	17:08	18:08	13852.22	13853.22	1.00	1.1130	1.1130	2.8001	2.8142	211
18/04/09	09:00	10:00	13853.22	13854.22	1.00	1.1130	1.1130	2.8012	2.8191	268
21/04/09	09:00	10:00	13854.22	13855.22	1.00	1.1130	1.1130	2.8203	2.8390	280
23/04/09	09:00	10:00	13879.22	13880.22	1.00	1.1130	1.1130	2.8111	2.8247	204
25/04/09	13:30	14:30	13880.22	13881.22	1.00	1.1130	1.1130	2.8101	2.8219	177
27/04/09	09:00	10:00	13881.22	13882.22	1.00	1.1130	1.1130	2.8092	2.8218	189
28/04/09	13:00	14:00	13906.22	13907.22	1.00	1.1130	1.1130	2.8202	2.8339	205
28/04/09	14:45	15:45	13907.22	13908.22	1.00	1.1130	1.1130	2.8114	2.8264	225
30/04/09	09:00	10:00	13908.22	13909.22	1.00	1.1130	1.1130	2.8144	2.8225	121

Monitoring Station : TM-A2 / TM-RA2 *

Date	Time			Sampling Time (hrs)		Flow Rate (m ³ /min.)		Average (m ³ /min.)	Filter Weight (g)	Conc. (µg/m ³)
	Start	Finish	Initial	Final	Initial	Final				
02/04/09	09:00	10:00	14059.16	14060.16	1.00	1.0838	1.0838	2.8092	2.8290	304
03/04/09	13:15	14:15	14060.16	14061.16	1.00	1.0383	1.0383	2.8277	2.8469	295
07/04/09	09:00	10:00	14085.17	14086.17	1.00	1.0575	1.0575	2.8317	2.8499	287
07/04/09	14:15	15:15	14086.17	14087.17	1.00	1.0575	1.0575	2.8115	2.8314	314
09/04/09	09:00	10:00	14087.17	14088.17	1.00	1.0575	1.0575	2.8093	2.8303	331
14/04/09	09:59	10:59	14112.17	14113.17	1.00	1.0311	1.0311	2.7881	2.8069	304
14/04/09	13:20	14:20	14113.17	14114.17	1.00	1.0311	1.0311	2.7874	2.8070	317
15/04/09	09:00	10:00	14114.17	14115.17	1.00	1.0575	1.0575	2.8175	2.8370	307
16/04/09	17:15	18:15	14139.17	14140.17	1.00	1.0575	1.0575	2.8034	2.8222	296
18/04/09	09:00	10:00	14140.17	14141.17	1.00	1.0575	1.0575	2.8115	2.8320	323
21/04/09	09:05	10:05	14141.17	14142.17	1.00	1.0575	1.0575	2.8152	2.8348	309
23/04/09	09:00	10:00	14146.17	14147.17	1.00	1.0575	1.0575	2.8043	2.8186	225
25/04/09	13:50	14:50	14147.17	14148.17	1.00	1.0575	1.0575	2.8070	2.8194	195
27/04/09	09:00	10:00	14148.17	14149.17	1.00	1.0575	1.0575	2.8412	2.8567	244
28/04/09	13:00	14:00	14149.17	14150.17	1.00	1.0575	1.0575	2.7717	2.7905	296
28/04/09	14:57	15:57	14149.17	14150.17	1.00	1.0575	1.0575	2.8041	2.8235	306
30/04/09	09:00	10:00	14149.17	14150.17	1.00	1.0575	1.0575	2.8293	2.8399	167

Remark (*) : Since the area for existing air monitoring station TM-A2 near Tipping Hall No.1 was handed over to EcoPark, air monitoring station TM-A2 was cancelled and the air monitoring was carried out at air monitoring station TM-RA2 (refer to Figure 2A attached) from 28 October 2008.


Appendix B3

Graphical Plots of Impact Air Quality Monitoring Data




東業德勤測試顧問有限公司
ETS-TESTCONSULT LIMITED

1-hour TSP level at TM-A1

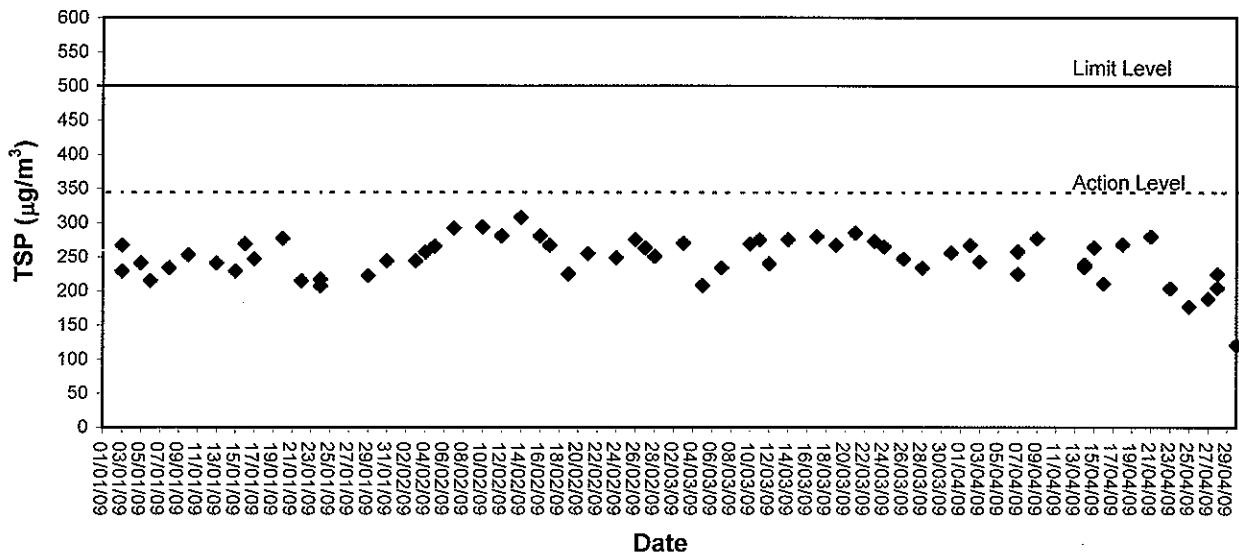


1-hour TSP level at TM-A2

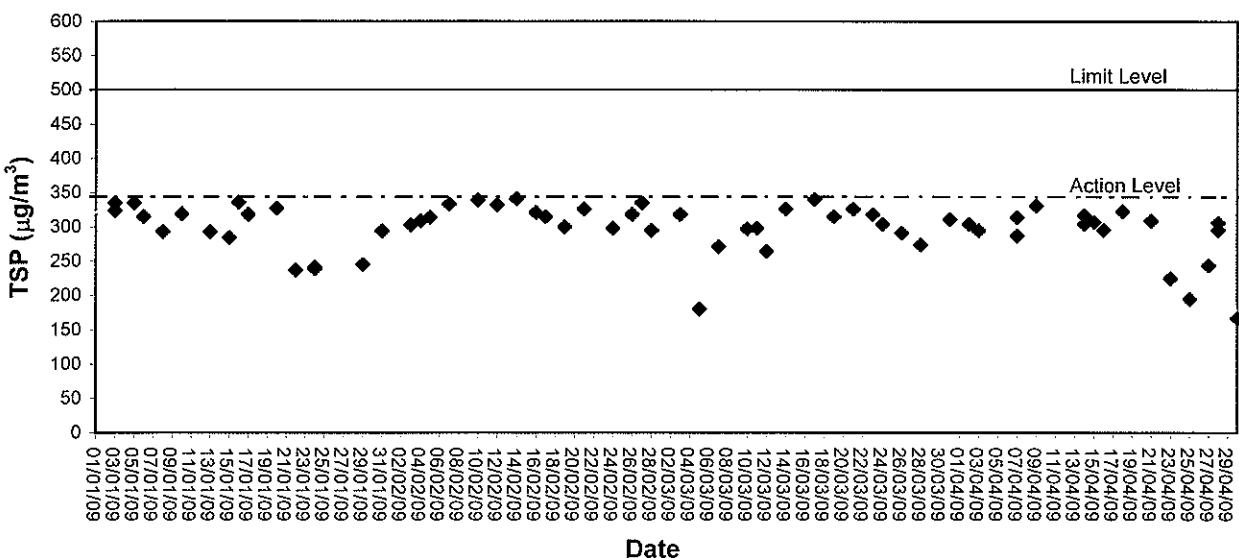




東業德勤測試廠有限公司
ETS-TESTCONSULT LIMITED

24-hour TSP level at TM-A1

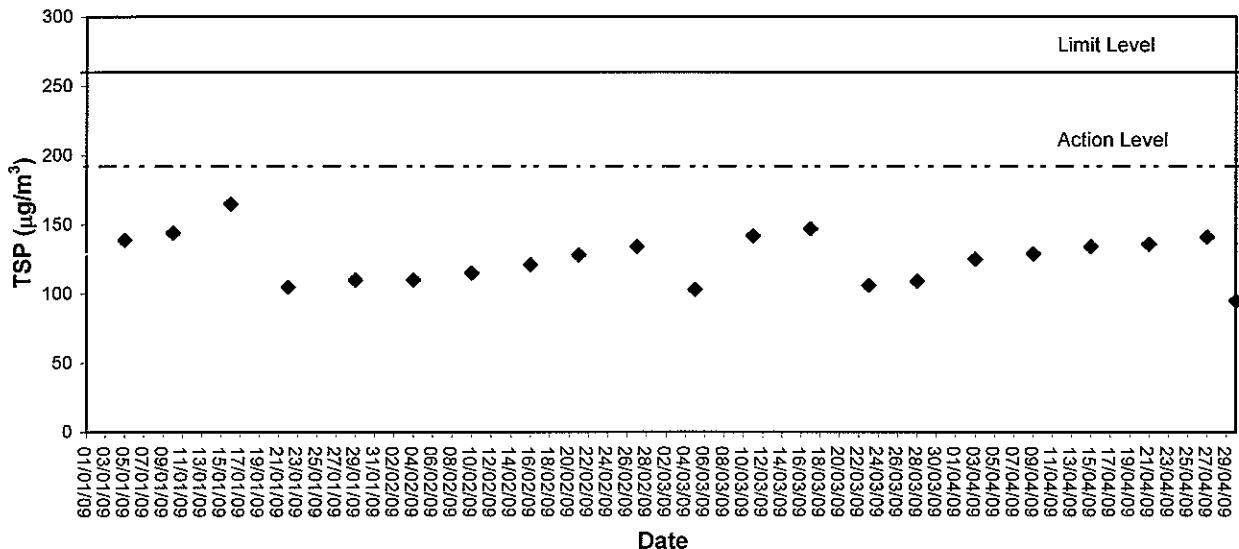

24-hour TSP level at TM-A2

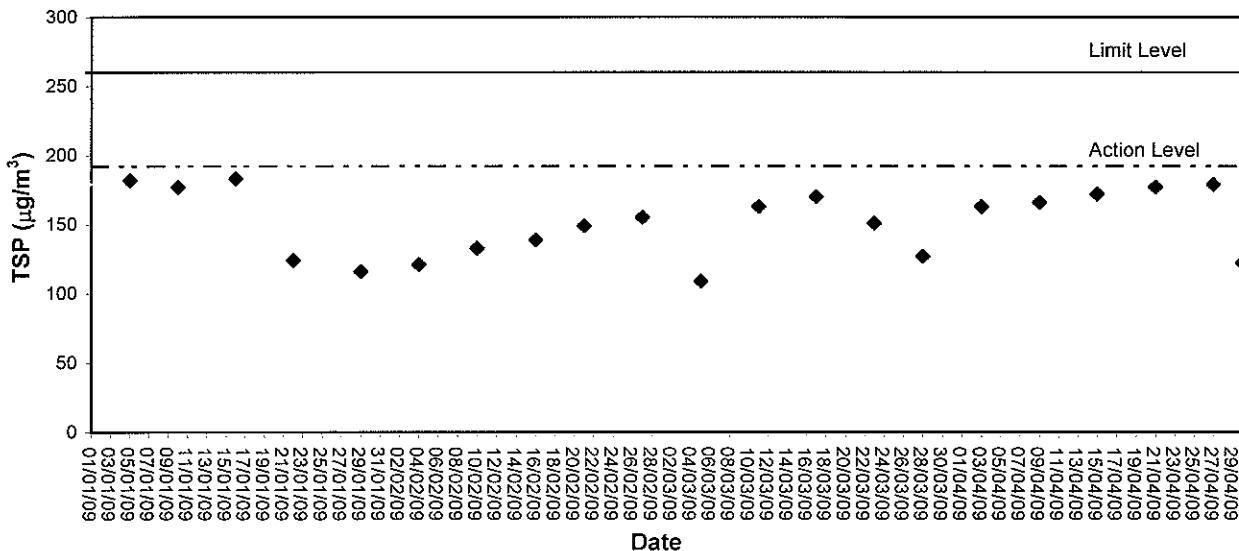

Appendix C1

Calibration Certificates for Impact Marine Water Quality Monitoring Equipments



Internal Calibration Report of Turbidimeter

Equipment Ref. No. : ET/0505/006 Manufacturer : HACH

Model No. : 2100P Serial No. : 660700018334

Date of Calibration : 9/2/09 Calibration Due : 8/15/09

Data

(5.34)	(56.6)	(547)
0 - 10 NTU Gelex Vial	10 - 100 NTU Gelex Vial	100 - 1000 NTU Gelex Vial
5.31	56.2	543

The equipment complies * / does not comply * with the specified requirements and is deemed acceptable * / unacceptable * for use.

* Delete as appropriate

Calibrated by : PK

Approved by : W.Law



Performance Check of Salinity Meter

Equipment Ref. No. : ETS-EW10087002 Manufacturer : TCF
Model No. : 85 Serial No. : 06C198AD
Date of Calibration : 28/21/99 Due Date : 28/5/01

Ref. No. of Salinity Standard used (30ppt)

5324

Salinity Standard (ppt)	Measured Salinity (ppt)	Difference %
30	28.8	4.08

Acceptance Criteria

Difference : <10 %

The salinity meter complies * / does not comply * with the specified requirements and is deemed acceptable * / unacceptable * for use. Measurements are traceable to national standards.

Checked by :

Approved by :

Internal Calibration Report of Dissolved Oxygen Meter

Equipment Ref. No.	<u>BTEW1008T 002</u>	Manufacturer	<u>YSI</u>
Model No.	<u>85</u>	Serial No.	<u>06C 1998AD</u>
Date of Calibration	<u>28/2/09</u>	Calibration Due Date	<u>28/5/09</u>

Ref. No. of Reference Thermometer : ET105211003Ref. No. of Potassium Dichromate : ET105201003102Temperature Verification

		Temperature (°C)
Thermometer reading		<u>15.0</u>
Meter reading		<u>15.0</u>

Linearity Checking

Purging time, min	DO meter reading, mg/L			Winkler Titration result, mg/L			Difference (%) of DO Content
	1	2	Average	1	2	Average	
2	<u>7.80</u>	<u>7.82</u>	<u>7.81</u>	<u>7.87</u>	<u>7.87</u>	<u>7.88</u>	<u>0.89</u>
5	<u>5.50</u>	<u>5.48</u>	<u>5.49</u>	<u>5.50</u>	<u>5.52</u>	<u>5.51</u>	<u>0.36</u>
10	<u>3.32</u>	<u>3.30</u>	<u>3.31</u>	<u>3.38</u>	<u>3.40</u>	<u>3.39</u>	<u>2.39</u>
Linear regression coefficient				<u>0.9998</u>			

Zero Point Checking

DO meter reading, mg/L	<u>0.00</u>
------------------------	-------------

Salinity Checking

Salinity (ppt)	DO meter reading, mg/L			Winkler Titration result, mg/L			Difference (%) of DO Content
	1	2	Average	1	2	Average	
10	<u>7.05</u>	<u>7.07</u>	<u>7.06</u>	<u>7.19</u>	<u>7.17</u>	<u>7.18</u>	<u>1.69</u>
30	<u>6.39</u>	<u>6.37</u>	<u>6.38</u>	<u>6.43</u>	<u>6.45</u>	<u>6.44</u>	<u>0.74</u>

Acceptance Criteria

- (1) Difference between temperature readings from temperature sensor of DO probe and reference thermometer : < 0.5 °C
- (2) Linear regression coefficient : > 0.99
- (3) Zero checking: 0.0mg/L
- (4) Difference (%) of DO content from the meter reading and by Winkler titration : within ± 5%

The equipment complies * / does not comply * with the specified requirements and is deemed acceptable *
 * unacceptable * for use.

* Delete as appropriate

Calibrated by : [Signature]Approved by : [Signature]

Appendix C2

Impact Marine Water Quality Monitoring Results

Monitoring Station :

TM-FC2

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Monitoring Depth (m)	Temp (°C)	Salinity (ppt)			Dissolved Oxygen (mg/L)			Dissolved Oxygen Saturation (%)			Turbidity (NTU)			Suspended Solids (mg/L)		
					Value	Average	Value	Depth-average	Value	Average	Depth-average	Value	Average	Depth-average	Value	Average	Depth-average	Value	Average
02/04/09	0954-1008	18/Cloudy	Surface	1.0	19.3	24.4	6.24	6.23	6.01	86.8	86.7	7.94	8.2	8.1					
			Middle	7.7	18.9	24.4	6.22	6.01	86.6	86.6	7.98	8.0	8.0						
			Bottom	14.4	18.8	26.4	5.81	5.77	80.9	80.5	8.72	8.69	8.02	8.5	8.4				
	1756-1808	17/Cloudy	Surface	1.0	17.9	24.3	6.53	6.51	90.5	90.1	90.3	6.87	6.90	8.2	8.4	8.0			
			Middle	8.5	17.2	27.0	5.82	5.81	6.16	80.6	80.4	7.39	7.43	7.43	7.3	7.4			
			Bottom	16.0	16.9	29.6	5.66	5.64	5.64	80.4	80.4	7.47	7.53	7.53	7.5	7.5			
03/04/09	0800-0815	22/Fine	Surface	1.0	21.5	28.4	6.57	6.58	6.58	80.6	80.4	7.46	7.43	7.19	7.19	7.19			
			Middle	7.6	20.6	29.9	6.23	6.24	6.24	80.4	80.4	7.21	7.24	7.24	7.24	7.24			
			Bottom	14.2	20.4	30.6	5.94	5.92	5.92	80.6	80.0	7.27	7.27	7.27	7.27	7.27			
	0825-0839	22/Fine	Surface	1.0	23.3	20.3	6.02	6.02	6.01	80.2	80.2	8.87	8.88	8.88	8.88	8.88			
			Middle	6.4	22.5	20.9	5.80	5.81	5.91	80.1	80.2	10.70	10.8	10.8	10.8	10.8			
			Bottom	11.8	21.2	21.5	5.37	5.38	5.38	76.6	76.6	10.20	10.3	10.62	10.62	10.62			
16/04/09	0700-0715	23/Fine	Surface	1.0	22.3	18.5	6.27	6.27	6.26	71.8	71.9	11.00	10.9	10.9	10.9	10.9			
			Middle	6.7	21.7	19.1	5.65	5.64	5.64	71.9	71.9	10.70	10.70	10.70	10.70	10.70			
			Bottom	12.4	20.7	21.5	5.04	5.05	5.05	67.6	67.5	10.40	10.40	10.40	10.40	10.40			
	0800-0815	25/Cloudy	Surface	1.0	23.8	28.8	6.70	6.69	6.45	93.1	93.1	6.85	6.84	6.84	6.84	6.84			
			Middle	7.6	22.5	29.9	6.24	6.22	6.20	86.7	86.7	8.24	8.26	8.26	8.26	8.26			
			Bottom	14.2	22.4	30.4	5.81	5.83	5.83	86.1	86.1	8.27	8.27	8.27	8.27	8.27			
21/04/09	1700-1715	28/Cloudy	Surface	1.0	26.9	27.9	6.70	6.72	6.52	95.1	95.4	7.15	7.17	7.17	7.17	7.17			
			Middle	7.6	24.2	28.9	6.33	6.32	6.32	89.2	89.0	8.19	8.20	8.20	8.20	8.20			
			Bottom	14.2	23.8	29.9	5.95	5.93	5.91	83.8	83.6	8.97	8.96	8.96	8.96	8.96			

Monitoring Station : TM-FC2

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Monitoring Depth (m)	Temp (°C)	Salinity (ppt)			Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)		
					Value	Average	Value	Depth-average	Value	Average	Depth-average	Value	Average	Depth-average	Value	Average
23/04/09 1752-1804	23/CLOUDY	Surface	1.0	21.6	24.5	6.41	6.39	6.19	89.7	89.5	7.52	7.57	7.5	7.6	7.6	7.6
			Middle	7.5	20.6	27.1	5.99	5.98	83.8	83.7	6.83	6.89	7.21	7.5	7.4	7.7
			Bottom	14.0	20.4	29.5	5.97	5.98	83.6	83.6	6.95	6.89		7.3	7.4	7.7
25/04/09 0700-0716	22/Rainy	Surface	1.0	22.3	18.0	18.1	6.12	6.12	84.5	84.5	9.94	9.92		8.0	8.0	8.0
			Middle	7.0	22.4	18.8	18.9	5.42	5.41	84.5	84.5	9.90		10.0	9.8	9.8
			Bottom	13.0	21.5	20.9	21.0	4.89	4.89	67.8	67.8	10.90		10.0	10.4	10.4
28/04/09 0745-0800	20/Fine	Surface	1.0	22.7	19.9	20.0	6.07	6.08	84.5	84.5	10.60	10.5	10.47	10.5	10.5	10.4
			Middle	7.1	22.8	20.5	20.4	5.34	5.35	75.2	75.2	10.40		11.0	11.0	11.0
			Bottom	13.2	21.8	21.0	21.0	4.47	4.47	61.7	61.7	11.10		11.0	11.0	11.0
30/04/09 0920-0932	24/Sunny	Surface	1.0	21.5	27.0	27.0	6.81	6.80	95.0	94.9	8.58	8.63		8.5	8.4	8.4
			Middle	7.7	20.8	28.4	28.5	6.24	6.22	6.51	94.8	8.68		8.3	8.4	8.4
			Bottom	14.4	20.3	29.7	29.7	5.48	5.47	76.4	86.8	9.42	9.38	9.08	9.5	9.7

Mid-Flood Tide

Monitoring Station : TM-FM1

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Monitoring Depth (m)	Temp (°C)	Salinity (ppt)			Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)			
					Value	Average	Depth-average	Value	Average	Depth-average	Value	Average	Depth-average	Value	Average	Depth-average	
02/04/09	0928-0938	18/Cloudy	Surface	1.0	19.1	24.1	6.29	6.28	6.27	5.97	87.4	7.64	7.70	7.3	7.3	7.3	
			Middle	8.5	18.9	25.9	5.68	5.66	5.64	5.36	79.0	7.75	8.11	8.08	8.29	8.5	8.5
			Bottom	16.0	18.6	26.0	5.34	5.35	5.35	74.4	78.8	8.04	9.09	9.09	9.0	9.0	8.3
07/04/09	1721-1733	17/Cloudy	Surface	1.0	17.7	24.2	6.68	6.66	6.64	6.04	92.5	7.52	7.55	7.5	7.5	7.6	7.6
			Middle	8.2	17.3	27.5	6.02	6.03	6.04	5.71	92.1	7.58	7.58	7.5	7.5	7.7	7.7
			Bottom	15.4	17.0	29.3	5.69	5.69	5.67	5.69	83.7	6.25	6.30	6.98	6.98	7.0	7.1
09/04/09	0720-0735	22/Fine	Surface	1.0	21.5	28.2	6.49	6.49	6.51	5.90	78.8	7.08	7.10	7.08	7.08	7.5	7.5
			Middle	8.6	20.7	29.8	6.21	6.19	6.17	5.71	79.2	7.12	7.12	7.12	7.12	7.5	7.5
			Bottom	16.2	20.5	30.4	5.90	5.90	5.92	5.92	90.2	7.05	7.11	7.05	7.05	7.5	7.4
14/04/09	0905-0918	22/Fine	Surface	1.0	23.6	21.2	6.07	6.08	6.09	5.71	90.7	7.69	7.70	7.69	7.69	8.0	8.0
			Middle	9.1	22.3	21.8	5.34	5.34	5.33	5.33	86.3	9.02	9.04	8.65	8.65	9.3	9.3
			Bottom	17.2	20.7	22.5	5.08	5.10	5.12	5.10	86.0	9.05	9.05	9.05	9.05	9.2	9.2
16/04/09	0743-0759	23/Fine	Surface	1.0	22.5	18.4	6.50	6.49	6.47	6.47	81.4	9.19	9.21	9.21	9.21	9.5	9.5
			Middle	9.6	22.0	21.5	5.70	5.68	5.65	5.70	71.0	9.81	9.81	10.00	10.00	9.5	9.7
			Bottom	18.2	20.4	22.2	5.20	5.21	5.22	5.21	67.7	10.30	10.30	10.30	10.30	10.0	10.0
18/04/09	0720-0735	25/Cloudy	Surface	1.0	23.7	28.6	6.59	6.58	6.56	6.32	91.6	7.43	7.42	7.2	7.2	7.4	7.4
			Middle	8.6	22.6	29.8	6.09	6.07	6.05	5.74	84.6	8.53	8.55	8.28	8.28	8.5	8.5
			Bottom	16.2	22.4	29.9	6.05	6.05	6.05	5.70	84.0	8.56	8.56	8.88	8.88	9.2	9.4
21/04/09	1620-1635	28/Cloudy	Surface	1.0	26.9	27.8	6.57	6.56	6.54	6.37	93.2	7.02	7.04	7.04	7.04	7.3	7.3
			Middle	8.6	24.3	28.7	6.17	6.19	6.21	6.19	88.1	8.92	8.94	8.34	8.34	9.4	8.7
			Bottom	16.2	23.9	29.8	5.64	5.62	5.60	5.62	79.5	8.95	8.95	9.06	9.06	9.2	9.3

Mid-Flood Tide

Monitoring Station : TM-FM1

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Monitoring Depth (m)	Temp (°C)	Salinity (ppt)	Dissolved Oxygen (mg/L)	Dissolved Oxygen Saturation (%)	Turbidity (NTU)	Suspended Solids (mg/L)
				Value	Average	Depth-average	Value	Average	Depth-average
23/04/09 1718-1730	23/Cloudy	Surface	1.0	21.3	24.2	6.14	85.9	7.93	7.5
		Middle	7.9	20.5	24.2	6.10	85.5	7.99	7.5
		Bottom	14.8	20.5	26.7	5.56	77.8	8.26	8.5
25/04/09 0746-0800	22/Rainy	Surface	1.0	22.6	29.3	5.54	77.6	8.31	8.8
		Middle	8.2	22.8	17.8	4.97	69.6	7.54	7.3
		Bottom	15.4	21.3	17.8	4.93	69.2	7.62	7.5
28/04/09 0827-0841	20/Fine	Surface	1.0	23.0	21.1	5.46	83.9	10.5	10.3
		Middle	9.9	22.6	21.1	5.45	83.6	10.50	10.3
		Bottom	18.8	21.2	20.8	4.96	76.4	10.90	10.93
30/04/09 0848-0900	24/Sunny	Surface	1.0	21.6	26.1	4.96	76.2	10.9	10.5
		Middle	8.0	20.7	27.2	4.95	68.9	11.50	11.3
		Bottom	15.0	20.2	29.1	4.88	68.7	11.30	11.3

Mid-Flood Tide

Monitoring Station : TM-FM2

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Monitoring Depth (m)	Temp (°C)	Salinity (ppt)	Dissolved Oxygen (mg/L)	Dissolved Oxygen Saturation (%)	Turbidity (NTU)	Suspended Solids (mg/L)	
				Value	Average	Value	Depth-average	Value	Average	Depth-average
02/04/09 0940-0950	18/CLOUDY	Surface	1.0	19.1	24.0	6.24	6.22	86.6	8.29	8.5
		Middle	8.1	18.8	26.1	5.61	5.60	86.4	8.31	8.5
		Bottom	15.2	18.7	28.7	5.28	5.24	78.4	7.64	7.5
07/04/09 1738-1750	17/CLOUDY	Surface	1.0	17.6	24.1	6.74	6.73	78.2	7.53	7.5
		Middle	7.9	17.1	26.9	6.12	6.10	93.4	7.82	8.13
		Bottom	14.8	17.0	29.2	5.94	5.93	93.2	7.88	9.0
09/04/09 0740-0755	22/FINE	Surface	1.0	21.4	28.4	6.60	6.62	87.8	8.48	8.5
		Middle	8.7	20.6	29.8	6.13	6.15	87.4	8.55	8.5
		Bottom	16.4	20.4	30.5	5.87	5.86	82.3	8.52	8.5
14/04/09 0847-0900	22/FINE	Surface	1.0	23.9	21.1	6.13	6.14	92.0	7.21	7.5
		Middle	7.5	22.6	21.2	5.71	5.69	82.1	7.14	7.5
		Bottom	14.0	21.0	21.8	5.30	5.28	87.6	7.07	7.5
16/04/09 0724-0738	23/FINE	Surface	1.0	22.3	18.3	6.38	6.37	92.2	7.07	7.5
		Middle	8.1	22.0	20.9	5.80	5.80	82.2	6.42	6.51
		Bottom	15.2	20.5	21.7	4.95	4.95	82.1	6.60	6.51
18/04/09 0740-0755	25/CLOUDY	Surface	1.0	23.8	28.8	6.43	6.42	87.4	7.21	7.5
		Middle	8.7	22.5	29.9	6.11	6.07	87.4	7.14	7.5
		Bottom	16.4	22.4	30.4	5.79	5.77	87.4	7.07	7.5
21/04/09 1640-1655	28/CLOUDY	Surface	1.0	26.9	27.8	6.62	6.59	94.0	9.38	9.5
		Middle	8.7	24.3	28.8	6.43	6.42	93.5	9.95	9.5
		Bottom	16.4	23.8	29.8	5.70	5.72	90.8	9.11	9.5

Monitoring Station : TM-FM2

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Monitoring Depth (m)	Temp (°C)	Salinity (ppt)			Dissolved Oxygen (mg/L)			Dissolved Oxygen Saturation (%)			Turbidity (NTU)			Suspended Solids (mg/L)		
					Value	Average	Depth-average	Value	Average	Depth-average	Value	Average	Depth-average	Value	Average	Depth-average	Value	Average	Depth-average
23/04/09 1735-1746	23/Cloudy	Surface	1.0	21.4	24.3	6.26	6.25	5.97	87.4	87.3	6.66	6.71	6.7	6.9	6.9	6.9	7.0	7.0	7.0
		Middle	8.0	20.5	26.8	5.70	5.68	5.66	79.8	79.6	7.06	7.08	6.92	7.5	7.5	7.8	8.0	8.0	7.8
		Bottom	15.0	20.4	29.2	5.12	5.10	5.11	71.7	71.6	6.94	6.97		7.5	7.5	7.5			7.4
25/04/09 0726-0741	22/Rainy	Surface	1.0	22.2	17.5	6.36	6.36	6.36	88.4	88.4	10.00	10.1		10.0	10.0	10.0	10.0	10.0	10.0
		Middle	7.9	22.5	18.5	5.74	5.74	5.74	88.3	88.3	10.20			10.0	10.0		10.0		
		Bottom	14.8	21.7	20.6	20.7	20.7	20.7	79.8	79.8	11.20	11.4	11.10	10.5	10.5	10.5	10.5	10.5	10.6
28/04/09 0808-0822	20/Fine	Surface	1.0	22.8	20.7	6.05	6.05	6.05	84.1	84.1	9.50	9.48		9.5	9.5	9.7			
		Middle	8.5	22.6	21.0	5.31	5.31	5.35	73.3	73.3	10.30	10.5	10.36	10.0	10.0	10.0	10.0	10.0	10.1
		Bottom	16.0	21.2	21.7	4.40	4.41	4.41	60.7	60.7	10.60	10.5		10.5	10.5				
30/04/09 0905-0912	24/Sunny	Surface	1.0	21.5	26.3	6.64	6.62	6.60	92.6	92.4	9.41	9.39		9.5	9.5	9.7			
		Middle	7.9	20.9	27.6	6.15	6.14	6.38	92.2	92.2	9.37			9.8	9.8				
		Bottom	14.8	20.4	29.3	5.71	5.69	5.67	85.8	85.7	8.82	8.89	9.39	8.5	8.5	8.5	9.4		
									85.6	85.6	8.95								
									79.6	79.4	9.93	9.89		10.0	10.0				
									79.2	79.2	9.84								
											10.0								

Mid-Flood Tide

Monitoring Station : TM-FC1

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Monitoring Depth (m)	Temp (°C)	Salinity (ppt)	Dissolved Oxygen (mg/L)	Dissolved Oxygen Saturation (%)	Turbidity (NTU)	Suspended Solids (mg/L)
				Value	Average	Depth-average	Value	Average	Depth-average
02/04/09 0910-0922	18/Cloudy	Surface	1.0	19.2	24.2	6.15	6.13	85.6	7.29
		Middle	12.9	19.0	24.4	6.11	5.83	85.2	7.33
		Bottom	24.8	18.7	26.2	5.54	5.53	77.1	9.24
07/04/09 1700-1712	17/Cloudy	Surface	1.0	18.0	26.3	5.52	5.21	76.9	9.40
		Middle	12.6	17.5	28.1	5.19	5.21	72.8	8.52
		Bottom	24.2	17.1	23.6	6.49	6.48	72.4	8.39
09/04/09 0700-0715	22/Fine	Surface	1.0	21.5	26.4	6.47	6.19	89.9	7.65
		Middle	12.1	20.8	26.4	5.92	5.90	82.0	7.72
		Bottom	23.2	20.6	28.1	6.53	6.52	81.8	7.23
14/04/09 0926-0938	22/Fine	Surface	1.0	23.6	28.1	6.50	6.32	81.6	8.29
		Middle	10.6	21.9	29.6	6.10	6.12	76.6	7.80
		Bottom	20.2	20.6	29.6	6.14	5.52	76.4	7.78
16/04/09 0805-0820	23/Fine	Surface	1.0	22.7	30.2	5.75	5.73	90.7	9.05
		Middle	12.4	21.8	30.1	5.71	5.73	79.3	10.05
		Bottom	20.3	22.8	20.8	5.98	5.99	79.5	10.30
18/04/09 0700-0715	25/Cloudy	Surface	1.0	23.8	21.0	5.99	5.99	79.7	10.30
		Middle	12.0	22.5	22.9	4.86	4.87	64.6	10.80
		Bottom	23.0	20.2	22.4	5.08	5.10	70.2	10.90
21/04/09 1600-1615	28/Cloudy	Surface	1.0	22.7	18.9	6.34	6.31	84.3	10.90
		Middle	12.0	21.8	19.1	6.28	6.28	82.9	11.00
		Bottom	23.8	20.2	22.3	5.12	6.02	76.3	11.40
		Surface	1.0	23.8	21.9	5.74	5.72	75.7	12.00
		Middle	12.0	22.5	29.6	6.15	6.13	68.1	12.50
		Bottom	23.0	22.3	29.7	6.11	6.11	68.5	12.60
		Surface	1.0	23.8	28.4	6.67	6.66	92.7	12.00
		Middle	12.0	22.5	29.7	6.64	6.39	92.2	12.00
		Bottom	23.0	22.3	30.2	5.84	5.86	85.4	12.00
		Surface	1.0	26.8	27.6	6.60	6.62	93.7	12.00
		Middle	12.0	24.2	28.7	6.30	6.32	94.2	12.00
		Bottom	23.0	24.0	29.6	5.95	5.97	89.4	12.00

Mid-Flood Tide

Monitoring Station : TM-FC1

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Monitoring Depth (m)	Temp (°C)	Salinity (ppt)			Dissolved Oxygen (mg/L)			Dissolved Oxygen Saturation (%)			Turbidity (NTU)			Suspended Solids (mg/L)		
					Value	Average	Depth-average	Value	Average	Depth-average	Value	Average	Depth-average	Value	Average	Depth-average	Value	Average	Depth-average
23/04/09 1700-1712	23/Cloudy	Surface	1.0	21.7	24.5	6.32	6.31	6.02	88.5	88.4	88.4	8.18	8.23	8.23	8.5	8.4	8.4		
			24.7	24.7	24.6	6.30	6.30	6.02	88.3	88.3	88.3	8.18	8.28	8.28	8.2	8.2	8.2		
			26.2	26.2	26.2	5.74	5.72	5.72	80.4	80.4	80.2	9.41	9.46	9.46	9.5	9.5	9.5		
	Bottom	Surface	20.6	29.0	28.9	5.23	5.23	5.24	73.6	73.5	73.6	8.06	8.11	8.11	8.5	8.4	8.4		
			18.3	18.3	18.2	6.20	6.19	6.19	86.2	86.0	86.0	11.30	11.4	11.4	8.2	8.2	8.2		
			18.0	18.0	18.0	6.17	6.17	5.87	85.8	85.8	85.8	11.50	11.50	11.50	10.5	10.6	10.6		
25/04/09 0807-0822	22/Rainy	Middle	11.4	22.4	20.1	5.55	5.55	5.55	77.1	77.1	77.1	10.80	10.9	10.9	10.7	10.7	10.7		
			20.1	20.1	20.1	5.55	5.55	5.55	77.1	77.1	77.1	10.90	10.90	10.90	10.3	10.3	10.3		
			21.5	21.5	21.6	5.08	5.08	5.08	69.6	69.6	69.6	11.30	11.30	11.30	10.3	10.3	10.3		
	Bottom	Surface	20.6	21.6	21.6	5.08	5.08	5.08	69.6	69.6	69.6	11.90	11.9	11.9	11.5	11.6	11.6		
			20.5	20.5	20.5	5.98	5.97	5.97	82.5	82.5	82.3	9.81	9.81	9.81	11.7	11.7	11.7		
			20.5	20.5	20.5	5.95	5.95	5.95	82.0	82.0	82.0	9.80	9.80	9.80	9.5	9.6	9.6		
28/04/09 0849-0902	20/Fine	Middle	12.5	22.5	20.9	5.18	5.18	5.19	71.5	71.5	71.5	9.90	9.87	9.87	9.7	9.7	9.7		
			20.8	20.8	20.9	5.20	5.20	5.20	71.8	71.8	71.8	71.7	71.7	71.7	10.0	10.0	10.0		
			21.0	21.0	21.3	4.20	4.23	4.23	58.0	58.0	58.4	10.40	10.40	10.40	10.4	10.4	10.4		
	Bottom	Surface	21.3	21.3	21.3	4.25	4.25	4.25	58.8	58.8	58.8	10.40	10.40	10.40	9.7	9.9	9.9		
			26.4	26.4	26.4	6.73	6.71	6.71	93.9	93.9	93.7	10.20	10.20	10.20	10.0	10.0	10.0		
			27.5	27.6	27.6	6.69	6.69	6.69	93.5	93.5	93.7	10.00	10.00	10.00	9.5	9.4	9.4		
30/04/09 0830-0842	24/Sunny	Middle	21.0	27.6	27.6	6.08	6.07	6.07	84.7	84.6	84.5	9.64	9.70	9.70	9.70	10.0	10.0		
			27.6	27.6	27.6	6.06	6.06	6.06	84.5	84.5	84.5	9.75	9.75	9.75	10.0	10.0	10.0		
			29.2	29.2	29.2	5.28	5.26	5.26	73.6	73.6	73.4	9.29	9.31	9.31	9.5	9.4	9.4		
			29.1	29.1	29.1	5.24	5.24	5.24	73.2	73.2	73.2	9.33	9.33	9.33	9.3	9.3	9.3		

Mid-Ebb Tide**Monitoring Station :****TM-FC1**

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Monitoring Depth (m)	Temp (°C)	Salinity (ppt)	Dissolved Oxygen (mg/L)	Dissolved Oxygen Saturation (%)	Turbidity (NTU)	Suspended Solids (mg/L)
				Value	Average	Depth-average	Value	Average	Depth-average
02/04/09	1700-1712	18/Cloudy	Surface	1.0	18.7	25.7	6.68	6.67	92.5
			Middle	11.2	18.1	25.7	6.66	6.43	92.3
			Bottom	21.4	17.4	29.3	5.74	5.73	79.5
07/04/09	1110-1122	18/Cloudy	Surface	1.0	17.6	24.4	6.27	6.25	85.8
			Middle	11.5	17.4	25.9	6.23	5.99	85.4
			Bottom	22.0	17.1	26.0	5.71	5.72	79.3
09/04/09	1200-1215	22/Fine	Surface	1.0	21.6	28.2	6.70	6.72	79.7
			Middle	11.2	20.9	29.8	6.25	6.23	74.5
			Bottom	22.6	20.7	30.2	5.93	5.92	74.1
14/04/09	1603-1618	27/Fine	Surface	1.0	25.3	21.5	5.94	5.95	93.1
			Middle	10.5	22.8	22.4	5.20	5.21	86.3
			Bottom	20.0	21.2	23.1	4.81	4.82	81.8
16/04/09	1808-1822	25/Dizzle	Surface	1.0	24.1	19.4	6.22	6.22	81.4
			Middle	11.8	22.9	21.7	5.68	5.68	78.8
			Bottom	22.6	20.7	22.3	5.04	5.02	64.0
18/04/09	1700-1715	25/Cloudy	Surface	1.0	24.2	28.1	6.73	6.72	90.7
			Middle	11.7	22.9	29.6	6.25	6.23	67.3
			Bottom	22.4	22.7	30.1	5.93	5.92	66.8
21/04/09	1030-1045	28/Cloudy	Surface	1.0	26.5	27.4	6.39	6.37	90.1
			Middle	11.6	24.1	28.6	6.12	6.14	86.2
			Bottom	22.2	23.6	29.4	5.75	5.77	81.0

Monitoring Station :

TM-FC1

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Monitoring Depth (m)	Temp (°C)	Salinity (ppt)			Dissolved Oxygen (mg/L)			Dissolved Oxygen Saturation (%)			Turbidity (NTU)			Suspended Solids (mg/L)		
					Value	Average	Value	Depth-average	Value	Average	Value	Depth-average	Value	Depth-average	Value	Average	Value	Depth-average	Value
23/04/09 1145-1157	26/Cloudy	Surface	1.0	25.6	25.2	25.2	6.06	6.04	5.87	84.9	84.7	80.2	80.1	7.69	7.66	7.86	8.32	8.28	8.3
		Middle	12.0	24.2	25.2	27.0	5.71	5.70		80.2	80.0	7.69	7.63	7.63	7.63		9.0	9.0	9.0
		Bottom	23.0	23.9	29.5	29.5	4.84	4.82	4.82	67.9	67.7	67.5	67.5	7.58	7.61		7.5	7.5	7.6
25/04/09 1340-1355	23/Rainy	Surface	1.0	23.2	17.2	17.2	6.10	6.08		84.3	84.0	83.7	83.7	10.70	10.70		10.0	10.0	10.0
		Middle	11.7	22.5	19.5	19.5	5.63	5.63	5.85	78.1	78.2	78.3	78.3	10.70	10.70		10.0	10.0	10.0
		Bottom	22.4	20.3	20.8	21.0	20.9	20.9	5.02	5.02	5.02	70.3	70.3	70.3	70.3	11.50	11.50		10.95
28/04/09 1536-1550	25/Fine	Surface	1.0	24.8	20.9	20.9	5.93	5.92		81.8	81.8	81.8	81.8	9.77	9.77		9.5	9.5	9.7
		Middle	11.8	23.1	21.2	21.3	5.10	5.09	5.50	70.4	70.4	70.0	70.0	9.92	9.92		9.8	9.8	9.7
		Bottom	22.6	21.7	21.7	21.7	4.15	4.15	4.15	57.7	57.8	57.8	57.8	10.20	10.20		9.5	9.5	9.7
30/04/09 1630-1643	26/Sunny	Surface	1.0	23.3	27.4	27.4	6.25	6.24		87.7	87.6	87.5	87.5	8.48	8.48		8.2	8.2	8.4
		Middle	11.5	22.8	28.3	28.5	5.34	5.32	5.30	74.9	74.7	74.5	74.5	9.39	9.39		8.5	8.5	8.4
		Bottom	22.0	22.5	29.6	29.8	4.82	4.81	4.80	67.6	67.5	67.4	67.4	8.60	8.60		8.8	8.8	8.9

Mid-Ebb Tide

Monitoring Station : TM-FM1

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Monitoring Depth (m)	Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)		Dissolved Oxygen Saturation (%)		Turbidity (NTU)		Suspended Solids (mg/L)	
					Value	Average	Value	Average	Depth-average	Value	Average	Value	Depth-average	Value
02/04/09	1720-1732	18/Cloudy	Surface	1.0	18.3	25.4	6.59	6.57	6.34	91.0	7.48	7.50	7.7	7.6
			Middle	7.9	18.1	26.9	6.55	6.12	6.11	7.51	7.51	7.5	8.5	8.5
			Bottom	14.8	17.7	29.0	5.79	5.83	5.81	84.7	84.6	83.3	8.36	7.98
	1128-1140	18/Cloudy	Surface	1.0	17.7	24.6	6.19	6.17	6.18	84.5	84.5	83.9	8.39	8.5
			Middle	7.6	17.5	26.1	5.76	5.78	5.81	80.3	80.5	81.2	8.09	8.2
			Bottom	14.2	17.2	29.1	5.29	5.27	5.28	86.3	86.2	7.42	7.47	7.5
07/04/09	1220-1235	22/Fine	Surface	1.0	21.7	28.4	6.67	6.66	6.66	86.1	7.51	7.51	7.5	7.5
			Middle	8.4	21.0	29.9	6.30	6.27	6.29	73.8	73.7	7.24	7.22	7.5
			Bottom	15.8	20.7	30.4	5.71	5.69	5.69	92.7	92.5	8.07	7.73	7.47
	1541-1555	27/Fine	Surface	1.0	25.4	21.8	6.11	6.10	6.11	80.5	87.5	8.09	8.0	7.7
			Middle	8.7	23.4	22.4	5.40	5.40	5.39	87.1	87.3	8.90	8.92	8.81
			Bottom	16.4	21.9	22.9	5.06	5.07	5.07	80.4	80.5	8.93	8.92	8.81
14/04/09	1744-1800	25/Dizzle	Surface	1.0	24.2	18.9	6.48	6.48	6.48	86.1	71.8	71.7	9.90	9.90
			Middle	9.2	23.0	21.8	5.75	5.74	5.74	78.7	78.5	9.44	9.43	9.43
			Bottom	17.4	20.6	22.4	5.09	5.13	5.11	78.2	78.2	9.41	9.41	9.41
	1720-1735	25/Cloudy	Surface	1.0	24.2	28.7	6.61	6.61	6.61	86.1	67.4	10.50	10.6	10.6
			Middle	8.3	23.0	29.8	6.57	6.57	6.57	67.5	67.5	10.60	10.60	10.6
			Bottom	15.6	22.7	30.4	5.85	5.88	5.87	68.3	68.6	10.50	10.50	10.50
18/04/09	1050-1105	28/Cloudy	Surface	1.0	26.6	27.6	6.47	6.40	6.44	6.31	61.3	81.5	81.5	11.40
			Middle	8.3	24.0	28.8	6.20	6.17	6.19	88.0	87.8	8.43	8.45	7.99
			Bottom	15.6	23.5	29.6	5.70	5.74	5.72	80.3	80.6	8.89	8.88	8.86

Monitoring Station : TM-FM1

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Monitoring Depth (m)	Temp (°C)	Salinity (ppt)			Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)		
					Value	Average	Depth-average	Value	Average	Depth-average	Value	Average	Depth-average	Value	Average	Depth-average
23/04/09	1203-1215	26/Cloudy	Surface	1.0	25.2	24.3	24.4	5.96	5.95	5.75	83.6	724	7.30	7.5	7.5	7.5
			Middle	7.7	24.0	27.2	27.2	5.94	5.56	5.54	78.0	735	7.35	7.5	7.5	7.5
			Bottom	14.4	24.0	29.6	29.6	5.52	4.89	4.88	77.8	761	7.65	7.60	8.0	8.0
25/04/09	1317-1332	23/Rainy	Surface	1.0	23.0	17.3	17.3	6.05	6.05	5.87	68.6	788	7.86	8.2	8.4	8.4
			Middle	8.6	22.8	17.6	17.6	5.68	5.68	5.87	68.4	784	7.84	8.5	8.5	8.4
			Bottom	16.2	20.5	20.8	20.7	5.63	5.63	5.68	83.2	10.30	10.3	10.2	10.1	10.1
28/04/09	1512-1528	25/Fine	Surface	1.0	24.9	20.5	20.5	5.96	5.94	5.61	79.1	9.95	9.97	10.46	10.5	10.4
			Middle	8.9	23.4	20.6	20.8	5.28	5.27	5.26	79.1	9.98	9.98	10.5	10.5	10.5
			Bottom	16.8	22.1	20.9	20.9	4.34	4.34	4.34	69.4	69.7	11.1	10.90	10.5	10.6
30/04/09	1650-1702	26/Sunny	Surface	1.0	23.1	27.2	27.2	6.14	6.12	5.91	86.1	748	7.52	7.5	7.8	7.8
			Middle	7.6	22.7	28.4	28.5	6.10	5.70	5.69	85.7	755	7.55	8.0	8.0	8.0
			Bottom	14.2	22.2	29.9	30.0	5.25	5.23	5.21	79.7	79.8	8.68	8.71	9.0	9.0

Mid-Ebb Tide

Monitoring Station : TM-FM2

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Monitoring Depth (m)	Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)		Dissolved Oxygen Saturation (%)		Turbidity (NTU)		Suspended Solids (mg/L)		
					Value	Average	Value	Average	Depth-average	Value	Average	Depth-average	Value	Average	Depth-average
02/04/09	1736-1748	18/CLOUDY	Surface	1.0	18.2	25.2	6.52	6.51	6.23	90.3	90.2	8.01	7.98	8.0	8.1
			Middle	7.5	17.9	26.8	5.97	5.95	5.53	82.7	82.4	9.06	7.94	8.2	8.3
			Bottom	14.0	17.7	28.9	5.54	5.52	5.53	76.7	76.6	8.95	7.18	9.01	9.3
	1144-1156	18/CLOUDY	Surface	1.0	17.7	24.5	6.03	6.01	84.1	83.9	83.7	7.96	7.90	8.07	9.3
			Middle	7.5	17.3	26.4	5.60	5.61	5.81	78.4	78.3	8.52	8.43	7.9	7.9
			Bottom	14.0	17.1	28.9	5.14	5.12	5.12	71.7	71.5	7.25	7.22	7.5	7.4
09/04/09	1240-1255	22/FINE	Surface	1.0	21.8	28.4	6.74	6.72	6.49	93.6	93.4	8.13	8.16	8.5	8.5
			Middle	8.5	21.1	30.0	6.27	6.26	6.26	93.1	93.0	8.15	8.14	8.5	8.5
			Bottom	16.0	20.8	30.5	5.87	5.86	5.86	86.7	86.9	8.86	8.89	8.5	8.5
	1522-1535	27/FINE	Surface	1.0	25.7	21.6	6.09	6.08	6.08	80.2	80.1	10.00	10.20	7.21	7.2
			Middle	7.2	23.6	22.8	5.66	5.66	5.87	80.0	80.1	10.00	10.1	7.25	7.2
			Bottom	13.4	22.2	22.7	5.31	5.31	5.31	75.1	75.1	10.40	10.20	7.16	7.1
16/04/09	1723-1738	25/DIZZLE	Surface	1.0	24.4	19.1	6.32	6.33	6.33	84.0	84.1	10.00	10.20	7.21	7.2
			Middle	7.7	23.4	21.2	5.82	5.82	5.82	70.6	70.5	9.92	9.92	7.25	7.2
			Bottom	14.4	20.9	22.0	4.91	4.91	4.91	65.0	65.0	10.40	10.50	7.16	7.1
	1740-1755	25/CLOUDY	Surface	1.0	24.1	28.7	6.77	6.76	6.76	94.1	93.9	7.54	7.53	9.17	9.17
			Middle	8.4	22.8	29.9	6.30	6.32	6.32	83.6	83.6	7.52	7.52	9.0	9.0
			Bottom	15.8	22.6	30.4	5.97	5.95	5.95	87.3	87.1	8.14	8.16	8.12	8.12
21/04/09	1110-1125	28/CLOUDY	Surface	1.0	26.5	27.8	6.42	6.41	6.41	91.1	91.0	6.58	6.57	7.5	7.5
			Middle	8.4	23.9	28.9	6.19	6.17	6.17	87.2	87.0	8.73	8.72	7.3	7.3
			Bottom	15.8	23.4	29.7	5.67	5.66	5.66	79.9	79.9	9.14	9.16	9.0	9.0

Mid-Ebb Tide

東業檢測有限公司
ETS-TEST CONSULT LIMITED

Monitoring Station : TM-FM2

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Monitoring Depth (m)	Temp (°C)	Salinity (ppt)			Dissolved Oxygen (mg/L)			Dissolved Oxygen Saturation (%)			Turbidity (NTU)			Suspended Solids (mg/L)			
					Value	Average	Depth-average	Value	Average	Depth-average	Value	Average	Depth-average	Value	Average	Depth-average	Value	Average	Depth-average	
23/04/09 1218-1230	26/Cloudy	Surface	1.0	25.0	24.8	24.8	6.13	6.11	5.71	85.6	85.8	75.9	7.61	7.63	7.5	7.5	7.5	7.5		
			Middle	7.6	24.1	27.1	5.32	5.31	74.7	74.6	8.32	8.40	8.36	7.89	8.5	8.7	8.7	8.7	8.0	
			Bottom	14.2	23.8	29.7	4.72	4.70	4.70	66.4	66.2	7.64	7.71	7.71	7.8	7.8	7.9	7.8	7.9	
25/04/09 1256-1311	23/Rainy	Surface	1.0	22.9	17.0	17.0	6.25	6.26	6.26	87.5	87.6	9.95	9.95	9.95	9.8	9.8	9.9	9.8	9.9	
			Middle	7.8	22.6	18.3	5.79	5.80	6.03	81.1	81.3	10.80	10.80	10.8	10.78	10.8	10.8	10.78	10.8	
			Bottom	14.6	21.6	20.4	20.5	4.95	4.96	4.96	68.7	68.8	11.50	11.50	11.7	11.3	11.3	11.4	11.5	11.4
28/04/09 1450-1506	25/Fine	Surface	1.0	25.1	20.9	20.9	6.01	6.01	6.01	83.3	83.3	9.25	9.25	9.25	9.3	9.3	9.3	9.3	9.3	
			Middle	8.0	23.5	21.3	21.4	5.35	5.35	5.35	73.9	73.9	9.81	9.81	9.81	9.5	9.5	9.7	9.5	9.7
			Bottom	15.0	22.4	21.9	21.9	4.30	4.33	4.33	59.1	59.5	10.80	10.80	10.8	10.3	10.3	10.3	10.2	10.3
30/04/09 1708-1720	26/Sunny	Surface	1.0	23.2	27.1	27.1	6.08	6.07	5.95	85.3	86.2	7.93	7.96	7.96	9.3	9.3	9.3	9.2	9.3	
			Middle	7.4	22.5	28.9	5.84	5.82	5.82	81.9	81.7	8.28	8.30	8.30	8.14	8.0	8.1	8.2	8.1	8.8
			Bottom	13.8	22.3	30.1	4.96	4.95	4.95	69.6	69.4	8.21	8.15	8.15	9.3	9.3	9.3	9.0	9.2	

Mid-Ebb Tide

Monitoring Station : TM-FC2

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Monitoring Depth (m)	Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)		Dissolved Oxygen Saturation (%)		Turbidity (NTU)		Suspended Solids (mg/L)			
					Value	Average	Value	Average	Depth-average	Value	Average	Value	Depth-average	Value	Average	Depth-average
02/04/09 1752-1804	18/CLOUDY	Surface	1.0	18.4	26.0	6.61	6.59	6.47	91.5	91.3	6.43	7.5	7.4			
		Middle	7.4	18.0	25.9	6.57	6.35	6.34	91.1	6.55	6.49	7.2	7.4			
		Bottom	13.8	17.8	27.4	27.3	6.33	5.94	5.92	87.9	87.8	8.72	7.60	9.0	9.2	8.3
	18/CLOUDY	Surface	1.0	18.0	29.6	5.90	5.92	5.94	87.7	81.8	8.66	7.69	9.3	9.3	9.2	8.3
		Middle	8.0	17.5	24.7	24.7	6.34	6.33	6.15	88.5	88.4	6.49	6.51	6.8	6.9	
		Bottom	15.0	17.2	25.8	5.94	5.98	5.96	83.4	83.2	7.91	8.00	7.0	7.0		
07/04/09 1202-1214	22/FINE	Surface	1.0	21.8	28.8	5.70	5.69	5.69	79.5	79.4	7.35	7.31	8.5	8.4	7.8	
		Middle	7.3	21.1	30.1	30.2	6.40	6.44	6.69	79.3	79.3	7.50	7.43	8.0	8.0	
		Bottom	13.6	20.8	30.5	30.5	5.95	5.97	5.97	94.9	94.7	7.58	7.51	8.0	8.0	
	27/FINE	Surface	1.0	25.9	21.2	21.2	6.08	6.07	6.62	88.9	88.9	8.67	8.66	8.43	8.4	8.6
		Middle	6.3	23.7	21.9	22.0	5.77	5.77	6.42	89.5	89.2	8.65	8.66	9.0	9.0	
		Bottom	11.6	22.4	22.4	22.3	5.98	5.98	5.97	82.7	82.9	9.04	9.06	9.3	9.4	
14/04/09 1500-1514	25/DIZZLE	Surface	1.0	24.4	19.4	19.3	6.21	6.05	6.07	80.2	80.0	10.40	10.4	10.5	10.5	10.5
		Middle	6.3	23.7	21.9	22.0	5.76	5.77	5.92	79.7	76.0	11.20	11.20	10.67	11.0	11.0
		Bottom	11.6	22.4	22.4	22.3	5.41	5.41	5.41	72.4	72.3	10.40	10.5	11.0	11.0	11.0
	1723-1738	Surface	1.0	19.3	19.4	19.3	6.21	6.21	6.21	82.6	82.5	9.91	9.92	9.5	9.6	9.6
		Middle	6.3	23.0	19.9	19.9	5.70	5.71	5.71	75.7	75.8	9.85	9.86	10.21	10.5	10.5
		Bottom	11.6	21.1	21.8	21.8	5.10	5.09	5.10	68.2	68.1	10.80	10.9	11.0	11.0	11.0
16/04/09 1800-1815	25/CLOUDY	Surface	1.0	24.3	28.8	28.8	6.82	6.80	6.05	94.7	94.5	7.29	7.30	7.7	7.9	7.9
		Middle	7.2	22.8	29.8	29.9	6.44	6.42	6.61	88.8	88.6	8.43	8.46	8.15	8.5	8.6
		Bottom	13.4	22.6	30.5	30.5	6.03	6.05	6.05	83.2	83.5	8.72	8.71	9.3	9.4	
	28/CLOUDY	Surface	1.0	26.4	27.8	27.8	6.57	6.54	6.46	93.2	93.0	7.04	7.06	7.2	7.2	
		Middle	7.2	23.8	29.0	29.1	6.34	6.36	6.36	90.1	90.4	8.62	8.64	8.25	8.8	8.6
		Bottom	13.4	23.4	29.7	29.7	5.88	5.87	5.87	83.4	83.2	9.09	9.06	9.3	9.4	8.5

Mid-Ebb Tide

Monitoring Station : TM-FC2


Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Monitoring Depth (m)	Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)		Dissolved Oxygen Saturation (%)		Turbidity (NTU)		Suspended Solids (mg/L)		
					Value	Average	Value	Average	Depth-average	Value	Average	Depth-average	Value	Average	Depth-average
23/04/09 1235-1248	26/Cloudy	26/Cloudy	Surface	1.0	25.1	25.0	6.25	6.24	87.7	87.6	7.57	7.54	7.5	7.6	7.6
			Middle	7.0	24.3	25.0	6.23	5.82	87.5	7.50	7.50	7.50	7.7	7.7	7.7
			Bottom	13.0	23.9	27.6	5.42	5.40	76.1	75.9	6.89	6.92	7.50	7.2	7.3
25/04/09 1230-1246	23/Rainy	23/Rainy	Surface	1.0	22.8	29.4	4.93	4.92	69.2	69.1	7.99	8.04	8.04	8.5	8.5
			Middle	6.6	22.5	29.6	4.91	4.91	69.0	69.0	8.08	8.08	8.04	8.5	8.5
			Bottom	12.2	21.4	16.9	6.15	6.15	85.1	85.1	9.91	9.91	9.91	9.5	9.6
28/04/09 1430-1444	25/Fine	25/Fine	Surface	1.0	25.2	18.5	5.49	5.50	77.0	77.1	10.10	10.2	10.22	10.3	10.2
			Middle	6.5	23.0	20.0	4.85	4.85	67.1	67.1	10.40	10.6	10.6	10.5	10.8
			Bottom	12.0	22.6	20.5	6.06	6.05	84.3	84.2	9.44	9.45	9.45	11.0	10.8
30/04/09 1728-1740	26/Sunny	26/Sunny	Surface	1.0	23.4	27.0	6.37	6.35	84.0	84.0	9.45	9.45	9.45	9.3	9.3
			Middle	7.3	22.8	28.4	6.33	6.12	72.8	72.8	9.34	9.35	9.35	9.5	9.5
			Bottom	13.6	22.1	29.6	5.90	5.89	82.8	82.7	9.51	9.38	9.38	9.6	9.6

Appendix C3


Graphical Plots of Impact Marine Water Quality Monitoring Data



Dissolved Oxygen (Surface & Middle) at Mid-Flood Tide

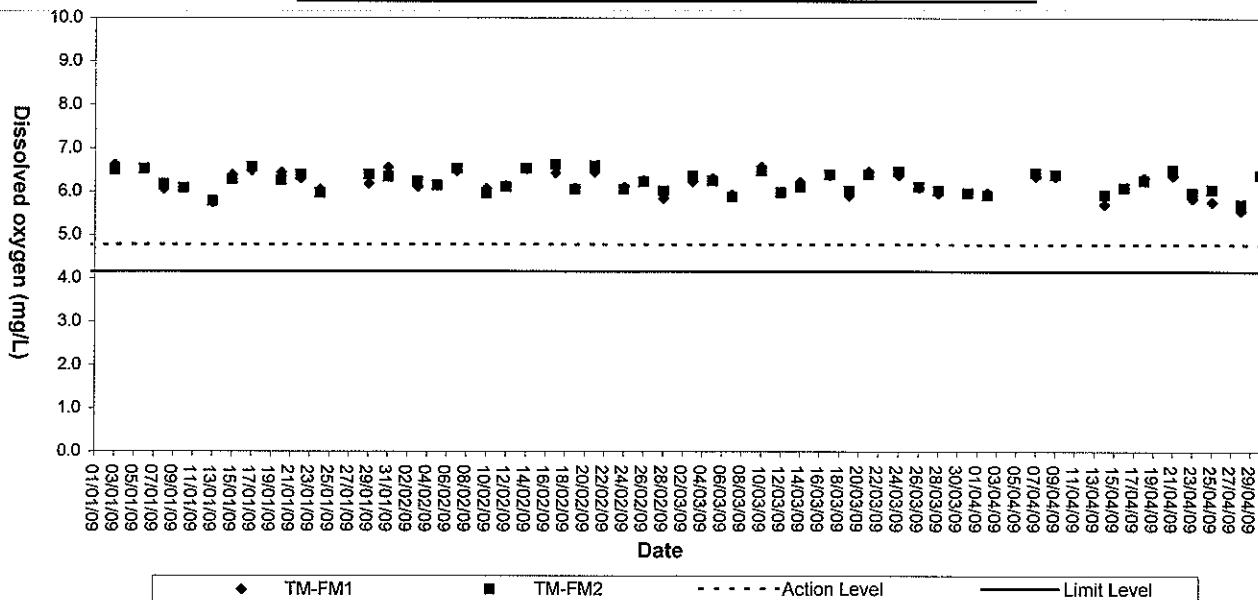


Dissolved Oxygen (Surface & Middle) at Mid-Ebb Tide

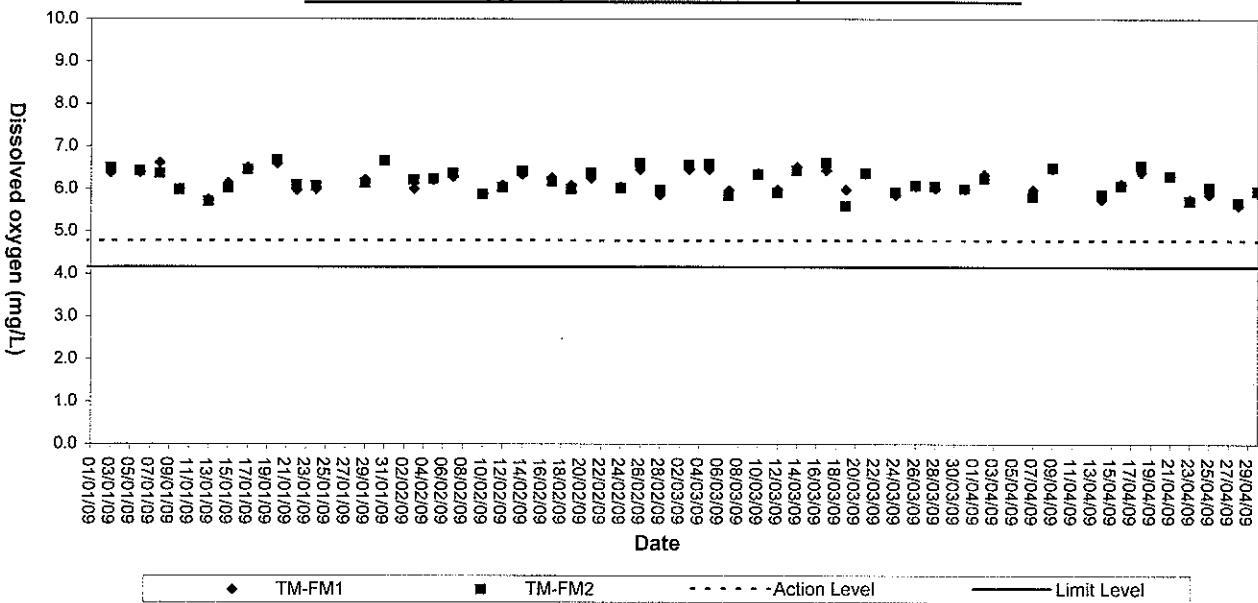




Dissolved Oxygen (Bottom) at Mid-Flood Tide

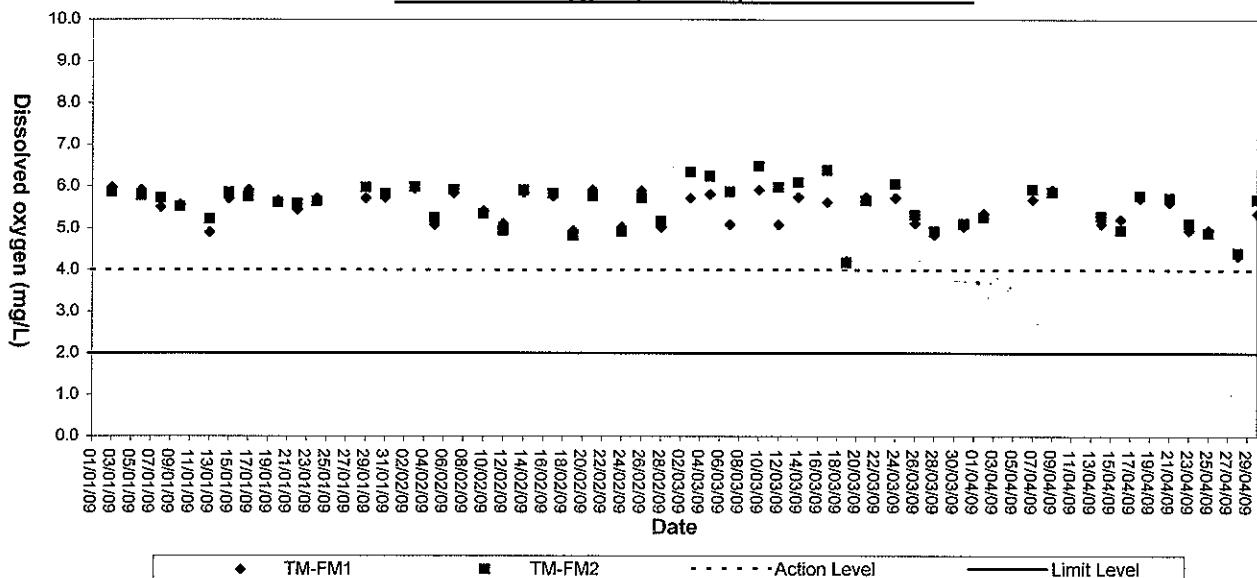


Dissolved Oxygen (Bottom) at Mid-Ebb Tide

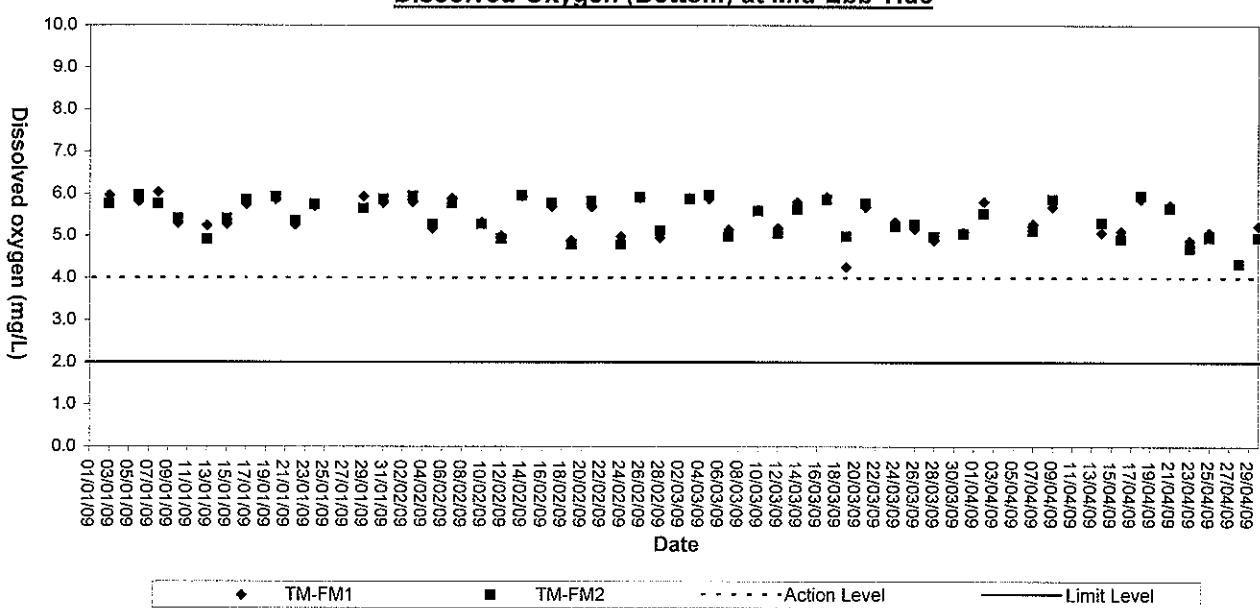




Turbidity (Depth-average) at Mid-Flood Tide

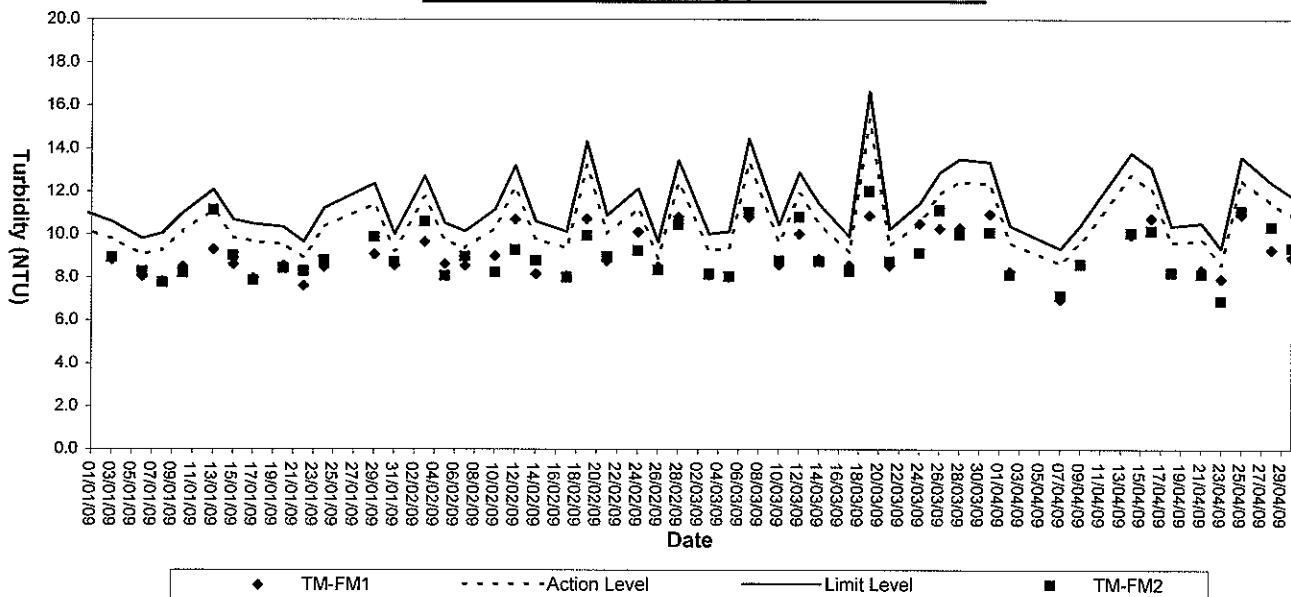


Turbidity(Depth-average) at Mid-Ebb Tide

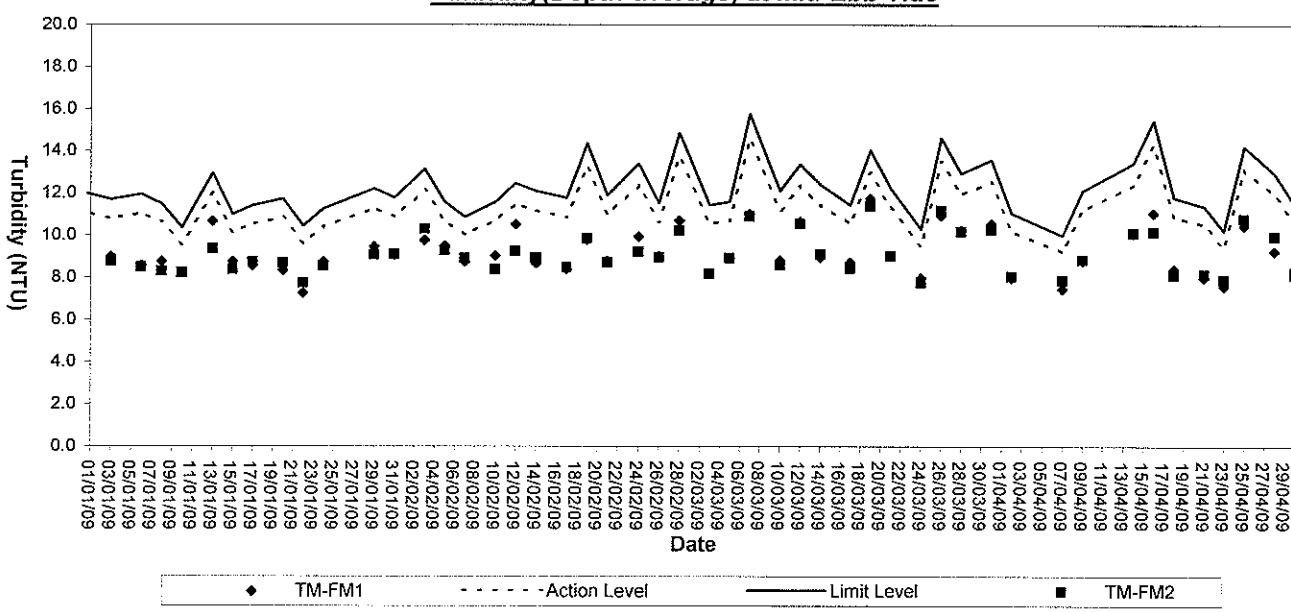




Suspended solids (Depth-average) at Mid-Flood Tide

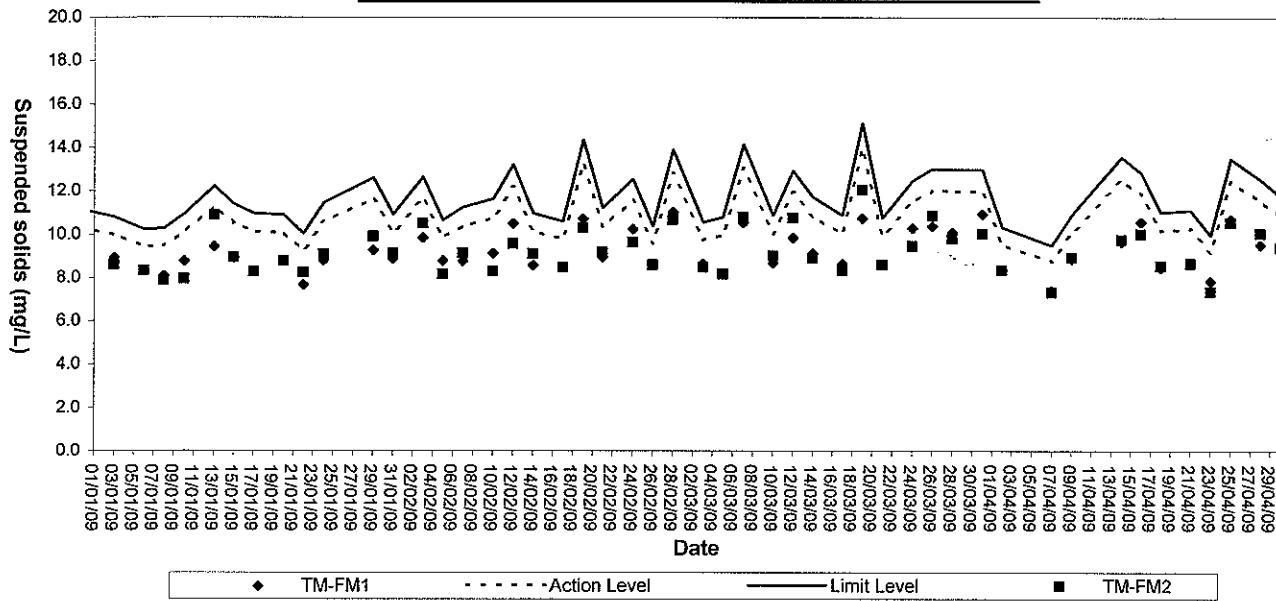

Suspended Solids (Depth-average) at Mid-Ebb Tide

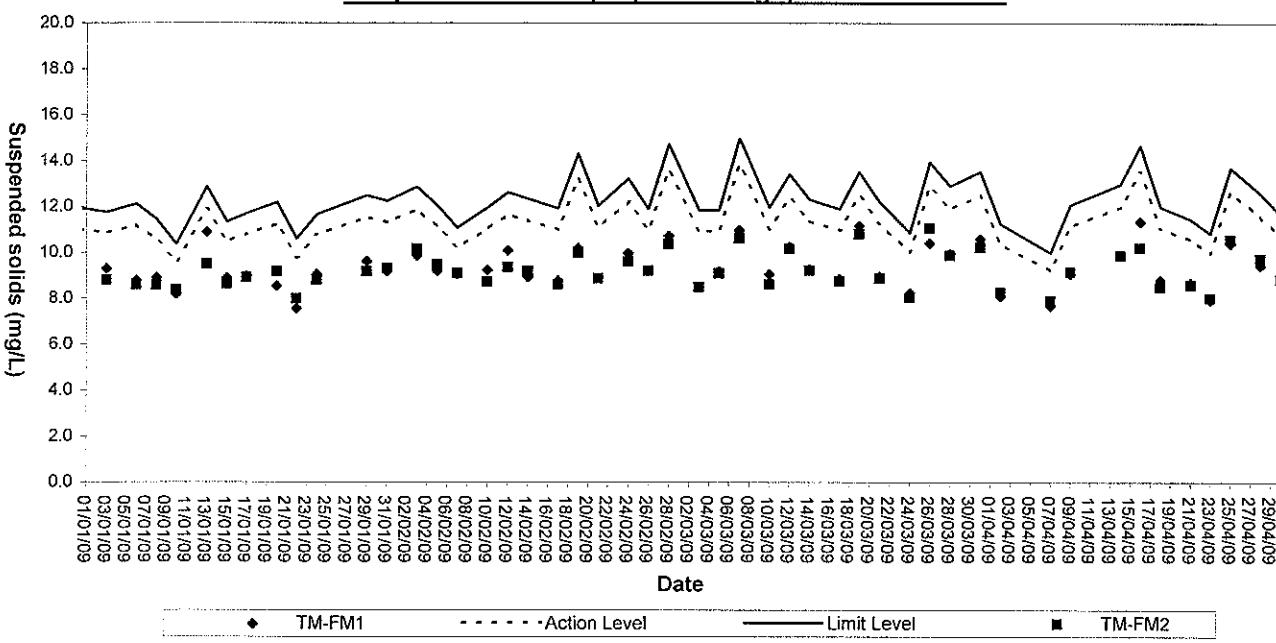

Appendix D1

Calibration Certificates for Impact Noise Monitoring Equipments



Hong Kong Calibration Ltd.

香港校正有限公司

Calibration Certificate

Certificate No. 81355

Page 1 of 2 Pages

Customer : ETS-Testconsult Limited

Address : 8/F., Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan St., Fotan, Hong Kong.

Order No. : Q80566

Date of receipt : 1-Apr-08

Item Tested

Description : Sound Level Calibrator

Manufacturer : Rion

Model : NC-73

Serial No. : 10196943

Test Conditions

Date of Test. : 3-Apr-08

Supply Voltage : --

Ambient Temperature : (23 ± 3)°C

Relative Humidity : (50 ± 25) %

Test Specifications

Calibration check.

Calibration procedure : F21, Z02.

Test Results

All results were within the manufacturer's specification.

The results are shown in the attached page(s).

Main Test equipment used:

Equipment No.	Description	Cert. No.	Due Date	Traceable to
S014	Spectrum Analyzer	73602	7-Jul-08	NIM-PRC & SCL-HKSAR
S024	Sound Level Calibrator	71791	16-Jul-08	NIM-PRC & SCL-HKSAR
S041	Universal Counter	73453	22-Aug-08	SCL-HKSAR

The values given in this Calibration Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environmental changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Hong Kong Calibration Ltd. shall not be liable for any loss or damage resulting from the use of the equipment.

The test equipment used for calibration are traceable to International System of Units (SI).
The test results apply to the above Unit-Under-Test only

Calibrated by :
Dorothy Cheuk

This Certificate is issued by:
Hong Kong Calibration Ltd.

Unit 8B, 24/F., Well Fung Industrial Centre, No. 58-76, Ta Chuen Ping Street, Kwai Chung, NT, Hong Kong.
Tel: 2425 8801 Fax: 2425 8646

The copyright of this certificate is owned by Hong Kong Calibration Ltd.. It may not be reproduced except in full.

Approved by :
Steve Kwan

Date: 3-Apr-08



Hong Kong Calibration Ltd.

香港校正有限公司

Calibration Certificate

Certificate No. 81355

Page 2 of 2 Pages

Results :

1. Level Accuracy (at 1 kHz)

UUT Nominal Value	Measured Value	Mfr's Spec.
94 dB	94.0 dB	± 1 dB

Uncertainty : ± 0.1 dB

2. Frequency Accuracy

UUT Nominal Value	Measured Value	Mfr's Spec.
1 kHz	0.990 8 kHz	± 2 %

Uncertainty : ± 0.1 %

3. Level Stability : 0.0 dB

Uncertainty : ± 0.01 dB

4. Total Harmonic Distortion : < 0.1 %

Mfr's Spec. : < 3 %

Uncertainty : ± 2.3 % of reading

Remark : 1. UUT : Unit-Under-Test

2. The uncertainty claimed is for a confidence probability of not less than 95%.

3. The above measured values are the mean of 3 measurement.

4. Atmospheric Pressure : 1 005 hPa

----- END -----



Hong Kong Calibration Ltd.

香港校正有限公司

Calibration Certificate

Certificate No. 85826

Page 1 of 4 Pages

Customer : ETS-Testconsult Limited

Address : 8/F., Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan St., Fotan, Hong Kong.

Order No. : Q82237

Date of receipt : 21-Nov-08

Item Tested

Description : Precision Integrating Sound Level Meter (ET/EN/003/12)

Manufacturer : Rion

Model : NL-31

Serial No. : 00773032

Test Conditions

Date of Test : 26-Nov-08

Supply Voltage : --

Ambient Temperature : (23 ± 3)°C

Relative Humidity : (50 ± 25) %

Test Specifications

Calibration check.

Calibration procedure : Z01.

Test Results

All results were within the IEC 651 Type 1 & IEC 804 Type 1 specification.

The results are shown in the attached page(s).


Main Test equipment used:

Equipment No.	Description	Cert. No.	Due Date	Traceable to
S017A	Multi-Function Generator	75932	6-Dec-08	SCL-HKSAR
S024	Sound Level Calibrator	82926	16-Jul-09	NIM-PRC & SCL-HKSAR

The values given in this Calibration Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environmental changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Hong Kong Calibration Ltd. shall not be liable for any loss or damage resulting from the use of the equipment.

The test equipment used for calibration are traceable to International System of Units (SI).


The test results apply to the above Unit-Under-Test only

Calibrated by : 
P.F. Wong

This Certificate is issued by:
Hong Kong Calibration Ltd.
Unit 8B, 24/F., Well Fung Industrial Centre, No. 58-76, Ta Chuen Ping Street, Kwai Chung, NT, Hong Kong.
Tel: 2425 8801 Fax: 2425 8846

Approved by : 
Dorothy Cheuk

Date: 28-Nov-08



Hong Kong Calibration Ltd.

香港校正有限公司

Calibration Certificate

Certificate No. 85826

Page 2 of 4 Pages

Results :

1. SPL Accuracy

UUT Setting			Applied Value (dB)	UUT Reading (dB)
Level Range (dB)	Weight	Response		
20 – 100	L _A	Fast	94.03	94.0
		Slow		94.0
	L _C	Fast		94.0
	L _p	Fast		94.0
30 – 120	L _A	Fast	94.03	93.9
		Slow		93.9
	L _C	Fast		93.9
	L _p	Fast		93.9
30 – 120	L _A	Fast	113.97	113.7
		Slow		113.7
	L _C	Fast		113.7
	L _p	Fast		113.7


IEC Type 1 Spec. : ± 0.7 dB

Uncertainty : ± 0.1 dB

2. Level Stability : 0.0 dB

IEC 651 Type 1 Spec. : ± 0.3 dB

Uncertainty : ± 0.01 dB



Calibration Certificate

Certificate No. 85826

Page 3 of 4 Pages

3. Linearity

3.1 Level Linearity

UUT Range (dB)	Applied Value (dB)	UUT Reading (dB)	Variation (dB)	IEC 651 Type 1 Spec. (Primary Indicator Range)
130	114.0	114.0	- 0.1	± 0.7 dB
130	104.0	103.9	0.0	
120	94.0	93.9 (Ref.)	--	
110	84.0	84.0	- 0.1	
100	74.0	74.1	- 0.2	
90	64.0	64.1	- 0.2	
80	54.0	54.2	- 0.3	

Uncertainty : ± 0.1 dB

3.2 Differential level linearity

UUT Range (dB)	Applied Value (dB)	UUT Reading (dB)	Variation (dB)	IEC 651 Type 1 Spec.
120	84.0	83.9	0.0	± 0.4 dB
	94.0	93.9 (Ref.)	--	
	95.0	94.9	0.0	± 0.2 dB
	104.0	103.8	+ 0.1	± 0.3 dB
	105.0	104.8	+ 0.1	± 1.0 dB


Uncertainty : ± 0.1 dB

4. Frequency Weighting

A weighting

Frequency	Attenuation (dB)	IEC 651 Type 1 Spec.
31.5 Hz	- 40.2	- 39.4 dB, ± 1.5 dB
63 Hz	- 26.8	- 26.2 dB, ± 1.5 dB
125 Hz	- 16.7	- 16.1 dB, ± 1 dB
250 Hz	- 9.2	- 8.6 dB, ± 1 dB
500 Hz	- 3.5	- 3.2 dB, ± 1 dB
1 kHz	0.0 (Ref.)	0 dB, ± 1 dB
2 kHz	+ 1.5	+ 1.2 dB, ± 1 dB
4 kHz	+ 1.4	+ 1.0 dB, ± 1 dB
8 kHz	- 0.7	- 1.1 dB, + 1.5 dB ~ - 3 dB
16 kHz	- 6.3	- 6.6 dB, + 3 dB ~ ∞

Uncertainty : ± 0.1 dB



Calibration Certificate

Certificate No. 85826

Page 4 of 4 Pages

4. Time Averaging

Applied Burst duty Factor	Applied L _{eq} Value (dB)	UUT Reading (dB)	IEC 804 Type 1 Spec.
continuous	40.0	40.0	--
1/10	40.0	40.1	± 0.5 dB
1/10 ²	40.0	40.2	
1/10 ³	40.0	40.4	± 1.0 dB
1/10 ⁴	40.0	40.5	

Uncertainty : ± 0.1 dB

Remark : 1. UUT : Unit-Under-Test

2. The uncertainty claimed is for a confidence probability of not less than 95%.
3. Atmospheric Pressure : 1 010 hPa.

----- END -----

Appendix D2

Impact Noise Monitoring Results

Day-time Noise Monitoring

Monitoring Location: TM-RN1 *

Date	Start Sampling Time (hh:mm)	Noise Level dB (A)			Wind Speed (m/s)	Weather Condition
		L _{eq(30min)}	L ₁₀	L ₉₀		
02/04/09	14:20	56.0	57.2	52.8	1.4	Cloudy
07/04/09	14:48	57.1	59.2	53.5	1.9	Cloudy
09/04/09	14:15	52.7	55.9	48.8	1.4	Fine
14/04/09	10:40	57.4	64.3	54.8	0.8	Fine
16/04/09	14:40	58.8	64.3	55.6	0.9	Fine
21/04/09	14:00	52.7	55.9	49.2	1.1	Cloudy
23/04/09	14:45	57.1	59.4	54.9	2.4	Cloudy
28/04/09	10:15	60.3	67.4	56.9	1.5	Fine
30/04/09	13:45	55.7	60.0	52.7	1.4	Sunny

Remark: Since Lands Department did not approve us to enter their own area where the noise monitoring stations TM-N1 and TM-N2 located due to the security, noise monitoring was temporarily carried out at noise monitoring stations TM-RN1 and TM-RN2 (refer to the figure attached) in this reporting month.

Monitoring Location: TM-RN2 *

Date	Start Sampling Time (hh:mm)	Noise Level dB (A)			Wind Speed (m/s)	Weather Condition
		L _{eq(30min)}	L ₁₀	L ₉₀		
02/04/09	14:55	52.7	55.8	48.9	1.9	Cloudy
07/04/09	15:26	54.2	56.9	51.3	1.5	Cloudy
09/04/09	14:55	51.6	54.0	48.2	1.6	Fine
14/04/09	11:18	54.0	56.8	52.8	0.5	Fine
16/04/09	15:20	56.1	60.3	53.6	0.6	Fine
21/04/09	14:40	51.6	54.4	48.7	1.3	Cloudy
23/04/09	15:22	56.5	58.5	52.6	1.6	Cloudy
28/04/09	11:00	56.2	60.2	54.5	0.9	Fine
30/04/09	14:25	52.4	58.3	50.5	0.8	Sunny


Remark: Since Lands Department did not approve us to enter their own area where the noise monitoring stations TM-N1 and TM-N2 located due to the security, noise monitoring was temporarily carried out at two noise monitoring stations TM-RN1 and TM-RN2 (refer to the figure attached) in this reporting month.

Appendix D3

Graphical Plots of Impact Noise Monitoring Data



Noise Monitoring (Day-time)

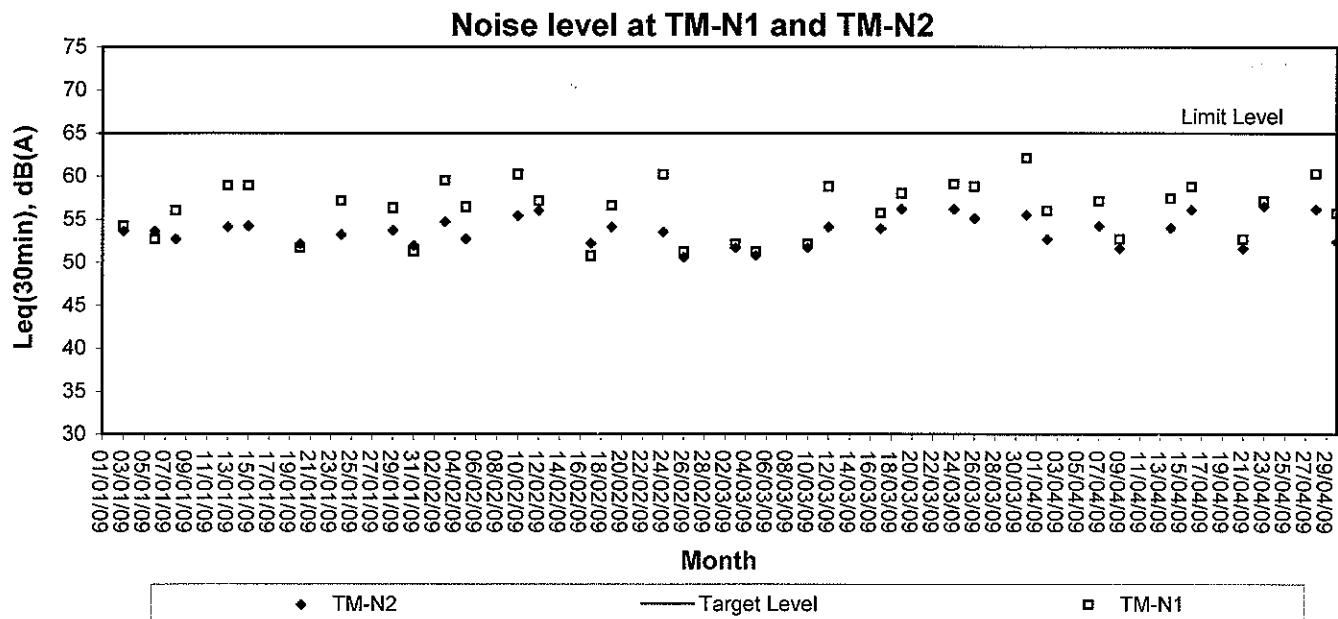

Appendix E

Weather Condition

Extract of Meteorological Observations for Tuen Mun Automatic Weather Station, April 2009

Date	Mean Pressure at M.S.L. (hPa)	Air Temperature			Mean Dew Point Temperature (deg C)	Relative Humidity		
		Max. (deg C)	Mean (deg C)	Min. (deg C)		Max. (%)	Mean (%)	Min. (%)
Apr 1	*****	24.1	21.0	19.2	13.1	75	61	45
Apr 2	*****	22.7	19.7	17.2	11.1	71	58	45
Apr 3	*****	22.9	20.5	18.0	14.8	78	70	58
Apr 4	*****	26.2	23.5	21.1	18.1	80	72	61
Apr 5	*****	29.7	24.8	21.9	18.5	86	69	54
Apr 6	*****	22.2	19.2	16.5	14.4	89	74	54
Apr 7	*****	20.8	18.8	16.2	12.0	87	66	51
Apr 8	*****	25.8	21.7	18.7	14.8	81	66	49
Apr 9	*****	26.0	22.2	19.5	8.5	57	42	30
Apr 10	*****	26.6	22.3	20.1	9.5	63	45	28
Apr 11	*****	26.2	22.5	19.9	15.1	78	63	51
Apr 12	*****	26.5	23.1	20.5	18.3	86	75	61
Apr 13	*****	31.5	24.5	21.7	20.5	89	79	52
Apr 14	*****	30.9	25.7	21.8	19.9	89	71	46
Apr 15	*****	26.4	24.0	22.2	19.0	85	74	58
Apr 16	*****	28.9	23.5	19.3	19.4	91	79	49
Apr 17	*****	28.4	24.2	20.7	19.1	91	74	58
Apr 18	*****	25.5	23.1	21.6	18.4	89	76	60
Apr 19	*****	27.6	26.0	23.1	23.5	90	86	80
Apr 20	*****	31.5	28.1	26.0	20.7	90	66	44
Apr 21	*****	30.1	26.5	23.2	16.1	77	53	39
Apr 22	*****	25.2	23.8	22.4	17.3	75	67	59
Apr 23	*****	26.9	24.1	22.3	18.8	78	73	61
Apr 24	*****	25.8	24.6	23.2	20.8	83	79	73
Apr 25	*****	25.3	23.5	19.9	20.8	91	85	72
Apr 26	*****	20.4	19.8	19.3	16.7	89	83	76
Apr 27	*****	26.0	22.2	19.5	13.7	82	60	37
Apr 28	*****	28.2	23.5	20.2	8.9	64	41	17
Apr 29	*****	26.3	23.2	20.6	13.2	64	54	31
Apr 30	*****	28.2	24.3	20.5	14.4	71	55	40
Mean	*****	26.4	23.1	20.5	16.3	81	67	51
Maximum	*****	31.5	28.1	26.0	23.5	91	86	80
Minimum	*****	20.4	18.8	16.2	8.5	57	41	17

Extract of Meteorological Observations for Tuen Mun Automatic Weather Station, April 2009

Date	Total Rainfall (mm)	Prevailing Wind Direction (degrees)	Mean Wind Speed (km/h)
Apr 1	0.0	160	9.5
Apr 2	0.0	150	9.5
Apr 3	0.0	160	9.3
Apr 4	0.0	150	12.0
Apr 5	0.0	310	8.3
Apr 6	15.0	030	8.4
Apr 7	2.5	020	6.2
Apr 8	0.0	170	5.9
Apr 9	0.0	150	9.4
Apr 10	0.0	160	8.9
Apr 11	0.0	170	11.2
Apr 12	0.5	170	7.7
Apr 13	1.5	160	5.3
Apr 14	0.0	020	6.8
Apr 15	0.5	160	10.6
Apr 16	37.0	160	8.1
Apr 17	0.0	140	10.0
Apr 18	14.5	150	11.0
Apr 19	4.5	160	13.6
Apr 20	0.0	300	8.8
Apr 21	0.5	030	12.2
Apr 22	0.0	150	9.8
Apr 23	0.0	150	13.1
Apr 24	0.0	160	12.0
Apr 25	52.5	030	10.8
Apr 26	0.5	030	9.9
Apr 27	0.0	140	11.8
Apr 28	0.0	140	13.3
Apr 29	0.0	160	10.1
Apr 30	0.0	140	13.9
Mean	-----	160	9.9
Total	129.5	---	-----
Maximum	52.5	---	13.9
Minimum	0.0	---	5.3

*** unavailable

missing (less than 24 hourly observations a day)

Rainfall measured in increment of 0.5 mm. Amount of < 0.5 mm cannot be detected

Appendix F

Event-Action Plans

EVENT/ACTION PLAN FOR AIR QUALITY EXCEEDANCE

EVENT	ET Leader	ACTION	ACTION LEVEL			Contractor
			IC(E)	ER	ET	
1. Exceedance for one sample	<ol style="list-style-type: none"> Identify source, investigate the causes of exceedance and propose remedial measures. Inform ER, IC(E) and Contractor Repeat measurement to confirm finding Increase monitoring frequency to daily 	<ol style="list-style-type: none"> Check monitoring data submitted by the ET Check contractor's working method 	<ol style="list-style-type: none"> Notify Contractor 	<ol style="list-style-type: none"> Rectify any unacceptable practise Amend working methods if appropriate 		
2. Exceedance for two or more consecutive samples	<ol style="list-style-type: none"> Identify source, investigate the causes of exceedance and propose remedial measures Inform IC(E) and Contractor Repeat measurements to confirm finding Increase monitoring frequency to daily Discuss with IC(E) and Contractor on proposed remedial actions If exceedance continues, arrange meeting with IC(E) and ER. If exceedance stops, cease additional monitoring 	<ol style="list-style-type: none"> Check monitoring data submitted by the ET Leader Check the Contractor's working method Discuss with ET and Contractor on possible remedial measures Advise the ER on the effectiveness of the proposed remedial measures Supervise implementation of remedial measures 	<ol style="list-style-type: none"> Confirm receipt of notification of failure in writing Notify the Contractor Ensure remedial measures properly implemented 	<ol style="list-style-type: none"> Submit proposals for remedial actions to IC(E) within 3 working days of notification Implement the agreed proposals Amend proposal if appropriate 		
1. Exceedance for one sample	<ol style="list-style-type: none"> Identify source, investigate the causes of exceedance and propose remedial measures Inform ER, Contractor and EPD Repeat measurement to confirm finding Increase monitoring frequency to daily Assess the effectiveness of Contractor's remedial actions and keep IC(E), EPD and ER informed of the results 	<ol style="list-style-type: none"> Check monitoring data submitted by the ET Leader Check Contractor's working method Discuss with ET and Contractor on possible remedial measures Advise the ER on the effectiveness of the proposed remedial measures Supervise implementation of remedial measures 	<ol style="list-style-type: none"> Confirm receipt of notification of failure in writing Notify the Contractor Ensure remedial measures properly implemented 	<ol style="list-style-type: none"> Take immediate action to avoid further exceedance Submit proposals for remedial actions to IC(E) within 3 working days of notification Implement the agreed proposals Amend proposal if appropriate. 		

EVENT/ACTION PLAN FOR AIR QUALITY EXCEEDANCE

EVENT	ACTION	IC(E)	ER	Contractor
				ET Leader
2. Exceedance for two or more consecutive samples	<p>1. Identify source, investigate the causes of exceedance and propose remedial measures</p> <p>2. Notify IC(E), ER, EPD and Contractor</p> <p>3. Repeat measurement to confirm finding</p> <p>4. Increase monitoring frequency to daily</p> <p>5. Carry out analysis of contractor's working procedures to determine possible mitigation to be implemented</p> <p>6. Arrange meeting with IC(E) and ER to discuss the remedial actions to be taken</p> <p>7. Assess effectiveness of Contractor's remedial actions and keep IC(E), EPD and ER informed of the results</p> <p>8. If exceedance stops, cease additional monitoring</p>	<p>1. Discuss amongst ER, ET and Contractor on the potential remedial actions</p> <p>2. Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly</p> <p>3. Supervise the implementation of remedial measures</p>	<p>1. Confirm receipt of notification of failure in writing</p> <p>2. Notify Contractor</p> <p>3. In consultation with the IC(E), agree with the Contractor on the remedial measures to be implemented</p> <p>4. Ensure remedial measures are properly implemented</p> <p>5. If exceedances continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated</p>	<p>1. Take immediate action to avoid further exceedances</p> <p>2. Submit proposals for remedial actions to IC(E) within 3 working days of notification</p> <p>3. Implement the agreed proposals</p> <p>4. Resubmit proposals if problem still not under control</p> <p>5. Stop the relevant activity of works as determined by the ER until the exceedance is abated</p>

EVENT/ACTION PLAN FOR NOISE EXCEEDANCE

EVENT	ACTION	IC(E)	ER	Contractor
ET Leader				
Action Level	<p>1. Notify the IC(E) and the Contractor.</p> <p>2. Carry out investigation.</p> <p>3. Report the results of investigation to the IC(E) and the Contractor.</p> <p>4. Discuss with the Contractor and formulate remedial measures.</p> <p>5. Increase monitoring frequency to check mitigation effectiveness</p>	<p>1. Review the analysed results submitted by the ET.</p> <p>2. Review the proposed remedial measures by the Contractor and advise the ER accordingly.</p> <p>3. Supervise the implementation of remedial measures.</p> <p>4. Ensure remedial measures are properly implemented.</p>	<p>1. Confirm receipt of notification of failure in writing.</p> <p>2. Notify the Contractor.</p> <p>3. Require the Contractor to propose remedial measures for the analysed noise problem.</p> <p>4. Ensure remedial measures are properly implemented.</p>	<p>1. Submit noise mitigation proposals to IC(E).</p> <p>2. Implement noise mitigation proposals.</p>
Limit Level	<p>1. Notify the IC(E), the ER, the EPD and the Contractor.</p> <p>2. Identify source.</p> <p>3. Repeat measurement to confirm findings.</p> <p>4. Increase monitoring frequency.</p> <p>5. Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented.</p> <p>6. Inform the IC(E), the ER and the EPD the causes & actions taken for the exceedances.</p> <p>7. Assess effectiveness of Contractor's remedial actions and keep the IC(E), the EPD and the ER informed of the results</p> <p>8. If exceedance due to the construction works stops, cease additional monitoring</p>	<p>1. Discuss amongst the ER, the ET Leader and the Contractor on the potential remedial actions.</p> <p>2. Review the Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly.</p> <p>3. Supervise the implementation of remedial measures.</p>	<p>1. Confirm receipt of notification of failure in writing.</p> <p>2. Notify the Contractor.</p> <p>3. Require the Contractor to propose remedial measures for the analysed noise problem.</p> <p>4. Ensure remedial measures are properly implemented.</p> <p>5. If exceedances continue, consider what activity of the work is responsible and instruct the Contractor to stop that activity of work until the exceedances is abated.</p>	<p>1. Take immediate action to avoid further exceedance</p> <p>2. Submit proposals for remedial actions to IC(E) within 3 working days of notification.</p> <p>3. Implement the agreed proposals.</p> <p>4. Resubmit proposals if problem still not under control.</p> <p>5. Stop the relevant activity of works as determined by the ER until the exceedances is abated.</p>

EVENT AND ACTION PLAN FOR WATER QUALITY EXCEEDANCE

Event	ET Leader	Contractor	ER	IEC	ACTION	
Action level being exceeded by one sampling day	<p>1. Identify source(s) of impact;</p> <p>2. Repeat in-situ measurement to confirm findings;</p> <p>3. Notify Contractor in writing within 24 hours of identification of exceedance;</p> <p>4. Check monitoring data, all plant, equipment and Contractor's working methods;</p> <p>5. Carry out investigation</p> <p>6. Report the results of investigation to the Contractor within 3 working days of identification of exceedance and advise contractor if exceedance is due to contractor's construction works</p> <p>7. Discuss mitigation measures with Contractor if exceedance is due to the construction works within 4 working days</p> <p>8. Repeat measurement on next day of exceedance if exceedance is due to the construction works</p>	<p>1. Notify the ER and IEC in writing within 24 hours of identification of exceedance</p> <p>2. Rectify unacceptable practice;</p> <p>3. Check all plant and equipment;</p> <p>4. Submit investigation report to IEC and ER within 3 working days of the identification of an exceedance</p> <p>5. Consider changes of working method if exceedance is due to the construction works</p> <p>6. Discuss with ET, IEC and ER and propose mitigation measures to IEC and ER if exceedance is due to the construction works within 4 working days of identification of an exceedance</p> <p>7. Implement the agreed mitigation measures within reasonable time scale</p>	<p>1. Notify EPD and other relevant governmental agencies in writing within 24 hours of the identification of the exceedance</p> <p>2. Discuss with IEC, ET and Contractor on the proposed mitigation measures;</p> <p>3. Require contractor to propose remedial measures for the analysed problem if related to the construction works</p> <p>4. Ensure remedial measures are properly implemented</p> <p>5. Assess the effectiveness of the mitigation measure</p>	<p>1. Check monitoring data submitted by ET</p> <p>2. Confirm ET assessment if exceedance is due / not due to the works</p> <p>3. Discuss with ET, ER and Contractor on the mitigation measures</p> <p>4. Review contractor's mitigation measures whenever necessary to ensure their effectiveness and advise the ER accordingly</p> <p>5. Supervise the implementation of mitigation measures</p>	<p>1. Check monitoring data submitted by ET</p> <p>2. Confirm ET assessment if exceedance is due / not due to the works</p> <p>3. Discuss with ET, ER and Contractor on the mitigation measures</p> <p>4. Review contractor's mitigation measures whenever necessary to ensure their effectiveness and advise the ER accordingly</p> <p>5. Supervise the implementation of mitigation measures</p>	


EVENT AND ACTION PLAN FOR WATER QUALITY

Event	ACTION			
	ET Leader	Contractor	ER	IEC
Action level being exceeded by more than one consecutive sampling days	<p>1. Identify source(s) of impact;</p> <p>2. Repeat in-situ measurement to confirm findings</p> <p>3. Notify Contractor in writing within 24 hours of identification</p> <p>4. Check monitoring data, all plant, equipment and Contractor's working methods;</p> <p>5. Carry out investigation</p> <p>6. Report the results of investigation to the Contractor within 3 working days of identification of exceedance</p> <p>7. Discuss mitigation measures with IEC and Contractor within 4 working of identification of an exceedance</p> <p>8. Ensure mitigation measures are implemented;</p> <p>9. Prepare to increase the monitoring frequency to daily;</p> <p>10. Repeat measurement on next day of exceedance.</p>	<p>1. Notify IEC and ER in writing within 24 hours of identification of exceedance</p> <p>2. Rectify unacceptable practice; Check all plant and equipment;</p> <p>3. Consider changes of working methods;</p> <p>4. Submit the results of the investigation to IEC and ER within 3 working days of the identification of an exceedance</p> <p>5. Require contractor to propose remedial measures for the analysed problem if related to the construction works</p> <p>6. Ensure remedial measures are properly implemented</p> <p>7. Implement the agreed mitigation measures within reasonable time scale</p>	<p>1. Notify EPD and other relevant governmental agencies in writing within 24 hours of the identification of the exceedance</p> <p>2. Discuss with ET, ER and Contractor on the proposed mitigation measures;</p> <p>3. Review contractor's mitigation measures whenever necessary to ensure their effectiveness and advise the ER accordingly</p> <p>4. Assess the effectiveness of the implemented mitigation measures.</p>	<p>1. Check monitoring data submitted by ET</p> <p>2. Confirm ET assessment if exceedance is due / not due to the works</p> <p>3. Discuss with ET, ER and Contractor on the mitigation measures.</p> <p>4. Review contractor's mitigation measures whenever necessary to ensure their effectiveness and advise the ER accordingly</p> <p>5. Assess the effectiveness of the implemented mitigation measures.</p>

EVENT AND ACTION PLAN FOR WATER QUALITY EXCEEDANCE

Event	ET Leader	ACTION	Contractor	ER	IEC
Limit level being exceeded by one sampling day	<ol style="list-style-type: none"> 1. Repeat in-situ measurement to confirm findings; 2. Identify source(s) of impact; 3. Notify Contractor in writing within 24 hours of identification of the exceedance 4. Check monitoring data, all plant, equipment and Contractor's working methods; 5. Carry out investigation 6. Report the results of investigation to the Contractor within 3 working days of identification of exceedance and advise contractor if exceedance is due to contractor's construction works 7. Discuss mitigation measures with IEC, ER and Contractor within 4 working days of identification of an exceedance 8. Ensure mitigation measures are implemented; 9. Increase the monitoring frequency to daily until no exceedance of Limit Level. 	<ol style="list-style-type: none"> 1. Notify IEC and ER in writing; within 24 hours of the identification of the exceedance 2. Rectify unacceptable practice; 3. Check all plant and equipment; 4. Consider changes of working methods; 5. Submit the results of the investigation to IEC and ER within 3 working days of the identification of an exceedance 6. Discuss with ET, IEC and ER and propose mitigation measures to IEC and ER within 4 working days of the identification of an exceedance 7. Implement the agreed mitigation measures within reasonable time scale 	<ol style="list-style-type: none"> 1. Notify EPD and other relevant governmental agencies in writing within 24 hours of identification of exceedance with IEC, ET and Contractor on the proposed mitigation measures; 2. Discuss with ET, ER and Contractor on the proposed mitigation measures; 3. Request Contractor to critically review the working methods; review the working methods; 4. Ensure remedial measures are properly implemented 5. Assess the effectiveness of the implemented mitigation measures. 	<ol style="list-style-type: none"> 1. Check monitoring data submitted by ET 2. Confirm ET assessment if exceedance is due / not due to the works 3. Discuss with ET, ER and Contractor on the proposed mitigation measures. 4. Review proposals on mitigation measures submitted by Contractor and advise the ER accordingly. 5. Assess the effectiveness of the implemented mitigation measures 	

EVENT AND ACTION PLAN FOR WATER QUALITY EXCEEDANCE					
Event	ET Leader	Contractor	ER	IEC	
Limit Level being exceeded by more than one consecutive sampling days	<p>1. Repeat in-situ measurement to confirm findings;</p> <p>2. Identify source(s) of impact;</p> <p>3. Notify Contractor in writing within 24 hours of identification of the exceedance</p> <p>4. Check monitoring data, all plant, equipment and Contractor's working methods;</p> <p>5. Carry out investigation</p> <p>6. Report the results of investigation to the Contractor within 3 working days of identification of exceedance</p> <p>7. Discuss mitigation measures with IEC, ER and Contractor;</p> <p>8. Ensure mitigation measures are implemented;</p> <p>9. Increase the monitoring frequency to daily until no exceedance of Limit Level for two consecutive days.</p>	<p>1. Notify ER and IEC in writing within 24 hours of the identification of the exceedance and rectify unacceptable practice;</p> <p>2. Rectify all plant and equipment;</p> <p>3. Consider changes of working methods;</p> <p>4. Submit the results of the investigation to IEC and ER within 3 working days of the identification of an exceedance</p> <p>5. Consider and instruct, if necessary, the Contractor to slow down or to stop all or part of the marine work until no exceedance of Limit Level.</p> <p>6. Implement the agreed mitigation measures within reasonable time scale</p> <p>7. As directed by the Engineer, to slow down or to stop all or part of the marine work or construction activities.</p>	<p>1. Notify EPD and other relevant governmental agencies in writing within 24 hours of identification of exceedance</p> <p>2. Discuss with IEC, ET and Contractor on the proposed mitigation measures;</p> <p>3. Request Contractor to critically review the working methods;</p> <p>4. Ensure remedial measures are properly implemented</p> <p>5. Assess the effectiveness of the implemented mitigation measures;</p> <p>6. Assess the effectiveness of the implemented mitigation measures.</p>	<p>1. Check monitoring data submitted by ET</p> <p>2. Confirm ET assessment if exceedance is due / not due to the works</p> <p>3. Discuss with ER, ET and Contractor on the mitigation measures.</p> <p>4. Review proposals on mitigation measures submitted by Contractor and advise the ER accordingly.</p> <p>5. Assess the effectiveness of the implemented mitigation measures.</p>	

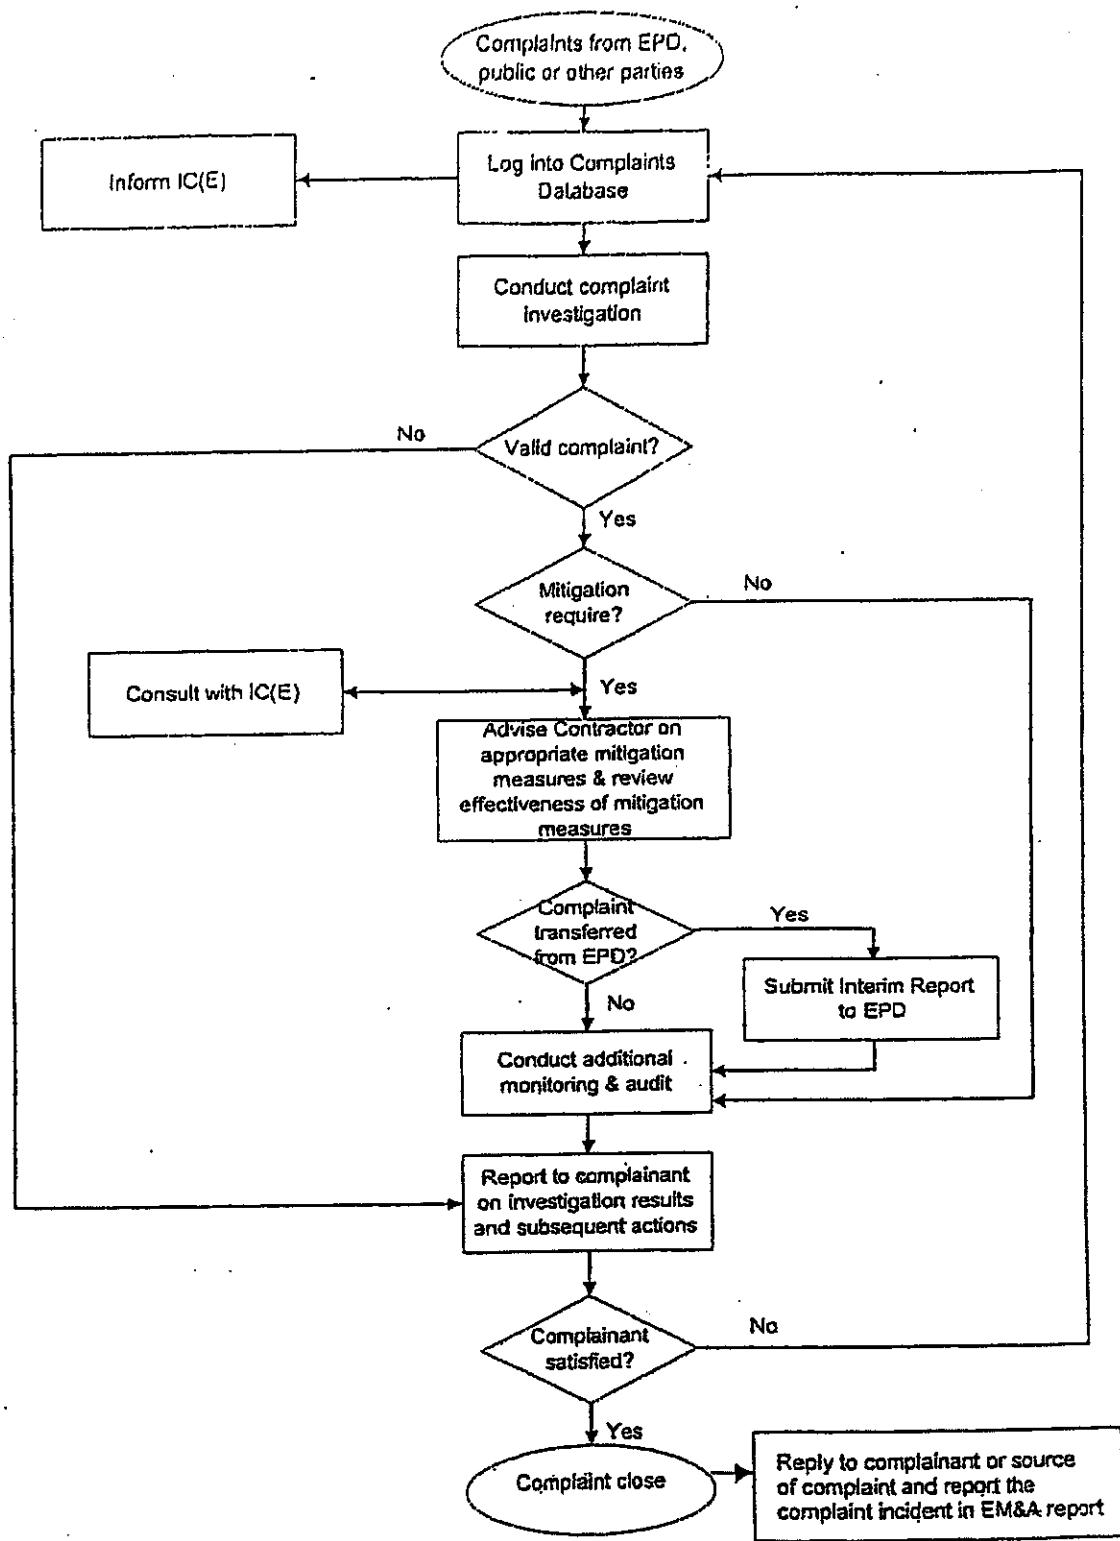

CEDD Contract No. CV/2005/01 Delivery of Reclamation Material to Mainland

Figure 5 Environmental Complaint Handling Procedure - Tuen Mun Area 38 Fill Bank

Scale : --

Date issued :
December 2006



東業進測試有限公司
ETS-TESTCONSULT LIMITED

Appendix G

Construction Programme

Project Activities at Tuen Mun (From March to June 2009)

Activity Description	Original Duration	Start	Finish
B1a Servicing	1127	01/12/06A	31/12/2009
Measurement System C&M for B1a	1124	01/12/06A	31/12/2009
B1b Servicing	1127	01/12/06A	31/12/2009
Measurement System O&M for B1b	1124	01/12/06A	31/12/2009
Surveillance System O&M for B1b	1124	01/12/06A	31/12/2009
B1c Servicing	1127	01/12/06A	31/12/2009
Measurement System O&M for B1c	1124	02/12/06A	31/12/2009
Sorting of Stockpiled Public fill	1127	01/12/06A	31/12/2009
Removal of Stockpiled Public Fill	1127	01/12/06A	31/12/2009
Disposal of unsuitable Material	1127	01/12/06A	31/12/2009
Compaction of Public Fill	1127	01/12/06A	31/12/2009
TM Tipping Halls Operation	1127	01/12/06A	31/12/2009
Record House B5 Servicing	1127	01/12/06A	31/12/2009
RE Secondary Office Servicing (B6)	1127	01/12/06A	31/12/2009
Servicing	1127	01/12/06A	31/12/2009

Appendix H

Weekly ET's Site Inspection Record

Inspection Date : 2 April 2009
Time : 10:15

Weather : Sunny / Fine / Cloudy / Overcast / Drizzle / Rain / Storm / Hazy
Wind : Calm / Light / Breeze / Strong

Temperature : 19 °C
Humidity : High / Moderate / Low

Inspected by	CEDD	Contractor / Sub-Contractor	ET
Signature:			
Name:	CHAN TIN PUI	NGAN LOK HO CHEUNG	H. T. CHOW
Title	Allow / P6	Site Officer	A. E. O.

	Environmental Checklist			Implementation Stages*			Remark
	Yes	No	N/A	Yes	No	N/A	
Fugitive Dust Emission							
-	Dust control / mitigation measures shall be provided to prevent dust nuisance.			√			
-	Water sprays shall be provided and used to dampen materials.			√			
-	All stockpile of aggregate or spoil should be enclosed or covered and water applied in dry or windy condition.			√			
-	Any vehicle with open load carrying area used for moving materials which has the potential to create dust shall have properly fitting side and tail boards. Material having the potential to create dust shall not be loaded to a level higher than the side and tail boards, and shall be covered by a clean tarpaulin.			√			
-	Unpaved areas should be watered regularly to avoid dust generation.			√			
-	The designated site main haul road shall be paved or regular watering.			√			
-	The haul road inside the site and public road around the site entrance should be kept clean and free from dust.			√			
-	Wheel washing facilities including high-pressure water jet shall be provided at the entrance of work site.			√			
-	Every vehicle shall be washed to remove any dusty materials from its body and wheels before leaving the fill bank.			√			
-	The temporary slope surfaces shall be covered with impermeable sheet or sprayed with water.			√			
-	Vehicle and equipment should be switched off while not in use.			√			
-	All plant and equipment should be well maintained e.g. without black smoke emission.			√			
-	Open burning should be prohibited.			√			
Noise Impact							
-	The approved method of working, equipment and sound-reducing measures (e.g. use of silenced type of equipment, etc.) shall be adapted.			√			
-	The constructions works should be scheduled to minimize noise nuisance.			√			
-	Only well maintained plant should be operated on-site and plant should be serviced regularly during the construction works.			√			
-	Powered mechanical equipment (PME) should be covered or shielded by appropriate acoustic materials.			√			
-	Air compressors and hand held breakers should have noise labels.			√			
-	Compressors and generators should operate with door closed.			√			
-	Machines and plants that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum.			√			
-	Noisy equipment and mobile plant shall always be site away from NSRs.			√			

	Environmental Checklist			Implementation Stages*			Remark
	Yes	No	N/A				
Water Quality							
▪ Drainage system and the sand / silt removal facilities should be adequate and well maintained to prevent flooding and overflow, especially after rain storms.	✓						Item 2 and 5
▪ The stormwater intercepting system shall be effective to collect of runoff and remove suspended solids before discharge.	✓						
▪ Unnecessary water retained in receptacles and standing water should be avoided to prevent mosquito breeding.	✓						Item 4
▪ The material shall be properly covered to prevent washed away especially before rainstorm.	✓						
▪ The temporary slope surfaces shall be covered with impermeable sheet or sprayed with water.	✓						
▪ Final slope surfaces, especially those facing to the north of the site shall be treated by compaction, followed by hydroseeding, vegetation planting or sealing with shotconcrete, latex, vinyl, bitumen, or other suitable surface stabilizer approved by CEDD.	✓						
▪ Existing and newly constructed Catchpits, sand and silt removal facilities and intercepting channels shall be maintained, and the deposited silt and grit shall be removed weekly and on a need basis especially at the onset of and after each rainstorm to ensure that these facilities are functioning properly at all times.	✓						
▪ A wheel washing bay shall be provided at the site exit and wash-water shall have sand and silt settled out or removed before being discharged into storm drains.	✓						
▪ The section of construction road between wheel washing bay and the public road shall be paved with concrete, bituminous materials or hardcores to reduce vehicle tracking of soil and to prevent site run-off from entering public road drains.	✓						
▪ Sewage from toilets shall be discharged in to a foul sewer, or chemical toilets shall be provided.	✓						
▪ The chemical toilets (if use) shall be provided by a licensed contractor, who will be responsible for disposal and maintenance of these facilities.	✓						
▪ Tipping halls enclosed with top and 3-side to prevent spillage of material into marine water.	✓						
▪ The barges shall be in right size such that adequate clearance is maintained between the vessels and the seabed at all states of the tide to ensure the undue turbidity is not generated by turbulence from vessel movement or propeller wash.	✓						
▪ All vessels used for transportation of fill material shall have tight fitting seals to their bottom openings to prevent leakage of material during transport.	✓						
▪ Barges shall not be filled to a level which may cause the overflow of material during loading or transportation. Barge effluents shall be properly collected and treated before disposal.	✓						
▪ Adequate environmental control measures shall be provided to prevent / avoid dropping of fill material into the sea during the transfer.	✓						
▪ The work activities shall not cause any visible foam, oil, grease, scum, litter or other objectionable matters to be present on the water in the vicinity of the barging facilities.	✓						
▪ A waste collection vessel shall be deployed to remove floating debris.	✓						
Landscape and Visual							
▪ The maximum stockpiling height at the fill bank shall be limited to a maximum of +40mPD.	✓						
▪ Surface of outer slopes of the Fill Bank shall preferably be hydroseeded.	✓						
▪ Stockpile of public fill shall be removed in a sequence to allow the outer hydroseeded to be removed later than other portions as far as practicable.	✓						
▪ Casuarina equisetifolia were planted as buffer tree along the northern perimeter of the Site. The height of Casuarina equisetifolia was maintained at least 3m above soil level.	✓						
▪ Lighting shall be set to minimise night-time glare.	✓						

	Environmental Checklist	Implementation Stages*			Remark
		Yes	No	N/A	
Waste Management					
Construction Waste Management					
	<ul style="list-style-type: none"> ▪ Relevant licence / permits for disposal of construction waste or excavated materials available for inspection. ▪ Excavated material to be generated from construction works to be re-used on-site as far as practicable to reduce off-site disposal. ▪ Mud and debris should be removed from waterworks access roads and associated drainage systems. ▪ Provision of sufficient waste disposal points and regular collection for disposal. Appropriate measures should be employed to minimise windblown litter and dust during transportation of wastes by either covering trucks or by transporting wastes in enclosed containers. ▪ Segregation and storage of different types of waste in different containers, skips or stockpiles to enhance reuse or recycling of materials and their proper disposal. ▪ Prior to disposal of C&D waste, recyclable materials should be salvaged for reuse (such as wood and metal) and inert waste utilised as public fill to minimise the quantity of waste to be disposed of to landfill. ▪ In order to monitor the disposal of C&D material and solid wastes at public filling areas and landfills, and to control fly-tipping, a trip-ticket system should be included as one of the contractual requirements. ▪ Any soil contaminated with chemicals/oils shall be removed from site and the void created shall be filled with suitable materials. 	✓	✓	✓	Item 2 and 5
Chemical Waste Management					
	<ul style="list-style-type: none"> ▪ It is required to register as a chemical waste producer if chemical wastes would be produced from the construction activities. The Waste Disposal Ordinance (Cap 354) and its subsidiary regulations in particular the Waste Disposal (Chemical Waste) (General) Regulation should be observed and complied with for control of chemical wastes. ▪ After use, chemical wastes (e.g. cleaning fluids, solvents, lubrication oil and fuel) should be handled according to the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes. ▪ Spent chemicals should be stored and collected by an approved operator for disposal at the Chemical Waste Treatment Facility or other licensed facility in accordance with the Chemical Waste (General) Regulation. ▪ Chemical wastes should be separated for special handling and appropriate treatment at the Chemical Waste Treatment Facility. ▪ Chemical wastes including waste oil should be stored properly in designated areas, e.g. chemical waste storage area. ▪ The designated chemical waste storage area should only be used for storing chemical wastes. ▪ The set-up of chemical waste storage area should <ul style="list-style-type: none"> ▪ Be suitable for the substance they are holding, resistant to corrosion, maintained in a good condition. ▪ Be enclosed on at least 3 sides and securely closed. ▪ Have an impermeable floor and bunding, of capacity to accommodate 110% of the volume of the largest container or 20% by volume of the chemical waste stored in that area, whichever is the greatest. ▪ Have adequate ventilation. ▪ Be covered to prevent rainfall entering (water collected within the bund must be tested and disposal as chemical waste if necessary). ▪ Be arranged so that incompatible materials are adequately separated. 	✓	✓	✓	Item 8

Environmental Checklist	Implementation Stages*			Remark
	Yes	No	N/A	
■ Warning panels should be displayed at the waste storage area.	✓			
■ Waste storage area should be cleaned and maintained regularly.	✓			
■ Chemical waste should be transported by a registered chemical waste collector to a facility licensed to receive chemical waste.	✓			
■ All generators, fuel and oil storage should be within bundle areas.	✓			Item 8
■ Oil leakage from machinery, vehicle and plant should be prevented.	✓			
■ In the event of chemical waste / dangerous goods / chemicals spillage or leakage, the procedures as outlined in the Spillage Response Plan should be followed.	✓			
■ The dangerous goods / chemical spillage or leakage procedures (including equipments) should be in place.	✓			
Good Site Practices				
■ Nomination of approved personnel, such as site manager, to be responsible for good site practices, arrangements for collection and effective disposal to an appropriate facility, of all wastes generated at the site.	✓			
■ Training of site personnel in proper waste management and chemical handling procedures should be provided.	✓			
■ Good site practices should be adopted to clean the rubbish and litter on a regular basis so as to prevent the rubbish and litter from dropping into the nearby environment..	✓			
■ Proper storage and site practices to minimise the potential for damage or contamination of construction materials.	✓			
■ The Environmental Permit should be displaced conspicuously on site.	✓			
■ Construction noise permits should be posted at site entrance or available for site inspection.	✓			
■ Plan and stock construction materials carefully to minimise amount of waste generated and avoid unnecessary generation of waste.	✓			
■ Chemical storage area provided with lock and located on sealed areas.	✓			
■ All chemicals should be placed at the banded area with adequate band capacity (>110% of largest tank).	✓			
■ Any unused chemicals or those with remaining functional capacity should be recycled.	✓			
■ Regular cleaning and maintenance programme for waste storage area, drainage systems, silt traps, sumps and oil interceptors.	✓			
■ To encourage collection of aluminium cans by individual collectors, separate labelled bins should be provided to segregate this waste from other general refuse generated by the workforce.	✓			
■ A recording system for the amount of wastes generated, recycled and disposed (including the disposal sites) should be used, e.g. trip ticket system for chemical waste disposal. Quantities could be determined by weighing each load or other suitable methods.	✓			
■ A collection area should be provided where waste can be stored and loaded prior to removal from site. An enclosed and covered area is preferred to reduce the occurrence of 'wind blown' light material. If an open area is unavoidable for the storage or loading/unloading of wastes, then the area should be bunded and all the polluted surface run-off collected within this area should be diverted into wastewater treatment system.	✓			Item 1 and 7




Summary of the Weekly Site Inspection:

Item	Details of defective works or observations	Photo Ref.	Further Action Required (Yes/No)
1	Follow up action to the previous site inspection item 1 on 26/03/09, rubbish and withered vegetation were still noted discarded on the ground near the CEDD site office. The Contractor was reminded to collect and dispose of them properly.	090402_001	Yes
2	Follow up action to the previous site inspection item 2 on 26/03/09, mud and silt were still observed accumulated inside in the u-channel near CEDD site office. The Contractor was reminded to clean up the mud and silt immediately in order to avoid any blockage.	090402_002	Yes
3	Follow up action to the previous site inspection item 3 on 26/03/09, the damaged water tank at weight bridge No.5 was repaired.	090402_003	No
4	Stagnant water was noted on the ground next to the Contractor's site office. The Contractor was reminded to drain the stagnant water or apply pesticide to avoid mosquito breeding.	090402_004	Yes
5	Mud and silt were observed accumulated inside the u-channel at weight bridge No.5. The Contractor was reminded to clean up the mud and silt in order to avoid any blockage of the u-channel.	090402_005	Yes
6	Follow up action to the previous site inspection item 4 on 26/03/09, the water bucket at weight bridge No.5 was found with cover.	090402_006	No
7	Follow up action to the previous site inspection item 5 on 26/03/09, C&D wastes were still noted discarded near chemical waste storage area. The Contractor was reminded to collect and dispose the waste properly.	090402_007	Yes
8	Follow up action to the previous site inspection item 6 on 26/03/09, oil leakage was still noted from a crack of a drip tray at chemical waste storage area. The Contractor was reminded to clean up the leak oil and repair the damaged drip tray.	090402_008	Yes

Remark

Checked by	Name	Title	Signature	Date
	Linda Law	Senior Environmental Officer		02 April 2009

Photos

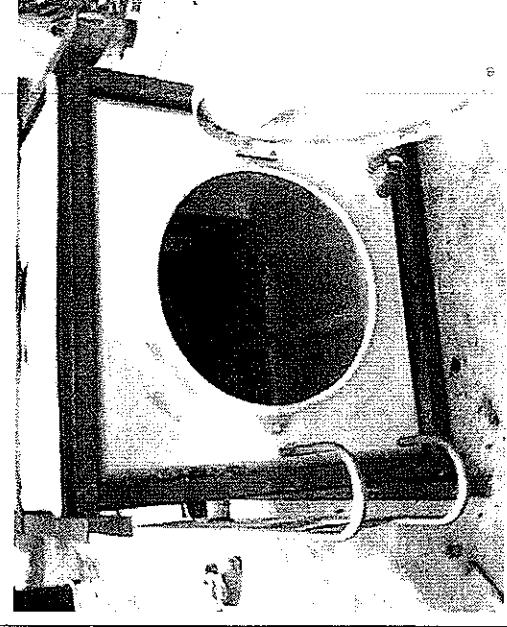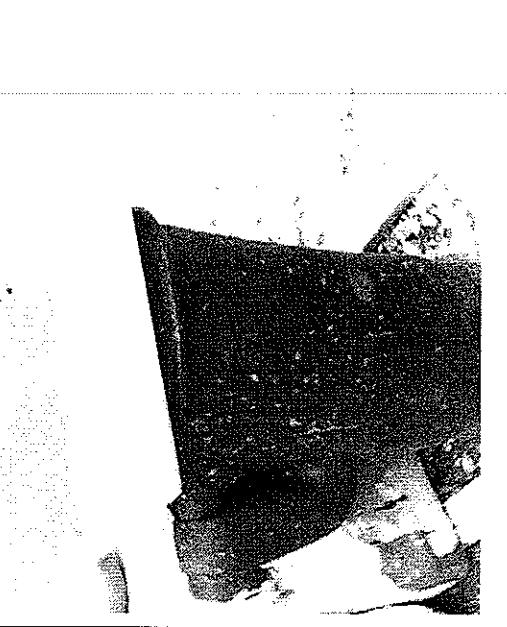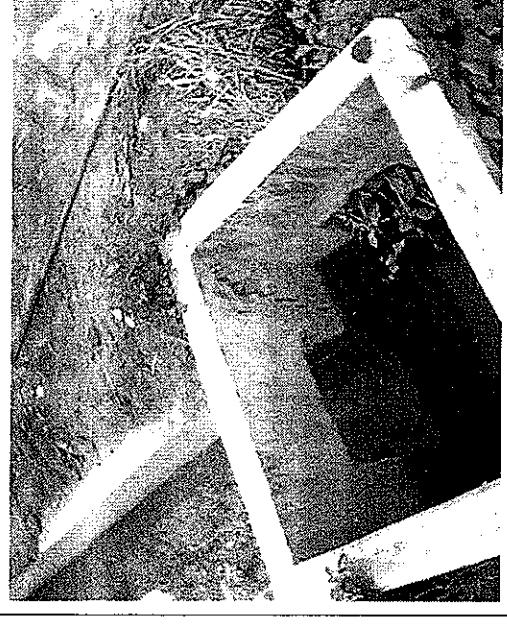	Photo 090402_001		Photo 090402_002
	Photo 090402_003		Photo 090402_004
	Photo 090402_005		Photo 090402_006

Photos

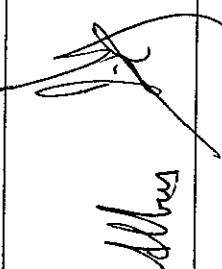


Photo 090402_007



Photo 090402_008

Inspection Date : 7 April 2009
 Time : 09:30
 Weather : Sunny / Fine / Cloudy, Overcast / Drizzle / Rain / Storm / Hazy
 Wind : Calm / Light Breeze / Strong
 Temperature : 17 °C
 Humidity : High / Moderate / Low

Inspected by	CEDD	Contractor / Sub-Contractor	ET
Signature:	 7/4/2009	 M.H.Cheng	
Name:	CHAN TIN PUI	K.H.Kwok	H.T. Chow
Title	Env. Engineer	Site Agent.	A.E.O.

	Environmental Checklist			Implementation Stages*			Remark
	Yes	No	N/A				
Fugitive Dust Emission							
-	Dust control / mitigation measures shall be provided to prevent dust nuisance.						
-	Water sprays shall be provided and used to dampen materials.						
-	All stockpile of aggregate or spoil should be enclosed or covered and water applied in dry or windy condition.						
-	Any vehicle with open load carrying area used for moving materials which has the potential to create dust shall have properly fitting side and tail boards. Material having the potential to create dust shall not be loaded to a level higher than the side and tail boards, and shall be covered by a clean tarpaulin.						
-	Unpaved areas should be watered regularly to avoid dust generation.						
-	The designated site main haul road shall be paved or regular watering.						
-	The haul road inside the site and public road around the site entrance should be kept clean and free from dust.						
-	Wheel washing facilities including high-pressure water jet shall be provided at the entrance of work site.						
-	Every vehicle shall be washed to remove any dusty materials from its body and wheels before leaving the fill bank.						
-	The temporary slope surfaces shall be covered with impermeable sheet or sprayed with water.						
-	Vehicle and equipment should be switched off while not in use.						
-	All plant and equipment should be well maintained e.g. without black smoke emission.						
-	Open burning should be prohibited.						
Noise Impact							
-	The approved method of working, equipment and sound-reducing measures (e.g. use of silenced type of equipment, etc.) shall be adapted.						
-	The constructions works should be scheduled to minimize noise nuisance.						
-	Only well maintained plant should be operated on-site and plant should be serviced regularly during the construction works.						
-	Powered mechanical equipment (PME) should be covered or shielded by appropriate acoustic materials.						
-	Air compressors and hand held breakers should have noise labels.						
-	Compressors and generators should operate with door closed.						
-	Machines and plants that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum.						
-	Noisy equipment and mobile plant shall always be site away from NSRs.						

Environmental Checklist			Implementation Stages*			Remark
	Yes	No	N/A			
Water Quality						
▪ Drainage system and the sand / silt removal facilities should be adequate and well maintained to prevent flooding and overflow, especially after rain storms.				✓		Item 5
▪ The stormwater intercepting system shall be effective to collect of runoff and remove suspended solids before discharge.	✓					
▪ Unnecessary water retained in receptacles and standing water should be avoided to prevent mosquito breeding.		✓				Item 3
▪ The material shall be properly covered to prevent washed away especially before rainstorm.		✓				
▪ The temporary slope surfaces shall be covered with impermeable sheet or sprayed with water.	✓					
▪ Final slope surfaces, especially those facing to the north of the site shall be treated by compaction, followed by hydroseeding, vegetation planting or sealing with shotconcrete, latex, vinyl, bitumen, or other suitable surface stabilizer approved by CEDD.	✓					
▪ Existing and newly constructed Catchpits, sand and silt removal facilities and intercepting channels shall be maintained, and the deposited silt and grit shall be removed weekly and on a need basis especially at the onset of and after each rainstorm to ensure that these facilities are functioning properly at all times.	✓					
▪ A wheel washing bay shall be provided at the site exit and wash-water shall have sand and silt settled out or removed before being discharged into storm drains.	✓					
▪ The section of construction road between wheel washing bay and the public road shall be paved with concrete, bituminous materials or hardcore to reduce vehicle tracking of soil and to prevent site run-off from entering public road drains.	✓					
▪ Sewage from toilets shall be discharged in to a foul sewer, or chemical toilets shall be provided.	✓					
▪ The chemical toilets (if use) shall be provided by a licensed contractor, who will be responsible for disposal and maintenance of these facilities.	✓					
▪ Tipping halls enclosed with top and 3-side to prevent spillage of material into marine water.	✓					
▪ The barges shall be in right size such that adequate clearance is maintained between the vessels and the seabed at all states of the tide to ensure the undue turbidity is not generated by turbulence from vessel movement or propeller wash.	✓					
▪ All vessels used for transportation of fill material shall have tight fitting seals to their bottom openings to prevent leakage of material during transport.	✓					
▪ Barges shall not be filled to a level which may cause the overflow of material during loading or transportation. Barge effluents shall be properly collected and treated before disposal.	✓					
▪ Adequate environmental control measures shall be provided to prevent / avoid dropping of fill material into the sea during the transfer.	✓					
▪ The work activities shall not cause any visible foam, oil, grease, scum, litter or other objectionable matters to be present on the water in the vicinity of the barging facilities.	✓					
▪ A waste collection vessel shall be deployed to remove floating debris.	✓					
Landscape and Visual						
▪ The maximum stockpiling height at the fill bank shall be limited to a maximum of +40mPD.	✓					
▪ Surface of outer slopes of the Fill Bank shall preferably be hydroseeded.	✓					
▪ Stockpile of public fill shall be removed in a sequence to allow the outer hydroseeded to be removed later than other portions as far as practicable.	✓					
▪ Casuarina equisetifolia were planted as buffer tree along the northern perimeter of the Site. The height of Casuarina equisetifolia was maintained at least 3m above soil level.	✓					
▪ Lighting shall be set to minimise night-time glare.	✓					

	Environmental Checklist	Implementation Stages*			Remark
		Yes	No	N/A	
Waste Management					
Construction Waste Management					
	<ul style="list-style-type: none"> ▪ Relevant licence / permits for disposal of construction waste or excavated materials available for inspection. ▪ Excavated material to be generated from construction works to be re-used on-site as far as practicable to reduce off-site disposal. ▪ Mud and debris should be removed from waterworks access roads and associated drainage systems. ▪ Provision of sufficient waste disposal points and regular collection for disposal. Appropriate measures should be employed to minimise windblown litter and dust during transportation of waste by either covering trucks or by transporting wastes in enclosed containers. ▪ Segregation and storage of different types of waste in different containers, skips or stockpiles to enhance reuse or recycling of materials and their proper disposal. ▪ Prior to disposal of C&D waste, recyclable materials should be salvaged for reuse (such as wood and metal) and inert waste utilised as public fill to minimise the quantity of waste to be disposed of to landfill. ▪ In order to monitor the disposal of C&D material and solid wastes at public filling areas and landfills, and to control fly-tipping, a trip-ticket system should be included as one of the contractual requirements. ▪ Any soil contaminated with chemicals/oils shall be removed from site and the void created shall be filled with suitable materials. 	✓	✓	✓	Item 5
Chemical Waste Management					
	<ul style="list-style-type: none"> ▪ It is required to register as a chemical waste producer if chemical wastes would be produced from the construction activities. The Waste Disposal Ordinance (Cap 354) and its subsidiary regulations in particular the Waste Disposal (Chemical Waste) (General) Regulation should be observed and complied with for control of chemical wastes. ▪ After use, chemical wastes (e.g. cleaning fluids, solvents, lubrication oil and fuel) should be handled according to the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes. ▪ Spent chemicals should be stored and collected by an approved operator for disposal at the Chemical Waste Treatment Facility or other licensed facility in accordance with the Chemical Waste (General) Regulation. ▪ Chemical wastes should be separated for special handling and appropriate treatment at the Chemical Waste Treatment Facility. ▪ Chemical wastes including waste oil should be stored properly in designated areas, e.g. chemical waste storage area. ▪ The designated chemical waste storage area should only be used for storing chemical wastes. ▪ The set-up of chemical waste storage area should <ul style="list-style-type: none"> ▪ Be suitable for the substance they are holding, resistant to corrosion, maintained in a good condition. ▪ Be enclosed on at least 3 sides and securely closed. ▪ Have an impermeable floor and bunding, of capacity to accommodate 110% of the volume of the largest container or 20% by volume of the chemical waste stored in that area, whichever is the greatest. ▪ Have adequate ventilation. ▪ Be covered to prevent rainfall entering (water collected within the bund must be tested and disposal as chemical waste if necessary). ▪ Be arranged so that incompatible materials are adequately separated. 	✓	✓	✓	Item 6

Environmental Checklist	Implementation Stages*			Remark
	Yes	No	N/A	
■ Warning panels should be displayed at the waste storage area.	✓			
■ Waste storage area should be cleaned and maintained regularly.	✓			
■ Chemical waste should be transported by a registered chemical waste collector to a facility licensed to receive chemical waste.	✓			
■ All generators, fuel and oil storage should be within bundle areas.	✓			Item 6
■ Oil leakage from machinery, vehicle and plant should be prevented.	✓			
■ In the event of chemical waste / dangerous goods / chemicals spillage or leakage, the procedures as outlined in the Spillage Response Plan should be followed.	✓			
■ The dangerous goods / chemical spillage or leakage procedures (including equipments) should be in place.	✓			
Good Site Practices				
■ Nomination of approved personnel, such as site manager, to be responsible for good site practices, arrangements for collection and effective disposal to an appropriate facility, of all wastes generated at the site.	✓			
■ Training of site personnel in proper waste management and chemical handling procedures should be provided.	✓			
■ Good site practices should be adopted to clean the rubbish and litter on a regular basis so as to prevent the rubbish and litter from dropping into the nearby environment..	✓			
■ Proper storage and site practices to minimise the potential for damage or contamination of construction materials.	✓			
■ The Environmental Permit should be displaced conspicuously on site.	✓			
■ Construction noise permits should be posted at site entrance or available for site inspection.	✓			
■ Plan and stock construction materials carefully to minimise amount of waste generated and avoid unnecessary generation of waste.	✓			
■ Chemical storage area provided with lock and located on sealed areas.	✓			
■ All chemicals should be placed at the banded area with adequate band capacity (>110% of largest tank).	✓			
■ Any unused chemicals or those with remaining functional capacity should be recycled.	✓			
■ Regular cleaning and maintenance programme for waste storage area, drainage systems, silt traps, sumps and oil interceptors.	✓			
■ To encourage collection of aluminium cans by individual collectors, separate labelled bins should be provided to segregate this waste from other general refuse generated by the workforce.	✓			
■ A recording system for the amount of wastes generated, recycled and disposed (including the disposal sites) should be used, e.g. trip ticket system for chemical waste disposal. Quantities could be determined by weighing each load or other suitable methods.	✓			
■ A collection area should be provided where waste can be stored and loaded prior to removal from site. An enclosed and covered area is preferred to reduce the occurrence of 'wind blown' light material. If an open area is unavoidable for the storage or loading/unloading of wastes, then the area should be bunded and all the polluted surface run-off collected within this area should be diverted into wastewater treatment system.	✓			Item 7

Summary of the Weekly Site Inspection:

Item	Details of defective works or observations	Photo Ref.	Further Action Required (Yes/No)
1	Follow up action to the previous site inspections item 1 on 26/03/09 and item 1 on 02/04/09, rubbish and withered vegetation discarded on the ground near the CEDD site office were collected.	090407_001	No
2	Follow up action to the previous site inspections item 2 on 26/03/09 and item 2 on 02/04/09, mud and silt accumulated inside in the u-channel near CEDD site office were cleaned up.	090407_002	No
3	Follow up action to the previous site inspection item 4 on 02/04/09, stagnant water was still noted on the ground next to the Contractor's site office. The Contractor was reminded to drain the stagnant water or apply pesticide to avoid mosquito breeding.	090407_003	Yes
4	Follow up action to the previous site inspection item 5 on 02/04/09, mud and silt accumulated inside the u-channel at weight bridge No.5 were cleaned up.	090407_004	No
5	Rubbish (e.g. lunch boxes) and vegetation were noted inside the main drainage channel. The Contractor was reminded to clean up the rubbish and vegetation in order to avoid any blockage.	090407_005	Yes
6	Follow up action to the previous site inspections item 6 on 26/03/09 and item 8 on 02/04/09, oil leakage was still noted from a crack of a drip tray at chemical waste storage area. The Contractor was reminded to clean up the leak oil and repair the damaged drip tray.	090407_006	Yes
7	Follow up action to the previous site inspections item 5 on 26/03/09 and item 7 on 02/04/09, C&D wastes were still noted discarded near chemical waste storage area. The Contractor was reminded to collect and dispose the waste properly.	090407_007	Yes

Remark

--

Checked by	Name	Title	Signature	Date
	Linda Law	Senior Environmental Officer		07 April 2009

Photos

	Photo 090407_001		Photo 090407_002		Photo 090407_003		Photo 090407_004		Photo 090407_005		Photo 090407_006		Photo 090407_007		Photo 090407_008
	Photo 090407_009		Photo 090407_010		Photo 090407_011		Photo 090407_012		Photo 090407_013		Photo 090407_014		Photo 090407_015		Photo 090407_016

Photos



Photo 090407_007

Inspection Date : 16 April 2009

Time : 10:15

Weather : Sunny / Fine / Cloudy / Overcast / Drizzle / Rain / Storm / Hazy

Wind : Calm / Light / Breeze / Strong

Temperature : 26 °C

Humidity : High / Moderate / Low

Inspected by	CEDD	Contractor / Sub-Contractor	ET
Signature:			
Name:	CHAN TIN PUI	CHAN HOI HIN WAI	W. L. LI
Title	Allow / P6	Supervisor / Site Agent	E.T.

	Environmental Checklist			Implementation Stages*			Remark
	Yes	No	N/A				
Fugitive Dust Emission							
-	Dust control / mitigation measures shall be provided to prevent dust nuisance.			✓			
-	Water sprays shall be provided and used to dampen materials.			✓			
-	All stockpile of aggregate or spoil should be enclosed or covered and water applied in dry or windy condition.			✓			
-	Any vehicle with open load carrying area used for moving materials which has the potential to create dust shall have properly fitting side and tail boards. Material having the potential to create dust shall not be loaded to a level higher than the side and tail boards, and shall be covered by a clean tarpaulin.			✓			
-	Unpaved areas should be watered regularly to avoid dust generation.			✓			
-	The designated site main haul road shall be paved or regular watering.			✓			
-	The haul road inside the site and public road around the site entrance should be kept clean and free from dust.			✓			
-	Wheel washing facilities including high-pressure water jet shall be provided at the entrance of work site.			✓			
-	Every vehicle shall be washed to remove any dusty materials from its body and wheels before leaving the fill bank.			✓			
-	The temporary slope surfaces shall be covered with impermeable sheet or sprayed with water.			✓			
-	Vehicle and equipment should be switched off while not in use.			✓			
-	All plant and equipment should be well maintained e.g. without black smoke emission.			✓			
-	Open burning should be prohibited.			✓			
Noise Impact							
-	The approved method of working, equipment and sound-reducing measures (e.g. use of silenced type of equipment, etc.) shall be adapted.			✓			
-	The construction works should be scheduled to minimize noise nuisance.			✓			
-	Only well maintained plant should be operated on-site and plant should be serviced regularly during the construction works.			✓			
-	Powered mechanical equipment (PME) should be covered or shielded by appropriate acoustic materials.			✓			
-	Air compressors and hand held breakers should have noise labels.			✓			
-	Compressors and generators should operate with door closed.			✓			
-	Machines and plants that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum.			✓			
-	Noisy equipment and mobile plant shall always be site away from NSRs.			✓			

	Environmental Checklist			Implementation Stages*			Remark
	Yes	No	N/A				
Water Quality							
▪ Drainage system and the sand / silt removal facilities should be adequate and well maintained to prevent flooding and overflow, especially after rain storms.	✓						
▪ The stormwater intercepting system shall be effective to collect of runoff and remove suspended solids before discharge.	✓						
▪ Unnecessary water retained in receptacles and standing water should be avoided to prevent mosquito breeding.	✓						Item 1
▪ The material shall be properly covered to prevent washed away especially before rainstorm.	✓						
▪ The temporary slope surfaces shall be covered with impermeable sheet or sprayed with water.	✓						
▪ Final slope surfaces, especially those facing to the north of the site shall be treated by compaction, followed by hydroseeding, vegetation planting or sealing with shotconcrete, latex, vinyl, bitumen, or other suitable surface stabilizer approved by CEDD.	✓						
▪ Existing and newly constructed Catchpits, sand and silt removal facilities and intercepting channels shall be maintained, and the deposited silt and grit shall be removed weekly and on a need basis especially at the onset of and after each rainstorm to ensure that these facilities are functioning properly at all times.	✓						
▪ A wheel washing bay shall be provided at the site exit and wash-water shall have sand and silt settled out or removed before being discharged into storm drains.	✓						
▪ The section of construction road between wheel washing bay and the public road shall be paved with concrete, bituminous materials or hardcore to reduce vehicle tracking of soil and to prevent site run-off from entering public road drains.	✓						
▪ Sewage from toilets shall be discharged in to a foul sewer, or chemical toilets shall be provided.	✓						
▪ The chemical toilets (if use) shall be provided by a licensed contractor, who will be responsible for disposal and maintenance of these facilities.	✓						
▪ Tipping halls enclosed with top and 3-side to prevent spillage of material into marine water.	✓						
▪ The barges shall be in right size such that adequate clearance is maintained between the vessels and the seabed at all states of the tide to ensure the undue turbidity is not generated by turbulence from vessel movement or propeller wash.	✓						
▪ All vessels used for transportation of fill material shall have tight fitting seals to their bottom openings to prevent leakage of material during transport.	✓						
▪ Barges shall not be filled to a level which may cause the overflow of material during loading or transportation. Barge effluents shall be properly collected and treated before disposal.	✓						
▪ Adequate environmental control measures shall be provided to prevent / avoid dropping of fill material into the sea during the transfer.	✓						
▪ The work activities shall not cause any visible foam, oil, grease, scum, litter or other objectionable matters to be present on the water in the vicinity of the barging facilities.	✓						
▪ A waste collection vessel shall be deployed to remove floating debris.	✓						
Landscape and Visual							
▪ The maximum stockpiling height at the fill bank shall be limited to a maximum of +40mPD.	✓						
▪ Surface of outer slopes of the Fill Bank shall preferably be hydroseeded.	✓						
▪ Stockpile of public fill shall be removed in a sequence to allow the outer hydroseeded to be removed later than other portions as far as practicable.	✓						
▪ Casuarina equisetifolia were planted as buffer tree along the northern perimeter of the Site. The height of Casuarina equisetifolia was maintained at least 3m above soil level.	✓						
▪ Lighting shall be set to minimise night-time glare.	✓						



Environmental Checklist			Implementation Stages*			Remark
	Yes	No	N/A			
Waste Management						
Construction Waste Management						
<ul style="list-style-type: none"> ▪ Relevant licence / permits for disposal of construction waste or excavated materials available for inspection. ▪ Excavated material to be generated from construction works to be re-used on-site as far as practicable to reduce off-site disposal. ▪ Mud and debris should be removed from waterworks access roads and associated drainage systems. ▪ Provision of sufficient waste disposal points and regular collection for disposal. Appropriate measures should be employed to minimise windblown litter and dust during transportation of waste by either covering trucks or by transporting wastes in enclosed containers. ▪ Segregation and storage of different types of waste in different containers, skips or stockpiles to enhance reuse or recycling of materials and their proper disposal. ▪ Prior to disposal of C&D waste, recyclable materials should be salvaged for reuse (such as wood and metal) and inert waste utilised as public fill to minimise the quantity of waste to be disposed of to landfill. ▪ In order to monitor the disposal of C&D material and solid wastes at public filling areas and landfills, and to control fly-tipping, a trip-ticket system should be included as one of the contractual requirements. ▪ Any soil contaminated with chemicals/oils shall be removed from site and the void created shall be filled with suitable materials. 	✓	✓	✓	✓		
Chemical Waste Management						
<ul style="list-style-type: none"> ▪ It is required to register as a chemical waste producer if chemical wastes would be produced from the construction activities. The Waste Disposal Ordinance (Cap 354) and its subsidiary regulations in particular the Waste Disposal (Chemical Waste) (General) Regulation should be observed and complied with for control of chemical wastes. ▪ After use, chemical wastes (e.g. cleaning fluids, solvents, lubrication oil and fuel) should be handled according to the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes. ▪ Spent chemicals should be stored and collected by an approved operator for disposal at the Chemical Waste Treatment Facility or other licensed facility in accordance with the Chemical Waste (General) Regulation. ▪ Chemical wastes should be separated for special handling and appropriate treatment at the Chemical Waste Treatment Facility. ▪ Chemical wastes including waste oil should be stored properly in designated areas, e.g. chemical waste storage area. ▪ The designated chemical waste storage area should only be used for storing chemical wastes. ▪ The set-up of chemical waste storage area should <ul style="list-style-type: none"> ▪ Be suitable for the substance they are holding, resistant to corrosion, maintained in a good condition. ▪ Be enclosed on at least 3 sides and securely closed. ▪ Have an impermeable floor and bunding, of capacity to accommodate 110% of the volume of the largest container or 20% by volume of the chemical waste stored in that area, whichever is the greatest. ▪ Have adequate ventilation. ▪ Be covered to prevent rainfall entering (water collected within the bund must be tested and disposal as chemical waste if necessary). ▪ Be arranged so that incompatible materials are adequately separated. 	✓	✓	✓	✓	✓	




Environmental Checklist	Implementation Stages*			Remark
	Yes	No	N/A	
■ Warning panels should be displayed at the waste storage area.	✓			
■ Waste storage area should be cleaned and maintained regularly.	✓			
■ Chemical waste should be transported by a registered chemical waste collector to a facility licensed to receive chemical waste.	✓			
■ All generators, fuel and oil storage should be within bundle areas.	✓			
■ Oil leakage from machinery, vehicle and plant should be prevented.	✓			
■ In the event of chemical waste / dangerous goods / chemicals spillage or leakage, the procedures as outlined in the Spillage Response Plan should be followed.	✓			
■ The dangerous goods / chemical spillage or leakage procedures (including equipments) should be in place.	✓			
Good Site Practices				
■ Nomination of approved personnel, such as site manager, to be responsible for good site practices, arrangements for collection and effective disposal to an appropriate facility, of all wastes generated at the site.	✓			
■ Training of site personnel in proper waste management and chemical handling procedures should be provided.	✓			
■ Good site practices should be adopted to clean the rubbish and litter on a regular basis so as to prevent the rubbish and litter from dropping into the nearby environment..	✓			
■ Proper storage and site practices to minimise the potential for damage or contamination of construction materials.	✓			
■ The Environmental Permit should be displayed conspicuously on site.	✓			
■ Construction noise permits should be posted at site entrance or available for site inspection.	✓			
■ Plan and stock construction materials carefully to minimise amount of waste generated and avoid unnecessary generation of waste.	✓			
■ Chemical storage area provided with lock and located on sealed areas.	✓			
■ All chemicals should be placed at the banded area with adequate band capacity (>110% of largest tank).	✓			
■ Any unused chemicals or those with remaining functional capacity should be recycled.	✓			
■ Regular cleaning and maintenance programme for waste storage area, drainage systems, silt traps, sumps and oil interceptors.	✓			
■ To encourage collection of aluminium cans by individual collectors, separate labelled bins should be provided to segregate this waste from other general refuse generated by the workforce.	✓			
■ A recording system for the amount of wastes generated, recycled and disposed (including the disposal sites) should be used, e.g. trip ticket system for chemical waste disposal. Quantities could be determined by weighing each load or other suitable methods.	✓			
■ A collection area should be provided where waste can be stored and loaded prior to removal from site. An enclosed and covered area is preferred to reduce the occurrence of 'wind blown' light material. If an open area is unavoidable for the storage or loading/unloading of wastes, then the area should be bunded and all the polluted surface run-off collected within this area should be diverted into wastewater treatment system.	✓		Item 7	

Summary of the Weekly Site Inspection:

Item	Details of defective works or observations	Photo Ref.	Further Action Required (Yes/No)
1	Follow up action to the previous site inspections item 4 on 02/04/09 and item 3 on 07/04/09, stagnant water was still noted on the ground next to the Contractor's site office. The Contractor was reminded to drain the stagnant water or apply pesticide to avoid mosquito breeding.	090416_001	Yes
2	Follow up action to the previous site inspection item 5 on 07/04/09, rubbish (e.g. lunch boxes) and vegetation noted inside the main drainage channel were cleaned up.	090416_002	No
3	Follow up action to the previous site inspections item 6 on 26/03/09, item 8 on 02/04/09 and item 6 on 07/04/09, leak oil noted from a crack of a drip tray at chemical waste storage area was cleaned up and no oil leakage was noted during the inspection.	090416_003	No
4	Follow up action to the previous site inspections item 5 on 26/03/09, item 7 on 02/04/09 and item 7 on 07/04/09, C&D wastes were still noted discarded near chemical waste storage area. The Contractor was reminded to collect and dispose the wastes properly.	090416_004	Yes

Remark

Checked by	Name	Title	Signature	Date
	Linda Law	Senior Environmental Officer		16 April 2009

Photos

	Photo 090416_003
	Photo 090416_002
	Photo 090416_001
	Photo 090416_004

Inspection Date : 23 April 2009.

Time : 10:00

Weather : Sunny / Fine Cloudy / Overcast / Drizzle / Rain / Storm / Hazy

Wind : Calm / Light Breeze / Strong

Temperature : 25°C

Humidity : High Moderate Low

Inspected by	CEDD	Contractor / Sub-Contractor	ET
Signature:			
Name:	CHAN TIN PUI	K.H.Kwok, Wayne Kwok, CK	
Title	Allow / PL	Site Agent, Site Agent, Officer	A.E.O.

Environmental Checklist			Implementation Stages*			Remark		
	Yes	No	N/A					
Fugitive Dust Emission								
-	Dust control / mitigation measures shall be provided to prevent dust nuisance.			✓				
-	Water sprays shall be provided and used to dampen materials.			✓				
-	All stockpile of aggregate or spoil should be enclosed or covered and water applied in dry or windy condition.			✓				
-	Any vehicle with open load carrying area used for moving materials which has the potential to create dust shall have properly fitting side and tail boards. Material having the potential to create dust shall not be loaded to a level higher than the side and tail boards, and shall be covered by a clean tarpaulin.			✓				
-	Unpaved areas should be watered regularly to avoid dust generation.			✓				
-	The designated site main haul road shall be paved or regular watering.			✓				
-	The haul road inside the site and public road around the site entrance should be kept clean and free from dust.			✓				
-	Wheel washing facilities including high-pressure water jet shall be provided at the entrance of work site.			✓				
-	Every vehicle shall be washed to remove any dusty materials from its body and wheels before leaving the fill bank.			✓				
-	The temporary slope surfaces shall be covered with impermeable sheet or sprayed with water.			✓				
-	Vehicle and equipment should be switched off while not in use.			✓				
-	All plant and equipment should be well maintained e.g. without black smoke emission.			✓				
-	Open burning should be prohibited.			✓				
Noise Impact								
-	The approved method of working, equipment and sound-reducing measures (e.g. use of silenced type of equipment, etc.) shall be adapted.			✓				
-	The constructions works should be scheduled to minimize noise nuisance.			✓				
-	Only well maintained plant should be operated on-site and plant should be serviced regularly during the construction works.			✓				
-	Powered mechanical equipment (PME) should be covered or shielded by appropriate acoustic materials.			✓				
-	Air compressors and hand held breakers should have noise labels.			✓				
-	Compressors and generators should operate with door closed.			✓				
-	Machines and plants that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum.			✓				
-	Noisy equipment and mobile plant shall always be site away from NSPs.			✓				

	Environmental Checklist			Implementation Stages*			Remark	
	Yes	No	N/A					
Water Quality								
	- Drainage system and the sand / silt removal facilities should be adequate and well maintained to prevent flooding and overflow, especially after rain storms.			✓				
	- The stormwater intercepting system shall be effective to collect of runoff and remove suspended solids before discharge.			✓				
	- Unnecessary water retained in receptacles and standing water should be avoided to prevent mosquito breeding.			✓				
	- The material shall be properly covered to prevent washed away especially before rainstorm.			✓				
	- The temporary slope surfaces shall be covered with impermeable sheet or sprayed with water.			✓				
	- Final slope surfaces, especially those facing to the north of the site shall be treated by compaction, followed by hydroseeding, vegetation planting or sealing with shotconcrete, latex, vinyl, bitumen, or other suitable surface stabilizer approved by CEDD.			✓				
	- Existing and newly constructed Catchpits, sand and silt removal facilities and intercepting channels shall be maintained, and the deposited silt and grit shall be removed weekly and on a need basis especially at the onset of and after each rainstorm to ensure that these facilities are functioning properly at all times.			✓				
	- A wheel washing bay shall be provided at the site exit and wash-water shall have sand and silt settled out or removed before being discharged into storm drains.			✓				
	- The section of construction road between wheel washing bay and the public road shall be paved with concrete, bituminous materials or hardcore to reduce vehicle tracking of soil and to prevent site run-off from entering public road drains.			✓				
	- Sewage from toilets shall be discharged in to a foul sewer, or chemical toilets shall be provided.			✓				
	- The chemical toilets (if use) shall be provided by a licensed contractor, who will be responsible for disposal and maintenance of these facilities.			✓				
	- Tipping halls enclosed with top and 3-side to prevent spillage of material into marine water.			✓				
	- The barges shall be in right size such that adequate clearance is maintained between the vessels and the seabed at all states of the tide to ensure the undue turbidity is not generated by turbulence from vessel movement or propeller wash.			✓				
	- All vessels used for transportation of fill material shall have tight fitting seals to their bottom openings to prevent leakage of material during transport.			✓				
	- Barges shall not be filled to a level which may cause the overflow of material during loading or transportation. Barge effluents shall be properly collected and treated before disposal.			✓				
	- Adequate environmental control measures shall be provided to prevent / avoid dropping of fill material into the sea during the transfer.			✓				
	- The work activities shall not cause any visible foam, oil, grease, scum, litter or other objectionable matters to be present on the water in the vicinity of the barging facilities.			✓				
	- A waste collection vessel shall be deployed to remove floating debris.			✓				
Landscape and Visual								
	- The maximum stockpiling height at the fill bank shall be limited to a maximum of +40mPD.			✓				
	- Surface of outer slopes of the Fill Bank shall preferably be hydroseeded.			✓				
	- Stockpile of public fill shall be removed in a sequence to allow the outer hydroseeded to be removed later than other portions as far as practicable.			✓				
	- Casuarina equisetifolia were planted as buffer tree along the northern perimeter of the Site. The height of Casuarina equisetifolia was maintained at least 3m above soil level.			✓				
	- Lighting shall be set to minimise night-time glare.			✓				

	Environmental Checklist	Implementation Stages*			Remark
		Yes	No	N/A	
Waste Management					
Construction Waste Management					
<ul style="list-style-type: none"> ▪ Relevant licence / permits for disposal of construction waste or excavated materials available for inspection. ▪ Excavated material to be generated from construction works to be re-used on-site as far as practicable to reduce off-site disposal. ▪ Mud and debris should be removed from waterworks access roads and associated drainage systems. ▪ Provision of sufficient waste disposal points and regular collection for disposal. Appropriate measures should be employed to minimise windblown litter and dust during transportation of waste by either covering trucks or by transporting wastes in enclosed containers. ▪ Segregation and storage of different types of waste in different containers, skips or stockpiles to enhance reuse or recycling of materials and their proper disposal. ▪ Prior to disposal of C&D waste, recyclable materials should be salvaged for reuse (such as wood and metal) and inert waste utilised as public fill to minimise the quantity of waste to be disposed of to landfill. ▪ In order to monitor the disposal of C&D material and solid wastes at public filling areas and landfills, and to control fly-tipping, a trip-ticket system should be included as one of the contractual requirements. ▪ Any soil contaminated with chemicals/oils shall be removed from site and the void created shall be filled with suitable materials. 	✓	✓	✓		
Chemical Waste Management					
<ul style="list-style-type: none"> ▪ It is required to register as a chemical waste producer if chemical wastes would be produced from the construction activities. The Waste Disposal Ordinance (Cap 354) and its subsidiary regulations in particular the Waste Disposal (Chemical Waste) (General) Regulation should be observed and complied with for control of chemical wastes. ▪ After use, chemical wastes (e.g. cleaning fluids, solvents, lubrication oil and fuel) should be handled according to the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes. ▪ Spent chemicals should be stored and collected by an approved operator for disposal at the Chemical Waste Treatment Facility or other licensed facility in accordance with the Chemical Waste (General) Regulation. ▪ Chemical wastes should be separated for special handling and appropriate treatment at the Chemical Waste Treatment Facility. ▪ Chemical wastes including waste oil should be stored properly in designated areas, e.g. chemical waste storage area. ▪ The designated chemical waste storage area should only be used for storing chemical wastes. ▪ The set-up of chemical waste storage area should <ul style="list-style-type: none"> ▪ Be suitable for the substance they are holding, resistant to corrosion, maintained in a good condition. ▪ Be enclosed on at least 3 sides and securely closed. ▪ Have an impermeable floor and bunding, of capacity to accommodate 110% of the volume of the largest container or 20% by volume of the chemical waste stored in that area, whichever is the greatest. ▪ Have adequate ventilation. ▪ Be covered to prevent rainfall entering (water collected within the bund must be tested and disposal as chemical waste if necessary). ▪ Be arranged so that incompatible materials are adequately separated. 	✓	✓	✓		

Environmental Checklist	Implementation Stages*			Remark
	Yes	No	N/A	
■ Warning panels should be displayed at the waste storage area.	✓			
■ Waste storage area should be cleaned and maintained regularly.	✓			
■ Chemical waste should be transported by a registered chemical waste collector to a facility licensed to receive chemical waste.	✓			
■ All generators, fuel and oil storage should be within bundle areas.	✓			
■ Oil leakage from machinery, vehicle and plant should be prevented.	✓			
■ In the event of chemical waste / dangerous goods / chemicals spillage or leakage, the procedures as outlined in the Spillage Response Plan should be followed.	✓			
■ The dangerous goods / chemical spillage or leakage procedures (including equipments) should be in place.	✓			
Good Site Practices				
■ Nomination of approved personnel, such as site manager, to be responsible for good site practices, arrangements for collection and effective disposal to an appropriate facility, of all wastes generated at the site.	✓			
■ Training of site personnel in proper waste management and chemical handling procedures should be provided.	✓			
■ Good site practices should be adopted to clean the rubbish and litter on a regular basis so as to prevent the rubbish and litter from dropping into the nearby environment.	✓			
■ Proper storage and site practices to minimise the potential for damage or contamination of construction materials.	✓			
■ The Environmental Permit should be displayed conspicuously on site.	✓			
■ Construction noise permits should be posted at site entrance or available for site inspection.	✓			
■ Plan and stock construction materials carefully to minimise amount of waste generated and avoid unnecessary generation of waste.	✓			
■ Chemical storage area provided with lock and located on sealed areas.	✓			
■ All chemicals should be placed at the banded area with adequate band capacity (>110% of largest tank).	✓			
■ Any unused chemicals or those with remaining functional capacity should be recycled.	✓			
■ Regular cleaning and maintenance programme for waste storage area, drainage systems, silt traps, sumps and oil interceptors.	✓			
■ To encourage collection of aluminium cans by individual collectors, separate labelled bins should be provided to segregate this waste from other general refuse generated by the workforce.	✓			
■ A recording system for the amount of wastes generated, recycled and disposed (including the disposal sites) should be used, e.g. trip ticket system for chemical waste disposal. Quantities could be determined by weighing each load or other suitable methods.	✓			
■ A collection area should be provided where waste can be stored and loaded prior to removal from site. An enclosed and covered area is preferred to reduce the occurrence of wind blown light material. If an open area is unavoidable for the storage or loading/unloading of wastes, then the area should be bunded and all the polluted surface run-off collected within this area should be diverted into wastewater treatment system.	✓			Item 1 and 3

Summary of the Weekly Site Inspection:

Item	Details of defective works or observations	Photo Ref.	Further Action Required (Yes/No)
1	Rubbish and C&D wastes were found on the tusock at dump truck's parking area. The Contractor was reminded to collect and dispose them properly.	090423_001	Yes
2	Follow up action to the previous site inspections item 4 on 02/04/09, item 3 on 07/04/09 and item 1 on 16/04/09, no stagnant water was noted on the ground next to the Contractor's site office.	090423_002	No
3	Follow up action to the previous site inspections item 5 on 26/03/09, item 7 on 02/04/09, item 7 on 07/04/09 and item 4 on 16/04/09, C&D wastes were still noted discarded near chemical waste storage area. The Contractor was reminded to collect and dispose the waste properly.	090423_003	Yes

Remark

--

Name	Title	Signature	Date
Checked by Linda Law	Senior Environmental Officer		23 April 2009

Photos



Photo 090423_001



Photo 090423_002

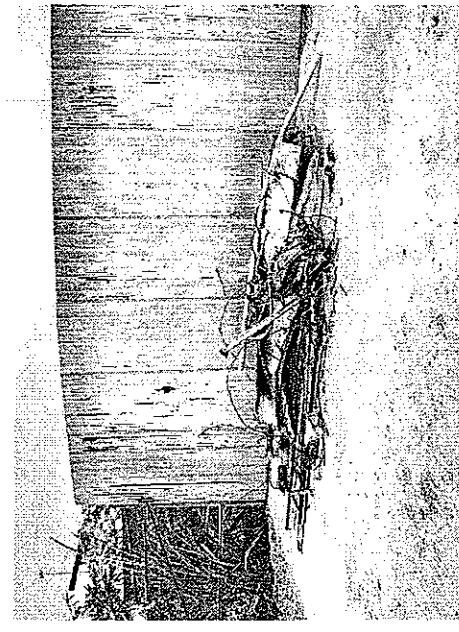
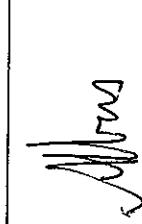


Photo 090423_003

Inspection Date : 30 April 2009
 Time : 10:30

 Weather : Sunny / Fine / Cloudy / Overcast / Drizzle / Rain / Storm / Hazy
 Wind : Calm / Light Breeze / Strong

 Temperature : 27 °C
 Humidity : High / Moderate / Low

Inspected by	CEDD	Contractor / Sub-Contractor	ET
Signature:			
Name:	CHAN TIN PUI	M.H. Cheung Angel	H.T. Chow
Title	Allow/P6	En. Engineer Shar Ngok	A.E.O.

	Environmental Checklist	Implementation Stages*			Remark
		Yes	No	N/A	
Fugitive Dust Emission					
- Dust control / mitigation measures shall be provided to prevent dust nuisance.					
- Water sprays shall be provided and used to dampen materials.					
- All stockpile of aggregate or spoil should be enclosed or covered and water applied in dry or windy condition.					
- Any vehicle with open load carrying area used for moving materials which has the potential to create dust shall have properly fitting side and tail boards. Material having the potential to create dust shall not be loaded to a level higher than the side and tail boards, and shall be covered by a clean tarpaulin.					
- Unpaved areas should be watered regularly to avoid dust generation.					
- The designated site main haul road shall be paved or regular watering.					
- The haul road inside the site and public road around the site entrance should be kept clean and free from dust.					
- Wheel washing facilities including high-pressure water jet shall be provided at the entrance of work site.					
- Every vehicle shall be washed to remove any dusty materials from its body and wheels before leaving the fill bank.					
- The temporary slope surfaces shall be covered with impermeable sheet or sprayed with water.					
- Vehicle and equipment should be switched off while not in use.					
- All plant and equipment should be well maintained e.g. without black smoke emission.					
- Open burning should be prohibited.					
Noise Impact					
- The approved method of working, equipment and sound-reducing measures (e.g. use of silenced type of equipment, etc.) shall be adapted.					
- The constructions works should be scheduled to minimize noise nuisance.					
- Only well maintained plant should be operated on-site and plant should be serviced regularly during the construction works.					
- Powered mechanical equipment (PME) should be covered or shielded by appropriate acoustic materials.					
- Air compressors and hand held breakers should have noise labels.					
- Compressors and generators should operate with door closed.					
- Machines and plants that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum.					
- Noisy equipment and mobile plant shall always be site away from NSRs.					

Environmental Checklist			Implementation Stages*			Remark
	Yes	No	N/A			
Water Quality						
<ul style="list-style-type: none"> ▪ Drainage system and the sand / silt removal facilities should be adequate and well maintained to prevent flooding and overflow, especially after rain storms. ▪ The stormwater intercepting system shall be effective to collect of runoff and remove suspended solids before discharge. ▪ Unnecessary water retained in receptacles and standing water should be avoided to prevent mosquito breeding. ▪ The material shall be properly covered to prevent washed away especially before rain storm. ▪ The temporary slope surfaces shall be covered with impermeable sheet or sprayed with water. ▪ Final slope surfaces, especially those facing to the north of the site shall be treated by compaction, followed by hydroseeding, vegetation planting or sealing with shotconcrete, latex, vinyl, bitumen, or other suitable surface stabilizer approved by CEDD. ▪ Existing and newly constructed Catchpits, sand and silt removal facilities and intercepting channels shall be maintained and the deposited silt and grit shall be removed weekly and on a need basis especially at the onset of and after each rainstorm to ensure that these facilities are functioning properly at all times. ▪ A wheel washing bay shall be provided at the site exit and wash-water shall have sand and silt settled out or removed before being discharged into storm drains. ▪ The section of construction road between wheel washing bay and the public road shall be paved with concrete, bituminous materials or hardcores to reduce vehicle tracking of soil and to prevent site run-off from entering public road drains. ▪ Sewage from toilets shall be discharged in to a foul sewer, or chemical toilets shall be provided. ▪ The chemical toilets (if use) shall be provided by a licensed contractor, who will be responsible for disposal and maintenance of these facilities. ▪ Tipping halls enclosed with top and 3-side to prevent spillage of material into marine water. ▪ The barges shall be in right size such that adequate clearance in maintained between the vessels and the seabed at all states of the tide to ensure the undue turbidity is not generated by turbulence from vessel movement or propeller wash. ▪ All vessels used for transportation of fill material shall have tight fitting seals to their bottom openings to prevent leakage of material during transport. ▪ Barges shall not be filled to a level which may cause the overflow of material during loading or transportation. Barge effluents shall be properly collected and treated before disposal. ▪ Adequate environmental control measures shall be provided to prevent / avoid dropping of fill material into the sea during the transfer. ▪ The work activities shall not cause any visible foam, oil, grease, scum, litter or other objectionable matters to be present on the water in the vicinity of the barging facilities. ▪ A waste collection vessel shall be deployed to remove floating debris. 						
Landscape and Visual						
<ul style="list-style-type: none"> ▪ The maximum stockpiling height at the fill bank shall be limited to a maximum of +40mPD. ▪ Surface of outer slopes of the Fill Bank shall preferably be hydroseeded. ▪ Stockpile of public fill shall be removed in a sequence to allow the outer hydroseeded to be removed later than other portions as far as practicable. ▪ Casuarina equisetifolia were planted as buffer tree along the northern perimeter of the Site. The height of Casuarina equisetifolia was maintained at least 3m above soil level. ▪ Lighting shall be set to minimise night-time glare. 						

Environmental Checklist			Implementation Stages*			Remark
	Yes	No	N/A			
Waste Management						
Construction Waste Management						
<ul style="list-style-type: none"> ▪ Relevant licence / permits for disposal of construction waste or excavated materials available for inspection. ▪ Excavated material to be generated from construction works to be re-used on-site as far as practicable to reduce off-site disposal. ▪ Mud and debris should be removed from waterworks access roads and associated drainage systems. ▪ Provision of sufficient waste disposal points and regular collection for disposal. Appropriate measures should be employed to minimise windblown litter and dust during transportation of waste by either covering trucks or by transporting wastes in enclosed containers. ▪ Segregation and storage of different types of waste in different containers, skips or stockpiles to enhance reuse or recycling of materials and their proper disposal. ▪ Prior to disposal of C&D waste, recyclable materials should be salvaged for reuse (such as wood and metal) and inert waste utilised as public fill to minimise the quantity of waste to be disposed of to landfill. ▪ In order to monitor the disposal of C&D material and solid wastes at public filling areas and landfills, and to control fly-tipping, a trip-ticket system should be included as one of the contractual requirements. ▪ Any soil contaminated with chemicals/oils shall be removed from site and the void created shall be filled with suitable materials. 	✓	✓	✓	✓	✓	
Chemical Waste Management						
<ul style="list-style-type: none"> ▪ It is required to register as a chemical waste producer if chemical wastes would be produced from the construction activities. The Waste Disposal Ordinance (Cap 354) and its subsidiary regulations in particular the Waste Disposal (Chemical Waste) (General) Regulation should be observed and complied with for control of chemical wastes. ▪ After use, chemical wastes (e.g. cleaning fluids, solvents, lubrication oil and fuel) should be handled according to the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes. ▪ Spent chemicals should be stored and collected by an approved operator for disposal at the Chemical Waste Treatment Facility or other licensed facility in accordance with the Chemical Waste (General) Regulation. ▪ Chemical wastes should be separated for special handling and appropriate treatment at the Chemical Waste Treatment Facility. ▪ Chemical wastes including waste oil should be stored properly in designated areas, e.g. chemical waste storage area. ▪ The designated chemical waste storage area should only be used for storing chemical wastes. ▪ The set-up of chemical waste storage area should ▪ Be suitable for the substance they are holding, resistant to corrosion, maintained in a good condition. ▪ Be enclosed on at least 3 sides and securely closed. ▪ Have an impermeable floor and bunding, of capacity to accommodate 110% of the volume of the largest container or 20% by volume of the chemical waste stored in that area, whichever is the greatest. ▪ Have adequate ventilation. ▪ Be covered to prevent rainfall entering (water collected within the bund must be tested and disposal as chemical waste if necessary). ▪ Be arranged so that incompatible materials are adequately separated. 	✓	✓	✓	✓	✓	

Environmental Checklist	Implementation Stages*			Remark	
	Yes	No	N/A		
■ Warning panels should be displayed at the waste storage area.	✓				
■ Waste storage area should be cleaned and maintained regularly.	✓				
■ Chemical waste should be transported by a registered chemical waste collector to a facility licensed to receive chemical waste.	✓				
■ All generators, fuel and oil storage should be within bundle areas.	✓				
■ Oil leakage from machinery, vehicle and plant should be prevented.	✓				
■ In the event of chemical waste / dangerous goods / chemicals spillage or leakage, the procedures as outlined in the Spillage Response Plan should be followed.	✓				
■ The dangerous goods / chemical spillage or leakage procedures (including equipments) should be in place.	✓				
Good Site Practices					
■ Nomination of approved personnel, such as site manager, to be responsible for good site practices, arrangements for collection and effective disposal to an appropriate facility, of all wastes generated at the site.	✓				
■ Training of site personnel in proper waste management and chemical handling procedures should be provided.	✓				
■ Good site practices should be adopted to clean the rubbish and litter on a regular basis so as to prevent the rubbish and litter from dropping into the nearby environment.	✓				
■ Proper storage and site practices to minimise the potential for damage or contamination of construction materials.	✓				
■ The Environmental Permit should be displayed conspicuously on site.	✓				
■ Construction noise permits should be posted at site entrance or available for site inspection.		✓			
■ Plan and stock construction materials carefully to minimise amount of waste generated and avoid unnecessary generation of waste.	✓				
■ Chemical storage area provided with lock and located on sealed areas.	✓				
■ All chemicals should be placed at the banded area with adequate band capacity (>110% of largest tank).	✓				
■ Any unused chemicals or those with remaining functional capacity should be recycled.	✓				
■ Regular cleaning and maintenance programme for waste storage area, drainage systems, silt traps, sumps and oil interceptors.	✓				
■ To encourage collection of aluminium cans by individual collectors, separate labelled bins should be provided to segregate this waste from other general refuse generated by the workforce.	✓				
■ A recording system for the amount of wastes generated, recycled and disposed (including the disposal sites) should be used, e.g. trip ticket system for chemical waste disposal. Quantities could be determined by weighing each load or other suitable methods.	✓				
■ A collection area should be provided where waste can be stored and loaded prior to removal from site. An enclosed and covered area is preferred to reduce the occurrence of wind blown light material. If an open area is unavoidable for the storage or loading/unloading of wastes, then the area should be bunded and all the polluted surface run-off collected within this area should be diverted into wastewater treatment system.	✓	Item 3			

Summary of the Weekly Site Inspection:

Item	Details of defective works or observations	Photo Ref.	Further Action Required (Yes/No)
1	Follow up action to the previous site inspection item 1 on 23/04/09, rubbish and C&D wastes found on the tusock at dump truck's parking area were cleaned up.	090430_001	No
2	Follow up action to the previous site inspections item 5 on 26/03/09, item 7 on 02/04/09, item 7 on 07/04/09, item 4 on 16/04/09 and item 3 on 23/04/09, C&D wastes discarded near chemical waste storage area were collected.	090430_002	No
3	Four idle tires were discarded near "plants parking area". The Contractor was reminded to collect and dispose the tires properly.	090430_003	Yes

Remark

--

Name	Title	Signature	Date
Checked by Linda Law	Senior Environmental Officer	Linda Law	30 April 2009

Photos



Photo 090430_001

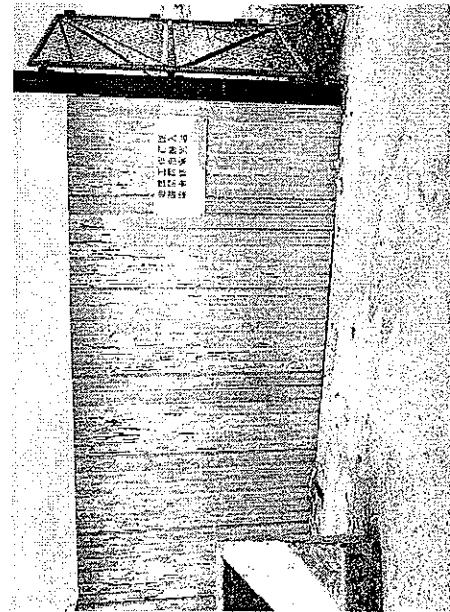


Photo 090430_002

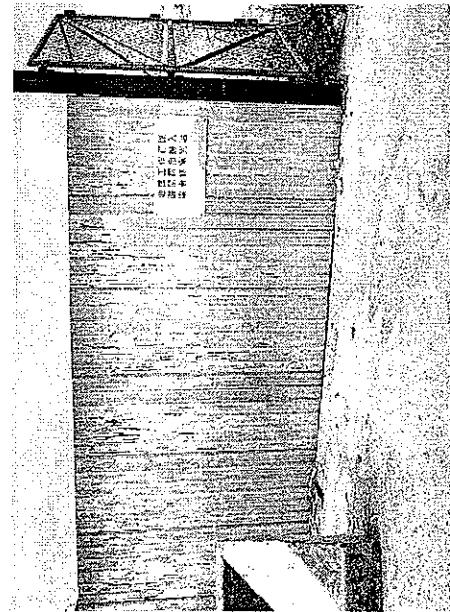


Photo 090430_003



東業德勤測試有限公司
ETS-TESTCONSULT LIMITED

Appendix I

Implementation Schedule of Mitigation Measures

Environmental Mitigation Implementation Schedule

Environmental Protection Measures		Location	Implementation Status		
			Implemented	Partially implemented	Not implemented
Air Quality					Not Applicable
▪ Dust control / mitigation measures shall be provided to prevent dust nuisance.		All areas	✓		
▪ Water sprays shall be provided and used to dampen materials.		All areas	✓		
▪ All stockpile of aggregate or spoil should be enclosed or covered and water applied in dry or windy condition.		All areas	✓		
▪ Any vehicle with open load carrying area used for moving materials which has the potential to create dust shall have properly fitting side and tail boards. Material having the potential to create dust shall not be loaded to a level higher than the side and tail boards, and shall be covered by a clean tarpaulin.		All areas	✓		
▪ Unpaved areas should be watered regularly to avoid dust generation.		Site Egress	✓		
▪ The designated site main haul road shall be paved or regular watering.		All haul roads	✓		
▪ The public road around the site entrance should be kept clean and free from dust.		All areas	✓		
▪ Wheel washing facilities including high-pressure water jet shall be provided at the entrance of work site.		Site Egress	✓		
▪ Every vehicle shall be washed to remove any dusty materials from its body and wheels before leaving the fill bank.		Site Egress	✓		
▪ The temporary slope surfaces shall be covered with impermeable sheet or sprayed with water.		All areas	✓		
▪ Vehicle and equipment should be switched off while not in use.		All areas	✓		
▪ All plant and equipment should be well maintained e.g. without black smoke emission.		All areas	✓		
▪ Open burning should be prohibited.		All areas	✓		
Noise Impact					Not Applicable
▪ The approved method of working, equipment and sound-reducing measures (e.g. use of silenced type of equipment, etc.) shall be adapted.		All areas	✓		
▪ Only well maintained plant should be operated on-site and plant should be serviced regularly during the construction works.		All areas	✓		
▪ Powered mechanical equipment (PME) should be covered or shielded by appropriate acoustic materials.		All areas	✓		
▪ Air compressors and hand held breakers should have noise labels.		All areas	✓		
▪ Machines and plants that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum.		All areas	✓		
▪ Noisy equipment and mobile plant shall always be site away from NSRs.		All areas	✓		


Environmental Protection Measures	Location	Implementation Status			Not Applicable
		Implemented	Partially implemented	Not implemented	
Water Quality					
<ul style="list-style-type: none"> ▪ The existing / realigned intercepting channels and the sand / silt removal facilities shall be used and maintained. ▪ Temporary intercepting drains should be used at the stockpiling area to divert polluted stormwater to the intercepting channels. Earth bunds and sand bay barriers shall be used to assist the diversion of polluted stormwater to the intercepting channels. ▪ The stormwater intercepting system shall be effective to collect of runoff and remove suspended solids before discharge. ▪ The material shall be properly covered to prevent washed away especially before rainstorm. ▪ The temporary slope surfaces shall be covered with impermeable sheet or sprayed with water. ▪ Existing and newly constructed Catchpits, sand and silt removal facilities and intercepting channels shall be maintained, and the deposited silt and grit shall be removed weekly and on a need basis especially at the onset of and after each rainstorm to ensure that these facilities are functioning properly at all times. ▪ A wheel washing bay shall be provided at the site exit and wash-water shall have sand and silt settled out or removed before being discharged into storm drains. ▪ The section of construction road between wheel washing bay and the public road shall be paved with concrete, bituminous materials or hardcore to reduce vehicle tracking of soil and to prevent site run-off from entering public road drains. ▪ Sewage from toilets shall be discharged in to a foul sewer, or chemical toilets shall be provided. ▪ The chemical toilets (if use) shall be provided by a licensed contractor, who will be responsible for disposal and maintenance of these facilities. ▪ Adequate environmental control measures shall be provided to prevent / avoid dropping of fill material into the sea during the transfer. ▪ A waste collection vessel shall be deployed to remove floating debris. 	All areas	√			
Landscape and Visual					
<ul style="list-style-type: none"> • The maximum stockpiling height at the fill bank shall be limited to a maximum of +40mPD. • Surface of outer slopes of the Fill Bank shall preferably be hydroseeded. • Stockpile of public fill shall be removed in a sequence to allow the outer hydroseeded to be removed later than other portions as far as practicable. • Casuarina equisetifolia were planted as buffer tree along the northern perimeter of the Site. The height of Casuarina equisetifolia was maintained at least 3m above soil level. • Lighting shall be set to minimise night-time glare. 	All areas	√			
Waste Management					
Construction Waste Management					
<ul style="list-style-type: none"> • Relevant licence / permits for disposal of construction waste or excavated materials available for inspection. • Excavated material to be generated from construction works to be re-used on-site as far as practicable to reduce off-site disposal. • Mud and debris should be removed from waterworks access roads and associated drainage systems. 	All areas	√			
		All areas	√		

Environmental Protection Measures	Location	Implementation Status			Not Applicable
		Implemented	Partially implemented	Not implemented	
Segregation and storage of different types of waste in different containers, skips or stockpiles to enhance reuse or recycling of materials and their proper disposal.	All areas	✓			
Prior to disposal of C&D waste, recyclable materials should be salvaged for reuse (such as wood and metal) and inert waste utilised as public fill to minimise the quantity of waste to be disposed of to landfill.	All areas	✓			
In order to monitor the disposal of C&D material and solid wastes at public filling areas and landfills, and to control fly-tipping, a tip-ticket system should be included as one of the contractual requirements.	All areas	✓			
Any soil contaminated with chemicals/oils shall be removed from site and the void created shall be filled with suitable materials.	All areas	✓			
Chemical Waste Management					
It is required to register as a chemical waste producer if chemical wastes would be produced from the construction activities. The Waste Disposal Ordinance (Cap 354) and its subsidiary regulations in particular the Waste Disposal (Chemical Waste) (General) Regulation should be observed and complied with for control of chemical wastes.	Waste Storage Area	✓			
After use, chemical wastes (e.g. cleaning fluids, solvents, lubrication oil and fuel) should be handled according to the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes.	Waste Storage Area	✓			
Spent chemicals should be stored and collected by an approved operator for disposal at the Chemical Waste Treatment Facility or other licensed facility in accordance with the Chemical Waste (General) Regulation.	Waste Storage Area	✓			
Chemical wastes should be separated for special handling and appropriate treatment at the Chemical Waste Treatment Facility.	Waste Storage Area	✓			
Chemical wastes including waste oil should be stored properly in designated areas, e.g. chemical waste storage area.	Waste Storage Area	✓			
The designated chemical waste storage area should only be used for storing chemical wastes.	Waste Storage Area	✓			
The set-up of chemical waste storage area should					
Be suitable for the substance they are holding, resistant to corrosion, maintained in a good condition.	Waste Storage Area	✓			
Be enclosed on at least 3 sides and securely closed.	Waste Storage Area	✓			
Have an impermeable floor and bunding, of capacity to accommodate 110% of the volume of the largest container or 20% by volume of the chemical waste stored in that area, whichever is the greatest.	Waste Storage Area	✓			
Have adequate ventilation.	Waste Storage Area	✓			
Be covered to prevent rainfall entering (water collected within the bund must be tested and disposal as chemical waste if necessary).	Waste Storage Area	✓			
Be arranged so that incompatible materials are adequately separated.	Waste Storage Area	✓			
Warning panels should be displayed at the waste storage area.	Waste Storage Area	✓			
Waste storage area should be cleaned and maintained regularly.	Waste Storage Area	✓			
Chemical waste should be transported by a registered chemical waste collector to a facility licensed to receive chemical waste.	All areas	✓			


Environmental Protection Measures	Location	Implementation Status			Not Applicable
		Implemented	Partially implemented	Not implemented	
• All generators, fuel and oil storage should be within bundle areas.	All areas	✓			
• Oil leakage from machinery, vehicle and plant should be prevented.	All areas	✓			
• In the event of chemical waste / dangerous goods / chemicals spillage or leakage, the procedures as outlined in the Spillage Response Plan should be followed.	All areas	✓			
• The dangerous goods / chemical spillage or leakage procedures (including equipments) should be in place.	All areas	✓			
Good Site Practices					
• Nomination of approved personnel, such as site manager, to be responsible for good site practices, arrangements for collection and effective disposal to an appropriate facility, of all wastes generated at the site.	All areas	✓			
• Training of site personnel in proper waste management and chemical handling procedures should be provided.	All areas	✓			
• Good site practices should be adopted to clean the rubbish and litter on a regular basis so as to prevent the rubbish and litter from dropping into the nearby environment.	All areas	✓			
• Proper storage and site practices to minimise the potential for damage or contamination of construction materials.	All areas	✓			
• The Environmental Permit should be displayed conspicuously on site.	Site Entrance	✓			
• Construction noise permits should be posted at site entrance or available for site inspection.	Site Entrance	✓			
• Plan and stock construction materials carefully to minimise amount of waste generated and avoid unnecessary generation of waste.	All areas	✓			
• Chemical storage area provided with lock and located on sealed areas.	Chemical Storage Area	✓			
• All chemicals should be placed at the banded area with adequate band capacity (>110% of largest tank).	Chemical Storage Area	✓			
• Any unused chemicals or those with remaining functional capacity should be recycled.	All areas	✓			
• Regular cleaning and maintenance programme for waste storage area, drainage systems, silt traps, sumps and oil interceptors.	All areas	✓			
• To encourage collection of aluminium cans by individual collectors, separate labelled bins should be provided to segregate this waste from other general refuse generated by the workforce.	All areas	✓			
• A recording system for the amount of wastes generated, recycled and disposed (including the disposal sites) should be used, e.g. trip ticket system for chemical waste disposal. Quantities could be determined by weighing each load or other suitable methods.	All areas	✓			
• A collection area should be provided where waste can be stored and loaded prior to removal from site. An enclosed and covered area is preferred to reduce the occurrence of 'wind blown' light material. If an open area is unavoidable for the storage or loading/unloading of wastes, then the area should be bunded and all the polluted surface run-off collected within this area should be diverted into wastewater treatment system.	All areas	✓			
• Remove wastes in a timely manner.	All areas	✓			

Appendix J

Site General Layout plan

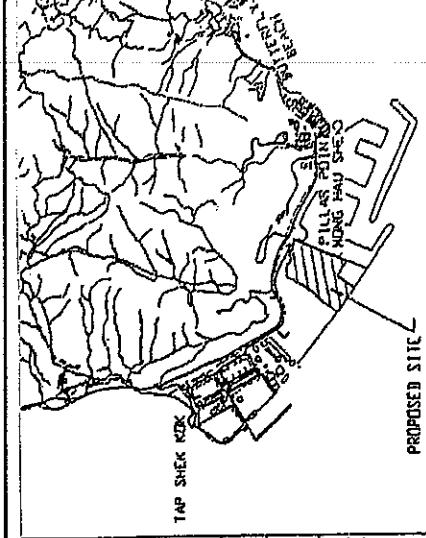

KEY PLAN SCALE : 1:2000

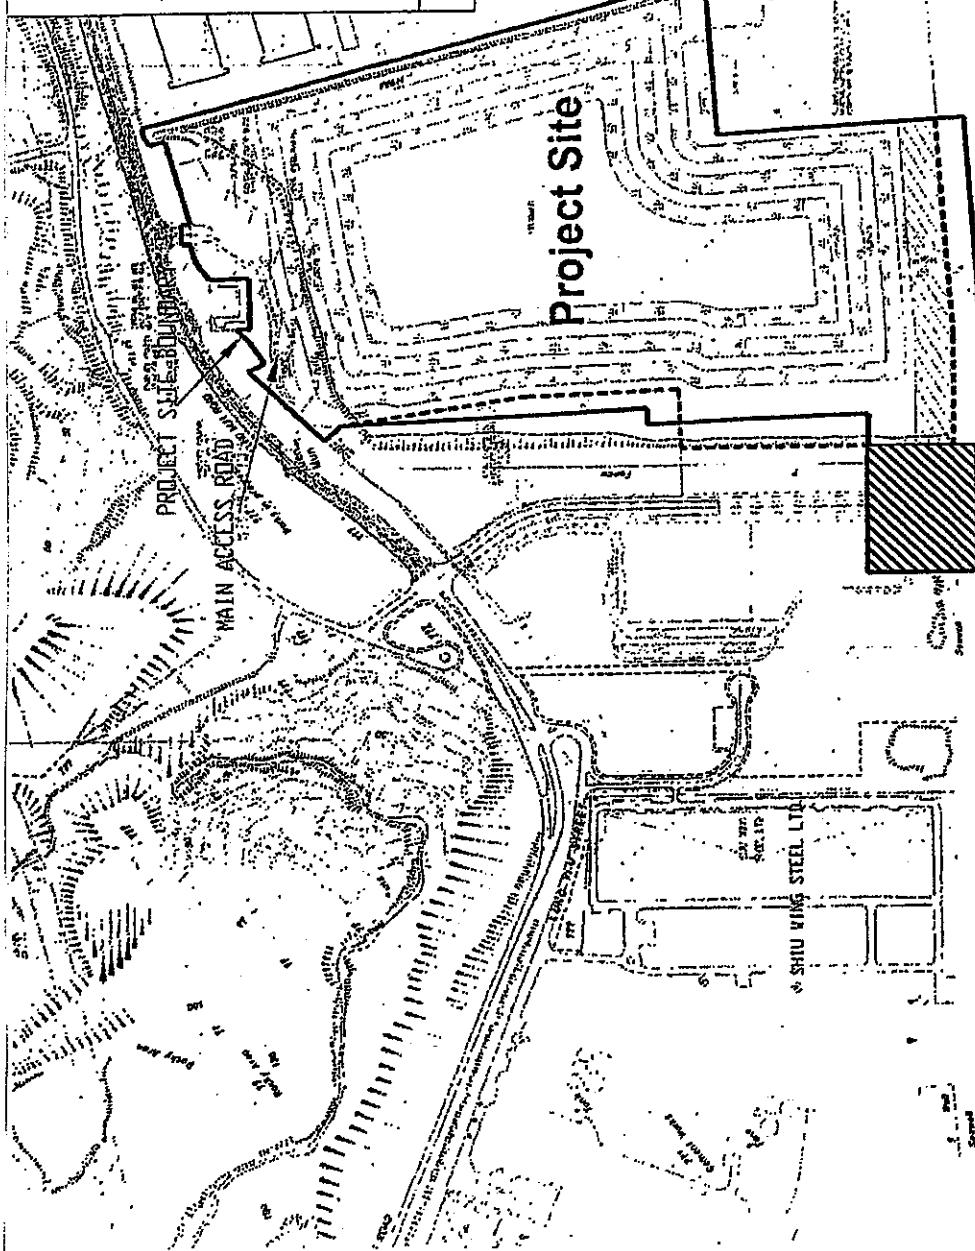

Part of the Site that would be
Occupied by Recovery Park Phase 1

— Amended Project Boundary Original Project Boundary

CEDD Contract No. C/V/2005/01 Delivery of Reclamation Material to
Mainland

Scale : ---
Date issued :
December 2006

Figure 1 Site Layout Plan - Tuen Mun Area 38 Fill Bank

東業築勤測試顧問有限公司
ETS-TESTCONSULT LIMITED

Appendix K

QA/QC Results of Laboratory Analysis

QA/QC Results of Laboratory Analysis of Total Suspended Solids


Sampling Date	QC Sample Analysis	Sample Duplicate		Sample Spike	
	% Recovery *	Sample ID	% Error #	Sample ID	% Recovery @
02/04/09	98.3	FC1-S	0.0	FM2-M	94.6
	100.6	FM2-B	0.0	EM1-S	96.8
	98.8	EM1-M	0.0	EC2-B	98.3
07/04/09	97.1	FC1-S	0.0	FM2-M	98.1
	94.2	FM2-B	0.0	EM1-S	94.8
	94.8	EM1-M	0.0	EC2-B	100.0
09/04/09	94.8	FC1-S	0.0	FM2-M	96.5
	97.7	FM2-B	0.0	FC2-B	105.5
	105.9	EM1-M	0.0	EC2-B	106.0
14/04/09	100.8	FC1-S	0.0	FM2-M	100.0
	104.0	FM2-B	0.0	EM1-S	96.3
	96.7	EM1-M	0.0	EC2-B	94.0
16/04/09	99.8	FC1-S	0.0	FM2-M	96.8
	95.9	FM2-B	0.0	EM1-S	93.4
	103.4	EM1-M	0.0	EC2-B	105.5
18/04/09	105.0	FC1-S	0.0	FM2-M	98.0
	105.8	FM2-B	0.0	EM1-S	96.9
	103.9	EM1-M	0.0	EC2-B	100.0
21/04/09	98.4	FC1-S	0.0	FM2-M	94.1
	93.5	FM2-B	0.0	EM1-S	101.9
	92.6	EM1-M	0.0	EC2-B	100.0
23/04/09	103.4	FC1-S	0.0	FM2-M	107.5
	92.9	FM2-B	0.0	EM1-S	106.7
	99.4	EM1-M	0.0	EC2-B	98.2
25/04/09	97.4	FC1-S	0.0	FM2-M	93.7
	101.5	FM2-B	0.0	EM1-S	104.4
	103.3	EM1-M	0.0	EC2-B	103.1
28/04/09	96.0	FC1-S	0.0	FM2-M	108.5
	96.8	FM2-B	0.0	EM1-S	97.0
	97.3	EM1-M	0.0	EC2-B	98.1
30/04/09	106.3	FC1-S	0.0	FM2-M	95.6
	106.5	FM2-B	0.0	EM1-S	96.4
	103.0	EM1-M	0.0	EC2-B	90.5

Note: (*) % Recovery of QC sample should be between 80% to 120%.

(#) % Error of Sample Duplicate should be between -10% to 10%.

(@) % Recovery of Sample Spike should be between 80% to 120%.

Figures

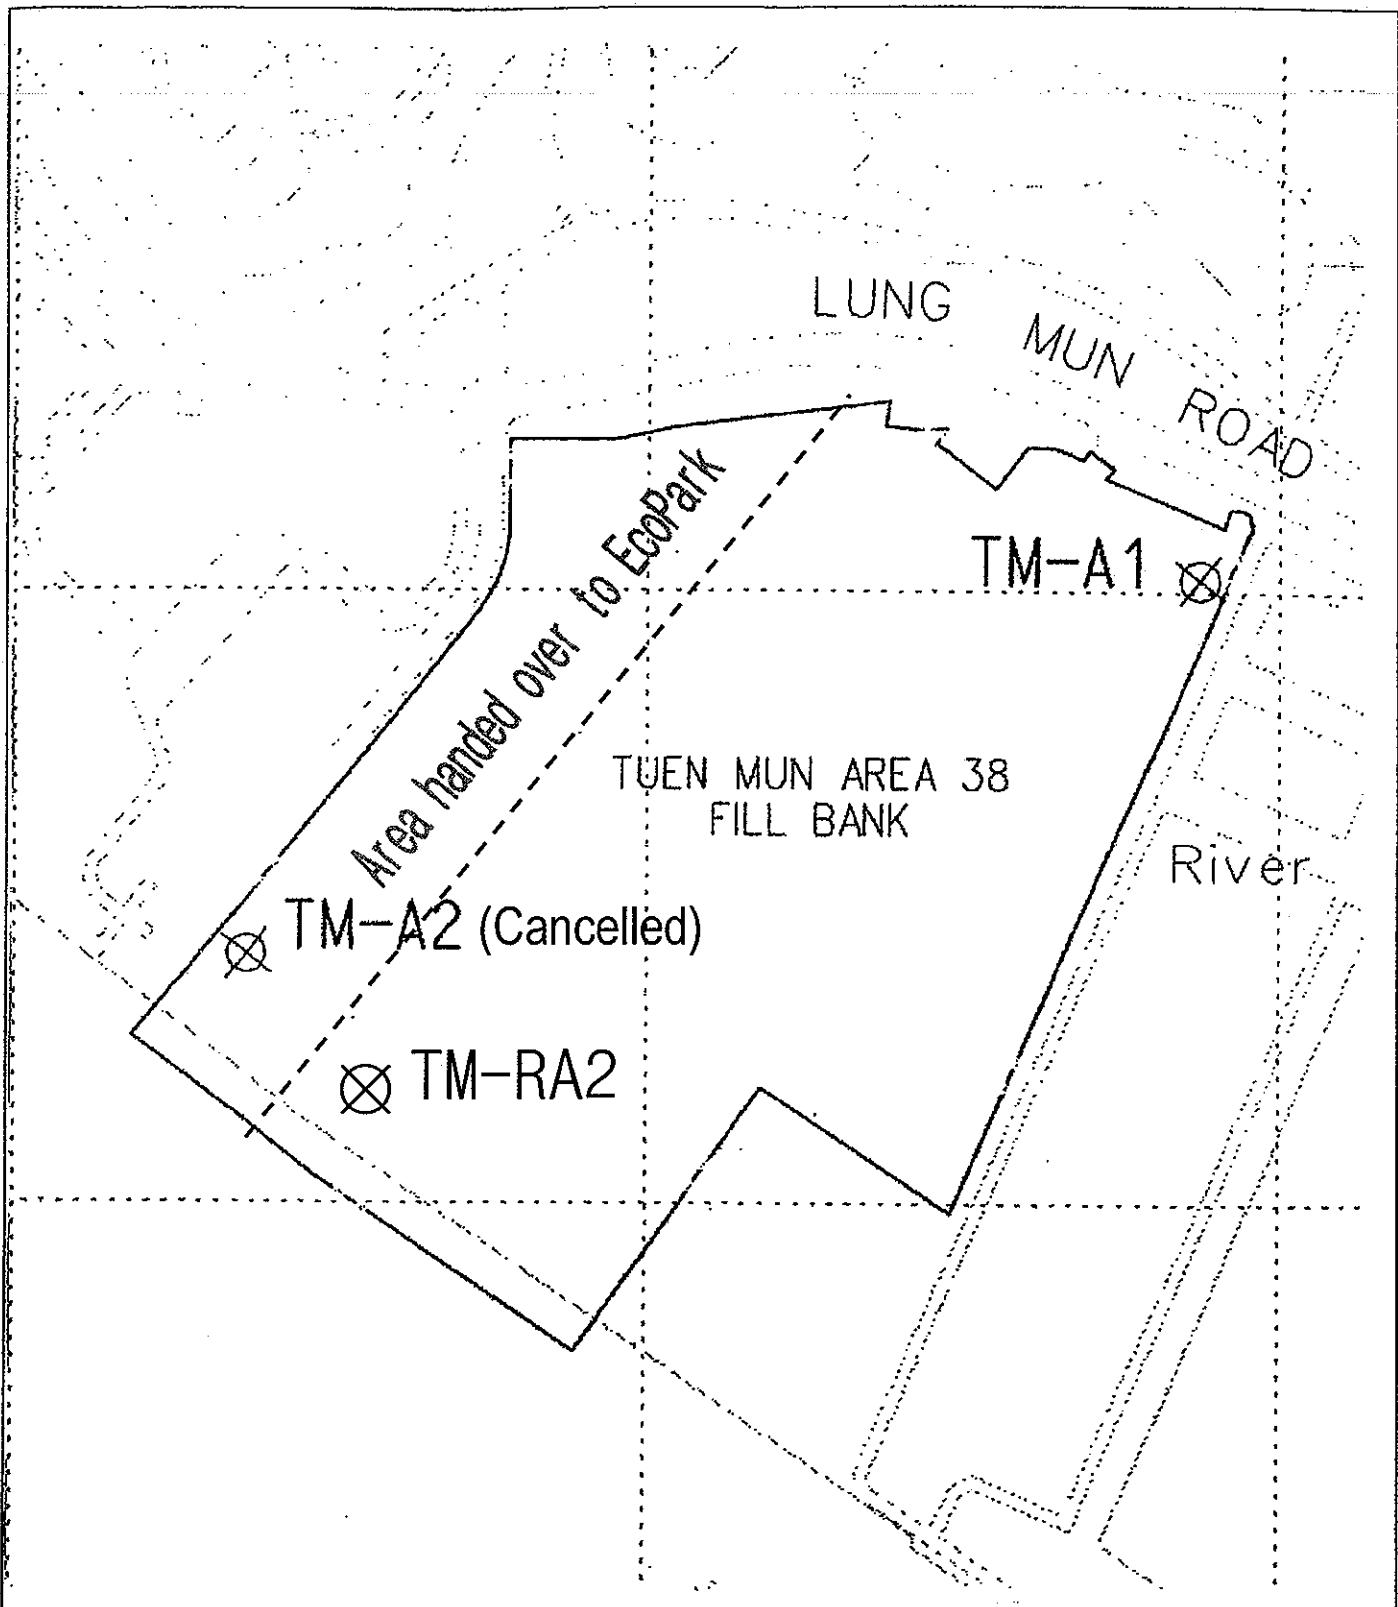


Contract No. CV/2005/01


Delivery of Reclamation Material to Mainland

Figure 2 A
Locations of Air Quality Monitoring Stations –
Tuen Mun Area 38 Fill Bank



東華築路測試顧問有限公司
ETS-TESTCONSULT LIMITED

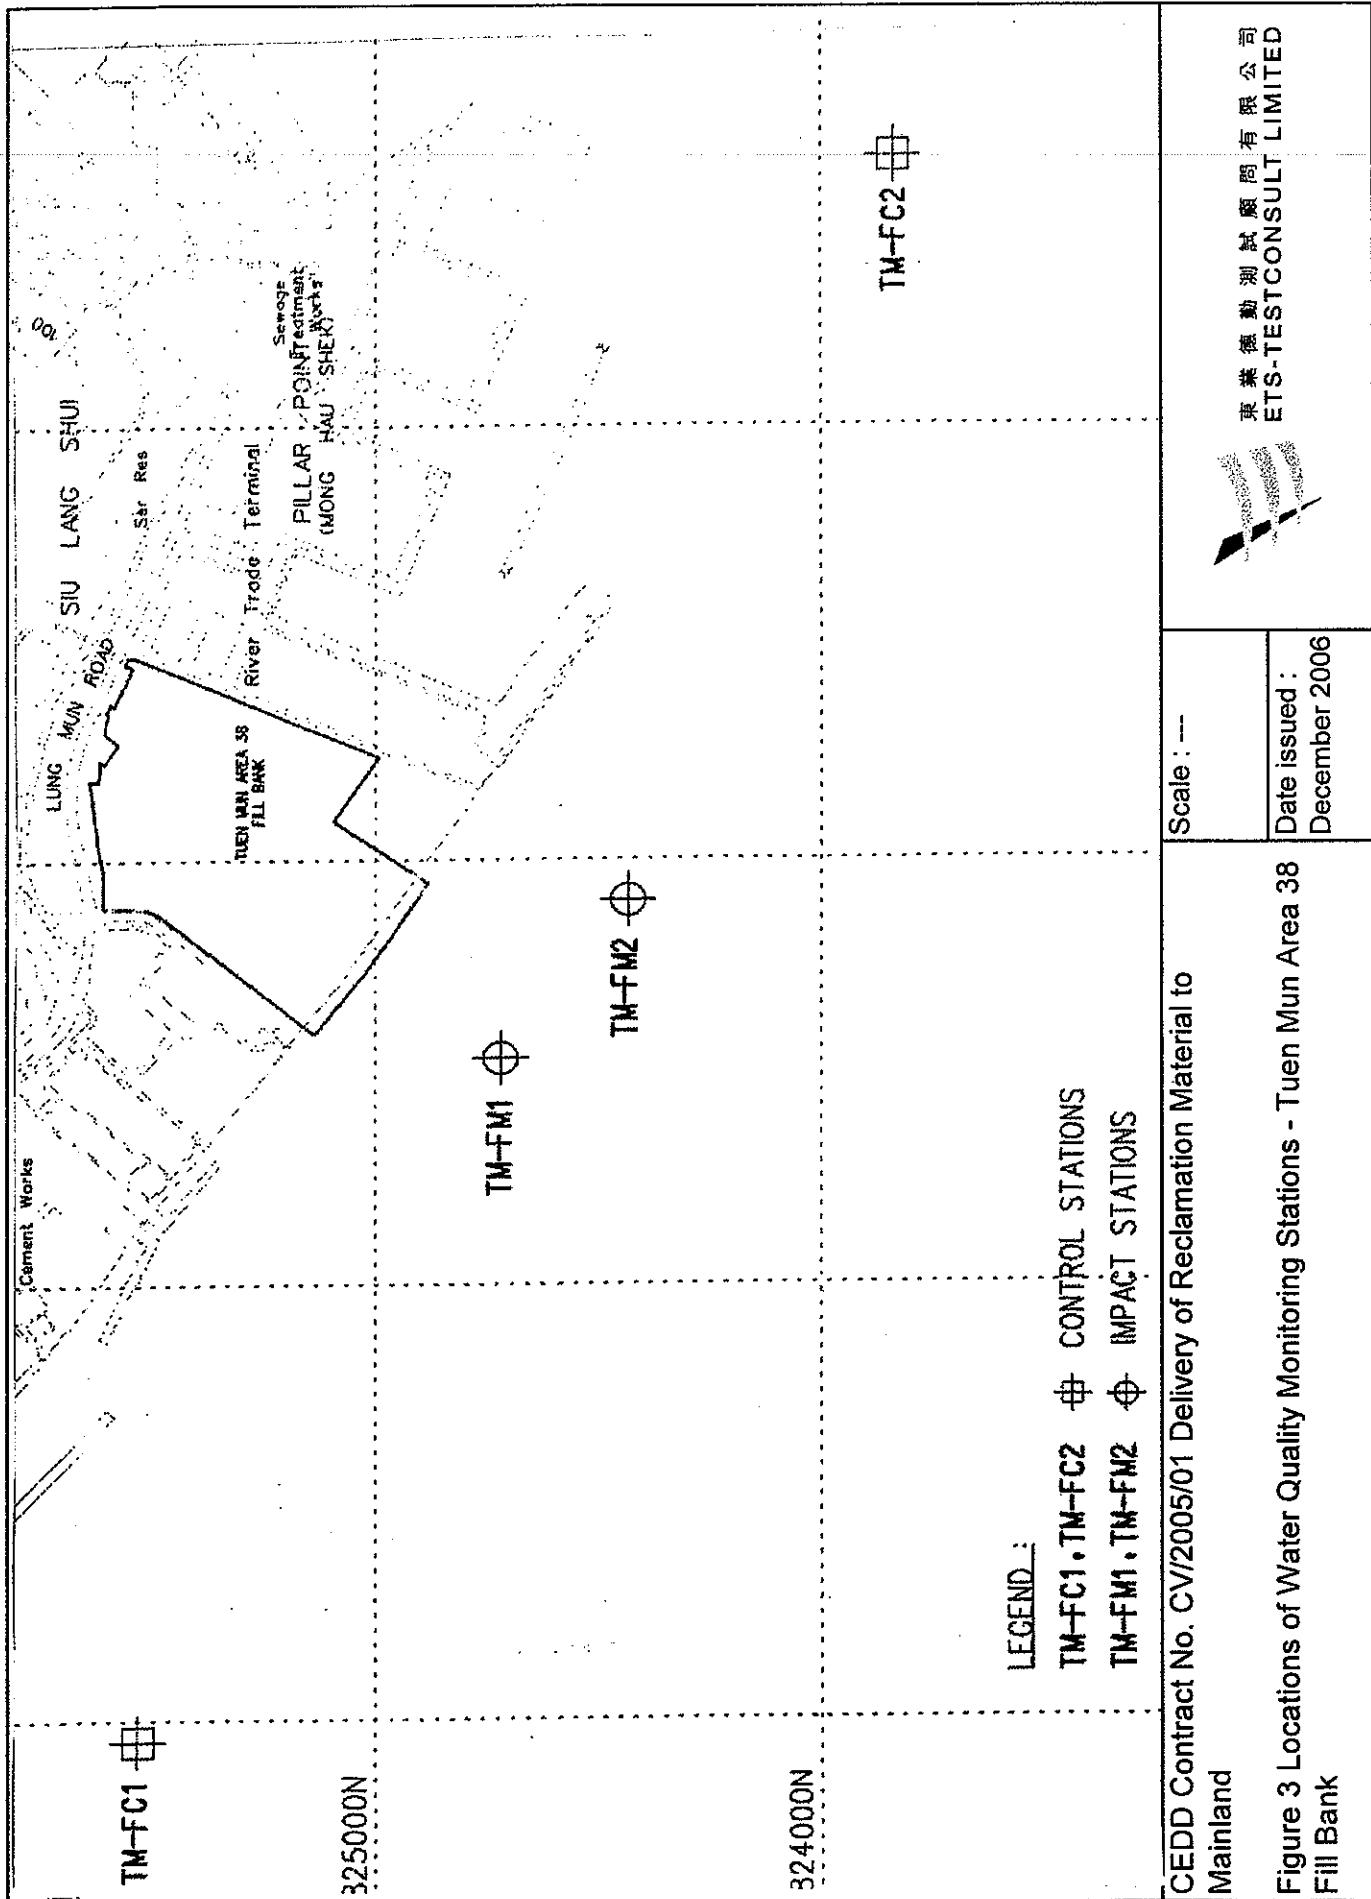

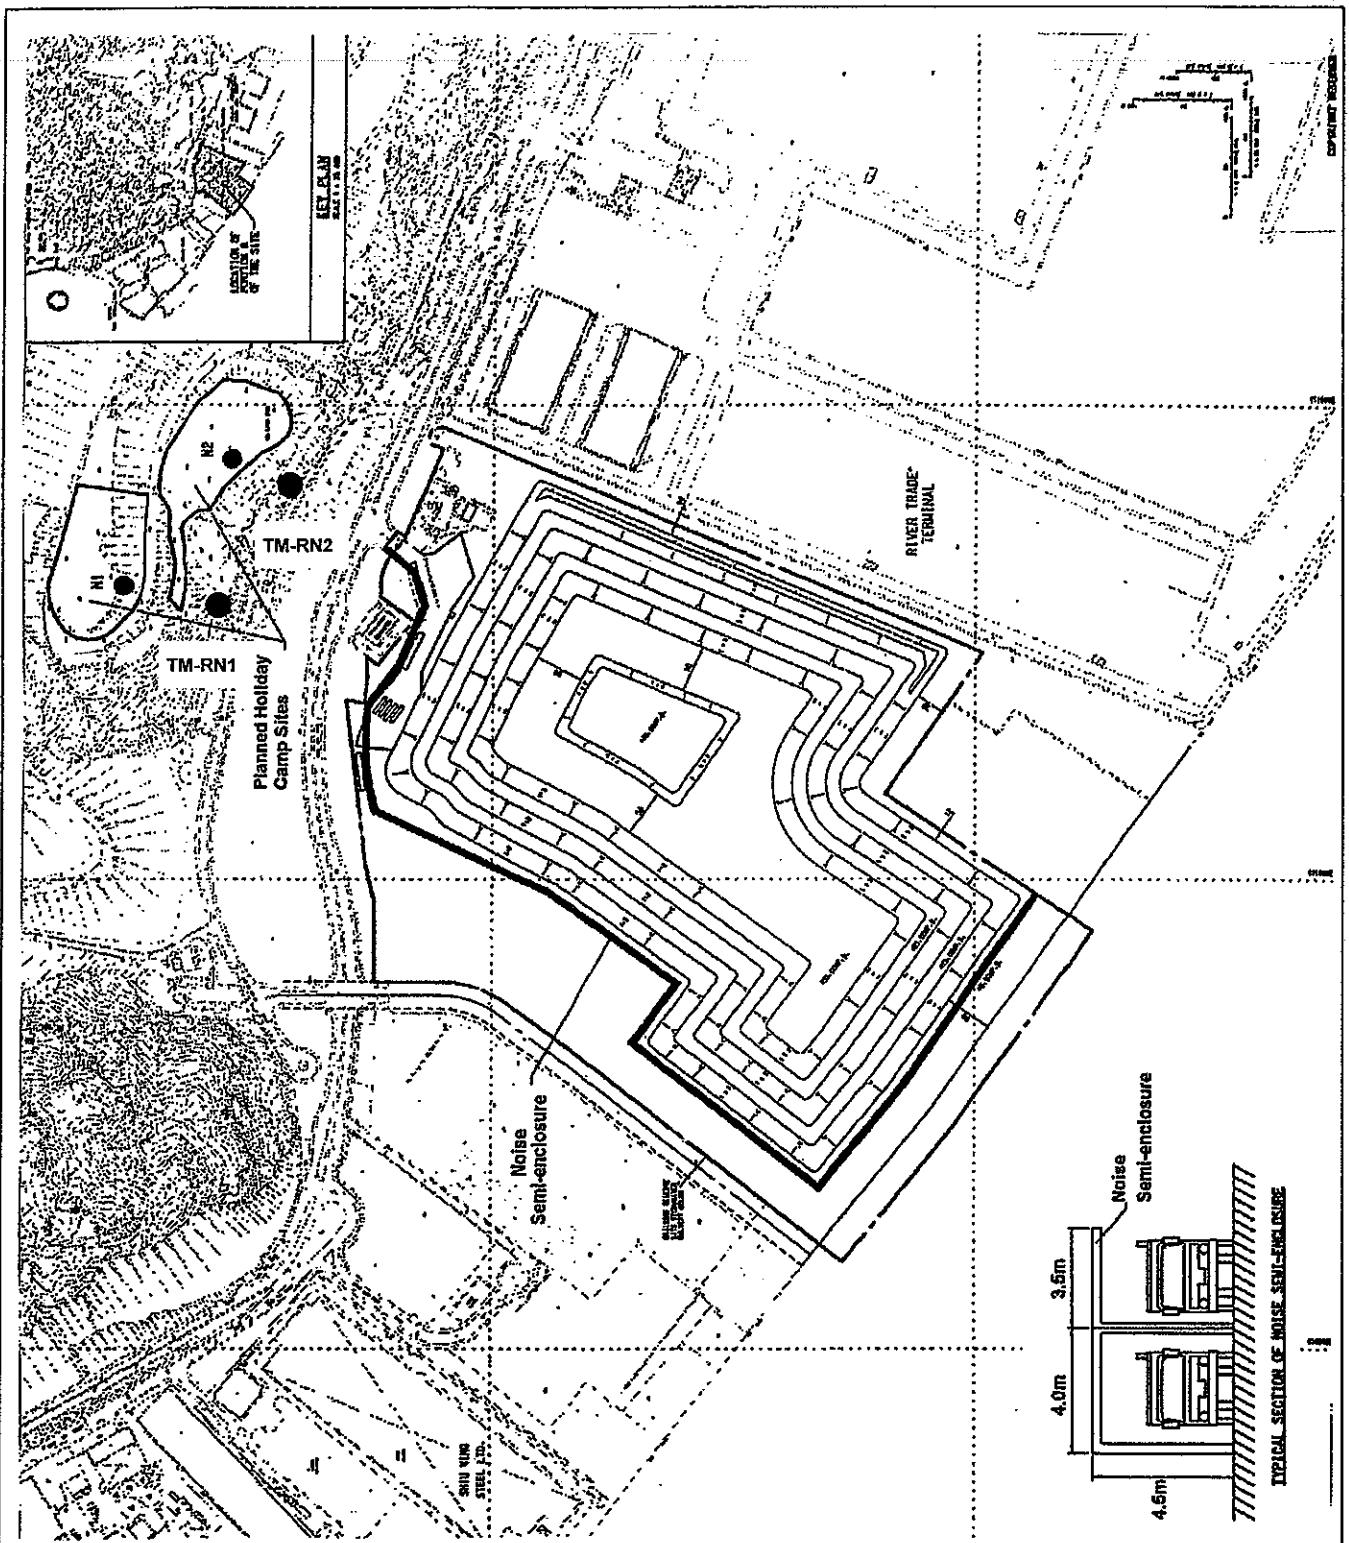

Contract No. CV/2005/01
Delivery of Reclamation Material to Mainland

Figure 4
Locations of Noise Quality Monitoring Stations –
Tuen Mun Area 38 Fill Bank



東聚德勤測試顧問有限公司
ETS-TESTCONSULT LIMITED