

**PROJECT NO.: TCS00409/08** 

# DSD CONTRACT NO. DC/2007/08 DRAINAGE IMPROVEMENTS WORKS IN TAI PO TIN, PING CHE, MAN UK PIN AND LIN MA HANG

42<sup>ND</sup> MONTHLY ENVIRONMENTAL MONITORING & AUDIT REPORT FOR THE DESIGNATED WORKS UNDER THE PROJECT – AUGUST 2012 CHANNELS MUP03A&B, MUP04A&B, MUP05 AND LMH01

**PREPARED FOR** 

**Quality Index** 

CHIU HING CONSTRUCTION & TRANSPORTATION COMPANY LIMITED

# Date Reference No. Prepared By Certified by 29 September 2012 TCS00409/08/600/R1185v2 Image: Certified by Image: Certified by Ben Tam Environmental Consultant T.W. Tam Environmental Consultant Environmental Team Leader

Version	Date	Remarks
1	29 September 2012	First Submission

This report has been prepared by Action-United Environmental Services & Consulting with all reasonable skill, care and diligence within the terms of the Agreement with the client, incorporating our General Terms and Conditions of Business and taking account of the resources devoted to it by agreement with the client. We disclaim any responsibility to the client and others in respect of any matters outside the scope of the above. This report is confidential to the client and we accept no responsibility of whatsoever nature to third parties to whom this report, or any part thereof, is made known. Any such party relies upon the report at their own risk.

1Z:\Jobs\2008\TCS00409 (DC-2007-08)\600\EM&A Report\DP\Monthly Report\42nd monthly - August 2012\R1185v1\_July DP.docx Action-United Environmental Services and Consulting



# Ref.: DSDFANLGEM01\_0\_1149L.12

1 Nov 2012

By Fax (26598323) and By Post

Engineer's Representative Office Black & Veatch Hong Kong Ltd 503 Tai Po Tin, Ta Kwu Ling Fanling, New Territories

Attention: Mr. Eric Lo

Dear Mr. Lo,

# Re: Contract No. DC/2007/08 (EP No. EP-277/2007/A) Drainage Improvement Works at Tai Po Tin, Ping Che, Man Uk and Lin Ma Hang 42<sup>nd</sup> Monthly EM&A Report for Channels MUP03A&B, MUP04A&B, MUP05 and LMH01 for Aug 2012 (Rev. 1)

Reference is made to the submission of 42<sup>nd</sup> Monthly EM&A Report (ref. no.: R1185v1) for the Designated Project Channels MUP03A&B, MUP04A&B, MUP05 and LMH01 provided by the Environmental Team by email on 9 Oct 2012.

We would like to inform that we have no further comment on the captioned report.

Please also note that the Monthly EM&A Report had been verified in accordance with the Condition 3.4 of the Environmental Permit No. EP-277/2007/A.

Thank you very much for your kind attention and please do not hesitate to contact the undersigned or Max Lee (3743 - 0359) should you have any queries.

Yours sincerely,

David Yeung Independent Environmental Checker

c.c. AUES

Attn: Mr. T. W. Tam

Fax: 2959-6079

Q:\Projects\DSDFANLGEM01\Corr\DSDFANLGEM01\_0\_1149L.12.doc

### EXECUTIVE SUMMARY

- ES.01 This is the 42<sup>nd</sup> monthly EM&A Report for Channels MUP03A&B, MUP04A&B, MUP05 and LMH01 covering a period from 26 July 2012 to 25 August 2012 (the Reporting Period). These works are classified as Designated Projects under the Environmental Impact Assessment Ordinance (Cap. 499) and Environmental Permit No.EP277/2007/A.
- ES.02 As construction works were undertaken only at Channels MUP03A&B, MUP04A&B, MUP05 during the Reporting Period, environmental monitoring for air quality, construction noise, water quality and ecology was therefore performed at those channels only.
- ES.03 In air quality and noise monitoring, there were no Action/ Limit Level exceedance recorded in this reporting period.
- ES.04 In stream water quality monitoring, there were 11 exceedances recorded in the reporting period (2 action level exceedances and 9 limit level exceedances). According to the information from Contractor, it is recorded from Hong Kong Observatory that adverse weather and heavy rainfall was record during the captioned days. In addition, high levels of SS and Turbidity were recorded at up-stream control stations and there is no major construction activity was carried out except dewatering and flood preventive measures. The exceedances at the captioned stations would be the consequences of rainfall recorded or seasonal variation. We would conclude that the exceedances were not works related under the project.

Station	D	0	Turb	idity	pH V	/alue	S	S	Total Exc	ceedance
Station	Action	Limit	Action	Limit	Action	Limit	Action	Limit	Action	Limit
MUP-W4 (a)	0	0	0	0	0	0	2	0	2	0
MUP-W5 (b)	0	0	0	0	0	0	0	4	0	4
MUP-W6 (b)	0	0	0	1	0	0	0	4	0	5
Exceedances	0	0	0	1	0	0	2	8	2	9

Remarks: <sup>(a)</sup> impact station; <sup>(b)</sup> Temporary or mobile station

- ES.05 **Five** ecological general audits were performed in this reporting month at the nominated construction channel (MUP05). No non-compliance was observed during the auditing period and all of the mitigation measures were found effectively implemented.
- ES.06 No written or verbal complaint, notification of summons or successful prosecution was received (written or verbal) for each media during the Reporting Period. No adverse environmental impacts were observed during the weekly site inspection and environmental audit which indicated that the implemented mitigation measures for air quality, construction noise, water quality and ecology were effective. Minor deficiencies found during the weekly site inspection were in general rectified within the specified deadlines. The environmental performance of the Project was therefore considered satisfactory.
- ES.07 During the wet season, the coming excavation works of the channels, ingression of surface runoff into the river within MUP Channels continues to be the key issue in future months. The contractor is reminded that mitigation measures for water quality and ecology should therefore be fully implemented.
- ES.08 In addition, attention should be paid to noise impact during the construction work progress, and with other environmental issues identified in the EM&A Manual. Mitigation measures recommended in the Environmental Study Report (ESR) and summarized in Mitigation Measure Implementation Schedule should continually be applied.

AUES

	TABLE OF CONTENTS	PAGE
<b>1.</b>	INTRODUCTION	-1-
1.1	Report Structure	-1-
<b>2.</b>	<b>BASIC PROJECT INFORMATION</b>	-2-
2.1	Project Organization	-2-
2.2	Master Construction Program for the Project	-2-
2.3	Works Undertaken During the Reporting Month	-2-
<b>3.</b>	<b>ENVIRONMENTAL STATUS</b>	<b>- 3 -</b>
3.1	Work Undertaken during the Month with Illustrations	- 3 -
3.2	Implementation of Environmental Protection and Pollution Control	- 3 -
<b>4.</b> 4.1 4.2 4.3 4.4 4.5 4.6 4.7 4.8 4.9	SUMMARY OF IMPACT MONITORING REQUIREMENTS Monitoring Parameters Monitoring Locations Monitoring Frequency Monitoring Equipment Monitoring Procedure Environmental Quality Performance Limits Event and Action Plans Environmental Mitigation Measures Data Management and Data QA/QC Control	- 4 - - 4 - - 5 - - 6 - - 7 - - 9 - - 11 - - 11 - - 11 -
<b>5.</b>	IMPACT MONITORING RESULTS	- 12 -
5.1	Air Quality	- 12 -
5.2	Construction Noise	- 13 -
5.3	Water Quality	- 14 -
5.4	Ecology	- 15 -
5.5	Other Factors Influencing the Monitoring Results	- 15 -
5.6	QA/QC Results and Detection Limits	- 15 -
<b>6.</b> 6.1 6.2 6.3 6.4 6.5 6.6	REPORT ON NON-COMPLIANCE, COMPLAINT, NOTIFICATION OF SUMMONS AND SUP PROSECUTION Record of Non-Compliance of Action and Limit Levels Environmental Complaints Record of Notification of Summons and Successful Prosecution Review of Reasons for and Implication of Non-Compliance, Complaint and Notice of Summons Description of Follow-up Actions Taken Others	<b>CCESSFUL</b> - 16 - - 16 -
7	CONCLUSIONS AND RECOMMENDATIONS	- 18 -



# Appendices

Appendix A	Site Location Plan				
Appendix B	Environmental Management Organization Contacts of Key Personnel				
Appendix C	Master Construction Program, Future Construction Works & Environmental Mitigation Implementation Schedule				
Appendix D	Environmental Monitoring Locations				
Appendix E	Certificates of Calibration				
Appendix F	Details of the Event Action Plan				
Appendix G	Monitoring Schedule				
Appendix H	Detailed Impact Monitoring Data of Air Quality and Water Quality				
Appendix I	Graphic Plot of Monitoring				
Appendix J	Meteorological Records				
Appendix K	Proforma of the weekly ET Site Inspection Checklist				
Appendix L	Proforma of the Ecology Inspection Checklist				
Appendix M	Monthly Summary Waste Flow Table				

# Tables

Table 1-1	Summary of the Channels under the Project
-----------	---

- Table 3-1
   Environmental Mitigation Measures Undertake in Reporting Month
- Table 3-2 Status of Environmental Licenses and Permits
- Table 4-1Summary of Monitoring Parameters
- Table 4-2
   Monitoring Locations Proposed in the EM&A Manuals
- Table 4-3
   Air Quality Monitoring Equipment
- Table 4-4
   Construction Noise Monitoring Equipment
- Table 4-5
   Water Quality Monitoring Equipment
- Table 4-6
   Action and Limit Levels for Air Quality
- Table 4-7
   Action and Limit Levels for Construction Noise
- Table 4-8 Action and Limit Levels for Water Quality
- Table 4-9 Action and Limit Levels for Ecology in Construction Phase at Channels MUP05 and LMH01
- Table 4-10 Action Level for Landscape and Visual Impact in Construction Phase
- Table 5-1 Summary of 1-hour TSP Monitoring Results (µg/m<sup>3</sup>)
- Table 5-2
   Summary of 24-hour TSP Monitoring Results (µg/m³)
- Table 5-3 Results of Construction Noise Monitoring at MUP-N1 / MUP01/02-N1 (MUP05)
- Table 5-4 Results of Construction Noise Monitoring at MUP-N2 (MUP05)
- Table 5-5 Results of Construction Noise Monitoring at MUP-N3 (MUP05)
- Table 5-6 Results of Construction Noise Monitoring at MUP-N4 (MUP04A)
- Table 5-8
   Summary of Defects and Deficiencies Identified and Follow-up Actions and Remedies Taken
- Table 6-1
   Summary of Quantities of Waste for Disposal
- Table 6-2Summary of Quantities of Waste for Reuse/Recycling
- Table 6-3
   Summary of Findings of Site Inspection and Environmental Audit

# 1. INTRODUCTION

The Chiu Hing Construction & Transportation Company Limited (CHCT) was appointed by the Drainage Services Department (DSD) to perform a contract – Contract No. DC/2007/08 *Drainage Improvement Works at Tai Po Tin, Ping Che, Man Uk Pin and Lin Ma Hang* (the Project). Total construction time is approximately 32 months.

The Project involves construction of various river channels: some classified as Designated Project (DP) and some Non-designated Project (Non-DP) under the Environmental Impact Assessment Ordinance (Cap. 499), as summarized in *Table 1-1*.

Channel ID	Location	Designated / Non-Designated
TKL02	Tai Po Tin	Non-Designated
TKL07	Ping Che / Ta Kwu Ling	Non-Designated
MUP01		Non-Designated
MUP02		Non-Designated
MUP03A and MUP03B	Man Uk Pin	Designated (EP277/2007/A)
MUP04A and MUP04B		Designated (EP277/2007/A)
MUP05		Designated (EP277/2007/A)
LMH01	Lin Ma Hang	Designated (EP277/2007/A)

This is the 42<sup>nd</sup> monthly report covering data from 26 July 2012 to 25 August 2012 to present the monitoring results of air quality, construction noise, water quality and ecology for the Designated Project of Channels MUP03A&B, MUP04A&B, MUP05 and LMH01 under the Environmental Monitoring & Audit Manual [382486/73//Issue2]. A set of location plans showing all DP works covered in this report are illustrated in *Appendix A*. Details of EM&A requirements for the Designated Project are summarized below:

- (a) Channel MUP03A&B NA
- (b) Channel MUP04A&B the scope of environmental monitoring includes construction noise, air quality and water quality
- (c) Channel MUP05 the scope of environmental monitoring includes construction noise, air quality, water quality and ecology
- (d) Channel LMH01 the scope of environmental monitoring includes construction noise, air quality, water quality and ecology

It has been agreed among the Engineer's Representative (ER), the Independent Environmental Checker (IEC), the Contractor (CHCT), the Environmental Team (ET) and the Environmental Protection Department (EPD) that 25<sup>th</sup> of each month is the cut-off day of each reporting month. Data collected after the 26<sup>th</sup> of every month will be reported in the next issue.

# 1.1 **REPORT STRUCTURE**

This report has been written in accordance with the requirements set out in the *Environmental Monitoring and Audit Manual* (the EM&A Manual) with the following structure:

- Section 1 Introduction
- Section 2 Basic Project Information
- Section 3 Environmental status
- Section 4 Summary of Impact EM&A Requirements
- Section 5 Impact Monitoring Results
- Section 6 Report on Non-Compliance (NC), Complaint, Notification of Summons (NOS) and Successful prosecution
- Section 7 Conclusions and Recommendations

# 2. BASIC PROJECT INFORMATION

# 2.1 PROJECT ORGANIZATION

The organization chart and lines of communication with respect to the on-site environmental management and the management structure are shown in *Appendix B*.

# 2.2 MASTER CONSTRUCTION PROGRAM FOR THE PROJECT

The master construction program of the Project is shown in *Appendix C*. Environmental mitigation measures implemented are shown in *Appendix C*.

# 2.3 WORKS UNDERTAKEN DURING THE REPORTING MONTH

During this reporting month, the construction work undertaken at the designated work areas is listed as follows:

<u>Channel</u>	Carried out defect works during construction period as follow:
MUP03A&B, MUP04A&B and MUP05	<ul> <li>Install outstanding fencing, railing and signates</li> <li>landscape softworks and establishment works</li> <li>Rectify defective concrete on grasscrete/paving</li> </ul>

LMH01 Not yet commenced

Future construction works is provided in *Appendix C*.

# 3. ENVIRONMENTAL STATUS

## 3.1 WORK UNDERTAKEN DURING THE MONTH WITH ILLUSTRATIONS

In this reporting month, the construction work was undertaken at Channels MUP03A&B, MUP04A&B and MUP05. All proposed construction channels are located at Man Uk Pin. The environmental mitigation Implement is shown in *Table 3-1*.

Table 3-1 Environmental Mitigation Measures Undertake in the F	he Reporting Month
--	--------------------

	0	
Location	Construction Activities	Environmental Mitigation Measures to be deployed
MUP03A&B, MUP04A&B and MUP05	<ul> <li>Carried out defect works during construction period as follow:</li> <li>1. install outstanding fencing, railing and signates;</li> <li>2. landscape softworks and establishment works;</li> <li>3. Rectify defective concrete on grasscrete/paving</li> </ul>	<ul> <li>Water spraying will be provided before and during handling of excavated material.</li> <li>Retained tree will be properly protected before works commenced</li> </ul>

#### 3.2 IMPLEMENTATION OF ENVIRONMENTAL PROTECTION AND POLLUTION CONTROL

The implementation of environmental protection and pollution control/mitigation measures as recommended in the EM&A Manual or ES is shown in *Appendix C*.

A summary status of the permits, licences, and/or notifications on environmental protection for this Project in this reporting month is presented in *Table 3-2*.

Table 3-2	Status of Environmental	Licenses and Permits

ltem	Item Description	Permit Status
1	Environmental Permit No.EP277/2007/A	Issued on 1 Dec 2009
2	Air Pollution Control (Construction Dust)	Notification to EPD on 27/12/2007
3	Chemical Waste Producer Registration	
	• 5213-652-C3251-04	Valid date: 23 July 2008
	• 5213-652-C3251-05	Valid date: 15 August 2008
4	Water Pollution Control (Discharge license)	
	• W5/1G34/1	Expiry date: 31 August 2013
	• W5/1G35/1	Expiry date: 31 August 2013
	• W5/1I324/1	Expiry date: 31 August 2013
	• W5/1I325/1	Expiry date: 31 August 2013
5	Account for Disposal of Construction Waste No. 7006522	Valid date: 9 January 2008
6	Construction Noise Permit	Nil

# 4. SUMMARY OF IMPACT MONITORING REQUIREMENTS

Environmental monitoring and audit for air quality, noise, water quality and ecology have been recommended in the EM&A Manual. They are summarized below.

### 4.1 MONITORING PARAMETERS

The monitoring parameters are summarized in Table 4-1.

#### Table 4-1

#### Summary of Monitoring Parameters

Environmental Issue	Parameters					
Air Quality		<ul> <li>1-hour Total Suspended Particulate (1-hour TSP); and</li> <li>24-hour Total Suspended Particulate (24-hour TSP)</li> </ul>				
Construction Noise	normal working hout A-weighted equiva	<ul> <li>A-weighted equivalent continuous sound pressure level (30min) (Leq(30min)) during the normal working hours; and</li> <li>A-weighted equivalent continuous sound pressure level (5min) (Leq(5min)) for construction work during the Restricted Hours</li> </ul>				
Water Quality	<ul> <li>In-situ Measurement</li> <li>Laboratory Analysis</li> </ul>	temperature, dissolved oxygen (DO), dissolved oxygen saturation (DOS), pH value, water depth, temperature & turbidity suspended solids (SS)				
Ecology	MUP05 and LMH01	<ul> <li>The stream conditions monitoring (in-situ measurements of DO, pF and turbidity; laboratory testing of SS);</li> <li>General site audit to reporting the mitigation measures are properly implemented during the construction phase</li> </ul>				

# 4.2 MONITORING LOCATIONS

# 4.2.1 Monitoring Locations Proposed in the EM&A manuals

Monitoring locations have been identified in the EM&A Manual. They are shown in *Appendix D* and summarized in *Table 4-2*.

#### Table 4-2 Monitoring Locations Proposed in the EM&A Manuals

Issue	Channel	Sensitive Receiver	Monitoring Location ID	Detailed Address		
	MUP04A	MUP04A-2	MUP-A3	Village house near Loi Tung		
Air	MUP05	MUP05-2 (same	MUP-A1 (same as	Village north of Loi Tung (same as Village house at		
		as MUP01/02-1)	MUP01/02-A1)	Man Uk Pin)		
	MUP05	MUP05-4	MUP-A2a <sup>#</sup>	Village north of Loi Tung		
	MUP04A	MUP04A-2	MUP-N4	Village house near Loi Tung		
		MUP05-2 (same	MUP-N1 (same as	Village north of Loi Tung (same as Village house at		
	MUP05	as MUP01/02-1)	MUP01/02-N1)	Man Uk Pin)		
		MUP05-4	MUP-N2	Village north of Loi Tung		
Noise		MUP05-6	MUP-N3	Village north of Loi Tung		
NOISE		LMH01-1		Village of Lin Ma Hang/*Pomark: Mobile station		
	LMH01	LMH01-2		Village of Lin Ma Hang(*Remark: Mobile station subject to the location of the construction works to be measured at Sensitive Receiver LMH01-1 or		
		LMH01-3	LMH-N1*			
		LMH01-4		LMH01-2 or LMH01-3 or LMH01-4 or LMH01-5)		
		LMH01-5				
	MUP04A	Control Station	MUP-W3	Upstream of MUP04A works		
		Control Station	MUP-W1 (same as MUP01/02-W1)	Upstream of MUP01 works		
	MUP05	Control Station	MUP-W2 (same as MUP01/02-W2)	Upstream of MUP02 works		
Water		Impact Station	MUP-W4	Downstream of MUP05 works immediately at the discharge point to River Indus		
		Temporary / Mobile Station	MUP-W5	Within MUP05, downstream of the discharge point of MUP01/02 and upstream of the discharge point of MUP04A		
		Temporary / Mobile Station	MUP-W6	Within MUP05, downstream of the discharge point of MUP01/02 and MUP04A		

Z:Uobs\2008\TCS00409 (DC-2007-08)\600\EM&A Report\DP\Monthly Report\42nd monthly - August 2012\R1185v1\_July DP.docx Action-United Environmental Services and Consulting

Issue	Channel	Sensitive Receiver	Monitoring Location ID	Detailed Address		
		Control Station	LMH-W1	Upstream of LMH01 works		
		Control Station	LMH-W2	Upstream of LMH01 works		
	LMH01	Impact Station	LMH-W3	Downstream of all LMH01 works immediately at the discharge point to Shenzhen River		
Water		Temporary / Mobile Station	LMH-W4	Upstream and downstream of particular group of LMH01 works		
		Temporary / Mobile Station	LMH-W5	Upstream and downstream of particular group of LMH01 works		
		Temporary / Mobile Station	LMH-W6	Upstream and downstream of particular group of LMH01 works		
	MUP05	Water Quality of Sti	ream	Upstream and downstream of Construction site		
	and General Site audit (with emphasis on		t (with emphasis on	Along stream channel, within 100m upstream and		
Ecology	LMH01			downstream of construction site		
	LMH01	Surveys of fish species		Along stream channel, within 100m upstream and downstream of construction site		

# Access to the original air quality monitoring location MUP-A2 has been denied. The nearby air quality sensitive receiver MUP05-4 is recommended to be the replacement of the denied MUP-A2 and named MUP-A2a for ease of reference.

# 4.3 MONITORING FREQUENCY

The impact monitoring should be conducted during the construction activities pass through the contract period to ensure the ambient environmental conditions compliance with the environmental performance criteria i.e. Action and Limit Levels for the Project. The impact monitoring frequency specified in the EM&A Manual is summarized below.

#### Air Quality

Parameters:	24-hour TSP and 1-hour TSP.
Frequency:	Once every 6 days for 24-hour TSP & three times every 6 days for 1-hour TSP.
Duration:	During the course of construction works

#### **Construction Noise**

Parameters:	Leq(30 min) in six consecutive Leq(5 min) measurements
Frequency:	Once a week during 0700-1900 on normal weekdays:
Duration:	During the course of construction works

#### Water Quality

Parameters:	Duplicate in-situ measurements of water depth, temperature, DO, pH & turbidity;
	and laboratory testing of SS. Relevant data will also be measured time of
	sampling, DO Saturation, weather conditions and special phenomena.
Depths:	All measurements will be carried out at three water depths, namely, 1 m below
	water surface, mid-water depth, and 1 m above river bed. If the water depth is
	less than 6 m, the mid-depth measurement will be omitted. If the depth is less
	than 3 m, only the mid-depth measurement will be taken.
Frequency:	3 days a week with an interval of at least 36 hours between two consecutive
	sampling days
Duration:	During the construction period of the channel works

# Ecology

According to the EM&A Manual [*382486/73/Issue2*], ecology monitoring is only performed at the Channels MUP05 and LMH01 during the construction phase, the monitoring requirements are listed as following:

# Parameters:

- (a) General site audit with emphasis on ecology mitigation measure;
- (ii) Water quality of stream (DO, pH, turbidity and SS); and
- (iii) Survey of fish species, which is only requested at Channel LMH01

#### Frequency:

- (b) Once a week for general site audit throughout the construction period;
- (ii) Three times per week for stream monitoring; and
- (iii) Once per week for survey of fish species.

## Duration:

Throughout the whole construction period

### 4.4 MONITORING EQUIPMENT

The monitoring equipment for air quality, construction noise, stream water quality and ecology are summarized below.

## 4.4.1 Air Quality

A list of air quality monitoring equipments is shown in *Table 4-3*.

### Table 4-3 Air Quality Monitoring Equipment

Equipment	Model		
24-hour TSP			
High Volume Air Sampler (herein after 'HVS')	Grasby Anderson GMWS 2310 HVS		
Calibration Kit	TISCH Model TE-5025A		
1-hour TSP			
Portable Dust Meter	TSI DustTrak Model 8520		

# 4.4.2 Construction Noise

A list of construction noise monitoring equipments is shown in Table 4-4.

## Table 4-4 Construction Noise Monitoring Equipment

Equipment	Model
Integrating Sound Level Meter	B&K Type 2238
Calibrator	B&K Type 4231
Portable Wind Speed Indicator	Testo Anemometer

# 4.4.3 Water Quality

Monitoring Equipment for water quality are shown in Table 4-5.

#### Table 4-5

#### Water Quality Monitoring Equipment

Equipment	Model / Description
In-situ Measurement	
Water Depth Detector	Eagle Sonar or steel ruler
Water Sampler	Teflon bailer / bucket
Thermometer & DO meter	YSI Multimeter
pH meter	Extech pH EC 500
Turbidimeter	Hach 2100p
Sample Container	High density polythene bottles (provided by laboratory)
Storage Container	'Willow' 33-litter plastic cool box
Laboratory Analysis	
Suspended Solids	HOKLAS accredited Laboratory

# 4.4.4 Equipment Calibration

The calibrations certificate of all monitoring equipment are used during the impact monitoring program are attached in *Appendix E* and the calibration requirement are described in below:

#### <u>Air Quality</u>

The calibration of the HVS is performed at a two month intervals in accordance with the manufacturer's instruction using the NIST-certified standard calibrator (Tisch Calibration Kit Model No.TE-5025A). The calibration data are properly documented and the associated records are maintained by the ET for future reference.

The 1-hour TSP meter is calibrated at a year intervals in accordance with the in-house method. Zero response of the equipment is checked before and after each monitoring event.

# <u>Noise</u>

The sound level meters are calibrated using an acoustic calibrator prior to and after spot checking measurements. The meters are regularly calibrated by HOKLAS accredited laboratory. Prior to and following each noise measurement, the accuracy of the sound level meter is checked using an acoustic calibrator generating a known sound pressure level at a known frequency. Measurements are considered valid only if the calibration levels before and after the noise measurement agree to within 1.0 dB

# Water Quality

In-situ monitoring instruments are calibrated and certified by a laboratory accredited under HOKLAS or any other international accreditation scheme at 3 monthly intervals.

# 4.4.5 Ecology

The following equipment will be used for monitoring:-

- General: field note books and survey forms, digital camera; and
- Binoculars (7-10x and 8 x 30 magnification);

# 4.4.6 Others EM&A Requirement

Landscape & Visual and Cultural Heritage impact monitoring are also required for the Designated Project and stipulated in EM&A manual [382486/73//Issue2] Section 7 and Section 8 accordingly

# Landscape & Visual

Landscape and visual mitigation measures should be implemented during construction phase according to the EM&A Manual. The construction phase landscape and visual EM&A shall be carried out as part of the site audit program. Site inspection will be undertaken at least once every two weeks throughout the construction period.

# Cultural Heritage

Cultural heritage of the Terrance Wall (AAHB-855) at Lin Ma Hang (LMH01) is required to be carried out during the construction phase in accordance with the EM&A Manual [382486/73//Issue2].

# 4.5 MONITORING PROCEDURE

The monitoring methodology and procedure during the impact monitoring are presented as below:

# 4.5.1 Air Quality

# <u>1-hour TSP</u>

Operation of the 1-hour TSP meter is follow manufacturer's Operation and Service Manual. The 1-hour TSP monitor, a TSI Dust Track Aerosol Monitor Model 8520, or Sibata LD-3 Laser Dust Meter is a portable, battery-operated laser photometer. The 1-hour TSP meter provides a real time 1-hour TSP measurement based on 90<sup>0</sup> light scattering. The 1-hour TSP monitor consists of the following:

- A pump to draw sample aerosol through the optic chamber where TSP is measured;
- A sheath air system to isolate the aerosol in the chamber to keep the optics clean for maximum reliability; and
- A built-in data logger compatible with Windows based program to facilitate data collection, analysis and reporting.

The 1-hour TSP meter using was within the valid period, calibrated by the manufacturer prior to purchasing. Zero response of the instrument was checked before and after each monitoring event.

# <u>24 –hour TSP</u>

The equipment used for 24-hour TSP measurement is the HVS brand named Thermo Andersen, Model GS2310 TSP high volume air sampling system, which complied with EPA Code of Federal Regulation, Appendix B to Part 50. The HVS consists of the following:

- An anodized aluminum shelter;
- A 8"x10" stainless steel filter holder;

- A blower motor assembly;
- A continuous flow/pressure recorder;
- A motor speed-voltage control/elapsed time indicator;
- A 6-day mechanical timer, and
- A power supply of 220v/50 Hz

The HVS is calibrated prior the impact monitoring to following the manufacturer's instruction using the NIST-certified standard calibrator brand named Tisch Calibration Kit Model TE-5028A. Regular HVS operation and maintenance as well as filter paper installation and collection was performed by the ET's competent technicians, whereas laboratory analyses were conducted in a local HOKLAS accredited laboratory, ALS Technichem (HK) Pty Ltd (hereinafter 'ALS'). The analyzed 24-hour TSP filters were kept in ALS for six months prior to disposal.

#### Meteorological Information

All relevant data including temperature, pressure, weather conditions, elapsed-time meter reading for the start and stop of the sampler, identification and weight of the filter paper is recorded in detail.

Meteorological information is sourced from the Hong Kong Observatory (Ta Kwu Ling Station). The data included wind direction, wind speed, humidity, rainfall, air pressure and temperature etc that in general is required for evaluating the air quality for air quality monitoring.

### 4.5.2 Construction Noise

Sound level meters listed above comply with the International Electrotechnical Commission Publications 651: 1979 (Type 1) and 804: 1985 (Type 1) specifications, as recommended in Technical Memorandum BE issued under the Noise Control Ordinance (NCO).

All noise measurements are performed with the meter set to FAST response and on the A-weighted equivalent continuous sound pressure level (Leq). Leq(30min) measurements are used as the monitoring parameter for the time period throughout the construction phase.

The sound level meter is set higher than 1.2m above the existing ground. The microphone is pointed to the site with the microphone facing perpendicular to the line of sight. The windshield is fitted for all measurements. The measurement point at impact locations is normally set close to the exterior of the building.

Immediately prior to and following each noise measurement the accuracy of the sound level meter is checked using an acoustic calibrator generating a known sound pressure level at a known frequency (94dBA). Measurements are accepted as valid due to the calibration levels from before and after the noise measurement agree to within 1.0dB.

#### 4.5.3 Water Quality

Water quality monitoring is conducted at the middle of the water columns (Mid-Depth) due to water columns at all sampling locations are less than 3.0 meters during monitoring.

#### Water Depth

Water depths are determined prior to measurement and sampling. A steel ruler with a suitable weight was dropped to the bottom of the water column to measure the water depth which is actually well below 1 meter.

#### Dissolved Oxygen (DO)

A portable Extech Instrument, ExStik<sup>R</sup> DO600 DO Meter is used for in-situ DO measurement. The DO meter is capable of measuring DO in the range of 0 - 20 mg/L and 0 - 200 % saturation and checked against water saturated ambient air on each monitoring day prior to monitoring.

Although the DO Meter automatically compensates ambient water temperature to a standard temperature of 20<sup>°</sup>C for ease of comparison of the data under the changing reality, the temperature readings of the DO Meter is recorded.

# <u>рН</u>

A portable Extech Instrument,  $ExStik^{TM}$  Models pH EC 500 or a Hanna HI98107 pH Meter is used for in-situ pH measurement. The pH meter is capable of measuring pH in the range of 0 – 14 and readable to 0.1. Standard buffer solutions of pH 7 and pH 10 are used for calibration of the instrument before and after measurement.

# <u>Turbidity</u>

A portable Hach 2100p turbidity Meter is used for in-situ turbidity measurement. The turbidity meter is capable of measuring turbidity in the range of 0 - 1000 NTU.

# Suspended Solids (SS)

SS is determined by ALS using HOKLAS accredited analytical methods namely ALS Method EA-025. The limit of report is 2mg/L

# Water Sampler

Water samples are collected by the ET using a plastic sampler to avoid metal contamination. Due to water depth for both sampling locations are lesser than 0.5m, a cleaned plastic beaker is used for sample collection. The sampler is rinsed before collection with the sample to be taken. 1,000mL water sample is collected from depth for laboratory analyses.

# <u>Sample Container</u>

Water samples are contained in screw-cap PE (Poly-Ethylene) bottles as provided by ALS. The PE bottles are pretreated by laboratory in accordance with the corresponding analytical requirements of HOKLAS. Where appropriate, the sampling bottles are rinsed with the water to be contained. Water sample is transferred from the sampler to the sample bottles to 95% bottle capacity to allow possible volume expansion during delivery and storage.

# Sample Storage and delivery

A 'Willow' 33-liter plastic cool box packed with ice is used to preserve the collected water samples prior to arrival at the laboratory. The temperature of the cool box is maintained as close to 4<sup>o</sup>C as possible without being frozen. Samples are delivered to the laboratory end of sampling day or following day within the maximum storage time requirement.

# Chemical Analysis

ALS Technichem (HK) Pty Ltd (HOKLAS No. 66) is appointed by ET to provide analytical services for this project. The analysis of suspended solids is carried out to follow the APHA Standard Methods for the Examination of Water and Wastewater 19ed 2540D. The sample preparation and analysis under the QA/QC control is follow the HOKLAS QA/QC requirements and undertaken by the laboratory.

# 4.5.4 Ecology

Weekly site audit covering the whole assessment area is conducted during the construction work at Channels MUP05 and LMH01, focusing on the status/condition of the study area and its immediate vicinity, especially those sensitive habitats that have been identified in the ESR and/or habitats of conservation importance as stated in the EIAO TM.

Any changes found during the site audit have been marked and reported in the Monthly EM&A Report, and for those changes will be predicted to possibly or probably have had an impact on flora and fauna distribution or numbers should be highlighted in the Monthly EM&A report.

Ecology of water quality monitoring at the stream as requested to undertake in upstream and downstream of construction site Channels MUP05 and LMH01. The location of monitoring stations and requirements are same as the Water Quality Monitoring at the Channels MUP05 and LMH01. The procedure of water monitoring is same as the Water Quality monitoring.

# 4.6 Environmental Quality Performance Limits

Baseline EM&A monitoring was carried out from17 September to 13 October 2008, and ecological baseline monitoring for the habitat updating was performed on 16 September 2008 in accordance with the EM&A Manuals requirements. A summary of Action/Limit (A/L) Levels for air quality, construction noise, stream water quality, ecology and Landscape & Visual are shown in **Tables 4-6**, **4-7**, **4-8**, **4-9** and **4-10** respectively.

Table 4-6 Action and Limit Levels for Air Quality

Monitoring Station	Action Lev	/el (μg /m³)	Limit Level (µg/m³)		
Monitoring Station	1-hour TSP	24-hour TSP	1-hour TSP	24-hour TSP	
MUP-A1	>307	>156	> 500	> 260	
MUP-A2a	>300	>149	> 500	> 260	
MUP-A3	>299	>150	> 500	> 260	

Table 4-7

# Action and Limit Levels for Construction Noise

Time Period	Action Level in dB(A)	Limit Level in dB(A)				
0700-1900 hours on normal weekdays	When one documented complaint is received	> 75* dB(A)				
Note: * Deduces to 70 dP(A) for schools and 65 dP(A) during the school examination periods						

Note: \* Reduces to 70 dB(A) for schools and 65 dB(A) during the school examination periods.

Table 4-8

#### Action and Limit Levels for Water Quality

Monitoring Location		DO (mg/L)			Turbidity (NTU)		pH (Unit)		SS (mg/L)	
ID	Station Type	Action Level	Limit Level	Action Level	Limit Level	Action Level	Limit Level	Action Level	Limit Level	
MUP-W1	Control	NA	NA	NA	NA	NA	NA	NA	NA	
MUP-W2	Control	NA	NA	NA	NA	NA	NA	NA	NA	
MUP-W3	Control	NA	NA	NA	NA	NA	NA	NA	NA	
MUP-W4	Impact	5.27	5.18	18.03	24.81	6.5 – 8.5	6.0 – 9.0	15.8	17.6	
MUP-W5	Mobile	4.42	4.37	7.88	8.54	6.5 – 8.5	6.0 – 9.0	6.0	6.0	
MUP-W6	Mobile	4.54	4.51	11.81	14.84	6.5 – 8.5	6.0 – 9.0	3.9	4.8	
LMH-W1	Control	NA	NA	NA	NA	NA	NA	NA	NA	
LMH-W2	Control	NA	NA	NA	NA	NA	NA	NA	NA	
LMH-W3	Impact	3.96	3.62	11.31	12.10	6.5 – 8.5	6.0 – 9.0	8.8	10.6	
LMH-W4	Mobile	4.34	3.98	5.33	5.95	6.5 – 8.5	6.0 – 9.0	3.0	3.0	
LMH-W5	Mobile	2.14	2.07	31.46	35.33	6.5 – 8.5	6.0 – 9.0	25.0	29.8	
LMH-W6	Mobile	2.67	2.65	12.32	13.02	6.5 – 8.5	6.0 – 9.0	4.8	6.6	

Note: - For DO, non-compliance of water quality limits occurs when monitoring result is lower than the limits.

- For SS and turbidity, non-compliance of the water quality limits occurs when monitoring result is higher than the limits.

- For pH, non-compliance of water quality limits occurs when monitoring result is exceeded the range of limits.

# Table 4-9 Action and Limit Levels for Ecology in Construction Phase at Channels MUP05 and LMH01

	Parameter	Action Level	Limit Level
•	Any construction works do not cause adverse ecological impacts outside the work site of Channels Where natural banks are to be retained are protected from adverse effects of engineering works, including impacts to riparian vegetation along these banks The existing natural stream channel is protected from adverse effect of engineering works, including potential indirect impacts through increased sedimentation	Non- conformity on one occasion	Repeated Non- conformity
•	Rock/fines used to form the bottom of the widened channel have the appropriate physical characteristics to permit re- establishment of semi-natural stream conditions The recommended mitigation measures are properly implemented by the Contractor		



#### Table 4-10 Action Level for Landscape and Visual Impact in Construction Phase

Parameter	Action Level	Limit Level
Any trespass by the contractor outside the limit of the works,	Non-conformity	Repeated non-
including any damage to existing trees, woodland and vegetation	on one occasion	conformity

#### 4.7 EVENT AND ACTION PLANS

An Event Action Plan for air quality, construction noise, water quality and ecology has been implemented for this designated project. Details of the Event Action Plan are presented in *Appendix F*.

#### 4.8 ENVIRONMENTAL MITIGATION MEASURES

The project ESR has recommended environmental mitigation measures to minimize potential environmental impacts arising from the construction of the project. A full list of the mitigation measures is detailed in *Appendix C*.

#### 4.9 DATA MANAGEMENT AND DATA QA/QC CONTROL

The impact monitoring data is handled by the ET's systematic data recording and management, which complies with an in-house certified (ISO 9001:2000) Quality Management System. Standard Field Data Sheets (FDS) are used in the EM&A program.

The monitoring data recorded in the equipment e.g. 1-hour TSP meters and noise meters are downloaded directly at the end of each monitoring day. The downloaded monitoring data are input into a computerized database properly maintained by the ET. The laboratory results are input directly into the computerized database and QA/QC checked by personnel other than those who input the data.

For monitoring activities which require laboratory analysis, the responsible laboratory, ALS, follows the QA/QC requirements as set out under their HOKLAS scheme for all laboratory testing.

## 5. IMPACT MONITORING RESULTS

In this reporting month, construction works and environmental monitoring had started at Channels MUP03A&B, MUP04A&B and MUP05 located in Man Uk Pin. No impact monitoring has yet been undertaken at Channel LMH01 due to no construction activities during the month. In the future when the EM&A programme will cover all four channels once works in Channel LMH01 start.

The scheduled impact monitoring in this month is shown in *Appendix G* and the monitoring results are detailed in the following sub-sections. The meteorological data during the Reporting Period are summarized in *Appendix J*.

#### 5.1 AIR QUALITY

According to the EM&A Manual, air monitoring is only required to conduct at Channels MUP04A and MUP05 during the construction phase. In this reporting period, the results of impact air quality monitoring for 24-hour and 1-hour TSP are summarized in **Tables 5-1** and **5-2**. The detailed 24-hour TSP monitoring data are shown in **Appendix H** and the graphic plots are shown in **Appendix I**.

	MUP-A1 (MUP05)			)	MUP-A2a (MUP05)				MUP-A3 (MUP04A)			
Date	Start	Measurement S		Start Measurement Start		Start	t Measurement					
	Time	1 <sup>st</sup>	2 <sup>nd</sup>	3 <sup>rd</sup>	Time	1 <sup>st</sup>	2 <sup>nd</sup>	3rd	Time	1 <sup>st</sup>	2 <sup>nd</sup>	3rd
31-Jul-12	13:00	205	210	201	13:05	198	201	190	15:15	211	215	209
6-Aug-12	11:10	60	52	56	14:30	59	67	69	11:22	47	59	52
11-Aug-12	10:00	167	182	182	13:09	196	171	179	10:14	121	109	101
17-Aug-12	10:15	22	20	23	10:20	20	21	20	12:40	25	24	25
23-Aug-12	10:40	198	195	201	10:45	186	189	188	13:15	201	197	202
Average	132				130			120				
(range)		(20 - 2)	210)		(20 - 201)			(24 – 215)				

Table 5-1 Summary of 1-hour TSP Monitoring Results (µg/m<sup>3</sup>)

Table 5-2 Summary of 24-hour TSP Monitoring Results	ե (µg/m³)
---	-----------

Date	MUP-A1 (MUP05)	MUP-A2a (MUP05)	MUP-A3 (MUP04A)
30-Jul-12	8	55	power failure#
4-Aug-12	78	85	power failure#
10-Aug-12	102	87	power failure#
16-Aug-12	25	62	power failure#
22-Aug-12	65	power failure#	power failure#
Average (range)	56 (8 - 102)	72 (55-87)	NA

# Power failure and no make up of lost samples.

As shown in **Tables 5-1** and **5-2**, there was no exceedance recorded in 1-hour TSP and 24-hour TSP during this reporting period. As a reminder, the Contractor is advised to increase the frequency of water spraying especially in the sunny and dry days. There were total 6 power failures incident recorded at Location MUP-A2a and MUP-A3. It is noted by the Contractor they have tried to fix the problem from power supplier. However, they could not get contact to the residents who supply power all the time. In recent month, monitoring location MUP-A1 and MUP-A2a has been resumed. We have constantly liaised with the Contractor to rectify the power supply problem and Contractor will deploy another stable power source. On the other hands, it is shown that there is no works near those locations in recent months. It is believed that the site area would not cause exceeding for monitoring results or significant impact for air quality. However, the Contractor is needed to resume the power supply as soon as possible.

#### 5.2 CONSTRUCTION NOISE

According to the EM&A Manual, noise monitoring is only required to perform at Channels MUP04A and MUP05 during the construction phase. All noise monitoring results are summarized in **Tables 5-3** to **5-6** and graphic plot are shown in **Appendix I**.

Table 5-3	Results of Construction Noise Monitoring at Channels MUP-N1 / MUP01/02-N1 (MUP05)
-----------	---

Date	Start Time	1 <sup>st</sup> Leq5	2 <sup>nd</sup> Leq5	3 <sup>rd</sup> Leq5	4 <sup>th</sup> Leq5	5 <sup>th</sup> Leq5	6 <sup>th</sup> Leq5	Leq30 dB(A)
31-Jul-12	13:30	63.2	70.4	68.1	67.9	69.3	66.4	68
6-Aug-12	11:17	64.5	60.1	62.3	61.3	59.4	63.9	62
11-Aug-12	11:22	64.8	65.9	66.4	64.6	69.0	66.8	67
17-Aug-12	10:24	59.0	59.3	60.2	60.8	60.6	62.4	61
23-Aug-12	11:21	60.1	62.9	61.5	64.5	61.4	61.6	62
Limit Level (Leq30)					75 dB(A)			

Table 5-4

Results of Construction Noise Monitoring at Channels MUP-N2 (MUP05)

Date	Start Time	1 <sup>st</sup> Leq5	2 <sup>nd</sup> Leq5	3 <sup>rd</sup> Leq5	4 <sup>th</sup> Leq5	5 <sup>th</sup> Leq5	6 <sup>th</sup> Leq5	Leq30 dB(A)
31-Jul-12	14:12	68.7	69.2	63.6	63.1	63.2	65.1	66
6-Aug-12	13:00	63.4	61.2	62.8	60.1	67.8	69.7	66
11-Aug-12	10:42	70.1	69.8	70.8	72.4	73.2	68.1	71
17-Aug-12	10:57	60.3	58.4	63.1	58.9	56.8	54.8	60
23-Aug-12	10:46	66.2	59.1	58.1	56.9	57.7	57.1	61
Limit Level (Leq30)					75 dB(A)			

Table 5-5

Results of Construction Noise Monitoring at Channels MUP-N3 (MUP05)

Date	Start Time	1 <sup>st</sup> Leq5	2 <sup>nd</sup> Leq5	3 <sup>rd</sup> Leq5	4 <sup>th</sup> Leq5	5 <sup>th</sup> Leq5	6 <sup>th</sup> Leq5	Leq30 dB(A)
31-Jul-12	13:35	66.5	66.5	66.5	72.0	63.2	63.7	67
6-Aug-12	11:20	67.4	71.3	65.8	70.9	69.9	67.9	69
11-Aug-12	9:55	59.7	58.3	64.7	67.7	61.0	59.2	63
17-Aug-12	11:00	68.7	70.6	69.2	66.2	71.6	65.4	69
23-Aug-12	11:30	60.8	62.0	61.6	63.3	62.2	69.5	65
Limit Level (	Leq30)				75 dB(A)			

Table 5-6

Results of Construction Noise Monitoring at Channels MUP-N4 (MUP04A)

Date	Start Time	1 <sup>st</sup> Leq5	2 <sup>nd</sup> Leq5	3 <sup>rd</sup> Leq5	4 <sup>th</sup> Leq5	5 <sup>th</sup> Leq5	6 <sup>th</sup> Leq5	Leq30 dB(A)
31-Jul-12	14:15	64.0	61.5	55.4	58.2	58.1	62.3	61
6-Aug-12	13:00	54.0	60.3	51.1	58.9	58.0	57.4	58
11-Aug-12	10:38	63.8	62.8	61.7	62.6	64.5	62.2	63
17-Aug-12	11:30	65.3	64.5	72.6	65.0	68.5	68.4	68
23-Aug-12	10:53	70.1	70.7	71.6	67.3	71.3	68.7	70
Limit Level (	Leq30)				75 dB(A)			

As shown in **Tables 5-3** to **5-6**, the construction noise levels fluctuated well below the Limit Level. No documented complaints against the construction noise were registered during the Reporting Period. No NOE or corrective actions were therefore required for the parameter

# 5.3 WATER QUALITY

In this reporting month, a total of 13 sampling days were performed for stream water quality monitoring according to the EM&A Manual requirements. Detailed in-situ measurements and laboratory results are shown in **Appendix H** and graphic plots given in **Appendix I**.

n stream water quality monitoring, there were 11 exceedances recorded in the reporting period (2 action level exceedances and 9 limit level exceedances). According to the information from Contractor, it is recorded from Hong Kong Observatory that adverse weather and heavy rainfall was record during the captioned days. In addition, high levels of SS and Turbidity were recorded at up-stream control stations and there is no major construction activity was carried out except dewatering and flood preventive measures. The exceedances at the captioned stations would be the consequences of rainfall recorded or seasonal variation. We would conclude that the exceedances were not works related under the project. A summary of exceedances in this reporting month is provided in **Table 5-7** below:

#### Table 5-7 Summary of Stream Water Quality Exceedances

Station	DO		Turbidity		pH Value		SS		Total Exceedance	
Station	Action	Limit	Action	Limit	Action	Limit	Action	Limit	Action	Limit
MUP-W4 (a)	0	0	0	0	0	0	2	0	2	0
MUP-W5 <sup>(b)</sup>	0	0	0	0	0	0	0	4	0	4
MUP-W6 (b)	0	0	0	1	0	0	0	4	0	5
Exceedances	0	0	0	1	0	0	2	8	2	9

For pH measurements, the results shown that the range of pH unit was within 7.11 - 8.07 and within the lower or upper bounds of Action Limit Level.

## 5.4 ECOLOGY

According to the EM&A Manual [*382486/73//Issue2*], ecology monitoring is required for Channels MUP05 and LMH01 during the construction phase. In this reporting period, the construction works of Channels LMH01and MUP05 are at late stage.

In this reporting month, four site visits were carried out on 26<sup>th</sup> July, 2<sup>nd</sup>, 9<sup>th</sup>, 18<sup>th</sup> and 23<sup>rd</sup> August 2012. During all site visits, water in river was generally clear as most of the construction works were completed. Some construction material including soil and rocks were still noticed piled in the stream or riverbed. The contractor has been reminded to carry out all the required sediment control measures to make sure no sediment-loaded water being discharged to the watercourse. River bed in completed sections were re-colonized with vegetation and some animals were seen in the river including fish, snails and insects, which indicates that the new river habitat is in process of ecology restoration.

The detailed findings are listed in the table below and the checklists are attached in *Appendix L*.

Date of Audit	Defects and Deficiencies Identified	Recommendation	Follow-up Actions and Remedies Taken
26 <sup>th</sup> July 2012	Piles of soil and rocks on streambed were washed away by flood during typhoon; Sediment-loaded water in the stream noted;	Soil erosion control;	To be taken
2 <sup>nd</sup> August 2012	Sediment-loaded water in the stream noted;	Soil erosion control;	To be taken
9th August 2012	Piles of soil and rocks on streambed with potential soil erosion problem during storm;	Soil erosion control; Remove soil piles in the streambed	To be taken
18 <sup>th</sup> August 2012	Piles of soil and rocks on streambed with potential soil erosion problem during storm;	Soil erosion control; Remove soil piles in the streambed	To be taken
23 <sup>rd</sup> August 2012	Piles of soil and rocks on streambed were washed away by flood during typhoon;	Soil erosion control;	To be taken

# Table 5-8Summary of Defects and Deficiencies Identified and Follow-up Actions and<br/>Remedies Taken

# 5.5 OTHER FACTORS INFLUENCING THE MONITORING RESULTS

There were no other noticeable external factors generally affecting the monitoring results in this reporting month.

5.6 QA/QC RESULTS AND DETECTION LIMITS

Not applicable.

- 6. REPORT ON NON-COMPLIANCE, COMPLAINT, NOTIFICATION OF SUMMONS AND SUCCESSFUL PROSECUTION
- 6.1 RECORD OF NON-COMPLIANCE OF ACTION AND LIMIT LEVELS

No Action or Limit Level exceedance was identified for air quality, construction noise but 6 exceedances were recorded for stream water quality monitoring. For details please refer to section 5.3. No associated corrective actions were required.

- 6.2 ENVIRONMENTAL COMPLAINTS No written or verbal complaints were received (written or verbal) for each medium during the Reporting Period.
- 6.3 RECORD OF NOTIFICATION OF SUMMONS AND SUCCESSFUL PROSECUTION No notification of summons or successful prosecutions was recorded during the Reporting Period.
- 6.4 REVIEW OF REASONS FOR AND IMPLICATION OF NON-COMPLIANCE, COMPLAINT AND NOTICE OF SUMMONS No non-compliance, complaint or Notice of Summons was received in this reporting month.
- 6.5 DESCRIPTION OF FOLLOW-UP ACTIONS TAKEN It follows from **Sections 6.1** and **6.4** that no follow-up actions were necessary.
- 6.6 OTHERS

# 6.6.1 Solid and Liquid Waste Management Status

The quantity of waste for disposal or reuse is summarized in **Tables 6-1** and **6-2**. The monthly summary of waste flow table is shown in **Appendix M**.

Table 6-1 Summary of Quantities of Waste for Disposal

Type of Waste	Quantity	Disposal Location
C&D Materials (Inert) (in '000m <sup>3</sup> )	0	Tuen Mun 38 Fill Bank
	0.6	Reused in other Projects
C&D Materials (Non-Inert) (in '000m <sup>3</sup> )	0	NENT
Chemical Waste (in '000kg)	0	NA
General Refuse (in '000m <sup>3</sup> )	0	NA

#### Table 6-2

Summary of Quantities of Waste for Reuse/Recycling

Type of Waste	Quantity	Disposal Location
Metals for Recycling (in '000kg)	0	NA
Paper for Recycling (in '000kg)	0	NA
Plastics for Recycling (in '000kg)	0	NA

There was no known site effluent discharged but it was assumed that an estimated volume of  $50m^3$  of waste water was discharged in this reporting month.

## 6.6.2 Site Inspection and Environmental Audit

A total of **5** weekly environmental site inspection and audit were conducted jointly by the ER, EO and ET during the Reporting Period on **26 July**, **2**, **9**, **16 and 23 August 2012**. No adverse environmental impacts were observed which indicated that the mitigation measures implemented were effective. Minor deficiencies found in the site inspections and audit was promptly rectified within the specified deadlines. Findings of the site inspection and environmental audit are summarized below. Performa of the weekly ET site inspection and audit activities are presented in *Appendix K*.

#### Table 6-3 Summary of Findings of Site Inspection and Environmental Audit

Date	Findings / Deficiencies	Follow-Up Status
26 July 2012	• Turbid water was observed in the river stream due to heavy rain. Full implementation of the required environmental mitigation measures is reminded.	The deficiency has been rectified during site inspection on 2 August 2012.
2 August 2012	• No adverse environmental impacts were observed during the site inspection. Full implementation of the required environmental mitigation measures, in particular de-watering and flood preventive measures in adverse weather, is reminded.	
9 August 2012	• No adverse environmental impacts were observed during the site inspection. Full implementation of the required environmental mitigation measures is reminded.	
16 August 2012	• No adverse environmental impacts were observed during the site inspection. Full implementation of the required environmental mitigation measures is reminded.	
23 August 2012	• No adverse environmental impacts were observed during the site inspection. Full implementation of the required environmental mitigation measures is reminded.	

# 6.6.3 Works to be undertaken in the Forth-Coming Month

Works to be undertaken next month are shown in the construction program enclosed in *Appendix* **C**. In addition, the activities undertaken in the Reporting Period including construction, preparation and site clearance activities will also continue in the future. They are summarized below:

The forthcoming activities in the next two months:

Carried out defect works during construction period as follow:

- (a) Install outstanding fencing, railing and signates;
- (b) Landscape softworks and establishment works;
- (c) Rectify defective concrete on grasscrete/paving;

# 6.6.4 Future Key Issues and Mitigation Measures for the Forth-Coming Month

As wet season has come, the coming excavation works of the channels, ingression of surface runoff into the river within MUP Channels continues to be the key issue in future months. The contractor is reminded that mitigation measures for water quality and ecology should therefore be fully implemented.

In addition, attention should be paid to noise impact during the construction work progress, and with other environmental issues identified in the EM&A Manual. Mitigation measures recommended in the Environmental Study Report (ESR) and summarized in Mitigation Measure Implementation Schedule should continually be applied.

# 7 CONCLUSIONS AND RECOMMENDATIONS

This is the **42<sup>nd</sup>** monthly EM&A Report for Channels MUP03A&B, MUP04A&B, MUP05 and LMH01 - Designated Project, covering a period from **26 July 2012** to **25 August 2012**.

In air quality and noise monitoring, there were no Action/ Limit Level exceedance recorded in this reporting period. No associated corrective actions were therefore required.

For water quality, there were also 11 exceedances recorded in the reporting period (2 action level exceedances and 9 limit level exceedances). According to the information from Contractor, it is recorded from Hong Kong Observatory that adverse weather and heavy rainfall was record during the captioned days. In addition, high levels of SS and Turbidity were recorded at up-stream control stations and there is no major construction activity was carried out except de-watering and flood preventive measures. The exceedances at the captioned stations would be the consequences of rainfall recorded or seasonal variation. We would conclude that the exceedances were not works related under the project.

No written or verbal complaints, notifications of summons or successful prosecutions were received during the Reporting Period. No adverse environmental impacts were observed during the weekly site inspection and environmental audit, which indicated that the implemented mitigation measures for air quality, construction noise and water quality were effective. A few minor deficiencies found in the weekly site inspection and they were rectified within the specified deadlines. The environmental performance of the Project was therefore considered satisfactory.

During the wet season, the coming excavation works of the channels, ingression of surface runoff into the river within MUP Channels continues to be the key issue in future months. The contractor is reminded that mitigation measures for water quality and ecology should therefore be fully implemented.

In addition, attention should be paid to noise impact during the construction work progress, and with other environmental issues identified in the EM&A Manual. Mitigation measures recommended in the Environmental Study Report (ESR) and summarized in Mitigation Measure Implementation Schedule should continually be applied.

Impact monitoring should be immediately undertaken upon the construction works commencement at Channel LMH01 and will be reported in the coming month.


- End of Text -



Appendix A

# **Site Location Plan**

Z:\Jobs\2008\TCS00409 (DC-2007-08)\600\EM&A Report\DP\Monthly Report\42nd monthly - August 2012\R1185v1\_July DP.docx Action-United Environmental Services and Consulting

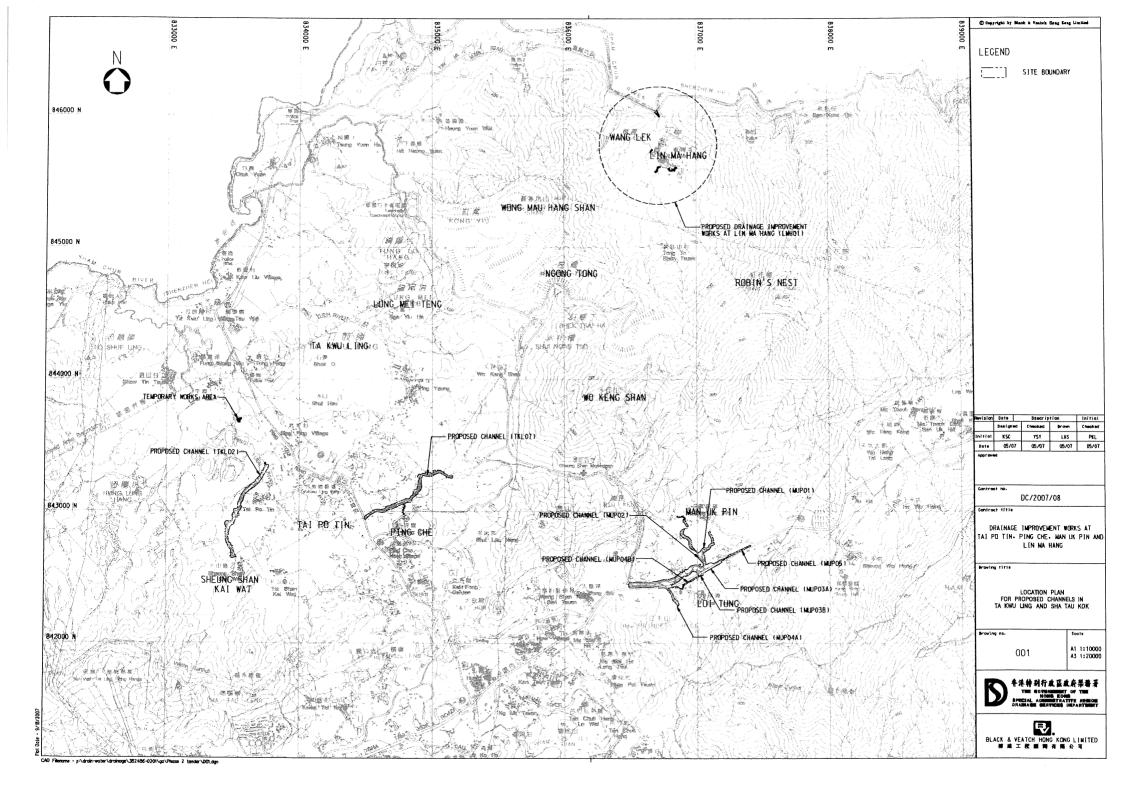




# **Appendix B**

# Environmental Management Organization and Contacts of Key Personnel



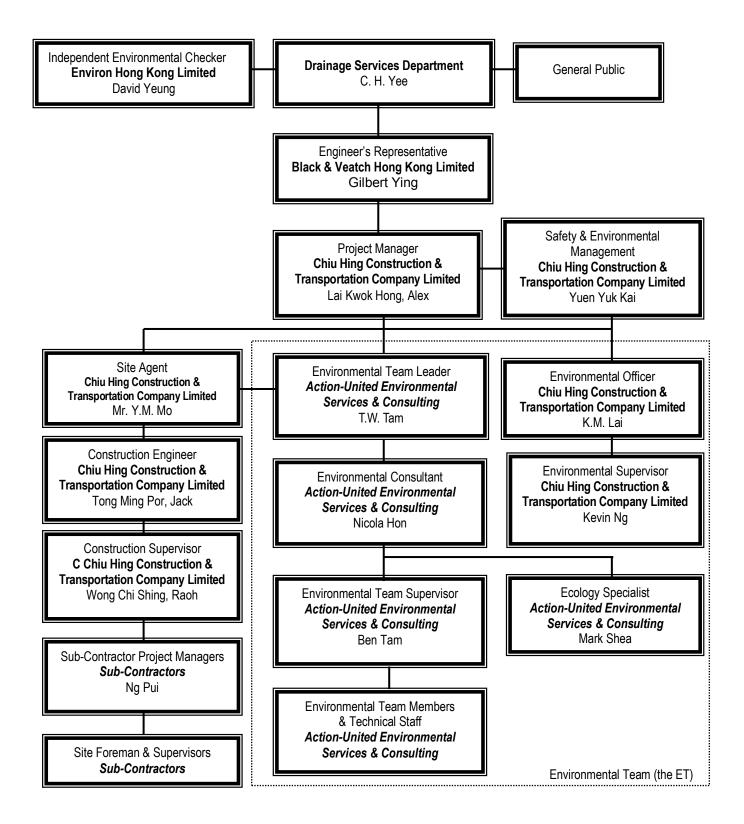

**Environmental Management Organization** 



# **Contact Details of Key Personnel**

Organization	Project Role	Name of Key Staff	Tel No.	Fax No.
DSD	Employer	Mr. C. H. Yee	2594-7347	2827-8700
B&V	Engineer's Representative	Mr. Gilbert Ying	2659-8787	2659-8323
Environ	Independent Environmental Checker	Mr. David Yeung	3743-0788	3548-6988
CHCT	Project Manager	Mr. Lai Kwok Hong, Alex	2659-8221	2659-8232
СНСТ	Safety & Environmental Manager	Mr. Yuen Yuk Kai	2659-8221	2659-8232
CHCT	Site Agent	Mr. Y.M. Mo	2659-8221	2659-8232
СНСТ	Construction Engineer	Mr. Tong Ming Por, Jacky	2659-8221	2659-8232
СНСТ	Construction Supervisor	Mr. Roah Wong	2659-8221	2659-8232
СНСТ	Structural Engineer	Mr. Kwok Chin Ming	2659-8221	2659-8232
СНСТ	Site Forman	Mr. Chung Ping Kai	2659-8221	2659-8232
СНСТ	Environmental Officer	Mr. K.M. Lai	2659-8221	2659-8232
СНСТ	Environmental Supervisor	Mr. Kevin Ng	2659-8221	2659-8232
Kin Tat	Sub-contractor Project Manager	Mr. Ng Pui	2659-8221	2659-8232
AUES	Environmental Team Leader	Mr. T.W. Tam	2959-6059	2959-6079
AUES	Environmental Consultant	Miss Nicola Hon	2959-6059	2959-6079
AUES	Environmental Team Supervisor	Mr. Ben Tam	2959-6059	2959-6079
AUES	Ecologist	Mr. Mark Shea	2959-6059	2959-6079

# Legends:

DSD	(Employer) – Drainage Services Department
B&V	(Engineer) – Black & Veatch Hong Kong Limited
CHCT	(Main Contractor) – Chiu Hing Construction & Transportation Company Limited
Environ	(IEC) – Environ Hong Kong Limited
AUES	(ET) – Action-United Environmental Services & Consulting



# Appendix C

Master Construction Program Future Construction Works & Environmental Mitigation Implementation Schedule




# **Master Construction Program**

CHIU HING CONSTRUCTION & TRANSPORTATION Co., Ltd MASTER PRCKIRAMME D6 ( Section 1 of works) (CONTRACT DC/2007/8, DRAINAGE IMPROVEMENT WORKS AT TAI PO TIN, PING CHE, MAN UK PIN AND LIN MA HANG	ATION Co., Ltd ) ENT WORKS at TAI PO TIN, PII	VG CHE, MAN UK P	IN AND LIN M	HANG
10 Tath Name	נאונטנאאו	Niat	4 inf	200
			-	2004.1011 2014.1012 2014.1012 2014.1012 2014.1012 2014.1012 2014.0012.1014.1012 2014.0014.2014.1012 2014.1014.20
CONTRACT: LX 2007/08 (The Weks)	1045 days	Wed 08-4-30	Thu 11-3-10	
Commencement Date	svab civit	Wed 08-4-30	Wed (8-4-30)	
1 Ilandover of Portion B	0 days	Wed 08-4-30	Wed 08-1-30	
River TKL02 with section 5 of works	1045 days 736 days	Wed 08-4-30 Wed 08-4-30	Thu 11-3-10 Tue 09-3-31	
7 Baseline Monitoring	180 days	Wed 08-4-30	Sun 08-10-26	
Initial survery	60 days 10 days	Tue 08-12-2 Mov.00.2.2	Fri (9-1-30	
10 Sile cleanneron	10 tadys [8 days	The (9-2-12	1-6-60 uns	
The survey + report	Nuclear States and States and States and States and States	Wed 08-4-30	Thu 08-10-16 Sec 60 2.51	
12 CONSTRUCT ACCESS KOND 13 Remove and Truestant trees	syna varys fill daves	Mon (2-2-2 Fri 08-10-17	Mon 08-12-15	
		Mon 03-3-2	Tue 09-3-31	
15 Utility Survey/diversion 16 Main River Construction	150 days 467 days	Mon 08-10-27 Sun 09-3-22	Well 09-3-25	
	50 thrys	Sun 09-3-22	Sun 09-5-10	
18 Open cut excavation 10 Upen cut excavation		Mon 09-5-11 Set 00-6-20	Wed (9)-10-7 Vin (99-13-6	
		Wed 09-7-22	Thu 10-1-7	
<u> </u>		Sun 09-8-16	Wed 10-3-3	
		En (9-9-25 Enc. 10-1-2	Sat 10-3-131 Ec: 10.4.21	
200 Kip Kap mung 201 kip Kap mung	stutuys access 90 days	Sul 10-1-23	Thu [0-4-22]	
[]		Fri 10-2-12	Set 10-5-22	
		Sun 10-3-14	Fn 10-6-11	
Zi : Grissed celhilar concrete paving		Xat 19-1-25 Wed 10:6-2	1-2-4-01 entr	
Riv		Wed 09-9-30	Thu 11-3-10	
The Freetbridge construction	160 theys 201	Sun 10-3-14	Fri 10-8-20	
			1 Pe 10 Pe 1	
-1	white	Weil 10-4-1	Sun ID-2-U	
34 FRIN2-1 at C1602 streadmare	-up the	Men 10-7-12	Fill 10.8.30	
Ramp construction	370 days	Wed 09-9-30 Wedented	Mon 10-10-4	
-T		Wel (00)-30	Men 03-10-10	
		Must P) 10-5	N2-011-020 PX	
3) Rise dah restancem in the tamp with some restance of devicement	240000 34045	Sal (94) (14) 24 (94) (14) 25 (94) (14)	Num (04, 11, 10)	
ALC:	of the second	14-10-14-13	Mar 10-6-21	
		Fii 19 4.23	Wet III-5-12	
4) (Water of the Winding Light	Addres	Wei 1945 Mee 1943	Med 10.542 De 10.542	
Walt construction for the range		Sal D.S.	Med 10-6-21	
ALCIDAL Approximate	-	Wei 10-5-2	Sat 10-7-31	
47 Grandler filling with postervice lifet	ter Endug	Ved [9-6-7	10-0-01 ms	
-1		Sa 10-6-12	Sen 10-7-11	
Wall conductive for the range	At days	31m 30-5-17 5-4-30 m 21	Sat 10-7-31	
51 AI CHEGZ Approximate 52 Granitar follone with posterular filter		Sat 10-8-21 Sat 10-8-21	6-6-01 Fell	
- <u>-</u>		Thu 10-8-X5	Tac 10-9-14	
51 Base 4th construction for the fact man	WTW U	Ter 10.8.31 Gen 1144 6	2401 IO	
Vereiv	200 days	Mon 00-10-5	Thu 10-4-22	
		Mon 00-10-5	Fri 10-4-2	
55 Girceel tellular monterityteering theo 3 solid consideration	nd data and data an	190 (9-10-1) Sun (9-10-1)	Med 10-4-12 The 10-4-22	
Ret	80 days	31-01-60 n4T	Sat 10-1-2	
ž		21-01 00 MJT 71-01 01 JUL	Mon 00-11-23	
<ul> <li>67</li> <li>1</li> <li>1</li> <li>7</li> <li>7</li></ul>	n Antoine An Antoine	And Co. 13.4	CI-IL (O H)	
	101444	54 (1) (1) 13	Mon 09-11-23	
	1000000000 (Norme.	Summary		Rettal ty Contast Tay. ESSERCES ESSER
Jaci la	-	Relia Up Task		Second Second Second Second Second Second Partice Dealine
				l sgel

| | | | |

1         (1)	
Result         Constraint         Outsing         Result of Action         Constraint         Constraint <thconstraint< th="">         Constraint         <thconstraint< th="">         Constraint         Constraint</thconstraint<></thconstraint<>	
Tearrent construction         Obset         Weil (84-3)         Under 50	
$ \begin{array}{cccccccccccccccccccccccccccccccccccc$	
Within Wolds         Control         Wolds = -50         Wolds = -50 <thwolds -50<="" =="" th="">         &lt;</thwolds>	
Billor homotion         Clubs         Wildbs-40         Tool B(1)-2         Wildbs-40	
Methods         Bases         Weith School         Bases         Method	
Transmistor         Tables         State	
Transmery (Tarsame)Transmery 	
Catores and Threads (and the true).         Blass         Survey.         Survey. <thsurvey.< th="">         Survey.         <thsu< td=""><td></td></thsu<></thsurvey.<>	
Ranker and Billing loyer Temperary FloweSubtring (Endoterant) Temperary flowe (Endoterant) Temperary	
<ul> <li>Bolays</li> <li>Bolays</li></ul>	
<ul> <li>9) days</li> <li>9) days</li> <li>9) days</li> <li>9) days</li> <li>9) days</li> <li>9) days</li> <li>10 days</li> <li>11 days</li> <li>12 days</li> <li>11 days</li> &lt;</ul>	
<ul> <li>96 days</li> <li>97 days</li> <li>98 days</li> <li>98 days</li> <li>99 days</li> <li>99 days</li> <li>90 days</li> &lt;</ul>	
D days         The 10.7-13           D days         Ho days         Ho 10.8-2           0 days         Ho 10.8-2         Mon 10.8-2           25 days         Wed 10.7-23         Wed 10.7-23           25 days         Wed 10.7-23         Wed 10.7-23           25 days         Wed 10.7-23         Wed 10.9-27           25 days         Fit 09-11-20         Wed 10.9-23           26 days         Fit 09-12-10         Ho 40.92           26 days         Fit 09-12-10         Ho 40.92           26 days         Fit 09-12-10         Ho 40.92           20 days         Fit 10-3-23         Mon 10-23           20 days         Fit 10-3-5         Mon 10-3-3           20 days         Fit 10-3-5         Mon 10-3-3           20 days         Fit 10-3-5         Mon 10-3-5           20 days         Fit 10.3-5	
<ul> <li>Datayas</li> &lt;</ul>	
<ul> <li>40 days</li> <li>41 10.3-19</li> <li>40 days</li> <li>41 10.3-19</li> <li>41 10.3-20</li> <li>41 1</li></ul>	
<ul> <li>Marky Weil (197-3)</li> <li>Marky Weil (197-3)</li> <li>Marky Meil (197-1)</li> <li>Marky Meil (197-2)</li> </ul>	
<ul> <li>Zi days</li> &lt;</ul>	
<ul> <li>25 days</li> <li>25 days</li> <li>710 days</li> <li>711 0-35</li> <li>711 0-55</li> </ul>	
<ul> <li>125 days</li> <li>Fri (0-, (1-2)</li> <li>35 days</li> <li>710 0, (1-2)</li> <li>36 days</li> <li>710 0, (1-2)</li> <li>37 days</li> <li>710 0, (1-2)</li> <li>38 days</li> <li>710 0, (1-2)</li> <li>38 days</li> <li>711 0, (1-3)</li> <li>39 days</li> <li>711 0, (1-3)</li> <li>30 days</li> <li>711 0, (1-4)</li> <li>30 days</li> <li>711 0, (1-5)</li> <li>30 days</li> <li>710 0, (1-5)</li> <li>31 0, (1-5)</li> <li>32 days</li> <li>710 0, (1-5)</li> </ul>	
20 days 50 days 50 days 50 days 50 days 50 days 50 days 50 days 50 days 50 days 51 09-12-10 50 days 51 10-3-5 10 days 51 10-3-5 50 days 51 10-3-5 50 days 51 10-3-5 50 days 51 10-3-5 50 days 51 10-3-5 50 days 50 days 50 days 51 10-4-8 50 days 50 days 50 days 51 10-4-8 50 days 50 days 50 days 51 10-12-19 50 days 50 days 50 days 51 10-5-13 50 days 50 days 51 10-6-27 50 days 51 10-6-27 50 days 51 10-6-28 50 days 51 10-6-28 51 10-6-28 51 10-6-28 52 days 51 10-6-28 51 10-6-28 52 days 51 10-6-28 51 10-6-28 51 10-6-28 51 10-6-28 51 10-6-28 51 10-6-28 51 10-6-28 51 10-6-28 51 10-	
35 days         Thu 09-12-10           30 days         Fin 10-23           30 days         Fin 10-35           10 days         Fin 10-35           11 days         Fin 10-35           30 days         Fin 10-48           40 days         Fin 10-48           50 days         Fin 10-48           50 days         Fin 10-5-19           50 days         Fin 10-5-19           50 days         Thu 10-5-13	
<ul> <li>4) days</li> <li>40 days</li> <li>50 days</li> <li>65 days</li> <li>65 days</li> <li>76 days</li> <li>77 days</li> <li>76 days</li> <li>77 days</li> <li>76 days</li> <li>77 days</li> <li>76 days</li> <li>77 days</li> &lt;</ul>	
<ul> <li>30 days</li> <li>50 days</li> <li>51 days</li> <li>51 days</li> <li>52 days</li> <li>53 days</li> <li>74 days</li> <li>76 days</li> <li>77 days</li> <li>76 days</li> <li>77 days</li> <li>76 days</li> <li>77 days</li> &lt;</ul>	
<ul> <li>66 days</li> <li>66 days</li> <li>76 days</li> <li>70 days</li> <li>71 (10-23)</li> <li>71 (10-35)</li> <li>71 (10-35)</li> <li>71 (10-35)</li> <li>71 (10-35)</li> <li>72 days</li> <li>71 (10-35)</li> <li>73 days</li> <li>71 (10-35)</li> <li>73 days</li> <li>71 (10-35)</li> <li>73 days</li> <li>71 (10-34)</li> <li>70 days</li> <li>71 (10-34)</li> <li>70 days</li> <li>71 (10-34)</li> <li>70 days</li> <li>71 (10-34)</li> <li>72 days</li> <li>71 (10-55)</li> <li>72 days</li> <li>73 days</li> <li>74 (10-72)</li> <li>74 (10-72)</li> <li>74 (10-72)</li> <li>74 (10-72)</li> <li>74 (10-72)</li> <li>75 days</li> <li>76 (10-72)</li> <li>76 (10-72)</li> <li>77 (10-72)</li> <li>76 (10-72)</li> <li>76 (10-72)</li> <li>77 (10-72)</li> <li>76 (10-72)</li> <li>77 (10-72)</li> <li>77 (10-72)</li> <li>77 (10-72)</li> <li>78 (10-72)</li> <li>78 (10-72)</li> <li>78 (10-72)</li> <li>79 (10-72)</li> <li>70 (10-72)</li> <li>70 (10-72)</li> <li>70 (10-72)</li> <li>70 (10-72</li></ul>	
<ul> <li>S. days</li> <li>S. days</li> <li>Mon 10-2-3</li> <li>Rein 10-3-5</li> <li>H. days</li> <li>Fri 10-3-5</li> <li>H. days</li> <li>Fri 10-3-5</li> <li>S. days</li> <li>Fri 10-3-14</li> <li>S. days</li> <li>Fri 10-3-19</li> <li>S. days</li> <li>Fri 10-5-13</li> <li>S. days</li> <li>Fri 10-72</li> <li>H. 10-5-13</li> <li>S. days</li> <li>Fri 10-72</li> <li>Fri 10-72</li></ul>	
2.8 days fri (0.3-5) 2.8 days fri (0.3-5) 1.4 days fri (0.3-5) 1.4 days fri (0.3-5) 2.0 days fri (0.3-19) 2.0 days fri (0.3-13) 2.0	
<ul> <li>2.24 days</li> <li>1.14 days</li> <li>1.14 days</li> <li>1.14 days</li> <li>1.14 days</li> <li>1.14 days</li> <li>1.10 days</li> <li>1.10</li></ul>	
<ul> <li>Fri 103-5</li> <li>Rei 103-19</li> <li>Rei 103-13</li> <li>Rei 1</li></ul>	
<ul> <li>R days</li> <li>R days</li></ul>	
30 days         Man 10,5,5,7           30 days         Man 10,5,5,7           30 days         Man 10,5,5,7           30 days         Su lays           60 days         Wei 10,4,8           50 days         Wei 10,4,8           50 days         Wei 10,4,8           50 days         Fri 10,3,19           60 days         Fri 10,3,19           60 days         Fri 10,3,19           55 days         Men 10,6,5,13           50 days         Fri 10,3,19           60 days         Thu 10,5,13           20 days         Thu 10,5,13	
30 days 30 days 40 days 40 days 50 days 50 days 50 days 50 days 50 days 50 days 50 days 50 days 50 days 71hu 105-13 20 days 71hu 105-13 50 days 71hu 105-13 10 days 71hu 105-13 70 days 71 days 7	
<ul> <li>Marges (Marges) (Marg</li></ul>	
<ul> <li>60 days</li> <li>60 days</li> <li>70 days</li> <li>70 days</li> <li>71 (0.3-19)</li> <li>75 (0.4)</li> <li>76 days</li> <li>77 (0.3-19)</li> <li>76 days</li> <li>77 (0.3-19)</li> <li>76 days</li> <li>77 (0.3-19)</li> <li>70 days</li> <li>71 (0.5-13)</li> <li>20 days</li> <li>71 (0.5-13)</li> <li>21 (0.7-2)</li> <li>22 days</li> <li>71 (0.7-3)</li> <li>72 days</li> <li>71 (0.7-3)</li> <li>71 (0.7-3)</li> <li>72 days</li> <li>71 (0.7-3)</li> <li>72 days</li> <li>71 (0.7-3)</li> <li>72 days</li> <li>71 (0.7-3)</li> </ul>	
30 days         50 days         50 days           196 days         66 days         66 days           56 days         66 days         66 days           56 days         66 days         66 days           50 days         76 i (0.3-19           66 days         76 i (0.3-19           20 days         76 i (0.3-19           20 days         71m (0.5-13           30 days         71m (0.5-13           30 days         71m (0.5-13           90 days         71m (0.5-13           10 days         71m (0.5-13           10 days         71m (0.5-13           10 days         71m (0.5-13           10 days         71m (0.7-2           10 days         71m (0.7-2           25 days         71m (0.7-3           25 days         71m (0.7-3           25 days         71m (0.7-3           25 days         71m (0.7-3	
196 days         Fri (10.3.19           60 days         Fri (10.3.19           60 days         Fri (10.3.19           60 days         Fri (10.3.19           80 days         Thu (10.5.13           20 days         Thu (10.5.13           9 days         Thu (10.5.13           10 days         Thu (10.5.13           10 days         Fri (10.7.2           25 days         Fri (10.7.2           25 days         Thu (10.5.35           25 days         Thu (10.5.35           25 days         Thu (10.5.35           25 days         Thu (10.5.35	
<ul> <li>60 days</li> <li>55 days</li> <li>60 days</li> <li>60 days</li> <li>71 00-5-19</li> <li>80 days</li> <li>71 00-5-19</li> <li>80 days</li> <li>71 00-5-13</li> <li>81 00-6-12</li> <li>10 days</li> <li>71 00-5-13</li> <li>81 00-6-12</li> <li>10 days</li> <li>71 00-5-13</li> <li>71 00-72</li> <li>75 days</li> <li>71 00-52</li> <li>75 days</li> <li>71 00-53</li> <li>71 00-53</li> <li>71 00-53</li> </ul>	
<ul> <li>55 days</li> <li>55 days</li> <li>60 days</li> <li>70 days</li> <li>70 days</li> <li>70 days</li> <li>70 days</li> <li>71 n 105-13</li> <li>72 days</li> <li>71 n 105-33</li> </ul>	
60 days 20 days 20 days 20 days 20 days 7hu 105-13 20 days 7hu 105-13 20 days 7hu 105-13 20 days 7hu 105-13 10 days 7hu 105-13 25 days 7hu 105-32 10 days 7hu 105-13 10 days 7hu 10	
20 days 20 day	
2.0 days Weal (16-2 2.0 days Weal (16-2 2.0 days Thu (10-5-13 2.0 days Thu (10-5-13 2.0 days Thu (10-5-13 2.0 days Thu (10-5-13 1.0 days Field (10-7-2 1.0 days Field (10-7-2 6 days Field (10-7-2 6 days Thu (10-7-2 2.5 days Thu (10-7-3 2.5 d	
20 days Thu 10-5-13 20 days Thu 10-5-13 20 days Thu 10-5-13 20 days Thu 10-5-13 20 days Thu 10-5-13 10 days Firit 10-5-13 10 days Firit 10-7-2 60 days Firit 10-7-2 45 days Thu 10-5-25 25 days Thu 10-5-35 25 days Thu 10-5-35	
20 days Thu 10-5-13 20 days Thu 10-5-13 30 days Thu 10-5-13 10 days Sai 10-6-12 10 days Sai 10-6-12 10 days Thi 10-7-2 60 days Fri 10-7-2 45 days Thu 10-7-2 25 days Thu 10-7-3 25 days Thu 10-7-3 26 days Thu 10-7-3 26 days Thu 10-7-3 26 days Thu 10-7-3 27 days	
20 days Thu 10-5-13 30 days Thu 10-5-13 10 days Sai 10-6-13 10 days Fri 10-5-2 105 days Fri 10-7-2 60 days Fri 10-7-2 45 days Thu 10-3-35 25 days Thu 10-3-35 25 days Thu 10-3-35	
20 days Tim 10-5-15 20 days Tim 10-5-15 10 days Firi 10-5-15 10 days Firi 10-7-2 105 days Firi 10-7-2 60 days Firi 10-7-2 45 days Tim 10-5-25 25 days Tim 10-5-35 25 days Tim 10-5-35	
20 days San 00-12 10 days San 00-12 10 days Fri 107-22 105 days Fri 107-2 60 days Fri 107-2 25 days Thu 107-35 25 days Thu 107-35 25 days Thu 107-35 25 days Thu 107-35 25 days Thu 107-35	
0.0.005 Tai 105-22 10.0.05 days Tai 105-22 105 days Fri 107-2 6 days Fri 107-2 45 days Tai 107-22 5 days Tai 10-3-25 25 days Thu 10-3-25	
10 days Fig. 10-22 105 days Fig. 10-7-2 105 days Fig. 10-7-2 60 days Fig. 10-7-2 45 days Tin 10-3-3 25 days Tin 10-3-35 25 days Tin 10-3-35 25 days Tin 10-3-35	
105 days 151 10.7-2 105 days 151 10.7-2 60 days 151 10.7-2 45 days 110 10.3-55 25 days 110 10.3-55 25 days 110 10.3-55	
60 Jays Fri 10-72 45 days The 10-8-11 25 days The 10-8-15 25 days The 10-8-25 25 days The 10-5-25	
25 days Thu 10-3-25 25 days Thu 10-3-25 25 days Thu 10-3-25	
25 days Thu 10-3-25 25 25 25 25 25 25 25 25 25 25 25 25 2	
25 days Thu 10-3-25	•••••
110 taue Thu 10.3-35	
CO GRASS FING DESIZED TO A DESI	
Н	
Pretet Made Pergamme Porchy) Tad ESSESSES Preter	

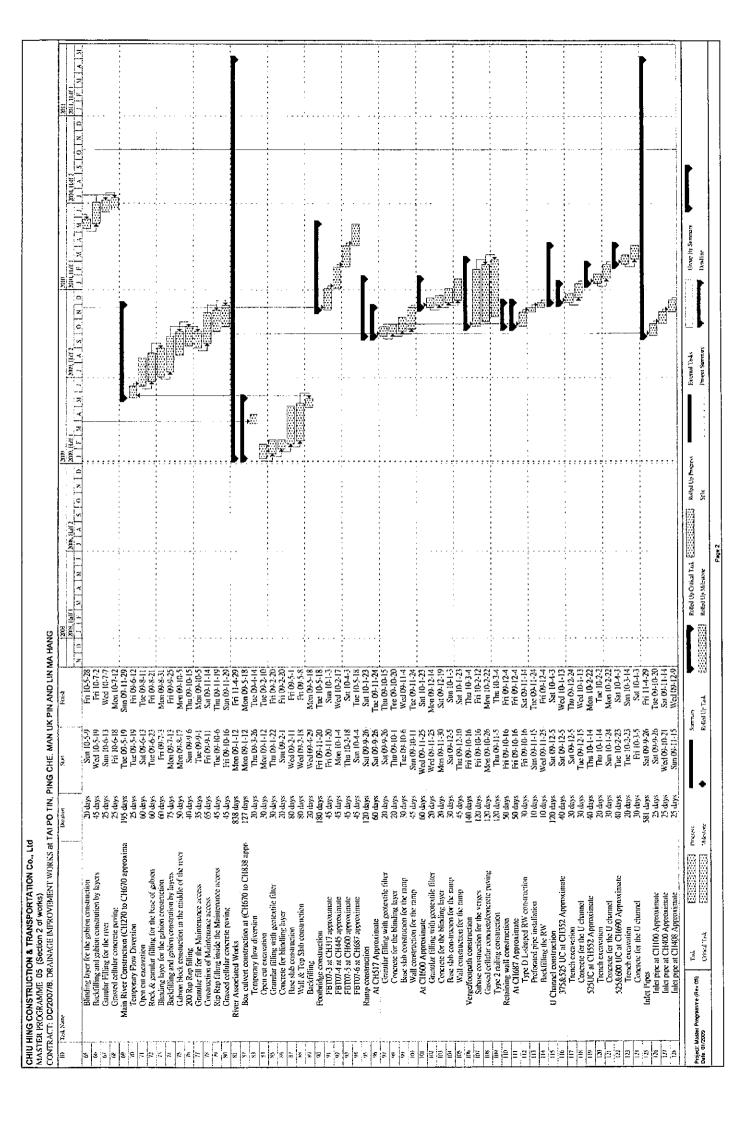

R R		ģ	Ĭ
3			
	· · · · · ·	12010101010	
0 5			1
2010, Fialt			
W   V			Green By Summary
010 1 15111 1 F M			Ginup By
0			
			facto
Yang C T P			Fitureal fadis
www.and with a local state of the local state of th			
NW IN		1	Impress
LoIN			Robot Cp Progress
XXX. [Lur2			
A IN L	-		Rokal UP Critical Tauk ESSERVESSES
208 208, failt 208, fa	-		Refer UP Critical Ta
- 1 07 07 07			
Finish	Sun 10-1-3 Thu 10-1-28 Mon 10-2-22 Fri 10-3-19	Fh 11-4-29	
			Summary
Surt	Thu 09-12-10 Nion 10-1-4 Fri 10-1-29 Tuc 10-2-23	Ser 10	
Duration	25 days 25 days 25 days 25 days	PP. days	Policy
<u> </u>		:	Page 1
	8 X A 8		
	Inlet pipe at CH450 Approximate Inlet pipe at CH450 Approximate Inlet pipe at CH650 Approximate Inlet pipe at CH750 Approximate	11th	1.00
	ipe al CH45 ipe al CH570 ipe al CH657 ipe al CH558	Section Sof works for 184397	Ted
	Line p Inter p Inter p	Series -	amme (Rev OS)
Task Name			Projecti. Marier Programme (Rev 05)
<b>a</b>	5852	s S	Project

66         65         65         644           66         67         67         61         61           66         67         81         64         81           66         67         81         64         81           66         67         81         81         81           67         81         82         81         84           66         82         81         81         84         81           7         7         7         81         84         84         84           7         7         7         7         81         84         <	The 10.5-16 That 10.6-15 Mon 19-3-2		DN 3041	200,147 200,14
(6) Yum ilk, precendination     (0.14)       (9) Mail R.; precendination     (0.14)       (9) Mail R.; precendination     (0.14)       (9) Mail R.; precendination     (0.14)       (1) E. at CH (5.4)     (0.14)       (1) Keet MUTCHIA (100 A)     (0.14)       (1) Keet MUTCHIA (100 A)     (0.14)       (1) Keet MUTCHIA (100 A)     (0.14)       (1) Keet Model (101 A)     (0.14)       (1) Keet Model (101 A)     (0.14)       (1) Mail (101 A)     (0.14)       <	The 10-5-16 That 10-6-10 Man 19-5-2			
B. C. at CH (First)     B. A. A. A.       B. C. at CH (First)     B. A. A.       B. C. at CH (First)     B. A. A.       T. TONNER THE A Devision     B. A. A.       D. Now sure theorem and the state of t	Nu R-6-17 Marth-3-2			
River MUTOH (Fulsion 1)         20, days           Territorian Phase Sinessine         20, days           Operating Sinessine         20, days           Sines operating Sinessine         20, days           Sines operating         20, days           Temporating         20, days           Sines operating         20, days           Sines operating         20, days           Sines operating         20, days           Sines operating         20, days           Sin		Fil0716 66 1449-14	•	
Temorary Plase Sheesiae 31445 Ore ard recreation 31445 Ore ard recreation 3145 Reck & gradian filling for the true of 2 doing 31445 Reck & gradiant filling for the true of 2 doing 31446 Bildidate Liser (for the chiever on the radial of 614 more 31446 University of 820 Milling and 10 more 31446 University of 820 Milling and 10 more 31446 States and a state and the surface 31 Constant of the surface 31 States construction in the surface 31 Constant of the surface 31 Constant of the surface 31 Temportup Flow difference 31 States 200 Milling and 200 Milling 31 Constant of the surface 31 Temportup Flow of the surface 31 Milling 31 States 32 Milling 32 Mil	101010	The 10-2-2		
Owner reconsider         Multis           Rock & gradinal filling for brune of guident         90,445           Bindotte Lang for drive a Diskon construction         90,445           Bindotte Lang for drive a Diskon construction         91,445           Bindotte Diskon Construction         91,445           Bindotte Diskon Construction         91,445           Bindotte Diskon DiskonDiskon DiskonDiskon Diskon Diskon Diskon DiskonDiskon Diskon Dis	1-6-003-9	Wellingthe St.		
ReA, & gandar filler for debase of salese         90,050           ReA, & gandar filler for these of salese         90,050           ReA, Brinder and Dewinstructure         91,450           ReA, Brinder and Dewinstructure         91,450           Reader of the salese or environment         91,450           Reader of the salese or environment         91,450           Reader of the filler of the salese         91,450           Reader of the filler of the salese         91,450           Reader of the salese of the salese of the salese         91,450           Reader of the salese of the salese of the salese         91,450           Reader of the salese of the salese of the salese         91,450           Reader of the salese of the sal	11hj OH 9 24	Terestan A		
Rinder Leer Gork ensorce or syntres         9 days           Rinder Lister Gork ensorce or syntres         9 days           Rinder State Leer and Particles of Approximate         9 days           XIM By Line and Development Particles of Approximate         9 days           XIM By Line and Development Particles of Approximate         9 days           XIM By Line and Development Particles of Approximate         9 days           XIM By Line and Development Particles         9 days           XIM By Line and Development Approximate         9 days           XIM By Line and Development Approximate         9 days           XIM By Line and Development Approximate         9 days           XIM By Line and Constraints         9 days           XIM By Line and Constraints         9 days           XIM By Line and Constraints         9 days           XIM By Line and Development Approximations         9 days	71-20-00	Wedden Hur 28 / Alfred August		
Allow BASA, total and the pridle of the inter- tident BASA, total and the pridle of the inter- prisment of the interpretation of the inter- section of the intervention of the inter- section of collaser concreted for the verse.         15, 44.55           WAND: Interhead CILE-600 Agreet innue.         15, 44.55         34.455           WAND: Interhead CILE-600 Agreet innue.         15, 44.55         34.455           WAND: Interhead CILE-600 Agreet innue.         16, 44.55         34.455           WAND: Consolid Cellular concreted for the verse.         30, 44.55         30, 44.55           River MUUSA (Puttion O)         22, 44.55         30, 45.55           River MUUSA (Puttion O)         30, 45.55         30, 45.55           River A standa (River A becover of the endown on the endown of the endown on the endown of the	Sei (9-(0.4 14.00-0.0	Monthly 112 727-55 days		
XIV Rep (Effect         [5:44]           XIV May Rep (Effect         [5:44]           HAVMS) I (norbidize al CU) (5:60) Approximate         [5:44]           Veractive constraints         [6:44]           Xive constraints         [6:44]           Xive constraints         [1:46]	To (P-11-20)	Wellbell2.0 Alffe5.64m		
<ul> <li>EMN03-1 Inchnige al Cl Field Argeneimale</li> <li>EMN03-1 Inchnige al Cl Field Argeneimale</li> <li>Construction of the surface</li> <li>State construction for the surface</li> <li>State construction for the surface</li> <li>State construction</li> <li>State construction</li></ul>	Mea 09-11-20	Mon 09 12-14 7517-5 days		
Vertue/Keepenh territorikin         (d. days           Kirvee entersteern in the verters         (d. days           Kirvee entersteern in the verters         (d. days           Kirvee entersteern in the verters         (d. days           Kirvee for the verters         (d. days	Sci.012.5	Men 10-118 No.		
Silvace consistences for the vertex         Mulary           Silvace consistences treated         Mulary           Type 2 adding areastation         Mulary           Type 2 adding areastation         Mulary           Niter MULPAA (Prime D)         Mulary           River MULPAA (Prime D)         Mulary           Terropactory How Datatelies         Mulary           River MULPAA (Prime D)         Mulary           River MULPAA (Prime D)         Mulary           Reads are accurateline         Mulary           Reads are accurateline         Mulary           Reads are accurateline         Mulary           Reads are accurateline         Mulary	S.0 09-42-5	The 10-2-2		
Greed reliais remeridences by taug Mules Topic Alines contained and the second and the second and the second and the second and and filling for the of taban filling to the second and and filling for the of taban remainment of the second and the second and the second and the second and taban se	Set Del D-5	Thu 04-12 34 24		
Type 2 utility, creating         Million           River MUVAA (Paulice D)         422 days           Topocon Fired Darrisle         94 days           Topocon Fired Darrisle         94 days           Char and cuasting         94 days           Rook & and a fired Darrisle         94 days           Million Provider More of types         94 days           Million Low For the charameterium         64 days	Fh (1) 25	Well NEL-13 PL		
Terr MULAN YOHAN () Xiera MULAN YOHAN () Annoar cumatura (Annoar cumatura (Annoa	The John H	Tue (11.2-2-20)		
ienteen teen laarteel Ontot europhie Rad, & genin filling terk bezei gibnen Hinding-Loor terk be chen recutivien (daes	Wei 10-2-17	Munt Hell-ZM		
	The full fits	State (14.5%) Crass		
Illighting have the characterization of the characteri	En IG-549	Men 10.5.17 845S-10.156		
	X - 10 - X	Thu 10.4 2/ WWS-10 days		
Kekfiling and gabara orestration for laws a	Pho 10-1-5	144 [[h-1:16 NASS-10.42]		
Furthern bleach associated on the muldle of the river	Thu 10-458	Set 10-6, 76 8755		
t <sup>5</sup> days	S.in (0-5-2)	Tue 10.8 40 45		
VBV841-2 wheelsr bridge at C203-11 Argmeinate 52 days	4.0110.8-11	Fit (0-(0-) 20		
WHANN-1 retriation feature or CT110-48. Autocompression 20-468	Set 2023	7184 10-11-25 10	-	
Uniones 13/1654mm dia press at (7110+155 Approximate COLlys	541 B H 26	Mee 13 1 24 91		
Vergerficeringhth cometruction	SN (0-1-1)	San 10-4-12		
Subside construction for the verges	1111 J	View JD-8-21 57		
Gased adjuin conceletewatere parte	Tec 10-7-27	had the part of the second sec		
90 provesti and the second sec	The OP-12-15	Fri 10.7.5		
"     ""     ""     ""	SI (1-10) - 40.	The Otabolity Min		
	Li (LEL) X	Set 10.1 23 18		
Red & conter filtene for the hase of earliest	Wed 19-12-30	Thu 10 L25 million date		
Blinding Lyter for the edition consideration	Men 10-1-4	The ID-2-2 (ITP) 45-105		
Backfelling and galver construction by layers	N 111 N	Fill 10.1.26-10155-5 dis		
Citizen Neck constantion in the multic of the near	Fii [0.3 12	WP101331 001400 PM		
	1-1-101 av(1).	The party of a		
Construct EXMemted in proce	ii- 10-4:56	Nex 10-5-10 101		
Manhole Mill to Mill's construction 880 km - 880	San 10-1-21	Tue 10-1-11 wi		
Vergeoficientaria emistraction 60 dave	Tite 10-5-11	l'n 10-7-9		
Subace construction for the version and and and and and and and and and an	11-10-11			
Chased cellular unancertanumer anne	Akm (C-2-1)			
-1	er houtus	and and the	-	
111 - Kiwat Kutoto (tatutok 12) - 000 ko fatiki mendime - Mildau 113 - Main Bitar (taratari ina 2013 fati fatiki mendime - Mildau		The 10.2 K	-	
There are a set of the	E-101-2	Wel69-1-21 9		
	The (0)-4-24	WellPaks 113		
Rock & constants.	Ter 01-4-22	Thu ID 1.7 1155		
Shurling layer for the galicon constitution	Therman 23	The first at 1988		
117 - Reddilling and gobon regarded by layers (200 days	15-100-421	They RA.2. 16 11655	计计计计学 医外外球 医外外外 化化化化化化化化化化化化化化化化化化化化化化化化化化化化化	
Curpular Filling for the rise	121110113	Tite ID-2-16 117FF		
Craveel cellular constructing proting	Fri (94.8.2)	The 10.2 16 11MP		
River associated Works 200 days	Wed (0-2-1)			
Run culvert construction at CTL C+100 approximate 100 fays	Wed (0-2-1) Wed (0-2-12	The totate		
	ACCERT IN	Mon 10-422 122		
Granadar fulfing with extention filler	1 ac (11.3-0	The ID-4-1 123(F-10 da)		
Cenercie for blas line lare	01.0.01 i/l	San Di-111 - 1240-0 - 10 - 10		
Have stath construction	Mine 19-1-20	The DEA-74 12885+10 day		
T	SAMA BAS	The life of a Lifest of the	-	
	Wel 10-2-17	Sal DED-13 (20		
VBVDS-Latendary and the second strategy contraction of the second strategy of the second st	Wel 10-2-17	The 10-1-12 11/		
VBVbS-bal CLC-M approximate	Wel 16-2-17	This 10-3-48 11/		
ADS-IA CLCMappeninu Tast	Wel 10.2.17	The 10-1-15 11/	Relief Up CHARLE	Rollad to Physics Figure 11 Adv
Prayert Mauser Pragmannine (Rev.09) Discl. E3333333333333 Province. Data of 120000 Chinesi Discl. E3333333333333333 Milecture.	.	Sumurs Rotof Up Tack	Relied Up Critical Tauk [255]	State Autority Prosess Exemution Francess State Control Process St

Mach (C)	000, jart 1 200, jart 1 200 k 1 200 k 1 200 k 20
Name         Control         Control <thcontrol< th=""> <thcontrol< th=""> <thcon< td=""><td></td></thcon<></thcontrol<></thcontrol<>	
VIMORS is at CIT, CAS serverse         State	
$ \begin{array}{cccccc}   0.000  J. 0.000 $	
FHRM is ALCI C-50 Accurate         Rein         Wein Ref         Temp (R)         Med	
Interval at 11.1.1         Main         Main <thmain< th="">         Main         Main<td></td></thmain<>	
Name         Name <t< td=""><td></td></t<>	
All CLC 368 Argeneration         Total ( $0.212$ )         Solution ( $0.212$ )         Sol	
Constrained filture seconds where         Nume         Num         Num         Nume	
Conserve for the known varies $3(k_{10})$ $k_{10}(k_{11})$ $k_{11}(k_{11})$ $k_{11}($	
Matrix         Matrix <thmatrix< th=""> <thmatrix< th=""> <thmatrix< t<="" td=""><td></td></thmatrix<></thmatrix<></thmatrix<>	
At C11 C-V0 Montanian         State         Non-topology         Non-topolo	
Answer         Control filter	
$ \begin{array}{llllllllllllllllllllllllllllllllllll$	
Use the operation is the renp with contrast of the trans of the static statis statis statis static static static static static static stati	
Well resonance for the same         S(Ja):         Well ( $M_{12}$ ):         S(M_{12}):	
ATCL + SA Approximate	
Constart effer web protectivity         Mass         Fig. (B-1)         Sen (D, 2)	
Construction the Muscles Layer         Status         Mail In Science         Mail In Science <thmail< td=""><td></td></thmail<>	
Bace distrumbactive for the random of the starts         Solves         Res (distrumbactive)         Solves         Solves         Res (distrumbactive)         Solves	
Weil constrained for learner $0_{class}$ $0_{$	
A CHC + 93A Approximate $2.6$ base $3.6$ base $3.9$ base $3.9$ base $3.6$	
$ \begin{array}{llllllllllllllllllllllllllllllllllll$	
Converte for the function between the matrix matrix         Matrix matrix         Matrix <thmatrix< th=""> <thmatrix< th="">         Matr</thmatrix<></thmatrix<>	
Income         Mathematical         States         State	
At Cliff Construction         Constructin         Construction         Cons	
And the set of the s	
The second field from the second set of the care.         Mark         Mark <thmark< th="">         Mark         Mark         <t< td=""><td></td></t<></thmark<>	
Rec. All-treesmont for the nerves         Relation of	
Will screative for the entry $0.4 \text{Hz}$ will location between the driven set (0.2). $0.4 \text{Hz}$	
Varaclestwin construction $22$ days         well ( $0.2,1$ )         San ( $0.3,6$ )           Show construction $22$ days         well ( $0.2,1$ )         San ( $0.3,6$ )         San ( $0.3,6$ )           Tyry 2 billing well construction $23$ days         well ( $0.2,1$ )         San ( $0.3,6$ )         San ( $0.3,6$ )           Tyry 2 billing well construction $23$ days         San ( $0.2,1$ )         San ( $0.3,6$ )         San ( $0.3,6$ )           Reading well construction $23$ days         San ( $0.2,1$ )         Well ( $0.2,1$ )         Well ( $0.2,1$ )           Read filter         ( $0.2,1$ )         Well ( $0.2,1$ )         Well ( $0.2,1$ )         Well ( $0.2,1$ )           Inder the         ( $0.2,1$ )         Well ( $0.2,1$ )         Well ( $0.2,1$ )         Well ( $0.2,1$ )           Inder the         ( $0.2,1$ )         Well ( $0.2,1$ )         Well ( $0.2,1$ )         Well ( $0.2,1$ )           Rem k1105 (Weither E)         ( $0.2,1$ )         Well ( $0.2,1$ )         Well ( $0.2,1$ )         Well ( $0.2,1$ )           Rem k1105 (Weither E)         ( $0.2,1$ )         Well ( $0.2,1$ )         Well ( $0.2,1$ )         San ( $0.2,2$ )           Rem k1105 (Weither E)         ( $0.2,1$ )         Well ( $0.2,1$ )         Well ( $0.2,1$ )         San ( $0.2,2$ )           Rem k1105 (Weither E)         ( $0.2,1$ )         ( $0.2,1$ )	
Shore construction for the versex         Shit dependent         Weil [0, 1]         Weil [0, 2]         Weil [0, 4]           Type 2 influe construction $M_1$ into: $M_1$ into: $M_1$ into: $M_2$ into: $M_1$ into: $M_1$ into: $M_2$ into: $M_1$ into: $M_2$ into:	
Trace of callule conservations         ML sins         Sin [01,2]         The 190,16 (667): 104a           Trace of callule constructions         ML sins	
Nites         Inc. ( $\lambda_{100}$ )         Sec ( $\lambda_{100}$ ) <td></td>	
Reading well recomplicit         130.bit         Well 102.17         Well 102.11         Well 102.11           Intel Tixes         10.dams(twenterwise)         10.dams         Well 102.11         Well 102.11         Well 102.11           Intel Tixes         10.dams(twenterwise)         10.dams         Well 102.11         Well 102.11         Well 102.11           Intel Tixes         10.dams         Well 102.11         Well 102.11         Well 102.12         Well 102.12           Tirreventy The obstration         10.dams         Well 102.23         Sci 09.23         Sci 09.23         Sci 09.23           Tirreventy The obstration         10.dams         Well 02.23         Sci 09.23         Sci 09.23 <td< td=""><td></td></td<>	
It Chantel Konstruction     [10] University     [10] University       It of Fires     [10] University     [10] University       Insolvers of Hyritics     [10] University     [10] University       Record of Explore     [10] University     [10] University       Record A. Rayolid filling for the following optimization     [10] University       Record A. Rayolid filling for the following     [10] University       Record A. Rayolid filling for the following     [10] University       Record A. Rayolid filling for the following     [10] University       Record A. Rayolid filling for the following     [10] University       Record Explore     [10] University       Recold Explore	
Individual         Clouds         Mod In Transmitter         Outs         Weat Individual           Roter M(10)S (1) when (E)         0.0015         Transmitter         0.0015         Transmitter           Cyrran out excassion         0.0015         0.0015         Mod In Statistics         Mod In Statistics           Cyrran out excassion         0.0015         Mod In Statistics         0.0015         Mod In Statistics           Cyrran out excassion         0.0015         Mod In Statistics         Mod In Statistics         Mod In Statistics           Reck & grapher Channel         0.0015         Mod In Statistics         Mod In Statistics         Mod In Statistics           Null versunding         Mod In Statistics         Mod In Statistics         Mod In Statistics         Mod In Statistics           Mod In Statistics         Mod In Statistics         Mod In Statistics         Mod In Statistics         Mod In Statistics           Mod In Statistics         Mod In Statistics         Mod In Statistics         Mod In Statistics         Mod In Statistics         Mod In Statistics           Reck Mathing and Fulforg on the mod Math In Statistics         Mod In Statis         Mod In	
Instement         U.0301         Instement           Rement (1005) (Herbiner)         U.0301         Horton (112)           Creation (1005) (Herbiner)         U.0401         Horton (112)           Creation (1005) (Herbiner)         U.0401         Under (112)           Reckd, A.g. anda (Herbiner)         States         States           Horton (112)         Relation (112)         States         States           Horton (112)         Relation (112)         States         Horton (112)           Mail resolution         States         Horton (112)         States           Mail resolution         States         Horton (112)         States           Mail resolution         Relation (112)         States         States           Mail resolution (112)         Relation (112)	
Kore follow between (1)         Both State	
Tritteries         Tritteries         Tritteries           Tritteries         Tritteries         Tritteries         Tritteries           Restanding Channel         Restanding         Status         Status         Status           Restanding         Restanding         Status	
Restandard Channel         Status	
Reads         State         State <th< td=""><td></td></th<>	
Hadrey Usye for the Solies or econcision         Midra         Well (N-1)           Har John Artinistic         Statics         Statics<	
Base valuation         Relative	
Wall construction         State         Use Object           Grant or fifting mode by channel         16.45         16.45         10.46,14           Grant or fifting mode by channel         16.45         16.45         10.46,14           Grant Outstanding mode by channel         10.64         54.69         10.45,14           Grant Outstanding mode by channel         10.64         54.69         34.04           Reading and by the type by constrainen         0.04,15         54.04         30.15,14           Reading and processmins in the induct of the type is the set weat set with the large of the type is the set weat set with the induct of the type is the set weat set with the induct of the type is the set weat set with the induct of the type is the set weat set with the induct of the type is the set weat set with the induct of the type is the set weat set with the induct of the type is the set weat set with the induct of the type is the set weat set with the induct of the type is the set weat set with the induct of the type is the set weat set with the induct of the type is the set weat set with the induct of the type is the set weat set with the induct of the type is the set weat set with the induct of the type is the set weat set with the induct of the type is the set weat set with the induct of the type is the set weat set with the induct of the type is the set weat set with the induct of the type is the set weat set with the induct of the type is the set weat set with the induct of the type is the set weat s	
Grant ler filling mode the channel         If days         Bart (N-14)           Game Unvertingende         (Bolds)         Stee (0) - 31           Robat Unvertingende         (Bolds)         Stee (0) - 31           Robat Lion Level or the base of galaxis         (Bolds)         Stee (0) - 31           Robat Lion Level or the base of galaxis         (Bolds)         Stee (0) - 31           Robat Lion Level or the base of galaxis         (Bolds)         (Bolds)         Stee (0) - 31           Robat Lion Level Corestation Ib Lattice         (Bolds)         (Bolds)         Stee (0) - 32           Robat Lion Level Corestation Ib Lattice         (Bolds)         (Bolds)         Stee (0) - 33           Robat Lion Level Los Los Libros         (Bolds)         (Bolds)         Stee (0) - 33           Robat Lion Level Los Los Los Libros         (Bolds)         (Bolds)         Stee (0) - 33           Robat Lion Level Los	
Calmen Unrefraction         Totalsy         Start & grants films, for the base of gravies         Totalsy         Start & grants films, for the base of gravies         Totalsy         Start & grave of gravies         Start & grave of grave of grave of graves         Totalsy         Start & grave of graves         Start & grave of graves         Start & g	
Read of granther fulling, for the elect (gridstont)         findings         Sim(014,5)           Reinholtz, and Johne revenances         0.015,5         0.015,5,11           Reinholtz, and Johne revenances         0.015,5         0.015,5,13           Reinholtz, and Johne revenances         0.012,5         0.015,5,13           Reinholtz, and Johne revenances         0.012,5         0.012,5           Reinholtz, Revenanci, Bill, et the revenance         0.012,5         0.012,5           Reinholtz, Revenanci, Bill, et the revenan	
Reinher, Just Ler Nerwar revisaria 10 days wei (1973-51) Reinher, and phore constants by Jarres (1974-51) (Labera Beck, constants and by Jarres (1974-51) (Labera Beck, constants and the river (1974-51) 2014): Septimentation of the river (1974-51) (reger freedoments (1974-52) Status strengt and for UV-95-52) (1975-52)	
Headfultar, and prive constraints by laters         130 days         Set (0) \$33           (Like) block, or sharks in the indukt of herror         (24 km) \$40         Set (0) \$41           (Like) block, or sharks in the indukt of herror         (24 km) \$40         Set (0) \$41           (Like) block         (24 km) \$40         (24 km) \$40           (104 km)         (24 km) \$40         (104 km) \$40           (104 km)         (104 km) \$40         (104 km) \$40           (104 km)         (104 km) \$40         (104 km) \$40	
Cubes black constants in the multic of the river 0.16459 is an 0.94394 26447 in the per fullowing the multic of the river 0.16449 is an 0.94394 is a 0.94394 is a 0.94494 is a 0.944944444 is a 0.9449444444 is a 0.9444444444444444444444444444444444444	
Vertification South Sout	
Vergebirankanka teruntukan 30 data ing teruh da 20 data ing teruh dat	
Three realing construction Monthly Monthly 1.9 1	
	3
[01] the Remaining sectors for a work of UU/P — We down — The H-1-35 — Fir H-1-35 9 Q — i	
Added Table 1 (2010) 100 (2000) 100 (2010) 1	Enternal Table Council of Summary
Test ESTERISTICS TRANSIS	

CHIU HING CONSTRUCTION & TRANSPORTATION Co., Ltd NANTER PROGRAMME 05 ( Section 4 of works) CONTRACT: DC/2007/8, DRAINAGE IMPROVEMENT WORKS at TAI PO TIN, PING CHE, MAN UK PIN AND LIN MA HANG	RANSPORTATION Co., Ltd on 4 of works) 3 [MPROVJ3MEW] WORKS at TAI PO	TIN, PING CHE	E. MAN UK PIN	and Lin Ma Hang	[
10 Trait Name		Brutker	THE R	2000 1602 2001 1602 2001 1601 2000 1001 2000 2000	
I CONTRACT: DC2207/08 (The Wolks)     Andewer of Portion A	: Woks)	1095 days 0 days	Fri 07-12-21		
3 Section 4 & 5 of works - Lin Commencement Date	n Man Hang (Portion F)	1095 days 0 days	Fri 07-12-21 Fri 07-12-21		
5 Handover of Portion F 6 Prelian Works		0 days 345 days	Fri 07-12-21 Wed 08-4-30		
		130 days 10 days	Wed 08-4-30 Men 09-2-9		
		14 days 14 days 20 -	Thu (9-2-19 Thu (9-3-5) Thu (9-3-5)		
12 The survey Construct Access Rend	رط	20 days 20 days 20 days	Thu 09-2-19 Thu 09-3-5		;
	nt lhe trees Survey	30 days 30 days 625 days	Wed 09-3-11 Thu 00-3-5 Sat 09-4-4		
	rsion construction for CH P+0 to CH P+35.	26 days 110 days	Sat 09-4-4 Thu 09-4-30		
Is         Open excavation and open exception and	Orean execution and construction for CH 0+0 to CH 0+35. Open execution and construction for CH R+0 to CH R+35. Open execution and construction for CH T=41 to CH T=43.	110 days 110 days 110 days	02-4-80 mH 02-4-80 mH 03-4-80 mH		01-3-17-00-1
<u></u>	experiencement and construction for the base of gabion Resk & gambler falling for the base of gabion Blinding layer for the griticer construction	110 days 110 days	Thu 09-5-7		
25 Rackfilling and gabior 24 Gunutar Filling for the	n constrution by layers e river	150 days 100 days	Thu 00-5-14 Sun 09-10-11		
1-1-	vilise the river	80 days 355 clave	Sun 09-10-11 Wed 00-12-30		<u>-</u>
1	Subsection for the verges Gassie construction for the verges	150 days	Wed 00-12-30	, ш	
<b></b>		150 days	Sat 10-1-9		
31 Section 5 of works	Section 5 of works for Lin Ma Hang	195 days	Tue 10-6-8		
Project Marter Programme (Ray 05)			Summary Dama Anaron	REPERSIVENCES and the thread first REPERSIVENCES Rules for the new second	<u> </u>
Usies: Orizou) Critical Tax	tion h <u>earteristerister</u> Marter	·	Reference	ESSESSESSES & Refeat Up Mickane Series Series Series - Project Stemans - Pages 1	Π

CHIU HING CONSTRUCTION & TRANSPORTATION Co., Ltd MASTER PROCRAMME 05 (Section 3 of works) CONTRACT: DC/2007(8, DRAINAGE ANTRUVANENT WORKS at TV

	┺
	æ
	2
	2
	2
	÷,
	_
	$\sim$
	≒
	-
	٩.
	7
	=
	o_
	≞.
	_
	*
	>
	-
	2
	-
	ш
	т
	75
	~
	o
	ž.
	-
	PING CHE
	ź
	z
	=
	⊢
	$\sim$
	Ľ
	α.
	-
	π.
	-
	يبيد
	ф,
	cr.
	- 2
	~
	志
	2
	-
	1
	G7
	5
	=
	z
	>
	0
	~
	~
	÷
	-
	(*1
	F.
	z
	-
	~
	7
	DRA
	=
	-
	m.
	=
	<b>P</b>
	9
	Ω.
	5
	ō.
	×
	-
1	
	5
	¥
	ρŽ
	Ľ

	10 Tok Nure	AURC .	Decidents	Mark	Trakers	2009 2009, iair 2000,
	1 CON	RACT DEPODAR The Works	1226.05	Fn 01-12-21	E6 11-120	
	; -  -	the first of the feature A	sveb 0	Eri 07-12-21	Fii (17.2)	
transmeria transm	رت الم	ection 3 - Man IIk Ding (Pration I) & E)	1005 days	Wed (08-4-30)	Vn 11-4-29	
New	+	Commenced Date	A days	01-1-10 1-14	Wrd 08-4-30 S	
The state         The state <t< td=""><td><b>.</b>.</td><td>[[antows of Petice []</td><td>Q days</td><td>Wed 08-4-30</td><td>Wed Riv 4: 30</td><td></td></t<>	<b>.</b> .	[[antows of Petice []	Q days	Wed 08-4-30	Wed Riv 4: 30	
	-	I'rctim Works	308 days	01-1-30) PV:5	Man Put 6-1	
	-	Reselling Monifecting	1. Welling	Wol 18-1-31	S.1 (8-9-6. 5	
	-	Architectures	sult of	M-1022	Wellow 2.11	
	6	Note elemente	with O.	20-2-1-2-1-2-4-2-	1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	
	<u> </u>		Alteria Alteria	Med 39-12-1	Mon (71-1-19 Para Artin 19	
	=		100 J		SUIDO-LI WALLN 6 16 KeE, YL-Free	· · · · · · · · · · · · · · · · · · ·
Control         Control <t< td=""><td></td><td>tite survey Churchert around David</td><td>Michon</td><td>Surface and</td><td>The first of the f</td><td></td></t<>		tite survey Churchert around David	Michon	Surface and	The first of the f	
TurbulationAnd <td>2 2</td> <td>the second and "france and an area of the second seco</td> <td>end res</td> <td>Field and</td> <td>Violence 1</td> <td></td>	2 2	the second and "france and an area of the second seco	end res	Field and	Violence 1	
	Y	[ [a became ] [ [i]] [i] or Service	in the second	Xa 09-611	Sun(24-6-12-12	
	. <u>s</u>	Kiver M(JIQ) (Cherine D)	420 days	Min 09-2-2	Tue 10-4-6	
	1	Temparary Ulew Dargesion	Mulay.	Nen 01-2-2	Ser 09-2 21	
	×	()beri cué recivation	(5.duvs)	Sun 07-2-22	Welders 11	
		Rock & gamber filing for the base of gaboan	101 Jaws	11-0-7-0	Sa 02446 1877+10 also	
Mathematical     Other     Other     Other     Other       Restance     Other     Other     Other     Other	6	Hindrig lawer for the patient construction	101dav.	Nun Ol. La	7ur-00.6.16 [9F7-10.dby	
Transmission         Other         Transmission         Transmission <thtra< td=""><td>~</td><td>Itself filting and calvas construction by layer-</td><td>180 days</td><td>N 1 100 WQL</td><td>Man (N.S. H. 2005-10-15vi</td><td></td></thtra<>	~	Itself filting and calvas construction by layer-	180 days	N 1 100 WQL	Man (N.S. H. 2005-10-15vi	
Anderserver     Gen     Gen <t< td=""><td>2</td><td>Verse/livitally concluding</td><td>201 days</td><td>The 04-9-15</td><td>Tue 10-1-6</td><td></td></t<>	2	Verse/livitally concluding	201 days	The 04-9-15	Tue 10-1-6	
Transmission     Optimization     O		School conclusion for the verses	(webse)	The 01-0.15	Serpertized 21	
Truth (1)         (	1	a second and the second se	the days	C II BUNS	The IO. N. JI	
		t kroat attigut kanan kanan attigat fundik. Weessan filipeese see alio			1. 10 14 14	
	4			ADVINE III		
Matrix         Description         Description <thdescripition< th=""> <thdescription< th=""> <th< td=""><td>2</td><td>JURICE CONSTRUCTION</td><td>-(n)(N)</td><td></td><td></td><td></td></th<></thdescription<></thdescripition<>	2	JURICE CONSTRUCTION	-(n)(N)			
	12	River MULTUR (Portion 13)	201 days	Mon 09-4-13	Star 10-1-01	
Trencriction     Dist     Verticity     Dist	25	Statistive pristing river bank	225 days	Mon (NH-L)		
Network     Dist     Diet ist     Diet ist </td <td><b>7</b>.</td> <td>Temporary these diversion</td> <td>13.days</td> <td>Mail (944-13</td> <td>Ved 05-122 15</td> <td></td>	<b>7</b> .	Temporary these diversion	13.days	Mail (944-13	Ved 05-122 15	
Note of an order of a constraint of a constra	F.	Sheet Prin in dultation	NTP IC	Thu (0).4.2)		
Rick starting multiplications     Biolity (Rick starting multiplications)     Biolity (Rick starting mu	=	HEREWIC & COL CARTER SUPPORT	51 days	Well025-15		
Builty list of key solution     Gala     Selection     Selection     Selection       Builty and few only.     0.001     1000     1000     1000     1000       Builty and few only.     0.001     1000     1000     1000     1000       Builty and few only.     0.001     1000     1000     1000     1000       Builty and few only.     0.001     1000     1000     1000     1000       Rest only.     0.001     1000     1000     1000     1000       Rest only. </td <td>~</td> <td>Rock &amp; gender filling for the base of galacer</td> <td></td> <td>For (0) (5-12</td> <td>Same 7.11 M</td> <td></td>	~	Rock & gender filling for the base of galacer		For (0) (5-12	Same 7.11 M	
Ubblic lates     Global     (640)     (640)     (640)     (610)     (101)     (101)       Rest of the Net     (100)     (100)     (100)     (100)     (100)     (100)       Targe of the Net     (100)     (100)     (100)     (100)     (100)     (100)       Rest of the Net     (100)     (100)     (100)     (100)     (100)     (100)       Rest of the Net     (100)     (100)     (100)     (100)     (100)     (100)       Rest of the Net     (100)     (100)     (100)     (100)     (100)     (100)       Rest of the Net     (100)     (100)     (100)     (100)     (100)     (100)       Rest of the Net     (100)     (100)     (100)     (100)     (100)     (100)       Rest of the Net     (100)     (100)     (100)     (100)     (100)     (100)       Rest of the Net     (100)     (100)     (100)     (100)     (100)     (100)       Rest of the Net     (100)     (100)     (100)     (100)     (100)     (100)       Rest of the Net     (100)     (100)     (100)     (100)     (100)     (100)       Rest of the Net     (100)     (100)     (100)     (100)     (100)	Ĩ	Hindore Locar for the arbiton coestnattoen		Sai 19-7-12	Mon ID-S-10 32	
Reserved (c)         (b)         second (c)         (b)         second (c)         (b)         second (c)         (c) <t< td=""><td>=</td><td>And the state of the state of the second second</td><td>, 12. Jun</td><td>Tec 09.8-11</td><td>Fright IB 35</td><td></td></t<>	=	And the state of the state of the second	, 12. Jun	Tec 09.8-11	Fright IB 35	
MURT Name     Data     Data     Strends     Data     Data       Rest Rest Name     Data     Verdel     Set 0043     Set 0043     Set 0043       Rest Rest Name     Data     Verdel     Set 0443     Set 0443     Set 0443       Rest Rest Name     Data     Verdel     Set 0443     Set 0443     Set 0443       Rest Rest Name     Data     Verdel     Set 0443     Set 0443     Set 0443       Rest Rest Name     Data     Rest Rest Name     Data     Set 0443     Set 0443       Rest Rest Name     Data     Rest Rest Name     Data     Set 0443     Set 0443       Rest Rest Name     Data     Rest Rest Name     Data     Set 0443     Set 0443       Rest Rest Name     Data     Rest Rest Name     Data     Set 0443     Set 0443       Rest Rest Name     Data     Rest Rest Name     Data     Set 0443     Set 0443       Rest Rest Name     Data     Rest Rest Name     Data     Set 0443     Set 0443       Rest Rest Name     Data     Rest Rest Name     Data     Set 0443     Set 0443       Rest Rest Name     Data     Rest Rest Name     Data     Set 0443     Set 0443       Rest Rest Rest Rest Rest Rest Rest Rest	×	Rentonal of the chest of e.	10 days	Sut04-13-14	Margh11-23 M	
Notice     100     100     100     100     100     100       Contraction     100     200     200     200     200     200       Contraction     200     200<	న	ALLINO RUMMA	115 days	Mice (21.4.13	New Dit 10.4	
Outcome     Outcome     Outcome     Outcome     Outcome     Outcome     Outcome       Outcome     Dist     Dist     Dist     Dist     Dist     Dist     Dist       Dist     Dist     Dist     Dist     Dist     Dist     Dist <td>; ; ;;</td> <td>Tanto and Rom Phone et al.</td> <td>- U Province of the second sec</td> <td>Man (Mull3)</td> <td>SI (CTOUPAN</td> <td></td>	; ; ;;	Tanto and Rom Phone et al.	- U Province of the second sec	Man (Mull3)	SI (CTOUPAN	
Bit of the original filter (reflection in the filter)     Description in the content	. 2	(These cut minimums)	sulful	The (P-4.25	Tor (P. 5.12 W	
Instant element     National services     National service	: 2	Alvel. & crucha filling for the boay of a dense		Wed 0225-13	the Diffel B	
Instant services     Bigs     Rescalar     Bigs     Rescalar <th< td=""><td></td><td>an each parameter interest of a construction of the second s</td><td></td><td>0.440</td><td></td><td></td></th<>		an each parameter interest of a construction of the second s		0.440		
Right distance     Right distance     Right distance     Right distance     Right distance       Right distance     Right distance     Right distance     Right distance     Right distance       Right distance     Right distance     Right distance     Right distance     Right distance       Right distance     Right distance     Right distance     Right distance     Right distance       Right distance     Right distance     Right distance     Right distance     Right distance       Right distance     Right distance     Right distance     Right distance     Right distance       Right distance     Right distance     Right distance     Right distance     Right distance       Right distance     Right distance     Right distance     Right distance     Right distance       Right distance     Right distance     Right distance     Right distance     Right distance       Right distance     Right distance     Right distance     Right distance     Right distance       Right distance     Right distance     Right distance     Right distance     Right distance       Right distance     Right distance     Right distance     Right distance     Right distance       Right distance     Right distance     Right distance     Right distance     Right distance       Right distance	2	particulary device for the factories press reported and		Nor 016.17		
Verafficient     Distribution     D		eta barrente eta kan barrente eta datu datu datu datu datu datu datu da				
Net restorement     State     Proof State     State     Proof State     State     Proof State       Net restorement     Net restorement     Net restorement     Net restorement     Net restorement       Net restorement     Net restorement     Net restorement     Net restorement     Net restorement       Net restorement     Net restorement     Net restorement     Net restorement     Net restorement       Net restorement     Net restorement     Net restorement     Net restorement     Net restorement       Net restorement     Net restorement     Net restorement     Net restorement     Net restorement       Net restorement     Net restorement     Net restorement     Net restorement     Net restorement       Net restorement     Net restorement     Net restorement     Net restorement     Net restorement       Net restorement     Net restorement     Net restorement     Net restorement     Net restorement       Net restorement     Net restorement     Net restorement     Net restorement     Net restorement       Net restorement     Net restorement     Net restorement     Net restorement     Net restorement       Net restorement     Net restorement     Net restorement     Net restorement     Net restorement       Net restorement     Net restorement     Net restorement     Net re			and the second s	The 00 P 6	en do Ma	
And the status of the statu	₽  :			14-60 au		
Yasa manuna kana kana kana kana kana kana kana	ş	opened the set of the		AL MARINA	New OLD ALL 1	
Mark Mark Mark     Num     Num     Num     Num     Num     Num       An Numer of Mark     Timen volume     14m     None 11     Sam (N) 3     Ref (N)     Num       Timen volume     14m     None (N)     14m     None (N) 3     Ref (N)     Num     Num       Krist and ref (N)     14m     None (N)     14m     None (N)     Sam (N)     Sam (N)     Sam (N)       Krist and ref (N)     14m     None (N)     14m     None (N)     Sam (N)     Sam (N)     Sam (N)       Krist and ref (N)     14m     None (N)     14m     None (N)     Sam (N)     Sam (N)     Sam (N)       Ridia: and ref (N)     24m     24m     24m     None (N)     Sam (N)     Sam (N)       None (N)     14m     24m     24m     24m     None (N)     Sam (N)       None (N)     14m     24m     24m     24m     24m       None (N)     14m     24m     2		A have a second solution to second solution.		The Mithly	Sea M. M. L. AS	
Tenser Fuel Beharia     Like     Nordist Li     Sordist Li	-	A THE A DESIGN AND A DESIGNATION OF A DE	while	Mon (29-4-11	Sher (6.1.3)	
Circuit and another in the whore of the second s				Vion 10-1-11	She fit the USN	
Next Stater view     Odds     Serie 1: Series     Notest Stater view       Risting law for the short of photon     Odds     Series 1: Series     Notest Stater view       Risting law for the short of photon     Odds     Series 1: Series     Notest Stater view       Risting law for the short of photon     Odds     Series 1: Series     Notest Stater view       Risting law for the short of photon     Odds     Notest Stater view     Odds     Notest Stater view       Risting law for the short of photon     Odds     Notest Stater view     Odds     Notest Stater view       Risting law for the short of photon     Odds     Notest Stater view     Odds     Notest Stater view       Risting law for the short of photon     Odds     Notest Stater view     Odds     Notest Stater view       Risting law for the short of photon     Odds     Notest Stater view     Odds     Notest Stater view       Risting law for the short of photon     Odds     Notest Stater view     Notest Stater view     Notest Stater view       Risting law for the short of photon     Notest Stater view     Notest Stater view     Notest Stater view     Notest Stater view       Risting law for the short of photon     Notest Stater view     Notest Stater view     Notest Stater view     Notest Stater view       Risting law for the state view     Notest Stater view     Notest Stater v	ç iş		A high states of the second st	Vie 04.177	The (1) 4.35 AV	
Rinks bar is the derivativities     Outs     Sate 3:1     World 1:1     World 1:1     Sate 3:1     World 1:1     Sate 3:1     World 1:1     Sate 3:1     Sate	ŝ, ja	Appendix Concernant National Participation and the Appendix of		The 01.5.7	Star (D. J. 5., 1987) All All All	
Multility and solvenentices between Science Section Sectin Section Section Section Section Section Section Section Se		Mission is parted a transfer and and an and an an and an		Surface 17	Welth Lis Shell was	
Gibbo RKA, Konstauron MY markler (K-mer     304as     ±1.0465     Tme190-3     5.5540/6400       OK RP Ray filling     0.04as     ±1.0465     Tme101-13     5.10465     Tme101-13       OK RP Ray filling     0.04as     ±1.0403     ±5.04034     5.10464     Tme101-13       HR0012,13 from has a U1 2by Amounter     5.4as     \$5.41011     Fm 101-13     5.0       HR0012,13 from has a U1 2by Amounter     5.4as     \$5.41011     Fm 101-13     5.0       Verificiends outstration     0.0ar     Tme10-13     \$5.0113     \$5.0112       State commution     0.0ar     Tme10-13     \$5.01     \$5.0113       State commution     0.0ar     Tme10-12     \$5.01     \$5.01       State commution     0.0ar     Tme00-13     \$5.01     \$5.01       State commution     0.0ar     Tme00-12     \$5.01     \$5.01       State commution     0.0ar     Tme00-13     \$5.01     \$5.01       State commution     0.0ar     Tme00-13     \$5.01     \$5.01       State commution     <	Ş	Read filling the selection construction is a selection of the fatients	(a) due	We102-27	Mon D1-6-24 \$155-10 days	
X0 for hard film       H80021 (Activitie al (1) - 50) Arrentine     Statis     San(5) 11.15     Tac(6) 11.15     X1 (1) 1.2       H80021 (Activitie al (1) - 50) Arrentine     Statis     San(5) 11.15     Tac(6) 11.15     X1 (1) 1.2       H80021 (Activitie al (1) - 50) Arrentine     Statis     San(5) 11.2     Xn (1) 1.3     Xn (1) 1.3       Varie/(cont) constration     30 data     San (1) 1.3     Xn (1) 1.3     Xn (1) 1.3       Arrentine     Statis     Ra (1) 1.3     Xn (1) 1.3     Xn (1) 1.3       Arrentine     Statis     Ra (1) 1.3     Xn (1) 1.3     Xn (1) 1.3       Arrentine     Statis     Ra (1) 1.3     Xn (1) 1.3     Xn (1) 1.3       Arrentine     Statis     Ra (1) 1.3     Xn (1) 1.3     Xn (1) 1.3       Arrentine     Statis     Ra (1) 1.3     Xn (1) 1.3     Xn (1) 1.3       Arrentine     Statis     Xn (1) 1.3     Xn (1) 1.3     Xn (1) 1.3       Arrentine     Statis     Xn (1) 1.3     Xn (1) 1.3     Xn (1) 1.3       Arrentine     Statis     Xn (1) 1.3     Xn (1) 1.3     Xn (1) 1.3       Arrentine     Statis     Xn (1) 1.3     Xn (1) 1.3     Xn (1) 1.3       Arrentine     Statis     Xn (1) 1.3 </td <td>-</td> <td>Citizen Neck consistention in the middle of the</td> <td></td> <td>5-100-6-6</td> <td>1400 DI-SS75 116-00 PUL</td> <td></td>	-	Citizen Neck consistention in the middle of the		5-100-6-6	1400 DI-SS75 116-00 PUL	
HSURD:1     feature at C1 (= 45. Approximate     55. data     State (0) (1/2)     Tare (0) (1/2)     State (0) (1/2) <t< td=""><td>5</td><td>200 Kap Kap Idling</td><td></td><td>1-0 04 9-4</td><td>5.4 01-10-3 23</td><td></td></t<>	5	200 Kap Kap Idling		1-0 04 9-4	5.4 01-10-3 23	
HUMD2 foreholder al CU15-SPA Arrentiere     6 data     8 st(0.11.18)     Fin (0.11.25)       Verefricterial contraction     20 data     8 st(0.11.25)     8 m(0.11.25)       Verefricterial contraction     20 data     8 st(0.11.25)     8 m(0.11.25)       Verefricterial contraction     20 data     8 st(0.11.25)     8 m(0.11.25)       State contraction     20 data     1 m(0.02.25)     8 m(0.11.25)       State contraction     20 data     1 m(0.02.25)     1 m(0.02.12)       Macro     20 data     2 m(0.02.12)     1 m(0.02.12)       State contraction     2 m(0.02.12)     1 m(0.02.12)     1 m(0.02.12)       Macro     2 macro     2 m(0.02.12)     1 m(0.02.12)       Macro     2 m(0.02.12)     1 m(0.02.12)     1 m(0.02.12)       Macro     2 m(0.02.12)     1 m(0.02.12)     1 m(0.02.12)       Macro     2 m(0.02.12)     1 m(0.02.12)     2 m(0.02.12)       Macro     2 m(0.02.	3.	FRM02-1 feetbeldge at CT18+155, Appendix,		Sun (E)-H)-A	Tue (0.1), 17 - 51	
Writer D al CB-S3 Agreetings     20 Jay     Sci (D-2)     Sci (D-2) <td>\$.</td> <td>F(DS02-2 footballise at C(1 2+23) Appendix.</td> <td></td> <td>Viction 11-18</td> <td>Fn 101-1 55</td> <td></td>	\$.	F(DS02-2 footballise at C(1 2+23) Appendix.		Viction 11-18	Fn 101-1 55	
Varial constration     Oder     The (0+24)     Sum (0+1):22       Stard collar constration     (14a)     (1a)     (1a)     (1a)       Stard collar constration     (14a)     (1a)     (1a)     (1a)       Stard collar constration     (1a)     (1a)     (1a)     (1a)       Start     (1a)     (1a)     (1a)     (1a)	7.	RW type D at CI (9+525 Approximate		Sa 10 1-2		
School contraction for the vertex     Tidato     Time(0): 18: 995: 10: 14: 95: 10: 14: 95: 10: 14: 95: 10: 14: 14: 14: 14: 14: 14: 14: 14: 14: 14	3.	Verke/feetpalt construction	tymb DR	The (0-8-25	Sun 09-11-22	
Circle and feally converted write     Rider     Product     Rider     Product     Rider       Circle and feally converted write     Rider     Ware Nation (1984)     Rider     Ware Nation (1984)     Rider     Rider       Machine (1984)     Machine (1984)     Rider     Rider     Rider     Rider     Rider     Rider       Machine (1984)     Rider     Rider     Rider     Rider     Rider     Rider     Rider       Machine (1984)     Rider     Rider     Rider     Rider     Rider     Rider     Rider       Machine (1984)     Rider     Rider     Rider     Rider     Rider     Rider     Rider       Machine (1984)     Rider     Rider     Rider     Rider     Rider     Rider     Rider       Machine (1984)     Rider     Rider     Rider     Rider     Rider     Rider     Rider       Machine (1984)     Rider     Rider     Rider     Rider     Rider     Rider       Machine (1984)     Rider     Rider     Rider     Rider     Rider     Rider       Machine (1984)     Rider     Rider     Rider     Rider     Rider     Rider	5	Subuce construction for the vertex		The (2) % Z	Mar (9-11.2 St.	
MATRIC in Clifford and construction     matrix     ware matrix     matri	8	Gased cellular connect Australe pano.		50 KI UA	Manual Manual Manual	
All All VACUE of Classification     S2 days     Were All 2.12     Fil 10.74.12	2	INTE A BUILDE CONSTRUCTION	5.FTW	el acentralitzador en	The second	
And Michael (1)     Status with 2-11     File 2-11       And Mick constrated     Status with 2-11     File 2-11       And Mick constrated     Status with 2-11       And Mick constrated     Stat	3	ATT A STATUC IN CONSTRUCTION APPROXIMATION	2017 B	Med 19-11-25	10 27-71-41 Juli	
Alledis construction Madeis construction Programme (PavGh) [154] ESSESSESS Physics Suites Alled (15-11-06) Fragmenter (PavGh) [154] ESSESSESS Physics Suites Alled (15-11-06) Fragmenter (PavGh) [154] ESSESSESS Physics Suites Alled (15-11-06) Fragmenter (PavGh) [154] ESSESSESS Physics Suites Physics Suites Physics Suites Physics Suites Physics Physic	6		51E1 200	7 (-71) III		
- Programme (PeroCh) [34] ESSESSESS Property Contract for Section (Proc. Section 194) [34] ESSESSESSES Property Contract for Section (Proc. Section 194) [34] [34] [34] [34] [34] [34] [34] [34]	8 8	outered constantions a Muchaels constantion	il) dave	210.53	Men In-S-17 Ge	
Programmer (Proc(6)     Joint     Essessesses     Provoco     Semantiv     Addata (Provoco     Esternal Takk       Programmer (Proc(6)     Joint     Essessesses     Matata (Provoco     Selation     Addata (Provoco       Clineard Tool     Essessesses     Matata (Provoco     Essessessesses     Matata (Provoco     Selation						
regreenen vervool jaar in internationaan vervool jaar vervo		1.1			Centrativ	ESERCESSES Redist for Decrees External Tasks
	ojoci. Muxier	1345			AUMINIA	
Pagel	ale: 01/2009			•	RODOL TO LEVE	
						Page 1



## **Future Construction Program**

#### Three month rolling programme at Man Uk Pin (MUP)

¥.	<b>D</b>	D .:	0	c · · ·		August										Septer	ıber																	Octobe	ar							
Item	Description	Duration	Start	finish	3	10 17 24	4 31	1 2	3 4	5 6	5 7	8 9	10	11 12	2 13	14 15	16 17	18 19	20 21	22	23 24	25 26	5 27 2	28 29	30 1	2	3 4	5	6 7	8 9	10 1	1 12	13 14	15 16	17 18	19	20 21 22	2 23	24 25	26 2	.7 28	29 30 31
	MUP01																																					$\square$				
1	Footpath (1.6m concrete paving)	61	1/8/2012	30/9/20	12																																					
2	Surface Channel	51	1/8/2012	20/9/20	12																																					
3	Chain-link fence & railing	31	15/9/2012	15/10/20	12											-								_																		
																								·									·									
	MUP02																																									
1	Footpath (1.0m grassed paving)	51	1/8/2012	20/9/20	12														+																							
2	Surface Channel	15	1/9/2012	15/9/20	12		-		_							_																										
3	Chain-link fence & railing	43	19/9/2012	31/10/20	12													-																		$\square$		+		++	-	
														·																												
	MUP03																																									
1	Chain-link fence & railing	47	15/9/2012	31/10/20	12																						_								$\square$	$\square$		$\square$			$\square$	
2	Type 2 railing	47	15/9/2012	31/10/20	12												_																			$\square$		+		++		
3	Vehicular parapet	9	15/9/2012	23/9/20	12																																					
MUP04																																										
1	Drainage works	51	1/8/2012	20/9/20	12																																					
2	Type 2 railing	41	21/9/2012	31/10/20	12														-																			+			_	
MUP05																																										
1	Footpath (1.0m grassed paving)	46	1/8/2012	15/9/20	12																																					
2	Surface channel	30	24/8/2012	22/9/20	12	-					-			_						-																						
3	Footpath (1.6m Concrete paving)	56	1/8/2012	25/9/20	12																																					
4	Chain-link fence & Fence	36	26/9/2012	31/10/20	12																														$\pm$	$\square$		$\pm$		┢	$\pm $	<u> </u>
5	Tree planting & hydroseeding	31	1/10/2012	31/10/20	12																				-	$\square$			_			$\square$			$\overline{+}$	$\square$		P		+	$\square$	$\square$
6	Site Clearance	90	1/8/2012	31/10/20	12																	_							_						-	$\square$		$\square$		$\square$	$\square$	<u> </u>



### **Environmental Mitigation Implementation Schedule**

t

#### APPENDIX A IMPLEMENTATION SCHEDULE OF THE PROPOSED MITIGATION MEASURES

.

# Table A1 Implementation Schedule of Air Quality Mitigation Measures

EIA Ref	EM&A Ref	<b>Recommended Mitigation Measures</b>	Objectives of the Recommended	Location /	Implementation	Im	plementa Stages*	tion	Relevant
			Measures and Main Concerns to addressed	Timing	Agent	D	C	0	Legislation & Guidelines
Air Q	uality - Co	nstruction Phase				<u> </u>		L	<u> </u>
		Construction Dust					T		I
3.6.1	2.9.2	In order to comply with Air Pollution Control Ordinance (APCO), the Contractor should undertake at all times measures to prevent dust nuisance as a results of his activities. The Contractors are required	To prevent dust nuisance on ASRs during construction	All works site / during construction	Construction Contractor		4		Air Pollution Control Ordinanc Air Pollution
		to follow all the requirements for dust control stipulated in the Air Pollution Control (Construction Dust) Regulation. Dust suppression measures should be installed as part of good construction practice, and							Control (Construction Dust) Regulation
1	l.	they should be incorporated in the Contract Specification and implemented to minimize dust nuisance to within acceptable levels arising from the				i			
		works. The followings are examples of the dust suppression measures.							
		<ul> <li>The area in which excavation takes place shall be sprayed with water immediately prior to, during and immediately after the excavation to minimise dust generation.</li> </ul>				-			
		(ii) The Contractor shall frequently clean and water the site to minimize fugitive dust emissions.							

EIA	EM&A	Dee	ommended Mitigation Measures	Objectives of the Recommended	Location /	Implementation	Imį	olementa Stages*	tion	Relevant
Ref	Ref	Ket		Measures and Main Concerns to addressed	Timing	Agent	D	Ĉ	0	Legislation & Guidelines
		delive simila create	ive water sprays shall be used during the ry and handling of aggregate, and other r materials, when dust is likely to be d and to dampen all stored materials g dry and windy weather.							
		condu	ing of exposed surfaces shall be incred at least 2 times per day especially g dry and windy weather.							
		mover as oft	within the site where there is a regular ment of vehicles must be regularly watered en as necessary for effective suppression st or as often as directed by the Engineer.							
		vehicl transf with a provid this e	e dusty material are being discharged to le from a conveying system at a fixed er point, a three-sided roofed enclosure a flexible curtain across the entry shall be ded. Exhaust fans shall be provided for enclosure and vented to a suitable fabric system.							
		vehic public hour	Contractor shall restrict all motorised les within the site, excluding those on c roads, to a maximum speed of 15 km per and confine haulage and delivery vehicles signated roadways inside the site.							
ĩ		used mud,	el washing facilities shall be installed and by all vehicles leaving the site. No earth, debris, dust and the like shall be deposited ublic roads. Water in the wheel cleaning							

EIA Ref	EM&A Ref	<b>Recommended Mitigation Measures</b>	Objectives of the Recommended	Location /	Implementation	Im	plement Stages		Relevant
			Measures and Main Concerns to addressed	Timing	Agent	D	.C	0	- Legislation & Guidelines
		facility shall be changed at frequent intervals and sediments shall be removed regularly. The Contractor shall submit details of proposals for the wheel cleaning facility. Such wheel washing facilities shall be usable prior to any earthworks excavating activity on the site. The Contractor shall also provide a hard-surfaced road between any washing facility and the public road.							
		(ix) All vehicle exhausts should be directly vertically upwards or directed away from the ground.							
		(x) Any materials dropped on paved roads will need to be cleaned up immediately to prevent dust nuisance.							
		Odow <sup>.</sup>					-		
3.6.2	2.9.3	In the event that excavated materials are found to be odourous, the following measures should be implemented by the Contractor.	To prevent odour nuisance on ASRs during construction	All works site / during construction	Construction Contractor		4		Air Pollution Control Ordinanc Environmental
		<ul> <li>Place odorous excavated material as far away (say, at least 20m) from air sensitive receivers as possible.</li> </ul>							Impact Assessmen Ordinance
		(ii) Temporary stockpiles of odorous excavated material should be properly covered with tarpaulin and should be removed off-site as soon as practically possible within 24 hours to							

EIA	EM&A	Recommended Mitigation Measures	Objectives of the Recommended	Location /	Implementation	Imj	plementa Stages*		Relevant Legislation &
Ref	Ref	Accommences (Anglesse (Account)	Measures and Main Concerns to addressed	Timing	Agent	D	C	0	Guidelines
		avoid any odour nuisance arising.							
Air Qı	uality - Ope	erational Phase					······································	T	F
		N/A							

#### Table A2 Implementation Schedule of Noise Mitigation Measures

EIA Ref	EM&A Ref	<b>Recommended Mitigation Measures</b>	Objectives of the Recommended	Location /	Implementation	Im	plementa Stages*		Relevant
			Measures and Main Concerns to addressed	Timing	Agent	D	C	0	Legislation & Guidelines
Noise - (	Constructio	on Phase							
		Level 1 Mitigation – Use of Quiet Plant							
4.6.2 – 4.6.5	Table 3.4	effective ways of alleviating construction noise impact. The Contractor should use quiet plant with sound power level lower than that stipulated in the	To protect NSRs from noise during construction	All works site / during construction	Construction Contractor			:	Environmental Impact Assessmen Ordinance
		TM-GW as the Level 1 mitigation for construction noise. The quiet plant used in the construction noise calculation is shown in Appendix B. The							ETWB TCW No. 19/2005
		Contractor can propose other suitable alternative equipment with similar or lower sound power level.		<b></b>					
		The use of mini or lower power rating equipment (e.g. mini excavator) should also be considered where practical. This technique would be feasible							
		and practical at some locations given the limited space available for using large size construction equipment and the small scale works involved (e.g. localised bank improvement at LMH01, U-channel							
:		and drainage pipes at MUP03 & 04B).		·					
		The contractor should take note of ETWB TCW No. 19/2005 on the use of QPME.							

EIA EM8	A Recommended Mitigation Measures	Objectives of the Recommended	Location /	Implementation	Im	plementa Stages*		Relevant
Ref Ref	8	Measures and Main Concerns to addressed	Timing	Agent	D	C	0	Legislation & Guidelines
	Level 2 Mitigation - Use of Temporary Noise Barriers							
4.6.7 – 4.6.8	3.4 Since most of the NSRs within the Project area are typically low-rise village houses of not more than 3 storeys tall, it would be effective to have noise screening structures or temporary noise barriers purposely-built along the site boundary to provide additional protection to NSRs close to the construction site boundary. This could be in the form of purposely-built site hoarding constructed from appropriate materials with a minimum superficial density of 7 kg/m <sup>2</sup> . Noise barrier should be provided for noisy construction activities that would be undertaken close (about 25m or less) to NSRs. With the exception of NSRs MUP04A-2 and MUP05-6, the noise barrier should have a vertical height of at least 2.5 m or (depending on the height of the NSRs to be protected) a height ensuring that the operating equipment can be shielded from the view of the NSRs. For NSR MUP04A-2, the temporary noise barrier should have a minimum height of 3.5m with a small cantilevered upper portion. For MUP05-6, the temporary noise barrier should have a minimum height of 3m with a small cantilevered upper portion. The temporary noise barrier should have no gaps or opening at joints. The Contractor should regularly inspect and maintain the noise	noise during construction	All works site located at 25m or less from NSRs as shown in Figures 4.4 – 4.6 / during construction	Construction Contractor				Environmental Impact Assessment Ordinance

EIA Ref	EM&A Ref	<b>Recommended Mitigation Measures</b>	Objectives of the Recommended	Location /	Implementation	Im	plement Stages <sup>3</sup>		Relevant
			Measures and Main Concerns to addressed	Timing	Agent	D	С	0	Legislation & Guidelines
		barrier to ensure its effectiveness.						1	
		For the construction works which have the potential to exceed the noise standards on nearby NSR and whose line of sight cannot be effectively blocked by the temporary noise barrier, movable (mobile) barriers should be provided. Movable barriers of at least 2.5 m height with a small cantilevered upper portion and skid footing can be located within a few meters of stationary plant (e.g. generator, compressor) and within about 5 m or more of a mobile equipment (e.g. excavator, mobile crane), such that the line of sight to the NSR is blocked by the barriers.							
		Good Site Practices							
4.6.11	Table 3.4	In general, potential construction noise impact can be minimised or avoided by imposing a combination of the following good site practices as mitigation measures:	To protect NSRs from noise during construction	All works site / during construction	Construction Contractor	·	4		Environmental Impact Assessmer Ordinance
		(a) Only well-maintained plant should be operated on-site and plant should be serviced regularly during the construction period.		· ,· ·	, .		•	:	
		(b) Construction plant should be sited away from NSRs.							

. . . . .

ELA	EM&A		Recommended Mitigation Measures	Objectives of the Recommended	Location /	Implementation	Im	plementa Stages*		Relevant
Ref	Ref		Recommended winigation measures	Measures and Main Concerns to addressed	Timing	Agent	D	Ĉ	0	Legislation & Guidelines
ì		(c)	Machines and plant that may be in intermittent use should be shut down between works periods or should be throttled down to a minimum.							
		(d)	Equipment known to emit sound strongly in one direction should be orientated such that the noise is directed away from nearby NSRs.							
		(e)	Material stockpiles and other structures (such as site offices) should be effectively utilised to shield on-site construction activities.							
		(f)	Stationary equipment should be located within the channel when weather conditions permit (e.g. dry season).	× .						
		(g)	The Contractor shall devise, arrange methods of working and carrying out the works in such manner as to minimise noise impacts on the surrounding environment, and shall provide experienced personnel with suitable training to ensure that these measures are implemented properly.	÷						
		(h)	In the event that new schools are built near the works area, the Contractor should minimize construction noise exposure to the schools (especially during examination periods). The Contractor should liaise with the school and the Examination Authority to							

EIA Ref	EM&A Ref	Recommended Mitigation Measures	Objectives of the Recommended	Location /	Implementation	Im	plementa Stages*	tion .	Relevant
			Measures and Main Concerns to addressed	Timing	Agent	D	C	0	Legislation & Guidelines
		ascertain the exact dates and times of all examination periods during the course of the contract and to avoid noisy activities during these periods.							
4.6.13 - 4.6.14	Table 3.4	To adopt good public relation with the local communities and maintain effective communication channel with the public such as setting up a 24-hour hotline system for enquiry and complaint.	To promote good public relation and maintain effective communication during construction	All works site / during construction	Project Office (Engineer) & Construction Contractor		1		Environmental Impact Assessmer Ordinance
4.6.17 & 4.6.18	Table 3.4	Further mitigation by restricting concurrent usage of several equipment at the same time.	To further mitigate construction noise at NSRs MUP04A-2 & MUP04B-2	For works within 20m of NSRs MUP04A-2 & MUP04B-2 / during construction	Construction Contractor		1		Environmental Impact Assessmer Ordinance
4.6.19	Table 3.4	The use of purpose built temporary noise barriers would not be practicable for works at LMH01 as the works are small scale, short duration and within village environs with very limited working space. It may also hamper access causing inconvenience to the villagers. The process of installing and dismantling the noise barriers itself would create additional noise nuisance. The use of light-weight mobile barrier is considered more preferable.	To protect NSRs at LMH01 from noise during construction	All works site located at 25m or less from NSRs as shown in Figure 4.6 / during construction	Construction Contractor		1		Environmental Impact Assessmen Ordinance

EIA	EM&A	Recommended Mitigation Measures	Objectives of the Recommended	Location /	Implementation	Imj	plementa Stages*		Relevant
Ref	Ref		Measures and Main Concerns to addressed	Timing	Agent	D	C	0	Legislation & Guidelines
4.6.20	Table 3.4	Employ quiet working method (e.g. mini-concrete crusher, saw & lift) during demolition works of crossings, restrict concurrent usage of several equipment at the same time such as parking dump truck, concrete lorry mixer outside main village area. The use of dump truck or concrete lorry mixer will be limited to only about 1 trip every few days.	To further mitigate construction noise at NSRs for LMH01	Construction works at LMH01 / during construction	Construction Contractor		~		Environmental Impact Assessment Ordinance
4.8.4	Table 3.4	It is recommended that works programme should be scheduled such that only one crossing is constructed at any one time. Bank improvement work can be conducted concurrently.	To mitigate cumulative noise impact at LMH01	Crossing construction at LMH01 / during construction	Construction Contractor		4		Environmental Impact Assessment Ordinance
4.9.1	3.8.1	The Contractor should design, construct, operate and maintain the mitigation measures throughout the construction stage and as required by the Engineer. Before commencement of the works, the Contractor should submit to the Engineer for approval (as part of their method statement) details of the mitigation measures to be employed under the works. The Contractor's proposed mitigation measures should also be certified by the ET Leader and verified by the IEC to ensure the intended noise reduction effectiveness can be achieved.	To protect NSRs from noise during construction and to ensure the Contractor will properly implement the mitigation measures	All works site / during construction	Construction Contractor		1		Environmental Impact Assessment Ordinance

EM&A Ref	<b>Recommended Mitigation Measures</b>	Objectives of the Recommended	Location /	Implementation	Imj	plementa Stages*	tion	Relevant
		Concerns to addressed	Timing	Agent	D	C	0	Legislation & Guidelines
T								
1	N/A							
	Ref erational I	Ref       erational Phase       N/A	Ref     Recommended       Measures and Main       Concerns to addressed	Ref     Recommended     Location /       rational Phase     Recommended     Location /	Ref     Location / Measures and Main Concerns to addressed     Location / Timing     Implementation Agent       erational Phase     N/A     N/A     Implementation Agent     Implementation Agent	Ref     Location / Measures     Implementation / Measures and Main Concerns to addressed     Implementation / Agent       erational Phase     N/A     N/A     Implementation / Concerns to addressed     Implementation / D	Ref     Indext and Main Concerns to addressed     Location / Timing     Implementation Agent     Stages*       erational Phase     N/A     N/A     Implementation Agent     Implementation Agent	Ref     Implementation     Stages*       Measures and Main Concerns to addressed     Timing     Agent     D     C     O

1

#### Table A3 Implementation Schedule of Water Quality Mitigation Measures

EIA	EM&A		Objectives of the Recommended	Location /	Implementation	-	lementa Stages*	tion	Relevant Legislation &
Ref	Ref	Recommended Mitigation Measures	Measures and Main Concerns to addressed	Timing	Agent	D	C	0	Guidelines
Water	Quality - (	Construction Phase		-					
		General	- -						,
5.6.2	4.9.2	The contractor shall observe and comply with the Water Pollution Control Ordinance (WPCO) and its subsidiary regulations. The contractor shall carry out the works in such a manner as to minimise adverse impacts on the water quality during execution of the works. In particular the contractor shall arrange his method of working to minimise the effects on the water quality within and outside the site and on the transport routes.	To minimize adverse water quality impact during construction	All works site / during construction	Construction Contractor		~		Water Pollution Control Ordinance
5.6.3	4.9.3	The contractor shall follow the practices, and be responsible for the design, construction, operation and maintenance of all the mitigation measures below and as specified in ProPECC PN 1/94 - Construction Site Drainage. In particular, the contractor shall submit and implement an Erosion Control Plan (as part of the Environmental Management Plan) which shall incorporate details of the mitigation measures recommended below to reduce water quality impacts arising from construction works. The design of the mitigation measures and the Plan shall be submitted by the contractor to the Engineer for approval.		All works site / during construction	Construction Contractor		1		ProPECC PN 1/94 ETWB TCW No. 19/2005

\_\_\_\_

EM&A Ref	<b>Recommended Mitigation Measures</b>	Objectives of the Recommended	Location /	Implementation	Im	plement: Stages*		Relevant
		Concerns to addressed	Timing	Agent	D	C	0	Legislation & Guidelines
	·				•			
4.9.4	Proper construction site drainage management measures shall be implemented to control site runoff and drainage, and thereby prevent high sediment loadings from reaching downstream sections of the river and adjacent agricultural land.	To minimize adverse water quality impact during construction	All works site / during construction	Construction Contractor		V		ProPECC PN 1/9
4.9.5	Turbid water from construction sites must be treated to minimise the solids content before being discharged. Advice on the handling and disposal of site discharge is given in the ProPECC Note PN 1/94 - Construction Site Drainage.	To minimize adverse water quality impact during construction	All works site / during construction	Construction Contractor		4		ProPECC PN 1/94
4.9.6	In general, surface run-off from construction sites should be discharged into waterbodies via adequately designed sand/silt removal facilities such as sand traps, silt traps and sediment basins. Channels or earth bunds or sand bag barriers should be provided on site to properly direct stormwater to such silt removal facilities. Perimeter channels at site boundaries should be provided to intercept storm run-off from outside the site so that it will not wash across the site (or into the proposed channel works area). Catchpits and perimeter channels should be constructed in advance of earthworks.	To minimize adverse water quality impact during construction	All works site / during construction	Construction Contractor		1	- - - -	ProPECC PN 1/94
	4.9.4	<ul> <li>Site Surface Runoff</li> <li>4.9.4 Proper construction site drainage management measures shall be implemented to control site runoff and drainage, and thereby prevent high sediment loadings from reaching downstream sections of the river and adjacent agricultural land.</li> <li>4.9.5 Turbid water from construction sites must be treated to minimise the solids content before being discharged. Advice on the handling and disposal of site discharge is given in the ProPECC Note PN 1/94 - Construction Site Drainage.</li> <li>4.9.6 In general, surface run-off from construction sites should be discharged into waterbodies via adequately designed sand/silt removal facilities such as sand traps, silt traps and sediment basins. Channels or earth bunds or sand bag barriers should be provided on site to properly direct stormwater to such silt removal facilities. Perimeter channels at site boundaries should be provided to intercept storm run-off from outside the site so that it will not wash across the site (or into the proposed channel works area). Catchpits and perimeter channels should be constructed in</li> </ul>	<ul> <li>4.9.4 Proper construction site drainage management measures shall be implemented to control site runoff and drainage, and thereby prevent high sediment loadings from reaching downstream sections of the river and adjacent agricultural land.</li> <li>4.9.5 Turbid water from construction sites must be treated to minimise the solids content before being discharged. Advice on the handling and disposal of site discharge is given in the ProPECC Note PN 1/94 - Construction Site Drainage.</li> <li>4.9.6 In general, surface run-off from construction sites should be discharged into waterbodies via adequately designed sand/silt removal facilities such as sand traps, silt traps and sediment basins. Channels or earth bunds or sand bag barriers should be provided on site to properly direct stormwater to such silt removal facilities. Perimeter channels at site boundaries should be provided to intercept storm run-off from outside the site so that it will not wash across the site (or into the proposed channel works area). Catchpits and perimeter channels should be constructed in</li> </ul>	Measures and Main Concerns to addressed       Timing         4.9.4       Proper construction site drainage management measures shall be implemented to control site runoff and drainage, and thereby prevent high sediment loadings from reaching downstream sections of the river and adjacent agricultural land.       To minimize adverse water quality impact during construction       All works site / during construction         4.9.5       Turbid water from construction sites must be treated to minimise the solids content before being discharged. Advice on the handling and disposal of site discharge is given in the ProPECC Note PN 1/94 - Construction Site Drainage.       To minimize adverse water quality impact during construction       All works site / during construction         4.9.6       In general, surface run-off from construction sites should be discharged into waterbodies via adequately designed sand/silt removal facilities such as sand traps, silt traps and sediment basins. Channels or earth bunds or sand bag barriers should be provided on site to properly direct stormwater to such silt removal facilities. Perimeter channels at site boundaries should be provided to intercept storm run-off from outside the site so that it will not wash across the site (or into the proposed channel works area). Catchpits and perimeter channels should be constructed in       All works site / during	Measures and Main Concerns to addressed       Timing       Agent         4.9.4       Site Surface Runoff       To minimize adverse measures shall be implemented to control site runoff and drainage, and thereby prevent high sediment loadings from reaching downstream sections of the river and adjacent agricultural land.       To minimize adverse water quality impact during construction       All works site / during construction       Construction Contractor         4.9.5       Turbid water from construction sites discharged. Advice on the handling and disposal of site discharge is given in the ProPECC Note PN 1/94 - Construction Site Drainage.       To minimize adverse water quality impact during construction       All works site / during construction       Construction Contractor         4.9.6       In general, surface run-off from construction sites should be discharged into waterbodies via adequately designed sand/silt removal facilities such as sand traps, silt traps and sediment basins. Channels or earth bunds or sand bag barriers should be provided on site to properly direct stornwater to such sit removal facilities. Perimeter channels at site boundaries should be provided to intercept storm run-off from outside the site so that it will not wash across the site (or into the proposed channel works area). Catchpits and perimeter channels works area). Catchpits       To minimize adverse water quality impact during construction       All works site / during construction       Construction Contractor	Measures and Main Concerns to addressed       Timing       Agent       D         4.9.4       Proper construction site drainage management measures shall be implemented to control site runoff and drainage, and thereby prevent high sediment loadings from reaching downstream sections of the river and adjacent agricultural land.       To minimize adverse water quality impact during construction       All works site / during construction       Construction Contractor         19.5       Turbid water from construction sites must be treated to minimise the solids content before being discharged. Advice on the handling and disposal of site discharge is given in the ProPECC Note PN 1/94 - Construction Site Drainage.       To minimize adverse water quality impact during construction       All works site / during construction       Construction Contractor         4.9.6       In general, surface run-off from construction sites should be discharged into waterbodies via adequately designed sand/silt removal facilities, such as sand traps, silt traps and sediment basins. Channels or earth bunds or sand bag barriers should be provided on site to properly direct stornwater to such silt removal facilities. Perimeter channels at site boundaries should be provided to intercept storm run-off from outside the site so that it will not wash across the site (or into the proposed channel works area). Catchpits and perimeter channels should be constructed in       To minimize adverse water quality impact       All works site / during construction       Construction Contractor	Measures and Main Concerns to addressed       Timing       Agent       D       C         4.9.4       Site Surface Runoff       Proper construction site drainage management measures shall be implemented to control site runoff and drainage, and thereby prevent high sediment loadings from reaching downstream sections of the river and adjacent agricultural land.       To minimize adverse water quality impact during construction       All works site / during construction       Construction       V         19.5       Turbid water from construction sites must be freated to minimise the solids content before being discharged. Advice on the handling and disposal of site discharge is given in the ProPECC Note PN 1/94 - Construction Site Drainage.       To minimize adverse water quality impact during construction       All works site / during construction       Construction Contractor       V         4.9.6       In general, surface run-off from construction should be discharged into waterbodies via adequately designed. sand/silt removal facilities such as sand traps, silt traps and sediment basins. Channels or earth bunds or sand bag barriers should be provided on site to properly direct stormwater to such silt removal facilities Perimeter channels at site boundaries should be provided to intercept storm run-off from outside the site so that it will not wash across the site (or into the proposed channel works area). Catchpits and perimeter channels would be constructed in       All works site / during construction       Construction Contractor       I	Measures and Main Concerns to addressed       Timing       Agent       D       C       O         4.9.4       Site Surface Runoff       Proper construction site drainage management measures shall be implemented to control site runoff and drainage, and thereby prevent high sediment loadings from reaching downstream sections of the river and adjacent agricultural land.       To minimize adverse water quality impact during construction       All works site / during construction       Construction       Image: Construction         19.5       Turbid water from construction sites must be treated to minimise the solids content before being discharged. Advice on the handling and disposal of site discharge is given in the ProPECC Note PN 1/94 - Construction Site Drainage.       To minimize adverse water quality impact during construction       All works site / during construction       Construction       Image: Construction         4.9.6       In general, surface run-off from construction sites should be discharged into waterbodies via adequately designed. sand/silt removal facilities such as sand traps, silt traps and sediment basins. Channels or earth bunds or sand bag barriers should be provided to intercept storm run-off from custide the site so that it will not wash across the site (or into the proposed channel works area). Catchpits and perimeter channels should be constructed in       All works site / during construction       Construction       Image: Construction

EIA	EM&A		Objectives of the Recommended	Location /	Implementation	Imj	plementa Stages*		Relevant
Ref	Ref	Recommended Mitigation Measures	Measures and Main Concerns to addressed	Timing	Agent	D	Ċ	0	Legislation & Guidelines
5.6.7	4.9.7	Silt removal facilities, channels should be maintained and the deposited silt and grit should be removed regularly, at the onset of and after each rainstorm to ensure proper functioning of these facilities at all times.	To minimize adverse water quality impact during construction	All works site / during construction	Construction Contractor				ProPECC PN 1/94
5.6.8	4.9.8	Measures should be taken to prevent the washing away of construction materials, soil, silt or debris into the nearby waterbodies. Open stockpiles susceptible to erosion should be covered with tarpaulin or similar fabric and provided with containment such as bunds, sand bag barriers or equivalent measures, especially during the wet season (April – September) or when heavy rainstorm is predicted. Runoff to watercourses should be reduced by minimising flat exposed areas of permeable soil, and by forming pits or diversion channels into which runoff can flow to suitable treatment facilities before discharge.	To minimize adverse water quality impact during construction	All works site / during construction	Construction Contractor		1		ProPECC PN 1/94
i		De-watering / Excavation of Streams and Removal of Sediment	-						
5.6.9	4.9.9	The use of containment structures such as earth bund or sand bag barriers wrapped with geotextile fabric or similar material or diversion channels is recommended to facilitate a dry or at least confined excavation within watercourses.	To minimize adverse water quality impact during construction	All works site / during construction	Construction Contractor		~		Water Pollution Control Ordinance

EIA Ref	EM&A Ref	Recommended Mitigation Measures	Objectives of the Recommended	Location /	Implementation	Im	plement Stages <sup>*</sup>		Relevant
			Measures and Main Concerns to addressed	Timing	Agent	D	C	0	- Legislation & Guidelines
5.6.10	4.9.10	Excavation works at the existing stream section of MUP05 should be programmed to be carried out during periods of low flow (dry season from 1 <sup>st</sup> October to 31 <sup>st</sup> March) to minimise impacts on downstream water quality and sensitive receivers. For the ecologically sensitive stream of LMH01, the restriction period should be further extended for an additional month (i.e. excavation works allowed from 1 <sup>st</sup> November to 31 <sup>st</sup> March) to protect the aquatic fauna from silty runoff due to possible heavy rain during the transitional period of the wet / dry seasons.	To minimize adverse water quality impact from excavation works during wet season	MUP05 & LMH01 / during construction	Construction Contractor		1		Water Pollution Control Ordinance
5.6.11	4.9.11	In addition, the excavation works should be carried out in sections to reduce the area of exposed surfaces as described below. For MUP05, the first 300m upstream section will have no restriction. For the remaining sections of MUP05 (within existing stream course), the length would be restricted to 300m at any one time. For MUP04A, a 100m restriction should be imposed for the entire stream works area to cater for potential cumulative impact on MUP05.	Restrict length of excavation work to minimise impacts on downstream water quality and sensitive receivers	MUP05 & MUP04A / during construction	Construction Contractor		1		Water Pollution Control Ordinance
5.6.12	4.9.12	As for LMH01, given its relatively small scale works but sensitive nature of the stream, it is recommended that only either one portion of bank	To minimize adverse water quality impact on LMH01 during	LMH01 / during construction	Construction Contractor		1		Water Pollution Control Ordinance

EIA	EM&A		Objectives of the Recommended	Location /	Implementation	Im	plementa Stages*		Relevant
Ref	Ref	Recommended Mitigation Measures	Measures and Main Concerns to addressed	Timing	Agent	D	C	0	Legislation & Guidelines
		improvement works or one vehicular crossing reconstruction should be carried out at any one time.	construction						
5.6.14	4.9.14	After dewatering of the streams, the sediments should be allowed to dry before excavation (yet still maintain a moist state to avoid dust nuisance). This will facilitate excavation of the sediments and also minimise the risk of drained water flowing back into watercourses as the sediment is handled. Where time or weather constraints require handling of wet sediment, care should be taken in the removal of sediment and the storage area should be bunded to prevent silty runoff entering watercourses. Given its small quantity, all excavated sediment should be reused on-site as backfilling material.	To minimize adverse water quality impact during construction (in particular when excavating and handling sediments)	All works site where sediment removal is required / during construction	Construction Contractor		7		Water Pollution Control Ordinance
5.6.15	4.9.15	Excavated sediment will likely be temporarily stored on-site for reuse as backfilling material. This should be stored in a bunded area and covered during wet season or when rainstorm is forecasted to avoid inadvertent release of silts and suspended solids to nearby water bodies.	To minimize adverse water quality impact during construction (in particular when excavating and handling sediments)	All works site where sediment removal is required / during construction	Construction Contractor		1		Water Pollution Control Ordinance
5.6.16	4.9.16	Regular monitoring of suspended solids and turbidity should be conducted during excavation works. Any exceedance of water quality in the	To minimize adverse water quality impact during construction	All works site / during construction	Construction Contractor		1		Water Pollution Control Ordinance

EIA Ref	EM&A Ref	<b>Recommended Mitigation Measures</b>	Objectives of the Recommended	Location /	Implementation	Imj	lements Stages*		Relevant
		N	Measures and Main Concerns to addressed	Timing	Agent	D	С	0	- Legislation & Guidelines
		nearby water bodies caused by inadvertent release of site runoff should be rectified in accordance with EM&A programme for this Project.				•	- -		
		Concreting Work		· · · · · · · · · · · · · · · · · · ·					
5.6.17	4.9.17	Runoff should be carefully channelled to prevent concrete-contaminated water from entering watercourses. Adjustment of pH can be achieved by adding a suitable neutralising reagent to wastewater prior to discharge. Re-use of the supernatant from the sediment pits for washing out of concrete lorries should be practised.	To minimize adverse water quality impact during construction (in particular concreting works)	All works site / during construction	Construction Contractor		V		Water Pollution Control Ordinance
5.6.18	4.9.18	Any exceedance of acceptable range of pH levels in the nearby water bodies caused by inadvertent release of site runoff containing concrete should be monitored and rectified under the EM&A programme for this Project.	To minimize adverse water quality impact during construction (in particular concreting works)	All works site / during construction	Construction Contractor			· · · · · · · · · · · · · · · · · · ·	Water Pollution Control Ordinance
5.6.19	4.9.19	To protect the sensitive stream of Lin Ma Hang, no concrete should be used during bank improvement works at LMH01.	To minimize adverse water quality impact on LMH01 during construction	LMH01 bank improvement works / during construction	Construction Contractor		√		Environmental Impact Assessment Ordinance
		Site Workshop or Depot		· · ·					•
5.6.20	4.9.20	Any contractor generating waste oil or other	To minimize adverse	All works site /	Construction		1		Water Pollution

EIA Ref	EM&A Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures and Main	Location / Timing	Implementation Agent	Imj D	olementa Stages* C	Relevant Legislation & Guidelines
ï		chemicals as a result of his activities should register as a chemical waste producer and provide a safe storage area for chemicals on site. The storage site should be located away from existing water courses.	Concerns to addressed water quality impact during construction	during construction	Contractor			Control Ordinance
5.6.21	4.9.21	All compounds in works areas should be located on areas of hard standing with provision of drainage channels and settlement ponds where necessary to allow interception and controlled release of settled/treated water; and provision of bunding for all potentially hazardous materials on site including fuels. Hard standing compounds should drain via an oil interceptor. To prevent spillage of fuels or other chemicals to water courses, all fuel tanks and storage areas should be sited on sealed areas, within a bund of a capacity equal to 110% of the storage capacity of the largest tank. Disposal of the waste oil should be done by a licensed collector. Oil interceptors should be regularly inspected and cleaned to avoid wash-out of oil during storm conditions. A bypass should be provided to avoid overload of the interceptor's capacity. Good housekeeping practices should be implemented to minimise careless spillage and to keep the storage and the work space in a tidy and clean condition. Appropriate training including safety codes and relevant manuals should be given to the personnel who regularly handle the chemicals on site.		All works site / during construction	Construction Contractor		1	Water Pollution Control Ordinance

ELA Ref	EM&A	<b>Recommended Mitigation Measures</b>	Objectives of the Recommended	Location /	Implementation	Im	plementa Stages*		Relevant
Kei	Ref		Measures and Main Concerns to addressed	Timing	Agent	D	C	0	Legislation & Guidelines
	·			•					
5.6.22	4.9.22	The contractor should prepare an emergency contingency plan (spill action plan) for the Project to contain and remove all accidental spillage of chemicals and hazardous materials on-site including fuels at short notice and to prevent or minimize the quantities of contaminants entering the stream water and affecting the habitats. The contractor should submit the emergency contingency plan to the ET for review & comment and the engineer for approval.	To prevent or minimize the quantities of contaminants entering the stream water and affecting the habitats in case of accidental spillage of chemicals and hazardous materials	All works site / during construction	Construction Contractor		√		Water Pollution Control Ordinance
5.6.24 î	4.9.24	Presence of Additional Population (Workers) Sewage arising from the additional population of workers on site should be collected in a suitable storage facility, such as portable chemical toilets. An adequate number of portable toilets should be provided for the construction workforce. The portable toilets should be maintained in a state that will not deter the workers from using them. The collected wastewater from sewage facilities and also from eating areas or washing facilities must be disposed of properly, in accordance with the WPCO requirements. Wastewater collected should be discharged into foul sewers and collected by licensed collectors.	To minimize adverse water quality impact during construction	All works site / during construction	Construction Contractor		1		ProPECC PN 1/94 Water Pollution Control Ordinance

## Table A4 Implementation Schedule of Waste Management Measures

EIA Ref	EM&A Ref	<b>Recommended Mitigation Measures</b>	Objectives of the Recommended Measures and Main	Location /	Implementation		plementa Stages*		Relevant Legislation &
			Concerns to addressed	Timing	Agent	D	С	0	Guidelines
Waste	- Construc	tion Phase						I	
		General							1
6.5.2 - 5.5.3	5.1.2 - 5.1.3	Upon appointment, the main contractor of each construction contract should prepare and implement an Environmental Management Plan (EMP) in accordance with ETWB TCW No. 19/2005 – Environmental Management on Construction Sites which should describe the arrangements for avoidance, reuse, recovery, recycling, storage, collection, treatment and disposal of different categories of waste to be generated from the construction activities. Such a management plan should incorporate site specific factors, such as the designation of areas for segregation and temporary storage of reusable and recyclable materials. The EMP should be submitted to the Engineer for approval. The contractor shall implement the waste management practices in the EMP throughout the construction stage of the Project. The EMP should be reviewed regularly and updated (preferably monthly) by the contractor. The EMP should take into account the recommended mitigation measures in the EIA Report. The contractor also should refer to the Construction and Demolition Material Management Plan (C&DMMP) in Appendix D1 (of the EIA) to facilitate him in the preparation of the EMP of the	Waste reduction, reuse, recycling and proper disposal of waste	All works site / during construction	Construction Contractor		4		Waste Disposal Ordinance ETWB TCW No 19/2005
		Contract.							

EIA	EM&A	Recommended Mitigation Measures	Objectives of the Recommended	Location /	Implementation	Im	olementa Stages*	tion	Relevant Legislation &
Ref	Ref		Measures and Main Concerns to addressed	Timing	Agent	Ø	C	0	Guidelines
	5.1.4	Training of construction staff should be undertaken by the contractor about the concept of site cleanliness and appropriate waste management procedures. The contractor should develop and provide toolbox talk for on-site sorting of C&D materials to enhance worker's awareness in handling, sorting, reuse and recycling of C&D materials. Requirements for staff training should be included in the EMP.	Waste reduction, reuse, recycling and proper disposal of waste	All work sites / during construction	Construction Contractor		V		Waste Disposal Ordinance ETWB TCW No. 19/2005
6.5.5	5.1.5	Good planning and site management practice should be employed to eliminate over ordering or mixing of construction materials to reduce wastage. Proper storage and site practices will minimise the damage or contamination of construction materials.	Waste reduction, reuse, recycling and proper disposal of waste	All work sites / during construction	Construction Contractor		~		Waste Disposal Ordinance ETWB TCW No. 19/2005
6.5.6	5.1.6	Where waste generation is unavoidable, the potential for recycling or reuse should be rigorously explored. If wastes cannot be recycled, disposal routes described in the EMP should be followed. A recoding system for the amount of waste generated, recycled and disposed (including the disposal sites) should be implemented. In order to monitor the disposal of C&D material and solid wastes at public filling facilities and landfills and to control fly-tipping, a trip-ticket system should be included.	Waste reduction, reuse, recycling and proper disposal of waste	All work sites / during construction	Construction Contractor		٨		Waste Disposal Ordinance ETWB TCW No 19/2005 31/2004
6.5.7	5.1.7	Regular cleaning and maintenance of the waste storage area should be provided.	Waste reduction, reuse, recycling and proper disposal of waste	All work sites / during construction	Construction Contractor		4		Waste Disposal Ordinance

EIA Ref	EM&A Ref	<b>Recommended Mitigation Measures</b>	Objectives of the Recommended	Location /	Implementation	Im	plementa Stages*		Relevant
			Measures and Main Concerns to addressed	Timing	Agent	D	C	0	– Legislation & Guidelines
									ETWB TCW No. 19/2005
		On-site Sorting, Reuse and Recycling		-			-		
6.5.8	5.1.8	All waste materials should be segregated into categories covering:	recycling and proper di disposal of waste co	All work sites / during construction	Construction Contractor		V		Waste Disposal Ordinance
		• excavated materials suitable for reuse on-site;							ETWB TCW No.
		<ul> <li>excavated materials suitable for public filling facilities;</li> </ul>							19/2005
		<ul> <li>remaining C&amp;D waste for landfill;</li> </ul>							
:		• chemical waste; and		[					
		• general refuse for landfill.							
6.5.9	5.1.9	Proper segregation and disposal of construction waste should be implemented. Separate containers should be provided for inert and non-inert wastes.	Waste reduction, reuse, recycling and proper	· All work sites / during construction	Construction Contractor	• .	1	. Arenner	Waste Disposal Ordinance
		should be provided for men and non-ment wastes.	disposal of waste	construction					ETWB TCW No. 19/2005
6.5.10	5.1.10	Sorting is important to recover materials for reuse	117						
	5.1.10	and recycling. Specific area should be allocated for on-site sorting of C&D materials and to provide a	Waste reduction, reuse, recycling and proper	All work sites / during construction	Construction Contractor		. √		Waste Disposal Ordinance
		temporary storage area for those sorted materials	disposal of waste	construction					ETWB TCW No. 19/2005, 31/2004

EIA	EM&A	Recommended Mitigation Measures	Objectives of the Recommended	Location /	Implementation	Implementation Stages*			Relevant
Ref	Ref	Accommended mangaton measures	Measures and Main Concerns to addressed	Timing	Agent	D	C	0	Legislation & Guidelines
Ĩ		such as metals, concrete, timber, plastics, glass, excavated spoils, bricks / tiles and waste papers. If area is limited, all C&D materials should at least be sorted on-site into inert and non-inert component. Non-inert materials (C&D waste) such as bamboo, timber, vegetation, packaging waste and other organic materials should be reused and recycled wherever possible and disposed of to designated landfill only as a last resort. Inert materials (public fill) such as concrete, stone, clay, brick, soil, asphalt and the like should be separated and reuse in this or other projects (subject to approval by the relevant parties in accordance with the ETWB TCW No. 31/2004) before disposed of at a public filling facility operated by Civil Engineering and Development Department (CEDD). Steel and other metals should be recovered from demolition waste stream and recycled.							
6.5.11	5.1.11	The reuse of inert materials such as soil, rock and broken concrete should be maximised. Waste should be separated into fine, soft and hard materials. With the use of a crusher coarse material can be crushed to make it suitable for use as fill material where fill is required in the works. This minimises the use of imported material and maximises use of the C&D material produced.	Waste reduction, reuse, recycling and proper disposal of waste	All work sites / during construction	Construction Contractor		1		Waste Disposal Ordinance ETWB TCW No. 19/2005
6.5.12	5.1.12	Prior to export of material from the site, the	Waste reduction, reuse,	All work sites /	Construction		1		Waste Disposal

EIA Ref	EM&A Ref	<b>Recommended Mitigation Measures</b>	Objectives of the Recommended	Location /	Implementation	Implementation Stages*			Relevant
Kei	Kei		Measures and Main Concerns to addressed	Timing	Agent	D .	C	0	- Legislation & Guidelines
		potential for it to be reused should be assessed. With the exception of excavated clay most C&D material can easily be reused. Waste separation methods should be followed to ensure that C&D waste is separated at source. Suitable soft materials should be used for landscaping and grading of embankments. Fine material should be separated out and used as topsoil.	recycling and proper disposal of waste	during construction	Contractor				Ordinance ETWB TCW No. 19/2005
6.5.13	5.1.13	The feasibility of using recycled aggregates in lieu of virgin materials should be rigorously considered during the detailed design and construction stages as stipulated in WBTC No. 12/2002 and ETWB TCW No. 24/2004. In general, recycled aggregates are suitable for use as fill materials in earthworks, road sub-base formation, and drainage works. Recycled aggregates can also be used in concrete (up to Grade 35) for mass concrete walls and other minor structures such as planter boxes, toe wall planters and pavement, etc.	Waste reduction, reuse, recycling and proper disposal of waste	All work sites / during construction	Construction Contractor		~		Waste Disposal Ordinance ETWB TCW No. 19/2005, 24/2004 WBTC No. 12/2002
6.5.14	5.1.14	Recycled inert C&D material should be used in the works as sub-bases for access roads and footpaths of the proposed channels. Recycled aggregates should be considered for use in concrete as outlined in the above mentioned technical circulars. Some recycled rock material can be reused in the gabions, as rock fill or as stream bed material. This is dependent on size of rock fragments but can be	Waste reduction, reuse, recycling and proper disposal of waste	All work sites / during construction	Construction Contractor	-	1		Waste Disposal Ordinance ETWB TCW No. 19/2005

EIA	EM&A	Recommended Mitigation Measures	Objectives of the Recommended	Location /	Implementation	Implementation Stages*			Relevant Legislation &
Ref	Ref	Accommented Mittgation measures	Measures and Main Concerns to addressed	Timing	Agent	D	C	0	Guidelines
		achieved by appropriate use of a crusher.							
		Site Clearance / Demolition Materials							· · · · · · · · · · · · · · · · · · ·
		Excavated Materials							
6.5.15	5.1.15	All C&D materials should be sorted on-site into inert and non-inert components by the contractor.	Waste reduction, reuse, recycling and proper	All work sites / during	Construction Contractor		V		Waste Disposal Ordinance
		Non inert materials (C&D waste) such as wood, glass and plastic should be reuse and recycle before disposal to a designated landfill as a last resort (currently assume to be the nearby NENT Landfill). Inert materials (public fill) such as soil, rubble, sand, rock, brick and concrete should be separated and where appropriate broken down to size suitable for subsequent filling. Suitable C&D material should be use as pipe bedding or for backfilling of retaining walls, box culvert and formation of	disposal of waste	construction					ETWB TCW No 19/2005, 31/2004
		channel embankments. Excavated rocks from existing streams should be reuse for rip-rap lining and gabion lining. Inert materials should be reused on-site or in other projects approved by relevant parties in accordance with the ETWB TCW No. 31/2004 before disposed of at public filling facilities. Steel and other metals should be recovered from C&D materials and recycled.							
6.5.16	5.1.16	Excavated sediment from existing stream should be reuse on-site as backfilling material.	Reuse of excavated sediment to minimize offsite disposal	MUP04A / during construction	Construction Contractor		1		Waste Disposal Ordinance

EIA Ref	EM&A Ref	<b>Recommended Mitigation Measures</b>	Objectives of the Recommended	Location /	Implementation	Implementation Stages*			Relevant
			Measures and Main Concerns to addressed	Timing	Agent	D	C	0	Legislation & Guidelines
6.5.17	5.1.17	Good quality reusable topsoil should be stockpiled for later landscaping works. Stockpiles should be less than 2 m in height, formed to a safe angle of repose and hydroseeded or covered with tarpaulin to prevent erosion during the rainy season and to minimise dust generation.	Waste reduction, reuse, recycling and proper disposal of waste	All work sites / during construction	Construction Contractor		4		Waste Disposal Ordinance ETWB TCW No 19/2005
5.5.18	5.1.18	<ul> <li>Control measures for temporary stockpiles on-site should be taken in order to minimize the noise, generation of dust, pollution of water and visual impact. These measures include:</li> <li>surface of stockpiled soil should be regularly wetted with water especially during dry season;</li> </ul>	Waste reduction, reuse, recycling and proper disposal of waste	All work sites / during construction	Construction Contractor		1		Waste Disposal Ordinance ETWB TCW No. 19/2005
		<ul> <li>disturbance of stockpiled soil should be minimized;</li> <li>stockpiled soil should be properly covered with tarpaulin especially when heavy rain storms are predicted;</li> <li>stockpiling areas should be enclosed where space is available;</li> <li>stockpiling location should be away from the water bodies; and</li> <li>an independent surface water drainage system</li> </ul>							

EIA	EM&A	Recommended Mitigation Measures	Objectives of the Recommended	Location /	Implementation	Implementation Stages*			Relevant Legislation &
Ref	Ref		Measures and Main Concerns to addressed	Timing	Agent	D	Ĉ	0	Guidelines
Î		equipped with silt traps should be installed at the stockpiling area.							
6.5.19	5.1.19	The identification of final disposal sites for C&D materials generated by the construction works will be considered during the detailed design stage of the Project when the volume and types of C&D materials can be more accurately estimated. The Public Fill Committee of CEDD should be consulted on designated outlets (e.g. public filling area) for public fill, whilst EPD should be consulted on landfills for C&D waste. Disposal of C&D waste to landfill must not have more than 50% (by weight) inert material. The C&D waste delivered for landfill disposal should contain no free water and the liquid content should not exceed 70% by weight.	Waste reduction, reuse, recycling and proper disposal of waste	All work sites / during construction	Construction Contractor		1		Waste Disposal Ordinance ETWB TCW No. 19/2005
6.5.20	5.1.20	In order to avoid dust or odour impacts, any vehicle leaving a works area carrying C&D waste or public fill should have their load covered before leaving the construction site.	Waste reduction, reuse, recycling and proper disposal of waste	All work sites / during construction	Construction Contractor		4		Waste Disposal Ordinance ETWB TCW No 19/2005 WBTC No. 19/2001
6.5.21	.5.1.21	C&D materials should be disposed of at designated public filling facilities or landfills. Disposal of		All work sites / during	Construction Contractor		1		Waste Disposal Ordinance

Г

EIA Ref	EM&A Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures and Main	Location /	Implementation				Relevant
		these materials for use		Timing	Agent	D	C	0	Legislation &
		these materials for use at other construction projects is subject to the approval of the EPD Engineer and/or relevant authorities, such as LandsD, PlanD, etc. Furthermore, unauthorized disposal of C&D materials in particular on private agricultural land is prohibited and may be subject to relevant enforcement and regulating actions. The	n disposal of waste , s i t	construction					Guidelines ETWB TCW No. 19/2005, 31/2004
		contractor shall refer and strictly follow the trip- ticket system for the disposal of C&D material as stipulated in the ETWB TCW No. 31/2004.							
5.22		Where the construction processes produce chemical waste, the contractor must register with EPD as a chemical waste producer. Wastes classified as chemical wastes are listed in the Waste Disposal (Chemical Waste) (General) Regulation. These wastes are subject to stringent disposal routes. EPD requires information on the particulars of the waste generation processes including the types of waste produced, their location, quantities and generation rates. A nominated contact person must be registered with EPD. An updated list of licensed chemical waste collector can be obtained from EPD.	recycling and proper disposal of chemical	All work sites / during construction	Construction Contractor		√		Waste Disposal (Chemical Waste) (General) Regulation, Code of Practice on the Packaging Labelling and Storage of Chemical Waste
.23	5.1.23	Storage, handling, transport and disposal of chemical vaste should be arranged in accordance with the		All work sites / luring	Construction Contractor		1		Waste Disposal Chemical Waste)

			Objectives of the Recommended	Location /	Implementation	Implementation Stages*			Relevant
EIA Ref	EM&A Ref	Recommended Mitigation Measures	Measures and Main Concerns to addressed	Timing	Agent	D	C	0	Legislation & Guidelines
		Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes published by EPD, and should be collected by a licensed chemical waste collector.	disposal of chemical waste	construction					Regulation, Code of Practice on the Packaging Labelling and Storage of Chemical Waste
6.5.24	5.1.24	Suitable containers should be used for specific types of chemical wastes, containers should be properly labelled (English and Chinese in accordance with instructions prescribed in Schedule 2 of the Regulations), resistance to corrosion, stored safely and closely secure. Stored volume should not be kept more than 450 liters unless the specification has been approved by the EPD. Storage area should be enclosed by three sides by a wall, partition of fence that is at least 2 m height or height of tallest container with adequate ventilation and space.		All work sites / during construction	Construction Contractor		1		Waste Disposal (Chemical Waste) (General) Regulation, Code of Practice on the Packaging Labelling and Storage of Chemical Waste
6.5.25	5.1.25	Hard standing, impermeable surfaces draining via oil interceptors should be provided in works area compounds. Interceptors should be regularly emptied to prevent release of oils and grease into the surface water drainage system after accidental spillages. The interceptor should have a bypass to prevent flushing during periods of heavy rain. Oil and fuel bunkers should be bunded and/or enclosed on three sides to prevent discharge due to accidental spillages or breaches of tanks. Bunding	recycling and proper disposal of chemical waste	During	Construction Contractor		1		Waste Disposal (Chemical Waste) (General) Regulation, Code of Practice on the Packaging Labelling and Storage of Chemical Waste

EIA Ref	EM&A Ref	<b>Recommended Mitigation Measures</b>	Objectives of the Recommended Measures and Main	Location / Timing	Implementation		plement: Stages*	Relevant	
		should be of sufficient capacity to accommodate 110% of the volume of the largest container or 20%			Agent	D	C	0	Legislation & Guidelines
		of the total volume of waste, whichever is largest. Waste collected from any grease traps should be collected and disposed of by a licensed contractor.							
6.5.26	5.1.26	Lubricants, waste oils and other chemical wastes are likely to be generated during the maintenance of vehicles and mechanical equipment. Used lubricants should be collected and stored in individual containers which are fully labelled in English and Chinese and stored in a designated secure place. If possible, such waste should be sent to oil recycling companies, and the empty oil drums collected by appropriate companies for reuse or refill.	Waste reduction, reuse, recycling and proper disposal of chemical waste	All work sites / during construction	Construction Contractor		1		Waste Disposal (Chemical Waste) (General) Regulation, Code of Practice on the Packaging Labelling and Storage of Chemical Waste
.5.27	1	be collected by licensed collectors. The licensed collector should regularly take chemical waste to a licensed chemical waste treatment facility (such as the Chemical Waste Treatment Centre in Tsing Yi). A trip ticket system operates to control the novement of chemical wastes.	recycling and proper	All work sites / during construction	Construction Contractor		1	- 4 . -	Waste Disposal (Chemical Waste) (General) Regulation, Code of Practice on the Packaging Labelling and Storage of Chemical Waste
5.28	5.1.28 N	No lubricants, oils, solvents or paint products V hould be allowed to discharge into water courses, re		All work sites / Juring	Construction Contractor		1		Waste Disposal

			Objectives of the Recommended	Location /	Implementation	Im	olementa Stages*	tion	Relevant Legislation &
EIA Ref	EM&A Ref	Recommended Mitigation Measures	Measures and Main Concerns to addressed	Timing	Agent	D	C	0	Guidelines
ï		either by direct discharge, or as contaminants carried in surface water runoff from the construction site.	disposal of chemical waste	construction					(General) Regulation, Code of Practice on the Packaging Labelling and Storage of Chemical Waste
6.5.29	5.1.29	Concrete Waste Dry concrete waste (considered as public fill) should be sorted out from the other wastes and recycled for reuse or sorted out for disposal at designated public filling facilities.	Waste reduction, reuse, recycling and proper disposal of waste	All work sites / during construction	Construction Contractor		V		Waste Disposal Ordinance ETWB TCW No. 19/2005, 33/2002
6.5.30	5.1.30	Wooden Materials All wooden materials used on-site should be kept separate from other wastes to avoid damage and to facilitate reuse. Timber which cannot be reused should be sorted out from other waste and stored separately from all inert waste before being disposed of to landfill.	recycling and proper disposal of waste	1	Construction Contractor				Waste Disposal Ordinance ETWB TCW No. 19/2005, 33/2002
6.5.31	5.1.31	Reusable steel or concrete panel shutters, fencing and hoarding and signboard should be used as a preferred alternative to items made of wood, to minimise wastage of wood. Attention should be paid to WBTC No. 19/2001 - Metallic Site Hoardings and Signboards to reduce the amount of	disposal of waste		Construction Contractor		↓		Waste Disposal Ordinance ETWB TCW No. 19/2005, 33/2002

EIA Ref	And A	Recommended Mitigation Measures	Objectives of the Recommended Measures and Main	Location / Timing	Implementation	Implementation Stages*			Relevant
		timber used on construction sites. Metallic alternatives to timber are readily available and	Concerns to addressed	l x ming	Agent	D	C	0	Legislation & Guidelines
		should be used rather than new timber. Recast concrete units should be adopted wherever feasible to minimize the use of timber formwork.							
5.32	5.1.32	Only waste material need be taken to a landfill. It	Waste reduction, reuse,	All work sites /					
		should be separated from recyclable wood and steel materials. As for all waste types these materials should be reused on-site or other approved sites before disposal is considered as an option.	recycling and proper disposal of waste	during construction	Construction Contractor		V		Waste Disposal Ordinance
		Disposal to landfill should only be considered as a final option. Contractors are responsible for storage of re-useable materials on-site.							ETWB TCW No. 19/2005, 33/2002
		Municipal Waste							
.33		from other construction and chemical wastes and disposed of at designated landfill A temporary	recycling and proper	All work sites / during construction	Construction Contractor		~		Waste Disposal Ordinance
		contractor to facilitate the collection of refuse by icensed contractors. The removal of wasta from the	- ·	• • •					ETWB TCW No. 19/2005
	p p	site should be arranged on a daily or at least on every second day by the contractor to minimise any potential odour impacts, minimise the presence of pests, vermin and other scavengers and prevent nsightly accumulation of waste.							· . 1

# Table A5 Implementation Schedule of Ecological Impact Measures

			Objectives of the Recommended	Location /	Implementation	Imp	olementa Stages*	tion	Relevant Legislation &
EIA EM&A Ref Ref		Recommended Mitigation Measures	Measures and Main Concerns to addressed	Timing	Agent	D	C	0	Guidelines
Ecology	- Construct	ion Phase	• · · · · · · · · · · · · · · · · · · ·	· · · · · · · · · · · · · · · · · · ·			1	r	l
7.9.3	6.5.2	<i>LMH01</i> Given the ecological importance of Lin Ma Hang stream, it is proposed that construction works at LMH01 should be restricted to the dry season period from 1 <sup>st</sup> November $-31^{st}$ March. The small scale of works should allow all construction to be completed within dry season to ensure that the risk of erosion and sedimentation due to heavy rain on the works areas, as well as disturbance impacts to surrounding areas, will be minimised.	impacts during construction at LMH01	All works sites at LMH01 / during construction	Construction Contractor		~		Environmental Impact Assessment Ordinance
7.9.4	6.5.3	In addition, the breaking of existing shotcrete banks at LMH01 should be restricted to hand-held equipment. Concrete should not be used for construction of the gabion banks.	impacts during	All works sites at LMH01 / during construction	Construction Contractor		7		Environmental Impact Assessment Ordinance
7.9.5	6.5.4	Potential disturbance impacts to surrounding habitats and pollution risks (water quality impacts) to the stream should be minimised by adoption of appropriate site managemen procedures, as detailed in ETWB TCW No 5/2005; including among others the location o access to the site and storage of materials, and treatment of construction site waste to preven	construction at LMH01 t f f	All works sites at LMH01 / during construction	Construction Contractor		1		Environmental Impact Assessment Ordinance

ELA Ref	EM&A Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures and Main	Location / Timing	Implementation	In	nplement Stages	tation *	Relevant
		pollution of the stream. These site management measures are listed in the subsequent section.			Agent	D	C	0	Legislation & Guidelines
7.9.9 i		MUP05 (natural stream section) <u>Streambed</u> One of the main benefits of the proposed stream widening measures is that the existing natural stream bed is left undisturbed. Accordingly, works should be carried out in such a way that as much as possible of the natural stream bed should be left undisturbed and that where disturbance is essential this should be minimised in terms of area, magnitude and duration to minimise potential impacts to stream fauna and to ensure refuges for these species during the period of the works. Avoidance of the stream bed can be achieved by conducting the earthworks to widen the stream from the landward side, by not lowering the widened channel to the same level as, or below, the existing channel, and by leaving the existing stream untouched except during the inal stage, when the newly formed widened tream bed is joined to the existing stream.	Minimize ecological impacts during construction at MUP05	All works sites at MUP05 / during construction	Construction Contractor		1		Environmental Impact Assessmer Ordinance
2.10	fi p st	nes of varying sizes) to approximate as closely as	mpacts during	All works sites at MUP05 / during construction	Construction Contractor		√		Environmental Impact Assessment Ordinance

- -

			Objectives of the Recommended Location / Measures and Main Timing Concerns to addressed	Location /	Implementation Agent	Imj	lementa Stages*	Relevant Legislation &	
EIA Ref	EM&A Ref					D	С	0	Guidelines
		deposited naturally.							
9.11	6.5.10	In order to minimise potential impacts to stream fauna during excavation of the widened "two- stage" channel, this work should be limited to the dry season as far as possible, between 1 <sup>st</sup> October and 31 <sup>st</sup> March. As rainfall is low at this time, erosion is less likely and deposition of sediment downstream of the works should be minimised. This also avoids the time when stream fauna are at the most vulnerable stage in their life cycle (eggs and young larvae). Any essential works outside the dry season should be temporarily isolated from the stream to prevent the risk of pollution or sedimentation affecting the ecological integrity of the stream.	Minimize ecological impacts during construction at MUP05	All works sites at MUP05 / during construction	Construction Contractor		1		Environmental Impact Assessment Ordinance
7.9.12	6.5.11	As required to minmize potential water quality impacts (Section 5.6), excavation works at the stream section of MUP05 should be restricted to 300m length at any one time. No restriction is considered necessary for the first 300m upstream concrete drains section. Excavation works at MUP04A should be restricted to 100m to cater for potential cumulative impact on MUP05.	construction at MUP05	All works sites at MUP05 / during construction	Construction Contractor		N .		Environmental Impact Assessmen Ordinance
1		Appropriate site management procedures during	Minimize ecological	All works sites at			1		Environmental Impact Assessme
7.9.13	6.5.12	the construction phase should be adopted, as	'l	MUP05 / during	Contractor	1			Impacticocounter

.

EIA Ref	EM&A Ref	<b>Recommended Mitigation Measures</b>	Objectives of the Recommended Measures and Main	Location / Timing	Implementation	In	nplemen Stages	tation *	Relevant
	1	recommended in ETWB TCW No. 5/2005, to	Concerns to addressed	Thung	Agent	D	C	0	<ul> <li>Legislation &amp; Guidelines</li> </ul>
}		minimise potential disturbance impacts and pollution risks (water quality impacts) to the stream. This should include the location of access to the site and storage of materials, and treatment of construction site waste to prevent pollution of the stream. These site management measures are listed in the subsequent section.	construction at MUP05	construction					Ordinance
7.9.20, Fable 7.29		transplanting existing trees to suitable locations	Mitigate the loss of bankside trees and associated riparian habitats at MUP05	MUP05 / during construction	Construction Contractor				Environmental Impact Assessmen Ordinance
	-	Ficus hispida Ficus microcarpa				2			

1. EV

			Objectives of the	Location /	Implementation		lementat Stages*	ion	Relevant Legislation &
EIA Ref	EM&A Ref	Recommended Mitigation Measures	Recommended Measures and Main Concerns to addressed	Timing	Agent	D	С	0	Guidelines
		Bambusa eutuldoides							
7.9.21	6.5.20	The proposed landscape compensatory planting of about 740 trees (approximately $1,100 \text{ m}^2$ ) along the MUP channels will serve dual purpose of landscape impact mitigation as well as mitigating the loss of riparian trees.	Dual purpose of landscape impact mitigation and mitigate the loss of riparian trees at the MUP channels	MUP channels / during construction	Construction Contractor		1		Environmental Impact Assessmen Ordinance
7.9.22	6.5.21	The Landscape Plan to be submitted prior to	To ensure the	All works site / during detailed	DSD (or its appointed	1	1		Environmental Impact Assessme
fable	Table 6.6	commencement of planting or landscaping works   r	recommended plant species are taken into	design and	Detailed Design			1	Ordinance
7.29	(7.5.11)	should take into account the recommended plant species.	account in the Landscape Plan	construction	Engineer)	1			
(8.11.27		Sporton .	Landscape Flan						
)					Construction Contractor to implement the approved planting plan				
7.9.23	6.5.22	The recommended site management measures are generally good site practices and proper wate quality control / waste management measures to be implemented by the contractor for all work near stream courses. These measures include:	to minimize ecological	All works sites at LMH01 and MUP05 / during construction	Construction Contractor		4		Environmental Impact Assessme Ordinance
		<ul> <li>Construction activities should be restricted t works area that should be clearly demarcated</li> </ul>	>						

APA-44

-(\_)

٦

EM&A Ref	<b>Recommended Mitigation Measures</b>	Objectives of the Recommended Measures and Main	Location / Timing	Implementation		plement Stages	Relevant
- H - H - H - H - H - H - H - H	Excavation works should be carried out during the dry season where stream flow is low. Where adequate space is available, works should be carefully phased such that only one side of the channel is constructed. Temporary diversion should be provided to ensure continuous water flow to the downstream section. The proposed works site inside or in the proximity of natural streams should be temporarily isolated, such as using bunds or sandbag barriers (wrapped with geotextile fabric) or other similar techniques, to prevent adverse impacts on the stream water quality. For the stream section where the existing natural stream bed and bank will be left untouched, no disturbance to the stream bed and bank should be allowed from construction works, equipment or workers. If temporary access track on streambed is unavoidable, this should be kept to the minimum width and length. Temporary stream crossings should be supported on stilts above the stream bed. Adequate temporary drainage measures ncluding sediment and oil/grease traps hould be provided to prevent contaminated ite run-off entering the water bodies.	Measures and Main Concerns to addressed	Location / Timing	Implementation Agent	D		Relevant Legislation & Guidelines


 $\overline{}$ 


			Objectives of the Recommended	Location /	Implementation	Imp	lementat Stages*	ion	Relevant Legislation &
EIA Ref	EM&A Ref	Def	Measures and Main Concerns to addressed	Timing	Agent	D	C	0	Guidelines
		the water bodies during rain storms.							
		<ul> <li>Construction effluent, site run-off and sewage should be properly collected, treated and disposed.</li> <li>Supervisory staff of the contractor should be assigned to station on site to closely supervise and monitor the construction works. All workers should be regularly briefed to avoid disturbing the flora and fauna near the works area.</li> </ul>							
7.9.24	6.5.23	The contractor should provide details of the mitigation measures to be implemented during construction stage as part of their working method statement to the Engineer for approval. This should be reviewed by the Environmental Team Leader.	construction at LMH01 and MUP05	All works sites at LMH01 and MUP05 / during construction	Construction Contractor		7		Environmental Impact Assessmen Ordinance
						<u>t</u>			
Ecology	- Operatio	n Phase		1		1			
7.9.6	6.5.5	<i>LMH01</i> Very little or no management / maintenance of the completed sections of LMH01 are expected Removal of obstruction should be undertaken only when flooding or safety issues have been identified.	operation of LMH01	LMH01 / during operation stage	DSD (or DSD's maintenance contractor)				Environmental Impact Assessme Ordinance



# Appendix D

## **Environmental Monitoring Locations**

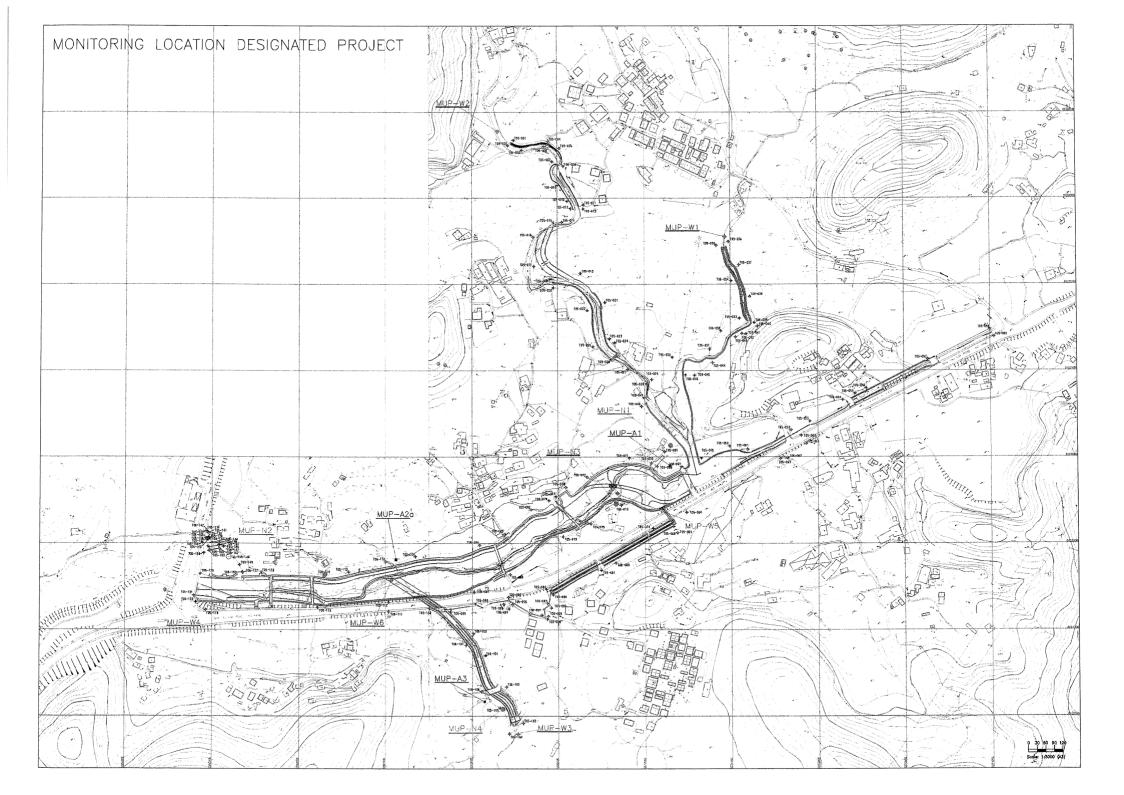

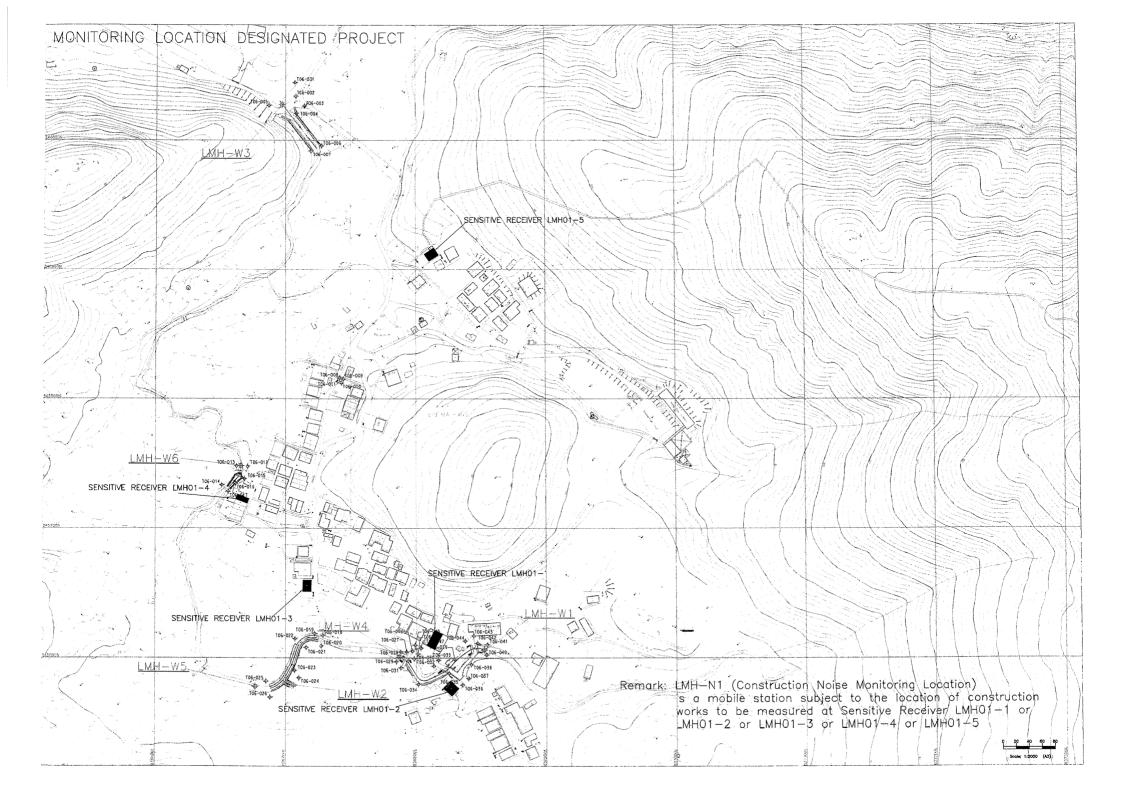



# Appendix E

# **Certificates of Calibration**



## **Equipment Calibration List**

Items	Aspect	Description of Equipment	Date of Calibration	Date of Next Calibration
1		TSP Sampler Calibration Spreadsheet for MUP-A1	13 Jul 12	13 Sep 12
2		TSP Sampler Calibration Spreadsheet for MUP-A2	7 Jul 12	7 Sep 12
3#	Air	TSP Sampler Calibration Spreadsheet for MUP-A3	30 Jun 11	30 Aug 11
4		DustTrak Model 8520 EQ064	13 Sep 2011	13 Sep 2012
5		AM510 11008017	10 Oct 2011	10 Oct 2012
6		Bruel & Kjaer Integrating Sound Level Meter EQ010 (Serial No. 2285721)	20 Apr 12	20 Apr 13
7	Noise	Bruel & Kjaer Integrating Sound Level Meter EQ082 (Serial No. 2713428)	20 Apr 12	20 Apr 13
8		NL-31 Rion Sound Level Meter EQ068 (Serial No. 00410247)	20 Apr 12	20 Apr 13
9		YSI Sonde 6820 / 650 MDS (Serial No. 02J0912/02K0788 AA) (DO, pH, Turbidity)	31 Apr 12	27 Jul 12
10*	Water	YSI Professional Plus (Serial No. 10G101946) (DO, pH)	16 Jul 12	16 Oct 12
11*		HACH 2100Q (Serial No. 11030C008499) (Turbidity)	13 Jul 12	13 Oct 12

\*Note: Calibration certificates will only be provided when monitoring equipment is re-calibrated or new. # Calibration could not conduct due to power failure.



# ALS Technichem (HK) Pty Ltd

# **REPORT OF EQUIPMENT PERFORMANCE CHECK/CALIBRATION**

CONTACT: MR RAY CHEUNG CLIENT: ACTION UNITED ENVIRO SERVICES ADDRESS: RM A 20/F., GOLDEN KING IND BLDG, NO. 35-41 TAI LIN PAI ROAD, KWAI CHUNG, N.T., HONG KONG. PROJECT: --

HK1218772
HONG KONG
16/07/2012
17/07/2012

## **COMMENTS**

It is certified that the item under calibration/checking has been calibrated/checked by corresponding calibrated equipment in the laboratory. Maximum Tolerance and calibration frequency stated in the report, unless otherwise stated, the internal aceptance criteria of ALS will be followed.

Scope of Test:	Dissolved Oxygen, pH, Salinity and Temperature
Description:	YSI Professional Plus
Brand Name:	YSI
Model No.:	YSI Professional Plus
Serial No.:	10G101946
Equipment No.:	
Date of Calibration:	16 July, 2012

## NOTES

This is the Final Report and supersedes any preliminary report with this batch number. Results apply to sample(s) as submitted. All pages of this report have been checked and approved for release.

## **ISSUING LABORATORY: HONG KONG**

#### Address

ALS Technichem (HK) Pty Ltd

11/F Chung Shun Knitting Centre 1-3 Wing Yip Street Kwai Chung HONG KONG 
 Phone:
 852-2610 1044

 Fax:
 852-2610 2021

 Email:
 hongkong@alsglobal.com

Mr Chan Kwok Fai, Godfrey

Laboratory Manager - Hong Kong

This report may not be reproduced except with prior written approval from ALS Technichem (HK) Pty Ltd.

Page 1 of 2

ADDRESS 11/F, Chung Shun Knitting Centre, 1-3 Wing Yip Street, Kwai Chung, N.T., Hong Kong PHONE +852 2610 1044 FAX +852 2610 2021 ALS TECHNICHEM (HK) PTY LTD Part of the ALS Laboratory Group A Campbell Brothers Limited Company

Environmental 았

www.alsglobal.com

**RIGHT SOLUTIONS RIGHT PARTNER** 

## **REPORT OF EQUIPMENT PERFORMANCE CHECK/CALIBRATION**

Work Order:	HK1218772
Amendment:	1
Date of Issue:	17/07/2012
Client:	ACTION UNITED ENVIRO SERVICES



Description:	YSI Professional Plus
Brand Name:	YSI
Model No.:	YSI Professional Plus
Serial No.:	10G101946
Equipment No.:	
Date of Calibration:	16 July, 2012

Date of next Calibration:

16 October, 2012

## Parameters:

## Dissolved Oxygen Method Ref: APHA (21st edition), 4500O: G

Expected Reading (mg/L)	Displayed Reading (mg/L)	Tolerance (mg/L)
1.82	1.79	-0.03
4.15	4.15	0.00
7.85	7.90	0.05
	Tolerance Limit (±mg/L)	0.20

pH Value

## Method Ref: APHA (21st edition), 4500H:B

Expected Reading (pH Unit)	Displayed Reading (pH Unit)	Tolerance (pH unit)	
10	4.06	0.06	
4.0 7.0	7.05	0.00	
10.0	10.06	0.06	
	Tolerance Limit (±unit)	0.20	

Salinity

## Method Ref: APHA (21st edition), 2520B

Expected Reading (g/L)	Displayed Reading (g/L)	Tolerance (%)	
0	0.00		
10	9.57	-4.3	
20	18.93	-5.4	
30	29.74	-0.9	
	Tolerance Limit (±%)	10.0	

#### Temperature

# Method Ref: Section 6 of International Accreditation New Zealand Technical

# Guide No. 3 Second edition March 2008: Working Thermometer Calibration Procedure.Reading of Ref. thermometer (°C )Displayed Reading (°C )Tolerance (°C )9.59.2-0.322.021.6-0.440.540.3-0.2Tolerance Limit (°C)

Mr Chan Kwok Fai, Godfrey Laboratory Manager - Hong Kong

ALS Technichem (HK) Pty Ltd ALS Environmental



# ALS Technichem (HK) Pty Ltd

# REPORT OF EQUIPMENT PERFORMANCE CHECK/CALIBRATION

CONTACT: MR RAY CHEUNG CLIENT: ACTION UNITED ENVIRO SERVICES ADDRESS: RM A 20/F., GOLDEN KING IND BLDG, NO. 35-41 TAI LIN PAI ROAD, KWAI CHUNG. N.T., HONG KONG. PROIECT: ---

HK1218502
HONG KONG
12/07/2012
17/07/2012

## **COMMENTS**

It is certified that the item under calibration/checking has been calibrated/checked by corresponding calibrated equipment in the laboratory. Maximum Tolerance and calibration frequency stated in the report, unless otherwise stated, the internal aceptance criteria of ALS will be followed.

Scope of Test:	Turbidity
Description:	Turbidimeter
Brand Name:	HACH
Model No.:	2100Q
Serial No.:	11030C008499
Equipment No.:	
Date of Calibration:	13 July, 2012

## NOTES

This is the Final Report and supersedes any preliminary report with this batch number. Results apply to sample(s) as submitted. All pages of this report have been checked and approved for release.

## **ISSUING LABORATORY: HONG KONG**

Address

ALS Technichem (HK) Pty Ltd

11/F Chung Shun Knitting Centre 1-3 Wing Yip Street Kwai Chung HONG KONG

Phone: Fax: Email:

852-2610 1044 852-2610 2021 hongkong@alsglobal.com

Mr Chan Kwok Fai, Godfrey Laboratory Manager – Hong Kong

This report may not be reproduced except with prior written approval from ALS Technichem (HK) Pty Ltd.

Page 1 of 2

ADDRESS 11/F, Chung Shun Knitting Centre, 1-3 Wing Yip Street, Kwai Chung, N.T., Hong Kong PHONE +852 2610 1044 FAX +852 2610 2021 ALS TECHNICHEM (HK) PTY LTD Part of the ALS Laboratory Group A Campbell Brothers Limited Company

Environmental 🕽

www.alsglobal.com

**RIGHT SOLUTIONS RIGHT PARTNER** 

## **REPORT OF EQUIPMENT PERFORMANCE CHECK/CALIBRATION**

Work Order: Date of Issue: Client:

Description:

HK1218502 17/07/2012 ACTION UNITED ENVIRO SERVICES

Turbidimeter



Brand Name: Model No.: Serial No.: Equipment No.: Date of Calibration:	HACH 2100Q 11030C008499  13 July, 2012	Date of next Calibration:	13 October, 2012
Parameters:			
Turbidity	Method Ref: ALPHA 21st Ed.	2130B	
	Expected Reading (NTU)	Displayed Reading (NTU)	Tolerance (%)
	0	0.23	
	4	4.36	9.00
	40	37.9	-5.25
	80	75.3	-5.88
	400	386	-3.50
	800	790	-1.25

Mr Chan Kwok Fail Godfrey Laboratory Manager - Hong Kong

ALS Technichem (HK) Pty Ltd ALS Environmental



# Appendix F

# **Details of the Event Action Plan**

## **Event/Action Plan for Air Quality**

	ACTION				
EVENT	ET Leader	IEC	ER	Contractor	
ACTION LEVEL					
Exceedance for one sample	<ol> <li>Identify source</li> <li>Inform IEC, ER and Contractor</li> <li>Repeat measurement to confirm findings</li> <li>Increase monitoring frequency to daily</li> </ol>	<ol> <li>Check monitoring data submitted by ET Leader</li> <li>Check Contractor's working method</li> </ol>	1. Notify Contractor	<ol> <li>Rectify any unacceptable practice</li> <li>Amend working methods if appropriate</li> </ol>	
Exceedance for two or more consecutive samples	<ol> <li>Identify source</li> <li>Inform IEC, ER and Contractor</li> <li>Repeat measurement to confirm findings</li> <li>Increase monitoring frequency to daily</li> <li>Discuss with IEC, Contractor and ER on remedial actions required</li> <li>If exceedance continue, arrange meeting with IEC, ER and Contractor</li> <li>If exceedance stops, cease additional monitoring</li> </ol>	<ol> <li>Check monitoring data submitted by ET Leader</li> <li>Check Contractor's working method</li> <li>Discuss with ET Leader and Contractor on possible remedial measures</li> <li>Advise the ER on the effectiveness of the proposed remedial measures</li> <li>Supervise implementation of remedial measures</li> </ol>	<ol> <li>Confirm receipt of notification of failure in writing</li> <li>Notify Contractor</li> <li>Ensure remedial measure properly implemented</li> </ol>	<ol> <li>Submit proposals for remedial actions to IEC and ER within 3 working days notification</li> <li>Implement the agreed proposals</li> <li>Amend proposal if apprpriate</li> </ol>	
LIMIT LEVEL					
Exceedance for one sample	<ol> <li>Identify source</li> <li>Inform IEC, ER, EPD and Contractor</li> <li>Repeat measurement to confirm findings</li> <li>Increase monitoring frequency to daily</li> <li>Access effectiveness of Contractor's remedial actions and kept IEC, EPD and ER informed of results</li> </ol>	<ol> <li>Check monitoring data submitted by ET Leader</li> <li>Check Contractor's working method</li> <li>Discuss with ET Leader and Contractor on possible remedial measures</li> <li>Advise the ER on the effectiveness of the proposed remedial measures</li> <li>Audit implementation of remedial measures</li> </ol>	<ol> <li>Confirm receipt of notification of failure in writing</li> <li>Notify Contractor</li> <li>Ensure remedial measures properly implemented</li> </ol>	<ol> <li>Take immediate action to avoid for the exceedance</li> <li>Submit proposals for remedial actions to IEC and ER within 3 working days of notification</li> <li>Implement the agreed proposals</li> <li>Amend proposal if appropriate</li> </ol>	
Exceedance for two or more consecutive samples	<ol> <li>Notify IEC, ER, Contractor and EPD</li> <li>Identify source</li> <li>Repeat measurement to confirm findings</li> <li>Increase monitoring frequency to daily</li> <li>Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented</li> <li>Arrange meeting with IEC, Contractor and ER to discuss the remedial actions to be taken</li> <li>Access effectiveness of Contractor's remedial actions and kept IEC, EPD and ER informed of results</li> <li>If exceedance stops, cease additional monitoring</li> </ol>	<ol> <li>Discuss amongst ER, ET Leader and Contractor on the potential remedial actions</li> <li>Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly</li> <li>Audit the implementation of remedial measures</li> </ol>	<ol> <li>Confirm receipt of notification of failure in writing</li> <li>Notify Contractor</li> <li>In consultation with IEC, agree with the Contractor on the remedial measures to be implemented</li> <li>Ensure remedial measures properly implemented</li> <li>If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated.</li> </ol>	<ol> <li>Take immediate action to avoid for the exceedance</li> <li>Submit proposals for remedial actions to IEC and ER within 3 working days of notification</li> <li>Implement the agreed proposals</li> <li>Resubmit proposals if problem still not under control</li> <li>Stop the relevant portion of works as determined by the ER unit the exceedance is abate</li> </ol>	

## **Event/Action Plan for Water Quality**

EVENT	ET Leader	IEC	ER	Contractor
Action Level being exceeded by one sampling day	<ol> <li>Repeat in-situ measurement to confirm findings</li> <li>Identify source(s) of impact</li> <li>Inform IEC and Contractor</li> <li>Check monitoring data, all plant, equipment and Contractor's working methods</li> <li>Discuss mitigation measures with IEC and Contractor</li> <li>Repeat measurement on next day of exceedance</li> </ol>	<ol> <li>Discuss with ET and Contractor on the mitigation measures</li> <li>Review proposals on mitigation measures submitted by Contractor and advise the ER accordingly</li> <li>Assess the effectiveness of the implemented mitigation measures</li> </ol>	<ol> <li>Discuss with IEC on the proposed mitigation measures</li> <li>Make agreement on the mitigation measures to be implemented</li> <li>Assess effectiveness of the implemented mitigation measures</li> </ol>	<ol> <li>Inform the ER and confirm notification of the non-compliance in writing</li> <li>Rectify unacceptable practice</li> <li>Check all plant and equipment</li> <li>Consider changes of working methods</li> <li>Discuss with ET and IEC and propose mitigation measures to IEC and ER</li> <li>Implement the agreed mitigation measures</li> </ol>
Action Level being exceeded by more than one consecutive sampling day	<ol> <li>Repeat in-situ measurement to confirm findings</li> <li>Identify source(s) of impact</li> <li>Inform IEC and Contractor</li> <li>Check monitoring data, all plant, equipment and Contractor's working methods</li> <li>Discuss mitigation measures with IEC and Contractor</li> <li>Ensure mitigation measures are implemented</li> <li>Prepare to increase the monitoring frequency to daily</li> <li>Repeat measurement on next day of exceedance</li> </ol>	<ol> <li>Discuss with ET and Contractor on the mitigation measures</li> <li>Review proposals on mitigation measures submitted by Contractor and advise the ER accordingly</li> <li>Assess the effectiveness of the implemented mitigation measures</li> </ol>	<ol> <li>Discuss with IEC on the proposed mitigation measures</li> <li>Make agreement on the mitigation measures to be implemented</li> <li>Assess effectiveness of the implemented mitigation measures</li> </ol>	<ol> <li>Inform the ER and confirm notification of the non-compliance in writing</li> <li>Rectify unacceptable practice</li> <li>Check all plant and equipment</li> <li>Consider changes of working methods</li> <li>Discuss with ET and IEC and propose mitigation measures to IEC and ER within 3 working days</li> <li>Implement the agreed mitigation measures</li> </ol>
Limit Level being exceeded by one sampling day	<ol> <li>Repeat in-situ measurement to confirm findings</li> <li>Identify source(s) of impact</li> <li>Inform IEC, Contractor and EPD</li> <li>Check monitoring data, all plant, equipment and Contractor's working methods</li> <li>Discuss mitigation measures with IEC, ER and Contractor</li> <li>Ensure mitigation measures are implemented</li> <li>Increase the monitoring frequency to daily until no exceedance of Limit Level</li> </ol>	<ol> <li>Discuss with ET and Contractor on the mitigation measures</li> <li>Review proposals on mitigation measures submitted by Contractor and advise the ER accordingly</li> <li>Assess the effectiveness of the implemented mitigation measures</li> </ol>	<ol> <li>Discuss with IEC on the proposed mitigation measures</li> <li>Request Contractor to critically review the working methods</li> <li>Make agreement on the mitigation measures to be implemented</li> <li>Assess effectiveness of the implemented mitigation measures</li> </ol>	<ol> <li>Inform the ER and confirm notification of the non-compliance in writing</li> <li>Rectify unacceptable practice</li> <li>Check all plant and equipment</li> <li>Consider changes of working methods</li> <li>Discuss with ET and IEC and propose mitigation measures to IEC and ER within 3 working days</li> <li>Implement the agreed mitigation measures</li> </ol>
Limit Level being exceeded by more than one consecutive sampling day	<ol> <li>Repeat in-situ measurement to confirm findings</li> <li>Identify source(s) of impact</li> <li>Inform IEC, Contractor and EPD</li> <li>Check monitoring data, all plant, equipment and Contractor's working methods</li> <li>Discuss mitigation measures with IEC, ER and Contractor</li> <li>Ensure mitigation measures are implemented</li> <li>Increase the monitoring frequency to daily until no exceedance of Limit Level for two consecutive days</li> </ol>	<ol> <li>Discuss with ET and Contractor on the mitigation measures</li> <li>Review proposals on mitigation measures submitted by Contractor and advise the ER accordingly</li> <li>Assess the effectiveness of the implemented mitigation measures</li> </ol>	<ol> <li>Discuss with IEC on the proposed mitigation measures</li> <li>Request Contractor to critically review the working methods</li> <li>Make agreement on the mitigation measures to be implemented</li> <li>Assess effectiveness of the implemented mitigation measures</li> <li>Consider and instruct, if necessary, the Contractor to slow down or to stop all or part of the work until no exceedance of Limit Level</li> </ol>	<ol> <li>Inform the ER and confirm notification of the non-compliance in writing</li> <li>Rectify unacceptable practice</li> <li>Check all plant and equipment</li> <li>Consider changes of working methods</li> <li>Discuss with ET and IEC and propose mitigation measures to IEC and ER within 3 working days</li> <li>Implement the agreed mitigation measures</li> <li>As directed by the ER, to slow down or to stop all or part of the work or construction activities</li> </ol>

## **Event/Action Plan for Ecology**

EVENT	ACTION				
	ET Leader	IEC	ER	Contractor	
Non-conformity on one occasion	<ol> <li>Identify source</li> <li>Inform the IEC and ER</li> <li>Discuss remedial actions with IEC, the ER and the Contractor</li> <li>Monitor remedial actions until rectification has been completed</li> </ol>	<ol> <li>Check monitoring results</li> <li>Check the Contractor's working method</li> <li>Discuss with the ET and Contractor on possible remedial measures</li> <li>Advise the ER on effectiveness of proposed remedial measures</li> <li>Check the implementation of remedial measures</li> </ol>	<ol> <li>Notify Contractor</li> <li>Ensure remedial measures are properly implemented</li> <li>Consider and instruct, if necessary, the Contractor to slow down or to stop all or part of the works in the case of serous non-conformity until situation is rectified</li> </ol>	<ol> <li>Take immediate action to avoid further problem</li> <li>Amend working methods if needed</li> <li>Submit proposals for remedial actions to ET, ER and IEC</li> <li>Rectify damage and implement the agreed remedial actions</li> </ol>	
Repeated Non-confirmity	<ol> <li>Identify source</li> <li>Inform the IEC, ER, EPD and AFCD</li> <li>Increase monitoring frequency</li> <li>Discuss remedial actions with IEC, the ER and the Contractor</li> <li>Monitor remedial actions until rectification has been completed</li> <li>If exceedance stops, cease additional monitoring</li> </ol>	<ol> <li>Check monitoring results</li> <li>Check the Contractor's working method</li> <li>Discuss with the ET and Contractor on possible remedial measures</li> <li>Supervise the implementation of remedial measures</li> <li>Advise the ER on effectiveness of proposed remedial measures and keep EPD and AFCD informed</li> </ol>	<ol> <li>Notify Contractor</li> <li>Ensure remedial measures are properly implemented</li> <li>Consider and instruct, if necessary, the Contractor to slow down or to stop all or part of the works in the case of serous non-conformity until situation is rectified</li> </ol>	<ol> <li>Take immediate action to avoid further problem</li> <li>Amend working methods if needed</li> <li>Submit proposals for remedial actions to ET, ER and IEC</li> <li>Rectify damage and implement the agreed remedial actions</li> </ol>	

## **Event/Action Plan for Landscape and Visual Impact**

EVENT	ACTION				
EVENI	ET Leader	IEC	ER	Contractor	
Non-conformity on one occasion	<ol> <li>Identify source</li> <li>Inform the IEC and the ER</li> <li>Discuss remedial actions with IEC, the ER and the Contractor</li> <li>Monitor remedial actions until rectification has been completed</li> </ol>	<ol> <li>Check report</li> <li>Check the Contractor's working method</li> <li>Discuss with the ET and Contractor on possible remedial measures</li> <li>Advise the ER on effectiveness of proposed remedial measures</li> </ol>	<ol> <li>Notify the Contractor</li> <li>Ensure remedial measures are properly implemented.</li> </ol>	<ol> <li>Amend working methods if needed</li> <li>Rectify damage and undertake remedial measures or any necessary replacement</li> </ol>	
Repeated Non-conformity	<ol> <li>Identify source</li> <li>Inform the IEC, ER, EPD and AFCD</li> <li>Increase monitoring (site audit) frequency</li> <li>Discuss remedial actions with IEC, the ER and the Contractor</li> <li>Monitor remedial actions until rectification has been completed</li> <li>If exceedance stops, cease additional monitoring (site audit)</li> </ol>	<ol> <li>Check report</li> <li>Check the Contractor's working method</li> <li>Discuss with the ET and Contractor on possible remedial measures</li> <li>Advise the ER on effectiveness of proposed remedial measures.</li> <li>Supervise the implementation of remedial measures</li> </ol>	<ol> <li>Notify Contractor</li> <li>Ensure remedial measures are properly implemented</li> </ol>	<ol> <li>Amend working methods if needed</li> <li>Rectify damage and undertake remedial measures or any necessary replacement</li> </ol>	

<b>Event/Action</b>	Plan	for	Construction	Noise
---------------------	------	-----	--------------	-------

		Action		
EVENT Action Level	ET Leader 1. Notify IEC, Contractor and ER 2. Carry out investigation and identify source 3. Report the results of investigation to IEC, Contractor and ER 4. Discuss with the Contractor and formulate remedial measures 5. Increase monitoring frequency 6. Check compliance to Action/limit Levels after application of mitigation measures	IEC           IEC           1.         Review the analysed results submitted by the ET Leader           2.         Review the proposed remedial measures by the Contractor and advise the ER & ER accordingly           3.         Review the implementation of remedial measures	ER           1.         Confirm receipt of notification of complaint in writing           2.         Notify Contractor           3.         Check monitoring data submitted by the ET           4.         Require Contractor to propose remedial measures for the analysed noise problem           5.         Ensure remedial measures are properly implemented	Contractor1.Submit noise mitigation proposals to ER and IEC within three working days2.Liaise with the ER to ensure the effectiveness of the agreed mitigation3.Amend proposal if required4.Implement noise mitigation proposals
Limit Level	<ol> <li>Notify IEC, Contractor and ER</li> <li>Identify source</li> <li>Repeat measurement to confirm findings</li> <li>Increase monitoring frequency</li> <li>Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented</li> <li>Inform IEC, ER and EPD the causes &amp; actions taken form the exceedances</li> <li>Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results</li> <li>If exceedance stops, cease additional monitoring</li> </ol>	<ol> <li>Check monitoring data submitted by ET</li> <li>Discuss amongst ER, ET Leader and Contractor on the potential remedial actions</li> <li>Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ER &amp; ET accordingly</li> <li>Audit the implementation of remedial measures</li> </ol>	<ol> <li>Confirm receipt of notification of exceedance</li> <li>Notify Contractor</li> <li>Check monitoring data submitted by the ET</li> <li>Require Contractor to propose remedial measures for the analysed noise problem</li> <li>Discuss with ET, IEC and Contractor on proposed remedial actions to be implemented</li> <li>Ensure remedial measures are properly implemented</li> <li>Assess the effectiveness of the remedial actions and keep the Contractor informed</li> <li>If exceedance continues, consider what protion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated</li> </ol>	<ol> <li>Take immediate action to avoid further exceedance</li> <li>Submit proposals for remedial actions to ER within three working days of notification</li> <li>Liaise with the ER to ensure the effectiveness of the agreed mitigation</li> <li>Amend proposal if required</li> <li>Implement the agreed proposals</li> <li>Resubmit proposals if problem still not under control</li> <li>Stop the relevant portion of works as determined by the ER until the exceedance is abated</li> </ol>



Appendix G

**Monitoring Schedule** 



	Date	Air Qu	uality	Noise Leq		Ec	ology
		1-hour TSP	24-hour TSP	30min	Water Quality	Water Quality	Ecology Surveys
Thu	26-July-12						
Fri	27-July-12						
Sat	28-July-12						
Sun	29-July-12						
Mon	30-July-12						
Tue	31-July-12						
Wed	1-Aug-12						
Thu	2-Aug-12						
Fri	3-Aug-12						
Sat	4-Aug-12						
Sun	5-Aug-12						
Mon	6-Aug-12						
Tue	7-Aug-12						
Wed	8-Aug-12						
Thu	9-Aug-12						
Fri	10-Aug-12						
Sat	11-Aug-12						
Sun	12-Aug-12						
Mon	13-Aug-12						
Tue	14-Aug-12						
Wed	15-Aug-12						
Thu	16-Aug-12						
Fri	17-Aug-12						
Sat	18-Aug-12						
Sun	19-Aug-12						
Mon	20-Aug-12						
Tue	21-Aug-12						
Wed	22-Aug-12						
Thu	23-Aug-12						
Fri	24-Aug-12						
Sat	25-Aug-12						

## Monitoring Schedule for Channels MUP in this Reporting Month

Monitoring Day
Sunday or Public Holiday

## Parameters:

Air Noise Water

Ecology Survey

## Location ID

MUP-A1 (Same as MUP01/02-A1), MUP-A2a, MUP-A3, MUP05-N1 (Same as MUP01/02-N1), MUP-N2, MUP-N3, MUP-N4, MUP-W1 (Same as MUP01/02-W1), MUP-W2 (Same as MUP01/02-W2), MUP-W3, MUP-W4, MUP-W5, MUP-W6 As location in MUP05



	Date	Air Q	Air Quality Noise Leq 30min Water Q			Ec	ology
		1-hour TSP	24-hour TSP	30min	Water Quality	Water Quality	Ecology Surveys
Sun	26-Aug-12						
Mon	27-Aug-12						
Tue	28-Aug-12						
Wed	29-Aug-12						
Thu	30-Aug-12						
Fri	31-Aug-12						
Sat	1-Sep-12						
Sun	2-Sep-12						
Mon	3-Sep-12						
Tue	4-Sep-12						
Wed	5-Sep-12						
Thu	6-Sep-12						
Fri	7-Sep-12						
Sat	8-Sep-12						
Sun	9-Sep-12						
Mon	10-Sep-12						
Tue	11-Sep-12						
Wed	12-Sep-12						
Thu	13-Sep-12						
Fri	14-Sep-12						
Sat	15-Sep-12						
Sun	16-Sep-12						
Mon	17-Sep-12						
Tue	18-Sep-12						
Wed	19-Sep-12						
Thu	20-Sep-12						
Fri	21-Sep-12						
Sat	22-Sep-12						
Sun	23-Sep-12						
Mon	24-Sep-12						
Tue	25-Sep-12						

## Monitoring Schedule for Channels MUP in coming month

Monitoring Day
Sunday or Public Holiday

### Parameters:

Air Noise Water

**Ecology Survey** 

## Location ID

MUP-A1 (Same as MUP01/02-A1), MUP-A2a, MUP-A3, MUP05-N1 (Same as MUP01/02-N1), MUP-N2, MUP-N3, MUP-N4, MUP-W1 (Same as MUP01/02-W1), MUP-W2 (Same as MUP01/02-W2), MUP-W3, MUP-W4, MUP-W5, MUP-W6 As location in MUP05



# **Appendix H**

Detailed Impact Monitoring Data of Air Quality and Water Quality

#### DSD CONTRACT NO. DC/2007/08 Drainage Improvements Works in Tai Po Tin, Ping Che, Man Uk Pin and Lin Ma Hang 24- hour TSP Monitoring Data

										STANDARD		BLANK	BLANK	BLANK	BLANK	INITIAL	FINAL	WEIGHT			
DATE	SAMPLE	ELAPSED	ELAPSED	ELAPSED	MIN	MAX	AVG	AVG	AVG	FLOW	AIR	SAMPLE	INTIAL	FINAL	DIFF	FILTER	FILTER	DUST	Dust 24-hr TSP in Air		
	NUMBER	TIME	TIME	TIME	CHART	CHART	CHART	TEMP	PRESS	RATE	VOLUME	NUMBER	WEIGHT	WEIGHT	WEIGHT	WEIGHT	WEIGHT	COLLECTED	in Air		
		INITIAL	FINAL	(min)	READING	READING	READING	(oC)	(hPa)	(m3/min)	(std m3)		(g)	(g)	(g)	(g)	(g)	(g)	(ug/m3)	Action Level	Limit Level
24-hour TSP	Monitoring Da	ita for MUP-A1	(same as ML	JP01/02-A1)																	
30-Jul-12	24939	3898.57	3923.69	1507.20	35	38	36.5	29.4	1001.2	1.3966	2104.93	NA	2.7090	2.7090	0.001	2.7958	2.8132	0.0174	8	156	260
4-Aug-12	24942	3923.69	3949.51	1549.20	38	39	38.5	28.6	1004.6	1.4557	2255.22	NA	3.5720	3.5720	0.001	2.7765	2.9544	0.1779	78	156	260
10-Aug-12	24954	3949.51	3974.57	1503.60	37	39	38	28.7	1004.6	1.4415	2167.50	NA	2.6464	2.6464	0.001	2.6464	2.8681	0.2217	102	156	260
16-Aug-12	24906	3974.57	3998.64	1444.20	32	36	34	28.6	1001.5	1.3281	1918.07	NA	2.7679	2.7679	0.001	2.7679	2.8165	0.0486	25	156	260
22-Aug-12	24908	3998.64	4023.43	1487.40	37	39	38	28	1006.3	1.4437	2147.33	NA	2.7935	2.8539	0.001	2.8122	2.9556	0.1434	65	156	260
24-hour TSP	Monitoring Da	ita for MUP-A2	2a																		
30-Jul-12	24879	1806.76	1832.34	1534.80	37	39	38	29.4	1001.2	1.3390	2055.08	NA	2.709	2.709	0.001	2.742	2.8561	0.1141	55	149	260
4-Aug-12	24943	1832.34	1856.16	1429.20	38	39	38.5	28.6	1004.6	1.3538	1934.84	NA	3.572	3.572	0.001	2.7792	2.9444	0.1652	85	149	260
10-Aug-12	24953	1856.16	1881.36	1512.00	37	39	38	28.7	1004.6	1.3416	2028.49	NA	2.6464	2.6464	0.001	2.7613	2.9382	0.1769	87	149	260
16-Aug-12	24905	1881.36	1905.51	1449.00	34	37	35.5	28.6	1001.5	1.2802	1854.99	NA	2.7679	2.7679	0.001	2.7705	2.8866	0.1161	62	149	260
22-Aug-12	power failure																		power failure	149	260
24-hour TSP	Monitoring Da	ita for MUP-A3	3																		
30-Jul-12	power failure																		power failure	150	260
4-Aug-12	power failure																		power failure	150	260
10-Aug-12	power failure																		power failure	150	260
16-Aug-12	power failure																		power failure	150	260
22-Aug-12	power failure																		power failure	150	260

## AUES

#### DSD CONTRACT NO. DC/2007/08 Drainage Improvements Works in Tai Po Tin, Ping Che, Man Uk Pin and Lin Ma Hang Water Quality Monitoring Data for MUP05

Date	27-	Jul-12			•		-							
Location	Time	Depth (m)	Tem	(0C)	DO (r	ng/L)	DOS	6(%)	Turbidit	ty(NTU)	р	н	S	s
MUP-W1 (Control) (MUP01/02-W1)	3:10	0.1	28.1	28.1	3.16	3.4	43.60	44.7	14.70	16.4	6.59	6.8	17.00	17.0
(MUP-W2 (Control)			28.1 30.8		3.68 5.80		45.70 50.60		18.10 5.75		7.01 7.08		17.00 18.00	
(MUP01/02-W2)	2:05	0.3	30.8	30.8	5.62	5.7	55.70	53.2	6.08	5.9	7.11	7.1	18.00	18.0
MUP-W3 (Control)	2:45	0.1	29.2	29.2	3.26	3.3	58.90	60.0	63.30	64.6	7.20	7.2	17.00	17.0
			29.2 29.5		3.38 5.68		61.00 48.30		65.80 15.20		7.13		17.00 16.00	
MUP-W4 (Impact)	2:25	0.4	29.5	29.5	5.87	5.8	52.40	50.4	13.80	14.5	7.31	7.3	16.00	16.0
MUP-W5 (mobile)	2:52	0.3	29.5	29.5	5.73	5.7	52.50	54.6	5.42	5.7	7.41	7.5	15.00	15.0
			29.5 28.9		5.66 4.67		56.60 39.80		5.97 21.50		7.56 6.73		15.00 15.00	
MUP-W6 (mobile)	2:35	0.2	28.9	28.9	4.83	4.8	42.90	41.4	24.60	23.1	7.08	6.9	15.00	15.0
Date	30- Time	Jul-12 Depth (m)	Tem	)(0C)	D0 (r	ma/l)	DOS	5(%)	Turbidit		p	н	S	s
MUP-W1 (Control)			30.5	<u> </u>	3.07		40.60		9.09		6.80		10.00	
(MUP01/02-W1)	2:55	0.1	30.5	30.5	3.12	3.1	41.40	41.0	9.17	9.1	6.91	6.9	10.00	10.0
MUP-W2 (Control) (MUP01/02-W2)	1:45	0.3	33.0 33.0	33.0	3.99	4.0	56.50 54.60	55.6	11.20	11.0	7.01	7.1	9.00	9.0
MUP-W3 (Control)	2:22	0.2	32.5	32.5	3.99	3.9	63.70	63.3	10.40	10.7	7.26	7.3	5.00	5.0
MOP-W3 (control)	2.22	0.2	32.5	32.5	3.86	3.7	62.80	03.5	10.90	10.7	7.33	7.5	5.00	3.0
MUP-W4 (Impact)	2:05	0.3	31.3 31.3	31.3	5.33 5.38	5.4	52.70 54.20	53.5	17.30 16.70	17.0	7.15	7.2	4.00	4.0
MUP-W5 (mobile)	2:30	0.5	31.5	31.5	5.02	5.1	48.30	49.0	5.30	5.3	7.18	7.2	5.00	5.0
wor-ws (mobile)	2.50	0.5	31.5	51.5	5.11	3.1	49.60	47.0	5.34	5.5	7.17	1.2	5.00	3.0
MUP-W6 (mobile)	2:15	0.3	32.0 32.0	32.0	5.43 5.37	5.4	49.70 49.20	49.5	9.21 9.38	9.3	7.06	7.1	3.00	3.0
Date		ug-12 Donth (m)	-					. (9/ )	<b>T</b>					
Location MUP-W1 (Control)	Time	Depth (m)	30.5		DO (r 3.54		45.70	6(%)	Turbidit 16.20		6.82		4.00	
(MUP01/02-W1)	3:00	0.1	30.5	30.5	3.48	3.5	42.60	44.2	15.30	15.8	6.91	6.9	4.00	4.0
MUP-W2 (Control) (MUP01/02-W2)	1:45	0.3	30.5	30.5	3.44	3.5	53.10	54.4	4.68	5.3	7.23	7.3	3.00	3.0
			30.5 31.0		3.52 3.97		55.60 58.10		5.85 56.50		7.31	-	3.00 5.00	
MUP-W3 (Control)	2:30	0.2	31.0	31.0	3.86	3.9	54.10	56.1	50.50	53.5	7.16	7.3	5.00	5.0
MUP-W4 (Impact)	2:10	0.3	30.3 30.3	30.3	6.22 6.33	6.3	69.70 68.40	69.1	5.60 5.33	5.5	7.08	7.1	2.00	2.0
	2.40		30.3	22.5	4.85		55.90		4.25		7.28	7.0	3.00	2.0
MUP-W5 (mobile)	2:40	0.4	31.5	31.5	4.77	4.8	58.90	57.4	3.95	4.1	7.36	7.3	3.00	3.0
MUP-W6 (mobile)	2:20	0.2	30.5 30.5	30.5	5.30 5.38	5.3	52.60 53.90	53.3	7.14 7.18	7.2	6.83 6.99	6.9	2.00	2.0
										L		<u> </u>		
Date		ug-12	-	(							1			
Location MUP-W1 (Control)	Time	Depth (m)	Tem 31.0		4.70 DO (r		47.30	6(%)	Turbidit 15.50		6.80		4.00	
(MUP01/02-W1)	3:20	0.1	31.0	31.0	4.08	4.4	49.60	48.5	16.30	15.9	6.91	6.9	4.00	4.0
MUP-W2 (Control) (MUP01/02-W2)	2:05	0.3	32.3	32.3	5.48	5.4	53.60	54.7	4.84	4.9	7.07	7.1	3.00	3.0
			32.3 31.0		5.37 3.96		55.70 60.80		4.95 40.00		7.11 7.23		3.00 4.00	
MUP-W3 (Control)	2:50	0.1	31.0	31.0	3.77	3.9	59.70	60.3	41.20	40.6	7.33	7.3	4.00	4.0
MUP-W4 (Impact)	2:30	0.3	31.2	31.2	5.87	5.8	52.70	53.3	6.07	6.2	7.16	7.2	4.00	4.0
			31.2 32.0		5.81 4.50		53.80 59.70		6.24 7.01		7.19		4.00	
MUP-W5 (mobile)	3:00	0.4	32.0	32.0	4.65	4.6	58.40	59.1	6.88	6.9	7.21	7.2	4.00	4.0
MUP-W6 (mobile)	2:40	0.2	31.1 31.1	31.1	5.57 5.62	5.6	52.90 55.70	54.3	8.43 8.56	8.5	6.76	6.8	3.00	3.0
			51.1		5.62		55.75		0.00		0.00	<u> </u>	5.00	
Date		ug-12 Depth (m)	<b>T</b>	(-0)	<b>DO</b> (			6(%)	Track Late		-		s	c
Location MUP-W1 (Control)	Time		24.8	<u> </u>	DO (r 4.08	-	58.50		Turbidit 16.40		7.18		<2	
(MUP01/02-W1)	12:20	0.2	24.8	24.8	4.12	4.1	59.60	59.1	17.20	16.8	7.12	7.2	<2	2.0
MUP-W2 (Control) (MUP01/02-W2)	11:05	0.3	24.1 24.1	24.1	4.22	4.5	59.70 58.80	59.3	13.60 14.20	13.9	7.08	7.1	<2 <2	2.0
			24.1		3.94		60.30		10.40		7.13		<2	
MUP-W3 (Control)	11:50	0.1	24.6	24.6	3.77	3.9	60.80	60.6	11.10	10.8	7.13	7.2	<2	2.0
MUP-W4 (Impact)	11:30	0.3	24.3 24.3	24.3	6.31 6.43	6.4	62.10 63.30	62.7	7.94 8.11	8.0	7.21	7.3	<2	2.0
	10.00		23.6	22.4	4.98		56.40	57.4	6.18	( )	7.16	7.0	<2	2.0
MUP-W5 (mobile)	12:00	0.4	23.6	23.6	4.87	4.9	57.70	57.1	6.21	6.2	7.19	7.2	<2	2.0
MUP-W6 (mobile)	11:40	0.2	23.8 23.8	23.8	5.86 5.79	5.8	60.30 62.60	61.5	9.33 9.28	9.3	7.01 6.98	7.0	3.00	3.0
·								·	· · · · · ·					
Date	8-A Time	ug-12 Depth (m)	Tem	2(0C)	D0 (r	ng/L)	DOS	6(%)	Turbidit			н	S	s
MUP-W1 (Control)			29.5		3.68		43.60		5.28		7.13		3.00	
(MUP01/02-W1)	2:50	0.1	29.5	29.5	3.44	3.6	44.30	44.0	5.37	5.3	7.08	7.1	3.00	3.0
MUP-W2 (Control) (MUP01/02-W2)	1:45	0.4	33.0 33.0	33.0	4.56 4.28	4.4	62.30 60.30	61.3	5.97 5.86	5.9	6.87 6.99	6.9	3.00	3.0
MUP-W3 (Control)	2:25	0.2	31.0	31.0	3.98	4.0	60.30	60.0	6.04	6.1	7.14	7.1	<2	2.0
			31.0 31.5		4.03 5.36		59.60 58.60		6.11 8.87		7.08 6.99		<2 2.00	
MUP-W4 (Impact)	2:10	0.3	31.5	31.5	5.48	5.4	60.10	59.4	8.64	8.8	7.11	7.1	2.00	2.0
MUP-W5 (mobile)	2:35	0.5	31.3	31.3	4.81	4.8	58.70	57.7	7.82	7.8	6.98	7.0	<2	2.0
			31.3 30.8		4.73 4.64		56.60 59.60		7.71 8.67		7.11 6.85		<2 3.00	
MUP-W6 (mobile)	2:17	0.2	30.8	30.8	4.71	4.7	59.90	59.8	8.48	8.6	6.88	6.9	3.00	3.0
Data	10	Jug-12												
Date Location	Time	Aug-12 Depth (m)	Tem	o(oC)	D0 (r	ng/L)	DOS	6(%)	Turbidit	ty(NTU)	D	н	S	s
MUP-W1 (Control)	2:40	0.1	29.8	29.8	2.96	3.0	52.90	54.6	5.15	5.2	6.68	6.7	3.00	3.0
(MUP01/02-W1)	2.40		29.8		3.11	5.0	56.30		5.19		6.77		3.00	2.0
MUP-W2 (Control) (MUP01/02-W2)	1:50	0.4	29.6 29.6	29.6	3.98 3.85	3.9	55.30 53.60	54.5	3.47 3.56	3.5	7.05	7.1	3.00 3.00	3.0
MUP-W3 (Control)	2:15	0.2	31.2	31.2	3.54	3.5	53.90	52.6	6.51	6.5	6.73	6.5	3.00	3.0
			31.2 30.4		3.48 5.26		51.20 52.70		6.44 4.25		6.29 7.30		3.00	
MUP-W4 (Impact)	2:10	0.4	30.4	30.4	5.26	5.3	52.70 54.80	53.8	4.25	4.2	7.30	7.2	3.00	3.0
	1		30.3	30.3	5.49	5.4	60.70	59.7	4.94	4.9	7.60	7.6	4.00	4.0
MUP-W5 (mobile)	2:25	0.5	20.2		E OC									
			30.3 30.7		5.28 5.35		58.70 55.30		4.88 5.96		7.65 6.78		4.00 3.00	
MUP-W5 (mobile) MUP-W6 (mobile)	2:25	0.5	30.3 30.7 30.7	30.7	5.28 5.35 5.24	5.3	58.70 55.30 53.50	54.4	4.88 5.96 5.82	5.9	7.65 6.78 6.91	6.8	4.00 3.00 3.00	3.0

## AUES

#### DSD CONTRACT NO. DC/2007/08 Drainage Improvements Works in Tai Po Tin, Ping Che, Man Uk Pin and Lin Ma Hang Water Quality Monitoring Data for MUP05

Date	13-/	Aug-12												
Location	Time	Depth (m)	Temp	p(oC)		mg/L)	DOS	(%)	Turbidi	ty(NTU)	р	н	s	s
MUP-W1 (Control) (MUP01/02-W1)	3:15	0.3	25.9	25.9	4.13	4.2	52.60	53.6	12.80	13.1	6.84	6.8	8.00	8.0
MUP-W2 (Control)			25.9 26.8		4.26 5.17		54.50 56.40		13.40 2.46		6.76 7.08		8.00 19.00	
(MUP01/02-W2)	2:05	0.4	26.8	26.8	4.98	5.1	53.80	55.1	2.84	2.7	7.11	7.1	19.00	19.0
MUP-W3 (Control)	2:45	0.2	26.1	26.1	4.26	4.3	55.40	56.3	5.04	5.1	7.63	7.7	15.00	15.0
			26.1		4.32		57.10		5.13		7.74		15.00	
MUP-W4 (Impact)	2:25	0.5	27.1 27.1	27.1	5.86 5.93	5.9	61.60 64.40	63.0	4.79 5.68	5.2	7.53	7.6	14.00 14.00	14.0
			27.1		5.04		53.60		4.89		7.68	_	13.00	
MUP-W5 (mobile)	2:52	0.4	27.1	27.1	4.93	5.0	55.80	54.7	4.77	4.8	7.74	7.7	13.00	13.0
MUP-W6 (mobile)	2:35	0.3	26.4	26.4	4.93	4.9	51.60	52.5	4.21	4.3	6.99	6.9	14.00	14.0
			26.4		4.86		53.30		4.39		6.86		14.00	
Date	15-/	Aug-12												
Location	Time	Depth (m)	Tem	p(oC)	DO (I	mg/L)	DOS	5(%)	Turbidi	ty(NTU)	р	н	S	s
MUP-W1 (Control)	2:27	0.3	24.7	24.7	5.68	5.7	66.40	67.9	7.36	7.5	7.05	7.1	15.00	15.0
(MUP01/02-W1) MUP-W2 (Control)			24.7		5.81 5.99		69.30 74.10		7.54		7.11 7.03		15.00 16.00	
(MUP01/02-W2)	2:50	0.1	25.3 25.3	25.3	5.89	5.9	73.60	73.9	3.71 3.84	3.8	7.09	7.1	16.00	16.0
MUP-W3 (Control)	2:35	0.1	24.6	24.6	4.70	4.6	52.30	51.5	48.50	48.8	7.08	7.1	21.00	21.0
MOP-W3 (control)	2.33	0.1	24.6	24.0	4.56	4.0	50.70	51.5	49.10	40.0	7.15	7.1	21.00	21.0
MUP-W4 (Impact)	2:40	0.3	24.8	24.8	6.43	6.3	75.60	73.7	5.66 5.49	5.6	7.41 7.29	7.4	15.00 15.00	15.0
			24.8 25.4		6.21 5.51		71.80 65.90		5.94		5.94		18.00	
MUP-W5 (mobile)	2:15	0.5	25.4	25.4	5.69	5.6	67.20	66.6	6.11	6.0	6.11	6.0	18.00	18.0
MUP-W6 (mobile)	2:05	0.4	23.3	23.3	4.59	4.6	54.50	56.1	6.20	6.4	6.20	6.4	9.00	9.0
	<u> </u>	L	23.3	I	4.55	I	57.60	l	6.51	l	6.51	l	9.00	
Date	17-/	Aug-12												
Location	Time	Depth (m)	Tem	p(oC)		mg/L)	DOS	(%)	Turbidi	ty(NTU)	р	н	s	s
MUP-W1 (Control) (MUP01/02-W1)	3:25	0.1	29.5	29.5	3.36	3.5	42.80	43.7	7.89	7.8	6.73	6.8	30.00	30.0
(MUP01/02-W1) MUP-W2 (Control)			29.5 28.2		3.59 6.97		44.60 54.30		7.73		6.91 6.98		30.00 16.00	
(MUP01/02-W2)	2:15	0.3	28.2	28.2	6.99	7.0	56.40	55.4	5.36	5.2	7.03	7.0	16.00	16.0
MUP-W3 (Control)	2:55	0.2	29.0	29.0	3.95	4.1	50.60	51.5	46.60	47.5	7.14	7.2	18.00	18.0
			29.0		4.17		52.30		48.40		7.24		18.00	
MUP-W4 (Impact)	2:35	0.5	28.8 28.8	28.8	5.27 5.38	5.3	45.60 51.60	48.6	6.20 6.03	6.1	7.08	7.1	17.00 17.00	17.0
	3:05	0.3	28.5	28.5	5.46	5.4	55.50	54.8	6.96	6.9	7.77	7.8	18.00	18.0
MUP-W5 (mobile)	3.05	0.5	28.5	20.5	5.38	5.4	54.10	34.0	6.84	0.9	7.83	7.0	18.00	10.0
MUP-W6 (mobile)	2:45	0.2	28.3 28.3	28.3	4.88 4.93	4.9	52.50 53.40	53.0	11.10 11.20	11.2	6.71 6.83	6.8	16.00 16.00	16.0
			20.3		4.93		03.40		11.20		0.03		10.00	
Date		Aug-12												
Location	20-/ Time	Aug-12 Depth (m)	Temp	p(oC)		ng/L)		6(%)	Turbidi	ty(NTU)	p	н	s	s
			Tem 29.1 29.1	<b>p(oC)</b> 29.1	3.36	mg/L) 3.4	51.70	<b>(%)</b> 52.2	Turbidi 5.43 5.82	<b>ty(NTU)</b> 5.6	8.01	H 8.1	4.00 4.00	<b>S</b>
Location MUP-W1 (Control) (MUP01/02-W1) MUP-W2 (Control)	Time 17:10	0.3	29.1	29.1		3.4		52.2	5.43	5.6		8.1	4.00	4.0
Location MUP-W1 (Control) (MUP01/02-W1)	Time	Depth (m)	29.1 29.1 28.2 28.2		3.36 3.44 4.61 4.91		51.70 52.60 50.60 51.30		5.43 5.82 9.36 7.88		8.01 8.12 7.34 7.46		4.00 4.00 3.00 3.00	
Location MUP-W1 (Control) (MUP01/02-W1) MUP-W2 (Control)	Time 17:10	0.3	29.1 29.1 28.2 28.2 28.8	29.1	3.36 3.44 4.61 4.91 3.04	3.4	51.70 52.60 50.60 51.30 48.70	52.2	5.43 5.82 9.36 7.88 12.90	5.6	8.01 8.12 7.34 7.46 7.97	8.1	4.00 4.00 3.00 3.00 <2	4.0
Location MUP-W1 (Control) (MUP01/02-W1) MUP-W2 (Control) (MUP01/02-W2) MUP-W3 (Control)	Time 17:10 15:40 16:27	Depth (m)           0.3           0.3           0.2	29.1 29.1 28.2 28.2	29.1 28.2 28.8	3.36 3.44 4.61 4.91	3.4 4.8 3.1	51.70 52.60 50.60 51.30 48.70 49.60	52.2 51.0 49.2	5.43 5.82 9.36 7.88	5.6 8.6 13.6	8.01 8.12 7.34 7.46 7.97 7.89	8.1 7.4 7.9	4.00 4.00 3.00 3.00	4.0 3.0 2.0
Location MUP-W1 (Control) (MUP01/02-W1) MUP-W2 (Control) (MUP01/02-W2)	Time 17:10 15:40	0.3 0.3	29.1 29.1 28.2 28.2 28.8 28.8	29.1 28.2	3.36 3.44 4.61 4.91 3.04 3.08	3.4	51.70 52.60 50.60 51.30 48.70	52.2 51.0	5.43 5.82 9.36 7.88 12.90 14.30	5.6 8.6	8.01 8.12 7.34 7.46 7.97	8.1	4.00 4.00 3.00 3.00 <2 <2 <2	4.0
Location MUP-W1 (Control) (MUP01/02-W1) MUP-W2 (Control) (MUP01/02-W2) MUP-W3 (Control) MUP-W4 (Impact)	Time 17:10 15:40 16:27	Depth (m)           0.3           0.3           0.2	29.1 29.1 28.2 28.2 28.8 28.8 28.8 28.8 28.8 28	29.1 28.2 28.8	3.36 3.44 4.61 4.91 3.04 3.08 5.69 5.83 5.31	3.4 4.8 3.1 5.8	51.70 52.60 50.60 51.30 48.70 49.60 60.10 62.70 58.40	52.2 51.0 49.2	5.43 5.82 9.36 7.88 12.90 14.30 3.93 4.01 3.88	5.6 8.6 13.6 4.0	8.01 8.12 7.34 7.46 7.97 7.89 7.21 7.18 7.88	8.1 7.4 7.9	4.00 4.00 3.00 3.00 <2 <2 2.00 2.00 3.00	4.0 3.0 2.0
Location MUP-W1 (Control) (MUP01/02-W1) MUP-W2 (Control) (MUP01/02-W2) MUP-W3 (Control)	Time           17:10           15:40           16:27           16:00	Depth (m)           0.3           0.3           0.2           0.6	29.1 29.1 28.2 28.2 28.8 28.8 28.8 28.8 28.8 28	29.1 28.2 28.8 28.8	3.36 3.44 4.61 3.04 3.08 5.69 5.83 5.31 5.29	3.4 4.8 3.1	51.70 52.60 50.60 51.30 48.70 49.60 60.10 62.70 58.40 57.70	52.2 51.0 49.2 61.4	5.43 5.82 9.36 7.88 12.90 14.30 3.93 4.01 3.88 4.01	5.6 8.6 13.6	8.01 8.12 7.34 7.46 7.97 7.89 7.21 7.18 7.88 7.94	8.1 7.4 7.9 7.2	4.00 4.00 3.00 3.00 <2 <2 2.00 2.00 3.00 3.00	4.0 3.0 2.0 2.0
Location MUP-W1 (Control) (MUP01/02-W1) MUP-W2 (Control) (MUP01/02-W2) MUP-W3 (Control) MUP-W4 (Impact)	Time           17:10           15:40           16:27           16:00	Depth (m)           0.3           0.3           0.2           0.6	29.1 29.1 28.2 28.2 28.8 28.8 28.8 28.8 28.8 28	29.1 28.2 28.8 28.8	3.36 3.44 4.61 4.91 3.04 3.08 5.69 5.83 5.31	3.4 4.8 3.1 5.8	51.70 52.60 50.60 51.30 48.70 49.60 60.10 62.70 58.40	52.2 51.0 49.2 61.4	5.43 5.82 9.36 7.88 12.90 14.30 3.93 4.01 3.88	5.6 8.6 13.6 4.0	8.01 8.12 7.34 7.46 7.97 7.89 7.21 7.18 7.88	8.1 7.4 7.9 7.2	4.00 4.00 3.00 3.00 <2 <2 2.00 2.00 3.00	4.0 3.0 2.0 2.0
Location MUP-W1 (Control) (MUP01/02-W1) MUP-W2 (Control) MUP-W3 (Control) MUP-W3 (Control) MUP-W4 (Impact) MUP-W5 (mobile)	Time           17:10           15:40           16:27           16:00           16:40           16:15	Depth (m)           0.3           0.3           0.2           0.6           0.4           0.3	29.1 29.1 28.2 28.2 28.8 28.8 28.8 28.8 28.8 28	29.1 28.2 28.8 28.8 28.8 28.1	3.36 3.44 4.61 3.04 3.08 5.69 5.83 5.31 5.29 4.86	3.4 4.8 3.1 5.8 5.3	51.70 52.60 50.60 51.30 48.70 49.60 60.10 62.70 58.40 57.70 51.10	52.2 51.0 49.2 61.4 58.1	5.43 5.82 9.36 7.88 12.90 14.30 3.93 4.01 3.88 4.01 4.76	5.6 8.6 13.6 4.0 3.9	8.01 8.12 7.34 7.46 7.97 7.89 7.21 7.18 7.88 7.94 7.14	8.1 7.4 7.9 7.2 7.9	4.00 4.00 3.00 3.00 <2 <2 2.00 2.00 3.00 3.00 3.00	4.0 3.0 2.0 2.0 3.0
Location MUP-W1 (Control) (MUP01/02-W1) MUP-W2 (Control) MUP-W3 (Control) MUP-W3 (Control) MUP-W4 (Impact) MUP-W6 (mobile) Date	Time           17:10           15:40           16:27           16:00           16:40           16:15	Depth (m)           0.3           0.3           0.4           0.3	29.1 29.1 28.2 28.2 28.8 28.8 28.8 28.8 28.1 28.1	29.1 28.2 28.8 28.8 28.8 28.1 28.7	3.36 3.44 4.61 3.04 3.08 5.69 5.83 5.83 5.31 5.29 4.86 4.77	3.4 4.8 3.1 5.8 5.3 4.8	51.70 52.60 50.60 51.30 48.70 49.60 60.10 62.70 58.40 57.70 51.10 49.30	52.2 51.0 49.2 61.4 58.1 50.2	5.43 5.82 9.36 7.88 12.90 14.30 3.93 4.01 3.88 4.01 4.76 4.93	5.6 8.6 13.6 4.0 3.9 4.8	8.01 8.12 7.34 7.46 7.97 7.89 7.21 7.18 7.88 7.94 7.14 7.08	8.1 7.4 7.9 7.2 7.9 7.1	4.00 4.00 3.00 3.00 <2 <2 2.00 2.00 3.00 3.00 3.00	4.0 3.0 2.0 2.0 3.0
Location MUP-VH (Control) (MUP01/02-VH3) MUP-V42 (Control) (MUP01/02-VH2) MUP-W4 (Impact) MUP-W4 (Impact) MUP-W6 (mobile) Date Location	Time           17:10           15:40           16:27           16:00           16:40           16:15           22-J           Time	Depth (m) 0.3 0.3 0.2 0.6 0.4 0.3 Aug-12 Depth (m)	29.1 29.1 28.2 28.2 28.8 28.8 28.8 28.8 28.8 28	29.1 28.2 28.8 28.8 28.1 28.7	3.36 3.44 4.61 3.04 3.08 5.69 5.83 5.83 5.31 5.29 4.86 4.77	3.4 4.8 3.1 5.8 5.3 4.8	51.70 52.60 50.60 51.30 48.70 49.60 60.10 62.70 58.40 57.70 51.10	52.2 51.0 49.2 61.4 58.1 50.2	5.43 5.82 9.36 7.88 12.90 14.30 3.93 4.01 3.88 4.01 4.76	5.6 8.6 13.6 4.0 3.9 4.8	8.01 8.12 7.34 7.46 7.97 7.89 7.21 7.18 7.88 7.94 7.14	8.1 7.4 7.9 7.2 7.9 7.1	4.00 4.00 3.00 3.00 <2 <2 2.00 2.00 3.00 3.00 3.00	4.0 3.0 2.0 2.0 3.0 3.0 5
Location MUP-W1 (Control) (MUP01/02-W1) MUP-W2 (Control) MUP-W3 (Control) MUP-W3 (Control) MUP-W4 (Impact) MUP-W6 (mobile) Date	Time           17:10           15:40           16:27           16:00           16:40           16:15	Depth (m)           0.3           0.3           0.4           0.3	29.1 29.1 28.2 28.8 28.8 28.8 28.8 28.8 28.1 28.1	29.1 28.2 28.8 28.8 28.8 28.1 28.7	3.36 3.44 4.61 3.04 3.08 5.69 5.83 5.83 5.29 4.86 4.77 <b>DO (</b>	3.4 4.8 3.1 5.8 5.3 4.8	51.70 52.60 50.60 51.30 48.70 49.60 60.10 62.70 58.40 57.70 51.10 49.30	52.2 51.0 49.2 61.4 58.1 50.2	5.43 5.82 9.36 7.88 12.90 14.30 3.93 4.01 3.88 4.01 4.76 4.93 <b>Turbidi</b>	5.6 8.6 13.6 4.0 3.9 4.8	8.01 8.12 7.34 7.46 7.97 7.89 7.21 7.18 7.88 7.94 7.14 7.08	8.1 7.4 7.9 7.2 7.9 7.1	4.00 4.00 3.00 <2 2.00 2.00 3.00 3.00 3.00 3.00 3.00	4.0 3.0 2.0 2.0 3.0
Location MUP-V1 (Control) (MUP01/02-W1) MUP-W2 (Control) MUP-W3 (Control) MUP-W4 (Impact) MUP-W4 (Impact) MUP-W6 (mobile) MUP-W6 (mobile) Date Location MUP-W1 (Control) (MUP0-1/02-W1)	Time           17:10           15:40           16:27           16:00           16:40           16:15           22-J           Time	Depth (m) 0.3 0.3 0.2 0.6 0.4 0.3 Aug-12 Depth (m)	29.1 29.1 28.2 28.8 28.8 28.8 28.8 28.8 28.8 28	29.1 28.2 28.8 28.8 28.1 28.7	3.36 3.44 4.61 3.04 3.08 5.69 5.83 5.31 5.29 4.86 4.77 <b>DO (</b> 0 3.96 3.88 4.11	3.4 4.8 3.1 5.8 5.3 4.8	51.70 52.60 50.60 51.30 48.70 49.60 60.10 62.70 58.40 57.70 51.10 49.30 <b>DOS</b> 42.10 43.10 55.40	52.2 51.0 49.2 61.4 58.1 50.2	5.43 5.82 9.36 7.88 12.90 14.30 3.93 4.01 3.88 4.01 3.88 4.01 4.76 4.93 <b>Turbidi</b> 6.32 6.44 2.94	5.6 8.6 13.6 4.0 3.9 4.8	8.01 8.12 7.34 7.46 7.97 7.89 7.21 7.18 7.88 7.94 7.14 7.14 7.08 <b>P</b> 7.23 7.26 7.39	8.1 7.4 7.9 7.2 7.9 7.1	4.00 4.00 3.00 -<2 2.00 2.00 3.00 3.00 3.00 3.00 3.00 3.0	4.0 3.0 2.0 2.0 3.0 3.0 5
Location MUP-VII (Control) (MUP01/02-W1) MUP-W2 (Control) MUP-W3 (Control) MUP-W4 (Impact) MUP-W4 (Impact) MUP-W6 (mobile) MUP-W6 (mobile) Date Location MUP-W1 (Control) (MUP01/02-W1) (MUP01/02-W2)	Time           17:10           15:40           16:27           16:00           16:40           16:15           22.1           Time           3:17           2:05	Depth (m) 0.3 0.3 0.2 0.6 0.4 0.3 Aug-12 Depth (m) 0.3 0.3	29.1 29.1 28.2 28.8 28.8 28.8 28.8 28.1 28.1 28	29.1 28.2 28.8 28.8 28.1 28.7 28.7 28.7 28.1 28.1 29.6	3.36 3.44 4.61 3.04 3.08 5.69 5.83 5.31 5.29 4.86 4.77 <b>DO (0</b> 3.96 3.86 4.11 4.31	- 3.4 4.8 3.1 5.8 5.3 4.8 mg/L) 3.9 - 4.2	51.70 52.60 50.60 51.30 48.70 49.60 60.10 62.70 58.40 57.70 51.10 49.30 <b>DOS</b> 42.10 43.10 55.40 55.80	52.2 51.0 49.2 61.4 58.1 50.2 (%) 42.6 55.6	5.43 5.82 9.36 7.88 12.90 14.30 3.93 4.01 4.76 4.93 <b>Turbidi</b> 6.32 6.44 2.94 3.07	5.6 8.6 13.6 4.0 3.9 4.8 <b>Ey(NTU)</b> 6.4 3.0	8.01 8.12 7.34 7.97 7.89 7.21 7.18 7.88 7.94 7.14 7.08 7.23 7.26 7.23 7.23 7.23 7.23 7.23	8.1 7.4 7.9 7.2 7.9 7.1 H 7.2 7.3	4.00 4.00 3.00 3.00 <2 <2 2.00 3.00	4.0 3.0 2.0 3.0 3.0 3.0 5 3.0 3.0 3.0
Location MUP-V1 (Control) (MUP01/02-W1) MUP-W2 (Control) MUP-W3 (Control) MUP-W4 (Impact) MUP-W4 (Impact) MUP-W6 (mobile) MUP-W6 (mobile) Date Location MUP-W1 (Control) (MUP0-1/02-W1)	Time           17:10           15:40           16:27           16:00           16:40           16:15           22-J           Time           3:17	Depth (m) 0.3 0.3 0.2 0.6 0.4 0.3 Aug-12 Depth (m) 0.3	29.1 29.1 28.2 28.8 28.8 28.8 28.8 28.8 28.8 28	29.1 28.2 28.8 28.8 28.8 28.1 28.7 <b>(oc)</b> 28.1	3.36 3.44 4.61 3.04 3.08 5.69 5.83 5.31 5.29 4.86 4.77 <b>DO (</b> 0 3.96 3.88 4.11	3.4 4.8 3.1 5.8 5.3 4.8 mg/L) 3.9	51.70 52.60 50.60 51.30 48.70 49.60 60.10 62.70 58.40 57.70 51.10 49.30 <b>DOS</b> 42.10 43.10 55.40	52.2 51.0 49.2 61.4 58.1 50.2 (%) 42.6	5.43 5.82 9.36 7.88 12.90 14.30 3.93 4.01 3.88 4.01 3.88 4.01 4.76 4.93 <b>Turbidi</b> 6.32 6.44 2.94	5.6 8.6 13.6 4.0 3.9 4.8 <b>Ey(NTU)</b> 6.4	8.01 8.12 7.34 7.46 7.97 7.89 7.21 7.18 7.88 7.94 7.14 7.14 7.08 <b>P</b> 7.23 7.26 7.39	8.1 7.4 7.9 7.2 7.9 7.1 H H	4.00 4.00 3.00 -<2 2.00 2.00 3.00 3.00 3.00 3.00 3.00 3.0	4.0 3.0 2.0 3.0 3.0 3.0 5 3.0
Location MUP-VH (Control) (MUP01/02-VH3) MUP-W2 (Control) (MUP04/02-VH2) MUP-W4 (Impact) MUP-W4 (Impact) MUP-W6 (mobile) Date Location MUP-W4 (Control) (MUP01/02-VH2) MUP-W2 (Control)	Time           17:10           15:40           16:27           16:00           16:40           16:15           22.1           Time           3:17           2:05	Depth (m)         0.3           0.3         0.3           0.2         0.6           0.4         0.3           Depth (m)         0.3           0.3         0.3	29.1 29.1 28.2 28.8 28.8 28.8 28.8 28.1 28.1 28	29.1 28.2 28.8 28.8 28.1 28.7 28.7 28.7 28.1 28.1 29.6	3.36 3.44 4.61 3.04 3.08 5.69 5.83 5.31 5.29 4.86 4.77 <b>DO (</b> 3.96 3.88 4.11 4.31 3.326 5.64	- 3.4 4.8 3.1 5.8 5.3 4.8 mg/L) 3.9 - 4.2	51.70 52.60 50.60 51.30 48.70 49.60 60.10 62.70 58.40 57.70 51.10 49.30 <b>DOS</b> 42.10 43.10 55.40 55.40 55.80 48.60 49.40 56.30	52.2 51.0 49.2 61.4 58.1 50.2 (%) 42.6 55.6	5.43 5.82 9.36 12.90 14.30 3.93 4.01 3.88 4.01 3.88 4.01 4.76 4.93 <b>Turbidi</b> 6.32 6.44 2.94 3.07 22.90 7.13	5.6 8.6 13.6 4.0 3.9 4.8 <b>EX(NTU)</b> 6.4 3.0 23.3	8.01 8.12 7.34 7.46 7.97 7.97 7.97 7.21 7.18 7.21 7.18 7.23 7.26 7.23 7.26 7.39 7.27 7.39 7.27 7.39 7.27 7.35	8.1 7.4 7.9 7.2 7.9 7.1 H 7.2 7.3 7.9	4.00 4.00 3.00 3.00 <2 2.00 2.00 3.	4.0 3.0 2.0 3.0 3.0 3.0 5 3.0 3.0 3.0
Location MUP-VH (Control) (MUP01/02-VH2) MUP-W2 (Control) (MUP01/02-VH2) MUP-W4 (Impact) MUP-W4 (Impact) MUP-W6 (mobile) Date Location MUP-W1 (Control) (MUP01/02-VH2) (MUP01/02-VH2) MUP-W3 (Control) MUP-W4 (Impact)	Time           17:10           15:40           16:27           16:00           16:15           22-J           Time           3:17           2:05           2:45           2:25	Depth (m) 0.3 0.3 0.2 0.6 0.4 0.3 Aug-12 Depth (m) 0.3 0.3	29.1 29.1 28.2 28.8 28.8 28.8 28.8 28.8 28.1 28.7 28.7 28.7 28.7 28.7 28.7 28.7 28.7	29.1 28.2 28.8 28.8 28.1 28.7 28.7 28.1 28.7 28.1 29.6 29.6	3.36 3.44 4.61 3.04 3.04 3.04 5.69 5.83 5.31 5.29 4.86 4.77 <b>DO (</b> 3.96 3.88 4.77 <b>DO (</b> 3.96 3.88 4.11 4.31 3.13 3.26 5.53	<ul> <li>3.4</li> <li>4.8</li> <li>3.1</li> <li>5.8</li> <li>5.3</li> <li>4.8</li> <li>mg/L)</li> <li>3.9</li> <li>4.2</li> <li>3.2</li> </ul>	51.70 52.60 50.60 51.30 48.70 49.60 60.10 62.70 58.40 57.70 51.10 49.30 <b>DOS</b> 42.10 43.10 55.40 55.40 55.80 48.60 49.40 56.30 54.40	52.2 51.0 49.2 61.4 58.1 50.2 (%) 42.6 55.6 49.0	5.43 5.82 9.36 7.88 12.90 14.30 3.93 4.01 3.88 4.01 4.76 4.93 <b>Turbidi</b> 6.32 6.44 2.94 3.07 22.90 23.60 7.13 7.16	5.6 8.6 13.6 4.0 3.9 4.8 <b>Ey(NTU)</b> 6.4 3.0	8.01 8.12 7.34 7.46 7.97 7.89 7.21 7.18 7.88 7.94 7.14 7.08 7.23 7.26 7.23 7.26 7.39 7.27 7.98 7.79 7.35 7.32	8.1 7.4 7.9 7.2 7.9 7.1 H 7.2 7.3 7.9 7.3	4.00 4.00 3.00 <2 <2 2.00 3.00	4.0 3.0 2.0 3.0 3.0 3.0 3.0 3.0 3.0 3.0 3.0
Location MUP-VH (Control) (MUP01/02-VH3) MUP-W2 (Control) (MUP04/02-VH2) MUP-W4 (Impact) MUP-W4 (Impact) MUP-W6 (mobile) Date Location MUP-W4 (Control) (MUP01/02-VH2) MUP-W2 (Control)	Time           17:10           15:40           16:27           16:00           16:15           22-0           Time           3:17           2:05           2:45	Depth (m)         0.3           0.3         0.3           0.2         0.6           0.4         0.3           Depth (m)         0.3           0.3         0.3	29.1 29.1 28.2 28.2 28.8 28.8 28.8 28.8 28.1 28.1	29.1 28.2 28.8 28.8 28.1 28.7 28.7 28.1 28.7 28.1 29.6 29.6	3.36 3.44 4.61 3.04 3.08 5.69 5.83 5.31 5.29 4.86 4.77 <b>DO (</b> 3.96 3.88 4.11 4.31 3.326 5.64	<ul> <li>3.4</li> <li>4.8</li> <li>3.1</li> <li>5.8</li> <li>5.3</li> <li>4.8</li> <li>mg/L)</li> <li>3.9</li> <li>4.2</li> <li>3.2</li> </ul>	51.70 52.60 50.60 51.30 48.70 49.60 60.10 62.70 53.70 57.70 51.10 49.30 42.10 55.40 55.40 55.80 48.60 49.40 55.40 55.40	52.2 51.0 49.2 61.4 58.1 50.2 (%) 42.6 55.6 49.0	5.43 5.82 9.36 7.88 12.90 14.30 3.93 4.01 4.76 4.93 <b>Turbidi</b> 6.32 6.44 2.94 3.07 22.90 22.60 7.13 7.16 5.88	5.6 8.6 13.6 4.0 3.9 4.8 <b>EX(NTU)</b> 6.4 3.0 23.3	8.01 8.12 7.34 7.46 7.97 7.97 7.97 7.21 7.18 7.21 7.14 7.08 7.24 7.14 7.08 <b>P</b> 7.23 7.26 7.39 7.27 7.39 7.27 7.39 7.29 7.35 7.35 7.35 7.35 7.35 7.65	8.1 7.4 7.9 7.2 7.9 7.1 H 7.2 7.3 7.9	4.00 4.00 3.00 3.00 <2 2.00 2.00 3.	4.0 3.0 2.0 3.0 3.0 3.0 3.0 3.0 3.0 3.0 3.0
Location MUP-W1 (Control) (MUP01/02-W1) MUP-W2 (Control) MUP-W3 (Control) MUP-W4 (Impact) MUP-W6 (mobile) MUP-W6 (mobile) MUP-W6 (mobile) Date Location MUP-W6 (control) (MUP01/02-W1) (MUP01/02-W2) MUP-W3 (Control) MUP-W3 (Control) MUP-W3 (Control) MUP-W3 (control)	Time           17:10           15:40           16:27           16:00           16:40           16:15           22-J           Time           3:17           2:05           2:45           2:25	Depth (m)           0.3           0.3           0.3           0.2           0.6           0.4           0.3           Depth (m)           0.3           0.3           0.4           0.3           0.3           0.3           0.3           0.3           0.3           0.3           0.3           0.4	29.1 29.1 28.2 28.2 28.8 28.8 28.8 28.8 28.1 28.1	29.1 28.2 28.8 28.8 28.1 28.7 28.7 28.1 29.6 29.6 29.6 29.6 29.7	3.36 3.44 4.61 3.08 5.69 5.83 5.31 5.29 4.86 4.77 <b>DO (</b> 0 3.96 3.88 4.11 3.13 3.26 5.53 4.71 4.71 4.86	3.4 4.8 3.1 5.8 5.3 4.8 <b>mg/L)</b> 3.9 4.2 3.2 5.6 4.7	51.70 52.60 50.60 51.30 48.70 49.60 60.10 62.70 58.40 57.70 51.10 49.30 49.30 42.10 43.10 55.40 55.80 48.60 49.40 55.80 55.80 55.80 55.80 55.80 51.40 52.90 51.60	52.2 51.0 49.2 61.4 58.1 50.2 (%) 42.6 55.6 49.0 55.4 52.5	5.43 5.82 9.36 7.88 12.90 14.30 3.93 4.01 4.76 4.93 <b>Turbidi</b> 6.32 6.44 2.94 3.07 22.90 23.60 7.13 7.16 5.88 6.13 5.36	5.6 8.6 13.6 4.0 3.9 4.8 <b>EX(NTU)</b> 6.4 3.0 23.3 7.1 6.0	8.01 8.12 7.34 7.46 7.97 7.89 7.21 7.18 7.21 7.14 7.08 P 7.23 7.24 7.23 7.26 7.37 7.26 7.37 7.27 7.98 7.27 7.98 7.32 7.35 7.32 7.35 7.32 7.65 7.71 6.96	8.1           7.4           7.9           7.2           7.9           7.1           H           7.2           7.3           7.7	4.00 4.00 3.00 3.00 2.00 2.00 3.00 3.00 3.00 3	4.0 3.0 2.0 3.0 3.0 3.0 3.0 3.0 3.0 3.0 2.0 2.0
Location MUP-VH (Control) (MUP01/02-VH2) MUP-W2 (Control) (MUP01/02-VH2) MUP-W4 (Impact) MUP-W4 (Impact) MUP-W6 (mobile) Date Location MUP-W1 (Control) (MUP01/02-VH2) (MUP01/02-VH2) MUP-W3 (Control) MUP-W4 (Impact)	Time           17:10           15:40           16:27           16:00           16:15           22-J           Time           3:17           2:05           2:45           2:25	Depth (m) 0.3 0.3 0.2 0.6 0.4 0.3 0.3 0.3 0.3 0.3 0.3 0.2 0.5	29.1 29.1 28.2 28.2 28.8 28.8 28.8 28.8 28.1 28.7 28.7 28.7 28.7 28.7 28.7 28.7 28.1 28.1 29.6 29.6 29.6 29.6 29.6 29.6 29.7 29.7	29.1 28.2 28.8 28.8 28.1 28.7 28.7 28.7 28.1 29.6 29.6 28.8	3.36 3.44 4.61 3.04 3.04 5.69 5.83 5.31 5.29 4.86 4.77 <b>DO (0</b> 3.96 3.88 4.11 4.31 3.12 5.64 5.53 4.71 4.68	3.4 4.8 3.1 5.8 5.3 4.8 <b>mg/L)</b> 3.9 4.2 3.2 5.6	51.70 52.60 50.60 51.30 48.70 49.60 60.10 62.70 58.40 57.70 51.10 49.30 42.10 43.10 55.40 55.80 42.10 43.10 55.80 42.10 43.10 55.80 42.0 55.80 43.00 55.80 43.00 55.80 43.00 55.80 55.90 52.90 52.90	52.2 51.0 49.2 61.4 58.1 50.2 (%) 42.6 55.6 49.0 55.4	5.43 5.82 9.36 7.88 12.90 14.30 3.93 4.01 4.76 4.93 <b>Turbidi</b> 6.32 6.44 2.94 2.90 23.60 7.13 7.16 5.88 6.13	5.6 8.6 13.6 4.0 3.9 4.8 <b>Ey(NTU)</b> 6.4 3.0 23.3 7.1	8.01 8.12 7.34 7.46 7.99 7.21 7.18 7.94 7.14 7.08 7.23 7.26 7.23 7.26 7.27 7.88 7.27 7.88 7.27 7.88 7.27 7.89 7.21 7.14 7.08 7.21 7.14 7.08 7.21 7.14 7.08 7.21 7.14 7.08 7.21 7.14 7.08 7.21 7.14 7.08 7.21 7.14 7.08 7.21 7.14 7.08 7.21 7.14 7.08 7.21 7.14 7.28 7.21 7.14 7.28 7.21 7.28 7.21 7.21 7.28 7.21 7.21 7.28 7.21 7.21 7.28 7.24 7.29 7.21 7.28 7.29 7.21 7.28 7.29 7.21 7.28 7.29 7.21 7.28 7.29 7.21 7.28 7.29 7.27 7.29 7.27 7.29 7.27 7.29 7.27 7.29 7.27 7.29 7.27 7.29 7.27 7.29 7.27 7.35 7.35 7.32 7.35 7.31 7.35 7.31 7.35 7.31	8.1 7.4 7.9 7.2 7.9 7.1 H 7.2 7.3 7.9 7.3	4.00 4.00 3.00 3.00 2.00 3.00 3.00 3.00 3.00 3	4.0 3.0 2.0 3.0 3.0 3.0 3.0 3.0 3.0 3.0 2.0
Location MUP-VH (Control) (MUP01/02-VH3) MUP-W2 (Control) (MUP01/02-VH2) MUP-W4 (Impact) MUP-W4 (Impact) MUP-W6 (mobile) Date Location MUP-W4 (Control) (MUP01/02-VH2) MUP-W3 (Control) MUP-W4 (Impact) MUP-W4 (Impact)	Time           17:10           15:40           16:27           16:00           16:40           16:15           22-1           3:17           2:05           2:45           2:25           2:55           2:35	Depth (m)           0.3           0.3           0.4           0.3           0.4           0.3           0.4           0.3           0.2           0.6           0.4           0.3           0.3           0.3           0.3           0.3           0.4           0.3           0.5           0.4           0.3	29.1 29.1 28.2 28.2 28.8 28.8 28.8 28.8 28.1 28.1	- 29.1 - 28.2 28.8 - 28.8 - 28.1 - 28.7 - 28.1 - 29.6 - 29.6 - 29.6 - 28.8 - 29.7	3.36 3.44 4.61 3.08 5.69 5.83 5.31 5.29 4.86 4.77 <b>DO (</b> 0 3.96 3.88 4.11 3.13 3.26 5.53 4.71 4.71 4.86	3.4 4.8 3.1 5.8 5.3 4.8 <b>mg/L)</b> 3.9 4.2 3.2 5.6 4.7	51.70 52.60 50.60 51.30 48.70 49.60 60.10 62.70 58.40 57.70 51.10 49.30 49.30 42.10 43.10 55.40 55.80 48.60 49.40 55.80 55.80 55.80 55.80 55.80 51.40 52.90 51.60	52.2 51.0 49.2 61.4 58.1 50.2 (%) 42.6 55.6 49.0 55.4 52.5	5.43 5.82 9.36 7.88 12.90 14.30 3.93 4.01 4.76 4.93 <b>Turbidi</b> 6.32 6.44 2.94 3.07 22.90 23.60 7.13 7.16 5.88 6.13 5.36	5.6 8.6 13.6 4.0 3.9 4.8 <b>EX(NTU)</b> 6.4 3.0 23.3 7.1 6.0	8.01 8.12 7.34 7.46 7.97 7.89 7.21 7.18 7.21 7.14 7.08 P 7.23 7.24 7.23 7.26 7.37 7.26 7.37 7.27 7.98 7.27 7.98 7.32 7.35 7.32 7.35 7.32 7.65 7.71 6.96	8.1           7.4           7.9           7.2           7.9           7.1           H           7.2           7.3           7.7	4.00 4.00 3.00 3.00 2.00 2.00 3.00 3.00 3.00 3	4.0 3.0 2.0 3.0 3.0 3.0 3.0 3.0 3.0 3.0 2.0 2.0
Location MUP-V1 (Control) (MUP01/02-W1) MUP-W2 (Control) MUP-W3 (Control) MUP-W3 (Control) MUP-W4 (Impact) MUP-W6 (mobile) Date Location MUP-W1 (Control) (MUP01/02-W1) (MUP01/02-W2) MUP-W3 (Control) MUP-W3 (Control) MUP-W3 (Control) MUP-W3 (Control) MUP-W4 (Impact)	Time           17:10           15:40           16:27           16:00           16:40           16:15           22-1           3:17           2:05           2:45           2:25           2:55           2:35	Depth (m)           0.3           0.3           0.3           0.2           0.6           0.4           0.3           Depth (m)           0.3           0.3           0.4           0.3           0.3           0.3           0.3           0.3           0.3           0.3           0.3           0.4	29.1 29.1 28.2 28.2 28.8 28.8 28.8 28.8 28.1 28.1	29.1 28.2 28.8 28.8 28.1 28.7 28.7 28.7 28.7 29.6 29.6 29.6 29.6 29.6 29.7 29.3	3.36 3.44 4.61 4.91 3.04 5.69 5.83 5.53 5.53 5.53 5.64 4.86 4.77 <b>DO (</b> 0 3.66 4.77 <b>DO (</b> 1 3.68 4.81 4.81 4.80 4.77 <b>DO (</b> 1 4.61 4.61 5.63 5.63 5.63 5.63 5.63 5.63 5.63 5.63	3.4 4.8 3.1 5.8 5.3 4.8 <b>mg/L)</b> 3.9 4.2 3.2 5.6 4.7	51.70 52.60 50.60 51.30 48.70 48.70 52.84 49.60 49.60 49.60 49.60 49.60 49.70 53.84 49.30 40.50	52.2 51.0 49.2 61.4 58.1 50.2 (%) 42.6 55.6 49.0 55.4 52.5	5.43 5.82 9.36 7.88 12.90 14.30 3.93 4.01 4.76 4.93 <b>Turbidi</b> 6.32 6.44 2.94 3.07 22.90 23.60 7.13 7.16 5.88 6.13 5.36	5.6 8.6 13.6 4.0 3.9 4.8 <b>yy(NTU)</b> 6.4 3.0 23.3 7.1 6.0 5.4	8.01 8.12 7.34 7.46 7.97 7.89 7.21 7.18 7.21 7.14 7.08 P 7.23 7.24 7.23 7.26 7.37 7.26 7.37 7.27 7.98 7.27 7.98 7.32 7.35 7.32 7.35 7.32 7.65 7.71 6.96	8.1 7.4 7.9 7.2 7.9 7.1 7.1 7.2 7.3 7.9 7.3 7.7 7.0	4.00 4.00 3.00 3.00 2.00 2.00 3.00 3.00 3.00 3	4.0 3.0 2.0 3.0 3.0 3.0 3.0 3.0 3.0 3.0 2.0 2.0 2.0
Location           MUP-VII (Control)           MUP-VI2 (Control)           MUP-W2 (Control)           MUP-W3 (Control)           MUP-W3 (Control)           MUP-W4 (Impact)           MUP-W6 (mobile)           MUP-W6 (mobile)           MUP-W4 (Impact)           MUP-W4 (Impact)           MUP-W4 (control)           MUP-W4 (control)           MUP-W3 (Control)           MUP-W3 (Control)           MUP-W4 (Impact)           MUP-W3 (Control)           MUP-W4 (Impact)           MUP-W5 (mobile)           MUP-W6 (mobile)           MUP-W6 (control)           MUP-W6 (control)           MUP-W6 (control)	Time           17:10           15:40           15:47           16:27           16:00           16:40           16:45           22-1           7           7           2:05           2:25           2:25           2:35           2:35	Depth (m)         0.3           0.3         0.3           0.2         0.6           0.4         0.3           Depth (m)         0.3           0.3         0.3           0.3         0.3           0.4         0.3           0.5         0.4           0.5         0.4           0.3         0.3	29.1 29.1 29.1 28.2 28.2 28.8 28.8 28.8 28.8 28.8 28	29.1 28.2 28.8 28.8 28.1 28.7 28.7 28.7 28.7 29.6 29.6 29.6 29.6 29.6 29.7 29.3	3.36 3.44 4.61 3.04 3.08 5.83 5.83 5.83 5.83 5.83 5.83 5.83 5.8	- 3.4 4.8 3.1 5.8 5.3 4.8 3.9 4.2 3.2 5.6 4.7 4.8	5170 5280 5060 5130 4960 6010 4960 6010 4970 5840 6010 5840 6010 5840 6010 5840 5840 4310 5840 5540 5540 5540 5540 5540 5540 554	52.2 51.0 49.2 61.4 58.1 50.2 42.6 55.6 49.0 55.4 52.5 51.0	5.43 5.82 9.36 7.88 9.36 7.88 4.01 4.290 4.01 4.01 4.01 4.01 4.01 4.01 4.01 4.0	5.6 8.6 13.6 4.0 3.9 4.8 <b>yy(NTU)</b> 6.4 3.0 23.3 7.1 6.0 5.4	8.01 8.12 7.34 7.74 7.87 7.87 7.87 7.87 7.87 7.87 7.8	8.1 7.4 7.9 7.2 7.9 7.1 7.1 7.2 7.3 7.9 7.3 7.7 7.0	4 00 4 00 3 00 3 00 3 20 3 20	4.0 3.0 2.0 3.0 3.0 3.0 3.0 3.0 3.0 3.0 2.0 2.0 2.0
Lacation MUP-V4 (Control) MUP-V4 (Control) MUP-V42 (Control) MUP-W42 (Control) MUP-W4 (Impact) MUP-W4 (Impact) MUP-W6 (mobile) Date Location MUP-W4 (Control) MUP-W4 (Control) MUP-W4 (Impact) MUP-W4 (Impact) MUP-W5 (mobile) MUP-W6 (mobile) Date Location MUP-W6 (mobile)	Time           17:10           15:40           16:27           16:00           16:40           16:40           16:15           22-1           Time           3:17           2:05           2:45           2:55           2:35           2:4-1           Time           3:20	Depth (m)           0.3           0.3           0.2           0.6           0.4           0.3           0.4           0.3           0.3           0.3           0.4           0.3           0.3           0.3           0.3           0.3           0.4           0.3           0.5           0.4           0.3           0.4           0.3	29.1 29.1 29.1 28.2 28.2 28.8 28.8 28.8 28.8 28.8 28	29.1 28.2 28.8 28.8 28.1 28.7 28.7 28.1 29.6 29.6 29.6 29.6 29.3 29.7 29.3	3.3.6 3.44 4.61 3.04 3.04 3.04 3.08 5.83 5.31 5.29 5.29 4.86 4.77 4.86 4.33 6.43 5.33 4.84 4.11 4.31 3.36 5.54 4.31 5.54 4.31 5.54 4.31 5.54 4.31 5.54 4.31 5.54 4.31 5.55 5.54 5.55 5.54 5.55 5.55 5.55 5.5	3.4 4.8 3.1 5.8 5.3 4.8 5.3 4.8 4.8 4.8 4.2 3.9 4.2 3.2 5.6 4.7 4.8 4.8 4.8 4.8 4.8 4.8 4.8 4.8 4.8 4.8	51 70 52 60 60 51 30 60 49 70 49 30 49 30 49 30 49 30 49 30 49 30 49 30 49 30 49 55 80 55	52.2 51.0 49.2 61.4 58.1 55.2 55.4 55.4 55.4 52.5 51.0 55.4 52.5 51.0	5.43 5.82 9.36 7.88 9.36 7.88 4.01 3.83 4.01 4.76 4.73 4.74 4.76 4.73 7.74 6.32 6.44 2.94 3.07 7.23,60 7.13 7.76 5.88 6.13 5.54 5.54 7.10 7.10 7.10 7.10 7.10 7.10 7.10 7.10	5.6 8.6 13.6 4.0 3.9 4.8 4.8 4.8 4.8 4.8 5.4 6.4 3.0 6.4 7.1 6.0 5.4 5.4	8.01 8.12 7.34 7.74 7.79 7.21 7.89 7.94 7.87 7.88 7.94 7.18 7.18 7.18 7.20 7.20 7.23 7.20 7.23 7.20 7.23 7.20 7.35 7.27 7.35 7.35 7.35 7.32 7.35 7.33	8.1           7.4           7.9           7.2           7.9           7.1 <b>H</b> 7.2           7.3           7.7           7.0 <b>H</b> 7.3           7.7           7.0 <b>H</b> 7.3	4 00 4 00 3 00	<ul> <li>4.0</li> <li>3.0</li> <li>2.0</li> <li>2.0</li> <li>3.0</li> <li>3.0</li> <li>3.0</li> <li>3.0</li> <li>3.0</li> <li>2.0</li> <li>2.0</li> <li>2.0</li> <li>2.0</li> <li>2.0</li> <li>2.0</li> </ul>
Location MUP-V1 (Control) (MUP01/02-W1) MUP-W2 (Control) (MUP01/02-W2) MUP-W3 (Control) MUP-W4 (Impact) MUP-W6 (mobile) Date Location MUP-W4 (Control) (MUP01/02-W1) (MUP01/02-W1) MUP-W3 (Control) MUP-W4 (Impact) MUP-W6 (mobile) MUP-W6 (mobile) Date Location MUP-W6 (control)	Time           17:10           15:40           16:27           16:00           16:40           16:40           16:15           22.4           2:45           2:55           2:55           2:55           2:55           2:45           2:55           2:45	Depth (m)         0.3           0.3         0.3           0.2         0.6           0.4         0.3           Depth (m)         0.3           0.3         0.3           0.3         0.3           0.4         0.3           0.5         0.4           0.3         0.2           0.5         0.4           0.3         0.3	29.1 29.1 29.1 28.2 28.2 28.8 28.8 28.8 28.8 28.8 28	29.1 28.2 28.8 28.8 28.1 28.7 28.7 28.7 28.1 28.7 29.6 29.6 29.6 29.6 29.6 29.7 29.3	3.36 3.44 4.61 3.04 3.08 5.83 5.83 5.83 5.83 5.83 5.83 5.83 5.8	- 3.4 4.8 3.1 5.8 5.3 4.8 - 5.3 4.8 	5170 5280 5060 5130 4960 6010 4960 6010 4970 5840 6010 5840 6010 5840 6010 5840 5840 4310 5840 5540 5540 5540 5540 5540 5540 554	52.2 51.0 49.2 61.4 58.1 50.2 42.6 55.6 49.0 55.4 55.5 51.0 (%)	5.43 5.82 9.36 7.88 9.36 7.88 4.01 4.290 4.01 4.01 4.01 4.01 4.01 4.01 4.01 4.0	5.6 8.6 13.6 4.0 3.9 4.8 4.8 4.8 4.8 4.8 4.8 5.4 5.4 5.4 5.4	8.01 8.12 7.34 7.74 7.87 7.87 7.87 7.87 7.87 7.87 7.8	8.1 7.4 7.9 7.2 7.9 7.1 7.1 7.2 7.3 7.9 7.3 7.7 7.0	4 00 4 00 3 00 3 00 3 20 3 20	4.0 3.0 2.0 3.0 3.0 3.0 3.0 3.0 3.0 2.0 2.0 2.0 2.0 3.0 3.0 3.0 3.0 3.0 3.0 3.0 3.0 3.0 3
Lacation MUP-V41 (Control) (MUP01/02-W1) MUP-W23 (Control) (MUP01/02-W2) MUP-W4 (Impact) MUP-W4 (Impact) MUP-W6 (mobile) Date Location MUP-W4 (Control) (MUP01/02-W1) MUP-W3 (Control) MUP-W4 (Impact) MUP-W4 (Impact) MUP-W6 (mobile) MUP-W6 (mobile) Date Location MUP-W6 (control) MUP-W6 (control) MUP-W1 (Control) (MUP01/02-W1) (MUP01/02-W1) (MUP01/02-W1) (MUP-W2 (Control) (MUP-W1 (Control) (MUP-W1 (Control) (MUP-W1 (Control) (MUP-W2 (Contr	Time           17:10           15:40           16:27           16:00           16:40           16:15           2:05           2:45           2:35           2:35           2:35           2:32           2:4-1           Time           3:20           2:05	Depth (m)           0.3           0.3           0.3           0.4           0.3           0.4           0.3           0.4           0.3           0.4           0.3           0.3           0.4           0.3           0.3           0.4           0.3           0.4           0.3           0.4           0.3           0.4           0.3           0.4           0.3           0.3	29.1 29.1 29.1 28.2 28.2 28.8 28.8 28.8 28.8 28.8 28	29.1 28.2 28.8 28.8 28.1 28.7 28.7 28.7 29.6 29.6 29.6 29.6 29.6 29.7 29.3 29.7 29.3	3.36 3.44 4.61 3.04 3.04 3.06 5.63 5.83 5.83 5.83 5.83 5.83 5.83 5.83 5.8	3.4 4.8 3.1 5.8 5.3 4.8 5.3 4.8 7 3.9 4.2 3.2 5.6 4.7 4.8 7 4.8 7 4.8 7 4.8 7 4.8	51 70 52 60 50 60 51 30 49 60 60 10 57 70 58 40 57 70 58 40 57 70 55 80 54 40 55 80 54 40 55 80 54 40 55 80 54 40 55 30 50 30 50 50 50 50 50 50 50 50 50 50 50 50 50	52.2 51.0 49.2 61.4 58.1 50.2 (%) 42.6 55.6 49.0 55.4 52.5 51.0 (%) 43.9 55.2	5.43 5.82 9.36 7.88 9.36 7.88 4.01 3.89 4.01 3.88 4.01 4.76 4.73 4.76 4.73 6.44 4.76 4.73 6.44 7.78 6.44 7.73 6.44 7.73 6.58 6.13 5.58 6.13 5.54 7.13 7.14 7.14 7.15 7.14 7.15 7.15 7.15 7.15 7.15 7.15 7.15 7.15	5.6 8.6 13.6 4.0 3.9 4.8 4.8 4.8 4.8 4.8 5.4 5.4 5.4 5.4 5.4 5.4 5.4	8.01 8.12 7.34 7.74 7.89 7.87 7.87 7.87 7.88 7.88 7.94 7.18 7.18 7.28 7.20 7.23 7.26 7.23 7.26 7.23 7.26 7.37 7.27 7.27 7.27 7.26 7.35 7.27 7.27 7.27 7.35 7.27 7.27 7.27 7.27 7.27 7.27 7.27 7.2	8.1           7.4           7.9           7.2           7.9           7.1 <b>H</b> 7.2           7.3           7.7           7.0 <b>H</b> 7.3           7.7           7.0 <b>H</b> 7.3           7.7           7.0	4.00 4.00 3.00 3.00 3.00 4.2 2.00 3.00 3.00 3.00 3.00 3.00 3.00 3.	4.0 3.0 2.0 3.0 3.0 3.0 3.0 3.0 3.0 2.0 2.0 5 2.0 3.0 3.0 3.0 3.0 3.0 3.0 3.0 3
Location MUP-VH (Control) (MUP01/02-VH2) MUP-W2 (Control) (MUP01/02-W2) MUP-W4 (Impact) MUP-W4 (Impact) MUP-W4 (Impact) MUP-W4 (Impact) MUP-W4 (Control) (MUP01/02-VH2) MUP-W3 (Control) MUP-W4 (Impact) MUP-W4 (Impac	Time           17:10           15:40           16:27           16:00           16:40           16:40           16:15           22-1           Time           3:17           2:05           2:45           2:55           2:35           2:4-1           Time           3:20	Depth (m)           0.3           0.3           0.2           0.6           0.4           0.3           0.4           0.3           0.3           0.3           0.4           0.3           0.3           0.3           0.3           0.3           0.4           0.3           0.5           0.4           0.3           0.4           0.3	29-1 29-1 29-1 28-2 28-2 28-8 28-8 28-8 28-8 28-8 28	29.1 28.2 28.8 28.8 28.1 28.7 28.7 28.1 29.6 28.1 29.6 29.6 29.6 29.3 29.7 29.3	3.36 3.44 4.61 4.61 3.04 3.04 3.04 3.04 3.04 3.04 3.04 4.30 4.30	3.4 4.8 3.1 5.8 5.3 4.8 5.3 4.8 4.8 4.8 4.2 3.9 4.2 3.2 5.6 4.7 4.8 4.8 4.8 4.8 4.8 4.8 4.8 4.8 4.8 4.8	5170 5280 5060 5130 4960 6010 4960 6010 4970 5840 6010 5840 6010 5840 6010 5540 5540 5540 5540 5540 5540 5540 5	52.2 51.0 49.2 61.4 58.1 55.2 55.4 55.4 55.4 52.5 51.0 55.4 52.5 51.0	5.43 5.82 9.36 7.88 9.36 7.88 4.01 4.290 4.01 4.01 4.01 4.01 4.01 4.01 4.01 4.0	5.6 8.6 13.6 4.0 3.9 4.8 4.8 4.8 4.8 4.8 5.4 6.4 3.0 6.4 7.1 6.0 5.4 5.4	8.01 8.12 7.34 7.74 7.87 7.87 7.87 7.87 7.87 7.87 7.8	8.1           7.4           7.9           7.2           7.9           7.1 <b>H</b> 7.2           7.3           7.7           7.0 <b>H</b> 7.3           7.7           7.0 <b>H</b> 7.3           7.7           7.0	4 00 4 00 3 00	<ul> <li>4.0</li> <li>3.0</li> <li>2.0</li> <li>2.0</li> <li>3.0</li> <li>3.0</li> <li>3.0</li> <li>3.0</li> <li>3.0</li> <li>2.0</li> <li>2.0</li> <li>2.0</li> <li>2.0</li> <li>2.0</li> <li>2.0</li> </ul>
Lacation MUP-V41 (Control) (MUP01/02-W1) MUP-W23 (Control) (MUP01/02-W2) MUP-W4 (Impact) MUP-W4 (Impact) MUP-W6 (mobile) Date Location MUP-W4 (Control) (MUP01/02-W1) MUP-W3 (Control) MUP-W4 (Impact) MUP-W4 (Impact) MUP-W6 (mobile) MUP-W6 (mobile) Date Location MUP-W1 (Control) MUP-W6 (mobile) Date Location MUP-W1 (Control) (MUP01/02-W1) (MUP01/02-W1) (MUP01/02-W1) (MUP-W2 (Control) (MUP-W1 (Control) (MUP-W1 (Control) (MUP-W1 (Control) (MUP-W2 (Control)	Time           17:10           15:40           16:27           16:00           16:40           16:15           2:05           2:45           2:25           2:35           2:35           2:35           2:32           2:4-1           Time           3:20           2:05	Depth (m)           0.3           0.3           0.3           0.4           0.3           0.4           0.3           0.4           0.3           0.4           0.3           0.3           0.4           0.3           0.3           0.4           0.3           0.4           0.3           0.4           0.3           0.4           0.3           0.4           0.3           0.3	29-1 29-1 29-1 29-1 28-2 28-8 28-8 28-8 28-8 28-8 28-8 28	29.1 28.2 28.8 28.8 28.1 28.7 28.7 28.7 29.6 29.6 29.6 29.6 29.6 29.7 29.3 29.7 29.3	3.3.6 3.44 4.61 3.04 3.04 3.06 5.69 5.83 5.31 5.29 5.29 5.29 4.86 4.77 4.86 4.77 4.81 4.31 3.36 5.54 4.71 4.62 5.54 4.77 4.62 5.54 4.77 4.61 5.54 4.77 5.54 4.77 5.57 4.77 5.74 5.74	3.4 4.8 3.1 5.8 5.3 4.8 5.3 4.8 7 3.9 4.2 3.2 5.6 4.7 4.8 7 7 4.8 7 7 4.8 7 7 4.8	51 70 52 60 50 60 51 30 49 60 60 10 49 60 60 10 49 60 60 10 53 70 53 80 57 70 53 80 57 70 53 80 49 30 49 30 49 30 49 30 49 30 49 30 49 40 55 80 54 40 55 80 54 40 55 80 54 40 55 80 54 40 55 80 54 40 55 80 54 40 55 80 56 80 56 80 56 80 56 80 56 80 56 80 56 80 57 80 58 50 58 50 50 50 50 50 50 50 50 50 50 50 50 50 50 50 50 50 50 50 5	52.2 51.0 49.2 61.4 58.1 50.2 (%) 42.6 55.6 49.0 55.4 52.5 51.0 (%) 43.9 55.2	5.43 5.82 9.36 7.88 9.36 7.88 4.01 3.83 4.01 4.76 4.73 4.01 4.76 4.73 4.74 4.74 4.76 4.73 4.74 7.16 6.32 6.44 7.13 7.16 5.88 6.33 5.84 7.13 7.16 5.84 6.32 7.85 5.84 7.85 5.84 7.85 5.84 7.85 5.84 7.85 5.84 7.85 5.85 5.85 5.84 7.85 5.85 5.85 5.85 5.85 5.85 5.85 5.85	5.6 8.6 13.6 4.0 3.9 4.8 4.8 4.8 4.8 4.8 5.4 5.4 5.4 5.4 5.4 5.4 5.4	8.01 8.12 7.34 7.67 7.87 7.87 7.87 7.88 7.94 7.88 7.94 7.94 7.94 7.95 7.95 7.94 7.95 7.94 7.95 7.95 7.97 7.35 7.35 7.35 7.32 7.35 7.32 7.32 7.32 7.32 7.32 7.32 7.32 7.32	8.1           7.4           7.9           7.2           7.9           7.1 <b>H</b> 7.2           7.3           7.7           7.0 <b>H</b> 7.3           7.7           7.0 <b>H</b> 7.3           7.7           7.0	4 00 4 00 3 00 2 00 2 00 2 00 2 00 2 00 2 00 2 00 2 00 3 00 3 00 3 00 2 0 2	4.0 3.0 2.0 3.0 3.0 3.0 3.0 3.0 3.0 2.0 2.0 5 2.0 3.0 3.0 3.0 3.0 3.0 3.0 3.0 3
Location MUP-V41 (Control) (MUP0102-V42) MUP-V42 (Control) MUP-W4 (Impact) MUP-W4 (Control) MUP-W4 (Control) MUP-W4 (Control) MUP-W4 (Control) MUP-W4 (Control) MUP-W3 (Control) MUP-W3 (Control) MUP-W4 (Impact)	Time           17:10           15:40           16:27           16:00           16:40           16:15           22:45           2:35           2:45           2:25           2:35           2:4-1           Time           3:20           2:05           2:25           2:35           2:4-1           2:05           2:25           2:25           2:25           2:25           2:25           2:25           2:25           2:25           2:25           2:25	Depth (m)           0.3           0.3           0.3           0.2           0.6           0.4           0.3           0.4           0.3           0.4           0.3           0.3           0.3           0.3           0.3           0.3           0.3           0.4           0.3           0.4           0.3           0.4           0.3           0.4           0.3           0.3           0.3           0.3           0.3           0.3           0.3           0.3           0.3	29-1 29-1 29-1 28-2 28-2 28-8 28-8 28-8 28-8 28-8 28	29.1 28.2 28.8 28.8 28.1 28.7 28.1 28.7 28.1 28.7 28.1 29.6 29.6 29.6 29.6 29.6 29.7 29.3 29.7 29.1 29.7 28.6 29.8	3.36 3.44 4.61 4.61 3.04 3.04 3.04 3.04 3.04 3.04 3.04 4.30 4.30	3.4 4.8 3.1 5.8 5.3 4.8 5.3 4.8 4.8 4.2 3.9 4.2 3.9 4.2 3.2 5.6 4.7 4.8 4.7 4.8 4.7 4.8 5.6 5.7 5.7	5170 5280 5060 5130 4960 6010 4960 6010 4970 5540 5540 5540 5540 5540 5540 5540 55	52.2 51.0 49.2 61.4 58.1 50.2 (%6) 42.6 55.6 49.0 55.4 52.5 51.0 (%6) 43.9 55.2 44.9 55.2 44.9 55.2 46.3 57.9	5.43 5.82 9.36 7.88 9.36 7.88 4.01 4.290 4.01 4.01 4.01 4.01 4.01 4.01 4.01 4.0	5.6 8.6 13.6 4.0 3.9 4.8 4.8 4.8 4.8 4.8 4.8 6.4 3.0 23.3 7.1 6.0 5.4 5.4 5.4 5.4 9.6 6.4	8.01 8.12 7.34 7.74 7.87 7.87 7.87 7.87 7.87 7.87 7.8	8.1           7.4           7.9           7.2           7.9           7.1 <b>H</b> 7.2           7.3           7.9           7.3           7.7           7.0 <b>H</b> 7.3           7.7           7.0           7.3           7.8           7.9           7.6	4 00 4 00 3 00	<ul> <li>4.0</li> <li>3.0</li> <li>2.0</li> <li>2.0</li> <li>3.0</li> <li>3.0</li> <li>3.0</li> <li>3.0</li> <li>3.0</li> <li>3.0</li> <li>2.0</li> <li>2.0</li> <li>2.0</li> <li>3.0</li> <li>2.0</li> <li>2.0</li> <li>3.0</li> <li>3.0</li></ul>
Location MUP-V41 (Control) (MUP01/02-W1) MUP-W2 (Control) (MUP01/02-W2) MUP-W4 (Impact) MUP-W4 (Impact) MUP-W6 (mobile) Date Location MUP-W4 (Control) MUP-W3 (Control) MUP-W4 (Impact) MUP-W4 (Impact) MUP-W4 (Impact) MUP-W4 (Impact) MUP-W4 (Impact) MUP-W4 (Impact) MUP-W4 (Impact) MUP-W4 (Impact) MUP-W4 (Control) MUP-W4 (Control) MUP-W4 (Control) MUP-W4 (Control) MUP-W3 (Control) MUP-W3 (Control) MUP-W3 (Control)	Time           17:10           15:40           16:27           16:00           16:40           16:15           22-4           2:45           2:55           2:55           2:55           2:55           2:55           2:35           2:4-1           Time           3:20           2:05           2:05           2:05           2:05           2:06           2:05	Depth (m)           0.3           0.3           0.3           0.4           0.3           0.4           0.3           0.4           0.3           0.4           0.3           0.3           0.4           0.3           0.3           0.4           0.3           0.4           0.3           0.4           0.3           0.3           0.3           0.3           0.3           0.3           0.3	29.1 29.1 29.1 28.2 28.8 28.8 28.8 28.8 28.8 28.8 28	29.1 28.2 28.8 28.8 28.1 28.7 28.7 29.6 29.6 29.6 29.6 29.6 29.7 29.3 29.7 29.3	3.36 3.44 4.61 3.04 3.08 5.69 5.83 5.83 5.83 5.83 5.83 5.83 5.83 5.83	3.4 4.8 3.1 5.8 5.3 4.8 4.8 4.8 4.8 4.2 3.2 5.6 4.7 4.8 4.7 4.8 3.6 4.1 3.2	51 70 52 60 50 60 51 30 49 60 60 10 57 70 88 40 57 70 88 40 57 70 49 30 49 40 55 80 55 80	52.2 51.0 49.2 61.4 58.1 50.2 (%) 42.6 55.6 49.0 55.4 55.5 51.0 (%) 43.9 55.2 51.0	5.43 5.82 9.36 7.88 9.36 7.88 4.01 3.83 4.01 4.74 4.01 4.76 4.73 4.01 4.76 4.73 7.06 6.32 6.44 7.73 7.16 5.88 6.33 5.84 7.73 5.84 7.73 7.13 7.16 2.99 7.13 7.13 7.13 7.14 7.13 7.14 7.14 7.14 7.14 7.14 7.14 7.14 7.14	5.6 8.6 13.6 4.0 3.9 4.8 4.8 4.8 4.8 4.8 5.4 5.4 5.4 5.4 5.4 5.4 9.6	8.01 8.12 7.34 7.74 7.797 7.89 7.89 7.89 7.81 7.88 7.94 7.78 7.74 7.23 7.20 7.35 7.27 7.23 7.27 7.29 7.23 7.27 7.29 7.23 7.27 7.29 7.23 7.27 7.29 7.25 7.27 7.25 7.25 7.25 7.25 7.25 7.25	8.1           7.4           7.9           7.2           7.9           7.1           7.2           7.3           7.9           7.3           7.7           7.0           H           7.3           7.7           7.0           7.3           7.7           7.0           7.3           7.7           7.0	4 00 4 00 3 00 3 00 3 00 4 2 2 2 0 0 3 00 3 00 3 00 3 00 3 00 3 00	<ul> <li>4.0</li> <li>3.0</li> <li>2.0</li> <li>2.0</li> <li>3.0</li> <li>3.0</li> <li>3.0</li> <li>3.0</li> <li>3.0</li> <li>3.0</li> <li>2.0</li> <li>2.0</li> <li>2.0</li> <li>2.0</li> <li>3.0</li> <li>3.0</li> <li>2.0</li> <li>3.0</li> <li>3.0</li></ul>
Location MUP-V41 (Control) (MUP0102-W12) MUP-W22 (Control) MUP-W4 (Impact) MUP-W4 (Control) MUP-W4 (Control) MUP-W4 (Control) MUP-W4 (Control) MUP-W4 (Control) MUP-W3 (Control) MUP-W3 (Control) MUP-W4 (Impact)	Time           17:10           15:40           16:27           16:00           16:40           16:15           22:45           2:35           2:45           2:25           2:35           2:4-1           Time           3:20           2:05           2:35	Depth (m)           0.3           0.3           0.3           0.2           0.6           0.4           0.3           0.4           0.3           0.4           0.3           0.3           0.3           0.3           0.3           0.3           0.3           0.4           0.3           0.4           0.3           0.4           0.3           0.4           0.3           0.3           0.3           0.3           0.3           0.3           0.3           0.3           0.3	291.1 293.2 28.2 28.8 28.8 28.8 28.8 28.8 28.8 2	29.1 28.2 28.8 28.8 28.1 28.7 28.1 28.7 28.1 28.7 29.6 29.6 29.6 29.6 29.6 29.7 29.3 29.7 29.1 29.7 28.6 29.8	3.36 3.44 4.61 4.61 3.04 3.04 3.04 3.04 3.04 3.04 3.04 4.30 4.30	3.4 4.8 3.1 5.8 5.3 4.8 5.3 4.8 4.8 4.2 3.9 4.2 3.9 4.2 3.2 5.6 4.7 4.8 4.7 4.8 4.7 4.8 5.6 5.7 5.7	5170 5280 5060 5130 4960 4960 4970 5840 4970 510 5540 5540 5540 5540 5540 5540 5540	52.2 51.0 49.2 61.4 58.1 50.2 (%6) 42.6 55.6 49.0 55.4 52.5 51.0 (%6) 43.9 55.2 44.9 55.2 44.9 55.2 46.3 57.9	5.43 5.82 9.36 7.88 9.36 7.88 4.01 4.290 14.30 3.93 4.01 4.01 4.01 4.01 4.01 4.01 4.01 4.01	5.6 8.6 13.6 4.0 3.9 4.8 4.8 4.8 4.8 4.8 4.8 6.4 3.0 23.3 7.1 6.0 5.4 5.4 5.4 5.4 9.6 6.4	8.01 8.12 7.34 7.37 7.87 7.87 7.87 7.87 7.87 7.87 7.87	8.1           7.4           7.9           7.2           7.9           7.1 <b>H</b> 7.2           7.3           7.9           7.3           7.7           7.0 <b>H</b> 7.3           7.7           7.0           7.3           7.8           7.9           7.6	4 00 4 00 3 00	<ul> <li>4.0</li> <li>3.0</li> <li>2.0</li> <li>2.0</li> <li>3.0</li> <li>3.0</li> <li>3.0</li> <li>3.0</li> <li>3.0</li> <li>3.0</li> <li>2.0</li> <li>2.0</li> <li>2.0</li> <li>3.0</li> <li>2.0</li> <li>2.0</li> <li>3.0</li> <li>3.0</li></ul>
Location MUP-W1 (Control) (MUP01/02-W2) MUP-W2 (Control) (MUP01/02-W2) MUP-W4 (Impact) MUP-W6 (mobile) Date Location MUP-W1 (Control) (MUP01/02-W1) (MUP01/02-W1) (MUP01/02-W1) MUP-W3 (Control) MUP-W4 (Impact) MUP-W4 (Impact) MUP-W3 (Control) (MUP01/02-W1) MUP-W3 (Control) MUP-W4 (Impact) MUP-W3 (Control) MUP-W3 (Control) MUP-W3 (Control) MUP-W3 (Control) MUP-W3 (Control) MUP-W3 (Control) MUP-W3 (Control) MUP-W3 (Control) MUP-W4 (Impact)	Time           17:10           15:40           16:27           16:00           16:40           16:15           22.41           2:05           2:25           2:25           2:25           2:35           2:44           3:20           2:05           2:05           2:05           2:25           2:25           2:25           2:25           2:25           2:25           2:25           2:25           2:25           2:25           2:25           2:25	Depth (m)           0.3           0.3           0.3           0.4           0.3           0.4           0.3           0.4           0.3           0.4           0.3           0.3           0.3           0.3           0.3           0.3           0.3           0.4           0.3           0.4           0.3           0.4           0.3           0.3           0.3           0.3           0.4	29.1 29.1 29.1 28.2 28.8 28.8 28.8 28.8 28.8 28.8 28	29.1 28.2 28.8 28.8 28.7 28.7 28.7 28.7 29.6 29.6 29.6 29.6 29.3 29.7 29.1 29.1 29.7 29.1 29.7 29.8 29.7 29.8	3.36 3.44 4.61 3.04 3.08 5.69 5.83 5.83 5.83 5.29 5.83 5.29 4.86 4.77 4.86 4.87 4.87 4.84 4.81 4.31 3.32 5.54 4.77 4.86 4.77 4.86 4.77 4.85 4.77 4.85 4.77 4.85 4.77 4.85 4.77 5.74 4.85 4.13 3.57 4.85 5.74 4.85 5.74 4.85 5.74 4.77 5.74 5.74 4.85 5.74 4.77 5.74 5.74 4.85 5.74 4.77 5.74 5.77 5.77 5.77 5.77 5.7	3.4 4.8 3.1 5.8 5.3 4.8 <b>mg/L)</b> 3.9 4.2 3.9 4.2 3.2 5.6 4.7 4.8 <b>mg/L)</b> 3.6 4.7 4.8 <b>mg/L)</b> 3.6 4.7 4.8	51 70 52 60 50 60 51 30 49 60 60 10 57 70 88 40 57 70 88 40 57 70 49 30 49 40 55 80 55 80	52.2 51.0 49.2 61.4 58.1 50.2 (%6) 42.6 55.6 49.0 55.4 52.5 51.0 (%6) 43.9 55.2 43.9 55.2 46.3 57.9 53.5	5.43 5.82 9.36 7.88 9.36 7.88 4.01 3.83 4.01 4.74 4.01 4.76 4.73 4.01 4.76 4.73 7.06 6.32 6.44 7.73 7.16 5.88 6.33 5.84 7.73 5.84 7.73 7.13 7.16 2.99 7.13 7.13 7.13 7.14 7.13 7.14 7.14 7.14 7.14 7.14 7.14 7.14 7.14	5.6 8.6 13.6 4.0 3.9 4.8 4.8 4.8 4.8 4.8 4.8 5.4 5.4 5.4 5.4 5.4 5.4 5.4 5.4 6.0 5.4 5.4 5.4 5.4 5.4 5.4 5.4 5.4 5.4 5.4	8.01 8.12 7.34 7.74 7.77 7.87 7.87 7.88 7.94 7.88 7.94 7.78 7.78 7.74 7.23 7.20 7.35 7.27 7.27 7.27 7.27 7.27 7.35 7.27 7.35 7.35 7.35 7.35 7.35 7.35 7.35 7.3	8.1           7.4           7.9           7.2           7.9           7.1 <b>H</b> 7.2           7.9           7.3           7.7           7.0 <b>H</b> 7.3           7.7           7.3           7.7           7.0 <b>H</b> 7.3           7.8           7.8           7.8           7.8           7.8	4 00 4 00 3 00 3 00 3 00 4 2 2 2 0 0 3 00 3 00 3 00 3 00 3 00 3 00	4.0 3.0 2.0 3.0 3.0 3.0 3.0 3.0 3.0 2.0 2.0 2.0 3.0 2.0 3.0 2.0 3.0 2.0 2.0 3.0 2.0 2.0 3.0 2.0 2.0 3.0 2.0 2.0 3.0 3.0 3.0 3.0 3.0 3.0 3.0 3.0 3.0 3





# Appendix I

# **Graphic Plot of Monitoring**

- 1. Construction Noise
- 2. Air Quality
- 3. Water Quality


AUES

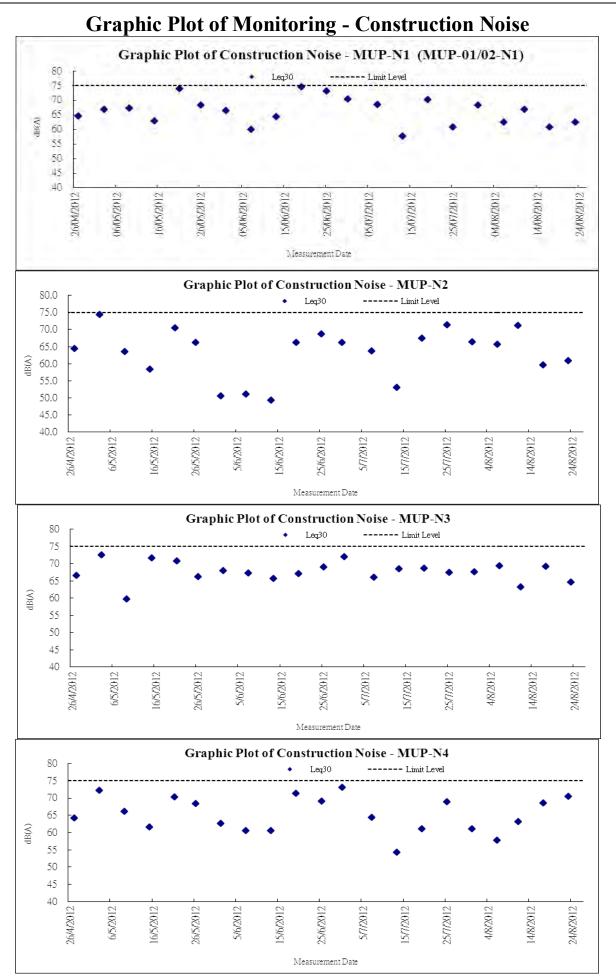







## **Graphic Plot of Monitoring - Air Quality Graphic Plot – 24-hour TSP**

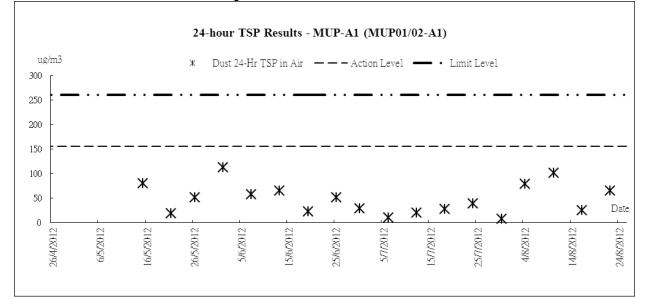

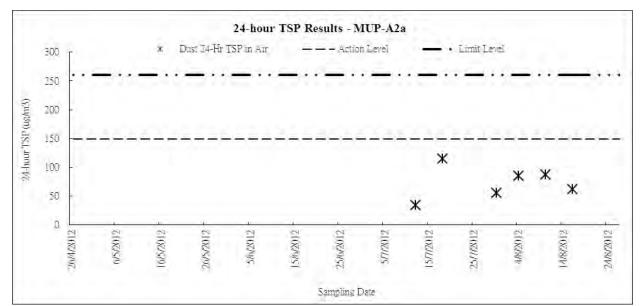


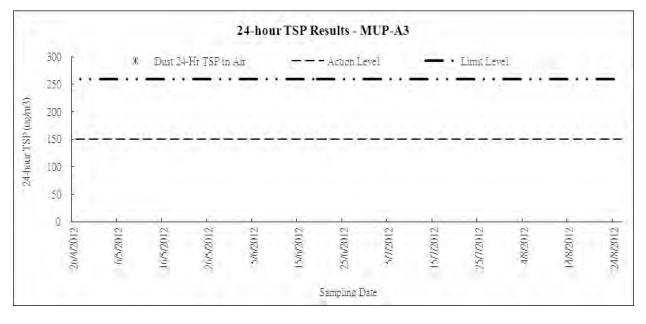



Z:Uobs\2008\TCS00409 (DC-2007-08)\600\EM&A Report\DP\Monthly Report\42nd monthly - August 2012\R1185v1\_July DP.docx Action-United Environmental Services and Consulting



## **Graphic Plot – 1-hour TSP**

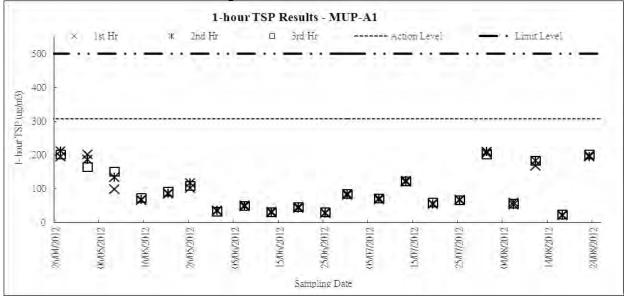

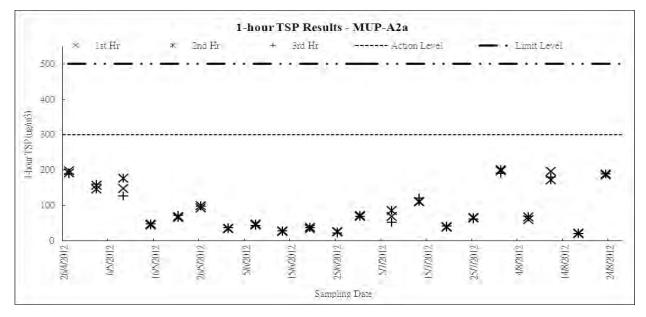


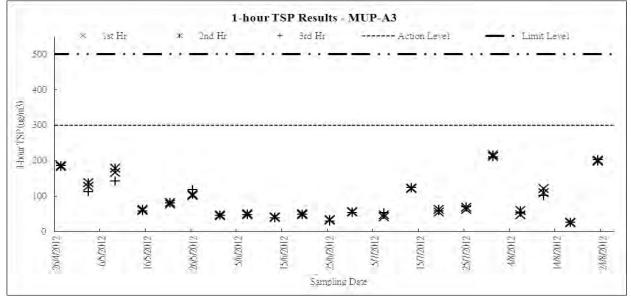


Z:\Jobs\2008\TCS00409 (DC-2007-08)\600\EM&A Report\DP\Monthly Report\42nd monthly - August 2012\R1185v1\_July DP.docx Action-United Environmental Services and Consulting




## **Graphic Plot of Monitoring - Water Quality**

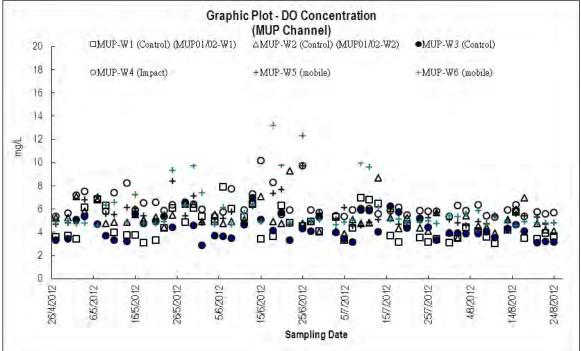


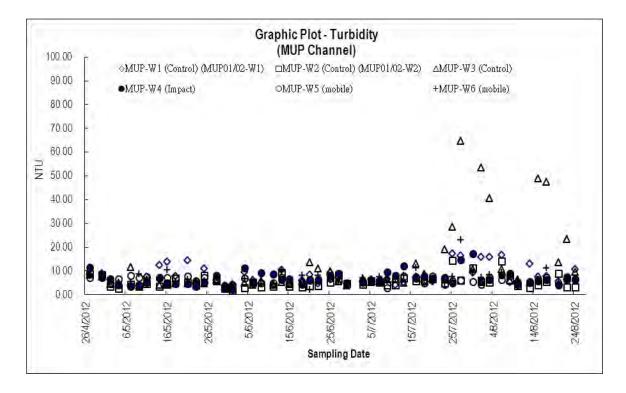

#### DSD Contract DC/2007/08 – Drainage Improvement Works in Tai Po Tin, Ping Che, Man Uk Pin and Lin Ma Hang 42nd Monthly EM&A Report for the Designated Project Works – August 2012



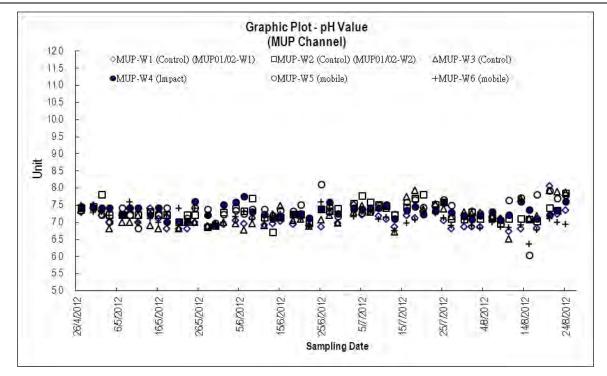

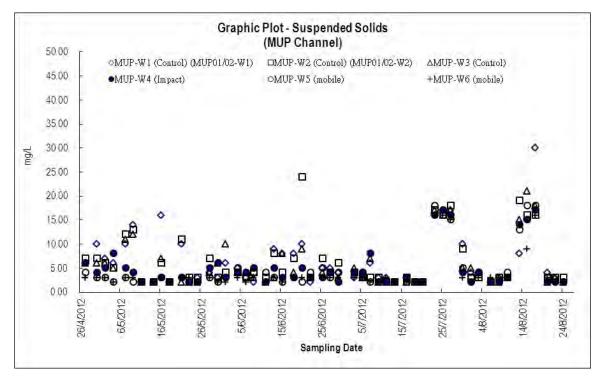

Z:\Jobs\2008\TCS00409 (DC-2007-08)\600\EM&A Report\DP\Monthly Report\42nd monthly - August 2012\R1185v1\_July DP.docx Action-United Environmental Services and Consulting



# Appendix J

# **Meteorological Records**

S/SE

N/NW

N/NW

						Ta Kwu Ling					
Date		Weather	Total Rainfall (mm)	Mean Air Temp. (°C)	Wind Speed (km/h)	Mean Relative Humidity (%)	Wind Direction				
26-Jul-12	Thu	Cloudy with scattered showers and a few squally thunderstorms.	28.1	25.3	7.5	90.5	Е				
27-Jul-12	Fri	Light winds.	25.7	25.9	8.9	89.7	E/SE				
28-Jul-12	Sat	Light winds.	Trace	27.3	5.9	80	Е				
29-Jul-12	Sun	Isolated showers in the afternoon	0	28.5	7.5	73.5	E/NE				
30-Jul-12	Mon	fine and very hot.	0	29	8.2	72.2	W/SW				
31-Jul-12	Tue	Amber Rainstorm Warning Signal	9.5	30.5	8.2	79	W/SW				
1-Aug-12	Wed	Isolated showers and thunderstorms	0.2	Maintenance	5.4	Maintenance	N/NW				
2-Aug-12	Thu	Sunny periods with haze.	0	Maintenance	4.9	Maintenance	N/NW				
3-Aug-12	Fri	isolated showers and one or two thunderstorms.	Trace	29.8			SW				
4-Aug-12	Sat	It will be very hot	0.4	29.2	7.8	69.2	SW				
5-Aug-12	Sun	Light to moderate westerly winds.	6.8	29.3	8.5	72.5	E/SE				
6-Aug-12	Mon	Isolated showers and thunderstorms	2.8	28.8	6.6	80	E/SE				
7-Aug-12	Tue	Fine and very hot but hazy.	Trace	29.7	5	76.7	SW				
8-Aug-12	Wed	Sunny periods with haze.	0	30.8	5.7	73	SW				
9-Aug-12	Thu	Cloudy with showers and isolated thunderstorms.	0	30.9	8.5	68	SW				
10-Aug-12	Fri	Moderate southwesterly winds.	7.7	29	5.3	78	S/SE				
11-Aug-12	Sat	Light to moderate southerly winds.	64.7	28.4	7.7	81	S/SE				
12-Aug-12	Sun	Mainly cloudy with showers	12.4	28.3	5.8	78	E/SE				
13-Aug-12	Mon	Light to moderate southerly winds.	9.5	28	6	85.5	Е				
14-Aug-12	Tue	Fine and very hot but hazy.	1.9	28.8	6.6	80.5	Е				
15-Aug-12	Wed	It will be very hot	0	29	4.9	73	Ν				
16-Aug-12	Thu	Cloudy with occasional squally showers and thunderstorms.	15.4	29.4	9	76.7	E/NE				
17-Aug-12	Fri	Light winds.	Trace	27.7	16.4	79	Е				
18-Aug-12	Sat	Mainly fine and hot	0.1	28.9	4.9	74.5	W/NW				
19-Aug-12	Sun	Light winds.	0	28.8	8.2	76	N/NW				
20-Aug-12	Mon	Hot during the day	0	29	5.5	75	SE				
21-Aug-12	Tue	Sunny periods with haze	Trace	28.1	6.6	78	E/SE				
22-Aug-12	Wed	fine, very hot, hazy	5.1	27.5	5.8	83.5	W/SW				

0

0

Trace

28

29.1

29.2

6.5

7

8

76.5

73

72.5

#### Meteorological Data in this Reporting Month

very hot, fine , haze. \* The record was extracted from The Hong Kong Observatory Weather Stations

isolated showers

winds moderate

23-Aug-12 Thu

Fri

Sat

24-Aug-12

25-Aug-12



Appendix K

# **Proforma of the Weekly ET Site Inspection Checklist**



Proje	iect: DSD Contract No. DC/2007/08		cted by		Checkli No.		00708-26-Jul-2012		
.,	Drainage Improvement Works at Tai Po Tin, Ping Che,	_ ·	IEC/IEC's Representative:						
	Man Uk Pin and Lin Ma Hang	RE/ R	E's Represe	entative:					
Inspe	ection	ETL/ I	ET's Repres	entative:	Wong F. N./Ben Tam				
Date:	_26-July-2012		O's Represe actor's	entative:	Lai Kwo	k Hong Al	ex		
Time:	15:00		esentative:						
PAR	GENERAL INFORMATION			Env	vironment	al Permit	No. EP-277/2007/A		
	ather: Sunny Fine Cloudy	Rainy	Ca	lm					
	perature: 31 ℃								
Hum									
	nannel	Calm Area Insp	ected						
TKL MU	L02 L07 JP01/02 JP05								
PART	B: SITE AUDIT								
Note:	Not Obs.: Not Observed; Yes: Compliance; No: Non-Compliance; Follow Up: Observations requiring follow-Up actions N/A: Not Applicable	Not Obs.	Yes	No	Follow Up	N/A	Photo/ Remarks		
Sectio	on 1: Water Quality	1							
1.01	Is an effluent discharge license obtained for the Project?	$\checkmark$							
1.02	Is the effluent discharged in accordance with the discharge licence?	? 🗹							
1.03	Is the discharge of turbid water avoided?		$\checkmark$						
1.04	Are there proper desilting facilities in the drainage systems to reduce SS levels in effluent?	р П	$\checkmark$						
1.05	Are there channels, sandbags or bunds to direct surface run-off to sedimentation tanks?	р П	$\checkmark$						
1.06	Are there any perimeter channels provided at site boundaries to intercept storm runoff from crossing the site?	р П	$\checkmark$						
1.07	Is drainage system well maintained?		$\checkmark$						
1.08	As excavation proceeds, are temporary access roads protected by crushed stone or gravel?	/	$\checkmark$						
1.09	Are temporary exposed slopes properly covered?		$\checkmark$						
1.10	Are earthworks final surfaces well compacted or protected?		$\checkmark$						
1.11	Are manholes adequately covered or temporarily sealed?	$\checkmark$							
1.12	Are there any procedures and equipment for rainstorm protection?		$\checkmark$						
1.13	Are wheel washing facilities well maintained?		$\checkmark$						
1.14	Is runoff from wheel washing facilities avoided?		$\checkmark$						
1.15	Are there toilets provided on site?		$\checkmark$						
1.16	Are toilets properly maintained?		$\checkmark$						
1.17	Are the vehicle and plant servicing areas paved and located within roofed areas?	י	$\checkmark$						
1.18	Is the oil leakage or spillage avoided?		$\checkmark$						
1.19	Are there any measures to prevent leaked oil from entering the drainage system?	e 🗌	$\checkmark$						
1.20	Are there any measures to collect spilt cement and concrete washings during concreting works?	•							



Note:	Not Obs.: Not Observed; Yes: Compliance; No: Non-Compliance; Follow Up: Observations requiring follow-Up actions N/A: Not Applicable	Not Obs.	Yes	No	Follow Up	N/A	Photo/ Remarks
1.21	Are there any oil interceptors/grease traps in the drainage systems for vehicle and plant servicing areas, canteen kitchen, etc?	$\checkmark$					
1.22	Are the oil interceptors/grease traps maintained properly?	$\checkmark$					
1.23	Is used bentonite recycled where appropriate?	$\checkmark$					
1.24	Designated settlement area for runoff/wheel wash waste is provide and located at the streambed with 1-2m deep, 12m long and around 50m3 capacities for sedimentation.		$\checkmark$				
1.25	No excavation is undertaken in the settlement area.		$\checkmark$				
1.26	Concreting wastes water should be neutralized below the pH Action Levels before discharge.	$\checkmark$					
1.27	Mobile toilets should provide on site and located away the stream course.		$\checkmark$				
1.25	License collector should be employed for handling the sewage of mobile toilet.		$\checkmark$				
1.26	Is ponding /stand water avoided		$\checkmark$				
Sectio	n 2: Air Quality						
2.01	Are there wheel washing facilities with high pressure jets provided at every vehicle exit point?		$\checkmark$				
2.02	Are vehicles washed to remove any dusty materials from their bodies and wheels before leaving construction sites?		$\checkmark$				
2.03	Are the excavated materials sprayed with water during handling?		$\checkmark$				
2.04	Are stockpiles of dusty materials sprayed with water, covered or placed in sheltered areas?		$\checkmark$				
2.05	Is the exposed earth properly treated within six months after the last construction activities?		$\checkmark$				
2.06	Are the access roads sprayed with water to maintain the entire road surface wet or paved?		$\checkmark$				
2.07	Is the surface where any drilling, cutting, polishing or breaking operation continuously sprayed with water?		$\checkmark$				
2.08	Is the load on vehicles covered entirely by clean impervious sheeting?		$\checkmark$				
2.09	Is the loading of materials to a level higher than the side and tail boards during transportation by vehicles avoided?		$\checkmark$				
2.10	Is the road leading to the construction site within 30m of the vehicle entrance kept clear of dusty materials?		$\checkmark$				
2.11	Is dark smoke emission from plant/equipment avoided?		$\checkmark$				
2.12	Are de-bagging, batching and mixing processes carried out in sheltered areas during the use of bagged cement?	$\checkmark$					
2.13	Are site vehicles travelling within the speed limit not more than 15km/hour?		$\checkmark$				
2.14	Are hoardings of not less than 2.4m high provided along the site boundary, which adjoins areas accessible to the public?	$\checkmark$					
2.15	Is open burning avoided?		$\checkmark$				
2.16	Excavated materials from the stream must remove form site on the same day. The materials shall be stored in covered impermeable skips awaiting removal from site.		$\checkmark$				
Sectio	n 3: Noise						
3.01	Are noisy equipment and activities positioned as far as practicable from the sensitive receivers?		$\checkmark$				
3.02	Is silenced equipment adopted?		$\checkmark$				
3.03	Is idle equipment turned off or throttled down?		$\checkmark$				
3.04	Are all plant and equipment well maintained and in good condition?		$\checkmark$				
3.05	Are noise barriers or enclosures provided at areas where construction activities cause noise impact on sensitive receivers?	$\checkmark$					
3.06	Are hand held breakers fitted with valid noise emission labels during operation?	$\checkmark$					




		<b>N1</b> <i>i</i>			<b>F</b> - ''		
Note:	Not Obs.: Not Observed; Yes: Compliance; No: Non-Compliance; Follow Up: Observations requiring follow-Up actions N/A: Not Applicable	Not Obs.	Yes	Νο	Follow Up	N/A	Photo/ Remarks
3.07	Are air compressors fitted with valid noise emission labels during operation?	$\checkmark$					
3.08	Are flaps and panels of mechanical equipment closed during operation?		$\checkmark$				
3.09	Are Construction Noise Permit(s) applied for percussive piling works?	$\checkmark$					
3.10	Are Construction Noise Permit(s) applied for general construction works during restricted hours?		$\checkmark$				
3.11	Are valid Construction Noise Permit(s) posted at site entrances?		$\checkmark$				
3.12	Use of quiet plant had been used on site to minimise the construction noise impact to the surrounding residences/dwellings (Level 1 mitigation measures).	$\checkmark$					
3.13	Temporary/Moveable noise barrier or site hoarding are provide or erect at the site boundary to minimise the noise impact of the closest NSRs or stationary equipments shield by the noise barrier which cannot visible from NSRs (Level 2 mitigation measure)	$\checkmark$					
3.14	Temporary/Moveable noise barrier equal to or more than 3m height with 10kg/m2 are provide for noise mitigation measures (Level 2 mitigation measures).	$\checkmark$					
Sectio	n 4: Waste/Chemical Management						
4.01	Waste Management Plan had been submit to Engineer for approval.		$\checkmark$				
4.02	Are receptacles available for general refuse collection?		$\checkmark$				
4.03	Is general refuse sorting or recycling implemented?		$\checkmark$				
4.04	Is general refuse disposed of properly and regularly?		$\checkmark$				
4.05	Is the Contractor registered as a chemical waste producer?	$\checkmark$					
4.06	Are the chemical waste containers properly labelled?	$\checkmark$					
4.07	Are the chemical containers stored in proper storage areas?		$\checkmark$				
4.08	Is the chemical waste storage area properly labelled?		$\checkmark$				
4.09	Is the chemical waste storage area used for storage of chemical waste only?		$\checkmark$				
4.10	Are incompatible chemical wastes stored in different areas?	$\checkmark$					
4.11	Are the chemical wastes disposed of by licensed collectors?	$\checkmark$					
4.12	Are trip tickets for chemical wastes disposal available for inspection?	$\checkmark$					
4.13	Are chemical/fuel storage areas bunded?		$\checkmark$				
4.14	Are designated areas identified for storage and sorting of construction wastes?		$\checkmark$				
4.15	Are construction wastes sorted (inert and non-inert) on site?		$\checkmark$				
4.16	Are construction wastes reused?		$\checkmark$				
4.17	Are construction wastes disposed of properly?				$\checkmark$		
4.18	Are site hoardings and signboards made of durable materials instead of timber?		$\checkmark$				
4.19	Is trip ticket system implemented for the disposal of construction wastes and records available for inspection?		$\checkmark$				
4.20	Are appropriate procedures followed if contaminated material exists?		$\checkmark$				
4.21	Is relevant license/ permit for disposal of construction waste or excavated materials available for inspection?		$\checkmark$				
4.22	Site cleanliness and appropriate waste management training had provided for the site workers.		$\checkmark$				
4.23	Contaminated sediments will be managed according to WBTC No.12/2000 and EWTB TC(W) No. 34/2002.		$\checkmark$				



Note:	Not Obs.: Not Observed; Yes: Compliance; No: Non-Compliance; Follow Up: Observations requiring follow-Up actions N/A: Not Applicable	Not Obs.	Yes	No	Follow Up	N/A	Photo/ Remarks
Sectio	on 5: Landscape & Visual						
5.01	Are retained and transplanted trees in health condition?		$\checkmark$				
5.02	Are retained and transplanted trees properly protected?		$\checkmark$				
5.03	Are surgery works carried out for the damaged trees?					$\checkmark$	
5.04	Is damage to trees outside site boundary due to construction activities avoided?		$\checkmark$				
5.05	Is the night-time lighting controlled to minimize glare to sensitive receivers?		$\checkmark$				
Sectio	on 6: Ecology						
6.01	Gabion banks and base had been provide for channel linings and banks for typical sections?	$\checkmark$					
6.02	Prevent site effluent/runoff discharge to the seasonal wetlands?	$\checkmark$					
6.03	Stockpiling or disposal of materials, and any dredging or construction activities at the seasonal wetlands are prohibited?	$\checkmark$					
Sectio	on 7: Others						
7.01	Are relevant Environmental Permits posted at all vehicle site entrances/exits?		$\checkmark$				
7.02	Is any mosquito control measures implemented to prevent mosquito breeding?						

#### Remarks

Follow-Up of Last Site Inspection: Not required t	or reminders.		
<ol> <li>Findings of Site Inspection on 26 July 2012:</li> <li>1. Turbid water was observed in the river stream due to heavy rain. Full implementation of the required environmental mitigation measures is reminded.</li> </ol>			
IFC's representative RF's representative	ET's	EO's representativ	Contractor's

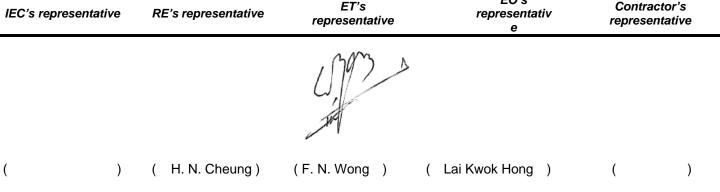

AUES
------

Projec	ct: DSD Contract No. DC/2007/08	Inspe	200708-2-Aug-2012						
	Drainage Improvement Works at Tai Po Tin, Ping Che,	IEC/IEC's Representative:							
	Man Uk Pin and Lin Ma Hang	_	RE/ RE's Representative:			Wong F. N./Ben Tam			
Inspec Date:	2-Aug-2012		21's Repre	esentative: sentative:		Wong F. N./Ben Tam Lai Kwok Hong Alex			
Time:		Contra	actor's sentative:						
PAR	T A: GENERAL INFORMATION				vironment	al Perm	it No. EP-277/2007/A		
Weat	ther: 🖌 Sunny 🔄 Fine 🔄 Cloudy 🔄	Rainy	c	alm					
Temp	oerature: 33 °C			[					
Humi				[	N/A				
Wind	d: Strong Breeze _ ✓ Light annel	Calm Area Inspe	acted						
TKL		Area map							
TKL									
MUI	P05								
PART	B: SITE AUDIT								
Note:	Not Obs.: Not Observed; Yes: Compliance; No: Non-Compliance; Follow Up: Observations requiring follow-Up actions N/A: Not Applicable	Not Obs.	Yes	No	Follow Up	N/A	Photo/ Remarks		
Sectio	on 1: Water Quality								
1.01	Is an effluent discharge license obtained for the Project?	$\checkmark$							
1.02	Is the effluent discharged in accordance with the discharge licence?	$\sim$							
1.03	Is the discharge of turbid water avoided?		$\checkmark$						
1.04	Are there proper desilting facilities in the drainage systems to reduce SS levels in effluent?	° 🗌	$\checkmark$						
1.05	Are there channels, sandbags or bunds to direct surface run-off to sedimentation tanks?	р П	$\checkmark$						
1.06	Are there any perimeter channels provided at site boundaries to intercept storm runoff from crossing the site?	) 	$\checkmark$						
1.07	Is drainage system well maintained?		$\checkmark$						
1.08	As excavation proceeds, are temporary access roads protected by crushed stone or gravel?	′ 🗌	$\checkmark$						
1.09	Are temporary exposed slopes properly covered?		$\checkmark$						
1.10	Are earthworks final surfaces well compacted or protected?		$\checkmark$						
1.11	Are manholes adequately covered or temporarily sealed?	$\checkmark$							
1.12	Are there any procedures and equipment for rainstorm protection?		$\checkmark$						
1.13	Are wheel washing facilities well maintained?		$\checkmark$						
1.14	Is runoff from wheel washing facilities avoided?		$\checkmark$						
1.15	Are there toilets provided on site?		$\checkmark$						
1.16	Are toilets properly maintained?		$\checkmark$						
1.17	Are the vehicle and plant servicing areas paved and located withir roofed areas?		$\checkmark$						
1.18	Is the oil leakage or spillage avoided?		$\checkmark$						
1.19	Are there any measures to prevent leaked oil from entering the drainage system?	, D	$\checkmark$						
1.20	Are there any measures to collect spilt cement and concrete washings during concreting works?	, N							



Note:	Not Obs.: Not Observed; Yes: Compliance; No: Non-Compliance; Follow Up: Observations requiring follow-Up actions N/A: Not Applicable	Not Obs.	Yes	No	Follow Up	N/A	Photo/ Remarks
1.21	Are there any oil interceptors/grease traps in the drainage systems for vehicle and plant servicing areas, canteen kitchen, etc?	$\checkmark$					
1.22	Are the oil interceptors/grease traps maintained properly?	$\checkmark$					
1.23	Is used bentonite recycled where appropriate?	$\checkmark$					
1.24	Designated settlement area for runoff/wheel wash waste is provide and located at the streambed with 1-2m deep, 12m long and around 50m3 capacities for sedimentation.		$\checkmark$				
1.25	No excavation is undertaken in the settlement area.		$\checkmark$				
1.26	Concreting wastes water should be neutralized below the pH Action Levels before discharge.	$\checkmark$					
1.27	Mobile toilets should provide on site and located away the stream course.		$\checkmark$				
1.25	License collector should be employed for handling the sewage of mobile toilet.		$\checkmark$				
1.26	Is ponding /stand water avoided		$\checkmark$				
Sectio	n 2: Air Quality						
2.01	Are there wheel washing facilities with high pressure jets provided at every vehicle exit point?		$\checkmark$				
2.02	Are vehicles washed to remove any dusty materials from their bodies and wheels before leaving construction sites?		$\checkmark$				
2.03	Are the excavated materials sprayed with water during handling?		$\checkmark$				
2.04	Are stockpiles of dusty materials sprayed with water, covered or placed in sheltered areas?		$\checkmark$				
2.05	Is the exposed earth properly treated within six months after the last construction activities?		$\checkmark$				
2.06	Are the access roads sprayed with water to maintain the entire road surface wet or paved?		$\checkmark$				
2.07	Is the surface where any drilling, cutting, polishing or breaking operation continuously sprayed with water?		$\checkmark$				
2.08	Is the load on vehicles covered entirely by clean impervious sheeting?		$\checkmark$				
2.09	Is the loading of materials to a level higher than the side and tail boards during transportation by vehicles avoided?		$\checkmark$				
2.10	Is the road leading to the construction site within 30m of the vehicle entrance kept clear of dusty materials?		$\checkmark$				
2.11	Is dark smoke emission from plant/equipment avoided?		$\checkmark$				
2.12	Are de-bagging, batching and mixing processes carried out in sheltered areas during the use of bagged cement?	$\checkmark$					
2.13	Are site vehicles travelling within the speed limit not more than 15km/hour?		$\checkmark$				
2.14	Are hoardings of not less than 2.4m high provided along the site boundary, which adjoins areas accessible to the public?	$\checkmark$					
2.15	Is open burning avoided?		$\checkmark$				
2.16	Excavated materials from the stream must remove form site on the same day. The materials shall be stored in covered impermeable skips awaiting removal from site.		$\checkmark$				
Sectio	n 3: Noise						
3.01	Are noisy equipment and activities positioned as far as practicable from the sensitive receivers?		$\checkmark$				
3.02	Is silenced equipment adopted?		$\checkmark$				
3.03	Is idle equipment turned off or throttled down?		$\checkmark$				
3.04	Are all plant and equipment well maintained and in good condition?		$\checkmark$				
3.05	Are noise barriers or enclosures provided at areas where construction activities cause noise impact on sensitive receivers?	$\checkmark$					
3.06	Are hand held breakers fitted with valid noise emission labels during operation?	$\checkmark$					



Note:	Not Obs.: Not Observed; Yes: Compliance; No: Non-Compliance; Follow Up: Observations requiring follow-Up actions N/A: Not Applicable	Not Obs.	Yes	No	Follow Up	N/A	Photo/ Remarks
3.07	Are air compressors fitted with valid noise emission labels during operation?	$\checkmark$					
3.08	Are flaps and panels of mechanical equipment closed during operation?		$\checkmark$				
3.09	Are Construction Noise Permit(s) applied for percussive piling works?	$\checkmark$					
3.10	Are Construction Noise Permit(s) applied for general construction works during restricted hours?		$\checkmark$				
3.11	Are valid Construction Noise Permit(s) posted at site entrances?		$\checkmark$				
3.12	Use of quiet plant had been used on site to minimise the construction noise impact to the surrounding residences/dwellings (Level 1 mitigation measures).	$\checkmark$					
3.13	Temporary/Moveable noise barrier or site hoarding are provide or erect at the site boundary to minimise the noise impact of the closest NSRs or stationary equipments shield by the noise barrier which cannot visible from NSRs (Level 2 mitigation measure)	$\checkmark$					
3.14	Temporary/Moveable noise barrier equal to or more than 3m height with 10kg/m2 are provide for noise mitigation measures (Level 2 mitigation measures).	$\checkmark$					
Sectio	n 4: Waste/Chemical Management						
4.01	Waste Management Plan had been submit to Engineer for approval.		$\checkmark$				
4.02	Are receptacles available for general refuse collection?		$\checkmark$				
4.03	Is general refuse sorting or recycling implemented?		$\checkmark$				
4.04	Is general refuse disposed of properly and regularly?		$\checkmark$				
4.05	Is the Contractor registered as a chemical waste producer?	$\checkmark$					
4.06	Are the chemical waste containers properly labelled?	$\checkmark$					
4.07	Are the chemical containers stored in proper storage areas?		$\checkmark$				
4.08	Is the chemical waste storage area properly labelled?		$\checkmark$				
4.09	Is the chemical waste storage area used for storage of chemical waste only?		$\checkmark$				
4.10	Are incompatible chemical wastes stored in different areas?	$\checkmark$					
4.11	Are the chemical wastes disposed of by licensed collectors?	$\checkmark$					
4.12	Are trip tickets for chemical wastes disposal available for inspection?	$\checkmark$					
4.13	Are chemical/fuel storage areas bunded?		$\checkmark$				
4.14	Are designated areas identified for storage and sorting of construction wastes?		$\checkmark$				
4.15	Are construction wastes sorted (inert and non-inert) on site?		$\checkmark$				
4.16	Are construction wastes reused?		$\checkmark$				
4.17	Are construction wastes disposed of properly?				$\checkmark$		
4.18	Are site hoardings and signboards made of durable materials instead of timber?		$\checkmark$				
4.19	Is trip ticket system implemented for the disposal of construction wastes and records available for inspection?		$\checkmark$				
4.20	Are appropriate procedures followed if contaminated material exists?		$\checkmark$				
4.21	Is relevant license/ permit for disposal of construction waste or excavated materials available for inspection?		$\checkmark$				
4.22	Site cleanliness and appropriate waste management training had provided for the site workers.		$\checkmark$				
4.23	Contaminated sediments will be managed according to WBTC No.12/2000 and EWTB TC(W) No. 34/2002.		$\checkmark$				



Note:	Not Obs.: Not Observed; Yes: Compliance; No: Non-Compliance; Follow Up: Observations requiring follow-Up actions N/A: Not Applicable	Not Obs.	Yes	No	Follow Up	N/A	Photo/ Remarks
Sectio	on 5: Landscape & Visual						
5.01	Are retained and transplanted trees in health condition?		$\checkmark$				
5.02	Are retained and transplanted trees properly protected?		$\checkmark$				
5.03	Are surgery works carried out for the damaged trees?					$\checkmark$	
5.04	Is damage to trees outside site boundary due to construction activities avoided?		$\checkmark$				
5.05	Is the night-time lighting controlled to minimize glare to sensitive receivers?		$\checkmark$				
Sectio	on 6: Ecology						
6.01	Gabion banks and base had been provide for channel linings and banks for typical sections?	$\checkmark$					
6.02	Prevent site effluent/runoff discharge to the seasonal wetlands?	$\checkmark$					
6.03	Stockpiling or disposal of materials, and any dredging or construction activities at the seasonal wetlands are prohibited?	$\checkmark$					
Sectio	on 7: Others						
7.01	Are relevant Environmental Permits posted at all vehicle site entrances/exits?		$\checkmark$				
7.02	Is any mosquito control measures implemented to prevent mosquito breeding?						

#### Remarks

 Follow-Up of Last Site Inspection: Not required for reminders.

 Findings of Site Inspection on 26 July 2012:

Construction activities were observed along the site at Loi Tung. No adverse environmental impacts were observed. However, full implementation of the required environmental mitigation measures is reminded. (Photo 1)



IEC's representative	RE's representative	ET's representative	EO's representativ e	Contractor representati	
		UJON A			
( )	(H.N.Cheung)	(F. N. Wong )	( Lai Kwok Hong )	(	)

AUES
------

Projec	ct: DSD Contract No. DC/2007/08	Checklist Inspected by No. <u>DC200708-9-Au</u>					C200708-9-Aug-2012
	Drainage Improvement Works at Tai Po Tin, Ping Che,	IEC/IEC's Representative:					
Inspec	<u>Man Uk Pin and Lin Ma Hang</u>	_	E's Repres		Wong E	N /Bor	Tam
Date:	9-Aug-2012	ETL/ ET's Representative:       Wong F. N./Ben Tam         EO/ EO's Representative:       Lai Kwok Hong Alex					
Time:	15:00		actor's esentative:				
PAR	T A: GENERAL INFORMATION			Er	vironment	al Perm	nit No. EP-277/2007/A
Weat	ther: Sunny Fine Cloudy 🗸	Rainy	C	alm			
-	erature: 32 °C			[			
Humi Wind		Calm		Ĺ	N/A		
	l: Strong Breeze ✓ Light annel	Area Insp	ected				
MUF	.07 P01/02 P05						
PART							
Note:	Not Obs.: Not Observed; Yes: Compliance; No: Non-Compliance; Follow Up: Observations requiring follow-Up actions N/A: Not Applicable	Not Obs.	Yes	No	Follow Up	N/A	Photo/ Remarks
Sectio	on 1: Water Quality	_	_	_	_	_	
1.01	Is an effluent discharge license obtained for the Project?	$\checkmark$					
1.02	Is the effluent discharged in accordance with the discharge licence?	$\checkmark$					
1.03	Is the discharge of turbid water avoided?		$\checkmark$				
1.04	Are there proper desilting facilities in the drainage systems to reduce SS levels in effluent?		$\checkmark$				
1.05	Are there channels, sandbags or bunds to direct surface run-off to sedimentation tanks?		$\checkmark$				
1.06	Are there any perimeter channels provided at site boundaries to intercept storm runoff from crossing the site?		$\checkmark$				
1.07	Is drainage system well maintained?		$\checkmark$				
1.08	As excavation proceeds, are temporary access roads protected by crushed stone or gravel?		$\checkmark$				
1.09	Are temporary exposed slopes properly covered?		$\checkmark$				
1.10	Are earthworks final surfaces well compacted or protected?		$\checkmark$				
1.11	Are manholes adequately covered or temporarily sealed?	$\checkmark$					
1.12	Are there any procedures and equipment for rainstorm protection?		$\checkmark$				
1.13	Are wheel washing facilities well maintained?		$\checkmark$				
1.14	Is runoff from wheel washing facilities avoided?		$\checkmark$				
1.15	Are there toilets provided on site?		$\checkmark$				
1.16	Are toilets properly maintained?		$\checkmark$				
1.17	Are the vehicle and plant servicing areas paved and located within roofed areas?		$\checkmark$				
1.18	Is the oil leakage or spillage avoided?		$\checkmark$				
1.19	Are there any measures to prevent leaked oil from entering the drainage system?		$\checkmark$				
1.20	Are there any measures to collect spilt cement and concrete washings during concreting works?	$\checkmark$					



Note:	Not Obs.: Not Observed; Yes: Compliance; No: Non-Compliance; Follow Up: Observations requiring follow-Up actions N/A: Not Applicable	Not Obs.	Yes	No	Follow Up	N/A	Photo/ Remarks
1.21	Are there any oil interceptors/grease traps in the drainage systems for vehicle and plant servicing areas, canteen kitchen, etc?	$\checkmark$					
1.22	Are the oil interceptors/grease traps maintained properly?	$\checkmark$					
1.23	Is used bentonite recycled where appropriate?	$\checkmark$					
1.24	Designated settlement area for runoff/wheel wash waste is provide and located at the streambed with 1-2m deep, 12m long and around 50m3 capacities for sedimentation.		$\checkmark$				
1.25	No excavation is undertaken in the settlement area.		$\checkmark$				
1.26	Concreting wastes water should be neutralized below the pH Action Levels before discharge.	$\checkmark$					
1.27	Mobile toilets should provide on site and located away the stream course.		$\checkmark$				
1.25	License collector should be employed for handling the sewage of mobile toilet.		$\checkmark$				
1.26	Is ponding /stand water avoided		$\checkmark$				
Sectio	n 2: Air Quality						
2.01	Are there wheel washing facilities with high pressure jets provided at every vehicle exit point?		$\checkmark$				
2.02	Are vehicles washed to remove any dusty materials from their bodies and wheels before leaving construction sites?		$\checkmark$				
2.03	Are the excavated materials sprayed with water during handling?		$\checkmark$				
2.04	Are stockpiles of dusty materials sprayed with water, covered or placed in sheltered areas?		$\checkmark$				
2.05	Is the exposed earth properly treated within six months after the last construction activities?		$\checkmark$				
2.06	Are the access roads sprayed with water to maintain the entire road surface wet or paved?		$\checkmark$				
2.07	Is the surface where any drilling, cutting, polishing or breaking operation continuously sprayed with water?		$\checkmark$				
2.08	Is the load on vehicles covered entirely by clean impervious sheeting?		$\checkmark$				
2.09	Is the loading of materials to a level higher than the side and tail boards during transportation by vehicles avoided?		$\checkmark$				
2.10	Is the road leading to the construction site within 30m of the vehicle entrance kept clear of dusty materials?		$\checkmark$				
2.11	Is dark smoke emission from plant/equipment avoided?		$\checkmark$				
2.12	Are de-bagging, batching and mixing processes carried out in sheltered areas during the use of bagged cement?	$\checkmark$					
2.13	Are site vehicles travelling within the speed limit not more than 15km/hour?		$\checkmark$				
2.14	Are hoardings of not less than 2.4m high provided along the site boundary, which adjoins areas accessible to the public?	$\checkmark$					
2.15	Is open burning avoided?		$\checkmark$				
2.16	Excavated materials from the stream must remove form site on the same day. The materials shall be stored in covered impermeable skips awaiting removal from site.		$\checkmark$				
Sectio	n 3: Noise						
3.01	Are noisy equipment and activities positioned as far as practicable from the sensitive receivers?		$\checkmark$				
3.02	Is silenced equipment adopted?		$\checkmark$				
3.03	Is idle equipment turned off or throttled down?		$\checkmark$				
3.04	Are all plant and equipment well maintained and in good condition?		$\checkmark$				
3.05	Are noise barriers or enclosures provided at areas where construction activities cause noise impact on sensitive receivers?	$\checkmark$					
3.06	Are hand held breakers fitted with valid noise emission labels during operation?	$\checkmark$					




Note:	Not Obs.: Not Observed; Yes: Compliance; No: Non-Compliance; Follow Up: Observations requiring follow-Up actions N/A: Not Applicable	Not Obs.	Yes	No	Follow Up	N/A	Photo/ Remarks
3.07	Are air compressors fitted with valid noise emission labels during operation?	$\checkmark$					
3.08	Are flaps and panels of mechanical equipment closed during operation?		$\checkmark$				
3.09	Are Construction Noise Permit(s) applied for percussive piling works?	$\checkmark$					
3.10	Are Construction Noise Permit(s) applied for general construction works during restricted hours?		$\checkmark$				
3.11	Are valid Construction Noise Permit(s) posted at site entrances?		$\checkmark$				
3.12	Use of quiet plant had been used on site to minimise the construction noise impact to the surrounding residences/dwellings (Level 1 mitigation measures).	$\checkmark$					
3.13	Temporary/Moveable noise barrier or site hoarding are provide or erect at the site boundary to minimise the noise impact of the closest NSRs or stationary equipments shield by the noise barrier which cannot visible from NSRs (Level 2 mitigation measure)	$\checkmark$					
3.14	Temporary/Moveable noise barrier equal to or more than 3m height with 10kg/m2 are provide for noise mitigation measures (Level 2 mitigation measures).	$\checkmark$					
Sectio	n 4: Waste/Chemical Management						
4.01	Waste Management Plan had been submit to Engineer for approval.		$\checkmark$				
4.02	Are receptacles available for general refuse collection?		$\checkmark$				
4.03	Is general refuse sorting or recycling implemented?		$\checkmark$				
4.04	Is general refuse disposed of properly and regularly?		$\checkmark$				
4.05	Is the Contractor registered as a chemical waste producer?	$\checkmark$					
4.06	Are the chemical waste containers properly labelled?	$\checkmark$					
4.07	Are the chemical containers stored in proper storage areas?		$\checkmark$				
4.08	Is the chemical waste storage area properly labelled?		$\checkmark$				
4.09	Is the chemical waste storage area used for storage of chemical waste only?		$\checkmark$				
4.10	Are incompatible chemical wastes stored in different areas?	$\checkmark$					
4.11	Are the chemical wastes disposed of by licensed collectors?	$\checkmark$					
4.12	Are trip tickets for chemical wastes disposal available for inspection?	$\checkmark$					
4.13	Are chemical/fuel storage areas bunded?		$\checkmark$				
4.14	Are designated areas identified for storage and sorting of construction wastes?		$\checkmark$				
4.15	Are construction wastes sorted (inert and non-inert) on site?		$\checkmark$				
4.16	Are construction wastes reused?		$\checkmark$				
4.17	Are construction wastes disposed of properly?				$\checkmark$		
4.18	Are site hoardings and signboards made of durable materials instead of timber?		$\checkmark$				
4.19	Is trip ticket system implemented for the disposal of construction wastes and records available for inspection?		$\checkmark$				
4.20	Are appropriate procedures followed if contaminated material exists?		$\checkmark$				
4.21	Is relevant license/ permit for disposal of construction waste or excavated materials available for inspection?		$\checkmark$				
4.22	Site cleanliness and appropriate waste management training had provided for the site workers.		$\checkmark$				
4.23	Contaminated sediments will be managed according to WBTC No.12/2000 and EWTB TC(W) No. 34/2002.		$\checkmark$				



Not Obs.: Not Observed; Yes: Compliance; No: Non-Compliance; Follow Up: Observations requiring follow-Up actions N/A: Not Applicable	Not Obs.	Yes	No	Follow Up	N/A	Photo/ Remarks
on 5: Landscape & Visual						
Are retained and transplanted trees in health condition?		$\checkmark$				
Are retained and transplanted trees properly protected?		$\checkmark$				
Are surgery works carried out for the damaged trees?					$\checkmark$	
Is damage to trees outside site boundary due to construction activities avoided?		$\checkmark$				
Is the night-time lighting controlled to minimize glare to sensitive receivers?		$\checkmark$				
on 6: Ecology						
Gabion banks and base had been provide for channel linings and banks for typical sections?	$\checkmark$					
Prevent site effluent/runoff discharge to the seasonal wetlands?	$\checkmark$					
Stockpiling or disposal of materials, and any dredging or construction activities at the seasonal wetlands are prohibited?	$\checkmark$					
on 7: Others						
Are relevant Environmental Permits posted at all vehicle site entrances/exits?		$\checkmark$				
Is any mosquito control measures implemented to prevent mosquito breeding?						
	Follow Up: Observations requiring follow-Up actions N/A: Not Applicable on 5: Landscape & Visual Are retained and transplanted trees in health condition? Are retained and transplanted trees properly protected? Are surgery works carried out for the damaged trees? Is damage to trees outside site boundary due to construction activities avoided? Is the night-time lighting controlled to minimize glare to sensitive receivers? On 6: Ecology Gabion banks and base had been provide for channel linings and banks for typical sections? Prevent site effluent/runoff discharge to the seasonal wetlands? Stockpiling or disposal of materials, and any dredging or construction activities at the seasonal wetlands are prohibited? On 7: Others Are relevant Environmental Permits posted at all vehicle site entrances/exits? Is any mosquito control measures implemented to prevent	Follow Up: Observations requiring follow-Up actions       N/A: Not Applicable       Obs.         on 5: Landscape & Visual	Follow Up: Observations requiring follow-Up actions       N/A: Not Applicable       Obs.       Yes         on 5: Landscape & Visual       Image: Are retained and transplanted trees in health condition?       Image: Are retained and transplanted trees properly protected?       Image: Are retained and transplanted trees properly protected?       Image: Are surgery works carried out for the damaged trees?       Image: Are surgery works carried out for the damaged trees?       Image: Are surgery works carried out for the damaged trees?       Image: Are surgery works carried out for the damaged trees?       Image: Are surgery works carried out for the damaged trees?       Image: Are surgery works carried out for the damaged trees?       Image: Are surgery works carried out for the damaged trees?       Image: Are surgery works carried out for the damaged trees?       Image: Are surgery works carried out for the damaged trees?       Image: Are surgery works carried out for the damaged trees?       Image: Are surgery works carried out for the damaged trees?       Image: Are surgery works carried out for the damaged trees?       Image: Are surgery works carried out for the damaged trees?       Image: Are surgery works carried out for the damaged trees?       Image: Are surgery works carried out for the damaged trees?       Image: Are surgery works carried out for the damaged trees?       Image: Are surgery works carried out for the damaged trees?       Image: Are surgery works carried out for the damaged trees?       Image: Are surgery works carried out for the damaged trees?       Image: Are surgery works carried out for the damaged trees?       Image: Are surgery worksurgery worksurgery worksurgery worksurgery worksurgery w	Pollow Up: Observations requiring follow-Up actions       NA: Not Applicable       Obs.       Yes       No         on 5: Landscape & Visual	Follow Up: Observations requiring follow-Up actions       N/A: Not Applicable       Obs.       Yes       No       Up         on 5: Landscape & Visual	Follow Up: Observations requiring follow-Up actions       N/A: Not Applicable       Obs.       Yes       No       Up       N/A         on 5: Landscape & Visual

#### Remarks

Follow-Up of Last Site Inspection: Not required f	or reminders.	
Findings of Site Inspection on 9 Auig 2012: No adverse environmental impacts were observed. However, full implementation of the required environmental mitigation measures is reminded. (Photo 1)		Photo 1
IEC's representative BE's representative	ET's	EO's Contractor's

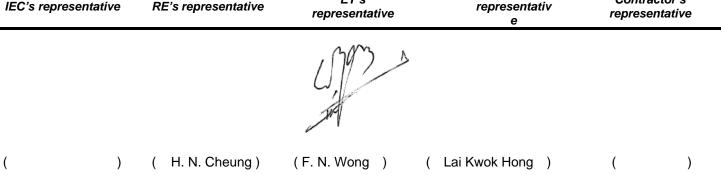

Project:	DSD Contract No. DC/2007/08		Inspected by		Checklist No.	DC200708-16-Aug-2012	
	Drainage Improven Ping Che, Man Uk			IEC/IEC's Repre			
Inspection				ETL/ ET's Repr	esentative:	Wong F. N./Ben	Tam
Date:	16-Aug-2012			EO/ EO's Repre	esentative:	Lai Kwok Hong A	lex
Time:	15:00			Contractor's Re	epresentative:		
PART A:		GENE	RAL INFORMA	TION		Environmenta	Il Permit No. EP-277/2007/A
Weather:	Sunny	Fine	Cloudy	✓ Rainy	Calm		
Temperature:	32	O₀C					
Humidity:	✓ High	Moderate	Low			N/A	
Wind:	Strong	Breeze	✓ Light	Calm			
Channel				Area Insp	ected		
TKL02 TKL07 MUP01/02 MUP05							
PART B:			SITE AUDIT				

PART	B: SITE AUDIT						
Note:	Not Obs.: Not Observed; Yes: Compliance; No: Non-Compliance; Follow Up: Observations requiring follow-Up actions N/A: Not Applicable	Not Obs.	Yes	No	Follow Up	N/A	Photo/ Remarks
Sectio	on 1: Water Quality						
1.01	Is an effluent discharge license obtained for the Project?	$\checkmark$					
1.02	Is the effluent discharged in accordance with the discharge licence?	$\checkmark$					
1.03	Is the discharge of turbid water avoided?		$\checkmark$				
1.04	Are there proper desilting facilities in the drainage systems to reduce SS levels in effluent?		$\checkmark$				
1.05	Are there channels, sandbags or bunds to direct surface run-off to sedimentation tanks?		$\checkmark$				
1.06	Are there any perimeter channels provided at site boundaries to intercept storm runoff from crossing the site?		$\checkmark$				
1.07	Is drainage system well maintained?		$\checkmark$				
1.08	As excavation proceeds, are temporary access roads protected by crushed stone or gravel?		$\checkmark$				
1.09	Are temporary exposed slopes properly covered?		$\checkmark$				
1.10	Are earthworks final surfaces well compacted or protected?		$\checkmark$				
1.11	Are manholes adequately covered or temporarily sealed?	$\checkmark$					
1.12	Are there any procedures and equipment for rainstorm protection?		$\checkmark$				
1.13	Are wheel washing facilities well maintained?		$\checkmark$				
1.14	Is runoff from wheel washing facilities avoided?		$\checkmark$				
1.15	Are there toilets provided on site?		$\checkmark$				
1.16	Are toilets properly maintained?		$\checkmark$				
1.17	Are the vehicle and plant servicing areas paved and located within roofed areas?		$\checkmark$				
1.18	Is the oil leakage or spillage avoided?		$\checkmark$				
1.19	Are there any measures to prevent leaked oil from entering the drainage system?		$\checkmark$				
1.20	Are there any measures to collect spilt cement and concrete washings during concreting works?	$\checkmark$					

washings during concreting works?

AUES



Note:	Not Obs.: Not Observed; Yes: Compliance; No: Non-Compliance; Follow Up: Observations requiring follow-Up actions N/A: Not Applicable	Not Obs.	Yes	No	Follow Up	N/A	Photo/ Remarks
1.21	Are there any oil interceptors/grease traps in the drainage systems for vehicle and plant servicing areas, canteen kitchen, etc?	$\checkmark$					
1.22	Are the oil interceptors/grease traps maintained properly?	$\checkmark$					
1.23	Is used bentonite recycled where appropriate?	$\checkmark$					
1.24	Designated settlement area for runoff/wheel wash waste is provide and located at the streambed with 1-2m deep, 12m long and around 50m3 capacities for sedimentation.		$\checkmark$				
1.25	No excavation is undertaken in the settlement area.		$\checkmark$				
1.26	Concreting wastes water should be neutralized below the pH Action Levels before discharge.	$\checkmark$					
1.27	Mobile toilets should provide on site and located away the stream course.		$\checkmark$				
1.25	License collector should be employed for handling the sewage of mobile toilet.		$\checkmark$				
1.26	Is ponding /stand water avoided		$\checkmark$				
Sectio	n 2: Air Quality						
2.01	Are there wheel washing facilities with high pressure jets provided at every vehicle exit point?		$\checkmark$				
2.02	Are vehicles washed to remove any dusty materials from their bodies and wheels before leaving construction sites?		$\checkmark$				
2.03	Are the excavated materials sprayed with water during handling?		$\checkmark$				
2.04	Are stockpiles of dusty materials sprayed with water, covered or placed in sheltered areas?		$\checkmark$				
2.05	Is the exposed earth properly treated within six months after the last construction activities?		$\checkmark$				
2.06	Are the access roads sprayed with water to maintain the entire road surface wet or paved?		$\checkmark$				
2.07	Is the surface where any drilling, cutting, polishing or breaking operation continuously sprayed with water?		$\checkmark$				
2.08	Is the load on vehicles covered entirely by clean impervious sheeting?		$\checkmark$				
2.09	Is the loading of materials to a level higher than the side and tail boards during transportation by vehicles avoided?		$\checkmark$				
2.10	Is the road leading to the construction site within 30m of the vehicle entrance kept clear of dusty materials?		$\checkmark$				
2.11	Is dark smoke emission from plant/equipment avoided?		$\checkmark$				
2.12	Are de-bagging, batching and mixing processes carried out in sheltered areas during the use of bagged cement?	$\checkmark$					
2.13	Are site vehicles travelling within the speed limit not more than 15km/hour?		$\checkmark$				
2.14	Are hoardings of not less than 2.4m high provided along the site boundary, which adjoins areas accessible to the public?	$\checkmark$					
2.15	Is open burning avoided?		$\checkmark$				
2.16	Excavated materials from the stream must remove form site on the same day. The materials shall be stored in covered impermeable skips awaiting removal from site.		$\checkmark$				
Sectio	n 3: Noise						
3.01	Are noisy equipment and activities positioned as far as practicable from the sensitive receivers?		$\checkmark$				
3.02	Is silenced equipment adopted?		$\checkmark$				
3.03	Is idle equipment turned off or throttled down?		$\checkmark$				
3.04	Are all plant and equipment well maintained and in good condition?		$\checkmark$				
3.05	Are noise barriers or enclosures provided at areas where construction activities cause noise impact on sensitive receivers?	$\checkmark$					
3.06	Are hand held breakers fitted with valid noise emission labels during operation?	$\checkmark$					



Note:	Not Obs.: Not Observed; Yes: Compliance; No: Non-Compliance; Follow Up: Observations requiring follow-Up actions N/A: Not Applicable	Not Obs.	Yes	No	Follow Up	N/A	Photo/ Remarks
3.07	Are air compressors fitted with valid noise emission labels during operation?	$\checkmark$					
3.08	Are flaps and panels of mechanical equipment closed during operation?		$\checkmark$				
3.09	Are Construction Noise Permit(s) applied for percussive piling works?	$\checkmark$					
3.10	Are Construction Noise Permit(s) applied for general construction works during restricted hours?		$\checkmark$				
3.11	Are valid Construction Noise Permit(s) posted at site entrances?		$\checkmark$				
3.12	Use of quiet plant had been used on site to minimise the construction noise impact to the surrounding residences/dwellings (Level 1 mitigation measures).	$\checkmark$					
3.13	Temporary/Moveable noise barrier or site hoarding are provide or erect at the site boundary to minimise the noise impact of the closest NSRs or stationary equipments shield by the noise barrier which cannot visible from NSRs (Level 2 mitigation measure)	$\checkmark$					
3.14	Temporary/Moveable noise barrier equal to or more than 3m height with 10kg/m2 are provide for noise mitigation measures (Level 2 mitigation measures).	$\checkmark$					
Sectio	n 4: Waste/Chemical Management						
4.01	Waste Management Plan had been submit to Engineer for approval.		$\checkmark$				
4.02	Are receptacles available for general refuse collection?		$\checkmark$				
4.03	Is general refuse sorting or recycling implemented?		$\checkmark$				
4.04	Is general refuse disposed of properly and regularly?		$\checkmark$				
4.05	Is the Contractor registered as a chemical waste producer?	$\checkmark$					
4.06	Are the chemical waste containers properly labelled?	$\checkmark$					
4.07	Are the chemical containers stored in proper storage areas?		$\checkmark$				
4.08	Is the chemical waste storage area properly labelled?		$\checkmark$				
4.09	Is the chemical waste storage area used for storage of chemical waste only?		$\checkmark$				
4.10	Are incompatible chemical wastes stored in different areas?	$\checkmark$					
4.11	Are the chemical wastes disposed of by licensed collectors?	$\checkmark$					
4.12	Are trip tickets for chemical wastes disposal available for inspection?	$\checkmark$					
4.13	Are chemical/fuel storage areas bunded?		$\checkmark$				
4.14	Are designated areas identified for storage and sorting of construction wastes?		$\checkmark$				
4.15	Are construction wastes sorted (inert and non-inert) on site?		$\checkmark$				
4.16	Are construction wastes reused?		$\checkmark$				
4.17	Are construction wastes disposed of properly?				$\checkmark$		
4.18	Are site hoardings and signboards made of durable materials instead of timber?		$\checkmark$				
4.19	Is trip ticket system implemented for the disposal of construction wastes and records available for inspection?		$\checkmark$				
4.20	Are appropriate procedures followed if contaminated material exists?		$\checkmark$				
4.21	Is relevant license/ permit for disposal of construction waste or excavated materials available for inspection?		$\checkmark$				
4.22	Site cleanliness and appropriate waste management training had provided for the site workers.		$\checkmark$				
4.23	Contaminated sediments will be managed according to WBTC No.12/2000 and EWTB TC(W) No. 34/2002.		$\checkmark$				



Note:	Not Obs.: Not Observed; Yes: Compliance; No: Non-Compliance; Follow Up: Observations requiring follow-Up actions N/A: Not Applicable	Not Obs.	Yes	No	Follow Up	N/A	Photo/ Remarks
Sectio	on 5: Landscape & Visual						
5.01	Are retained and transplanted trees in health condition?		$\checkmark$				
5.02	Are retained and transplanted trees properly protected?		$\checkmark$				
5.03	Are surgery works carried out for the damaged trees?					$\checkmark$	
5.04	Is damage to trees outside site boundary due to construction activities avoided?		$\checkmark$				
5.05	Is the night-time lighting controlled to minimize glare to sensitive receivers?		$\checkmark$				
Sectio	on 6: Ecology						
6.01	Gabion banks and base had been provide for channel linings and banks for typical sections?	$\checkmark$					
6.02	Prevent site effluent/runoff discharge to the seasonal wetlands?	$\checkmark$					
6.03	Stockpiling or disposal of materials, and any dredging or construction activities at the seasonal wetlands are prohibited?	$\checkmark$					
Sectio	on 7: Others						
7.01	Are relevant Environmental Permits posted at all vehicle site entrances/exits?		$\checkmark$				
7.02	Is any mosquito control measures implemented to prevent mosquito breeding?						

#### Remarks

Follow-Up of Last Site Inspection: Not required f	for reminders.
Findings of Site Inspection on 16 Auig 2012:	Photo 1
No adverse environmental impacts were observed along the site at Loi Tung. However, full implementation of the required environmental mitigation measures is reminded. (Photo 1)	
IEC's representative RE's representative re	ET's EO's Contractor's presentative e representative
	N AND A

(

) (H. N. Cheung) (F. N. Wong) (Lai Kwok Hong)

)

(

Project:	DSD Contract No	o. DC/2007/08		Inspected by		Checklist No.	DC200708-23-Aug-2012
	Drainage Improven Ping Che, Man Uk			IEC/IEC's Repre			
Inspection				ETL/ ET's Repr	esentative:	Wong F. N./Ben	Tam
Date:	23-Aug-2012			EO/ EO's Repre	esentative:	Lai Kwok Hong A	lex
Time:	15:00			Contractor's R	epresentative:		
PART A:		GENE	RAL INFORMA	TION		Environmenta	I Permit No. EP-277/2007/A
Weather:	Sunny	Fine	Cloudy	✓ Rainy	Calm		
Temperature	31	O₀C					
Humidity:	✓ High	Moderate	Low			N/A	
Wind:	Strong	Breeze	✓ Light	Calm			
Channel				Area Insp	ected		
TKL02 TKL07 MUP01/02 MUP05							
PART B:			SITE AUDIT				

PARI	B: SITE AUDIT						
Note:	Not Obs.: Not Observed; Yes: Compliance; No: Non-Compliance; Follow Up: Observations requiring follow-Up actions N/A: Not Applicable	Not Obs.	Yes	No	Follow Up	N/A	Photo/ Remarks
Sectio	n 1: Water Quality						
1.01	Is an effluent discharge license obtained for the Project?	$\checkmark$					
1.02	Is the effluent discharged in accordance with the discharge licence?	$\checkmark$					
1.03	Is the discharge of turbid water avoided?		$\checkmark$				
1.04	Are there proper desilting facilities in the drainage systems to reduce SS levels in effluent?		$\checkmark$				
1.05	Are there channels, sandbags or bunds to direct surface run-off to sedimentation tanks?		$\checkmark$				
1.06	Are there any perimeter channels provided at site boundaries to intercept storm runoff from crossing the site?		$\checkmark$				
1.07	Is drainage system well maintained?		$\checkmark$				
1.08	As excavation proceeds, are temporary access roads protected by crushed stone or gravel?		$\checkmark$				
1.09	Are temporary exposed slopes properly covered?		$\checkmark$				
1.10	Are earthworks final surfaces well compacted or protected?		$\checkmark$				
1.11	Are manholes adequately covered or temporarily sealed?	$\checkmark$					
1.12	Are there any procedures and equipment for rainstorm protection?		$\checkmark$				
1.13	Are wheel washing facilities well maintained?		$\checkmark$				
1.14	Is runoff from wheel washing facilities avoided?		$\checkmark$				
1.15	Are there toilets provided on site?		$\checkmark$				
1.16	Are toilets properly maintained?		$\checkmark$				
1.17	Are the vehicle and plant servicing areas paved and located within roofed areas?		$\checkmark$				
1.18	Is the oil leakage or spillage avoided?		$\checkmark$				
1.19	Are there any measures to prevent leaked oil from entering the drainage system?		$\checkmark$				

 $\checkmark$ 

Are there any measures to collect spilt cement and concrete

washings during concreting works?

1.20

AUES



Note:	Not Obs.: Not Observed; Yes: Compliance; No: Non-Compliance; Follow Up: Observations requiring follow-Up actions N/A: Not Applicable	Not Obs.	Yes	No	Follow Up	N/A	Photo/ Remarks
1.21	Are there any oil interceptors/grease traps in the drainage systems for vehicle and plant servicing areas, canteen kitchen, etc?	$\checkmark$					
1.22	Are the oil interceptors/grease traps maintained properly?	$\checkmark$					
1.23	Is used bentonite recycled where appropriate?	$\checkmark$					
1.24	Designated settlement area for runoff/wheel wash waste is provide and located at the streambed with 1-2m deep, 12m long and around 50m3 capacities for sedimentation.		$\checkmark$				
1.25	No excavation is undertaken in the settlement area.		$\checkmark$				
1.26	Concreting wastes water should be neutralized below the pH Action Levels before discharge.	$\checkmark$					
1.27	Mobile toilets should provide on site and located away the stream course.		$\checkmark$				
1.25	License collector should be employed for handling the sewage of mobile toilet.		$\checkmark$				
1.26	Is ponding /stand water avoided		$\checkmark$				
Sectio	n 2: Air Quality						
2.01	Are there wheel washing facilities with high pressure jets provided at every vehicle exit point?		$\checkmark$				
2.02	Are vehicles washed to remove any dusty materials from their bodies and wheels before leaving construction sites?		$\checkmark$				
2.03	Are the excavated materials sprayed with water during handling?		$\checkmark$				
2.04	Are stockpiles of dusty materials sprayed with water, covered or placed in sheltered areas?		$\checkmark$				
2.05	Is the exposed earth properly treated within six months after the last construction activities?		$\checkmark$				
2.06	Are the access roads sprayed with water to maintain the entire road surface wet or paved?		$\checkmark$				
2.07	Is the surface where any drilling, cutting, polishing or breaking operation continuously sprayed with water?		$\checkmark$				
2.08	Is the load on vehicles covered entirely by clean impervious sheeting?		$\checkmark$				
2.09	Is the loading of materials to a level higher than the side and tail boards during transportation by vehicles avoided?		$\checkmark$				
2.10	Is the road leading to the construction site within 30m of the vehicle entrance kept clear of dusty materials?		$\checkmark$				
2.11	Is dark smoke emission from plant/equipment avoided?		$\checkmark$				
2.12	Are de-bagging, batching and mixing processes carried out in sheltered areas during the use of bagged cement?	$\checkmark$					
2.13	Are site vehicles travelling within the speed limit not more than 15km/hour?		$\checkmark$				
2.14	Are hoardings of not less than 2.4m high provided along the site boundary, which adjoins areas accessible to the public?	$\checkmark$					
2.15	Is open burning avoided?		$\checkmark$				
2.16	Excavated materials from the stream must remove form site on the same day. The materials shall be stored in covered impermeable skips awaiting removal from site.		$\checkmark$				
Sectio	n 3: Noise						
3.01	Are noisy equipment and activities positioned as far as practicable from the sensitive receivers?		$\checkmark$				
3.02	Is silenced equipment adopted?		$\checkmark$				
3.03	Is idle equipment turned off or throttled down?		$\checkmark$				
3.04	Are all plant and equipment well maintained and in good condition?		$\checkmark$				
3.05	Are noise barriers or enclosures provided at areas where construction activities cause noise impact on sensitive receivers?	$\checkmark$					
3.06	Are hand held breakers fitted with valid noise emission labels during operation?	$\checkmark$					



Note:	Not Obs.: Not Observed; Yes: Compliance; No: Non-Compliance; Follow Up: Observations requiring follow-Up actions N/A: Not Applicable	Not Obs.	Yes	No	Follow Up	N/A	Photo/ Remarks
3.07	Are air compressors fitted with valid noise emission labels during operation?	$\checkmark$					
3.08	Are flaps and panels of mechanical equipment closed during operation?		$\checkmark$				
3.09	Are Construction Noise Permit(s) applied for percussive piling works?	$\checkmark$					
3.10	Are Construction Noise Permit(s) applied for general construction works during restricted hours?		$\checkmark$				
3.11	Are valid Construction Noise Permit(s) posted at site entrances?		$\checkmark$				
3.12	Use of quiet plant had been used on site to minimise the construction noise impact to the surrounding residences/dwellings (Level 1 mitigation measures).	$\checkmark$					
3.13	Temporary/Moveable noise barrier or site hoarding are provide or erect at the site boundary to minimise the noise impact of the closest NSRs or stationary equipments shield by the noise barrier which cannot visible from NSRs (Level 2 mitigation measure)	$\checkmark$					
3.14	Temporary/Moveable noise barrier equal to or more than 3m height with 10kg/m2 are provide for noise mitigation measures (Level 2 mitigation measures).	$\checkmark$					
Sectio	n 4: Waste/Chemical Management						
4.01	Waste Management Plan had been submit to Engineer for approval.		$\checkmark$				
4.02	Are receptacles available for general refuse collection?		$\checkmark$				
4.03	Is general refuse sorting or recycling implemented?		$\checkmark$				
4.04	Is general refuse disposed of properly and regularly?		$\checkmark$				
4.05	Is the Contractor registered as a chemical waste producer?	$\checkmark$					
4.06	Are the chemical waste containers properly labelled?	$\checkmark$					
4.07	Are the chemical containers stored in proper storage areas?		$\checkmark$				
4.08	Is the chemical waste storage area properly labelled?		$\checkmark$				
4.09	Is the chemical waste storage area used for storage of chemical waste only?		$\checkmark$				
4.10	Are incompatible chemical wastes stored in different areas?	$\checkmark$					
4.11	Are the chemical wastes disposed of by licensed collectors?	$\checkmark$					
4.12	Are trip tickets for chemical wastes disposal available for inspection?	$\checkmark$					
4.13	Are chemical/fuel storage areas bunded?		$\checkmark$				
4.14	Are designated areas identified for storage and sorting of construction wastes?		$\checkmark$				
4.15	Are construction wastes sorted (inert and non-inert) on site?		$\checkmark$				
4.16	Are construction wastes reused?		$\checkmark$				
4.17	Are construction wastes disposed of properly?				$\checkmark$		
4.18	Are site hoardings and signboards made of durable materials instead of timber?		$\checkmark$				
4.19	Is trip ticket system implemented for the disposal of construction wastes and records available for inspection?		$\checkmark$				
4.20	Are appropriate procedures followed if contaminated material exists?		$\checkmark$				
4.21	Is relevant license/ permit for disposal of construction waste or excavated materials available for inspection?		$\checkmark$				
4.22	Site cleanliness and appropriate waste management training had provided for the site workers.		$\checkmark$				
4.23	Contaminated sediments will be managed according to WBTC No.12/2000 and EWTB TC(W) No. 34/2002.		$\checkmark$				



Note:	Not Obs.: Not Observed; Yes: Compliance; No: Non-Compliance; Follow Up: Observations requiring follow-Up actions N/A: Not Applicable	Not Obs.	Yes	No	Follow Up	N/A	Photo/ Remarks
Sectio	on 5: Landscape & Visual						
5.01	Are retained and transplanted trees in health condition?		$\checkmark$				
5.02	Are retained and transplanted trees properly protected?		$\checkmark$				
5.03	Are surgery works carried out for the damaged trees?					$\checkmark$	
5.04	Is damage to trees outside site boundary due to construction activities avoided?		$\checkmark$				
5.05	Is the night-time lighting controlled to minimize glare to sensitive receivers?		$\checkmark$				
Sectio	on 6: Ecology						
6.01	Gabion banks and base had been provide for channel linings and banks for typical sections?	$\checkmark$					
6.02	Prevent site effluent/runoff discharge to the seasonal wetlands?	$\checkmark$					
6.03	Stockpiling or disposal of materials, and any dredging or construction activities at the seasonal wetlands are prohibited?	$\checkmark$					
Sectio	on 7: Others						
7.01	Are relevant Environmental Permits posted at all vehicle site entrances/exits?		$\checkmark$				
7.02	Is any mosquito control measures implemented to prevent mosquito breeding?						

#### Remarks

Follow-Up of Last Site Inspection: Not required for reminders.								
Findings of Site Inspection on 23 Auig 2012: No adverse environmental impacts were observed along the site at MUP05 (Photo 1) and Loi Tung (Photo 2). However, full implementation of the required environmental mitigation measures is reminded.	<image/> <section-header></section-header>	Photo 2 EO's						
IEC's representative RE's rep	resentative ET's representative	representativ	Contractor's representative					



(

) ( H. N. Cheung ) ( F. N. Wong ) ( Lai Kwok Hong )

)

(



Appendix L

**Proforma of Ecology Inspection Checklist** 



Project:	DSD Contract	No. DC/2007/08		Inspected by		Checklist No. 120726		
		nprovement Works at Ping Che, Man Uk Pin and Lin Ma Hang			IEC/IEC's Repres			
Inspection					ETL/ ET's Repres		Mark Shea	
Date:	26 July 2012				EO/EO's Represe	entative:	Lai Kwok Hong Alex	
Time:	16:00 pm		Contractor's Representative:					
PART A:		GENE	RAL INFORMA	TION		Env	vironmental Permit No.	
Weather:	Sunny	Fine	Cloudy	✓ Rainy	Calm	✓ EF	P-277/2007A	
Temperature	26	°C						
Humidity:	High	✓ Moderate	Low			N/A		
Wind:	Strong	Breeze	✓ Light	Calm				
Channel				Area Ins	spected			
MUP01/02/0	)5			AI	I			

PART	В:	SITE AUDIT							
Note:	EM&A REF:	Not Obs.: Not Observed; Yes: Compliance; No: Non-Compliance; Follow Up: Observations requiring follow-Up actions N/A: Not Applicable	Not Obs.	Yes	No	Follow Up	N/A	Photo/ Remarks	
Sectio	on 6: Eco								
1.01	6.5.8	earthworks to widen the stream have been undertaken from the landward side and existing stream untouched except during the final stage		✓					
1.04	6.5.9	widened stream bottom floored with natural materials to approximate as closely as possible to the rocky components of a natural stream bottom		✓					
1.02	6.5.10	Any essential works outside the dry season have been temporarily isolated from the stream					~		
1.03	6.5.11	Excavation works have been restricted to 300m length at any one time		✓					
1.04	6.5.13	native riparian trees which would be impacted during construction works have been transplanted to suitable sites within the project area where possible				~			
1.05	6.5.22	Construction activities have been restricted to works area that should be clearly demarcated		✓					
1.06	6.5.22	Temporary diversions have been provided to ensure continuous water flow to the downstream section.		✓					
1.07	6.5.22	The proposed works site inside or in the proximity of natural streams have been temporarily isolated		✓					
1.08	6.5.22	no disturbance to the stream bed and bank have been found from construction works, equipment or workers for the stream section where the existing natural stream bed and bank will be left untouched				✓			
1.09	6.5.22	Temporary access track on streambed have been kept to the minimum width and length		✓					
1.09	6.5.22	Temporary stream crossings are supported on stilts above the stream bed.					~		
1.10	6.5.22	Adequate temporary drainage measures including sediment and oil/grease traps have been provided to prevent contaminated site run-off entering the water bodies		✓					
1.11	6.5.22	Stockpiling of construction materials, spoils and waste have been properly covered and located away from water bodies				$\checkmark$			



Note:	EM&A REF:	Not Obs.: Not Observed; Yes: Compliance; No: Non-Compliance; Follow Up: Observations requiring follow-Up actions N/A: Not Applicable	Not Obs.	Yes	No	Follow Up	N/A	Photo/ Remarks
1.12	6.5.22	Supervisory staff of the contractor have been assigned to station on site to closely supervise and monitor the construction works		✓				
1.13	6.5.22	workers have bee regularly briefed to avoid disturbing the flora and fauna near the works area		~				
1.14	6.5.22	Construction effluent, site run-off and sewage have been properly collected, treated and disposed				$\checkmark$		
1.15	6.5.22	details of the mitigation measures to be implemented during construction stage have been submitted to the Engineer for approval		√				

#### Remarks

MUP05: Soil and rocks are observed piled in riverbed, attention should be paid to potential erosion caused by storm or heavy rain. Without control measure, the potential runoff with sediments will affect downstream / riverbed.

Recommended actions:

Soil erosion control;

IEC's representative	RE's representative	ET's representative	EO's representative	Contractor's representative	
		Mosh			
( )	( )	(Mark Shea )	( )	(	)



Project:	DSD Contract N	No. DC/2007/08			Inspected by		Checklist No.	120802
	Drainage Improve	ement Works at Che, Man Uk Pin ar	nd I in Ma Hand	1	IEC/IEC's Repres	entative:		
					RE/RE's Represe	ntative:		
Inspection					ETL/ ET's Repres	entative:	Mark Shea	
Date:	2 August 2012				EO/EO's Represe	entative:	Lai Kwok Hong	Alex
Time:	16:00 pm				Contractor's Rep	resentative:		
PART A:		GENE	RAL INFORMA	TION		Envi	ronmental Permi	t No.
Weather:	Sunny	✓ Fine	Cloudy	Rainy	Calm	✓ EP-	277/2007A	
Temperature	32	0°C						
Humidity:	High	✓ Moderate	Low			N/A		
Wind:	Strong	Breeze	✓ Light	Calm				
Channel				Area Ins	spected			
MUP01/02/0	)5			AI				

PART	В:	SITE AUDIT							
Note:	EM&A REF:	Not Obs.: Not Observed; Yes: Compliance; No: Non-Compliance; Follow Up: Observations requiring follow-Up actions N/A: Not Applicable	Not Obs.	Yes	No	Follow Up	N/A	Photo/ Remarks	
Sectio	on 6: Eco								
1.01	6.5.8	earthworks to widen the stream have been undertaken from the landward side and existing stream untouched except during the final stage		✓					
1.04	6.5.9	widened stream bottom floored with natural materials to approximate as closely as possible to the rocky components of a natural stream bottom		✓					
1.02	6.5.10	Any essential works outside the dry season have been temporarily isolated from the stream					~		
1.03	6.5.11	Excavation works have been restricted to 300m length at any one time		✓					
1.04	6.5.13	native riparian trees which would be impacted during construction works have been transplanted to suitable sites within the project area where possible				~			
1.05	6.5.22	Construction activities have been restricted to works area that should be clearly demarcated		✓					
1.06	6.5.22	Temporary diversions have been provided to ensure continuous water flow to the downstream section.		✓					
1.07	6.5.22	The proposed works site inside or in the proximity of natural streams have been temporarily isolated		✓					
1.08	6.5.22	no disturbance to the stream bed and bank have been found from construction works, equipment or workers for the stream section where the existing natural stream bed and bank will be left untouched				✓			
1.09	6.5.22	Temporary access track on streambed have been kept to the minimum width and length		✓					
1.09	6.5.22	Temporary stream crossings are supported on stilts above the stream bed.					~		
1.10	6.5.22	Adequate temporary drainage measures including sediment and oil/grease traps have been provided to prevent contaminated site run-off entering the water bodies		✓					
1.11	6.5.22	Stockpiling of construction materials, spoils and waste have been properly covered and located away from water bodies				$\checkmark$			



Note:	EM&A REF:	Not Obs.: Not Observed; Yes: Compliance; No: Non-Compliance; Follow Up: Observations requiring follow-Up actions N/A: Not Applicable	Not Obs.	Yes	No	Follow Up	N/A	Photo/ Remarks
1.12	6.5.22	Supervisory staff of the contractor have been assigned to station on site to closely supervise and monitor the construction works		~				
1.13	6.5.22	workers have bee regularly briefed to avoid disturbing the flora and fauna near the works area		~				
1.14	6.5.22	Construction effluent, site run-off and sewage have been properly collected, treated and disposed				$\checkmark$		
1.15	6.5.22	details of the mitigation measures to be implemented during construction stage have been submitted to the Engineer for approval		√				

#### Remarks

MUP05: Soil and rocks are observed piled in riverbed, attention should be paid to potential erosion caused by storm or heavy rain. Without control measure, the potential runoff with sediments will affect downstream / riverbed.

Recommended actions:

Soil erosion control;

IEC's representative	RE's representative	ET's representative	EO's representative	Contractor's representative	
		Mossh			
( )	( )	(Mark Shea )	( )	(	)



Project:	DSD Contract N		Inspected by	Checklist No. 120809					
-	Drainage Improve Tai Po Tin, Ping C	nd Lin Ma Hano	IEC/IEC's Repres	sentative:					
	<b>_</b>	,		, 	RE/RE's Represe	entative:			
Inspection					ETL/ ET's Repres	sentative:	Mark Shea		
Date:	9 August 2012			EO/EO's Represe	entative:	Lai Kwok Hong Alex			
Time:	13:30 pm			Contractor's Representative:					
PART A:		GENE	RAL INFORMA	TION		En	vironmental Permit No.		
Weather:	Sunny	✓ Fine	Cloudy	Rainy	Calm	E	P-277/2007A		
Temperature	32	0°C							
Humidity:	High	Moderate	Low			N/A			
Wind:	Strong	Breeze	Light	Calm					
Channel				Area Ins	spected				
MUP01/02/0	)5			Al	I				

PART	В:	SITE AUDIT						
Note:	EM&A REF:	Not Obs.: Not Observed; Yes: Compliance; No: Non-Compliance; Follow Up: Observations requiring follow-Up actions N/A: Not Applicable	Not Obs.	Yes	No	Follow Up	N/A	Photo/ Remarks
Sectio	on 6: Eco	logy						
1.01	6.5.8	earthworks to widen the stream have been undertaken from the landward side and existing stream untouched except during the final stage		√				
1.04	6.5.9	widened stream bottom floored with natural materials to approximate as closely as possible to the rocky components of a natural stream bottom		~				
1.02	6.5.10	Any essential works outside the dry season have been temporarily isolated from the stream					$\checkmark$	
1.03	6.5.11	Excavation works have been restricted to 300m length at any one time		$\checkmark$				
1.04	6.5.13	native riparian trees which would be impacted during construction works have been transplanted to suitable sites within the project area where possible				✓		
1.05	6.5.22	Construction activities have been restricted to works area that should be clearly demarcated		$\checkmark$				
1.06	6.5.22	Temporary diversions have been provided to ensure continuous water flow to the downstream section.		~				
1.07	6.5.22	The proposed works site inside or in the proximity of natural streams have been temporarily isolated		$\checkmark$				
1.08	6.5.22	no disturbance to the stream bed and bank have been found from construction works, equipment or workers for the stream section where the existing natural stream bed and bank will be left untouched				✓		
1.09	6.5.22	Temporary access track on streambed have been kept to the minimum width and length		$\checkmark$				
1.09	6.5.22	Temporary stream crossings are supported on stilts above the stream bed.					$\checkmark$	
1.10	6.5.22	Adequate temporary drainage measures including sediment and oil/grease traps have been provided to prevent contaminated site run-off entering the water bodies		✓		√		
1.11	6.5.22	Stockpiling of construction materials, spoils and waste have been properly covered and located away from water bodies				$\checkmark$		



Note:	EM&A REF:	Not Obs.: Not Observed; Yes: Compliance; No: Non-Compliance; Follow Up: Observations requiring follow-Up actions N/A: Not Applicable	Not Obs.	Yes	No	Follow Up	N/A	Photo/ Remarks
1.12	6.5.22	Supervisory staff of the contractor have been assigned to station on site to closely supervise and monitor the construction works		V				
1.13	6.5.22	workers have bee regularly briefed to avoid disturbing the flora and fauna near the works area		~				
1.14	6.5.22	Construction effluent, site run-off and sewage have been properly collected, treated and disposed				$\checkmark$		
1.15	6.5.22	details of the mitigation measures to be implemented during construction stage have been submitted to the Engineer for approval		~				

#### Remarks

MUP05: Works at most river section completed. Soil and rocks are observed piled on river side, attention should be paid to potential erosion caused by storm or heavy rain.

Recommended actions:

- Soil erosion control;
- Remove soil piles in the streambed

IEC's representative	RE's representative	ET's representative	EO's representative	Contractor's representative
		Moosh		
( )	( )	(Mark Shea )	( )	( )



Project:	DSD Contract N	lo. DC/2007/08		Inspected by		Checklist No. 120818		
-	Drainage Improve Tai Po Tin, Ping C	ement Works at Che, Man Uk Pin ar	ıd Lin Ma Hanç	IEC/IEC's Repres				
Inspection			RE/RE's Represe ETL/ ET's Repres	sentative:	Mark Shea			
Date:	18 August 2012				EO/EO's Represe	entative:	Lai Kwok Hong Alex	
Time:	15:00 pm				Contractor's Rep	presentative:		
PART A:		GENE	RAL INFORMA	TION		Env	vironmental Permit No.	
Weather:	Sunny	✓ Fine	Cloudy	Rainy	Calm	✓ EP	-277/2007A	
Temperature	32	0°C						
Humidity:	High	✓ Moderate	Low			N/A		
Wind:	Strong	Breeze	✓ Light	Calm				
Channel				Area Ins	spected			
MUP01/02/0	)5			AI	I			
				7.0				

PART B:		SITE AUDIT							-
Note:	EM&A REF:	Not Obs.: Not Observed; Yes: Compliance; No: Non-Compliance; Follow Up: Observations requiring follow-Up actions N/A: Not Applicable	Not Obs.	Yes	No	Follow Up	N/A	Photo/ Remarks	
Sectio	on 6: Eco	logy							
1.01	6.5.8	earthworks to widen the stream have been undertaken from the landward side and existing stream untouched except during the final stage		√					
1.04	6.5.9	widened stream bottom floored with natural materials to approximate as closely as possible to the rocky components of a natural stream bottom		~					
1.02	6.5.10	Any essential works outside the dry season have been temporarily isolated from the stream					~		
1.03	6.5.11	Excavation works have been restricted to 300m length at any one time		~					
1.04	6.5.13	native riparian trees which would be impacted during construction works have been transplanted to suitable sites within the project area where possible				~			
1.05	6.5.22	Construction activities have been restricted to works area that should be clearly demarcated		$\checkmark$					
1.06	6.5.22	Temporary diversions have been provided to ensure continuous water flow to the downstream section.		$\checkmark$					
1.07	6.5.22	The proposed works site inside or in the proximity of natural streams have been temporarily isolated		$\checkmark$					
1.08	6.5.22	no disturbance to the stream bed and bank have been found from construction works, equipment or workers for the stream section where the existing natural stream bed and bank will be left untouched				✓			
1.09	6.5.22	Temporary access track on streambed have been kept to the minimum width and length		~					
1.09	6.5.22	Temporary stream crossings are supported on stilts above the stream bed.					~		
1.10	6.5.22	Adequate temporary drainage measures including sediment and oil/grease traps have been provided to prevent contaminated site run-off entering the water bodies		✓		V			
1.11	6.5.22	Stockpiling of construction materials, spoils and waste have been properly covered and located away from water bodies				$\checkmark$			



Note:	EM&A REF:	Not Obs.: Not Observed; Yes: Compliance; No: Non-Compliance; Follow Up: Observations requiring follow-Up actions N/A: Not Applicable	Not Obs.	Yes	No	Follow Up	N/A	Photo/ Remarks
1.12	6.5.22	Supervisory staff of the contractor have been assigned to station on site to closely supervise and monitor the construction works		$\checkmark$				
1.13	6.5.22	workers have bee regularly briefed to avoid disturbing the flora and fauna near the works area		✓				
1.14	6.5.22	Construction effluent, site run-off and sewage have been properly collected, treated and disposed				$\checkmark$		
1.15	6.5.22	details of the mitigation measures to be implemented during construction stage have been submitted to the Engineer for approval		✓				

#### Remarks

MUP05: Works at most of river sections completed. Soil and rocks are observed piled in riverbed at an upper river section, attention should be paid to potential erosion caused by storm or heavy rain.

Recommended actions:

- Soil erosion control;
- Remove soil piles in the streambed

IEC's representative	RE's representative	ET's representative	EO's representative	Contractor's representative
		Moosh		
( )	( )	(Mark Shea )	( )	( )



Project:	DSD Contract N	o. DC/2007/08		Inspected by		Checklist No. 120823			
-	Drainage Improvement Works at Tai Po Tin, Ping Che, Man Uk Pin and Lin Ma Hang				IEC/IEC's Repres				
				<u> </u>	RE/RE's Represe	entative:			
Inspection					ETL/ ET's Repres	sentative:	Mark Shea		
Date:	23 August 2012		EO/EO's Repres	entative:	Lai Kwok Hong Alex				
Time:	16:00 pm			Contractor's Representative:					
PART A:		GENE	RAL INFORMA	TION		Env	vironmental Permit No.		
Weather:	Sunny	Fine	✓ Cloudy	✓ Rainy	Calm	✓ EF	P-277/2007A		
Temperature	32	°C							
Humidity:	High	✓ Moderate	Low			N/A			
Wind:	Strong	✓ Breeze	Light	Calm					
					spected				

PART	ART B: SITE AUDIT							
Note:	EM&A REF:	Not Obs.: Not Observed; Yes: Compliance; No: Non-Compliance; Follow Up: Observations requiring follow-Up actions N/A: Not Applicable	Not Obs.	Yes	No	Follow Up	N/A	Photo/ Remarks
Sectio	on 6: Eco	logy						
1.01	6.5.8	earthworks to widen the stream have been undertaken from the landward side and existing stream untouched except during the final stage		√				
1.04	6.5.9	widened stream bottom floored with natural materials to approximate as closely as possible to the rocky components of a natural stream bottom		~				
1.02	6.5.10	Any essential works outside the dry season have been temporarily isolated from the stream					✓	
1.03	6.5.11	Excavation works have been restricted to 300m length at any one time		$\checkmark$				
1.04	6.5.13	native riparian trees which would be impacted during construction works have been transplanted to suitable sites within the project area where possible				$\checkmark$		
1.05	6.5.22	Construction activities have been restricted to works area that should be clearly demarcated		$\checkmark$				
1.06	6.5.22	Temporary diversions have been provided to ensure continuous water flow to the downstream section.		$\checkmark$				
1.07	6.5.22	The proposed works site inside or in the proximity of natural streams have been temporarily isolated		$\checkmark$				
1.08	6.5.22	no disturbance to the stream bed and bank have been found from construction works, equipment or workers for the stream section where the existing natural stream bed and bank will be left untouched				✓		
1.09	6.5.22	Temporary access track on streambed have been kept to the minimum width and length		$\checkmark$				
1.09	6.5.22	Temporary stream crossings are supported on stilts above the stream bed.					✓	
1.10	6.5.22	Adequate temporary drainage measures including sediment and oil/grease traps have been provided to prevent contaminated site run-off entering the water bodies		√		V		
1.11	6.5.22	Stockpiling of construction materials, spoils and waste have been properly covered and located away from water bodies				√		



Note:	EM&A REF:	Not Obs.: Not Observed; Yes: Compliance; No: Non-Compliance; Follow Up: Observations requiring follow-Up actions N/A: Not Applicable	Not Obs.	Yes	No	Follow Up	N/A	Photo/ Remarks
1.12	6.5.22	Supervisory staff of the contractor have been assigned to station on site to closely supervise and monitor the construction works		✓				
1.13	6.5.22	workers have bee regularly briefed to avoid disturbing the flora and fauna near the works area		✓				
1.14	6.5.22	Construction effluent, site run-off and sewage have been properly collected, treated and disposed				$\checkmark$		
1.15	6.5.22	details of the mitigation measures to be implemented during construction stage have been submitted to the Engineer for approval		~				

IEC's representative		RE's representative		ET's representat	ive	EO's repres	entative	Contractor's representative	
				Moosh					
(	)	(	)	( Mark Shea	)	(	)	(	)
				$\checkmark$					



Appendix M

**Monthly Summary Waste Flow Table** 

# Monthly Summary Waste Flow Table for 2012 (26 July to 25 August 2012)

		Actual Quan	Actual Quantities of C&D Wastes Generated Monthly								
Month	Total Quantity Generated	Hard Rock and Large Broken Concrete	Reused in the Contract	Reused in other Projects	Disposed as Public Fill	Imported Fill	Metals	Paper/ cardboard packaging	Plastics (see Note 3)	Chemical Waste	Others, e.g. general refuse
	(in '000m <sup>3</sup> )	(in '000m <sup>3</sup> )	(in '000m <sup>3</sup> )	(in '000m <sup>3</sup> )	(in '000m <sup>3</sup> )	(in '000m <sup>3</sup> )	(in '000 kg)	(in '000kg)	(in '000kg)	(in '000kg)	(in '000m3)
Jan	2.392	0	0.2	1.062	0	1.13	0	0	0	0	0
Feb	1.97	0	0	1.87	0	0.1	0	0	0	0	0
Mar	2.65	0	0	2.35	0	0.3	0	0	0	0	0
Apr	2.83	0	0	2.68	0	0.15	0	0	0	0	0.011
May	1.37	0	0.1	1.27	0	0	0	0	0	0	0
Jun	0.9	0	0.9	0	0	0	0	0	0	0	0
Sub-total	12.112	0	1.2	9.232	0	1.68	0	0	0	0	0.011
Jul	0.52	0	0.52	0	0	0	0	0	0	0	0
Aug	0.6	0	0	0.6	0	0	0	0	0	0	0
Sep											
Oct											
Nov											
Dec											
Total	13.232	0	1.72	9.832	0	1.68	0	0	0	0	0.011

1										25/7/2012	
	Forecast of Total Quantities of C&D Materials to be Generated from the Contract*										
IVI	Total Quantity Generated	Hard Rock and Large Broken Concrete	Reused in the Contract	Reused in other Projects	Disposed as Public Fill	Imported Fill	Metals	Paper/ cardboard packaging	Plastics (see Note 3)	Chemical Waste	Others, e.g. general refuse
	(in '000m <sup>3</sup> )	(in '000m <sup>3</sup> )	(in '000m <sup>3</sup> )	(in '000m <sup>3</sup> )	(in '000m <sup>3</sup> )	(in '000m <sup>3</sup> )	(in '000 kg)	(in '000 kg)	(in '000 kg)	(in '000 kg)	(in '000m <sup>3</sup> )
	283.5	35.1	47.5	107	32	24	60	1	1	1	10

Notes: (1) The performance targets are given in PS Clause 25.01F(14).

(2) The waste flow table shall also include C&D materials that are specified in the Contract to be imported for use at the Site.

(3) Plastics refer to plastic bottles/containers, plastic sheets/foam from packaging material

\* (4) The Contractor shall also submit the latest forecast of the total amount of C&D materials expected to be generated from the Works, together with a breakdown of the

1.37 nature where the total amount of C&D materials expected to be generated from the Works is equal to or exceeding 50,000 m3. (PS Clause 25.01E(4)(b) refers). [Delete 0.9 Note (4) and the table above on the forecast, where inapplicable].

2.27

#### Summary Table for Work Processes or Activities Requiring Timber for Temporary Works

Contract No. : DC/2007/08

Date: : 25 August 2012

#### Contract Title: \_\_\_\_\_DRAINAGE IMPROVEMENT WORKS AT TAI PO TIN, PING CHE, MAN UK PIN & LIN MA HANG\_

Item No.	Description of Works Process or Activity [see note (a) below]	Justifications for Using Timber in Temporary Construction Works	Est. Quantities of Timber Used (m <sup>3</sup> )	Actual Quantities used (m <sup>3</sup> )	Remarks
	Construction of footpath and Grasscrete paving at MUP05 and MUP01	Formwork for Supporting formwork	1.2	1.3	
2	Construction of U-Channel	Formwork Supporting	2.6	2.1	
		Total Estimated Quantity of Timber Used	3.8		

Notes: (a) The Contractor shall list out all the work items requiring timber for use in temporary construction works. Several minor work items may be grouped into one for ease of updating.

(b) The summary table shall be submitted to the Engineer's Representative monthly together with the Waste Flow Table for review and monitoring in accordance with the PS Clause 25.01E(5).



Appendix N

**Response to Comments** 

Z:\Jobs\2008\TCS00409 (DC-2007-08)\600\EM&A Report\DP\Monthly Report\42nd monthly - August 2012\R1185v1\_July DP.docx Action-United Environmental Services and Consulting



#### DSD Contract DC/2007/08 – Drainage Improvement Works at Tai Po Tin, Ping Che, Man Uk and Lin Ma Hang

1st Response to IEC Comments - EM&A Report (Designated Project)

Item	Section / Paragraph	Comment	Response