MTR Corporation Limited

Tsim Sha Tsui Station Northern Subway

Monthly Environmental Monitoring and Audit Report

December 2016

Certified By:	
Felice Wong Environmental Team Leader	
Date:	

1 3 JAN 2017

MTR Corporation Limited

Tsim Sha Tsui Station Northern Subway

Monthly Environmental Monitoring and Audit Report

December 2016

Verified By:
Dais
Sam Tsoi
Independent Environmental Checker
Date:
14/1/2017

EXECUTIVE SUMMARY

The Tsim Sha Tsui Northern Subway Project (TNS) was awarded to the respective contractor in late Dec 2012. The EM&A programme for (TNS) Project commenced on 8 Feb 2013, the commencement date of construction of the Project. This is the forty seventh monthly Environmental Monitoring and Audit (EM&A) Report for TNS Project. The Report presents the results of EM&A works for the project works undertaken during the period of December 2016.

The impact monitoring for air quality and noise were conducted for the weeks of December 2016. Both noise and dust monitoring results were below action limits. No environmental notification of summon, prosecution and valid complaint were received in the reporting period.

Regular joint site inspections, led by the ER with the presence with representatives from the Contractor and Environmental Team, were conducted on weekly basis to monitor Contractors' performance on environmental management and implementation of environmental pollution control and mitigation measures for the Project.

The Environmental Permit (EP-317/2009/A), which is a variation to the original permit and issued on 27 January 2014, is being used for the TNS Project.

In the reporting period, no non-conformance was identified and no reporting change of circumstances which may affect the compliance with the recommendations of the EIA Report.

In next reporting period, no major key issue is anticipated as the works have been substantially completed and only site handover and defect rectification remained.

EXECUTIVE SUMMARY

- 1 Introduction
 - 1.1 Project Background
 - 1.2 Project Programme
 - 1.3 Coverage of the EM&A Report
- 2 Project Information
 - 2.1 Project Management Organization and Contact Details
 - 2.2 Project Works Sites and Areas and Environmental Monitoring Locations
 - 2.3 Summary of EM&A Requirements
 - 2.4 Implementation of Environmental Mitigation Measures
 - 2.5 Construction Activities in the Reporting Month
 - 2.6 Construction Activities in the Coming Month
- 3 Impact Monitoring
 - 3.1 Air Quality
 - 3.2 Noise
 - 3.3 Action Taken in Event of Exceedance
- 4 Landscape and Visual
 - 4.1 Monitoring Requirements
 - 4.2 Audit Results
 - 4.3 Action Taken in Event of Non-Conformance
- 5 Waste Management
- 6 Water Quality
- 7 Built heritage
- 8 Record of Environmental Complaints
- 9 record of non-Compliances
- 10 Notification of Summons and Successful Prosecutions
- 11 Status of Statutory Submissions
 - 11.1 Submissions required under Environmental Permit
 - 11.2 Statutory Permits and Licenses
- 12 Site Insepctions
 - 12.1 Observations

- 12.2 Other Notable Events
- 13 Future Key Issues
 - 13.1 Key Issues for the Coming Month
 - 13.2 Effectiveness and Efficiency of Mitigation Measures
- 14 Conclusions

List of Appendices

Appendix A Figures

Appendix B Environmental Quality Performance Limits

Appendix C Event Action Plans

Appendix D Implementation of Environmental Mitigation Measures

Appendix E Calibration Details

Appendix F Impact Monitoring Graphical Plots

Appendix G Monitoring Schedule for the Present and Next Reporting Period

1 INTRODUCTION

1.1 Project Background

MTR Corporation Limited (MTRCL) proposes to construct Tsim Sha Tsui Station Northern Subway, otherwise referred 'TNS'. This EM&A report is for the phase 1 of the TNS, which is the modification of existing Tsim Sha Tsui Station Entrance A1. The scope of this phase 1 work is to upgrade the Entrance A1 to replace the existing concrete structure with a new transparent box reconstructed on the same site with improved access to the station with new disable lift serving Tsim Sha Tsui concourse level, street and Kowloon Park; and escalators serving street and the existing Entrance A1 Adit. The remaining subway running from the north end of Tsim Sha Tsui Station to the new satellite concourse at The One shopping (previous Tung Ying Building) and then to Miramar Shopping Centre will be grouped at the phase 2 of the TNS project. The phase 2 is still under planning stage and the status will be updated later.

1.2 Project Programme

The TNS Project Phase 1 contract with contract number C6564-11C was awarded to the Goldfield N&W Construction Company Limited (GNW) in late Dec 2012. The commencement of construction was on 8 Feb 2013. The commencement of operation of the Project is scheduled to be in early 2017.

1.3 Coverage of the EM&A Report

The EM&A programme for the TNS Project commenced on 8 Feb 2013. This is the forty seventh Monthly Environmental Monitoring and Audit (EM&A) Report for the Project. The Report presents the results of EM&A works and the impact monitoring for the construction works undertaken by the Contractor during the period of December 2016.

2 PROJECT INFORMATION

2.1 Project Management Organization and Contact Details

The TNS Project organization chart is presented in **Figure 1**. Contacts of key environmental personnel of the Project are shown in **Tables 1a** and **1b** respectively.

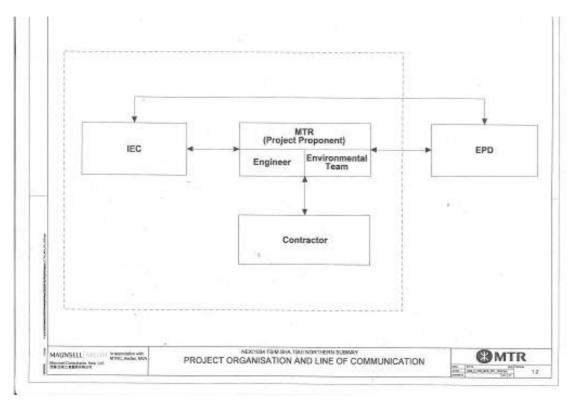


Figure 1 Project Organization

 Table 1a
 Contact List of Key Personnel for Project Management

Organization	Name	Telephone
Engineer's Representative		
Construction Manager	Kevin Man	3547 0001
Senior Construction Engineer	Jack Chan	3547 0086
Construction Engineer	Andy Chan	3547 0087
Independent Environmental Checker		
Arup	Sam Tsoi	2268 3097
Environmental Team		
Environmental Team Leader	Felice Wong	2688 1760

 Table 1b
 Contact List of Environmental Authority

Organization	Name	Telephone
Environmental Protection Department		
Environmental Protection Officer (Regional East) 61	Arthur Lee	2150 8021

2.2 Project Works Sites and Areas and Environmental Monitoring Locations

- The TNS Project works sites and areas are summarized in Table 2 below and shown in Appendix A Figure 1.
- The locations of environmental monitoring locations are indicated in **Appendix** A Figure 2.
- **Table 3** shows the details of the active monitoring stations as reported in Sections 3.1 and 3.2.

 Table 2
 Summary of TNS Project Works Sites and Areas

Contact C6564	l-11C Works Sites and Areas
Works Sites	Tsim Sha Tsui Entrance A

Table 3 Summary of impact air quality and noise monitoring stations

ID	Monitoring Station
Air	
D1	Hai Phong Road
Noise	
M1	Hai Phong Mansion
M2	Comfort Building
M3	Burlington Arcade

2.3 Summary of EM&A Requirements

The EM&A programme mainly requires environmental monitoring for air quality, noise, landscape & visual, water quality, built heritage and waste management as specified in the EM&A Manual.

A summary of impact EM&A requirements as applicable to this EM&A Report is presented in **Table 4** below.

 Table 4
 Summary of Impact EM&A Requirements

Parameters	Descriptions	Locations	Monitoring Frequencies	Duration
Air Quality	24hr- TSP	Shown in Table 3	Once a week	Construction Stage
Noise	L _{eq(30min)}	Shown in Table 3	Once a week	Construction Stage
Landscape and Visual	On-Site Audit	Active Works Sites	Bi-weekly	Construction Stage
Built Heritage	On-Site Audit	Active Works Sites	Bi-weekly	Construction Stage
Waste	On-Site Audit	Active Works Sites	Weekly	Construction Stage
General Site Conditions	Environmental Site Inspection	Active Works Sites	Weekly	Construction Stage

Environmental Quality Performance Limits for air quality and noise are shown in **Appendix B**.

The Event Action Plans for air quality and noise are shown in **Appendix C**.

2.4 Implementation of Environmental Mitigation Measures

The TNS Civil Works Contractors are required to implement the mitigation measures as specified in the EP, EIA Report and EM&A Manual. During the regular environmental site inspections, the Contractors' implementation of mitigation measures were inspected and reviewed. A schedule of the implementation of mitigation measures identified in the TNS EM&A Manual is given in **Appendix D**.

2.5 Construction Activities in the Reporting Month

Major construction activities carried out by the respective TNS Civil Works Contractors during the reporting period include:

Works Site (Tsim Sha Tsui Entrance A)

- Site handover work and defect rectification

2.6 Construction Activities in the Coming Month

Works Site (Tsim Sha Tsui Entrance A)

- Site handover work and defect rectification

3 IMPACT MONITORING

3.1 Air Quality

24 Hour TSP Level Monitoring

The TSP was measured by Andersen High Volume Sampler, model G25A. The sampling procedure follows that described in the App. B of Pt 50 in 40CFR Ch.1 (U.S. Environmental Protection Agency). TSP is sampled by drawing air through a conditioned, pre-weighed filter paper inside the high volume sampler at a controlled rate. After 24-hour sampling the filter paper with retained particles is collected and returned to the laboratory for drying in a desiccator followed by weighing. TSP levels are calculated from the ratio of the mass of particulate retained on the filter paper to the total volume of air sampled.

The samplers should be properly maintained. Prior to dust monitoring commencing, appropriate checks should be made to ensure that all equipment and necessary power supply are in good working condition.

Calibration Requirements

The flow rate of the high volume sampler with mass flow controller will be calibrated using an orifice calibrator. Initial calibration (five points) will be conducted upon installation and prior to commissioning. Calibration will be carried out every six months. Calibration certificates are attached in $\bf Appendix \, E$.

To examine the construction dust levels, 24-hour TSP monitoring was undertaken according to the EM&A Manual. The dust monitoring location is shown in the Section 2.2 above. The monitoring location is subjected to construction dust impact from Works Site, is available to check the environmental performance of the work site and assess the effectiveness of the mitigation measures.

Monitoring results are presented in **Table 5** and **Appendix F** for graphical plot. The 24-hour TSP monitoring results in the range from 66.5 to 71.3 μ g/m³ recorded in the monitoring period shows that the dust levels generated by the active construction activities were within the Action Levels.

Table 5 D1 Hai Phong Road

Date	TSP (μg/m³)	Action Level (μg/m³)	Limit Level (µg/m³)	Compliance to Limit Level	Weather Condition
6 December 2016	69.4	226	260	Yes	Overcast
13 December 2016	71.3	226	260	Yes	Overcast
20 December 2016	66.5	226	260	Yes	Sunny
29 December 2016	68.4	226	260	Yes	Sunny

3.2 Noise

B&K 2250 sound level meters which complied with the International Electrotechnical Commission Publication 651:1979 (Type 1) and 804:1985 (Type 1), specification as referred to in the Technical Memoranda to the NCO were used for the construction noise impact monitoring. The B&K sound level meters and B&K 4231 calibrator are verified by the certified laboratory or manufacturer once every two years to ensure they perform to the same level of accuracy as stated in the manufacturer's specifications. In this reporting period, all relevant calibration certificates are attached in **Appendix E**.

Immediately prior to and following each set of measurements at any NSR, the accuracy of the sound level meter was checked using an acoustic calibrator generating a known sound pressure level at a known frequency. If the calibration levels before and after the measurement differs by more than 1.0dB the measurement shall be repeated to obtain a reliable result. Periods of prolonged or repeated overloading of the sound level meter detector were avoided by setting the meter with adequate headroom prior to commencing measurements. Measurements were recorded to the nearest whole dB, with values of 0.5 or more being rounded up.

Impact noise monitoring of $L_{Aeq(30min)}$ was undertaken to measure construction noise levels in accordance with the EM&A Manual. The noise monitoring locations are shown in Section 2.2 above.

The monitoring results in the range from 65 to 69 dBA are presented in the following **Tables 6a**, **6b** & **6c** and **Appendix F** for graphical plot.

Table 6a M1 Hai Phong Mansion

Date	Time	Measured L _{eq} (dBA)	Baseline Leq (dBA)	Limit Level (dBA)	Exceedance of Limit Level	Weather Condition	Wind Speed (m/s)
6 December 2016	9:30	67	71	75	No	Overcast	<2
13 December 2016	9:30	66	71	75	No	Overcast	<2
20 December 2016	9:30	66	71	75	No	Sunny	<2
29 December 2016	9:30	66	71	75	No	Sunny	<2

^{*} Noise monitoring was carried out during non-raining session.

Table 6b M2 Comfort Building

Date	Time	Measured L _{eq} (dBA)	Baseline Leq (dBA)	Limit Level (dBA)	Exceedance of Limit Level	Weather Condition	Wind Speed (m/s)
6 December 2016	14:00	68	70	75	No	Overcast	<2
13 December 2016	14:00	68	70	75	No	Overcast	<2
20 December 2016	14:00	69	70	75	No	Sunny	<2
29 December 2016	10:00	68	70	75	No	Sunny	<2

^{*} Noise monitoring was carried out during non-raining session.

Table 6c M3 Burlington Arcade

Date	Time	Measured L _{eq} (dBA)	Baseline Leq (dBA)	Limit Level (dBA)	Exceedance of Limit Level	Weather Condition	Wind Speed (m/s)
6 December 2016	14:30	66	68	75	No	Overcast	<2
13 December 2016	14:30	65	68	75	No	Overcast	<2
20 December 2016	14:30	66	68	75	No	Sunny	<2
29 December 2016	10:30	66	68	75	No	Sunny	<2

^{*} Noise monitoring was carried out during non-raining session.

3.3 Action Taken in Event of Exceedance

There was no exceedance in air quality and noise monitoring for the monitoring locations in the reporting period.

4 LANDSCAPE AND VISUAL

4.1 Monitoring Requirements

Monitoring of the implementation of the landscape and visual mitigation measures during construction phase was conducted in accordance with the requirements as stipulated in the EM&A Manual.

The landscape and visual monitoring and audit will be conducted once every two weeks throughout the construction stage.

4.2 Audit Results

Monitoring and audit was undertaken in accordance with the EM&A Manual.

OVT T30 and T31 had fallen due to non-project related causes since the EIA Report, other OVTs were in good health.

The transplantation of the two *Elaeocarpus balansae* in front of Entrance A1 was carried out in May 2013, to sites within Kowloon Park as pre-agreed with LCSD. Both trees have been handed over to LCSD already.

T69, T70 and T71 (all Delonix Regia) at Hai Phong Road were removed on 14 September 2013 as approved under the Tree Removal Applications.

Bi-weekly inspection

The Registered Landscape Architect of Environmental Team or his representatives conducted inspections and audits and the tree protection works were implemented by the respective contractor. No non-conformance was identified in the reporting period.

4.3 Action Taken in Event of Non-Conformance

No actions on landscape and visual were required to be taken in this reporting period.

5 WASTE MANAGEMENT

The quantities disposed in the reporting period are summarized in **Table 7**:

Table 7 Amount of Construction Waste Disposed

Reporting Period	Inert C&D Materials to Public Fill (m³)	Inert C&D Materials Reused (m³)	Non-Inert Waste to Landfill (m ³)	Chemical Waste to Designated Treatment Facility (trips)
Year 2013	715	0	92	0
Year 2014	796	0	8	0
Year 2015	4,809	0	6	0
Jan 2016	18	0	0	0
Feb 2016	36	0	0	0
Mar 2016	12	0	0	0
Apr 2016	0	0	0	0
May 2016	0	0	0	0
Jun 2016	24	0	0	0
Jul 2016	6	0	0	0
Aug 2016	0	0	0	0
Sep 2016	3	0	0	0
Oct 2016	0	0	0	0
Nov 2016	6	0	0	0
Dec 2016	6	0	0	0
Total	6,431	0	106	0

6 WATER QUALITY

An effluent discharge license was granted in November 2013. No construction activity would generate major wastewater discharge. Weekly site inspection was conducted to ensure the recommended mitigation measures are properly implemented and license conditions are observed where applicable.

7 BUILT HERITAGE

There are two built heritage resources have been identified in the close proximity to the work site. The two built heritage resources, the retaining wall and the Block S4 of former Whitfield Barracks were inspected visually. They were well kept and no observable impact due to the project was identified. The two granite columns previously relocated to Kowloon Park is in good condition.

8 RECORD OF ENVIRONMENTAL COMPLAINTS

There was no complaint received during the reporting month.

9 RECORD OF NON-COMPLIANCES

There was no non-compliance identified in the reporting period.

10 NOTIFICATION OF SUMMONS AND SUCCESSFUL PROSECUTIONS

No summon or prosecution related to environmental issue was recorded in the reporting period. A summary of environmental prosecution since commencement of construction is shown in **Table 8** below:

Table 8 Summary of Prosecution

Reporting Period	Frequency	Cumulative	Nature	Status
December 2016	0	0	N/A	N/A
Cumulative	0	0	N/A	N/A

11 STATUS OF STATUTORY SUBMISSIONS

11.1 Submissions required under Environmental Permit

A summary of the status of the clauses required under the TNS Environmental Permit as of December 2016 is shown in **Table 9** below:

Table 9 Summary of EP Submissions

140		Summary of El Submissions	
EP-317/2009 Clause No.		Description	Status
1.11	1	Notification of commencement of construction	Construction commenced on 8 Feb 2013
2.1	2	Establishment of ET with ET Leader	ET set up since Oct 2012
2.2	4	Employment of IEC	IEC set up since Oct 2012
2.3	5	Notification of the management organization of main construction companies and/or any form of JV	Set up in Dec 2012
2.4	6	Submission of Waste Management Plan	Comments received and RTC is being prepared. The WMP is being revised accordingly
5.4	7	Submission of Baseline Monitoring Report	Submitted
5.7	8	Notification of setting up A community liaison procedure and channel	Established since Jan 2013
6.2	9	Notification of Internet address to place EM&A data	Established on 7 March 2013
5.5	10	Monitoring Report for Nov 2016	Submitted

11.2 Statutory Permits and Licenses

A summary of the status of all relevant environmental permits and licenses as of 31 December 2016 is shown in **Table 10** below:

Table 10 Summary of Permits and Licenses

Descriptions	License / Permit Reference	Issue Date	Expired Date
Environmental Permit for Tsim Sha Tsui Station Northern Subway Project	EP-317/2009/A	27 January 2014	NA
Wastewater Discharge License	WT00017459-2013	1 November 2013	30 Jun 2018
Registration as a Chemical Waste Producer	Waste Producer Number: 5213-214-G2417-05	12 March 2013	NA
Disposal of Construction Waste	Billing Account no. 7016610 activated	27 Dec 2012	NA

A variation to the Environmental Permit has been granted by EPD on 27 January 2014. The variation concerns works near OVT 73 and demolition existing exit.

12 SITE INSEPCTIONS

12.1 Observations

Regular site inspections led by the Engineer's Representative and anticipated by ET and respective Contractors were undertaken in accordance with the EM&A Manual in the reporting period. The contractors' performance on environmental matters were assessed and found in an acceptable manner. The inspection findings and the associated recommendations on improvement to the environmental protection and pollution control works were raised to the contractors for reference and/ or action.

Observations against the implementation of the mitigation measures recommended in the EP/EIA are summarized in **Table 11** as follows:

Table 11 Observations

Item	Description	Follow-up Status
	Contract C6564-11C	
1	The contractor was reminded to pay special attention to the Heritage Built and the OVT protection.	On-going

The respective contractors have followed most of concerned items raised during the inspections for rectification in a responsible manner.

12.2 Other Notable Events

IEC Site Inspection

The IEC conducted site inspections for Works Areas on 29 December 2016. Some observations listed in section 12.1 were noted during the site inspections and the respective Contractors had followed up the issues as identified in the site inspections in a responsible manner.

EPD Inspection

EPD inspection was not recorded in this reporting period.

13 FUTURE KEY ISSUES

13.1 Key Issues for the Coming Month

No major key issue is expected as the construction works have been substantially completed, only site handover and defect rectification remain.

13.2 Effectiveness and Efficiency of Mitigation Measures

Based on the environmental monitoring results of the reporting period, the effectiveness and efficiency of the mitigation measures implemented were found to be satisfactory. The respective contractors were reminded to carry out their future construction activities to comply with the requirements of the EP and the relevant contract requirements.

14 CONCLUSIONS

The Report presents the results of EM&A works and the impact monitoring for the construction works undertaken during December 2016. No major construction activities in the reporting period, and only site handover and defect rectification remained.

No exceedance on noise and dust action level and no complaint received.

No notification of summon and prosecution were received in the reporting period.

Regular site inspections led by the Engineer's Representative and participated by the representatives from ET and the respective Contractors' Team were conducted on a weekly basis to monitor the implementation of environmental pollution control and mitigation measures for the Project. No non-conformance to the environmental requirements was identified by the Environmental Team in the reporting period. The performances of the respective contractors on site environmental management were found in a responsible manner in this reporting period.

It is concluded from the environmental monitoring and audit works for the Tsim Sha Tsui Northern Subway Project were undertaken in a responsible manner. The environmental protection and pollution control measures provided by the contractor were generally acceptable.

Appendix A Figures

Figure 1. TNS Project Works Area


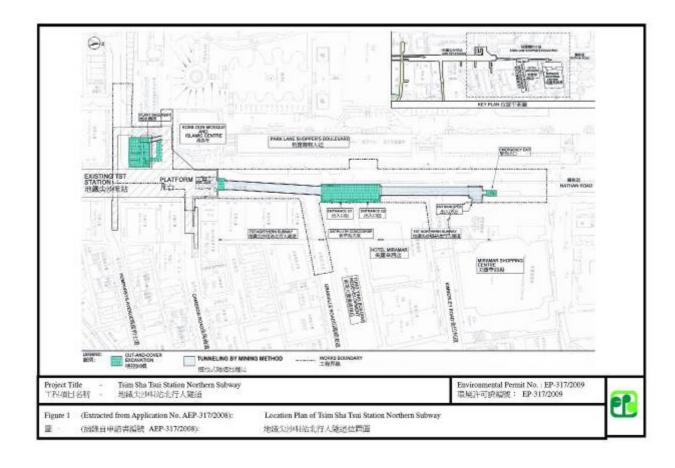


Figure 2. TNS Project Dust and Noise Monitoring Location Plan

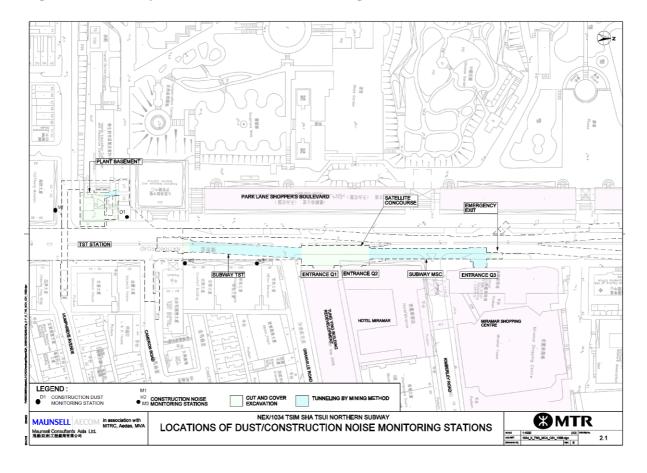

Appendix B

Environmental Quality Performance Limits

Action and Limit Level for 24-hour TSP

Monitoring Station	Action Level (µg/m³)	Limit Level (µg/m³)
D1	226	260

Action and Limit Level for 1-hour TSP for Complaint Handling

Monitoring Station	Action Level (μg/m³)	Limit Level (µg/m³)
D1	310	500

Action and Limit Level for Construction Noise

Time Period	Action Level	Limit Level (dB(A)),
		L _{eq(30min)}
0700-1900 hr on normal	When one documented	75
weekdays	complaint is received	

Appendix C Event Action Plans

Table 2.3 Event / Action Plan for Air Quality (Dust)

Event		Action		一年に はをおおび で 日前
	ET CONTRACTOR	Contractor	83	IEC
Action Level	Conduct additional measurement to confirm finding. Identify source and investigate the causes of exceedance, if caused by MTRCL's work. Inform IEC, ER and Contractor. Discuss with IEC, ER and Contractor on remedial actions required. If necessary, conduct additional monitoring to assess the effectiveness of Contractor's remedial actions. If exceedance continues, arrange meeting with IEC and ER to review implementation and identify further appropriate mitigation measures. If exceedance stops, cease additional monitoring.	Discuss with ET on proper remedial actions. Submit proposals for remedial actions to ER within 3 working days of notification. Amend proposal if appropriate. Implement the agreed proposals. Liaise with ER to optimize the effectiveness of the agreed mitigation.	1. Confirm receipt of notification of exceedance. 2. Notify Contractor. 3. Check Contractor's working methods. 4. Agree with the Contractor on the remedial measures to be implemented. 5. Ensure proper implementation of remedial measures. 6. Assess the efficiency of remedial actions and keep the Contractor informed.	Check Contractor's working method. Advise ET on the effectiveness of the proposed remedial measures.

		-	
-	_	ı	
		ъ	
	•	•	
L	ż	з	
•	-	•	
	r	٦	
2	۰	A	
-	_	•	
Ξ	=	÷	
Ξ		Š	
-		Ş	
-		5	
	The Party of the P	JOHN THE PROPERTY OF THE PERTY	VSELL

Event		ACTION		THE RESERVE AND ADDRESS OF THE PARTY OF THE
	ET.	Contractor	. 83	E
Limit level being exceeded	Conduct additional measurement to confirm findings. Identify source and investigate the causes of exceedance; Notify EPD, IEC, ER and Contractor. Check Contractor's working procedures. Discuss with IEC, ER and Contractor on remedial actions required. If necessary, conduct additional monitoring to assess effectiveness of Contractor's remedial actions. Keep EPD, IEC and ER informed of the monitoring results. If exceedance continues, arrange meeting with IEC and ER informed of the most original and identify further appropriate mitigation measures. If exceedance stops, cease additional monitoring. If exceedance stops, cease additional monitoring.	1. Take immediate action to avoid further exceedance. 2. Discuss with ET and ER on proper remedial actions. 3. Submit proposals for remedial actions to ER within 3 working days of notification. 4. Implement the agreed proposals. 5. Liaise with ER to optimize the effectiveness of the agreed mittgation.	Confirm receipt of notification of exceedance. Notify Contractor. Check Contractor's working methods. Agree with the Contractor on the remedial measures to be implemented. Ensure proper implementation of remedial measures. Ensure proper implementation of remedial actions and keep the Contractor informed.	Check Contractor's working method. Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ET accordingly.

NEX/1034 Tsim Sha Tsui Station Northern Subway EM&A Manual

Table 3.3 Event and Action Plan for Construction Noise

STATE OF THE STATE OF		Action	on	
Event	Ь	Contractor	ER	IEC
Action Level being exceeded	Undertake measurement to establish validity of complaint. Identify source(s) of complaint. Notify IEC, ER and Contractor. Discuss with the IEC, ER and Contractor on remedial measures required. Increase monitoring frequency to check mitigation effectiveness. If excedence continues, arrange meeting with IEC and ER to review implementation and identify further appropriate mitigation measures. 7. If exceedance stops, cease additional monitoring.	Submit noise mitigation proposals to ER within three working days of notification. Amend proposal if appropriate. Implement noise mitigation proposals. Liaise with ER to optimize the effectiveness of the agreed mitigation.	Confirm receipt of notification of complaint. Notify Contractor's working methods. Agree with the Contractor on the remedial measures to be implemented. Ensure proper implementation of remedial measures. Assess the efficiency of remedial actions and keep the Contractor informed. Inform complainant of actions taken.	Check Contractor's working methods. Review the proposed remedial measures by the Contractor and advise the ET accordingly.

Event	M		Action	ANGES SERVICE		
		ET.	Contractor		ER	IEC
Level being exceeded	+ 4 6 4 6	Repeat measurement to confirm findings. Identify source and investigate the cause of exceedance. Inform EPD, IEC, ER and Contractor. Contractors working procedures. Discuss with the IEC, Contractor and ER on remedial measures required. Increase monitoring frequency to assess effectiveness of Contractor's mitigation actions and keep EPD, IEC and ER	Take immediate action to avoid further exceedance. Submit proposals for remedial actions to ER within 3 working days of notification. Implement the agreed proposals. Liaise with ER to optimize the effectiveness of the agreed mitigation.	Confirm receipt of notification of exceedan 2. Notify Contractor. Check Contractor's worl methods. Agree with the Contract on the remedial measur to be implemented. Ensure proper implementation of rememeasures. Assess the efficiency of remedial actions and ket the Contractor informed.	Confirm receipt of notification of exceedance. Notify Contractor. Check Contractor's working methods. Agree with the Contractor on the remedial measures to be implemented. Ensure proper implementation of remedial measures. Assess the efficiency of remedial actions and keep the Contractor informed.	Check Contractor's working methods. Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ET accordingly.
	٧. 8	informed the results If exceedance continuenting with IEC and review implementation dentity further appropriation measures If exceedance stops additional monitoring			į	

Rev. A

3-5



IMPLEMENTATION SCHEDULE OF THE PROPOSED MITIGATION MEASURES APPENDIX B

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Implementation Agent	Location of the Measure	When to implement	Relevant Legislation and Guidelines
Constructi	ion Air Qua	Construction Air Quality Impact				
3.10.1	2.9.2	 watering of active construction works area twice a day 	Contractor	Works Area	Construction	EIAO-TM
		 skip hoist for material transport shall be totally enclosed by impervious sheeting 	pes		Phase	Air Pollution Control
		 every vehicle shall be washed to remove any dusty materials from its body and wheels before leaving a construction site 	usty g a			(Construction Dust) Regulation
		 the area where vehicle washing takes place and the section of the road between the washing facilities and the exit point shall be paved with concrete, bituminous materials or hardcores 	and ous			1 1 1 1
		 where a site boundary adjoins a road, streets or other accessible to the public, hoarding of not less than 2.4m high from ground level shall be provided along the entire length except for a site entrance or exit 	ther Am			
		 every stack of more than 20 bags of cement shall be covered entirely by impervious sheeting places in an area sheltered on the top and the 3 sides 	be an		•	
		 all dusty materials shall be sprayed with water prior to any loading, unloading or transfer operation so as to maintain the dusty materials wet 	1 to	D		
		 the height from which excavated materials are dropped shall be controlled to a minimum practical height to limit fugitive dust generation from unloading 	ped			
r		 stockpile of excavated or dusty materials shall covered entirely by clean impervious sheeting 	pe	71		
		the load of dusty materials carried by vehicle leaving a construction site shall be covered entirely by clean impervious sheeting to ensure dust materials do not leak from the vehicle.	g a ean eak			
		instigation of an environmental monitoring and auditing	ting			

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Implementation Agent	Location of the Measure	When to implement	Relevant Legislation and Guidelines
		program to monitor the construction process in order to enforce controls and modify method of work if dusty conditions arise	order to if dusty			
Construct	Construction Noise Impact	Impact		THE REAL PROPERTY.	に対けの日本のののの	(10年間の東京の東京の日本の日本の日本の日本の日本の日本の日本の日本の日本の日本の日本の日本の日本の
4.9.2-	3.8.1	Adoption of Quieter PME	Contractor	Works Area	Construction Phase	EIAO-TM Noise Control Ordinance
4.9.4	3.8.1	Use of Movable Noise Barrier 5 dB(A) reduction for movable PME and 10 dB(A) for stationary PME can be achieved depending on the actual design of movable noise barrier Barrier material of surface mass in excess of 7 kg/m² is recommended to achieve the predicted screening effect	JB(A) for contractor on the kg/m² is geffect	Works Area	Construction Phase	EIAO-TM Noise Control Ordinance
4.9.5	3.8.1	Use of Noise Enclosure/Acoustic Shed Noise Enclosure or Acoustic Shed is to cover stationary PME such as air compressor and concrete pump. With the adoption of the noise enclosure, the PME could be completely screened, and noise reduction of 15 dB(A) can be achieved according to the GW-TM	Contractor tationary 5. ME could 15 dB(A)	Works Area	Construction Phase	EIAO-TM Noise Control Ordinance
4.9.6	3.8.1	Use of Silencer Silencers are recommended to be used in fan ventilation system to attenuate noise generated during fan operation to achieve a noise reduction of 15dB(A). The Contractor shall be responsible for selection of appropriate silencers for the ventilation fans.	Contractor ing fan (A). The ction of	Works Area	Construction Phase	EIAO-TM Noise Control Ordinance
7.9.7	3.8.1	Use of Noise Insulating Fabric Noise insulating fabric (the Fabric) can be adopted for certain PME (e.g. drill rig, pilling auger etc) The Fabric should be lapped such that no opening or gaps on the joints. Technical data from manufacturer states that by using the Fabric, a noise reduction of over 10 dB(A) can be achieved on noise level (Reference was	Contractor spted for ening or ufacturer n of over snce was	Works Area	Construction Phase	EIAO-TM Noise Control Ordinance

MAUNSELL APCOM

EIA Ref.	EM&A Ref.	Reco	Recommended Mitigation Measures	Implementation Agent	Location of the Measure	When to Implement	Relevant Legislation and Guidelines
			made from Modifications to MTRC Tsim Sha Tsui Station Variation of Environmental Permit EP-113/2001/C). As an conservative approach, a noise reduction of 10 dB(A) for the PME lapped with the Fabric was assumed.				
4.6.6	3.8.1	•	Decking over the excavation areas at the Entrance A1 and satellite concourse	Contractor	Works Area	Construction Phase	EIAO-TM Noise Control Ordinance
4.10.8	3.8.1	Good	Good Site Practices	Contractor	Works Area	Construction Phase	EIAO-TM Noise Control
			Only well-maintained plant shall be operated on-site and plant shall be serviced regularly during the construction program.				Ordinance
		•	Silencers or mufflers on construction equipment shall be utilised and shall be properly maintained during the construction program.				
		• > a	Mobile plant, if any, shall be sited as far away from NSRs as possible.				
		. 2.5 a	Machines and plant (such as trucks) that may be in intermittent use shall be shut down between works periods or shall be throttled down to a minimum.			•	
		• •	Plant known to emit noise strongly in one direction shall, wherever possible, be orientated so that the noise is directed away from the nearby NSRs.				
		2 o ć	Material stockpiles and other structures shall be effectively utilised, wherever practicable, in screening noise from on-site construction activities.				
Operation Noise Impact	Noise Imp			Second September 2015			CONTROL OF BUILDING CO.
Table 4,8	Table 3.4	, 2	The maximum Sound Power Levels (SWLs) for the ventilation shaft openings shall be complied with during the selection of ventilation fans and mitigation measures.	Designer	Station, ventilation shafts and E&M plant items	Design Phase	EIAO-TM

EIA Ref.	EM&A Ref.	Reco		Implementation Agent	Location of the Measure	When to implement	Relevant Legislation and Guidelines
5. 5.	N D D	e quieter plant such as the rely silenced. In noise levels specification naturally plant/louver away from able. If fixed plant/louver away from able. If fixed plant in walled plant ed enclosures. If noisy machines in a baser to building. If acoustic louvers and acounts, acoustic louvers and acounts. If and implement a regular and implement a regular ance programme so that end and serviced in order to noise. The programme sherly trained personnel.	when ordering new ipment). In any NSRs as far as rooms or in specially ment or a completely measures including ustic enclosure where arly scheduled plant equipment is properly or maintain controlled ould be implemented	Designer / Contractor	Station, ventilation shafts and E&M plant items	Design / Operational Phase	Noise Control Ordinance
Construction	on Water (Construction Water Quality Impact	日本の15万米日の大学を対象が 日本の15万米日の大学を対象が 日本の15万米日の大学を対象が 日本の15万米日の大学を対象が 日本の15万米日の大学を対象が 日本の15万米日の大学を対象が 日本の15万米日の大学を対象が 日本の15万米日の大学と 日本の15万米日の大学 日本の15万米日の 日本の15万米日の 日本の15万米日の 日本の15万米日の 日本の15万米日の 日本の15万米日の 日本の15万米日の 日本の15万米日の 日本の15万米日の 日本の15万米日の 日本の15万米日の 日本の 日本の 日本の 日本の 日本の 日本の 日本の 日本の 日本の 日	THE REST OF THE PARTY OF THE PA	STATE OF THE PARTY OF THE	CONTRACTOR CONTRACTOR	Control Color and Color Color
5.13.2	4.3.2	Construction runoff and site drainage should be prevented or minimized in accordance with the guidelines stipulated in ProPECC PN 1/94 "Construction Site Drainage". The specified mitigation measures and practices include the following: • Provision of perimeter drains to intercept off-site water around the site with internal drainage works and erosion and sedimentation control facilities implemented. These shall be constructed in advance of site formation works and earthworks. Earth bunds or sand bag barriers shall be provided on-site to direct storm water to silt removal facilities. The design of the temporary on-site drainage system will be undertaken by the Contractor prior to the commencement of construction. All drainage facilities and erosion and sediment control.	be prevented or sets stipulated in sets. The specified following: bit off-site water rks and erosion mented. These formation works ag barriers shall in to silt removal on-site drainage ctor prior to the ediment control	Contractor	Works Area	Construction	ProPECC PN 1/94 Construction Site Drainage EIAO-TM Water Pollution Control Ordinance Waste Disposal Ordinance

EIA Ref.	The Course	EM&A Recommended Mittgation Measures Ref.	Implementation Agent	Location of the Measure	When to implement	Relevant Legislation Guidelines	and
		structures shall be regularly inspected and maintained to ensure proper and efficient operation at all times and particularly during rainstorms. Deposited silt and grit shall be regularly removed, at the onset of and after each rainstorm to ensure that these facilities are functioning properly at all times.	-			¥1	
		 Exposed slope/soil surface shall be covered by tarpaulin as soon as possible to reduce the potential of soil erosion. Arrangements should always be in place to ensure that adequate surface protection measures can be safely carried out well before the arrival of a rainstorm. Other measures that need to be implemented before, during and after rainstorms are summarized in ProPECC PN 1/94. 					h
		 Open stockpiles of construction materials (e.g. aggregates, sand and fill material) or construction wastes on-site shall be covered with tarpaulin or similar fabric during rainstorms. 		33			
		 Construction works shall be programmed to minimise surface excavation works during the rainy seasons (April to September). All exposed earth areas shall be completed and vegetated as soon as possible after earthworks have been completed, or alternatively, within 14 days of the cessation of earthworks where practicable. If excavation of soil cannot be avoided during the rainy season, or at any time of year when rainstorms are likely, exposed surfaces shall be covered by tarpaulin or other means. 			•		
		 Manholes shall always be adequately covered and temporarily sealed so as to prevent silt, construction materials or debris being washed into the drainage system and storm runoff being directed into foul sewers. 		100			
		 Precautions be taken at any time of year when rainstorms are likely, actions to be taken when a 	2				

-	=	
Ž	Š	
ž	3	
Ę	H	
	4	
		Ħ

EIA Ref.	EM&A Ref.	Recommended Mittgation Measures	Implementation Agent	Location of the Measure	When to implement	Relevant Legislation and Guidelines
		rainstorm is imminent or forecasted, and actions to be taken during or after rainstorms are summarised in Appendix A2 of ProPECC PN 1/94. All vehicles and plant should be cleaned before leaving a construction site to ensure no earth, mud, debris and the like is deposited by them on roads. An adequate designed and sited wheel washing facilities shall be provided at every construction site exit, where practicable. Wash-water shall have sand and silt settled out and removed at least on a weekly basis to ensure the continued efficiency of the process. The section of access road leading to, and exiting from, the wheel-wash bay to the public road shall be paved with sufficient backfall toward the wheel-wash bay to prevent vehicle tracking of soil and silty water to public roads and drains. Oil interceptors shall be emptied and cleaned regularly to prevent the release of oil and grease into the storm water drainage system after accidental spillage. A bypass shall be provided for the oil interceptors to prevent flushing during heaving rain. Construction solid waste, debris and rubbish on site shall be collected, handled and disposed of properly to avoid water quality impacts.			*	
5.13.6	4.3.3 - 3.55	Underground Works shall be conducted sequentially to limit the amount of construction runoff generated from exposed areas during the wet season (April to September). Uncontaminated discharge shall pass through settlement tanks prior to off-site discharge. The wastewater including surface runoff and ingressive	Contractor	Works Area	Construction	ProPECC PN 1/94 Construction Site Drainage EIAO-TM Water Pollution Control Ordinance

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Implementation Agent	Location of the Measure	When to implement	Relevant Legistation and Guidelines
		water in underground area with a high concentration of SS shall be treated (e.g. by settlement in tanks with sufficient retention time) before discharge. Oil interceptors would also be installed to remove the oil, lubricants and grease from the wastewater.				
5.13.7	4.3.6	Sewage Effluent Temporary sanitary facilities, such as portable chemical toilets, shall be employed on-site where necessary to handle sewage from the workforce. A licensed contractor would be responsible for appropriate disposal of waste matter and maintenance of these facilities.	Contractor	Works Area	Construction Phase	ProPECC PN 1/94 Construction Site Drainage EIAO-TM Water Pollution Control Ordinance
5.14.2	4.3.8	General Construction Site Activities Debris and rubbish generated on-site shall be collected, handled and disposed of properly to avoid being flushed or blown by wind into the drainage culvert. Stockpiles of cement and other construction materials should be kept covered when not being used. Oils and fuels shall only be used and stored in designated areas which have pollution prevention facilities. To prevent spillage of fuels and solvents, all fuel tanks and storage areas shall be provided with locks and be sited on sealed areas, within bunds of a capacity equal to 110% of the storage capacity of the largest tank. The bund shall be drained of rainwater after a rain event.			*	
Waste Ma	Waste Management	Good Site Dractices	Contractor	Worke Area	Construction	FIAO-TM
3	2	Nomination of an approved person, such as a site manager, to be responsible for good site practices, arrangements for collection and effective disposal to an appropriate facility, of all wastes generated at the site.			Phase	Waste Disposal Ordinance ETWB TCW No. 19/2005

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Implementation Agent	Location of the Measure	When to implement	Relevant Legislation	and
		 Training of site personnel in proper waste management and chemical waste handling procedures. Provision of sufficient waste disposal points and regular collection for disposal. 					
		 Appropriate measures to minimise windblown litter and dust during transportation of waste by either covering trucks or by transporting wastes in enclosed containers. 					
	,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,	 Regular cleaning and maintenance programme for drainage systems, sumps and oil interceptors. 					
		 A Waste Management Plan should be prepared and submitted to the Engineer for approval. One may make reference to ETWB TCW No. 19/2005 for details. 					
		 A recording system for the amount of wastes generated, recycled and disposed (including the disposal sites) should be proposed. 					
6.7.2	5.2.4	In order to monitor the disposal of C&D materials at public fill reception facilities, as appropriate, and to control fly tipping, a trip-ticket system should be included as one of the contractual requirements.					
6.7.3	5.2.5	Waste Reduction Measures	Contractor	Works Area	Construction	EIAO-TM	T
		 Segregation and storage of different types of waste in different containers, skips or stockpiles to enhance reuse or recycling of materials and their proper disposal. 			Phase		
		 Encourage collection of aluminium cans, PET bottles and paper by providing separate labelled bins to enable these wastes to be segregated from other general refuse generated by the work force. 		×			
		 Any unused chemicals or those with remaining functional capacity shall be recycled. 					
		 Proper storage and site practices to minimise the potential for damage or contamination of construction materials. 		,	7		-

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Implementation Agent	Location of the Measure	When to implement	Relevant Legislation and Guidelines
		Plan and stock construction materials carefully to minimise amount of waste generated and avoid unnecessary generation of waste.				
6.7.6 &	5.2.7 -	Construction and Demolition Material Within stockpile areas, the following measures shall be taken to control potential environmental impacts or nuisance:	Contractor	Works Area	Construction	ETWB TCW No. 33/2002 ETWB TCW No. 19/2005
		 covering stockpile of C&D material entirely by clean impervious sheet to reduce potential dust impact. locating stockpiles to minimise potential visual impacts. 	3			
		 minimizing land intake of stockpile areas as far as possible. 				
		 When disposing C&D material at a public fill reception facility, the material shall only consist of soil, rock, concrete, brick, cement plaster/mortar, inert building debris, aggregates and asphalt. 				
		 The material shall be free from marine mud, household refuse, plastic, metals, industrial and chemical waste, animal and vegetable matter, and other material considered to be unsuitable by the Filling Supervisor. 			*	
6.7.8	5.2.9	Chemical Wastes	Contractor	Works Area	Construction	EIAO-TM
	N.	 After use, chemical wastes (for example, cleaning fluids, solvents, lubrication oil and fuel) should be handled according to the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes. 	47-14-20-20		D 200	Waste Disposal (Chemical Waste) (General) Regulation
		 Spent chemicals should be collected by a licensed collector for disposal at the CWTC or other licensed facility. 				
6.7.9	5.2.10	General Refuse General refuse shall be stored in enclosed bins or compaction units separate from C&D material.	Contractor	Works Area	Construction Phase	Public Health and Municipal Services Ordinance
		 A licensed waste collector shall be employed by the 				

September 2008

EIA Het.	EM&A Ref.	Hecommended Mitigation Measures	Implementation Agent	Location of the Measure	When to implement	Relevant Legislation	and
		contractor to remove general refuse from the site, separately from C&D material. Preferably an enclosed and covered area shall be provided to reduce the occurrence of 'wind blown' light material.			251	Guidelines	Prilit
Landscape and Visual Impact	and Visu	al Impact			JENNY SALISTONIA SALISTONIA		
able 7.5	6.3.1	CM1: Existing trees including OVTs to be retained and maintained on site should be carefully protected during construction. Encroachment of any works close to the drip line of OVTs should be avoided. CM2: Trees of high amenity and survival rate after transplanting which unavoidably affected by the works should be transplanted where practical. CM3: Control-of night – time lighting. CM4: Erection of decorative screen hoarding compatible with surrounding setting.	Confractor	Works Area	Construction	EIAO-TM	19
	- 0	Mark Aesthetic design of Entrance A1 (Minimisation of building bulk and adoption of transparent material) and Emergency Exit OM2: Reinstatement of Entrance to Kowloon Park OM3: Planting of 4 nos. of Delanix regia or species as agreed with LCSD along Haiphong Road	Contractor	Works Area	Operation Phase	EIAO-TM	
Built Heritage Impact	ge Impact		THOSE STATES STATES AND SECOND	Paralle Company of the Company			
8.7.4	7.1.1	 Temporary removal of the two granite columns (east of brick wall of modern extension of Block S4) and will be stored securely during construction period, and reinstated back to its original location after completion of works. 	Contractor	Works Area	Construction	EIAO-TM	100
8.8.2	7.2.4	Precautions shall be taken throughout the construction stage to prevent any damage to the historical building. Structural monitoring system, including preconstruction survey shall be designed and implemented by a Registered Structural Engineer to ensure compliance with the Building Ordinance. Consult AMO on any other mitigation measures that	Contractor	Works Area	Construction	EIAO-TM; Building Ordinance	

Charles Land

NEX/1034 Tsim Sha Tsui Station Northern Subway EM&A Manual

EIA Ref. EM8	4	Recommended Mitigation Measures	Implementation Agent	Location of the Measure	Location of When to Relevant the Measure implement Legislation	L 0	and
	woul and required tempt	would be required administratively or under Antiquities and Monuments Ordinance. Implement these requirements from AMO during the construction period. use of sensibly designed hoardings to minimize the temporary visual impact during construction phase.					

Appendix E Calibration Details

ANDERSEN INSTRUMENTS INC.

GS2310 Series Sampler Calibration

 o berren		
(Dickso	n Recon	der)

	Customer ->	> MTRC	(Dici	SITE	Certificate ->	20161101	
	Location ->	> TNS			Date ->	12-Nov-16	
	Sampler ->	1294-109	6		Tech ->	Chan Kin Fung	
***************************************			C(ONDITIO	NS		
Sea Lev	el Pressure	(hpa)	1017.9		Sampler Eleva	ntion (feet)	50
Sea Lev	el Pressure	(in Hg)	30.06		Corrected Pres	ssure (mm Hg)	763.49
Tempera	ature	(deg C)	23.3		Temperature	(deg K)	296.30
Seasona	1 SL Pressure	(in Hg)	30.06		Corrected Sea	sonal (mm Hg)	763.49
Seasona	l Temperature	(deg C)	23.30		Seasonal Tem	perature(deg K)	296.30
			CALIBR	RATION	ORIFICE		
	Make ->	TISCH				Qstd Slope ->	2.06617
	Model ->	TE-5025A	١.			Qstd Intercept ->	-0.2528
	Serial# ->	2821				Date Certified ->	13-May-16
			CA	LIBRAT	ION		
	Plate or	H_2O	Qstd	I	IC	LINEAR	
	Test #	(in)	(M³/min)	(chart)	(corrected)	REGRESSION	
1	18	12.6	1.766	58	59.938	Slope =	29.6947
2	13	10.3	1.598	53	52.943	Intercept =	5.6016
3	10	8.1	1.418	48	47.949	Corr. Coeff. =	0.9996
4	7	5	1.117	39	38,958		
5	5	3.2	0.895	32	31,966		
	C-1-1-1						

Calculations

 $Qstd = 1/m [Sqrt (H_2O (Pa/Pstd) (Tstd/Ta)) - b]$

IC = I [Sqrt (Pa/Pstd) (Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart response

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pa = actual pressure during calibration (mm Hg)

Tstd = 298 deg K

Pstd = 760 mm Hg

For subsequent calculation of sampler flow:

1/m ((I) [Sqrt (298/Tav) (Pav/760)] - b)

m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

Pav = daily average pressure

This is to certify that the above equipment has been calibrated in accordance with manufacturer's procedure.





脊捲貨竹坑道37號利達中心12根 12年, Leader Centre, 37 Wong Chuk Hang Road, Aberdeen, Hong Kong. E-mall: smec@cigismec.com Website: www.cigismec.com

Tel: (852) 2873 6860 Fax: (852) 2555 7533



CERTIFICATE OF CALIBRATION

Certificate No.:	16CA1025 02-03		Page	1	of	2
Item tested						
Description: Manufacturer: Type/Model No.: Serial/Equipment No.: Adaptors used:	Sound Level Mete B & K 2250 2551244	r(Type 1)	Microphone B & K 4189 2550229		Preamp B & K ZC0032 5051	
Item submitted by					-	
Customer Name: Address of Customer: Request No.: Date of receipt:	MTR Corporation 8/F, Fo Tan Railwa - 25-Oct-2016	ay House, Fo Tan, N.'	T. Hong Kong			
Date of test:	26-Oct-2016					
Reference equipment	used in the calib	ration				V. V. III
Description: Multi function sound calibrator Signal generator Signal generator	Model: 88K 4226 DS 360 DS 360	Serial No. 2288444 33873 61227	Expiry Date: 18-Jun-2017 18-Apr-2017 18-Apr-2017		Traceab CIGISME CEPREI CEPREI	
Ambient conditions						
Temperature: Relative humidity; Air pressure:	22 ± 1 °C 55 ± 10 % 1005 ± 5 hPa					

Test specifications

- The Sound Level Meter has been calibrated in accordance with the requirements as specified in BS 7580; Part 1: 1997 and the lab calibration procedure SMTP004-CA-152,
- The electrical tests were performed using an electrical signal substituted for the microphone which was removed and replaced by an equivalent capacitance within a tolerance of ±20%.
- The acoustic calibration was performed using an B&K 4226 sound calibrator and corrections was applied for the difference between the free-field and pressure responsess of the Sound Level Meter.

Test results

This is to certify that the Sound Level Meter conforms to 8S 7580; Part 1: 1997 for the conditions under which the test was performed.

Details of the performed measurements are presented on page 2 of this certificate.

Actual Measurement data are documented on worksheets.

Approved Signatory:

Hueng Jish Tith/Feng Jun Qi

27-Oct-2016

Company Chop:

京 ENGME 综合試験 CO 有限公司

Comments: The results reported in this pertificate refer to the condition of the instrument on the date of calibration and carry no implication regarding the long-term stability of the instrument.

Date:

© Soils & Materials Engineering Co., Ltd.

Form No CARP152-1/Issue 1/Rev C/01/02/2007



香港资价坑道37號利建中心12程 12/F., Leader Centre, 37 Wong Chuk Hang Road, Aberdeen, Hong Kong. E-mail: smec@cigismec.com Website: www.cigismec.com

Tel: (852) 2873 6860 Fax: (852) 2555 7533



CERTIFICATE OF CALIBRATION

(Continuation Page)

Certificate No.:	16CA1025 02-03	Page	2	of	- 2
------------------	----------------	------	---	----	-----

1, Electrical Tests

The electrical tests were performed using an equivalent capacitance substituted for the microphone. The results are given in below with test status and the estimated uncertainties. The "Pass" means the result of the test is inside the tolerances stated in the test specifications. The "-" means the result of test is outside these tolerances.

Test:	Subtest:	Status:	Expanded Uncertanity (dB)	Coverage Factor
Self-generated noise	A	Pass	0.3	
	С	Pass	0.8	
	Lin	Pass	1.6	
Linearity range for Leq	At reference range, Step 5 dB at 4 kHz	Pass	0.3	
	Reference SPL on all other ranges	Pass	0.3	
	2 dB below upper limit of each range	Pass	0.3	
	2 dB above lower limit of each range	Pass	0.3	
Linearity range for SPL	At reference range, Step 5 dB at 4 kHz	Pass	0.3	
Frequency weightings	A	Pass	0.3	
	С	Pass	0.3	
	Lin	Pass	0.3	
Time weightings	Single Burst Fast	Pass	0.3	
	Single Burst Slow	Pass	0.3	
Peak response	Single 100µs rectangular pulse	Pass	0.3	
R.M.S. accuracy	Crest factor of 3	Pass	0.3	
Time weighting 1	Single burst 5 ms at 2000 Hz	Pass	0.3	
	Repeated at frequency of 100 Hz	Pass	0.3	
Time averaging	1 ms burst duty factor 1/103 at 4kHz	Pass	0.3	
	1 ms burst duty factor 1/104 at 4kHz	Pass	0.3	
Pulse range	Single burst 10 ms at 4 kHz	Pass	0.4	
Sound exposure level	Single burst 10 ms at 4 kHz	Pass	0.4	
Overload indication	SPL	Pass	0.3	
	Leq	Pass	0.4	

2, Acoustic tests

The complete sound level meter was calibrated on the reference range using a B&K 4226 acoustic calibrator with 1000Hz and SPL 94 dB. The sensitivity of the sound level meter was adjusted. The test result at 125 Hz and 8000 Hz are given in below with test status and the estimated uncertainties.

Test:	Subtest	Status	Expanded Uncertanity (dB)	Coverage Factor
Acoustic response	Weighting A at 125 Hz Weighting A at 8000 Hz	Pass Pass	0.3 0.5	
	3,111,13		0.0	

Response to associated sound calibrator

N/A

The expanded uncertainties have been calculated in accordance with the ISO Publication "Guide to the expression of uncertainty in measurement", and gives an interval estimated to have a level of confidence of 95%. A coverage factor of 2 is assumed unless explicitly stated.

Calibrated by:

Date:

Fung Chi Yip 26-Oct-2016 - End -

Checked by:

Date:

Lam Tze Wai 27-Oct-2016

The standard(s) and equipment used in the calibration are traceable to national or international recognised standards and are calibrated on a schedule to migintain the required accuracy level.

© Sods & Materials Engineering Co., Utd

Form No CARP152-2/Issue 1/Rev C/01/02/2007



香港货作坑道37號利道中心12板 12F., Leader Centre, 37 Wong Chuk Hang Road, Aberdeen, Hong Kong. E-mall: smac@cigismec.com Website: www.cigismac.com Tel: (852) 2873 6860 Fax: (852) 2555 7533 **SMECLab**

Test Data for Sound Level Meter

Page 1 of 5

Sound level me	eter type:	2250	Serial No.	2551244	Date	26-Oct-2016
Microphone	type:	4189	Serial No.	2550229		
Preamp	type:	ZC0032	Serial No.	5051	Report:	16CA1025 02-03

SELF GENERATED NOISE TEST

The noise test is performed in the most sensitive range of the SLM with the microphone replaced by an equivalent impedance.

Noise level in A weighting	12.5	dB
Noise level in C weighting	13.8	dB
Noise level in Lin	20.1	dB

LINEARITY TEST

The linearity is tested relative to the reference sound pressure level using a continuous sinusoidal signal of frequency 4 kHz. The measurement is made on the reference range for indications at 5 dB intervals starting from the 94 dB reference sound pressure level. And until within 5 dB of the upper and lower limits of the reference range, the measurements shall be made at 1 dB intervals.(SLM set to LEQ/SPL)

dB dB<	Reference/Expected level	Actua	level	Tolerance	Devis	tion
94.0 94.0 94.0 0.7 0.0 0.0 99.0 99.0 99.0 0.7 0.0 0.0 104.0 104.0 104.0 0.7 0.0 0.0 109.0 109.0 109.0 0.7 0.0 0.0 114.0 114.0 114.0 0.7 0.0 0.0 119.0 119.0 119.0 0.7 0.0 0.0 124.0 124.0 124.0 0.7 0.0 0.0 129.0 129.0 129.0 0.7 0.0 0.0 134.0 134.0 134.0 0.7 0.0 0.0 135.0 135.0 135.0 0.7 0.0 0.0 136.0 136.0 136.0 0.7 0.0 0.0 138.0 138.0 138.0 0.7 0.0 0.0 139.0 139.0 139.0 0.7 0.0 0.0 140.0 140.0 140.0 0.7 0.0 0.0 84.0 89.0 89.0 89.0		non-integrated	integrated	6	non-integrated	integrated
99.0 99.0 99.0 0.7 0.0 0.0 104.0 104.0 104.0 0.7 0.0 0.0 109.0 109.0 109.0 0.7 0.0 0.0 114.0 114.0 114.0 0.7 0.0 0.0 119.0 119.0 119.0 0.7 0.0 0.0 124.0 124.0 124.0 0.7 0.0 0.0 129.0 129.0 129.0 0.7 0.0 0.0 134.0 134.0 134.0 0.7 0.0 0.0 135.0 135.0 135.0 0.7 0.0 0.0 136.0 136.0 136.0 0.7 0.0 0.0 138.0 138.0 138.0 0.7 0.0 0.0 139.0 139.0 139.0 0.7 0.0 0.0 140.0 140.0 140.0 0.7 0.0 0.0 89.0 89.0 89.0 0.7 0.0 0.0 84.0 84.0 84.0 0.7 0.0 0.0 79.0 79.0 79.0 0.7 0.0 0.0 69.0 69.0 69.0 0.7 0.0 0.0 64.0 64.0 64.0 0.7 0.0 0.0 65.0 53.9 53.9 0.7 0.0 0.0 64.0 44.0 44.0 43.9 0.7 0.0 0.0	dB	₫B	dB	+/- dB	dB	dB
104.0 104.0 104.0 0.7 0.0 0.0 109.0 109.0 109.0 0.7 0.0 0.0 114.0 114.0 114.0 0.7 0.0 0.0 119.0 119.0 119.0 0.7 0.0 0.0 124.0 124.0 124.0 0.7 0.0 0.0 129.0 129.0 0.7 0.0 0.0 134.0 134.0 134.0 0.7 0.0 0.0 135.0 135.0 135.0 0.7 0.0 0.0 136.0 136.0 136.0 0.7 0.0 0.0 137.0 137.0 137.0 0.7 0.0 0.0 138.0 138.0 138.0 0.7 0.0 0.0 139.0 139.0 139.0 0.7 0.0 0.0 89.0 89.0 89.0 0.7 0.0 0.0 84.0 84.0 84.0 0.7 <td< td=""><td>94.0</td><td>94.0</td><td>94.0</td><td>0.7</td><td>0.0</td><td>0.0</td></td<>	94.0	94.0	94.0	0.7	0.0	0.0
109.0 109.0 109.0 0.7 0.0 0.0 114.0 114.0 114.0 0.7 0.0 0.0 119.0 119.0 119.0 0.7 0.0 0.0 124.0 124.0 124.0 0.7 0.0 0.0 129.0 129.0 0.7 0.0 0.0 134.0 134.0 134.0 0.7 0.0 0.0 135.0 135.0 135.0 0.7 0.0 0.0 136.0 136.0 136.0 0.7 0.0 0.0 137.0 137.0 137.0 0.7 0.0 0.0 138.0 138.0 138.0 0.7 0.0 0.0 139.0 139.0 139.0 0.7 0.0 0.0 140.0 140.0 140.0 0.7 0.0 0.0 89.0 89.0 89.0 0.7 0.0 0.0 84.0 84.0 0.7 0.0	99.0	99.0	99.0	0.7	0.0	0.0
114.0 114.0 114.0 0.7 0.0 0.0 119.0 119.0 119.0 0.7 0.0 0.0 124.0 124.0 124.0 0.7 0.0 0.0 129.0 129.0 0.7 0.0 0.0 134.0 134.0 134.0 0.7 0.0 0.0 135.0 135.0 135.0 0.7 0.0 0.0 136.0 136.0 136.0 0.7 0.0 0.0 137.0 137.0 137.0 0.7 0.0 0.0 138.0 138.0 138.0 0.7 0.0 0.0 139.0 139.0 139.0 0.7 0.0 0.0 140.0 140.0 140.0 0.7 0.0 0.0 89.0 89.0 89.0 0.7 0.0 0.0 84.0 84.0 0.7 0.0 0.0 79.0 79.0 79.0 0.7 0.0 0.0 69.0 69.0 69.0 0.7 0.0 0.0	104.0	104.0	104.0	0.7	0.0	0.0
119.0 119.0 119.0 0.7 0.0 0.0 124.0 124.0 124.0 0.7 0.0 0.0 129.0 129.0 129.0 0.7 0.0 0.0 134.0 134.0 134.0 0.7 0.0 0.0 135.0 135.0 135.0 0.7 0.0 0.0 136.0 136.0 136.0 0.7 0.0 0.0 137.0 137.0 137.0 0.7 0.0 0.0 138.0 138.0 138.0 0.7 0.0 0.0 139.0 139.0 139.0 0.7 0.0 0.0 140.0 140.0 140.0 0.7 0.0 0.0 89.0 89.0 89.0 0.7 0.0 0.0 84.0 84.0 84.0 0.7 0.0 0.0 79.0 79.0 79.0 0.7 0.0 0.0 69.0 69.0 69.0 0.7 0.0 0.0 64.0 64.0 64.0 0.7 0.	109.0	109.0	109.0	0.7	0.0	0.0
124.0 124.0 124.0 0.7 0.0 0.0 129.0 129.0 129.0 0.7 0.0 0.0 134.0 134.0 134.0 0.7 0.0 0.0 135.0 135.0 135.0 0.7 0.0 0.0 136.0 136.0 136.0 0.7 0.0 0.0 137.0 137.0 0.7 0.0 0.0 138.0 138.0 138.0 0.7 0.0 0.0 139.0 139.0 139.0 0.7 0.0 0.0 140.0 140.0 140.0 0.7 0.0 0.0 89.0 89.0 89.0 0.7 0.0 0.0 84.0 84.0 84.0 0.7 0.0 0.0 79.0 79.0 79.0 0.7 0.0 0.0 74.0 74.0 74.0 0.7 0.0 0.0 69.0 69.0 69.0 0.7 0.0	114.0	114.0	114.0	0.7	0.0	0.0
129.0 129.0 129.0 0.7 0.0 0.0 134.0 134.0 134.0 0.7 0.0 0.0 135.0 135.0 135.0 0.7 0.0 0.0 136.0 136.0 136.0 0.7 0.0 0.0 137.0 137.0 137.0 0.7 0.0 0.0 138.0 138.0 138.0 0.7 0.0 0.0 139.0 139.0 139.0 0.7 0.0 0.0 140.0 140.0 140.0 0.7 0.0 0.0 89.0 89.0 89.0 0.7 0.0 0.0 84.0 84.0 84.0 0.7 0.0 0.0 79.0 79.0 79.0 0.7 0.0 0.0 69.0 69.0 69.0 0.7 0.0 0.0 64.0 64.0 64.0 0.7 0.0 0.0 59.0 59.0 59.0 0.7	119.0	119.0	119.0	0.7	0.0	0.0
134.0 134.0 134.0 0.7 0.0 0.0 135.0 135.0 135.0 0.7 0.0 0.0 136.0 136.0 136.0 0.7 0.0 0.0 137.0 137.0 137.0 0.7 0.0 0.0 138.0 138.0 138.0 0.7 0.0 0.0 139.0 139.0 139.0 0.7 0.0 0.0 140.0 140.0 140.0 0.7 0.0 0.0 89.0 89.0 89.0 0.7 0.0 0.0 84.0 84.0 84.0 0.7 0.0 0.0 79.0 79.0 79.0 0.7 0.0 0.0 74.0 74.0 74.0 0.7 0.0 0.0 69.0 69.0 69.0 0.7 0.0 0.0 64.0 64.0 64.0 0.7 0.0 0.0 59.0 59.0 59.0 0.7 -0.1 -0.1 49.0 49.0 49.0 0.7 0.0	124.0	124.0	124.0	0.7	0.0	0.0
135.0 135.0 135.0 0.7 0.0 0.0 136.0 136.0 136.0 0.7 0.0 0.0 137.0 137.0 137.0 0.7 0.0 0.0 138.0 138.0 138.0 0.7 0.0 0.0 139.0 139.0 139.0 0.7 0.0 0.0 140.0 140.0 140.0 0.7 0.0 0.0 89.0 89.0 89.0 0.7 0.0 0.0 84.0 84.0 84.0 0.7 0.0 0.0 79.0 79.0 79.0 0.7 0.0 0.0 74.0 74.0 74.0 0.7 0.0 0.0 69.0 69.0 69.0 0.7 0.0 0.0 64.0 64.0 64.0 0.7 0.0 0.0 59.0 59.0 59.0 0.7 0.0 0.0 54.0 53.9 53.9 0.7 -0.1 -0.1 49.0 49.0 49.0 0.7 0.0	129.0	129.0	129.0	0.7	0.0	0.0
136.0 136.0 136.0 0.7 0.0 0.0 137.0 137.0 137.0 0.7 0.0 0.0 138.0 138.0 138.0 0.7 0.0 0.0 139.0 139.0 139.0 0.7 0.0 0.0 140.0 140.0 140.0 0.7 0.0 0.0 89.0 89.0 89.0 0.7 0.0 0.0 84.0 84.0 84.0 0.7 0.0 0.0 79.0 79.0 79.0 0.7 0.0 0.0 74.0 74.0 74.0 0.7 0.0 0.0 69.0 69.0 69.0 0.7 0.0 0.0 64.0 64.0 0.7 0.0 0.0 59.0 59.0 59.0 0.7 0.0 0.0 54.0 53.9 53.9 0.7 -0.1 -0.1 49.0 49.0 49.0 0.7 0.0 -0.1 44.0 44.0 43.9 0.7 0.0 -0.1 <	134.0	134.0	134.0	0.7	0.0	0.0
137.0 137.0 137.0 0.0 0.0 138.0 138.0 138.0 0.7 0.0 0.0 139.0 139.0 139.0 0.7 0.0 0.0 140.0 140.0 140.0 0.7 0.0 0.0 89.0 89.0 89.0 0.7 0.0 0.0 84.0 84.0 84.0 0.7 0.0 0.0 79.0 79.0 79.0 0.7 0.0 0.0 74.0 74.0 74.0 0.7 0.0 0.0 69.0 69.0 69.0 0.7 0.0 0.0 64.0 64.0 64.0 0.7 0.0 0.0 59.0 59.0 59.0 0.7 0.0 0.0 54.0 53.9 53.9 0.7 -0.1 -0.1 49.0 49.0 0.7 0.0 0.0 44.0 43.9 0.7 0.0 -0.1	135.0	135.0	135.0	0.7	0.0	0.0
138.0 138.0 138.0 0.7 0.0 0.0 139.0 139.0 139.0 0.7 0.0 0.0 140.0 140.0 140.0 0.7 0.0 0.0 89.0 89.0 89.0 0.7 0.0 0.0 84.0 84.0 84.0 0.7 0.0 0.0 79.0 79.0 79.0 0.7 0.0 0.0 74.0 74.0 74.0 0.7 0.0 0.0 69.0 69.0 69.0 0.7 0.0 0.0 64.0 64.0 64.0 0.7 0.0 0.0 59.0 59.0 59.0 0.7 0.0 0.0 54.0 53.9 53.9 0.7 -0.1 -0.1 49.0 49.0 49.0 0.7 0.0 0.0 44.0 43.9 0.7 0.0 -0.1	136.0	136.0	136.0	0.7	0.0	0.0
139.0 139.0 139.0 0.7 0.0 0.0 140.0 140.0 140.0 0.7 0.0 0.0 89.0 89.0 89.0 0.7 0.0 0.0 84.0 84.0 84.0 0.7 0.0 0.0 79.0 79.0 79.0 0.7 0.0 0.0 74.0 74.0 74.0 0.7 0.0 0.0 69.0 69.0 69.0 0.7 0.0 0.0 64.0 64.0 64.0 0.7 0.0 0.0 59.0 59.0 59.0 0.7 0.0 0.0 54.0 53.9 53.9 0.7 -0.1 -0.1 49.0 49.0 0.7 0.0 0.0 44.0 43.9 0.7 0.0 -0.1	137.0	137.0	137.0	0.7	0.0	0.0
140.0 140.0 140.0 0.7 0.0 0.0 89.0 89.0 89.0 0.7 0.0 0.0 84.0 84.0 84.0 0.7 0.0 0.0 79.0 79.0 79.0 0.7 0.0 0.0 74.0 74.0 74.0 0.7 0.0 0.0 69.0 69.0 69.0 0.7 0.0 0.0 64.0 64.0 64.0 0.7 0.0 0.0 59.0 59.0 59.0 0.7 0.0 0.0 54.0 53.9 53.9 0.7 -0.1 -0.1 49.0 49.0 49.0 0.7 0.0 0.0 44.0 43.9 0.7 0.0 -0.1	138.0	138.0	138.0	0.7	0.0	0.0
89.0 89.0 89.0 0.7 0.0 0.0 84.0 84.0 0.7 0.0 0.0 79.0 79.0 79.0 0.7 0.0 0.0 74.0 74.0 74.0 0.7 0.0 0.0 69.0 69.0 69.0 0.7 0.0 0.0 64.0 64.0 64.0 0.7 0.0 0.0 59.0 59.0 59.0 0.7 0.0 0.0 54.0 53.9 53.9 0.7 -0.1 -0.1 49.0 49.0 49.0 0.7 0.0 0.0 44.0 43.9 0.7 0.0 -0.1	139.0	139.0	139.0	0.7	0.0	0.0
84.0 84.0 84.0 0.7 0.0 0.0 79.0 79.0 79.0 0.7 0.0 0.0 74.0 74.0 74.0 0.7 0.0 0.0 69.0 69.0 0.7 0.0 0.0 64.0 64.0 0.7 0.0 0.0 59.0 59.0 59.0 0.7 0.0 0.0 54.0 53.9 53.9 0.7 -0.1 -0.1 49.0 49.0 0.7 0.0 0.0 44.0 43.9 0.7 0.0 -0.1	140.0	140.0	140.0	0.7	0.0	0.0
79.0 79.0 79.0 0.7 0.0 0.0 74.0 74.0 74.0 0.7 0.0 0.0 69.0 69.0 69.0 0.7 0.0 0.0 64.0 64.0 64.0 0.7 0.0 0.0 59.0 59.0 59.0 0.7 0.0 0.0 54.0 53.9 53.9 0.7 -0.1 -0.1 49.0 49.0 0.7 0.0 0.0 44.0 43.9 0.7 0.0 -0.1	89.0	89.0	89.0	0.7	0.0	0.0
74.0 74.0 74.0 0.7 0.0 0.0 69.0 69.0 69.0 0.7 0.0 0.0 64.0 64.0 64.0 0.7 0.0 0.0 59.0 59.0 59.0 0.7 0.0 0.0 54.0 53.9 53.9 0.7 -0.1 -0.1 49.0 49.0 0.7 0.0 0.0 44.0 43.9 0.7 0.0 -0.1	84.0	84.0	84.0	0.7	0.0	0.0
69.0 69.0 69.0 0.7 0.0 0.0 64.0 64.0 64.0 0.7 0.0 0.0 59.0 59.0 59.0 0.7 0.0 0.0 54.0 53.9 53.9 0.7 -0.1 -0.1 49.0 49.0 0.7 0.0 0.0 44.0 43.9 0.7 0.0 -0.1	79.0	79.0	79.0	0.7	0.0	0.0
64.0 64.0 64.0 0.7 0.0 0.0 59.0 59.0 59.0 0.7 0.0 0.0 54.0 53.9 53.9 0.7 -0.1 -0.1 49.0 49.0 49.0 0.7 0.0 0.0 44.0 44.0 43.9 0.7 0.0 -0.1	74.0	74.0	74.0	0.7	0.0	0.0
59.0 59.0 59.0 0.7 0.0 0.0 54.0 53.9 53.9 0.7 -0.1 -0.1 49.0 49.0 0.7 0.0 0.0 44.0 44.0 43.9 0.7 0.0 -0.1	69.0	69.0	69.0	0.7	0.0	0.0
54.0 53.9 53.9 0.7 -0.1 -0.1 49.0 49.0 0.7 0.0 0.0 44.0 43.9 0.7 0.0 -0.1	64.0	64.0	64.0	0.7	0.0	0.0
49.0 49.0 49.0 0.7 0.0 0.0 44.0 44.0 43.9 0.7 0.0 -0.1	59.0	59.0	59.0	0.7	0.0	0.0
44.0 44.0 43.9 0.7 0.0 -0.1	54.0	53.9	53.9	0.7	-0.1	-0.1
	49.0	49.0	49.0	0.7	0.0	0.0
390 389 389 07 -04 -04	44.0	44.0	43.9	0.7	0.0	-0.1
55.5 56.5 50.7 -0,1 -0,1	39.0	38.9	38.9	0.7	-0.1	-0.1

re(Sorls Materials Eng. Co. 1 ad

From No. CANN 152 logge LRes. (640) 02-2007



香港货竹坑道37装利塩中心12樓 12/F., Lasder Centre, 37 Wong Chuk Hang Road, Aberdeen, Hong Kong. E-mail: smec@cigismec.com Website: www.cigismec.com

Tel: (852) 2873 6860 Fax: (852) 2555 7533

SMECLab

Test Data for Sound Level Meter

Page 2 of 5

Sound level meter typ	be: 2250		Serial No.	2551244	Dat	e 26-Oct-	2016
Microphone type Preamp typ			Serial No. Serial No.	2550229 5051		ort: 16CA10	25 02-03
34.0	34.0	33.9	0.7		0.0	-0.1	
33.0	33.0	33.0	0.7		0.0	0.0	
32.0	32.0	32.0	0.7		0.0	0.0	
31.0	31.0	31.0	0.7		0.0	0.0	
30.0	30.0	30.0	0.7		0.0	0.0	

Measurements for an indication of the reference SPL on all other ranges which include it

Other ranges	Expected level	Actual level	Tolerance	Deviation	
dB	dB	dB	+/- dB	dB	
20-140	94.0	94.0	0.7	0.0	1

Measurements on all level ranges for indications 2 dB below the upper limit and 2 dB above the lower limit

Ranges	Reference/Expected level	Actual level	Tolerance	Deviation
dB	dB	dB	+/- dB	dB
20-140	30.0	30.0	0.7	0.0
20-140	138.0	138.0	0.7	0.0

FREQUENCY WEIGHTING TEST

The frequency response of the weighting netwoks are tested at octave intervals over the frequency ranges 31.5 Hz to 12500 Hz. The signal level at 1000 Hz is set to give an indication of the reference SPL.

Frequency weighting A:

Frequency		Ref. level	Expected level	Correction of electrical response	Actual level	Tolerar	ice(dB)	Deviation *
Hz	•	dB	dB	dB	dB	+		dB
1000.0		94.0	94.0	0.0	94.0	0.0	0.0	0.0
31.6	i	94.0	54.6	N/A	54.6	1.5	1.5	0.0
63.1	İ	94.0	67.8	0.0	67.8	1.5	1.5	0.0
125.9		94.0	77.9	0.0	77.9	1.0	1.0	0.0
251.2		94.0	85.4	0.0	85.4	1.0	1.0	0.0
501.2		94.0	90.8	0.0	90.8	1.0	1.0	0.0
1995.0		94.0	95.2	0.0	95.2	1.0	1.0	0.0
3981.0		94.0	95.0	0.0	95.0	1.0	1.0	0.0
7943.0		94.0	92.9	0.0	92.9	1.5	3.0	0.0
12590.0	I	94.0	89.7	-0.5	89.2	3.0	6.0	0.0

Frequency	weighting C:
-----------	--------------

Frequency	Ref. level	Expected level	Correction of electrical response	Actual level	Tolerar	nce(dB)	Deviation *
Hz	dB	dB	dB	dB	+	- '	dB
1000.0	94.0	94.0	0.0	94.0	0.0	0.0	0.0
31.6	94.0	91.0	N/A	91.0	1.5	1.5	0.0
63.1	94.0	93.2	0.0	93.2	1.5	1.5	0.0
125.9	94.0	93.8	0.0	93.8	1.0	1.0	0.0
251.2	94.0	94.0	0.0	94.0	1.0	1.0	0.0

(c)Sods Materials Eng. Co., Ltd.

Form No. CAWS 152/bane 1-Rev. B/01/02/2007



奇態 近 竹 坑 近 3 7 號 利 達 中 心 | 2 複 12/F., Leader Centre, 37 Wong Chuk Hang Road, Aberdeen, Hong Kong. E-mail: smec⊗cigismec.com Website: www.cigismec.com Tel: (852) 2873 6860 Fax: (852) 2555 7533 **SMECLab**

Test Data for Sound Level Meter

Page 3 of 5

Sound level me	eter type:	2250		Serial No.	255	1244	Date 26-	Oct-2016
Microphone Preamp	type: type:	4189 ZC0032		Serial No. Serial No.	255 505	0229 1	Report: 160	A1025 02-03
501.2	94.0	94.0	0.0	94.0	1.0	1.0	0.0	
1995.0	94.0	93.8	0.0	93.8	1.0	1.0	0.0	
3981.0	94.0	93.2	0.0	93.2	1.0	1.0	0.0	
7943.0	94.0	91.0	0.0	91.0	1.5	3.0	0.0	
12590.0	94.0	87.8	-0.5	87.3	3.0	6.0	0.0	

Frequency weighting Lin:

Frequency	Ref. level	Expected level	Correction of electrical response	Actual level	Tolerar	nce(dB)	Deviation *
Hz	dB	dB	dB	dB	+	-	dB
1000.0	94.0	94.0	0.0	94.0	0.0	0.0	0.0
31.6	94.0	94.0	N/A	94.0	1.5	1.5	0.0
63.1	94.0	94.0	0.0	94.0	1.5	1.5	0.0
125.9	94.0	94.0	0.0	94.0	1.0	1.0	0.0
251.2	94.0	94.0	0.0	94.0	1.0	1.0	0.0
501.2	94.0	94.0	0.0	94.0	1.0	1.0	0.0
1995.0	94.0	94.0	0.0	94.0	1.0	1.0	0.0
3981.0	94.0	94.0	0.0	94.0	1.0	1.0	0.0
7943.0	94.0	94.0	0.0	94.0	1.5	3.0	0.0
12590.0	94.0	94.0	-0.5	93.5	3.0	6.0	0.0

^{*}Deviation = Actual level - (Expected level + Correction of electrical response)

TIME WEIGHTING FAST TEST

Time weighting F is tested on the reference range with a single sinusoidal burst of duration 200 ms at a frequency 2000 Hz and an amplitude which produces an indication 4 dB below the upper limit of the primary indicator range when the signal is continuous. (Weight A, Maximum hold)

Ref. level	Expected level	Actual level	Tolerance(dB)	Deviation
dB	dB	dB	+ -	dB
116.0	115.0	115.0	1.0 1.0	0.0

TIME WEIGHTING SLOW TEST

Time weighting S is tested on the reference range with a single sinusoidal burst of duration 500 ms at a frequency 2000 Hz and an amplitude which produces an indication 4 dB below the upper limit of the primary indicator range when the signal is continuous. (Weight A. Maximum hold)

	(g				
Ref. level	Expected level	Actual level	Tolera	nce(dB)	Deviation
dB	dB	dB	+	-	dB
116.0	111.9	111.9	1.0	1.0	0.0

PEAK RESPONSE TEST

The onset time of the peak detector is tested on the reference range by comparing the response to a 100 us rectangular test pulse with the response to a 10 ms reference pulse of the same amplitude. The amplitude of the 10 ms reference pulse is such as to produce an indication 1 dB below the upper limit of the primary indicator range.

(c)Soils Moterals Eng. Co., Lad

Form No. CAWS 112-base 11Rev. Bi01/02/2007

The correction of electrical response is specified in the Table A.2 of technical documentation of BE 1712-21. The maximum expanded uncertainty of correction of electrical response is 0.29 dB.



香酱数竹坑罐37数利缩中心12板 12/F., Leader Centre, 37 Wong Chuk Hang Road, Aberdeen, Hong Kong. E-mall: smec@cigismec.com Website: www.cigismec.com

Tel: (852) 2873 6860 Fax: (852) 2555 7533

SMECLab

Test Data	for Sound	Level	Meter
-----------	-----------	-------	-------

Page 4 of 5

Sound level me	ter type:	2250	Serial No.	2551244	Date 26-Oct-2016
Microphone Preamp	type: type:	4189 ZC0032	Serial No. Serial No.	2550229 5051	Report: 16CA1025 02-03
Positive polaritie	es:	(Weighting Z, set the ge	nerator signal to sir	gle, LZPeak)	
Ref	level	Response to 10 ms	Response to 100 us	Tolerance	Deviation
	dB	dB	dB	+/- dB	dB
11	19.0	119.0	118.7	2.0	-0.3
Negative polarit	ies:				·
Ref	f. level	Response to 10 ms	Response to 100 us	Tolerance	Deviation
	dB	dB	dB	+/- dB	dB
11	19.0	119.0	119.2	2.0	0.2

RMS ACCURACY TEST

The RMS detector accuracy is tested on the reference range for a crest factor of 3.

Test frequency:

2000 Hz

Amplitude: Burst repetition frequency: 2 dB below the upper limit of the primary indicator range.

40 Hz

11 cycles of a sine wave of frequency 2000 Hz. (Set to INT) Tone burst signal: Ref. Level Expected level Tone burst signal Tolerance Deviation Time wighting dB dB indication(dB) +/- dB dB Slow 118.0+6.6 118.0 118.0 0.0

TIME WEIGHTING IMPULSE TEST

Time weighting I is tested on the reference range (Set the SLM to LAImax)

Test frequency: 2000 Hz

Amplitude:

The upper limit of the primary indicator range.

Single sinusoidal burst of duration 5 ms: Ref. Level

Ref. Level	Single burs	t indication	Tolerance	Deviation
dB	Expected (dB)	Actual (dB)	+/- dB	dB
120.0	111.2	111.1	2.0	-0.1
Repeated at 100 Hz				
Ref. Level	Repeated but	rst indication	Tolerance	Deviation
dB	Expected (dB)	Actual (dB)	+/- dB	dB
120.0	117.3	117.2	1.0	-0.1

TIME AVERAGING TEST

This test compares the SLM reading for continuous sine signals with readings obtained from a sine tone burst sequence having the same RMS level. The test level is 30 dB below the upper limit of the linearity range and repeated for Type 1 SLM with 40 dB below the upper limit of the linearity.

4000 Hz Frequency of tone burst:

Duration of tone burst:

 $1 \, \mathrm{ms}$

maneri er terre earet						
Repetition Time	Level of	Expected	Actual	Tolerance	Deviation	Remarks
	tone burst	Leq	Leq			
msec	dB	dB	dB	+/- dB	dB	
1000	110.0	110.0	109.9	1.0	-0.1	60s integ.
10000	100.0	100.0	99.9	1.0	-0.1	6min. integ.

PULSE RANGE AND SOUND EXPOSURE LEVEL TEST

(c)Seds Morenals Eng. Co. Ltd.

Linux No. € NAS 152 Issue Likes, 13/01/02/2007



存储设竹筑缝37號利途中心12模 12/F., Leader Centre, 37 Wong Chuk Hang Road, Aberdeen, Hong Kong. E-mail: smeo@cigismec.com Website: www.cigismec.com

Tel: (852) 2873 6860 Fax: (852) 2555 7533

SMECLab

Test Data for Sound Level Meter

Page 5 of 5

2250 Sound level meter type: 4189

Serial No. 2551244 Serial No. 2550229 Date 26-Oct-2016

Microphone Preamp

type: ZC0032 type:

Serial No. 5051

Report: 16CA1025 02-03 The test tone burst signal is superimposed on a baseline signal corresponding to the lower limit of reference rar

Test frequency:

4000 Hz

Integration time:

10 sec

The integrating sound level meter set to Leg:

Duration	Rms level of	Expected	Actual	Tolerance	Deviation
msec	tone burst (dB)	dB	dB	+/- dB	dB
10	120.0	90.0	89.8	1.7	-0.2

The integrating sound level meter set to SEL:

	Duration	Rms level of	Expected	Actual	Tolerance	Deviation	
	msec	tone burst (dB)	dB	dB	+/- dB	dB	
I	10.0	120.0	100.0	100.0	1.7	0.0	

OVERLOAD INDICATION TEST

For SLM capable of operating in a non-integrating mode.

Test frequency:

2000 Hz

Amplitude:

2 dB below the upper limit of the primary indicator range.

Burst repetition frequency:

40 Hz

Tone burst signal:

11 cycles of a sine wave of frequency 2000 Hz.

Level	Level reduced by	Further reduced	Difference	Tolerance	Deviation
at overload (dB)	1 dB	3 dB	dB	dB	dB
134.3	133.4	130.5	2.9	1.0	-0.1

For integrating SLM, with the instrument indicating Leq.

For integrating SLM, with the instrument indicating Leq and set to the reference range. The test signal as follow The test tone burst signal is superimposed on a baseline signal corresponding to the lower limit of reference rar

Test frequency:

4000 Hz 10 sec

Integration time: Single burst duration:

1 msec

Rms level	Level reduced by	Expected level	Actual level	Tolerance	Deviation
at overload (dB)	1 dB	dB	dB	dB	dB
141.8	140.8	100.8	100.7	2.2	-0.1

ACOUSTIC TEST

The acoustic test of the complete SLM is tested at the frequency 125 Hz and 8000 Hz using a B&K type 4226 Multifunction Acoustic Calibrator. The test is performed in A weighting.

Frequency	Expected level	Actual level	Tolerar	nce (dB)	Deviation
Hz	dB	Measured (dB)	+		dB
1000	94.0	94.0	0.0	0.0	0.0
125	77.9	77.8	1.0	1.0	-0.1
8000	92.9	93.4	1.5	3.0	0.5

----END-----



香港 黄 竹 坑 遊 3 7 號 利 達 中 心 1 2 樓 12/F., Leader Centre, 37 Wong Chuk Hang Road, Aberdeen, Hong Kong. E-mail: smec@cigismec.com Website: www.cigismec.com

Tel: (852) 2873 6860 Fax: (852) 2555 7533



CERTIFICATE OF CALIBRATION

Certificate No.:	16CA1025 02-04		Page:	1	of 2	
Item tested						
Description:	Acoustical Calibra	tor (Class 1)				
Manufacturer:	B&K					
Type/Model No.:	4231					
Serial/Equipment No.:	2725557					
Adaptors used:	-					
Item submitted by					· - -	
Curstomer:	MTR Corporation					
Address of Customer:		ay House, Fo Tan, N.T.	Hong Kong			
Request No.:		.,	. rong rang			
Date of receipt:	25-Oct-2016					
Date of test:	27-Oct-2016		erromaniamento reminente y se		hadden eesseen oo oo oo o	
Reference equipment	used in the calib	ration				-
Description:	Model:	Serial No.	Expiry Date:		Traceable to	·
Lab standard microphone	B&K 4180	2412857	14-Apr-2017		SCL	
Preamplifier	B&K 2673	2743150	28-Apr-2017		CEPREI	
Measuring amplifier	B&K 2610	2346941	26-Apr-2017		CEPREI	
Signal generator	DS 360	61227	18-Apr-2017		CEPREI	
Digital multi-meter	34401A	US36087050	18-Apr-2017		CEPREI	
Audio analyzer	8903B	GB41300350	19-Apr-2017		CEPREI	
Universal counter	53132A	MY40003662	19-Apr-2017		CEPREI	
Ambient conditions		' -d - b -d				
Temperature:	22 ± 1 °C					
Relative humidity:	55 ± 10 %					
Air pressure:	1005 ± 5 hPa					

Test specifications

- The Sound Calibrator has been calibrated in accordance with the requirements as specified in IEC 60942 1997 Annex B and the lab calibration procedure SMTP004-CA-156.
- The calibrator was tested with its axis vertical facing downwards at the specific frequency using insert voltage technique.
- The results are rounded to the nearest 0.01 dB and 0.1 Hz and have not been corrected for variations from a reference pressure of 1013.25 hectoPascals as the maker's information indicates that the instrument is insensitive to pressure 3. . changes.

Test results

This is to certify that the sound calibrator conforms to the requirements of annex B of IEC 60942; 1997 for the conditions under which the test was performed. This does not imply that the sound calibrator meets IEC 60942 under any other conditions.

Details of the performed measurements are presented on page 2 of this certificate.

Нцапа-Лі

hv/Feng Jun Ql

Approved Signatory:

Date: 27-Oct-2016

Company Chop:

Comments: The results reported in his certificate refer to the condition of the instrument on the date of calibration and carry no implication regarding the long-term stability of the instrument.

© Soris & Materials Engineering Co., Ltd



Certificate No.:

綜合試驗有限公司 SOILS & MATERIALS ENGINEERING CO., LTD.

香油 近竹坑 道 3 7 號 稱 途 中 心 1 2 戲 12/F., Leader Centre, 37 Wong Chuk Hang Road, Aberdeen, Hong Kong. E-mail: smec@cigismec.com Website: www.cigismec.com

16CA1025 02-04

Tel: {852} 2873 6860 Fax: {852] 2555 7533

Page: 2




CERTIFICATE OF CALIBRATION

(Continuation Page)

a calibrated laboratory the estimated uncertain	standard microphone and inser inties.	t voltage technique. The resul	ts are given in below with
Frequency Shown Hz	Output Sound Pressure Level Setting d8	Measured Output Sound Pressure Level	(Output level in dB re 20 μPa) Estimated Expanded Uncertainty dB
1000	94.00	94.11	0.10
Sound Pressure Leve	el Stability - Short Term Flucti	uations	2 - 1
	uations was determined by mea: 0 measuring amplifier over a 20 found to be:		
At 1000 Hz	5	STF ≃ 0.002 dB	
Estimated expanded u	incertainty	0.005 dB	
Actual Output Freque	ency		
preamplifier connected	actual output frequency was mad to a B&K 2610 measuring amp	olifier. The AC output of the B&	K 2610 was taken to an univ
	output frequency at 1 KHz was:	veraged over 20 second of ope	eration as required by the
			eration as required by the
standard. The actual of	output frequency at 1 KHz was; Actual Frequen	cy = 1000.0 Hz	eration as required by the
standard. The actual of	output frequency at 1 KHz was; Actual Frequen incertainty	cy = 1000.0 Hz	
standard. The actual of At 1000 Hz Estimated expanded u Total Noise and Distr For the Total Noise and	output frequency at 1 KHz was; Actual Frequen incertainty	cy = 1000.0 Hz 0.1 Hz Cove	rage factor k = 2.2 K 2610 measuring amplifier v
standard. The actual of At 1000 Hz Estimated expanded u Total Noise and Distr For the Total Noise and	Actual Frequency at 1 KHz was; Actual Frequent incertainty ortion d Distortion measurement, the	cy = 1000.0 Hz 0.1 Hz Cove	rage factor k = 2.2 K 2610 measuring amplifier v
standard. The actual of At 1000 Hz Estimated expanded un Total Noise and Distr For the Total Noise and connected to an Agiller	Actual Frequency at 1 KHz was; Actual Frequent ancertainty ortion d Distortion measurement, the sent Type 8903 B distortion analys	cy = 1000.0 Hz 0.1 Hz Cove unfiltered AC output of the B&Rer. The TND result at 1 KHz w	rage factor k = 2.2 K 2610 measuring amplifier v
standard. The actual of At 1000 Hz Estimated expanded ut Total Noise and District For the Total Noise and connected to an Agillet At 1000 Hz Estimated expanded ut The expanded uncertainty in meas	Actual Frequency at 1 KHz was; Actual Frequent ancertainty ortion d Distortion measurement, the sent Type 8903 B distortion analys	cy = 1000.0 Hz 0.1 Hz Cover unfiltered AC output of the B&R er. The TND result at 1 KHz w TND = 0.5 % 0.7 % coordance with the ISO Public	rage factor k = 2.2 K 2610 measuring amplifier vas:
standard. The actual of At 1000 Hz Estimated expanded user Total Noise and District For the Total Noise and connected to an Agiller At 1000 Hz Estimated expanded user The expanded uncertainty in measurant factor of 2 is assumed Calibrated by:	Actual Frequency at 1 KHz was: Actual Frequency ancertainty ortion and Distortion measurement, the sent Type 8903 B distortion analyse ancertainty ainties have been calculated in a unless explicitly stated.	cy = 1000.0 Hz 0.1 Hz Cover unfiltered AC output of the B&R er. The TND result at 1 KHz w TND = 0.5 % 0.7 % coordance with the ISO Public	rage factor k = 2.2 K 2610 measuring amplifier values: cation "Guide to the expressive onfidence of 95%. A coverage


Hong Kong Accreditation Service (HKAS) has accredited this laboratory (Reg. No. 028 - CAL) under the Hong Kong Laboratory Accreditation Scheme (HCKLAS) for specific calibration activities as listed in the HCKLAS Directory of Accredited Laboratories. The results shown in this certificate were determined by this laboratory in accordance with its terms of accreditation. Such terms of accreditation stipulate that the results shall be traceable to the International System of Units (S.I.) or recognised measurement standards. This certificate shall not be reproduced except in full.

Appendix F Impact Monitoring Graphical Plots

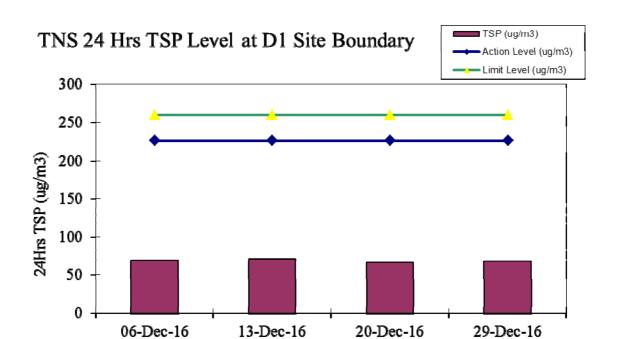


Noise Level at M1 Hai Phong Mansion


Date

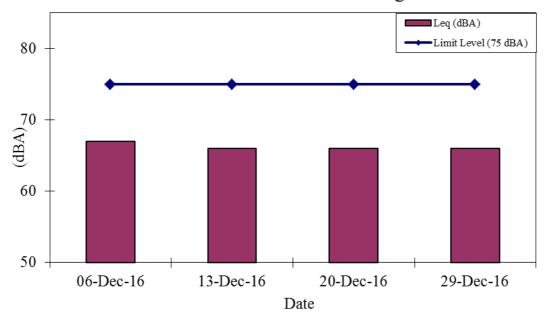

Noise Level at M2 Comfort Building

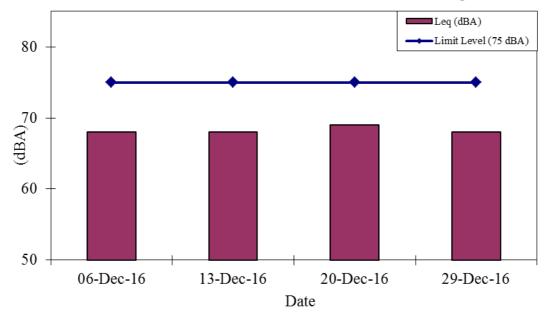

Noise Level at M3 Burlington Arcade

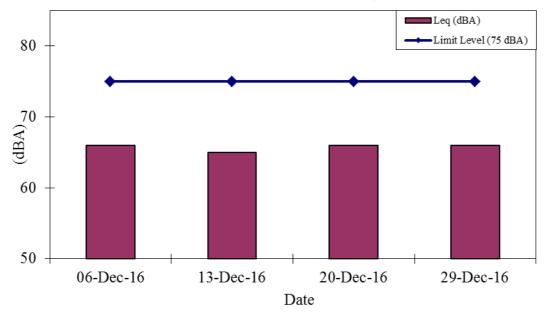

Appendix G Monitoring Schedule for the Present and Next Reporting Period

Monitoring Schedule for December 2016						
Dust	Noise					
D1	M1	M2	M3			
6 December 2016	6 December 2016	6 December 2016	6 December 2016			
13 December 2016	13 December 2016	13 December 2016	13 December 2016			
20 December 2016	20 December 2016	20 December 2016	20 December 2016			
29 December 2016	29 December 2016	29 December 2016	29 December 2016			

Monitoring Schedule for January 2017						
Dust	Noise					
D1	M1	M2	M3			
3 January 2017	4 January 2017	4 January 2017	4 January 2017			
10 January 2017	11 January 2017	11 January 2017	11 January 2017			
20 January 2017	20 January 2017	20 January 2017	20 January 2017			
26 January 2017	26 January 2017	26 January 2017	26 January 2017			

Remarks:

The schedule may be changed due to unforeseen circumstances (adverse weather, etc)