

**AUES PROJECT NO. TCS/00704/14** 

CONTRACT NO. MTRC6593-13C -WAN CHAI STATION LEE TUNG STREET SUBWAY

 $19^{\text{th}}$  Environmental Monitoring and Audit (EM&A) MONTHLY REPORT - MARCH 2016

PREPARED FOR KADEN CONSTRUCTION LIMITED

# **Quality Index**

Date	Reference No.	Prepared By	Approved By
13 April 2016	TCS00704/14/600/R0090v2	Aula	Jan.
		Nicola Hon	T.W. Tam
		<b>Environmental Consultant</b>	Environmental Team Leader

Prepared By

Version	Date	Description	
1	12 April 2016	First Submission	
2	13 April 2016	Amended against the IEC's comments on 12 April 2016	



**AECOM** 

+852 3922 9000 tel +852 2317 7609 fax

8/F, Grand Central Plaza, Tower 2, 138 Shatin Rural Committee Road. Shatin, Hong Kong 香港新界沙田鄉事會路 138 號新城

市中央廣場第2座8樓 www.aecom.com

Your Ref:

Our Ref:

40032976/450415

#### By Email and Post

MTR Corporation Limited Fo Tan Railway House No. 9, Lok King Street, Fo Tan Shatin, N.T., Hong Kong

Attn.: Mr. Kenneth Chow / Environmental Engineer II

13 April 2016

Dear Sirs

**Consultancy Agreement A130-13** Independent Environmental Checker for CRS and LTS LTS - Verification for 19th Monthly Environmental Monitoring and Audit (EM&A) Report (March 2016) (Report No.: TCS00704/14/600/R0090v2)

We refer to the 18th Monthly EM&A Report (March 2016) received under cover of the email from the Environmental Team, AUES, dated on 12 April 2016.

Further to our comments provided on 12 March 2016 and subsequent revision of the Report by AUES on 13 March 2016, we have no further comment and have verified the captioned report (Report No.: TCS00704/14/600/R0090v2).

Should you have any queries, please feel free to contact the undersigned at 3922 9529.

Yours faithfully

**AECOM Consulting Services Ltd** 

Y. W. Fung

Independent Environmental Checker

LLMC/wwsc

**AUES** 

cc Kaden Consturction Limited (Attn.: Mr. Ronald Fung) via email

(Attn.: Ms. Nicola Hon)

via email



#### **EXECUTIVE SUMMARY**

ES01 This is the 19<sup>th</sup> monthly EM&A Report presenting the monitoring results and inspection findings for the period from 1 to 31 March 2016 (hereinafter 'the Reporting Period').

#### SUMMARY OF ENVIRONMENTAL MONITORING AND AUDIT ACTIVITIES

ES02 The monitoring and audit activities during the Reporting Period are summarized in below:-

		<b>Reporting Period</b>	
Environmental Aspect	Environmental Monitoring Parameters / Inspection	Number of Monitoring Location Total Occasio	
Air Quality	24-hour TSP	1	6
Construction Noise	$L_{eq(30min)}$ Daytime	2	10
Site Inspection	Weekly inspection with ET, the Contractor and RE		5
Audit	Monthly joint inspection with ET, the Contractor, RE and IEC		1

## BREACH OF ACTION AND LIMIT (A/L) LEVELS

ES03 In the Reporting Period, no air quality and noise monitoring exceedances were registered. The statistics of environmental exceedance, NOE issued and investigation of exceedance are summarized in the following table.

Envisonmental	Manitaring	Action	I imit		Event & Action		
Environmental Aspect	Monitoring Parameters		Limit Level	NI DH.	Investigation	Corrective Actions	
Air Quality	24-hour TSP	0	0	0	0	0	
Construction Noise	L <sub>eq(30min)</sub> Daytime	0	0	0	0	0	

## **ENVIRONMENTAL COMPLAINT**

ES04 No public complaint was received in the Reporting Period.

## NOTIFICATION OF SUMMONS AND SUCCESSFUL PROSECUTIONS

ES05 No environmental summons or successful prosecutions were recorded in the Reporting Period.

#### REPORTING CHANGE

ES06 No reporting changes were made in the Reporting Period.

#### **SITE INSPECTION**

ES07 In the Reporting Period, weekly site inspection by the MTRC, ET and Contractor was carried out on 2, 11, 16, 23 and 30 March 2016 and the IEC was joined the site inspection on 16 March 2016. No non-compliance but four (4) observations and three (3) reminders were recorded during the site inspection.

# **FUTURE KEY ISSUES**

- ES08 Construction noise is the key environmental issue during construction work of the Project as there are residential buildings nearby. Noise mitigation measures should be fully implemented in accordance with the EM&A requirement.
- ES09 Special attention should be paid on the potential construction dust impact as the construction site is located near the residential area. The Contractor should fully implement the construction dust mitigation measures properly.

# Contract No. MTRC6593-13C – Wan Chai Station Lee Tung Street Subway 19<sup>th</sup> Environmental Monitoring and Audit Monthly Report – March 2016



ES010 The Contractor should prevent muddy water and other water pollutants via site surface water runoff get into public areas and implement water quality mitigation measures properly. Any discharge water should be strictly complied with wastewater discharge license requirement.



# **TABLE OF CONTENTS**

1	PROJECT BACKGROUND REPORT STRUCTURE	1 1 1
2	PROJECT ORGANIZATION AND SUBMISSION PROJECT ORGANIZATION SUMMARY OF ENVIRONMENTAL SUBMISSIONS	<b>2</b> 2 3
3	ENVIRONMENTAL IMPACT MONITORING REQUIREMENT  MONITORING PARAMETERS  MONITORING LOCATIONS  MONITORING FREQUENCY AND PERIOD  MONITORING EQUIPMENT  MONITORING METHODOLOGY  DERIVATION OF ACTION/LIMIT (A/L) LEVELS  DATA MANAGEMENT AND DATA QA/QC CONTROL	5 5 5 6 7 8 8
4	MONITORING RESULTS 24-HOUR TSP AIR QUALITY MONITORING RESULTS NOISE MONITORING RESULTS	<b>9</b> 9 9
5	WASTE MANAGEMENT GENERAL WASTE MANAGEMENT RECORDS OF WASTE QUANTITIES	10 10 10
6	SITE INSPECTION FINDINGS / DEFICIENCIES DURING THE REPORTING MONTH	<b>11</b> 11
7	ENVIRONMENTAL COMPLAINT AND NON-COMPLIANCE ENVIRONMENTAL COMPLAINT, SUMMONS AND PROSECUTION	<b>12</b> 12
8	IMPLEMENTATION STATUS OF MITIGATION MEASURES GENERAL REQUIREMENTS KEY ISSUES FOR THE COMING MONTH	13 13 14
9	CONCLUSIONS AND RECOMMENDATIONS CONCLUSION RECOMMENDATIONS	15 15 15
LIST OF	<u>FTABLES</u>	
TABLE 2-	SUBMISSION/SET-UP STATUS OF THE EP REQUIREMENTS	
TABLE 2-		
TABLE 3-		
TABLE 4-	SUMMARY OF 24-HOUR TSP MONITORING RESULTS – A1	
TABLE 4-	Noise Monitoring Results of N1 (2/F floor of Hennessey Building), (dB(A))	
TABLE 4-		
TABLE 4-		
TABLE 5-		
TABLE 5-	2 SUMMARY OF QUANTITIES OF NON-INERT C&D WASTES	

# Contract No. MTRC6593-13C – Wan Chai Station Lee Tung Street Subway 19<sup>th</sup> Environmental Monitoring and Audit Monthly Report – March 2016



TABLE 6-1	SITE OBSERVATIONS
TABLE 7-1	STATISTICAL SUMMARY OF ENVIRONMENTAL COMPLAINTS
TABLE 7-2	STATISTICAL SUMMARY OF ENVIRONMENTAL SUMMONS
TABLE 7-3	STATISTICAL SUMMARY OF ENVIRONMENTAL PROSECUTION
TABLE 8-1	ENVIRONMENTAL MITIGATION MEASURES

# LIST OF APPENDICES

LIST OF APP	ENDICES
APPENDIX A	PROJECT SITE LAYOUT PLAN
APPENDIX B	ORGANIZATION OF THE PROJECT AND MASTER CONSTRUCTION PROGRAMME
APPENDIX C	MONITORING LOCATIONS
APPENDIX D	CALIBRATION CERTIFICATE OF MONITORING EQUIPMENT
APPENDIX E	HOKLAS-ACCREDITATION CERTIFICATE OF THE TESTING LABORATORY
APPENDIX F	EVENT AND ACTION PLAN
APPENDIX G	MONITORING SCHEDULE
APPENDIX H	DATABASE OF MONITORING RESULTS
APPENDIX I	GRAPHICAL PLOTS
APPENDIX J	METEOROLOGICAL INFORMATION
APPENDIX K	MONTHLY SUMMARY WASTE FLOW TABLE
A DDENIDIV I	IMDI EMENITATION SCHEDI II E EOD ENVIDONMENTAL MITIGATION MEASUDES (ISEMM)



#### 1 INTRODUCTION

#### PROJECT BACKGROUND

- 1.01 **KADEN CONSTRUCTION LIMITED** (hereinafter 'KCL') has been awarded by the MTR Corporation Limited (MTRCL) the Contract No. *MTRC6593-13C Wan Chai Station Lee Tung Street Subway* (hereinafter "the Project'), which is a Designated Project to be implemented under Environmental Permit EP-444/2012 (hereinafter referred as "the EP-444/2012" or "the EP").
- 1.02 The Project includes redevelopment of the Lee Tung Street area to improve pedestrian networking by enhancing the accessibility, connectivity and circulation of human traffic north-south from Queen's Road East area to Wan Chai MTR Station, and providing a safe and attractive means for pedestrian crossing of Johnston Road. The Project site layout plan is shown in *Appendix A* and works under the Project comprise of:
  - (i) Construction of a pedestrian subway link between Urban Renewal Authority's Redevelopment at Site H15 (the Development) and Wan Chai Station (WAC);
  - (ii) Construction of two ventilation shafts; and
  - (iii) Modification works of some of the station concourse.
- 1.03 The Project is expected to be undertaken for 36 months. In order to effectively implement the environmental protection measures as stipulated in the Particular Specification (PS), an Environmental Monitoring and Audit Plan (EMAP) which enclosed in the Project Profile (PP) was prepared to guide the setup of the environmental monitoring and audit (EM&A) programme of the Project.
- 1.04 Action-United Environmental Services and Consulting (AUES) has been commissioned by the KCL as the independent environmental team (ET) to implement the relevant EM&A programme for the Project.
- 1.05 The baseline monitoring program was carried out between 3 June 2014 and 19 June 2014 at the proposed monitoring locations by the ET according to the approved EMAP. The "Baseline Monitoring Report (R0010 Version 4)" has been verified by IEC submitted to the EPD on 15 July 2014 before commencement of major construction works. The construction of the Project was commenced on 28 August 2014 as notified by KCL. Accordingly, relevant EM&A programme was started on 28 August 2014.
- 1.06 This is 19<sup>th</sup> monthly EM&A report presenting the monitoring results and inspection findings in the Reporting Period from 1 to 31 March 2016.

#### REPORT STRUCTURE

- 1.07 This Report is structured into the following sections:-
  - Section 1 Introduction
  - Section 2 Project Organization
  - Section 3 Environmental Impact Monitoring Requirement
  - **Section 4** Monitoring Results
  - Section 5 Waste Management
  - **Section 6** Site Inspections
  - Section 7 Environmental Complaint and Non-Compliance
  - **Section 8** Implementation Status of Mitigation Measures
  - Section 9 Conclusions and Recommendations



#### 2 PROJECT ORGANIZATION AND SUBMISSION

#### **PROJECT ORGANIZATION**

2.01 The project organization is shown in *Appendix B*. The responsibilities of respective parties are:

#### MTR Corporation Limited (MTRCL)

2.02 MTRCL is the Project Proponent and the Permit Holder of the EP of the development of the Project and will assume overall responsibility for the project. Also, an Independent Environmental Checker (IEC) should be employed by MTRCL to audit the results of the EM&A work conducted by Environmental Team.

# Environmental Protection Department (EPD)

2.03 EPD is the statutory enforcement body for environmental protection matters in Hong Kong.

# Resident Engineer (RE)

- 2.04 The RE is responsible for overseeing the construction works and for ensuring that the works are undertaken by the Contractor in accordance with the specification and contract requirements. The duties and responsibilities of the ER with respect to EM&A are:
  - Monitor the Contractor's compliance with Contract Specifications, including the effective implementation and operation of the environmental mitigation measures;
  - Inform the Contractor when action is required to reduce impacts in accordance with the Event and Action Plans:
  - Participate in site inspections undertaken by the ET; and
  - Co-operate with the ET in providing all the necessary information and assistance for completion of the complaint investigation works.

# Independent Environmental Checker (IEC)

- 2.05 The IEC should advise the ET and RE on environmental issues related to the project. The IEC should audit from an independent viewpoint on the environmental performance during the construction of the project. The IEC should be a person who has relevant professional qualifications in environmental control and at least 7 years' experience in EM&A and environmental management. The duties and responsibilities of the IEC are:
  - Review and audit in an independent, objective and professional manner in all aspects of the EM&A programme;
  - Validate and confirm the accuracy of monitoring results, appropriateness of monitoring equipment, monitoring locations with reference to the locations of the nearby sensitive receivers, and monitoring procedures;
  - Carry out random sample check and audit on monitoring data and sampling procedures, etc;
  - Conduct random site inspection;
  - Review the effectiveness of environmental mitigation measures and project environmental performance;
  - On an as-need basis, verify and certify the environmental acceptability of the construction methodology (both temporary and permanent works), relevant design plans and submissions under the environmental permit. Where necessary, the IEC should agree in consultation with the ET and the Contractor least impact alternative;
  - Check complaint cases and the effectiveness of corrective measures;
  - Verify EM&A report certified by the ET Leader; and
  - Feedback audit results to RE/ET according to the Event/Action Plan.

# Environmental Team (ET)

- 2.06 The ET should conduct the EM&A programme and ensure the Contractor's compliance with the project's environmental performance requirements during construction. The ET should plan, organize and manage the implementation of the EM&A programme and ensure that the EM&A works are undertaken to the required standard.
- 2.07 The ET should be led and managed by the ET Leader. The ET Leader should have relevant



professional qualifications in environmental control and possess at least 7 years' experience in EM&A. The ET Leader should be responsible for the implementation of the EM&A programmes in accordance with the EM&A requirements. The duties and responsibilities of the ET include:

- Sampling, analysis and statistical evaluation of monitoring parameters;
- Environmental site surveillance;
- Inspection and audit of compliance with environmental protection, and pollution prevention and control regulations;
- Assess the effectiveness of the environmental mitigation measures implemented;
- Monitor compliance with the environmental protection clauses/specifications in the Contract;
- Review construction programme and comment as necessary;
- Review work methodologies which may affect the extent of environmental impact during the construction phase and comment as necessary;
- Complaint investigation, evaluation and identification of corrective measures;
- Liaison with the IEC on all environmental performance matters, and timely submission of all relevant EM&A proforma for IEC's approval; and
- Advice to Contractor on environmental improvement, awareness and enhancement matters etc.

#### The Contractor

- 2.08 The Contractor should report to the RE. The duties and responsibilities of the Contractor are:
  - Comply with the relevant contract conditions and specifications on environmental protection
  - Participate in the site inspections undertaken by the ET;
  - Provide assistance to ET to carry out monitoring;
  - Provide requested information to the ET in the event of any exceedance in the environmental criteria (Action/Limit levels);
  - Submit proposals on mitigation measures in case of exceedances of Action and Limit levels in accordance with the Event / Action Plans; and
  - Cooperate with the ET in providing all the necessary information and assistance for completion of the complaint investigation works. If mitigation measures are required following the investigation, the Contractor should promptly carry out these measures.

#### SUMMARY OF ENVIRONMENTAL SUBMISSIONS

2.09 In accordance with the EP stipulation, the required documents and submission status to EPD are listed in Table 2-1.

Table 2-1 Submission/Set-up Status of the EP Requirements

<b>EP Condition</b>	Submission	Status
2.3	Management Organization of Main Construction Companies	Submitted
2.7	Landscape Plan	Submitted
3.3	Baseline Monitoring Report (TCS00704/14/600/R0010v4)	Submitted
4.2	Internet website	live

2.10 Summary of environmental permits, licenses, and relevant notifications on environmental protection for the Project are presented in *Table 2-2*.

Table 2-2 Status of Environmental Licenses and Permits of the Project

Item	Description	License/Permit Status	
1	Air Pollution Control (Construction Dust) Regulation	Notified EPD.	
2	Chemical Waste Producer Registration - Waste		
	Producers Number	Approved on 14/05/2014	
3	Water Pollution Control Ordinance - Discharge	License no.: WT00019539-2014	
	License	Approved on 16/07/2014	
	License	Valid to: 31/07/2019	
	Waste Disposal Regulation - Billing Account	Account no.: 7019837	
	for Disposal of Construction Waste	Approved on 30/04/2014	



Item	Description	License/Permit Status
5	Construction Noise Permit under Noise Control	GW-RS0923-15 obtained on 11 Sep
	Ordinance	2015
		Valid from 11 Sep 2015 to 10 March
		2016
		GW-RS0970-15 obtained on 14 Sep
		2015
		Valid from 14 Sep 2015 to 12 March
		2016
		GW-RS0164-16 obtained on 11 Mar
		2016
		Valid from 11 Mar 2016 to 10 Sep
		2016
		GW-RS0165-16 obtained on 14 Mar
		2016
		Valid from 14 Mar 2016 to 13 Sep
		2016

#### **CONSTRUCTION PROGRESS**

- 2.11 The construction activities conducted in the Reporting Period are listed in below. Moreover, the master construction program is shown in *Appendix B*.
  - Construction of mini piles and excavation for primary RC beam of tram deck at Eastbound
  - Sheet piling and grouting at Westbound footpath
  - Side wall concreting for North Basketball Court
  - Block Walls for AFC Audit Room



## 3 ENVIRONMENTAL IMPACT MONITORING REQUIREMENT

3.01 The ET will implement the EM&A programme in accordance with the requirements in EMAP. Details of the EM&A programme are presented in the following sub-sections.

#### MONITORING PARAMETERS

- 3.02 The EM&A impact monitoring program covers the following environmental aspects:
  - Air quality; and
  - Construction noise
- 3.03 A summary of the monitoring parameters is presented in *Table 3-1*:

Table 3-1 Summary of the monitoring parameters of EM&A Requirements

Environmental Issue	Parameters			
Air Quality	<ul> <li>24-hour Total Suspended Particulate (hereinafter '24-hour TSP')</li> <li>1-hour TSP monitoring (*)</li> </ul>			
Construction Noise	• A-weighted equivalent continuous sound pressure level (30min) (hereinafter 'L <sub>eq(30min)</sub> ' during the normal working hours			

#### Remarks:

#### MONITORING LOCATIONS

3.04 According to Sections 2.3 and 3.4 of the EMAP which enclosed in the Project Profile (Register No. PP-472/2012), construction noise and air quality monitoring locations are required to be set up at Hennessy Building and Chiu Hin Mansion. In early May 2014, site visit was conducted to select suitable locations to carry out relevant noise and air monitoring for the EM&A Programme. It was noted that both Hennessy Building and Chiu Hin Mansion are residential buildings and only the 1/F to 2/F of the buildings could be accessed which are commercial premises. It is not possible to set up the monitoring station at upper floors inside the residential apartment which will cause nuisance to the residents. Finally, two locations at lower floor were selected which access were successfully granted by the premises occupiers. The monitoring stations proposed for the Project are summarized in *Table 3-2* and illustrated in *Appendix C*.

**Table 3-2** Air and Noise Monitoring Locations

Aspect	Monitoring Location	Location ID	Address	Description
Air Quality	Chiu Hin Mansion	A1	balcony at 1/F of Chiu Hin Mansion	ASR close to the Project site
Construction	Hennessey Building	N1	2/F floor of Hennessey Building	NSR facing to the Project site
Noise	Chiu Hin Mansion	N2	balcony at 1/F of Chiu Hin Mansion	NSR facing to the Project site

#### MONITORING FREQUENCY AND PERIOD

3.05 The requirements of impact monitoring as stipulated in the EMAP are presented in following.

#### Air Quality

- 3.06 Frequency of impact air quality monitoring:
  - 24-hour TSP Once every 6 days during course of works.
- 3.07 In case of non-compliance with the air quality criteria, a more frequent monitoring exercise adopting 1-hour TSP monitoring undertaken when the highest dust impact occurs, as specified in the Event and Action Plan, should be conducted within 24 hours after the result is obtained. This additional monitoring should be continued until excessive dust emission or the deterioration in air quality is rectified.

<sup>(\*)</sup> In case 24-hour TSP exceed the air quality criteria to be carried out



#### **Construction Noise**

3.08 One set of  $L_{eq(30min)}$  as 6 consecutive  $L_{eq(5min)}$  between 0700-1900 hours on normal weekdays and once every week during course of works. If construction work necessary to carry out at other time periods, i.e. restricted time period (19:00 to 07:00 the next morning and whole day on public holidays) (hereinafter referred as "the restricted hours"), 3 consecutive  $L_{eq(5min)}$  measurement will be depended on CNP requirements to undertake. Supplementary information for data auditing, statistical results such as  $L_{10}$  and  $L_{90}$  shall also be obtained for reference.

#### MONITORING EQUIPMENT

#### Air Quality Monitoring

- 3.09 The 24-hour TSP shall be measured by following the standard high volume sampling method as set out in the *Title 40 of the Code of Federal Regulations, Chapter 1 (Part 50), Appendix B (USEPA)*. A direct reading dust meter is used to measure 1-hour TSP air quality, in case of non-compliance of air quality criteria occurred in 24-hour TSP measurement.
- 3.10 The filter paper sample collected in 24-hour TSP measurement shall be determined by HOKLAS accredited laboratory. All equipments to be used for air quality monitoring are listed in *Table 3-3*.

**Table 3-3 Air Quality Monitoring Equipment** 

Equipment	Model
24-hour TSP	
High Volume Air Sampler	TISCH High Volume Air Sampler, HVS Model TE-5170
Calibration Kit	TISCH Model TE-5025A
1- hour TSP	
	TSI Model 8520 DustTrak Aerosol Monitor / Aerocet 531
Portable Dust Meter	Handheld Particle Mass Profiler & Counter / Sibata LD-3A
	Laser Dust Monitor

- 3.11 According to the EMAP, wind data monitoring equipment shall be provided and set up for logging wind speed and wind direction near the dust monitoring locations. The equipment installation location shall be proposed by the ET and agreed with the IEC. For installation and operation of wind data monitoring equipment, the following points shall be observed:
  - 1) The wind sensors should be installed 10 m above ground so that they are clear of obstructions or turbulence caused by buildings.
  - 2) The wind data should be captured by a data logger. The data shall be downloaded for analysis at least once a month.
  - 3) The wind data monitoring equipment should be re-calibrated at least once every six months.
  - 4) Wind direction should be divided into 16 sectors of 22.5 degrees each.
- 3.12 Although ET was successful granted HVS installation premises, the owners rejected to install wind data monitoring equipment.
- 3.13 In this situation, the ET proposed to adopt the meteorological information from King's Park Weather Station from the Hong Kong Observatory as the representative wind data. King's Park Station provided all useful from information such as humidity, rainfall, and air pressure and temperature etc.
- 3.14 Although there are other closer weather stations, King's Park Station was selected as it is the nearest weather station that measures all the relevant parameters mentioned above. Moreover, the ET has compared the data among the stations, and concluded that there is minimal difference between meteorological data collected at the King's Park station and other stations.

# **Construction Noise Monitoring**

3.15 Sound level meter in compliance with the International Electrotechnical Commission Publications 651: 1979 (Type 1) and 804: 1985 (Type 1) specifications shall be used for carrying out the noise monitoring. The sound level meter shall be checked using an acoustic calibrator. The wind



speed shall be checked with a portable wind speed meter capable of measuring the wind speed in ms<sup>-1</sup>. Furthermore, an acoustic calibrator and sound level meter shall be calibrated yearly.

3.16 Noise monitoring equipment to be used for monitoring is listed in *Table 3-4*.

**Table 3-4** Construction Noise Monitoring Equipment

Equipment	Model
Integrating Sound Level Meter	B&K Type 2238
Calibrator	Rion NC-73 / B&K Type 4231/ Cesva CB-5
Portable Wind Speed Indicator	Testo Anemometer

#### MONITORING METHODOLOGY

#### 24-hour TSP

- 3.17 The equipment used for 24-hour TSP measurement is a Tisch Environmental, Inc. Model TE-5170 TSP high volume air sampling system, which complied with USEPA Code of Federal Regulation, Appendix B to Part 50. The High Volume Air Sampler (HVS) consists of the following:
  - a. An anodized aluminum shelter;
  - b. A 8"x10" stainless steel filter holder;
  - c. A blower motor assembly;
  - d. A continuous flow/pressure recorder;
  - e. A motor speed-voltage control/elapsed time indicator;
  - f. A 7-day mechanical timer, and
  - g. A power supply of 220v/50 hz
- 3.18 The HVS is calibrated in accordance with the manufacturer's instruction using the NIST-certified standard calibrator (Tisch Calibration Kit Model TE-5028A). The 24-hour TSP monitoring using the HVS is also processed in accordance with the manufacturer's Operations Manual. The valid calibration certificate of the calibration kit with the certificate of HVS calibrated is shown in *Appendix D*.
- 3.19 24-hour TSP is collected on filters of the HVS and quantified by a local HOKLAS accredited laboratory, ALS Technichem (HK) Pty Ltd (ALS), upon receipt of the samples. The ET will keep all the sampled 24-hour TSP filters in normal air conditioned room conditions, i.e. 70% HR (Relative Humidity) and 25°C, for six months prior to disposal. HOKLAS-accreditation certificate of ALS Technichem (HK) Pty Ltd (ALS) is provided in *Appendix E*.

#### Noise

- 3.20 Sound level meter complied with the International Electrotechnical Commission Publications 651: 1979 (Type 1) and 804: 1985 (Type 1) specifications, as recommended in Technical Memorandum (TM) issued under the Noise Control Ordinance (NCO). The valid of calibration certificates including sound level meter and an acoustic were shown in *Appendix D*.
- 3.21 The noise measurement is performed with the meter set to FAST response and on the A-weighted equivalent continuous sound pressure level  $(L_{eq})$ .  $L_{eq(30min)}$  in six consecutive  $L_{eq(5min)}$  measurements were used as the monitoring parameter.
- 3.22 During monitoring, the sound level meter mounted at the monitoring locations and oriented such that the microphone pointed to the site with the microphone facing perpendicular to the line of sight. The windshield was fitted for the measurement. For the monitoring, N1 and N2 are conducted 1 m from the exterior of the building façade.
- 3.23 Prior construction noise measurement, the accuracy of the sound level meter checked using an acoustic calibrator generating a known sound pressure level at a known frequency. The calibration level from before and after the noise measurement agrees to within 1.0dB.



# **DERIVATION OF ACTION/LIMIT (A/L) LEVELS**

3.24 The baseline results form the basis for determining the environmental acceptance criteria for the impact monitoring. According to EMAP, the air quality and construction noise criteria were set up, namely Action and Limit levels are listed in *Tables 3-5* and *3-6*.

Table 3-5 Action and Limit Levels for Air Quality Monitoring

Monitoring Station	Action Lev	vel (μg /m³)	Limit Level (µg/m³)		
Monitoring Station	1-hour TSP	24-hour TSP	1-hour TSP	24-hour TSP	
A1	290	162	500	260	

**Table 3-6** Action and Limit Levels for Construction Noise

Manitaring Station	0700-1900 hours on normal weekdays				
Monitoring Station	Action Level	Limit Level			
N1 and N2	When one documented complaint is received	75 dB(A)			

Note: If works are to be carried out during restricted hours, the conditions stipulated in the construction noise permit issued by the NCA have to be followed.

3.25 Should non-compliance of the environmental quality criteria occurs, remedial actions will be triggered according to the Event and Action Plan which presented in *Appendix F*.

# DATA MANAGEMENT AND DATA QA/QC CONTROL

- 3.26 The all monitoring data were handled by the ET's in-house data recording and management system.
- 3.27 The monitoring data recorded in the equipment were downloaded directly from the equipment at the end of each monitoring day. The downloaded monitoring data were input into a computerized database properly maintained by the ET. The laboratory results were input directly into the computerized database and checked by personnel other than those who input the data.
- 3.28 For monitoring parameters that require laboratory analysis, the local laboratory shall follow the QA/QC requirements as set out under the HOKLAS scheme for the relevant laboratory tests.



#### 4 MONITORING RESULTS

4.01 The impact air quality and construction noise monitoring schedule is presented in *Appendix G* and the monitoring results are summarized in the following sub-sections.

### 24-HOUR TSP AIR QUALITY MONITORING RESULTS

4.02 In the Reporting Period, 6 occasions of 24-hours TSP monitoring were carried out at the proposed location A1 and the monitoring results are summarized in *Table 4-1*. The detailed 24-hour TSP monitoring data are presented in *Appendix H* and the relevant graphical plots are shown in *Appendix I*.

Table 4-1 Summary of 24-hour TSP Monitoring Results – A1

Date	24-hour TSP (μg/m³)	Action Level	Limit Level
1-Mar-16	77		
7-Mar-16	103		
12-Mar-16	76		
18-Mar-16	100	162	260
24-Mar-16	162		
30- Mar-16	51		
Average (Range)	95 (51 – 162)		

4.03 As shown in *Table 4-1*, 24-hour TSP monitoring results are fluctuated below Action/ Limit Levels.

#### NOISE MONITORING RESULTS

4.04 In the Reporting Period, **10** occasions noise measurement were conducted at N1 and N2. The sound level meter was set in 1m from the exterior of the building façade at N1 and N2. Therefore, no façade correction (+3dB(A)) is added according to acoustical principles and EPD guidelines. The noise measurement results at N1 and N2 are listed in *Tables 4-2* and *4-3*. The relevant graphical plots are shown in *Appendix I*.

Table 4-2 Noise Monitoring Results of N1 (2/F floor of Hennessey Building), dB(A)

				•				
Date	Start Time	1st Leq5	2nd Leq5	3rd Leq5	4th Leq5	5th Leq5	6th Leq5	$ m L_{eq30min}$
1-Mar-16	11:29	72.0	73.6	73.8	74.9	73.5	72.4	73
8-Mar-16	14:15	72.0	72.6	72.1	73.0	71.5	71.6	72
15-Mar-16	9:51	63.8	65.7	66.1	65.5	66.2	66.5	66
22-Mar-16	16:19	73.0	69.4	70.0	68.9	68.5	70.4	70
30-Mar-16	14:41	73.1	73.6	73.8	74.9	74.1	73.9	74
Limit L Construct		75 dB(A)						

Table 4-3 Noise Monitoring Results of N2 (balcony at 1/F of Chiu Hin Mansion), dB(A)

Date	Start Time	1st Leq5	2nd Leq5	3rd Leq5	4th Leq5	5th Leq5	6th Leq5	$ m L_{eq30min}$
1-Mar-16	10:52	67.1	67.5	67.2	67.4	64.6	66.6	67
8-Mar-16	14:49	71.7	71.7	70.9	73.6	71.8	71.1	72
15-Mar-16	16:00	73.6	72.6	73.2	73.7	74.3	72.3	73
22-Mar-16	15:28	72.9	73.8	72.1	73.8	72.9	72.0	73
30-Mar-16	13:39	68.6	70.6	72.2	68.0	67.6	67.3	69
Limit L Construct		75 dB(A)						

4.05 As shown in Tables 4-2 and 4-3, no noise measurement exceedance was recorded at both N1 and N2. Furthermore, there is no noise complaint (Action Level exceedance) received by the MTRCL and Contractor or EPD in the Reporting Period. The meteorological data during the impact monitoring days are shown in *Appendix J*.



#### 5 WASTE MANAGEMENT

#### GENERAL WASTE MANAGEMENT

5.01 Waste management was carried out by an on-site Environmental Officer or an Environmental Supervisor from time to time.

#### **RECORDS OF WASTE QUANTITIES**

- 5.02 All types of waste arising from the construction work are classified into the following:
  - Construction & Demolition (C&D) Material;
  - Chemical Waste;
  - General Refuse; and
  - Excavated Soil.
- 5.03 The quantities of waste for disposal in this Reporting Period are summarized in *Tables 5-1* and *5-2* and the Monthly Summary Waste Flow Table is shown in *Appendix K*.

Table 5-1 Summary of Quantities of Inert C&D Materials

Type of Waste	Quantity	<b>Disposal Location</b>
Total C&D Materials (Inert) (m <sup>3</sup> )	0.03685	-
Reused in this Contract (Inert) (m <sup>3</sup> )	0	-
Reused in other Projects (Inert) (m <sup>3</sup> )	0	1
Disposal as Public Fill (Inert) (m <sup>3</sup> )	0.03685	TKO 137

Table 5-2 Summary of Quantities of Non-Inert C&D Wastes

Type of Waste	Quantity	Disposal Location
Recycled Metal (m <sup>3</sup> )	0	-
Recycled Paper / Cardboard Packing (m <sup>3</sup> )	0	-
Recycled Plastic (m <sup>3</sup> )	0	-
Chemical Wastes (m <sup>3</sup> /L)	0	-
General Refuses (m <sup>3</sup> )	0.001	SENT Landfill

- 5.04 In the Reporting Period, effluent generated from the Project was discharged in accordance with the Wastewater Discharge License.
- 5.05 Moreover, it is reminded that C&D materials would be reused on-site as far as practicable.



#### **6** SITE INSPECTION

6.01 According to the EMAP, the environmental site inspection shall be formulation by ET Leader. Weekly environmental site inspections should carry out to confirm the environmental performance.

#### FINDINGS / DEFICIENCIES DURING THE REPORTING MONTH

- 6.02 During the Reporting Period, Five (5) occasions of weekly site inspections to evaluate site environmental performance was carried out by the RE, ET and the Contractor on 2, 11, 16, 23 and 30 March 2016 and the IEC was joined the site inspection on 16 March 2016.
- 6.03 No non-compliance was noted. However, four (4) observations and three (3) reminders were recorded by the ET. The findings / deficiencies observed during the weekly site inspections are listed in *Table 6-1*.

Table 6-1 Site Observations

Date	Findings / Deficiencies	Follow-Up Status
2 March 2016	No adverse environmental issue was observed.	• NA
11 March 2016	• The contractor was advised to improve the roadside shelter for grout mixing to avoid dust impact to the public.	The grout mixer was removed from site.
	• Free standing chemical without drip tray was observed. The Contractor should provide drip tray for chemical on site to prevent land contamination.	All free standing chemical cans without drip tray were removed from site.
16 March 2016	• The contractor was advised to carry out maintenance work for the AquaSed to ensure the chemical process can be function properly.	To be followed up.
23 March 2016	The contractor was advised to keep the construction material clean at the public road outside the site boundary.	The construction materials at the public road outside the site boundary was removed.
	• The contractor was reminded to dispose the general refuse regularly.	Not required for reminder.
30 March 2016	The contractor was reminded to cover the roadside hoarding entirely.	Not required for reminder.
	The contractor was reminded to dispose general refuse regularly.	Not required for reminder.

6.04 No site inspection was undertaken by external parties i.e. EPD in this Reporting Month.



# 7 ENVIRONMENTAL COMPLAINT AND NON-COMPLIANCE

# **ENVIRONMENTAL COMPLAINT, SUMMONS AND PROSECUTION**

7.01 For the Project, no environmental complaint, summons and prosecution was received in the Reporting Period. The statistical summary table of environmental complaint is presented in *Tables 7-1*, 7-2 and 7-3.

**Table 7-1** Statistical Summary of Environmental Complaints

	Environmental Complaint Statistics						
Reporting Period	Engage Completing		Complaint Nature				
	Frequency Cumul	Cumulative	Air	Noise	Water	Others	
28 Aug 2014 – 29 Feb 2016	0	0	NA	NA	NA	NA	
1–31 Mar 2016	0	0	NA	NA	NA	NA	

Table 7-2 Statistical Summary of Environmental Summons

Donouting Dowlad	Environmental Summons Statistics						
Reporting Period	Frequency	Cumulative	Air	Noise	Water	Others	
28 Aug 2014 – 29 Feb 2016	0	0	NA	NA	NA	NA	
1–31 Mar 2016	0	0	NA	NA	NA	NA	

Table 7-3 Statistical Summary of Environmental Prosecution

Donouting Dowind		<b>Environmental Prosecution Statistics</b>														
Reporting Period	Frequency	Cumulative	Air	Noise	Water	Others										
28 Aug 2014 – 29 Feb 2016	0	0	NA	NA	NA	NA										
1–31 Mar 2016	0	0	NA	NA	NA	NA										



#### 8 IMPLEMENTATION STATUS OF MITIGATION MEASURES

# GENERAL REQUIREMENTS

- 8.01 The environmental mitigation measures that recommended in the Implementation Schedule for Environmental Mitigation Measures (ISEMM) in the EMAP covered the issues of dust, noise, water and waste and they are summarized presented in *Appendix L*.
- 8.02 The Works under the Project shall be implementing the required environmental mitigation measures according to the EMAP as subject to the site condition. Environmental mitigation measures generally to be implemented by the Contractor is listed in *Table 8-1*.

**Table 8-1 Environmental Mitigation Measures** 

Issues	Environmental Mitigation Measures
Air Quality	• Regular watering to reduce dust emissions from all exposed site surface, particularly during dry weather;
	• Frequent watering for particularly dusty construction areas and areas close to air sensitive receivers;
	• Cover all excavated or stockpile of dusty material by impervious sheeting or sprayed with water to maintain the entire surface wet;
	• Public areas around the site entrance/exit had been kept clean and free from dust; and
	<ul> <li>Tarpaulin covering of any dusty materials on a vehicle leaving the site.</li> </ul>
Noise	<ul> <li>Good site practices to limit noise emissions at the sources;</li> </ul>
	• Use of quiet plant and working methods;
	• Use of site hoarding or other mass materials as noise barrier to screen the working site;
	• Use of shrouds/temporary noise barriers to screen noise from relatively static PMEs; and
	• Limiting as use one construction plant within worksite, where practicable.
Water	Wastewater were appropriately treated by treatment facilities;
Quality	• Drainage channels were provided to convey run-off into the treatment facilities; and
	Drainage systems were regularly and adequately maintained.
Waste and Chemical Management	• Excavated material should be reused on site as far as possible to minimize off-site disposal. Scrap metals or abandoned equipment should be recycled if possible;
	• Waste arising should be kept to a minimum and be handled, transported and disposed of in a suitable manner;
	• The Contractor should adopt a trip ticket system for the disposal of C&D materials to any designed public filling facility and/or landfill; and
	• Chemical waste should be handled in accordance with the Code of Practice on the Packaging, Handling and Storage of Chemical Wastes.
Landscape and Visual	• Clear demarcation of works area to prevent damages to existing trees in close proximity;
	<ul> <li>Protection of all trees planned to be retained onsite;</li> </ul>
	<ul> <li>Preserving all affected trees by transplanting where practical. Tree transplanting application and tree removal application shall be submitted for approval in accordance with ETWB TCW 3/2006; and</li> </ul>
	• Screening of construction works by hoardings/noise barriers around Works area in visually unobtrusive colors.
General	The site was generally kept tidy and clean.

# TENTATIVE CONSTRUCTION ACTIVITIES IN THE COMING MONTH

8.03 Construction activities as undertaken in the coming month for the Project lists below:



- Temporary traffic deck of stage 2 ELS on Johnston Road Eastbound Fast Lane
- Primary RC beam of Temp. Tram Deck
- Mini piling on Johnston Road Westbound Slow Lane
- Bulk excavation of stage 2
- RC structure work at stage 3
- AFC audit room construction
- BS installation at WAC station plantroom and concourse

#### **KEY ISSUES FOR THE COMING MONTH**

- 8.04 Key issues to be considered in the coming month of the Project include:
  - Implementation of dust suppression measures at all times;
  - Potential wastewater quality impact due to surface runoff;
  - Potential fugitive dust quality impact due from the dry/loose/exposure soil surface/dusty material;
  - Disposal of empty engine oil containers within site area;
  - Ensure dust suppression measures are implemented properly;
  - Silt removal facilities should be regularly maintained;
  - Management of chemical wastes;
  - Discharge of site effluent and stockpiling or disposal of materials at this area are prohibited;
  - Follow-up of improvement on general waste management issues; and
  - Implementation of construction noise preventative control measures
- 8.05 In addition, mosquito control measures should be continued to prevent mosquito breeding on site.



#### 9 CONCLUSIONS AND RECOMMENDATIONS

#### **CONCLUSION**

- 9.01 This is the **19**<sup>th</sup> monthly EM&A report presenting the monitoring results and inspection findings in the Reporting Period from **1** to **31 March 2016**.
- 9.02 In the Reporting Period, 6 occasions of 24-hours TSP monitoring were conducted at A1. The monitoring results are all below the Action/ Limit Level. No Notifications of Exceedances (NOEs) or the associated corrective actions were therefore issued.
- 9.03 In the Reporting Period, total of **10** occasions of noise measurement were conducted at N1 and N2 and no exceedance were recorded.
- 9.04 No environmental complaint, notification of summons or successful prosecution was received in the Reporting Period.
- 9.05 **Five (5)** occasions of weekly site inspections to evaluate site environmental performance was carried out by the RE, ET and the Contractor on **2, 11, 16, 23 and 30 March 2016** and the IEC was joined the site inspection on **16 March 2016**. No non-compliance was noted but four (4) observations and three (3) reminders were recorded by the ET.
- 9.06 In the Reporting Period, no site inspection was undertaken by external parties i.e. EPD.


#### RECOMMENDATIONS

- 9.07 Construction noise is the key environmental issue during construction work of the Project as there are residential buildings nearby. Noise mitigation measures should be fully implemented in accordance with the EM&A requirement.
- 9.08 Also, special attention should be paid on the potential construction dust impact as the construction site is located near the residential area. The Contractor should fully implement the construction dust mitigation measures properly.
- 9.09 The Contractor should also prevent muddy water and other water pollutants via site surface water runoff get into public areas. Any discharge water should be strictly complied with wastewater discharge license requirement. As a reminder, water quality mitigation measures should be properly implemented in accordance with the EM&A requirement.
- 9.10 As a reminder, the Contractor should be regular checking and maintenance wastewater treatment facilities ensure compliance with the currently Discharge License stipulation. A warning sign should be provided all the retained trees as remind the workers prevent scratch the trees. In addition, mosquito control should be kept to prevent mosquito breeding on site.



# Appendix A

**Project Site Layout Plan** 

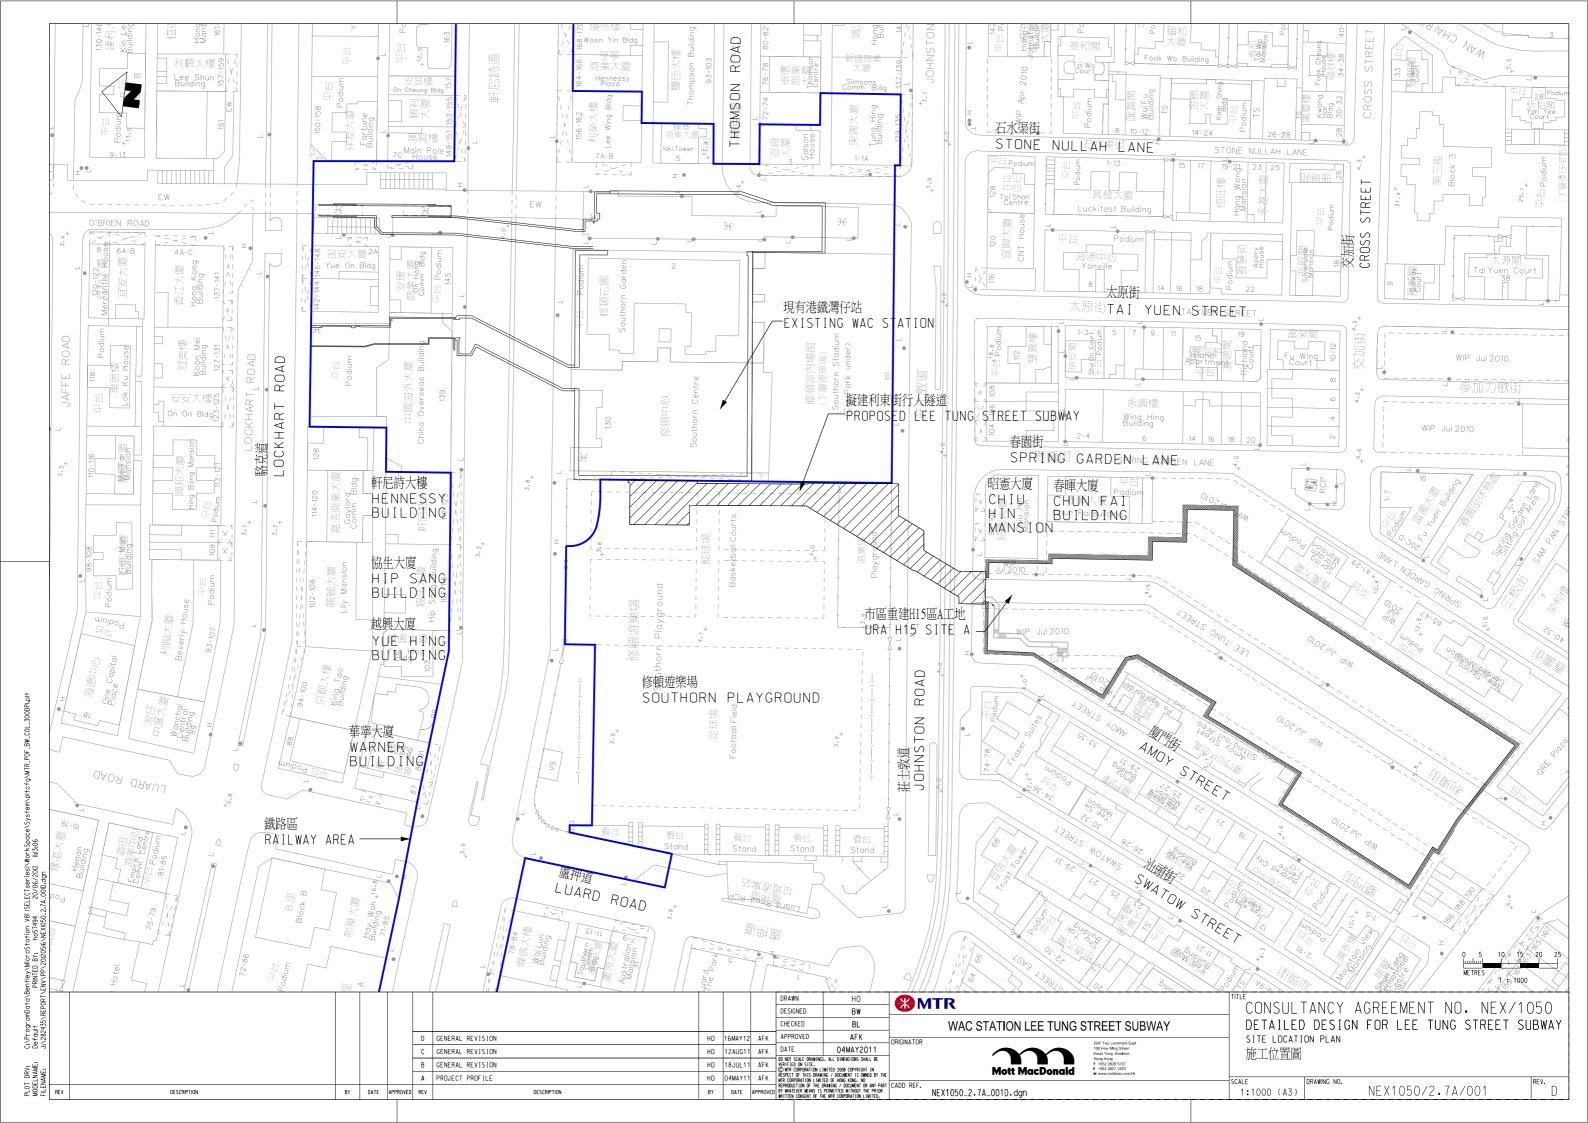




# Appendix B

Organization of the Project and Master Construction Programme



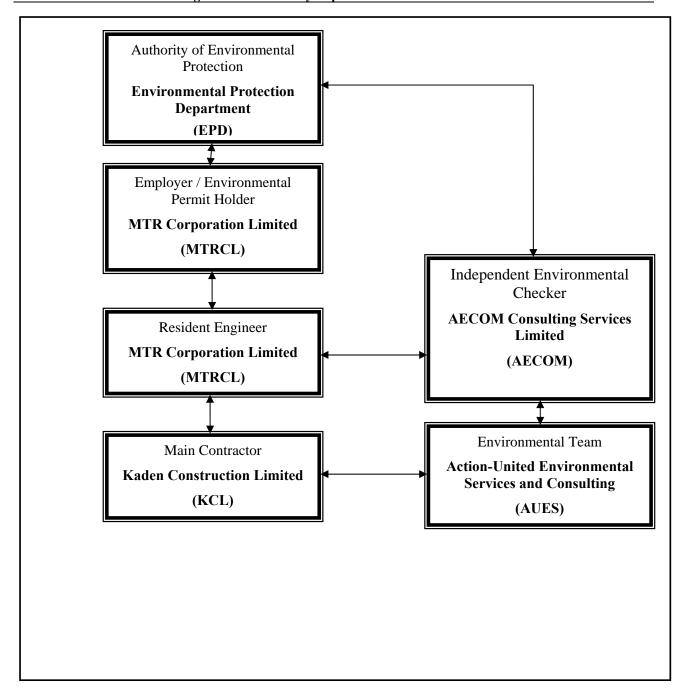



# **Contact Details of Key Personnel for the Project**

Organization	Project Role	Name of Key Staff	Tel No.	Fax No.
MTRCL	Resident Engineer	Mr. Raymond Lee	3547 0002	3547 0090
AECOM	Independent Environmental Checker	Mr. Y. W. Fung	3922 9366	3922 9797
KCL	Project Manager	Mr. Vincent, Kwan Chun Yin	9833 1313	2770 4278
KCL	Site Agent	Mr. Chan Kam Chuen	6462 8910	2770 4278
KCL	Environmental Officer	Ms. Ricci Poon Wai Tin	9533 1115	2770 4278
AUES	Environmental Team Leader	Mr. T. W. Tam	2959 6059	2959 6079
AUES	Environmental Consultant	Ms. Nicola Hon	2959 6059	2959 6079
AUES	Environmental Consultant	Mr. Ben Tam	2959 6059	2959 6079

# Legend:

MTRCL (Employer) – MTR Corporation Limited


MTRCL (Resident Engineer) – MTR Corporation Limited


KCL (Main Contractor) – Kaden Construction Limited

AECOM (IEC) – AECOM Consulting Services Limited


AUES (ET) – Action-United Environmental Services & Consulting

# MTR Contract C6593-13C Wan Chai Statoin Lee Tung Street Subway 3 Months Rolling Programme

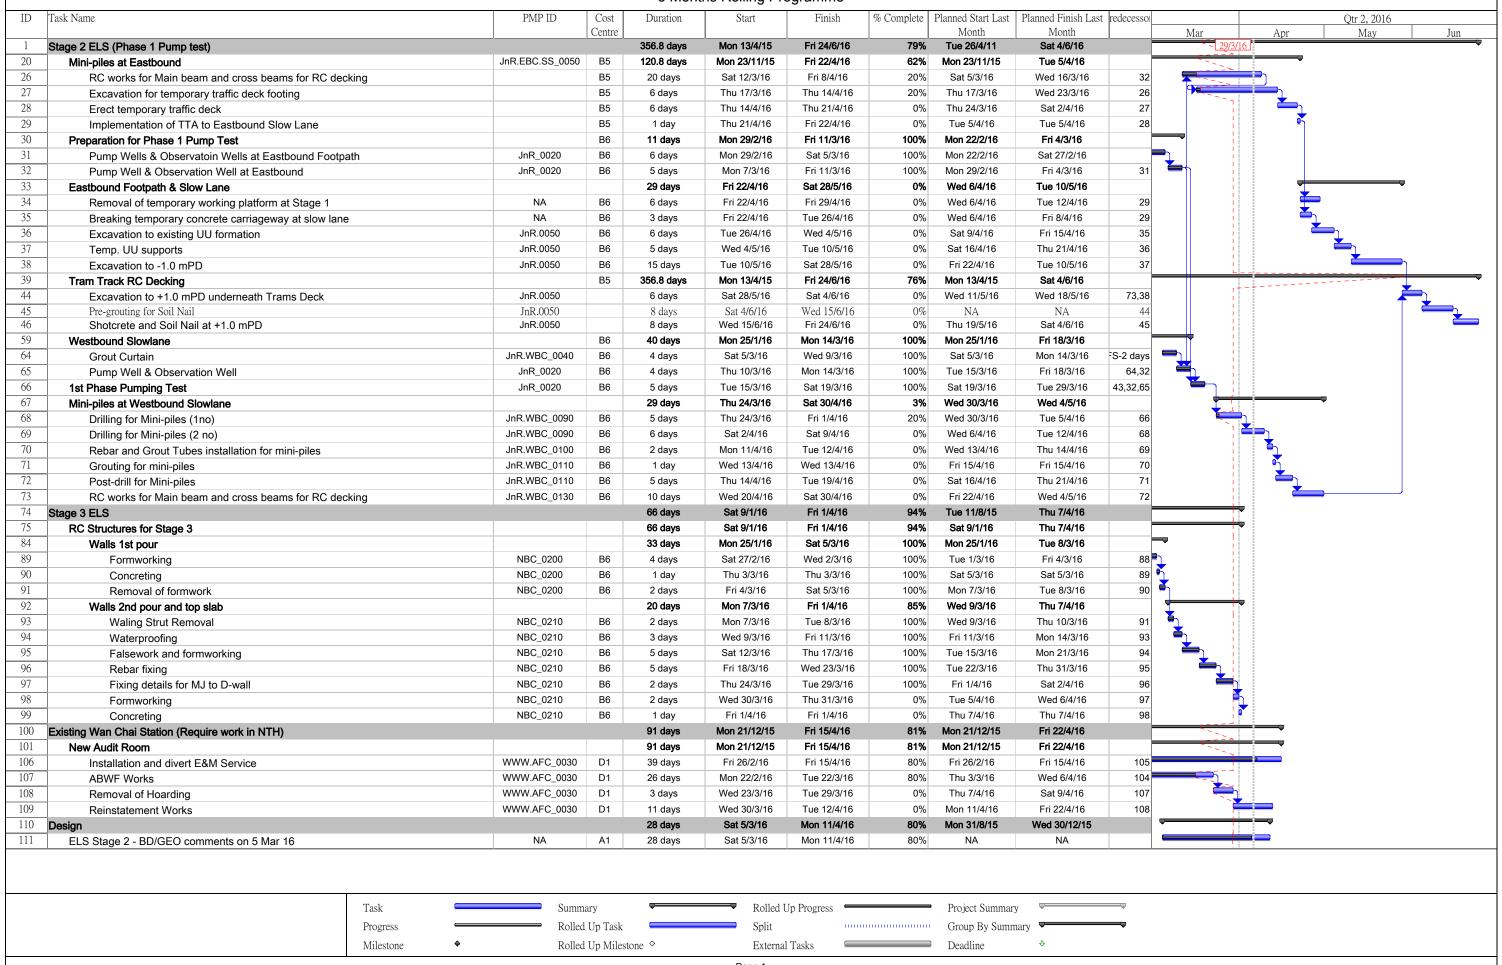


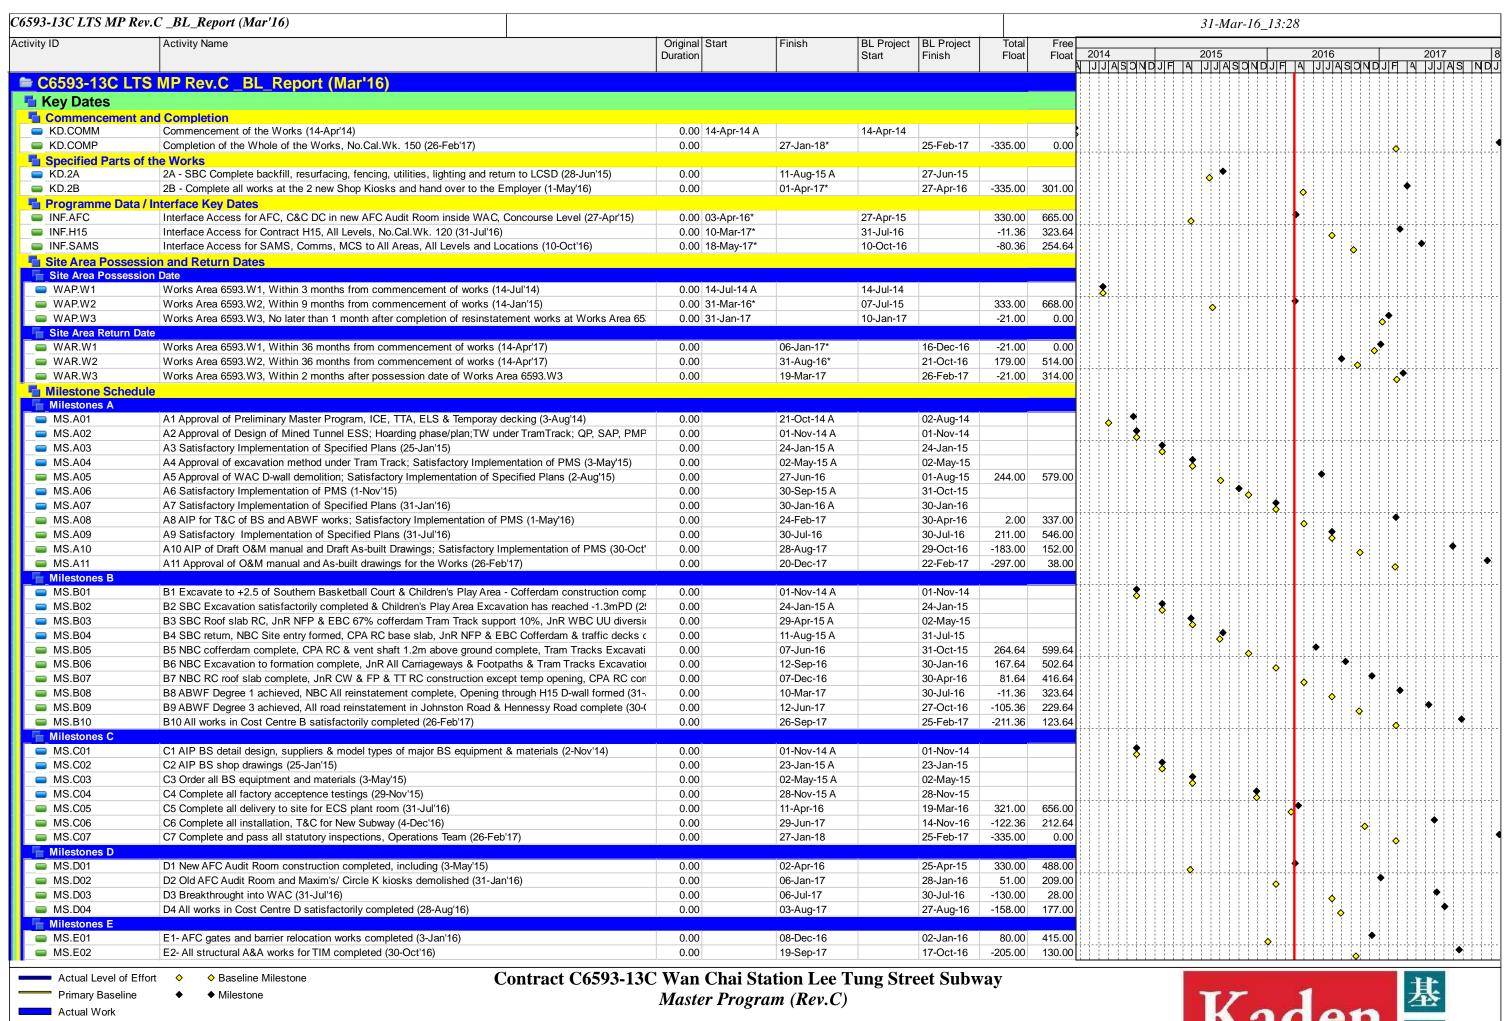

Remaining Work

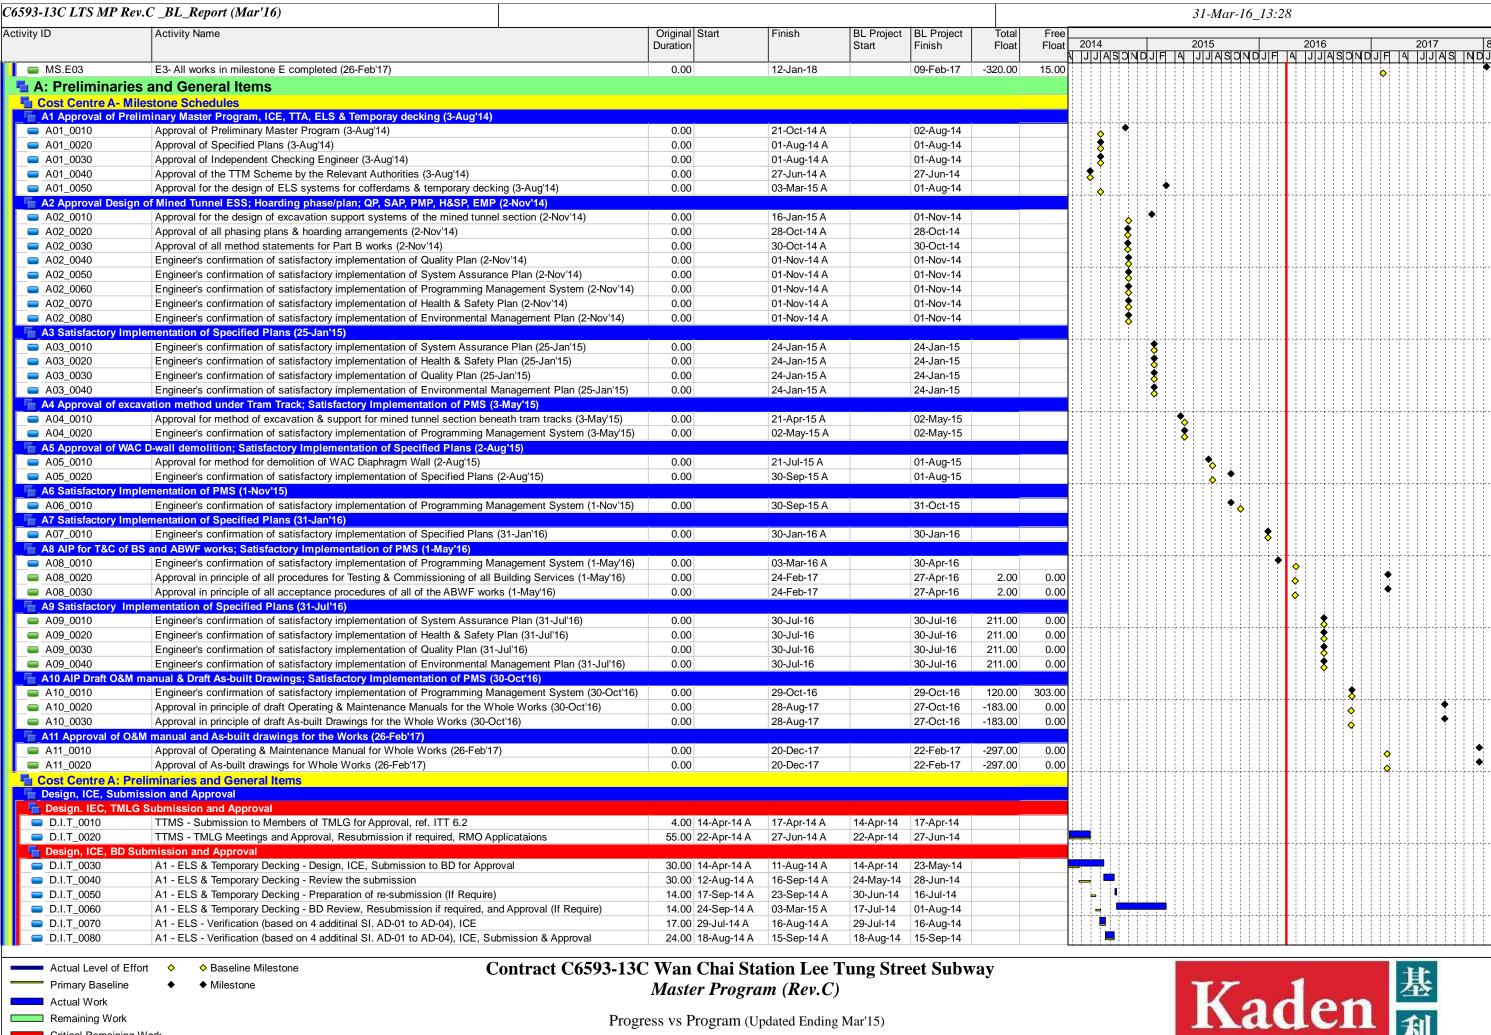


Remaining Work

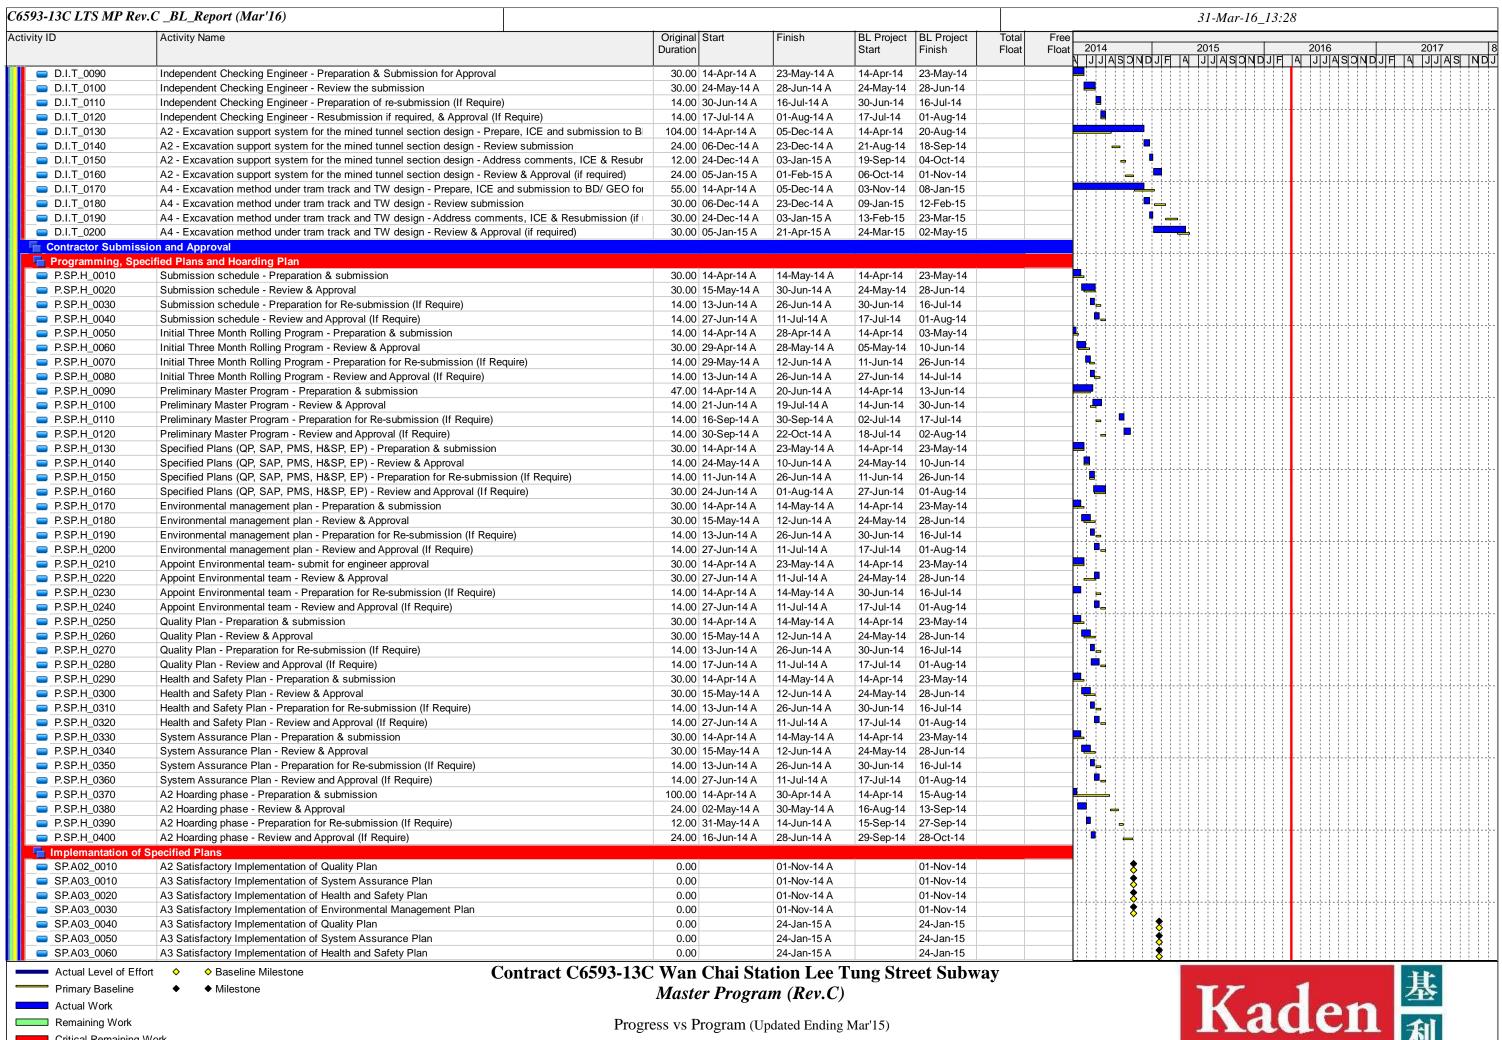


Remaining Work

Critical Remaining Work

Progress vs Program (Updated Ending Mar'15)

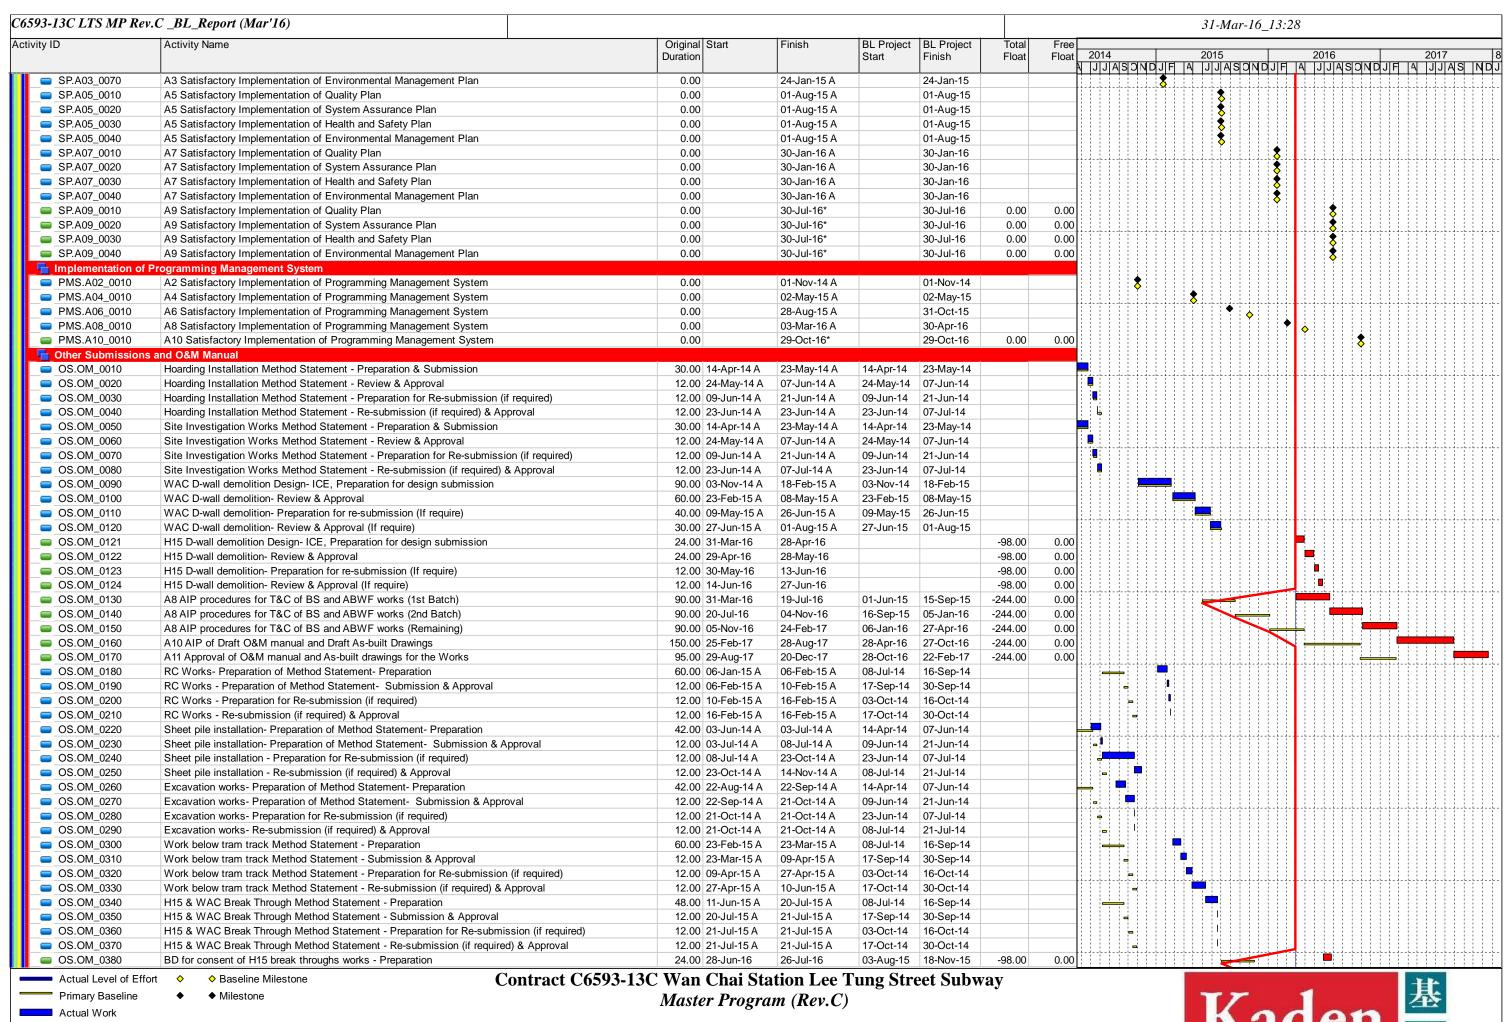


Remaining Work

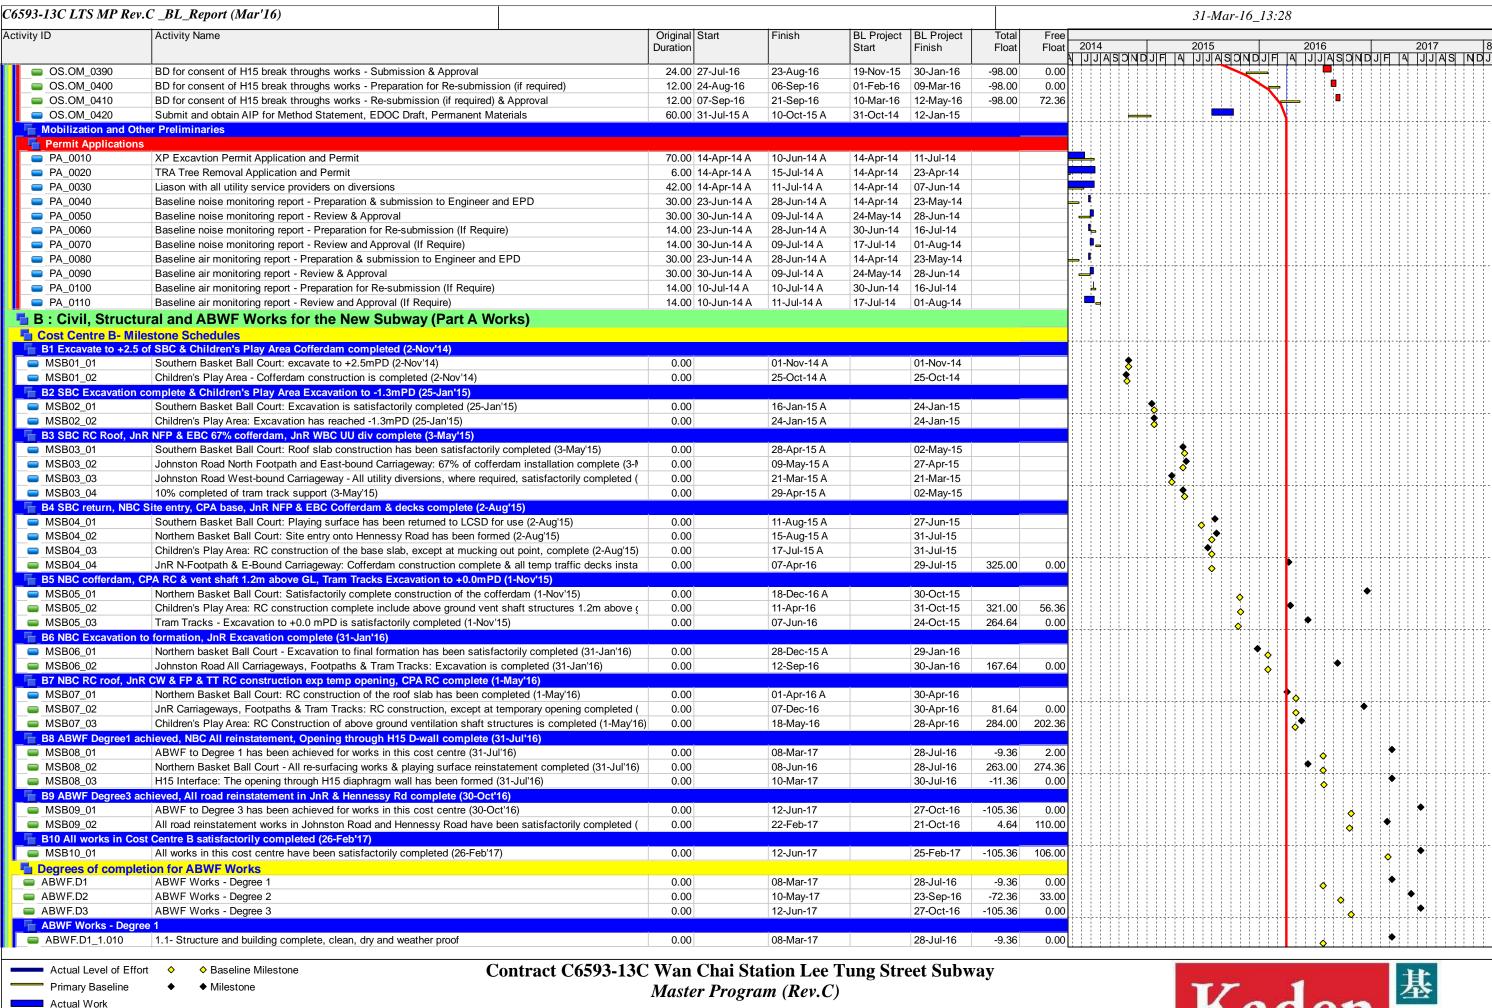


Kaden

ID	Activity Name	Original Duration		Finish	BL Project Start	BL Project Finish	Total Float	Free Float	2014			2015			2016		201	17
		Duration			Start	FIIIISII	Fluat	Float		ASIDNE	JF A	JJJA	SONI	DJF	A JJJA	SONDJE		
ABWF.D1_1.020	1.2- Blockwalls and partition walls complete, except on plant access route	0.00		08-Mar-17		28-Jul-16	-9.36	0.00							<b>•</b>		<b>.</b>	
ABWF.D1_1.030	1.3- Plastering, undercoat painting, floor screeding including plinths & upstands complete	0.00		08-Mar-17		28-Jul-16	-9.36	0.00							<b>♦</b>			
ABWF.D1_1.040	1.4- Equipment delivery routes & access openings available for Designated Contractors or Interface Con	0.00		08-Mar-17		28-Jul-16	-9.36	0.00	ļ- ļ ļ - <u></u>	ļ.ļ.ļ.ļ.					,			
ABWF.D1_1.050	1.5- Cast-in items & subframe installed; niches, recesses and box outs formed; cable troughs, ducts & n	0.00		08-Mar-17		28-Jul-16	-9.36	0.00							<b>♦</b>	- 1 1 1 1 1 1 7		
ABWF.D1_1.060	1.6- Structure as-built survey accepted	0.00		08-Mar-17		28-Jul-16	-9.36	0.00							,     <b>           </b>			
ABWF.D1_1.070	1.7- Structural & blockwork E&M openings formed & survey complete	0.00		08-Mar-17		28-Jul-16	-9.36	0.00							<b>\</b>			
ABWF.D1_1.080	1.8- Movement joints & stitch strips complete	0.00		08-Mar-17		28-Jul-16	-9.36	0.00							,     <b>         </b>			
ABWF.D1_1.090	1.9- Drainage system & discharge connections complete with temporary pumps operational	0.00		07-Mar-17		27-Jul-16	-8.36	1.00	- - - -	1-1-1-1-		.   -   -   -						
ABWF.D1_1.100	1.10- Escalator zones & pits complete; survey reference lines accepted	0.00		08-Mar-17		28-Jul-16	-9.36	0.00				1111			, i i 💠 i			-1-1
ABWF.D1_1.110	1.11- Earthing mat, earthing rods & earthing pits complete & test results accepted	0.00		08-Mar-17		28-Jul-16	-9.36	0.00							,     <b> </b>			
ABWF.D1_1.120	1.12- Underground pipework complete including manholes, ductworks & drawpits	0.00		08-Mar-17		28-Jul-16	-9.36	0.00							(   <b> </b>		•	
ABWF.D1_1.130	1.13- Civil & building provisions for designated & interfacing contractors complete	0.00		31-Mar-16		14-Apr-14	333.00	342.36										
ABWF Works - Degre ABWF.D2_2.010	2.1- Permanent door frames installed with temporary doors and locks	0.00	(	02-May-17		15-Sep-16	-64.36	8.00		++++				+	,		,-+-∳-+-	
ABWF.D2_2.010	2.2- Floor finishes & wall tilling in plant rooms for Designated Contractors complete	0.00		10-May-17		23-Sep-16	-72.36	0.00								<u> </u>	•	
ABWF.D2_2.030	2.3- Glazing & Balustrade support installed	0.00		22-Mar-17		11-Aug-16	-23.36	49.00								•	•	
ABWF.D2_2.040	2.4- Metal staircases, cat-ladders & catwalks complete	0.00		02-May-17		15-Sep-16	-64.36	8.00						1111			.   •	
ABWF.D2_2.040 ABWF.D2_2.050	2.5- External louvers installed	0.00		02-May-17		15-Sep-16	-64.36	8.00						1111			•	
ABWF.D2_2.060	2.6- Framework for final finishes installed	0.00		02-May-17		15-Sep-16	-64.36	8.00		++-				+		•		
ABWF.D2_2.060 ABWF.D2 2.070	2.7- Water tightness testing to water tanks passed	0.00		02-May-17		15-Sep-16	-64.36	8.00						1111	1 1 1 1 1	<b>&gt;</b>		
ABWF.D2_2.070 ABWF Works - Degre		0.00		02-181ay-11		10-0ch-10	-04.30	0.00							· · · · · · · · · · · · · · · · · · ·	<b>&gt;</b>		
ABWF.D3_3.010	3.1- All finishes complete including permanent doors, ironmongery	0.00		12-Jun-17		27-Oct-16	-105.36	0.00									•	
ABWF.D3_3.020	3.2- Balustrade installed	0.00		12-Jun-17		27-Oct-16	-105.36	0.00						1111		<b>?</b>		
ABWF.D3_3.030	3.3- Signage hangers & supports installed	0.00		08-Jun-17		24-Oct-16	-105.36	4.00	<del> - - - </del> -	++								
ABWF.D3_3.040	3.4- Roller shutters, fire shutters & smoke barriers installed	0.00		08-Jun-17		24-Oct-16	-101.36	4.00						-		<b>\Q</b>		
ABWF.D3_3.050	3.5- Acoustic treatment applied	0.00		08-Jun-17		24-Oct-16	-101.36	4.00						4111	,	<b>?</b>		
ABWF.D3_3.060	3.6- Louvres & grilles installed	0.00		08-Jun-17		24-Oct-16 24-Oct-16	-101.36	4.00						-				
ABWF.D3_3.070	3.7- All openings & Penetrations sealed	0.00		08-Jun-17		24-Oct-16	-101.36	4.00							,	<b>&gt;</b>	•	
	und Reprovision works	0.00		JOG GUIT-17		27 JUI-10	101.00	7.00	<del> - - - </del> -	++++				++++				
RW_0010	LCSD handover Northern Basket Ball Court 1	1 00	07-Jan-17	07-Jan-17	17-Dec-16	17-Dec-16	-15.00	0.00						1111				
RW_0020	Fence off the site		09-Jan-17	10-Jan-17	_	20-Dec-16	-15.00	0.00						1111				
RW_0030	Expose the surface		11-Jan-17	17-Jan-17	_	29-Dec-16	-15.00	0.00						4111	,			
RW_0040	Resurfacing works		18-Jan-17	06-Feb-17	30-Dec-16		-15.00	0.00						-				
RW_0050	Hand over to LCSD, additional remedial if require		07-Feb-17	11-Feb-17		21-Jan-17	-15.00	0.00	<del> - - - </del> -	1111				+++++				
RW_0060	LCSD handover Southern Basket Ball Court 2		13-Feb-17	13-Feb-17	23-Jan-17	23-Jan-17	-15.00	0.00							,			
RW_0070	Fence off the site		14-Feb-17	15-Feb-17	24-Jan-17	25-Jan-17	-15.00	0.00						1111		1		
RW 0080	Expose the surface		16-Feb-17	22-Feb-17	26-Jan-17	04-Feb-17	-15.00	0.00						4				-
RW_0090	Resurfacing works		23-Feb-17	09-Mar-17	06-Feb-17		-15.00	0.00						1111	,		<b>,</b>	
RW_0100	Hand over to LCSD, additional remedial if require		10-Mar-17	15-Mar-17	21-Feb-17		-15.00	3.00	† 				! <del>}</del> !	1111			,0	
ost Centre B: Par	t A Works, Civil and Structural Works for the New Subway																	1 1
3.RC_Comp	RC Structure completed for the new subway	0.00		07-Dec-16		30-Apr-16	-217.36	0.00							<b>\ \</b>	•		
Site Preliminary Wo		0.00	44.0 44.5	40.0 44.5	44 5 44	40.6												
SPW_0010	LCSD handover SBC & Play's Area		14-Apr-14 A	16-Apr-14 A	<u> </u>				ļ <u>i</u> -	++-					,			
SPW_0020	Fence off the Site area for SBC & Play's Area		17-Apr-14 A	23-Apr-14 A										1111	,		.	
SPW_0030	Employ security guard & security booth delivery		24-Apr-14 A	26-Apr-14 A														
SPW_0040	Removal of existing furniture for SBC & Play's Area as require		28-Apr-14 A	05-May-14 A		05-May-14			<u> </u>						,			
SPW_0050	Trial trenches and expose existing UU service in SBC & Play's area		14-Apr-14 A	05-Jun-14 A	14-Apr-14			-						1111	,			
SPW_0060	Setting up site office & misc.		07-May-14 A	05-Jul-14 A	07-May-14					++++					,			
SPW_0070	Form site access for vehicle		07-Jul-14 A	19-Jul-14 A	07-Jul-14	19-Jul-14									,			
SPW_0080	Diversion of existing utilities & misc. works if require for SBC & Play's Area		09-Jun-14 A	07-Jul-14 A	09-Jun-14	07-Jul-14								1111	,			
SPW_0090	Erect hoarding for SBC		16-Jul-14 A	29-Jul-14 A		21-Jul-14								4				
SPW_0100 SPW_0110	Ground/ Site Investigation in SBC & Play's Area  Transplant and tree removal		08-Jul-14 A	28-Jul-14 A 21-Jul-14 A	08-Jul-14 24-Apr-14	28-Jul-14									,			
SPW_0110 <mark>lorthern Basket Ball</mark>		12.00	24-Apr-14 A	∠ 1-Jul- 14 A	24-Apr-14	∠1-Jul-14			<del> -  -</del>  -	++				+				
NBC_0010	Liaison with relevance parties for TTM	80 00	02-Apr-15 A	02-Jul-15 A	02-Apr-15	13-Jul-15						<u>i</u>		1111				
NBC_0010	LCSD handover Northern Basket Ball Court for LTS construction works		11-Aug-15 A	11-Aug-15 A	29-Jun-15							TIH		4111				
NBC_0020	Preparation works for NBC site access		11-Aug-15 A	11-Aug-15 A	07-Jul-15	10-Jul-15								-				
NBC_0030	Implementation of TTM		11-Aug-15 A	11-Aug-15 A	14-Jul-15	16-Jul-15								1111				
NBC_0040 NBC_0050	Relocation of metal fence access door for public		11-Aug-15 A	11-Aug-15 A	11-Jul-15	17-Jul-15				++								
NBC_0060	Hoarding installation, installation of site entry on Hennessy Road		11-Aug-15 A	15-Aug-15 A	18-Jul-15	31-Jul-15								-				
NBC_0000	Expose UU & trial trench for sheet piles works			20-Aug-15 A		14-Aug-15						لرآ!!		1111	,			
	Phase 3 ELS- Sheet Piles Installation [104 no. x 24m]		24-Aug-15 A			12-Oct-15							<b>_</b>					
NISC, UUSU									<u> </u>	1111				النفذ				
	rt 💠 💠 Baseline Milestone (Contract (C6593-136	, wan	Cnai Sta	uon Lee I	_	eet Subw	ay					//			2000		H	4
Actual Level of Effo			_															
NBC_0080  Actual Level of Efformation Primary Baseline	♦ Milestone		er Progra	m (Rev.C)													4	
Actual Level of Effo Primary Baseline Actual Work	◆ Milestone	Maste	J	,											10	n	4	
Actual Level of Effo Primary Baseline	◆ Milestone	Maste	J	m (Rev.C)  odated Ending								K	(	10	le	n	金仙	


rity ID	Activity Name	Original		Finish	BL Project		Total	Free					-16_13:				20.11
		Duration			Start	Finish	Float	Float	2014  J J A S		2 	015 JIJIAISIC	DNDJF	2016 	, ASONE		2017  J J A S
■ NBC_0090	Curtain Grouting and remedial works for sheet piles not reaching to design toe level		30-Sep-15 A			30-Oct-15						<u> </u>					
■ NBC_0100	Phase 3 ELS- Pumping Test preparation works	_	09-Oct-15 A			27-Oct-15											
NBC_0110	Phase 3 ELS- Pumping Test		27-Oct-15 A			06-Nov-15							<b>L</b>				
■ NBC_0120	Phase 3 ELS- Pumping Test Report Preparation and submission to BD		02-Nov-15 A			13-Nov-15											
NBC_0130	Bulk Excavation (Removal of hard paving on ground surface) & excavation for layer 1 to +2.5mPD [500m		04-Nov-15 A			24-Nov-15 11-Dec-15											
<ul><li>■ NBC_0140</li><li>■ NBC_0150</li></ul>	Bulk excavation & layer 2 strut & preloading [500m^3]  Bulk excavation & layer 3 strut & preloading [500m^3]		11-Nov-15 A 23-Nov-15 A			05-Jan-16				-1-1-1-1		+					+-+-+-
■ NBC_0160	Bulk excavation & layer 4 strut & preloading [500m*3]		04-Dec-15 A			29-Jan-16											
■ NBC_0170	Plate load test	_	05-Jan-16 A			05-Feb-16							ı,				
■ NBC_0180	Plate load test- Preparation of report & submission to BD		09-Jan-16 A			16-Feb-16											
■ NBC_0190	Base Slab- Waterproofing & RC construction [Concrete 490m^3] & [Re-Bar 29.5 T]		13-Jan-16 A			04-Mar-16											
■ NBC_0200	Wall- Waterproofing & RC construction [Concrete 300m^3] & [Re-Bar 54 T]	21.00	20-Feb-16 A	08-Mar-16 A		01-Apr-16				-1-1					-1-1-1-1-		11111
■ NBC_0210	Top Slab- Waterproofing & RC construction [Concrete 180m^3] & [Re-Bar 42.7 T]	24.00	17-Mar-16 A	01-Apr-16 A	02-Apr-16	30-Apr-16								<mark> </mark>			
■ NBC_0220	Construction of flood light footing [2 nos.]	12.00	29-Mar-16 A	01-Apr-16 A	03-May-16	17-May-16											
■ NBC_0230	Reinstatement and installation of flood light [2nos.]	_	29-Mar-16 A	· ·		24-May-16	144.00	0.00									
■ NBC_0240	Backfilling for Northern Basketball Court		05-Apr-16	18-Apr-16		07-Jun-16	144.00	0.00				4444					4444
■ NBC_0250	Reinstate hard paving of Northern Basketball Court		19-Apr-16	10-May-16		29-Jun-16	144.00	0.00									
■ NBC_0260	Reinstate surface coating of Northern Basketball Court		11-May-16	25-May-16	30-Jun-16		144.00	0.00									
■ NBC_0270	Hand over to LCSD, additional remedial if require		26-May-16	08-Jun-16	15-Jul-16		144.00	0.00									
NBC_0280	Reinstate road surface on Hennessy Road	/0.00	10-Jun-16	31-Aug-16	29-Jul-16	21-Oct-16	144.00	0.00							<del></del>		
Southern Basket Baset Ba	Phase 1 ELS- Sheet Piles Installation [184n. x 24m]	6F 00	22-Jul-14 A	15-Nov-14 A	22-Jul-14	08-Oct-14											++++
SBC_0010 SBC_0020	Curtain Grouting and remedial works for sheet piles not reaching to design toe level		15-Oct-14 A		09-Oct-14												
SBC_0020	Bulk Excavation (Removal of hard paving on ground surface) & excavation for layer 1 to +2.5mPD [800m]		09-Oct-14 A			01-Nov-14											
SBC_0040	Phase 1 ELS- Pumping Test preparation works		16-Oct-14 A							<u>,</u>							
■ SBC_0050	Phase 1 ELS- Pumping Test		17-Nov-14 A			07-Nov-14											
■ SBC 0060	Phase 1 ELS- Pumping Test Report Preparation and submission to BD	_	04-Dec-14 A			14-Nov-14						11111	-1-1				11111
■ SBC_0070	Bulk excavation & layer 2 strut & preloading [800m^3]		15-Nov-14 A			17-Dec-14											
■ SBC_0080	Bulk excavation & layer 3 strut & preloading [800m^3]	30.00	18-Dec-14 A	24-Jan-15 A	18-Dec-14	24-Jan-15											
■ SBC_0090	Plate load test	6.00	26-Jan-15 A	31-Jan-15 A	26-Jan-15	31-Jan-15											
■ SBC_0100	Temporary Traffic Deck construction	12.00	10-Jan-15 A	28-Jan-15 A	26-Jan-15	07-Feb-15				<b> </b>	<b>.</b>						
SBC_0110	Plate load test- Preparation of report & submission to BD	12.00	12-Feb-15 A	16-Mar-15 A		14-Feb-15						THIT					
SBC_0120	Base Slab- Waterproofing & RC construction [Concrete 420m^3] & [Re-Bar 25.3 T]	15.00	04-Sep-15 A	04-Sep-15 A	16-Feb-15	07-Mar-15					-						
SBC_0130	Wall- Waterproofing & RC construction [Concrete 280m^3] & [Re-Bar 50.4 T]	21.00	02-Mar-15 A			01-Apr-15					. <u> </u>						
SBC_0140	Top Slab- Waterproofing & RC construction [Concrete 210m^3] & [Re-Bar 50 T]		28-Mar-15 A	<u> </u>	<u> </u>	02-May-15					<del>     </del>						
SBC_0150	Construction of flood light footing (2 nos.)		-	21-May-15 A		11-May-15						44444					
SBC_0160	Reinstatement and installation of flood light (2nos.)			05-Jun-15 A		14-May-15											
SBC_0170	Backfilling for Southern Basketball Court	_	18-May-15 A		-	21-May-15											
SBC_0180 SBC_0190	Reinstate hard paving of Southern Basketball Court  Reinstate surface coating of Southern Basketball Court		16-Jun-15 A 20-Jun-15 A			02-Jun-15 12-Jun-15					9						
■ SBC_0200	Hand over to LCSD, additional remedial if require		30-Jun-15 A			27-Jun-15					-						
Children's Play Are		12.00	30-3411-13 A	11-Aug-13-A	10-0411-10	27-0011-10									:		++++
CPA_0010	Phase 1 ELS- Sheet Piles Installation [123 No. x 24m]	65.00	22-Jul-14 A	15-Nov-14 A	22-Jul-14	08-Oct-14				<b>-</b>							
■ CPA_0020	Curtain Grouting and remedial works for sheet piles not reaching to design toe level		15-Oct-14 A			25-Oct-14				<u> </u>							
■ CPA_0030	Phase 1 ELS- Pumping Test preparation works		16-Oct-14 A			25-Oct-14				<b>.</b>							
CPA_0040	Bulk Excavation (Removal of hard paving on ground surface) & excavation for layer 1 to +2.5mPD [680m	32.00	27-Oct-14 A	02-Dec-14 A		02-Dec-14											
CPA_0050	Phase 1 ELS- Pumping Test	11.00	17-Nov-14 A	28-Nov-14 A	27-Oct-14	07-Nov-14				<b>₽</b> B							
CPA_0060	Phase 1 ELS- Pumping Test Report Preparation and submission to BD	6.00	04-Dec-14 A	19-Jan-15 A	08-Nov-14	14-Nov-14				. =							
CPA_0070	Bulk excavation & layer 2 strut & preloading to -1.3 mPD [680m^3]	30.00	18-Dec-14 A	24-Jan-15 A		24-Jan-15											
CPA_0080	Play's Area Temporary Traffic Deck construction		10-Jan-15 A			07-Feb-15				-							
CPA_0090	Bulk excavation & layer 3 strut & preloading [680m^3]		09-Feb-15 A			30-Mar-15								-			4-4-4-4
CPA_0100	Bulk excavation & layer 4 strut & preloading [680m^3]		01-Mar-15 A			03-Jun-15											
CPA_0110	Plate load test		30-Mar-15 A	<u> </u>		10-Jun-15					! <u>.</u>						
CPA_0120	Plate load test- Preparation of report & submission to BD		08-Apr-15 A			25-Jun-15						<u> </u>					
<ul><li>■ CPA_0130</li><li>■ CPA_0140</li></ul>	Base Slab- Waterproofing & RC construction [Concrete 395m^3] & [Re-Bar 23.8 T]  Wall- Waterproofing & RC construction [Concrete 210m^3] & [Re-Bar 37.8 T]		23-Apr-15 A 18-Jun-15 A		26-Jun-15	21-Aug-15											
■ CPA_0140 ■ CPA_0150	Top Slab- Waterproofing & RC construction [Concrete 185m^3] & [Re-Bar 43.8 T]		07-Aug-15 A			14-Sep-15							-   -   -   -   -				1-1-1-1-
■ CPA_0160	Ventilation Shaft Below Ground- Waterproofing & RC construction [Concrete 35m^3] & [Re-Bar 6.3 T]		22-Aug-15 A			09-Oct-15											
■ CPA_0170	Ventilation Shaft 1.2m Above Ground- Waterproofing & RC construction [Concrete 25m^3] & [Re-Bar 4.5		14-Sep-15 A	· ·		31-Oct-15	-15.00	0.00						<u> </u>			
■ CPA_0180	Ventilation Shaft - Waterproofing & RC construction reach +7.40 & +9.50mPD [Concrete 50m^3] & [Re-E		12-Apr-16	18-May-16	21-Mar-16		-15.00	0.00						<b></b>			
■ CPA_0190	Site cleaning for Play Area reinstatement & Landscape works		19-May-16	01-Jun-16		13-May-16	-15.00	0.00						\			
CPA_0200	Reinstatement works for Plays Area		02-Jun-16	19-Aug-16	<u> </u>	02-Aug-16	-15.00	0.00							<b>P</b>		
Actual Level of Eff																	370
<ul><li>Primary Baseline</li></ul>	♦ Milestone				_	cci gubn	ay				4	-	-			<u> </u>	
•	▼ WIIIGSTOLIG	Maste	er Progr	am (Rev.C)	)						-			$\mathrm{d}\epsilon$			D.
Actual Work	_	_															
Remaining Work		ess vs F	rogram (U	Jpdated Ending	g Mar'15)						-	1	199				411
Critical Remaining																	4.30

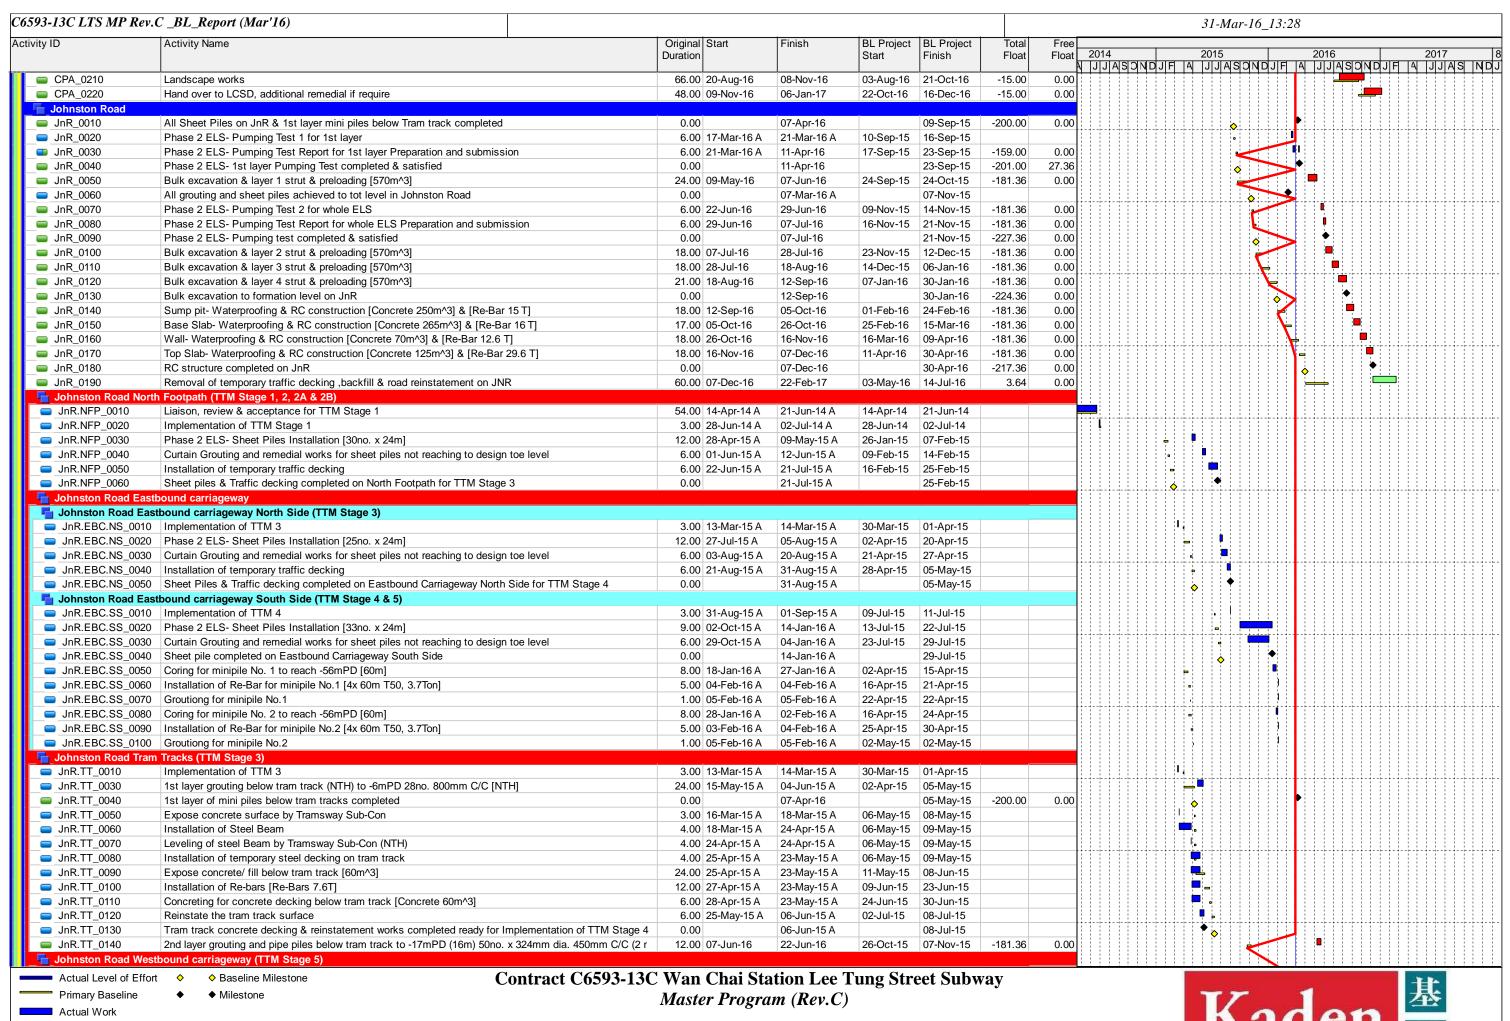

Remaining Work

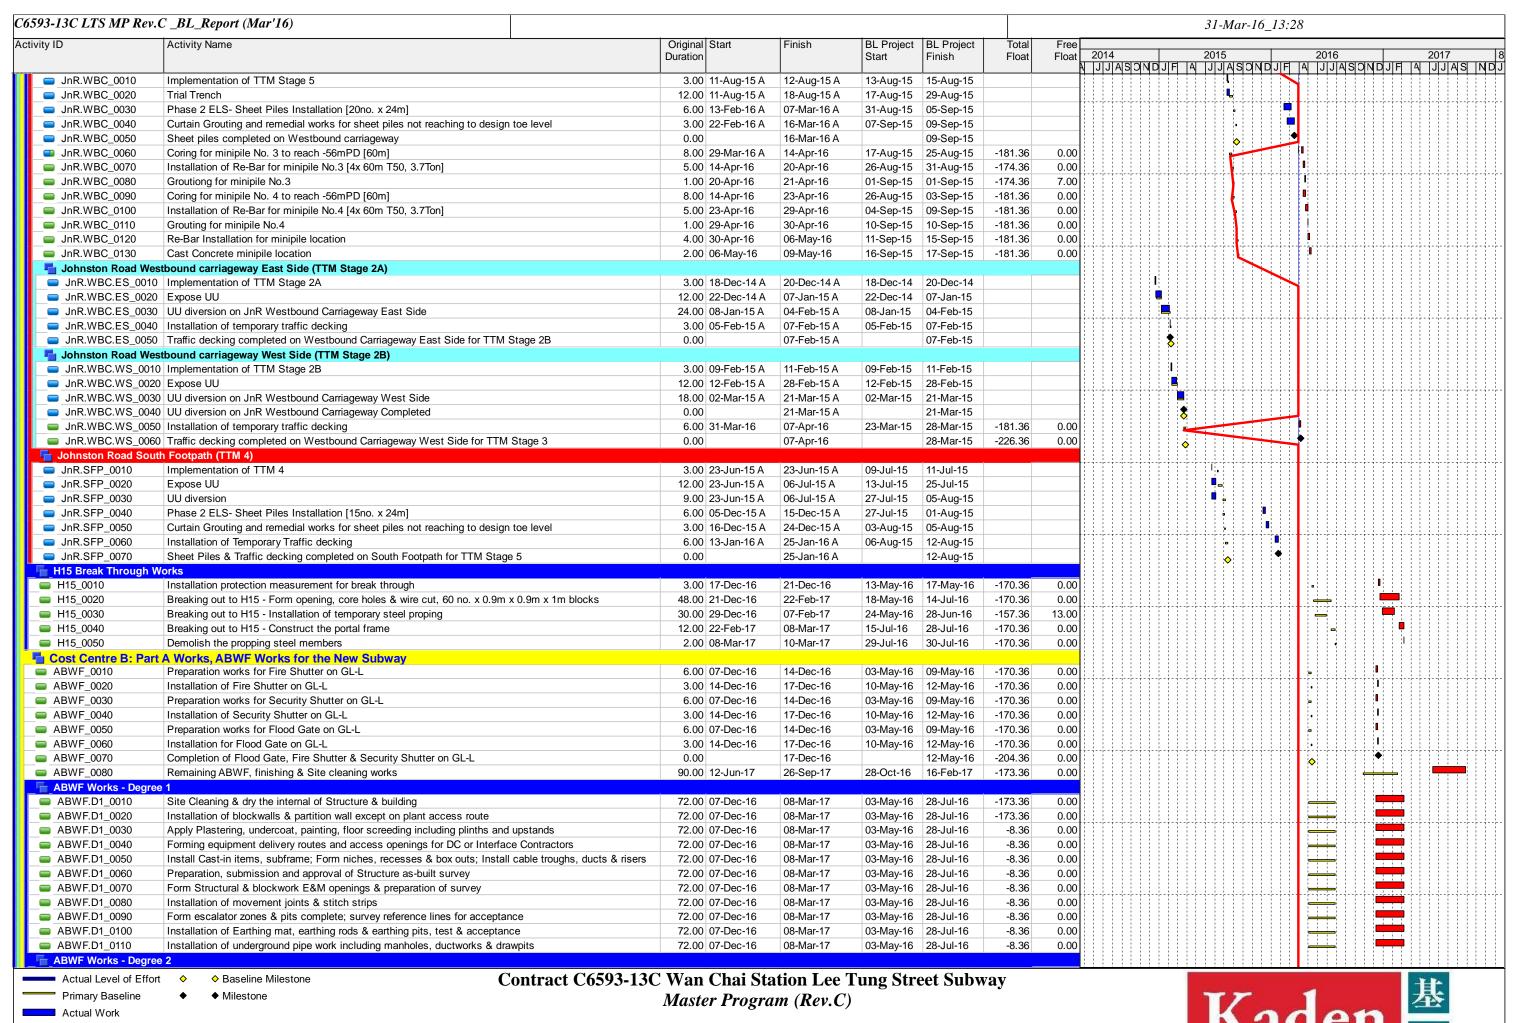

Remaining Work

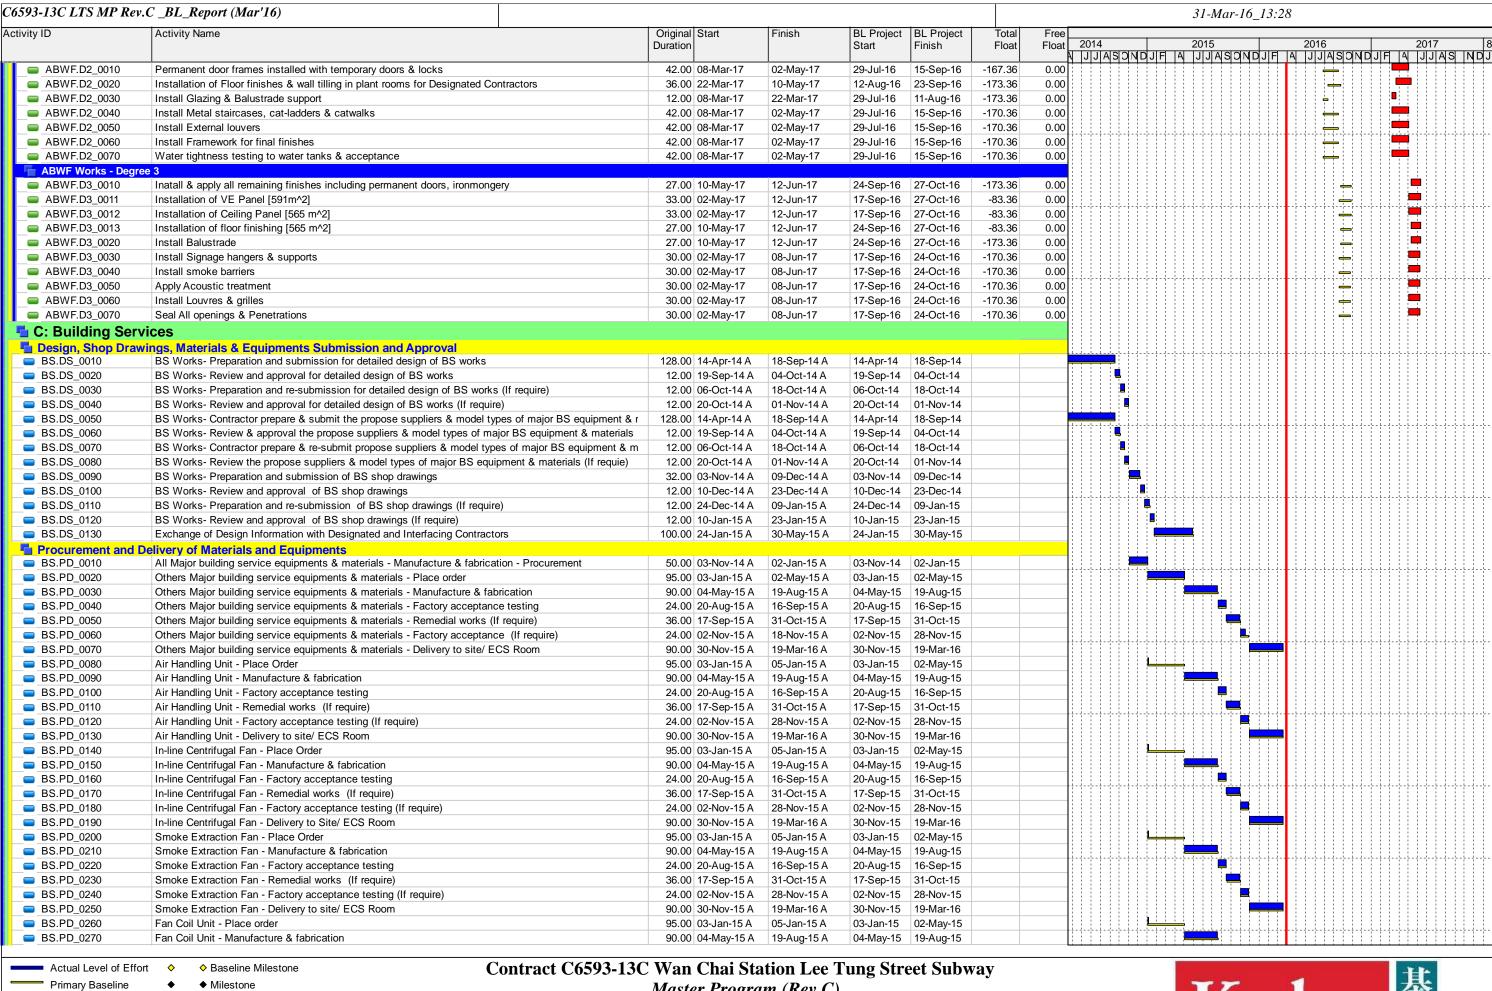


Master Program (Rev.C)

Progress vs Program (Updated Ending Mar'15)


Actual Work Remaining Work Critical Remaining Work



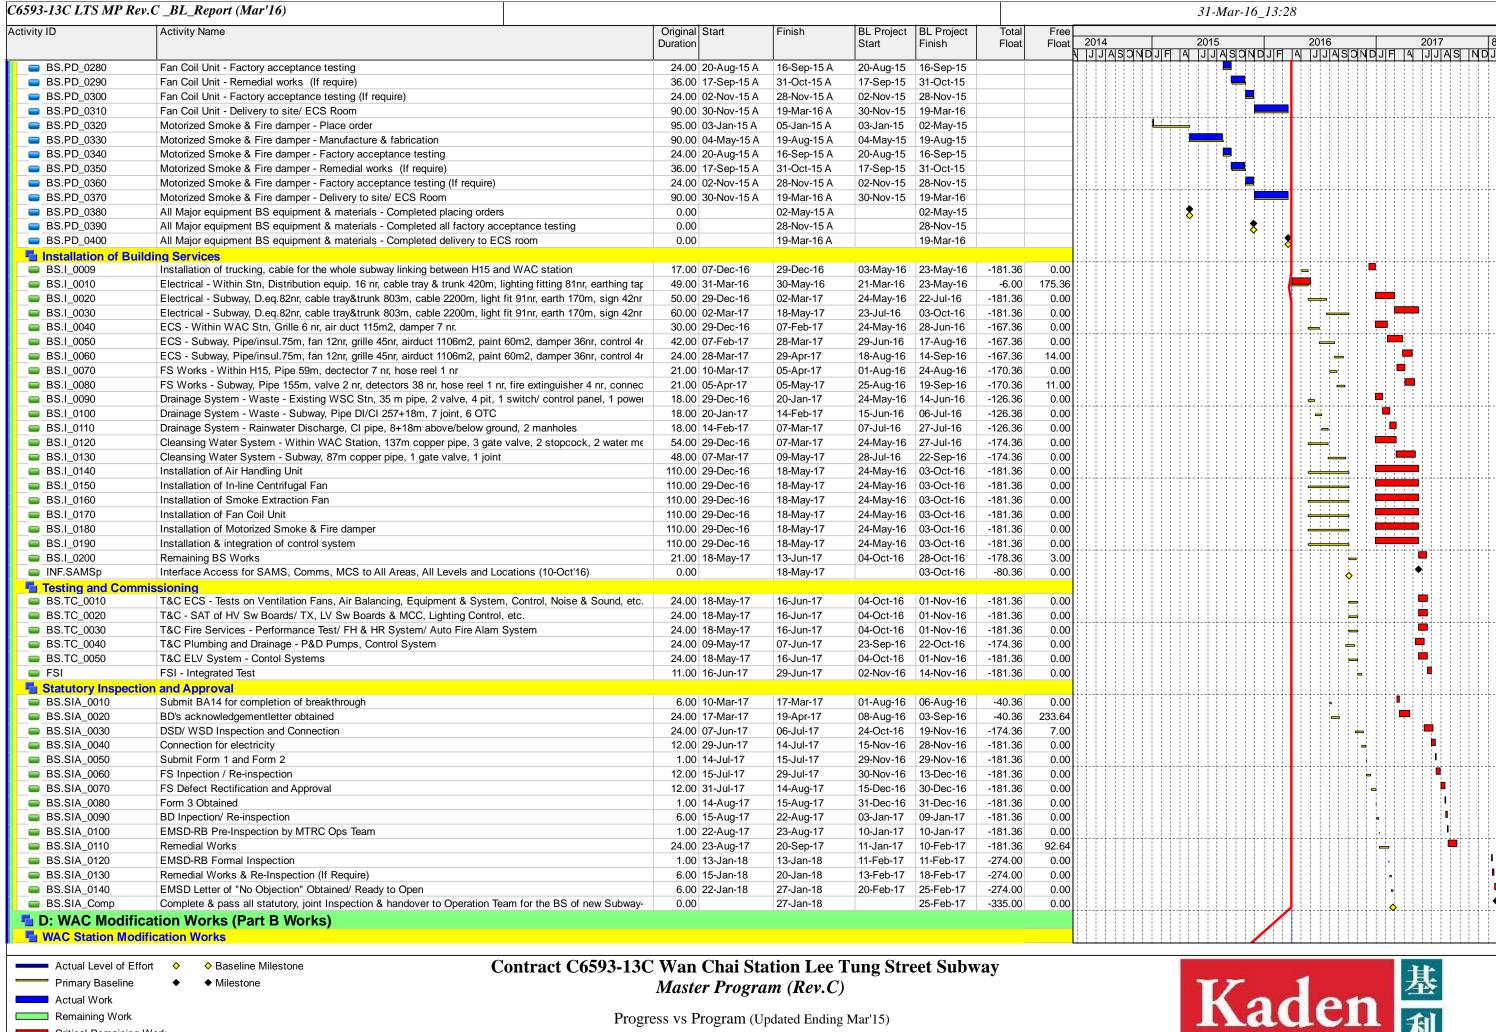

Critical Remaining Work

	v.C_BL_Report (Mar'16)							_				31-M	ar-16_13	3:28			
ctivity ID	Activity Name	Original		Finish		BL Project	Total	Free	2014	1		2015		2016	1	2017	7
		Duration			Start	Finish	Float	Float		SIOINID	JIFI 14		SOND.	Z016  F   A   J J A	SONDJE		
■ WMW_0010	Install New Telephone Booth and associated works (NTH)	60.00	19-Sep-16	29-Nov-16	12-Oct-15	21-Dec-15	-245.00	30.00		9 9  1-1	<u>-1.1 1.</u>	1 10101.1	33133			11 1919	1911
■ WMW_0020	Relocate 4 Advertising Panels (NTH)	21.00	07-Jan-17	03-Feb-17	29-Jan-16	25-Feb-16	-256.00	0.00									
■ WMW_0030	Finishing, Remedial works & site cleaning	24.00	07-Jul-17	03-Aug-17	01-Aug-16	27-Aug-16	-274.00	0.00									1
AFC Audit Room									† - <del> </del>		1111						
■ INF.AFCp	Interface Access for AFC, C&C DC in new AFC Audit Room inside WAC, Concourse Level (3-May'15)	0.00		28-Dec-15 A		25-Apr-15							.       •	. !   ! ! ! ! !			
■ WMW.AFC_0010	Preparation works for works in WAC station	10.00	28-Dec-15 A	02-Jan-16 A	13-Jan-15	23-Jan-15					-	Ĭ	1 1 1	.			
WMW.AFC_0020	Internal Hoarding in WAC station (NTH)	12.00	04-Jan-16 A	09-Jan-16 A	24-Jan-15	06-Feb-15					4						
■ WMW.AFC_0030	Construct new AFC/Audit Room next to Entrance B1, B2, ABWF & BS Works (NTH)	60.00	28-Dec-15 A	02-Apr-16	07-Feb-15	25-Apr-15	-275.00	0.00			1			<del></del>			: : : :
Existing AFC Aduit	Room, Maxim's & Circle K Kiosks																
■ WMW.K_0010	Liaison with MTR/ relevance parties for modification works of existing Kiosks & Audit Room	36.00	05-Apr-16	18-May-16	27-Apr-15	09-Jun-15	-275.00	0.00						.   📻			
■ WMW.K_0020	Internal Hoarding in WAC station (NTH)	12.00	19-May-16	01-Jun-16	10-Jun-15	24-Jun-15	-275.00	0.00				-		.			
■ WMW.K_0030	Modification Works to existing AFC/Audit, Store & Kiosk 3 & 5 (NTH)	90.00	02-Jun-16	17-Sep-16	25-Jun-15	10-Oct-15	-275.00	0.00					<b>→</b> ! ! ! !				
■ WMW.K_0040	Modification to existing Kiosk 2 (NTH)	90.00	19-Sep-16	06-Jan-17	12-Oct-15	28-Jan-16	-275.00	0.00									
ABWF Works & M	isc Works																
WMW.ABWF_0010	ABWF - Plaster & titling 29 m2, baffling ceiling 10 m2, metal cladding 9 m2	70.00	07-Jan-17	01-Apr-17	29-Jan-16	27-Apr-16	-275.00	0.00								<b>=</b>	
Breaking Out WAC	Station													N I I I I I I			
WMW.BO_0010	Installation protection measurement for break through	2.00	03-Apr-17	05-Apr-17	03-May-16	04-May-16	-274.00	0.00						. 📏 🖟 🗀		1	
WMW.BO_0020	Breaking out WAC Station - Form opening, core holes & wire cut, 60 no. x 0.9m x 0.9m x 1m blocks	54.00	06-Apr-17	14-Jun-17	05-May-16	09-Jul-16	-274.00	0.00									
WMW.BO_0030	Breaking out WAC Station - Installation of temporary steel proping	30.00	12-Apr-17	22-May-17	11-May-16	16-Jun-16	-255.00	19.00									
WMW.BO_0040	Breaking out WAC Station - Construct the portal frame	12.00	15-Jun-17	28-Jun-17	11-Jul-16	23-Jul-16	-274.00	0.00						.			
WMW.BO_0050	Demolish the propping steel members	6.00	29-Jun-17	06-Jul-17	25-Jul-16	30-Jul-16	-274.00	0.00									
Testing and Comm	nissioning													. :/  : : : : :			
■ WMW.C_0010	Testing and Commissioning	30.00	04-Feb-17	10-Mar-17	26-Feb-16	05-Apr-16	-256.00	19.00			.1.1.1.			. 🖶			
WMW.K_Comp	Specified Part 2B - Complete all works at the 2 new Shop Kiosks and hand over to the Employer - Progra	0.00		01-Apr-17		27-Apr-16	-335.00	0.00						<b>\</b>		<b>*</b>	
<b>E. WAC Station</b>	Imporvement Works (Part C Works)													/			
Improvement Worl														.			
■ WIW_0010	Modify, provide & install new glass barrier to suit new AFC gates (NTH)	34.00	19-Sep-16	29-Oct-16	12-Oct-15	20-Nov-15	62.00	0.00									
■ WIW_0020	Provide and install additional AFC gates (NTH)		31-Oct-16	08-Dec-16	21-Nov-15	02-Jan-16	62.00	0.00									
■ WIW_0030	Provide builder works for TIMS relocation (NTH)	40.00	04-Aug-17	19-Sep-17	29-Aug-16	17-Oct-16	-274.00	0.00						+	<del></del>		
■ WIW_0040	T&C by Designated Contractor for TIMS (NTH)	40.00	20-Sep-17	08-Nov-17	18-Oct-16		-274.00	0.00									
■ WIW_0050	Make Good builder works for TIMS (NTH)	53.00	09-Nov-17	12-Jan-18	03-Dec-16	09-Feb-17	-274.00	0.00									
WIW Comp	E3- All works in milestone E completed - Programmed	0.00		12-Jan-18		09-Feb-17	-336.00	0.00						.			



♦ Baseline Milestone

◆ Milestone

Contract C6593-13C Wan Chai Station Lee Tung Street Subway


Master Program (Rev.C)





### **Appendix C**

**Monitoring Locations** 

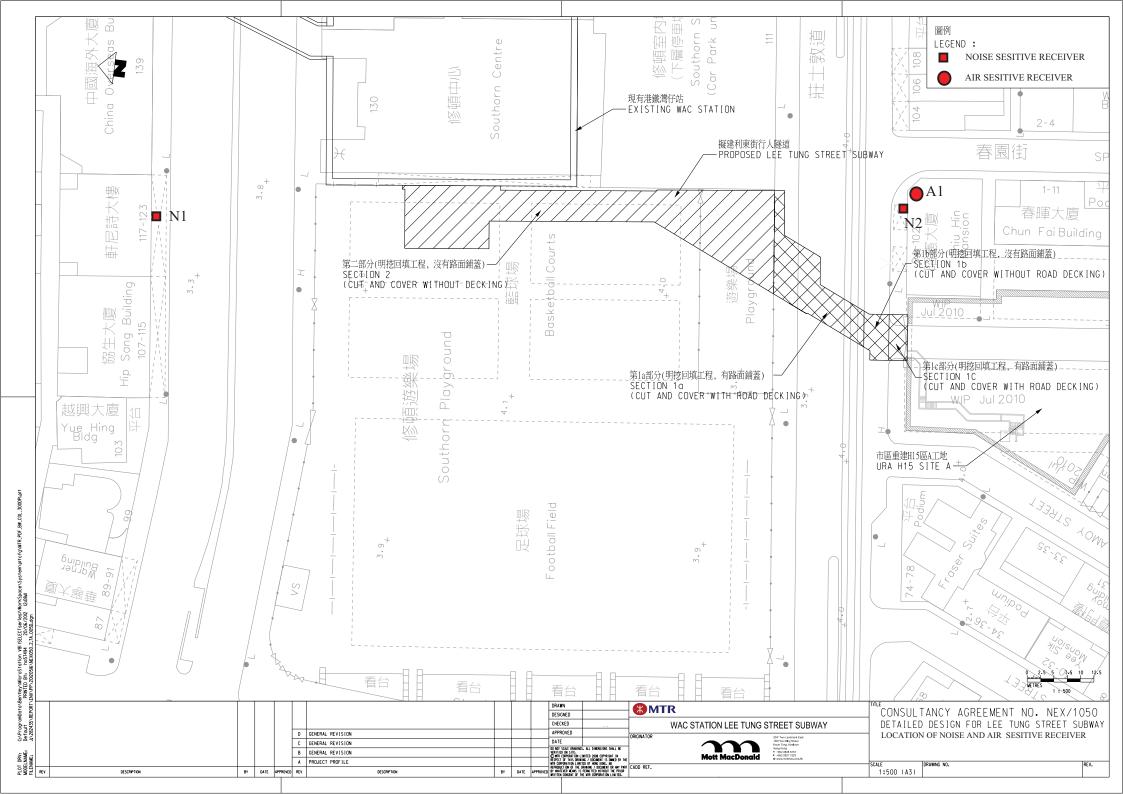



### Appendix D

**Calibration Certificate of Monitoring Equipment** 

#### TSP SAMPLER CALIBRATION CALCULATION SPREADSHEET

Location: Chiu Hin Mansion

Date of Calibration: 13-Feb-16

Location ID: A1

Next Calibration Date: 13-May-16

Technician: Mr. Ip Ka Hing

#### **CONDITIONS**

Sea Level Pressure (hPa) Temperature (°C) 1012.5 23.1 Corrected Pressure (mm Hg)
Temperature (K)

759.375

#### **CALIBRATION ORIFICE**

Make-> TISCH
Model-> 5025A
Serial # -> 1941

Qstd Slope -> Qstd Intercept ->

2.10265 -0.00335

#### **CALIBRATION**

L								
	Plate	H20 (L)	H2O (R)	H20	Qstd	I	IC	LINEAR
l	No.	(in)	(in)	(in)	(m3/min)	(chart)	corrected	REGRESSION
	18	6.5	6.5	13	1.721	52	52.31	Slope = $32.4312$
	13	5.1	5.1	10.2	1.525	47	47.28	Intercept = -3.1140
	10	4.1	4.1	8.2	1.367	41	41.25	Corr. coeff. = 0.9978
	7	2.9	2.9	5.8	1.150	33	33.20	
	5	1.5	1.5	3	0.828	24	24.14	

#### Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart respones

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration ( deg K

Pstd = actual pressure during calibration ( mm Hg

#### For subsequent calculation of sampler flow:

1/m(( I )[Sqrt(298/Tav)(Pav/760)]-b)


m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

Pav = daily average pressure

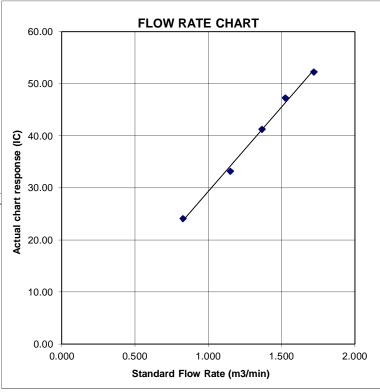



TISCH ENVIRONMENTAL, INC. 145 SOUTH MIAMI AVE VILLAGE OF CLEVES, OH 45002 513.467.9000 877.263.7610 TOLL FREE 513.467.9009 FAX

### ORIFICE TRANSFER STANDARD CERTIFICATION WORKSHEET TE-5025A

Date - Ma Operator		Rootsmeter Orifice I.I	-/	438320 1941	Ta (K) - Pa (mm) -	292 756.92
PLATE OR Run #	VOLUME START (m3)	VOLUME STOP (m3)	DIFF VOLUME (m3)	DIFF TIME (min)	METER DIFF Hg (mm)	ORFICE DIFF H2O (in.)
1 2 3 4 5	NA NA NA NA NA	NA NA NA NA	1.00 1.00 1.00 1.00	1.4880 1.0510 0.9360 0.8920 0.7360	3.2 6.4 7.9 8.8 12.7	2.00 4.00 5.00 5.50 8.00

#### DATA TABULATION

Vstd	(x axis) Qstd	(y axis)	Va	(x axis) Qa	(y axis)
1.0121 1.0078 1.0057 1.0046 0.9993	0.6802 0.9589 1.0745 1.1262 1.3578	1.4258 2.0163 2.2543 2.3644 2.8515	0.9958 0.9916 0.9895 0.9884 0.9832	0.6692 0.9434 1.0571 1.1080 1.3358	0.8784 1.2422 1.3888 1.4566 1.7568
Ostd slo intercep coeffici	t (b) = ent (r) =	2.10265 -0.00335 0.99999	Qa slor intercer coeffici	ot (b) =	1.31664 -0.00206 0.99999


#### CALCULATIONS

Vstd = Diff. Vol[(Pa-Diff. Hg)/760](298/Ta) Qstd = Vstd/Time

Va = Diff Vol [(Pa-Diff Hg)/Pa] Qa = Va/Time

For subsequent flow rate calculations:

Qstd =  $1/m\{ [SQRT (H2O (Pa/760) (298/Ta))] - b\}$ Qa =  $1/m\{ [SQRT H2O (Ta/Pa)] - b\}$ 

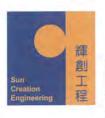

#### Sun Creation Engineering Limited

Calibration and Testing Laboratory

# Certificate of Calibration

Certificate No.: C151969

證書編號

Date of Receipt / 收件日期: 24 March 2015

校正證書

Description / 儀器名稱

ITEM TESTED / 送檢項目 (Job No. / 序引編號: IC15-0720)

Integrating Sound Level Meter (EQ006)

Manufacturer/製造商 Brüel & Kjær

Model No. / 型號 2238 Serial No. / 編號 2285762

Supplied By / 委託者 Action-United Environmental Services and Consulting

> Unit A, 20/F., Gold King Industrial Building, 35-41 Tai Lin Pai Road, Kwai Chung, N.T.

TEST CONDITIONS / 測試條件

Relative Humidity / 相對濕度: Temperature / 温度 :  $(23 \pm 2)^{\circ}C$ 

Line Voltage / 電壓 :

TEST SPECIFICATIONS / 測試規範

Calibration check

DATE OF TEST / 測試日期 : 11 April 2015

TEST RESULTS / 測試結果

The results apply to the particular unit-under-test only.

All results are within manufacturer's specification.

The results are detailed in the subsequent page(s).

The test equipment used for calibration are traceable to National Standards via:

- The Government of The Hong Kong Special Administrative Region Standard & Calibration Laboratory
- Agilent Technologies / Keysight Technologies
- Rohde & Schwarz Laboratory, Germany
- Fluke Everett Service Center, USA

Tested By 測試

K C/Lee

Certified By

核證

Project Engineer

Engineer

Date of Issue 簽發日期 KM WII

14 April 2015

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory



#### Sun Creation Engineering Limited

Calibration and Testing Laboratory

### Certificate of Calibration 校正證書

Certificate No.: C151969

證書編號

1. The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 12 hours, and switched on to warm up for over 10 minutes before the commencement of the test.

Self-calibration using laboratory acoustic calibrator was performed before the test from 6.1.1.2 to 6.4. 2.

The results presented are the mean of 3 measurements at each calibration point. 3.

4. Test equipment:

Equipment ID

Description

Certificate No.

CL280 CL281 40 MHz Arbitrary Waveform Generator Multifunction Acoustic Calibrator

C150014 DC130171

Test procedure: MA101N. 5.

6. Results:

6.1 Sound Pressure Level

Reference Sound Pressure Level 6.1.1

6.1.1.1 Before Self-calibration

	UUT	Setting		Applied	d Value	UUT	
Range (dB)	Parameter	Frequency Weighting	Time Weighting	Level (dB)	Freq. (kHz)	Reading (dB)	
50 - 130	LAFP	A	F	94.00	1	94.3	

6.1.1.2 After Self-calibration

UUT Setting				Applie	d Value	UUT	IEC 60651
Range (dB)	Parameter	Frequency Weighting	Time Weighting	Level (dB)	Freq. (kHz)	Reading (dB)	Type 1 Spec. (dB)
50 - 130	LAFP	A	F	94.00	1	94.1	$\pm 0.7$

6.1.2 Linearity

	UU	Γ Setting		d Value	UUT	
Range (dB)	Parameter	Frequency Weighting	Time Weighting	Level (dB)	Freq. (kHz)	Reading (dB)
50 - 130	L <sub>AFP</sub>	A	F	94.00	1	94.1 (Ref.)
	5.14.0	4		104.00		104.0
				114.00		114.0

IEC 60651 Type 1 Spec. :  $\pm$  0.4 dB per 10 dB step and  $\pm$  0.7 dB for overall different.

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory



#### Sun Creation Engineering Limited

Calibration and Testing Laboratory

## Certificate of Calibration

校正證書

Certificate No.: C151969

證書編號

6.2 Time Weighting

6.2.1 Continuous Signal

	UUT Setting				d Value	UUT	IEC 60651	
Range (dB)	Parameter	Frequency Weighting	Time Weighting	Level (dB)	Freq. (kHz)	Reading (dB)	Type 1 Spec (dB)	
50 - 130	L <sub>AFP</sub>	A	F	94.00	1	94.1	Ref.	
	L <sub>ASP</sub>		S			94.1	± 0.1	
	L <sub>AIP</sub>		1			94.1	± 0.1	

6.2.2 Tone Burst Signal (2 kHz)

	UUT	Setting		App	lied Value	UUT	IEC 60651
Range (dB)	Parameter	Frequency Weighting	Time Weighting	Level (dB)	Burst Duration	Reading (dB)	Type 1 Spec. (dB)
30 - 110	L <sub>AFP</sub>	A	F	106.0	Continuous	106.0	Ref.
	L <sub>AFMax</sub>				200 ms	104.9	$-1.0 \pm 1.0$
	L <sub>ASP</sub>		S		Continuous	106.0	Ref.
	L <sub>ASMax</sub>				500 ms	101.9	$-4.1 \pm 1.0$

#### 6.3 Frequency Weighting

6.3.1 A-Weighting

	UUT	Setting		Appli	ed Value	UUT	IEC 60651
Range (dB)	Parameter	Frequency Weighting	Time Weighting	Level (dB)	Freq.	Reading (dB)	Type 1 Spec. (dB)
50 - 130	LAFP	A	F	94.00	31.5 Hz	55.1	-39.4 ± 1.5
	,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,			63 Hz		68.0	-26.2 ± 1.5
			125 Hz	77.9	$-16.1 \pm 1.0$		
				250 Hz	85.4	$-8.6 \pm 1.0$	
				500 Hz	90.8	$-3.2 \pm 1.0$	
					1 kHz	94.1	Ref.
					2 kHz	95.3	$+1.2 \pm 1.0$
					4 kHz	95.1	$+1.0 \pm 1.0$
				8 kHz	93.0	-1.1 (+1.5; -3.0)	
					12.5 kHz	89.9	-4.3 (+3.0; -6.0)

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory. 本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書面批准。



Sun Creation Engineering Limited

Calibration and Testing Laboratory

## Certificate of Calibration

Certificate No.: C151969

證書編號

C-Weighting 6.3.2

	UUT	Setting		Appli	ed Value	UUT	IEC 60651
Range (dB)	Parameter	Frequency Weighting	Time Weighting	Level (dB)	Freq.	Reading (dB)	Type 1 Spec. (dB)
50 - 130	$L_{CFP}$	C	F	94.00	31.5 Hz	91.4	$-3.0 \pm 1.5$
					63 Hz	93.4	$-0.8 \pm 1.5$
				125 Hz	93.9	$-0.2 \pm 1.0$	
					250 Hz	94.1	$0.0 \pm 1.0$
					500 Hz	94.1	$0.0 \pm 1.0$
					1 kHz	94.1	Ref.
					2 kHz	93.9	$-0.2 \pm 1.0$
					4 kHz	93.3	$-0.8 \pm 1.0$
					8 kHz	91.1	-3.0 (+1.5; -3.0
					12.5 kHz	88.0	-6.2 (+3.0 ; -6.0

6.4 Time Averaging

	UUT	[ Setting			A	oplied Valu	e		UUT	IEC 60804
Range (dB)	Parameter	Frequency Weighting	Integrating Time	Frequency (kHz)	Burst Duration (ms)	Burst Duty Factor	Burst Level (dB)	Equivalent Level (dB)	Reading (dB)	Type 1 Spec. (dB)
30 - 110	LAcq	A	10 sec.	4	1	1/10	110.0	100	100.0	± 0.5
						1/10 <sup>2</sup>		90	90.1	± 0,5
			60 sec.			1/103		80	79.4	± 1.0
			5 min.			1/104		70	69.2	± 1.0

Remarks: - UUT Microphone Model No.: 4188 & S/N: 2812705

- Mfr's Spec. : IEC 60651 Type 1 & IEC 60804 Type 1

94 dB : 31.5 Hz - 125 Hz :  $\pm$  0.35 dB - Uncertainties of Applied Value:

250 Hz - 500 Hz : ± 0.30 dB 1 kHz  $: \pm 0.20 \text{ dB}$ 2 kHz - 4 kHz : ± 0.35 dB 8 kHz : ± 0.45 dB  $: \pm 0.70 \text{ dB}$ 12.5 kHz

104 dB: 1 kHz  $: \pm 0.10 \text{ dB (Ref. 94 dB)}$ 114 dB: 1 kHz : ± 0.10 dB (Ref. 94 dB) Burst equivalent level : ± 0.2 dB (Ref. 110 dB

continuous sound level)

The values given in this Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environment changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Sun Creation Engineering Limited shall not be liable for any loss or damage resulting from the use of the equipment.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書儒先獲本實驗所書面批准。

Sun Creation Engineering Limited - Calibration & Testing Laboratory

c/o 4/F, Tsing Shan Wan Exchange Building, 1 Hing On Lane, Tuen Mun, New Territories, Hong Kong 解創工程有限公司 —校正及檢測實驗所

c/o 香港新界屯門興安里一號青山灣機樓四樓 Tel/電話: 2927 2606 Fax/傳真: 2744 8986

E-mail/電郵: callab@suncreation.com Website/網址: www.suncreation.com

<sup>-</sup> The uncertainties are for a confidence probability of not less than 95 %.

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.



#### Sun Creation Engineering Limited

Calibration and Testing Laboratory

# Certificate of Calibration

校正證書

Certificate No.: C151967

證書編號

ITEM TESTED / 送檢項目 (Job No. / 序引編號: IC15-0720)

Date of Receipt / 收件日期: 24 March 2015

Description / 儀器名稱 Sound Level Calibrator (EQ084) Manufacturer / 製造商

Cesva

Model No. / 型號

CB-5

Serial No. / 編號

030023

Supplied By / 委託者

Action-United Environmental Services and Consulting

Unit A, 20/F., Gold King Industrial Building, 35-41 Tai Lin Pai Road, Kwai Chung, N.T.

TEST CONDITIONS / 測試條件

Temperature / 温度 : (23 ± 2)°C

Relative Humidity / 相對濕度 : (55 ± 20)%

Line Voltage / 電壓 :

TEST SPECIFICATIONS / 測試規範

Calibration

DATE OF TEST / 測試日期 : 11 April 2015

TEST RESULTS / 測試結果

The results apply to the particular unit-under-test only.

All results are within manufacturer's specification. (after adjustment)

The results are detailed in the subsequent page(s).

The test equipment used for calibration are traceable to National Standards via:

- The Government of The Hong Kong Special Administrative Region Standard & Calibration Laboratory
- Agilent Technologies / Keysight Technologies
- Rohde & Schwarz Laboratory, Germany
- Fluke Everett Service Center, USA

Tested By 測試

K C Lee Project Engineer

Certified By 核證

K M Wu Engineer Date of Issue 簽發日期

14 April 2015

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory



#### Sun Creation Engineering Limited

Calibration and Testing Laboratory

## Certificate of Calibration 校正證書

Certificate No.: C151967

證書編號

- 1. The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 12 hours before the commencement of the test.
- 2. The results presented are the mean of 3 measurements at each calibration point.
- 3. Test equipment:

Equipment ID CL130 CL281 TST150A

Description Universal Counter Multifunction Acoustic Calibrator Measuring Amplifier

Certificate No. C143868 DC130171 C141558

- 4. Test procedure: MA100N.
- 5. Results:
- 5.1 Sound Level Accuracy

5.1.1 Before Adjustment

UUT Nominal Value	Measured Value (dB)	Mfr's Spec.	Uncertainty of Measured Value (dB)
94 dB, 1 kHz	* 94.4	± 0.3	± 0.2
104 dB, 1 kHz	* 104.4		± 0.3

Out of Mfr's Spec.

5.1.2 After Adjustment

UUT Nominal Value	Measured Value (dB)	Mfr's Spec. (dB)	Uncertainty of Measured Value (dB)		
94 dB, 1 kHz	94.0	± 0.3	± 0.2		
104 dB, 1 kHz	104.0		± 0.3		

#### 5.2 Frequency Accuracy

5.2.1 Before Adjustment

UUT Nominal Measured Value Value (kHz) (kHz)		Mfr's Spec.	Uncertainty of Measured Value (Hz)		
1	1,002	1 kHz ± 1.5 %	± 1		

5.2.2 After Adjustment

 itel i idjustilielit			
UUT Nominal	Measured Value	Mfr's	Uncertainty of Measured Value
Value (kHz)	(kHz)	Spec.	(Hz)
1	1.001	1 kHz ± 1.5 %	± 1

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.



Sun Creation Engineering Limited

Calibration and Testing Laboratory

## Certificate of Calibration 校正證書

Certificate No.: C151967

證書編號

Remark: The uncertainties are for a confidence probability of not less than 95 %.

#### Note:

The values given in this Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environment changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Sun Creation Engineering Limited shall not be liable for any loss or damage resulting from the use of the equipment.

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.



### **Appendix E**

**HOKLAS-Accreditation Certificate of the Testing Laboratory** 



### Hong Kong Accreditation Service 香港認可處

### Certificate of Accreditation

認可證書

This is to certify that 特此證明

### ALS TECHNICHEM (HK) PTY LIMITED

11/F., Chung Shun Knitting Centre, 1-3 Wing Yip Street, Kwai Chung, New Territories, Hong Kong 香港新界葵涌永業街1-3號忠信針織中心11樓

has been accepted by the HKAS Executive, on the recommendation of the Accreditation Advisory Board, as a 為香港認可處執行機關根據認可諮詢委員會建議而接受的

### **HOKLAS Accredited Laboratory**

「香港實驗所認可計劃」認可實驗所

This laboratory meets the requirements of ISO / IEC 17025: 2005 - General requirements for the competence 此實驗所符合ISO / IEC 17025: 2005 -《測試及校正實驗所能力的通用規定》所訂的要求, of testing and calibration laboratories and it has been accredited for performing specific tests or calibrations as 獲認可進行載於香港實驗所認可計劃《認可實驗所名冊》內下述測試類別中的指定 listed in the HOKLAS Directory of Accredited Laboratories within the test category of 測試或校正工作

### **Environmental Testing**

環境測試

This laboratory is accredited in accordance with the recognised International Standard ISO / IEC 17025: 2005. 本實驗所乃根據公認的國際標準 ISO / IEC 17025 : 2005 獲得認可。 This accreditation demonstrates technical competence for a defined scope and the operation of a laboratory 這項認可資格演示在指定範疇所需的技術能力及實驗所質量管理體系的運作 quality management system (see joint IAF-ILAC-ISO Communiqué). (見國際認可論壇‧國際實驗所認可合作組織及國際標準化組織的聯合公報)。

The common seal of the Hong Kong Accreditation Service is affixed hereto by the authority of the HKAS Executive 香港認可處根據認可處執行機關的權限在此蓋上通用印章

CHAN Sing Sing, Terence, Executive Administrator

執行幹事 陳成城 Issue Date: 5 May 2009

簽發日期:二零零九年五月五日

Registration Number : HOKLAS 066

註冊號碼:



Date of First Registration: 15 September 1995 首次註冊日期:一九九五年九月十五日



### Appendix F

**Event and Action Plan** 



### **Event and Action Plan for Construction Noise**

Enant		Action		
Event	ET	Contractor		
Action Level	1. Notify IEC and Contractor.  2. Carry out investigation.  3. Report the results of investigation to the IEC and Contractor.  4. Discuss with the Contractor and formulate remedial measures  5. Increase monitoring frequency to check mitigation effectiveness.	1. Review the analyzed result submitted by ET.  2. Review the proposed remedial measures by the Contractor and advise the ER accordingly.  3. Supervise the implementation of remedial measures.	1. Confirm receipt of notification of exceedance 2. Notify Contractor 3. Require Contractor to propose remedial measures for the analyzed noise problem 4. Ensure remedial measures are properly implemented.	Submit noise mitigation proposals to IEC     Implement noise mitigation proposals
Limit Level	1. Notify IEC, ER, EPD and Contractor, and follow other actions  2. Identify source  3. Repeat measurement to confirm findings  4. Increase monitoring frequency  5. Check Contractor's working procedures to determine possible mitigation to be implemented  6. Inform IEC, ER and EPD the causes and actions taken for the exceedances  7. Assess effectiveness of Contractor's remedial actions and keep IEC, EPD, ER informed of the results  8. If exceedance stops, cease additional monitoring	1. Discuss amongst ER, ET and Contractor on the potential remedial actions 2. Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ET accordingly 3. Supervise the implementation of remedial measures	1. Confirm receipt of notification of exceedances  2. Notify Contractor  3. Require Contractor to propose remedial measures  4. Ensure remedial measures are properly implemented  5. If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated.	1. Take immediate action to avoid further exceedance  2. Submit proposals for remedial actions to IEC within 3 working days of notifications  3. Implement the agreed proposals  4. Revise and resubmit proposals if problem still not under control  5. Stop the relevant portion of works as determined by the ER until the exceedance is abated



### **Event and Action Plan for Air Quality**

Event	Action									
	ET	IEC	ER	Contractor						
Action Level			T	T						
Exceedance for one sample	1. Identify source;     2. If valid, inform IEC and ER;     3. Repeat measurement to confirm finding;     4. Increase monitoring frequency to daily	Check monitoring data submitted by ET;     Check Contractor's working method.	1. Notify Contractor	1. Rectify any     unacceptable     practice;     2. Amend working     methods if     appropriate						
Exceedance for two or more consecutive samples	1. Identify source; 2. Inform IEC and EPD; 3. Repeat measurements to 1. confirm findings; 4. Increase monitoring frequency to daily; 5. Discuss with IEC and Contractor on remedial action required; 6. If exceedance continues, arrange meeting with IEC and ER; 7. If exceedance stops, cease additional monitoring.	1. Check monitoring data submitted by ET; 2. Check Contractor's working method; 3. Discuss with ET and Contractor on possible remedial measures; 4. Advise the ER on the effectiveness of the proposed remedial measures; 5. Supervisor implementation of remedial measures.	1. Confirm receipt of notification of failure in writing;     2. Notify Contractor;     3. Ensure remedial Measure properly implemented.	1. Submit proposals for remedial action to IEC within 3 working days of notification; 2. Implement the agreed proposals; 3. Amend proposal if appropriate.						
Limit Level										
Exceedance for one sample	1. Identify source; 2. Inform ER and EPD; 3. Repeat measurement to confirm finding; 4. Increase monitoring frequency to daily; 5. Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results.	1. Check monitoring data submitted by ET; 2. Check Contractor's working method; 3. Discuss with ET and the Contractor on possible remedial measures; 4. Advise the ER on the effectiveness of the proposed remedial measures; 5. Supervise implementation of remedial measures.	1. Confirm receipt of notification of failure in writing;     2. Notify Contractor;     3. Ensure remedial measures properly implemented.	1. Take immediate action to avoid further exceedance; 2. Submit proposals for remedial actions to IEC within 3 working days of notification; 3. Implement the agreed proposals; 4. Amend proposal if appropriate.						
Exceedance for two or more consecutive samples	1. Notify IEC, ER, Contractor and EPD; 2. Identify sources; 3. Repeat measurement to confirm findings; 4. Increase monitoring frequency to daily; 5. Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented; 6. Arrange meeting with IEC and ER to discuss the remedial actions to be taken; 7. Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results; 8. If exceedance stops cease additional monitoring.	1. Discuss amongst ER, ET and Contractor on the potential remedial actions;  2. Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ET accordingly.  3. Supervise the implementation of remedial measures.	1. Confirm receipt of notification of failure in writing; 2. Notify Contractor; 3. In consultation with IEC, agree with the Contractor on the remedial measures to be implemented; 4. Ensure remedial measures properly implemented; 5. If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated	1. Take immediate action to avoid further exceedance; 2. Submit proposals for remedial actions to IEC within 3 working days of notification; 3. Implement the agreed proposals; 4. Resubmit proposals if problem still not under control; 5. Stop the relevant portion of works as determined by the ER until the exceedance is abated.						



### Appendix G

**Monitoring Schedule** 



### Monitoring Schedule in the Reporting Period – March 2016

DATE		AIR QUALITY	Noise
		24-HOUR TSP	L <sub>eo</sub> 30min
TUE	1-MAR-16	✓	<u> </u>
WED	2-Mar-16		
THU	3-MAR-16		
Fri	4-MAR-16		
SAT	5-MAR-16		
Sun	6-MAR-16		
Mon	7-MAR-16	✓	
TUE	8-MAR-16		✓
WED	9-MAR-16		
THU	10-MAR-16		
Fri	11-Mar-16		
SAT	12-Mar-16	✓	
Sun	13-MAR-16		
Mon	14-MAR-16		
TUE	15-MAR-16		✓
WED	16-MAR-16		
THU	17-Mar-16		
Fri	18-Mar-16	✓	
SAT	19-MAR-16		
SUN	20-Mar-16		
Mon	21-Mar-16		
TUE	22-Mar-16		✓
WED	23-MAR-16		
THU	24-Mar-16	✓	
Fri	25-MAR-16		
SAT	26-Mar-16		
SUN	27-MAR-16		
Mon	28-Mar-16		
TUE	29-MAR-16		
WED	30-MAR-16	✓	✓
THU	31-MAR-16		

✓	Monitoring Day
	Sunday or Public Holiday

### **Air Quality Monitoring Location**

A1 - balcony at 1/F of Chiu Hin Mansion

#### **Construction Noise Monitoring Location:**

N1 - 2/F floor of Hennessey Building

N2 - balcony at 1/F of Chiu Hin Mansion



### Monitoring Schedule for the Coming Month - April 2016

	DATE	AIR QUALITY	Noise
		24-HOUR TSP	L <sub>eo</sub> 30min
Fri	1-APR-16		•
SAT	2-APR-16		
SUN	3-APR-16		
Mon	4-APR-16		
TUE	5-APR-16	✓	✓
WED	6-APR-16		
THU	7-APR-16		
Fri	8-Apr-16		
SAT	9-APR-16		
SUN	10-Apr-16		
Mon	11-Apr-16	✓	
TUE	12-APR-16		✓
WED	13-APR-16		
THU	14-APR-16		
Fri	15-Apr-16		
SAT	16-APR-16	✓	
SUN	17-Apr-16		
Mon	18-Apr-16		
TUE	19-Apr-16		✓
WED	20-APR-16		
THU	21-Apr-16		
Fri	22-Apr-16	✓	
SAT	23-APR-16		
SUN	24-Apr-16		
Mon	25-APR-16		
TUE	26-Apr-16		✓
WED	27-APR-16		
THU	28-APR-16	✓	
FRI	29-APR-16		
SAT	30-APR-16		

✓	Monitoring Day
	Sunday or Public Holiday

#### Remarks:

Designated Location for Impact noise measurement:

- N1 Hennessey Building; and
- N2 Chiu Hin Mansion

Designated Location for Impact air quality monitoring

• A1 Chiu Hin Mansion



### Appendix H

**Database of Monitoring Results** 



### **Result of 24-hour TSP Monitoring**

Location: A	Location: A1 (balcony at 1/F of Chiu Hin Mansion)														
Date	Sample Number	Elapsed Time			Chart Reading		Ave.	Standard			Filter Weight (g)		Weight	Dust 24-hour	
		Initial	Final	Actual (min)	Min	Max	Ave	Temp. (°C)	Ave. Press. (hPa)	Flow Rate (m³/min)	Air Volume (std m <sup>3</sup> )	Initial	Final	Dust Collected (g)	TSP in Air (μg/m³)
1-Mar-16	29172	17580.06	17604.13	1444.20	39	40	39.5	17	1018.4	1.33	1926	2.8982	3.0467	0.1485	77
7- Mar-16	29050	17604.13	17628.20	1444.20	39	41	40.0	17.9	1018	1.35	1946	2.8802	3.0810	0.2008	103
12-Mar-16	29174	17628.20	17652.26	1443.60	36	39	37.5	19.6	1015.4	1.26	1825	2.8790	3.0167	0.1377	76
18-Mar-16	29242	17652.26	17676.34	1444.80	35	39	37.0	19.7	1014.9	1.25	1803	2.9041	3.0830	0.1789	100
24-Mar-16	29207	17676.34	17700.57	1453.80	39	40	39.5	15.3	1020.2	1.34	1946	2.8951	3.2111	0.3160	162
30-Mar-16	29388	17700.57	17724.70	1447.80	39	39	39.0	20	1018.3	1.31	1899	2.8716	2.9674	0.0958	51




### Appendix I


**Graphical Plots** 




#### Air Quality

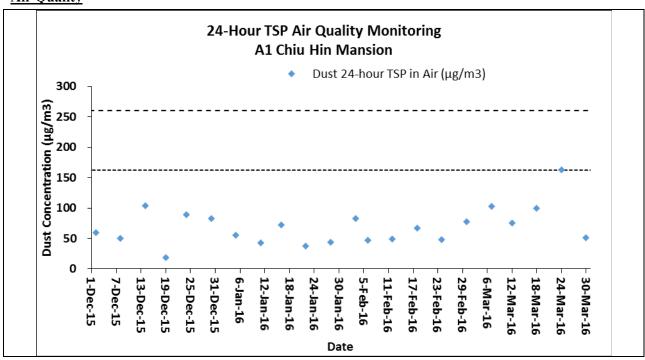

#### **Construction Noise**

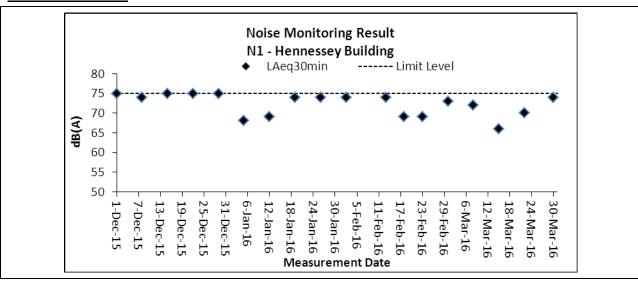

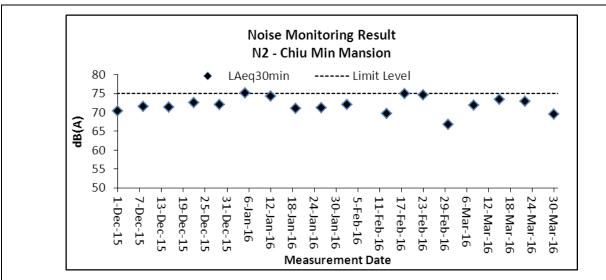



### Appendix J

**Meteorological Information** 



Meteorological Data downloaded from HKO in the Reporting Period									
						Park Station			
Date	•	Weather Rainfall Mean Air Wind Speed Mean Relative					Wind		
			(mm)	Temp.	Speed (km/h)	Humidity (%)			
1-Mar-16	Tue	Mainly fine. Moderate easterly winds.	0	17.6	11.9	67.5	E/NE		
2-Mar-16	Wed	Mainly fine. Moderate easterly winds.	0	17.8	12.2	51.3	E/NE		
	TI	Fine. Dry in the afternoon. Light to	0	16.0					
3-Mar-16	Thu	moderate easterly winds.	0	16.9	13.3	80.5	E/NW		
4-Mar-16	Fri	Mainly cloudy. Sunny intervals during the day. Light to moderate easterly winds.	0	19.3	8.7	86.6	E/N		
5-Mar-16	Sat	Mainly cloudy with a few fog and light rain patches.	Trace	21.1	7.3	85	E/N		
6-Mar-16	Sun	Mainly cloudy with a few fog and light rain patches.	0	21	9.7	84	W/SW		
7-Mar-16	Mon	Mainly cloudy with a few fog and light rain patches.	0.2	20.6	8.9	85.5	SE		
8-Mar-16	Tue	Fresh northerly winds, occasionally strong offshore and on high ground at first.	0	21.8	16.2	82.2	SE		
9-Mar-16	Wed	Mainly cloudy with a few fog and light rain patches.	15.5	21	12	91.0	SE		
10-Mar-16	Thu	Mainly cloudy with a few fog and light rain patches.	16.8	13.4	21.0	94	N/NW		
11-Mar-16	Fri	Moderate to fresh easterly winds	0.1	10.5	15.2	77	N		
12-Mar-16	Sat	Cloudy to overcast with occasional rain	0.1	12.3	11.1	88	Е		
13-Mar-16	Sun	Mainly fine. Moderate easterly winds.	6.8	16.5	4	97.5	N/NW		
14-Mar-16	Mon	Fine. Dry in the afternoon. Light to moderate easterly winds.	0.8	14.5	20	85.5	N		
15-Mar-16	Tue	Mainly cloudy. Sunny intervals during the day. Light to moderate easterly winds.	Trace	14.1	11.7	83	E/NE		
16-Mar-16	Wed	Moderate to fresh easterly winds	1.1	14.4	9.7	88	E/NE		
17-Mar-16	Thu	Cloudy to overcast with occasional rain	2.2	17.8	13.4	92.5	E/NE		
18-Mar-16	Fri	Fine. Dry in the afternoon. Light to moderate easterly winds.	Trace	21.7	16	89	SE		
19-Mar-16	Sat	Mainly cloudy with a few fog and light rain patches.	Trace	23.1	8.3	93	Е		
20-Mar-16	Sun	Moderate to fresh easterly winds	0.3	21.7	23.2	82.5	E/SE		
21-Mar-16	Mon	Moderate to fresh easterly winds	59.6	18.6	19.2	92.5	E/NE		
22-Mar-16	Tue	Cloudy to overcast with occasional rain	1.7	18.1	18	92	E/NE		
23-Mar-16	Wed	Cloudy to overcast with occasional rain	8.7	19.3	14.5	96.2	E/NE		
24-Mar-16	Thu	Cloudy to overcast with occasional rain	33.4	15.6	15.6	95.2	E/NE		
25-Mar-16	Fri	Moderate to fresh easterly winds	1.4	13.7	11.5	76	N/NW		
26-Mar-16	Sat	Moderate to fresh easterly winds	0	15.3	11.3	67	SE		
27-Mar-16	Sun	Moderate to fresh easterly winds	0	17.1	11.7	58	SE		
28-Mar-16	Mon	Mainly cloudy with coastal fog.	0	17.2	10.8	54.5	E/NE		
29-Mar-16	Tue	Light to moderate southeasterly winds.	Trace	17.8	10.2	60.5	E/NE		
30-Mar-16	Wed	Light to moderate southeasterly winds.	Trace	19.9	12.3	78.7	SW		
31-Mar-16	Thu	Mainly cloudy with coastal fog.	0	21.3	9.5	84.5	SW		



### Appendix K

**Monthly Summary Waste Flow Table** 

### Wan Chai Station Lee Tung Street Subway- C6593-13C

### Monthly Summary Waste Flow Table for 2016

Name of Employer: MTR Corporation Limited							Contract No.: C65931-13C								
		Actual Quantities of Inert C&D Materials Generated Monthly							Actual Quantities of Non-Inert C&D Wastes Generated Monthly						
Month	Total Quantity	Broken Concrete	Building Debris	Mixed Rock & Soil	Bentonite	Rubbish	Slurry	Rock	Soil	Reused in this Project	Metals	Paper/ cardboard	Plastics	Chemical Waste	Others, e.g. general
	(in m³)	(in m³)	(in m <sup>3</sup> )	(in m³)	(in m <sup>3</sup> )	(in m <sup>3</sup> )	(in m <sup>3</sup> )	(in m³)	(in m³)	(in m³)	(in m <sup>3</sup> )	(in m³)	(in m <sup>3</sup> )	(in m3/ Litre)	(in m³)
Jan	0.01559	0	0	0	0	0	0	0	0.01559	0	0	0	0	0	0.001
Feb	0.007	0	0	0	0	0	0	0	0	0	0	0	0	0	0.007
Mar	0.03685	0	0	0	0	0	0	0	0.03685	0	0	0	0	0	0.001
Apr	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
May	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
Jun	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
Jul	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
Aug	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
Sep	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
Oct	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
Nov	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
Dec	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
Total	0.05944	0	0	0	0	0	0	0	0.05244	0	0	0	0	0	0.009



### **Appendix** L

Implementation Schedule for Environmental Mitigation Measures (ISEMM)



Project Profile Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Parties	Location of the measure	When to implement the measure	Relevant requirements or standards for the measure to achieve
NOISE IM	IPACT					
S.5.1.1	Use of quieter plant	To minimize construction noise emissions	Contractor	Work site	Construction Stage	ProPECC PN2/93 and Noise Control Ordinance
S.5.1.1	Use of noise enclosure and movable barrier	To minimize	Contractor	Work site	Construction	ProPECC PN2/93,
	• movable barrier can achieve a 5 dB(A) reduction for movable PME and 10 dB(A) reduction for stationary PME;	construction noise emissions			Stage	Noise Control Ordinance and EIAO Guidance
	• noise enclosure can achieve 15dB(A) reduction for PME;			1		Note NO. 9/2010
	<ul> <li>noise enclosure is proposed to be built after open excavation in order to minimize the noise impact due to further excavation work and construction of subway. The enclosure should either be provided with acoustic door for access purpose which should be kept closed during the construction works or should be designed with no direct line of sight from the open side to the NSRs;</li> </ul>					
	• A typical design barrier with a steel frame of vertical / cantilever type would be adopted and located close to the noise generating part of PME;					
	• Barrier material of surface mass in excess of 7kg/m² shall be required to achieve the maximum screening effect (and minimum 10kg/m² for noise enclosure);					
	• The length of barrier should generally be at least five times greater than its height and the minimum height of a barrier should be such that no part of the noise source will be visible from the noise sensitive receiver being protected.					
S.5.1.1	General Construction Noise Control Measures	To minimize	Contractor	Work site	Construction	ProPECC PN2/93
	• The Code of Practice on Good Management Practice to Prevent Violation of the Noise Control Ordinance (Chapter 400) (for Construction Industry) published by EPD shall be adopted;	construction noise emissions			Stage	and Noise Control Ordinance
	• The statutory and non-statutory requirements and guidelines shall be complied with;					
	• Approval for the method of working, equipment and noise mitigation measures intended to be used at the site shall be granted from the Project Engineer before commencing any work;					



Project Profile Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Parties	Location of the measure	When to implement the measure	Relevant requirements or standards for the measure to achieve
	Working methods to minimize the noise impact on the surrounding NSRs shall be formulated and executed, and the implementation of these methods shall be monitored by experienced personnel with suitable training;					
	Noisy equipment and noisy activities shall be located as far away from the NSRs as is practical;					
	Unused equipment shall be turned off;					
	PME should be kept to a minimum and the parallel use of noisy equipment / machinery should be avoided;					
	All plant and equipment shall be maintained regularly; and					
	Material stockpiles and other structures shall be effectively utilized as noise barriers, whenever practicable.					
AIR QUAL	ITY IMPACT					
S.5.1.2	<b>Construction Dust Control Measures</b>	To minimize the dust	Contractor	Work site	Construction	Air Pollution
	• Regular watering to reduce dust emissions from all exposed site surface, particularly during dry weather;	impacts arising from the construction works			Stage	Control (Construction Dust) Regulation
	• Frequent watering for particularly dusty construction areas and areas close to air sensitive receivers;					Ü
	• Covering of stockpile of excavated dusty materials, if any, with impervious sheeting or spraying with water to maintain the entire surface wet;					
	Provision of vehicle washing facilities at the entry and exit points of site;					
	• Tarpaulin covering of any dusty materials being transported to and from site by vehicle;					
	Positioning of construction plant at maximum practicable distance from air sensitive receivers; and					
	Due to the small size of the works sites and lack of space for stockpiling, excavated materials should be hauled off-site almost immediately. However, in the event of any stockpiled excavated materials, they should be covered with tarpaulin and be removed offsite as soon as practicable to avoid any dust nuisance arising					



Project Profile Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Parties	Location of the measure	When to implement the measure	Relevant requirements or standards for the measure to achieve
WATER Q	UALITY IMPACT					
S.5.1.3	Construction Water Quality Impact Measures	To reduce water	Contractor	Work site	Construction	ProPECC PN1/94;
	Collection of wastewater into a sedimentation tank for treatment before discharge into the public drainage system;	quality impact induced by the construction work			Stage	Water Pollution Control Ordinance
	• Provision of silt trap and oil interceptor to remove the oil, lubricants, grease, silt, grit and debris from the wastewater prior to discharge to the public stormwater system. The silt traps and oil interceptors should be cleaned and maintained regularly;					
	Installation of wheel washing facilities to minimize muddy runoff;					
	Regular maintenance and inspection of drainage systems and erosion control and silt removal facilities;					
	Management and monitoring of sewage treatment facilities (if any);					
	• Any foul effluent should not be discharged into any public sewer and stormwater drain, unless an effluent discharge permit is obtained under the WPCO by the Contractor;					
	Coverage of stockpiles of C&D materials (if any) during rainstorms; and					
	• Site toilet facilities, if needed, should be chemical toilets or should have the sewage discharge directed to a foul sewer.					
WASTE M	ANAGEMENT					
S.5.1.4	Construction Waste Management Measures	To adopt waste	Contractor	Work site	Construction	Waste Disposal
	Scrap metals or abandoned equipment should be recycled if possible;	management measures in the way of avoiding, minimizing, reusing and recycling so as to reduce waste generation			Stage	Ordinance (Cap. 354); Waste Disposal (Chemical Waste) (General) Regulation; DEVB TCW No. 6/2010; ETWB TCW No. 19/2005.
	Waste arising should be kept to a minimum and be handled, transported and disposed of in a suitable manner;					
	The Contractor should adopt a trip ticket system for the disposal of C&D materials to any designated public filling facility and/or landfill. Independent audits of the Contractor and resident site staff will be undertaken to ensure that the correct procedures are being followed;					
	Chemical waste shall be handled in accordance with the Code of Practice on the Packaging, Handling and Storage of Chemical Wastes; and					



Project Profile Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Parties	Location of the measure	When to implement the measure	Relevant requirements or standards for the measure to achieve
	<ul> <li>All general refuse should be segregated and stored in enclosed bins or compaction units and waste separation facilities for paper, aluminum cans, plastic bottles etc. should be provided to facilitate reuse or recycling of materials and their proper disposal.</li> </ul>					
LANDSCA	PE AND VISUAL IMPACT					
S.5.1.5	Landscape and Visual Measures     Clear demarcation of works area to prevent damages to existing trees in close proximity;	To reduce landscape and visual impact by construction works.	Contractor	Work Site and nearby playground	Construction Stage	EIAO; ETWB TCW No. 3/2006.
	<ul> <li>Protection of all trees planned to be retained onsite;</li> <li>Preserving all affected trees by transplanting where practical. Tree transplanting application and tree removal application shall be submitted for approval in accordance with ETWB TCW 3/2006; and</li> <li>Screening of construction works by hoardings/noise barriers around Works area in visually unobtrusive colors.</li> </ul>					