#### MONTHLY EM&A REPORT

OSCAR Bioenergy Joint Venture

Contract No. EP/SP/61/10 Organic Resources Recovery Centre (Phase 1): *Eighty-sixth Monthly EM&A Report* 

1 July 2022 - 31 July 2022

**Environmental Resources Management** 

2509, 25/F, One Harbourfront, 18 Tak Fung Street, Hunghom, Kowloon, Hong Kong Telephone: (852) 2271 3000 Facsimile: (852) 3015 8052 E-mail: post.hk@erm.com http://www.erm.com Meinhardt Infrastructure and Environment Limited

# Organic Resources Recovery Centre, Phase I

# Monthly EM&A Report (1 July 2022 – 31 July 2022)

(August 2022)

Verified by:	Claudine Lee
Position:	Independent Environmental Checker
Date:	15 <sup>th</sup> August 2022

#### MONTHLY EM&A REPORT

OSCAR Bioenergy Joint Venture

## Contract No. EP/SP/61/10 Organic Resources Recovery Centre (Phase 1): *Eighty-sixth Monthly EM&A Report*

1 July 2022 - 31 July 2022

Reference 0279222

For and on beh	alf of ERM-Hong Kong, Limited
Approved by:	Frank Wan
c: 1	Warch-HJ.
Signed:	7
Position:	Partner
Certified by:	Mously 20 _ onmental Team Leader – Mandy To)
Date:	9 August 2022

#### EXECUTIVE SUMMARY

1	INTRODUCTION	1
1.1	Purpose of the Report	1
1.2	Structure of the Report	1
2	PROJECT INFORMATION	3
2.1	BACKGROUND	3
2.2	General Site Description	4
2.3	Major Activities Undertaken	4
2.4	PROJECT ORGANISATION AND MANAGEMENT STRUCTURE	4
2.5	STATUS OF ENVIRONMENTAL APPROVAL DOCUMENTS	4
3	ENVIRONMENTAL MONITORING AND AUDIT REQUIREMENTS	6
3.1	Environmental Monitoring	6
3.1.1	Air Quality	6
3.1.2	Odour	8
3.2	SITE AUDIT	10
3.2.1	Water Quality	11
3.2.2	Landscape and Visual	12
4	MONITORING RESULTS	13
4.1	Air Quality	13
4.1.1	$\widetilde{Operation}$ Phase Monitoring	13
4.2	Odour	16
4.2.1	Operation Phase Monitoring	16
4.3	WATER QUALITY	16
4.3.1	Operation Phase Monitoring	16
4.4	WASTE MANAGEMENT	17
4.4.1	Operation Phase Monitoring	17
5	SITE AUDIT	19
5.1	Environmental Site Audit	19
5.1.1	Operation Phase	19
5.2	LANDSCAPE AND VISUAL AUDIT	19
6	ENVIRONMENTAL NON-CONFORMANCE AND DEFICIENCIES	20
6.1	SUMMARY OF ENVIRONMENTAL NON-COMPLIANCE AND DEFICIENCIES	20
6.2	SUMMARY OF ENVIRONMENTAL COMPLAINT	20
6.3	SUMMARY OF ENVIRONMENTAL SUMMON AND SUCCESSFUL PROSECUTION	20
7	FUTURE KEY ISSUES	21
7.1	Key Issues for the Coming Month	21

#### LIST OF TABLES

- TABLE 2.1
   SUMMARY OF ACTIVITIES UNDERTAKEN IN THE REPORTING PERIOD
- TABLE 2.2
   Summary of Environmental Licensing, Notification and Permit Status
- TABLE 3.1
   SAMPLING AND LABORATORY ANALYSIS METHODOLOGY
- TABLE 3.2EMISSION LIMIT FOR CAPCS STACK
- TABLE 3.3EMISSION LIMIT FOR CHP STACK
- TABLE 3.4Emission Limit for ASP Stack
- TABLE 3.5Emission Limit for Standby Flaring Gas Unit ()
- TABLE 3.6ODOUR INTENSITY LEVEL
- TABLE 3.7
   ACTION AND LIMIT LEVELS FOR ODOUR NUISANCE
- TABLE 3.8EVENT AND ACTION PLAN FOR ODOUR MONITORING
- TABLE 3.9Discharge Limits for Effluent from the Outlet Chamber of theEffluent Storage Tank
- TABLE 3.10
   Discharge Limits for Effluent from the Petrol Interceptors
- TABLE 4.1HOURLY AVERAGE OF PARAMETERS RECORDED FOR CAPCS
- TABLE 4.2
   HOURLY AVERAGE OF PARAMETERS RECORDED FOR CHP1
- TABLE 4.3
   HOURLY AVERAGE OF PARAMETERS RECORDED FOR CHP2
- TABLE 4.4HOURLY AVERAGE OF PARAMETERS RECORDED FOR CHP3
- TABLE 4.5HOURLY AVERAGE OF PARAMETERS RECORDED FOR ASP
- TABLE 4.6
   Results of the Discharge Sample from the Outlet Chamber of the

   Effection Act Tank

**EFFLUENT STORAGE TANK** 

- TABLE 4.7Results of the Discharge Sample from the Petrol Interceptor 1
- TABLE 4.8Results of the Discharge Sample from the Petrol Interceptor 2
- TABLE 4.9
   QUANTITIES OF WASTE GENERATED FROM THE OPERATION OF THE PROJECT
- TABLE 8.1EXCEEDANCES FOR STACK EMISSIONS

#### LIST OF ANNEXES

- ANNEXA LOCATION OF PROJECT
- ANNEX B PROJECT ORGANISATION CHART AND CONTACT DETAIL
- ANNEX C IMPLEMENTATION SCHEDULE OF MITIGATION MEASURES
- ANNEX D WASTE FLOW TABLE
- ANNEX E ENVIRONMENTAL COMPLAINT, ENVIRONMENTAL SUMMONS AND PROSECUTION LOG
- ANNEX F INVESTIGATION REPORTS
- ANNEX G ODOUR PATROL RESULTS

#### **EXECUTIVE SUMMARY**

The construction works of *No. EP/SP/61/10 Organic Resources Recovery Centre Phase 1 (the Project)* commenced on 21 May 2015. This is the 86<sup>th</sup> monthly Environmental Monitoring and Audit (EM&A) report presenting the EM&A works carried out during the period from **1 to 31 July** 2022 in accordance with the EM&A Manual. Substantial completion of the construction works was confirmed on 3 December 2018. In the meantime, the operation phase EM&A programme had commenced in March 2019. Substantial Completion in respect of substantial part of the Works was confirmed on 24 February 2020. The construction phase EM&A programme was completed in the end of February 2020.

#### Summary of Works undertaken during the Reporting Month

Works undertaken in the reporting month included:

- Suspension Buffer Tank (SBT) cleaning and structural maintenance
- Maintenance of ASP, including 1/F & G/F heat exchanger cleaning
- Maintenance of CHP1, including oil and filter change and exhaust gas heat exchanger cleaning;
- Maintenance of CHP2, including catalyst converter replacement and exhaust gas heat exchanger cleaning
- Maintenance of CHP3, including catalyst converter replacement and exhaust gas heat exchanger cleaning

#### **Environmental Monitoring and Audit Progress**

#### Air Quality Monitoring

Non-compliance of emission limits of  $SO_2$  and  $NO_x$  from the CHPs and  $NO_x$ ,  $SO_2$  and  $NH_3$  from ASP were recorded during the reporting period. It should be noted that measurements recorded under abnormal operating conditions, e.g. start up and stopping of stacks, unstable operation, test runs and interference of sensor, are disregarded.

Non-compliance of emission limits of  $SO_2$  from the CHPs occurred due to tripping of the de-sulphurisation system caused by residual sulphur from the exhaust heat exchangers. The exceedances of  $NO_x$  from the CHPs occurred due to system instability caused by prolonged usage of the CHPs. The exceedance of  $NO_x$ ,  $SO_2$  and  $NH_3$  from ASP occurred due to system instability caused by issues in the ASP column and heat exchanger.

Odour Intensity of 2 was recorded in one location during an odour patrol on 6 July 2022. The Contractor has identified the mixing of the scents of garbage and de-odorising agent used for the SBT cleaning undertaken during the odour patrol as the source of the odour.

#### Water Quality

No non-compliance to the effluent discharge limit stipulated in the discharge licence issued by the EPD under the *Water Pollution Control Ordinance* was recorded during this reporting period.

#### Waste Management

Waste generated from the operation of the Project includes chemical waste, waste generated from pre-treatment process and general refuse.

No chemical waste was collected by licenced waste collector from the operation of the Project.

430.89 tonnes of waste generated from pre-treatment process from the operation of the Project was disposed of at landfill. Among the recyclable waste generated from pre-treatment process from the operation of the Project, 4.75 tonnes of metals, 1.12 tonnes of papers/ cardboard packing and 0.00 tonne of plastics were sent to recyclers for recycling during the reporting period.

Around 2.76 tonnes of general refuse from the operation of the Project was disposed of at landfill. Among the recycled general refuse from the operation of the Project, 0.00 tonne of metals, 0.00 tonne of papers/ cardboard packing and 0.00 tonne of plastics were sent to recyclers for recycling during the reporting period.

#### Findings of Environmental Site Audit

A summary of the monitoring activities undertaken in this reporting period is listed below:

Joint Environmental Site Inspections
 1 time

1 monthly joint environmental site inspection was carried out by the representatives of the Contractor and the MT. The IEC was also present at the joint inspections on 29 July 2022. The environmental control/ mitigation measures (related to air quality, water quality, waste (including land contamination prevention), hazard-to-life and landscape and visual) recommended in the approved EIA Report and the EM&A Manual were properly implemented by the Contractor during the reporting month.

## Environmental Exceedance/Non-conformance/Compliant/Summons and Prosecution

Exceedances for the air emission limits for the CHP and ASP stacks were recorded during the reporting period. Odour Intensity of 2 was recorded during the reporting period.

No complaint/ summon/prosecution was received in this reporting period.

#### **Future Key Issues**

Activities to be undertaken in the next reporting month include:

- Operation of the Project; and
- CHP2 overhaul.

#### 1 INTRODUCTION

ERM-Hong Kong, Limited (ERM) was appointed by OSCAR Bioenergy Joint Venture (the Contractor) as the Environmental Team (ET) to undertake the construction Environmental Monitoring and Audit (EM&A) programme for the *Contract No. EP/SP/61/10 of Organic Waste Treatment Facilities Phase I,* which the project name has been updated to *Organic Resources Recovery Centre (Phase I) (the Project)* since November 2017. ERM was also appointed by the Contractor to undertake the operation EM&A programme starting 1 March 2019.

#### 1.1 PURPOSE OF THE REPORT

This is the 86<sup>th</sup> EM&A report which summarises the monitoring results and audit findings for the EM&A programme during the reporting period from **1** to **31 July 2022**.

**1.2** STRUCTURE OF THE REPORT

The structure of the report is as follows:

#### Section 1: Introduction

It details the scope and structure of the report.

#### Section 2: Project Information

It summarises the background and scope of the Project, site description, project organisation and status of the Environmental Permits (EP)/licences.

#### Section 3: Environmental Monitoring and Audit Requirements It summarises the environmental monitoring requirements including monitoring parameters, programmes, methodologies, frequency, locations, Action and Limit Levels, Event/Action Plans, as well as environmental audit requirements as recommended in the EM&A Manual and approved EIA report.

*Section 4: Monitoring Results* It summarises monitoring results of the reporting period.

### *Section 5: Site Audit* It summarises the audit findings of the environmental as well as landscape and visual site audits undertaken within the reporting period.

Section 6: Environmental Non-conformance It summarises any exceedance of environmental performance standard, environmental complaints and summons received within the reporting period.

### Section 7: Further Key Issues It summarises the impact forecast for the next reporting month.

Section 8: Conclusions

#### 2 PROJECT INFORMATION

#### 2.1 BACKGROUND

The Organic Resources Recovery Centre (ORRC) Phase I development (hereinafter referred to as "the Project") is to design, construct and operate a biological treatment facility with a capacity of about 200 tonnes per day and convert source-separated organic waste from commercial and industrial sectors (mostly food waste) into compost and biogas through proven biological treatment technologies. The location of the Project site is shown in *Annex A*.

The environmental acceptability of the construction and operation of the Project had been confirmed by findings of the associated Environmental Impact Assessment (EIA) Study completed in 2009. The Director of Environmental Protection (DEP) approved this EIA Report under the *Environmental Impact Assessment Ordinance* (EIAO) (Cap. 499) in February 2010 (Register No.: AEIAR-149/2010) (hereafter referred to as the approved EIA Report). Subsequent Report on Re-assessment on Environmental Implications and Report on Re-assessment on Hazard to Life Implications were completed in 2013, respectively.

An Environmental Permit (EP) (No. EP-395/2010) was issued by the DEP to the EPD (Project Team), the Permit Holder, on 21 June 2010 and varied on 18 March 2013 (No. EP-395/2010/A) and 21 May 2013 (No. EP-395/2010/B), respectively. The Design Build and Operate Contract for the ORRC Phase 1 (Contract No. EP/SP/61/10 Organic Resources Recovery Centre (Phase 1) (the Contract)) was awarded to SITA Waste Services Limited, ATAL Engineering Limited and Ros-Roca, Sociedad Anonima jointly trading as the OSCAR Bioenergy Joint Venture (OSCAR or the Contractor). A Further EP (No. FEP-01/395/2010/B) was issued by the DEP to the OSCAR on 16 February 2015. Variation to both EPs (Nos. EP-395/2010/B and FEP-01/395/2010/B) were made in December 2015. The latest EPs, Nos. EP-395/2010/C and FEP-01/395/2010/C, were issued by the DEP on 21 December 2015.

Under the requirements of Condition 5 of the EP (No. FEP-01/395/2010/C), an Environmental Monitoring and Audit (EM&A) programme as set out in the approved EM&A Manual (hereinafter referred to as EM&A Manual) is required to be implemented during the construction and operation of the Project. ERM-Hong Kong, Ltd (ERM) has been appointed by OSCAR as the Environmental Team (ET) for the construction phase EM&A programme and the Monitoring Team (MT) for the operation phase EM&A programme for the implementation of the EM&A programme in accordance with the requirements of the EP and the approved EM&A Manual.

The construction works commenced on 21 May 2015. The construction phase EM&A programme was completed in the end of February 2020. The

operation phase of the EM&A programme commenced on 1 March 2019<sup>(1)</sup>.

#### 2.2 GENERAL SITE DESCRIPTION

The Project Site is located at Siu Ho Wan in North Lantau with an area of about 2 hectares. The layout of the Project Site is illustrated in *Annex A*. The facility received an average of 133 tonnes and treated an average of 151 tonnes of source separated organic waste per day during the reporting month.

#### 2.3 MAJOR ACTIVITIES UNDERTAKEN

A summary of the major activities undertaken in the reporting period is shown in *Table 2.1*.

#### Table 2.1Summary of Activities Undertaken in the Reporting Period

#### Activities Undertaken in the Reporting Period

- Systems being operated waste reception, pre-treatment, CAPCS extraction, the digesters, the centrifuge, the composting tunnels, the de-sulphurisation, the emergency flare, the CHPs, the ASP and the biological waste water treatment plant (133 t/d SSOW received); SBT cleaning and structural maintenance
- Maintenance of ASP, including 1/F & G/F heat exchanger cleaning
- Maintenance of CHP1, including oil and filter change and exhaust gas heat exchanger cleaning;
- Maintenance of CHP2 and CHP3, including catalyst converter replacement and exhaust gas heat exchanger cleaning

#### 2.4 PROJECT ORGANISATION AND MANAGEMENT STRUCTURE

The project organisation chart and contact details are shown in *Annex B*.

#### 2.5 STATUS OF ENVIRONMENTAL APPROVAL DOCUMENTS

A summary of the valid permits, licences, and/or notifications on environmental protection for this Project is presented in *Table 2.2*.

#### Table 2.2Summary of Environmental Licensing, Notification and Permit Status

Permit/Licences/ Notification	Reference	Validity Period	Remarks
Environmental	FEP-01/395/2010/C	Throughout the	Permit granted on 21
Permit		Contract	December 2015
Effluent Discharge	WT00038391-2021	7 July 2021 – 30	Approved on 7 July
Licence		June 2026	2021
Chemical Waste	WPN 5213-961-	Throughout the	Approved on 10
Producer Registration	O2231-02	implementation of	November 2017
		the Project	

 As some of the minor items are yet to be closed out in March 2019, the construction phase EM&A programme and Operation Phase EM&A programme were undertaking in parallel in March 2019.

Permit/Licences/ Notification	Reference	Validity Period	Remarks
Waste Disposal	Account number:	Throughout the	-
Billing Account	702310	Contract	

\_

-

#### 3 ENVIRONMENTAL MONITORING AND AUDIT REQUIREMENTS

#### 3.1 Environmental Monitoring

The air quality (including odour) monitoring to be carried out during the commissioning and operation phase of the Project are described below. Although water quality monitoring is not required for the operation phase under the EM&A programme, there are water quality monitoring requirement under the Water Discharge Licence of the plant under the *Water Pollution Control Ordinance* (WPCO). As part of this EM&A programme, the monitoring results will be reviewed to check the compliance with the WPCO requirements.

#### 3.1.1 Air Quality

According to the EM&A Manual and EP requirements, stack monitoring are required during the commissioning and operation phase of the Project.

On-line monitoring (using continuous environmental monitoring system (CEMS) shall be carried out for the centralised air pollution unit (CAPCS), cogeneration units (CHP) and the ammonia stripping plant (ASP) during the commissioning and operation phase. The last calibration was carried out on July 2022.

The monitoring data is transmitted instantaneously to EPD (Regional Office) by telemetry system.

When the on-line monitoring for certain parameter cannot be undertaken, monitoring will be carried out using the following methodology approved by the EPD.

Parameters	Method	Stacks to be Monitored
Gaseous and vaporous organic	USEPA Method 18	• CAPCS
substances (including methane)		• CHP
		• ASP
Particulate	USEPA Method 5	• CAPCS
		• CHP
		• ASP
Carbon monoxide (CO)	USEPA Method 10	• CHP
		• ASP
Nitrogen oxides (NOx)	USEPA Method 7E	• CHP
		• ASP
Sulphur dioxide (SO2);	USEPA Method 6	• CHP
		• ASP
Hydrogen chloride (HCl)	USEPA Method 26A	• CHP
		• ASP

#### Table 3.1Sampling and Laboratory Analysis Methodology

Parameters	Method	Stacks to be Monitored
Hydrogen fluoride (HF)	USEPA Method 26A	• CHP
		• ASP
Oxygen (O2);	USEPA Method 3A	• CAPCS
		• CHP
		• ASP
Velocity and Volumetric Flow	USEPA Method 2	• CAPCS
		• CHP
		• ASP
Ammonia (NH3)	USEPA CTM 027	• ASP
Odour (including NH3 and H2S)	EN 13725	• CAPCS
Water vapour content (continuous	USEPA Method 4	• CAPCS
measurement of the water vapour		• CHP
content should not be required if the sample exhaust gas is dried before the emissions are analysed)		• ASP
Temperature	USEPA Method 4	• CAPCS
		• CHP
		• ASP

With reference to the EM&A Manual, the air emission of the stacks shall meet the following emission limits as presented in *Tables 3.2* to *3.5*.

Table 3.2Emission Limit for CAPCS Stack

Parameter	Emission Level (mg/Nm <sup>3</sup> ) <sup>(a)</sup>	
VOCs (including methane)	680	
Dust (or Total Suspended Particulates (TSP))	6	
Odour (including NH <sub>3</sub> & H <sub>2</sub> S)	220 <sup>(b)</sup>	
Notes:		
(a) Hourly average concentration		
(b) The odour unit is $OU/Nm^3$		

#### Table 3.3Emission Limit for CHP Stack

Parameter	Maximum Emission Level (mg/Nm <sup>3</sup> ) <sup>(a) (b)</sup>
Dust (or Total Suspended Particulates)	15
Carbon Monoxide	650
NOx	300
SO <sub>2</sub>	50
NMVOCs <sup>(c)</sup>	150
VOCs (including methane) <sup>(d)</sup>	1,500
HCl	10
HF	1

Notes:

(a) All values refer to an oxygen content in the exhaust gas of 6% and dry basis.

(b) Hourly average concentration

(c) NMVOCs should be monitored by gas sampling and laboratory analysis at an agreed interval. For the first 12 months (starting from August 2019), monitoring should be carried out at quarterly intervals. The monitoring frequency should then be reduced to

#### Parameter Maximum Emission Level (mg/Nm<sup>3</sup>) <sup>(a) (b)</sup>

half-yearly for next 12 months (starting from August 2020). The monitoring of NMVOCs ended in August 2021.

(d) The VOCs emission limit include methane as biogas is adopted as fuel in the combustion process.

#### Table 3.4Emission Limit for ASP Stack

Parameter	Maximum Emission Level (mg/Nm $^3$ ) <sup>(a) (b)</sup>	
Dust (or Total Suspended Particulates)	5	
Carbon Monoxide	100	
NOx	200	
SO <sub>2</sub>	50	
VOCs (including methane) (c)	20	
NH3	35	
HCl	10	
HF	1	

(a) All values refer to an oxygen content in the exhaust gas of 11% and dry basis.

(b) Hourly average concentration

(c) The VOCs emission limit include methane as biogas is adopted as fuel in the combustion process.

#### Table 3.5Emission Limit for Standby Flaring Gas Unit (1)

Parameter	Maximum Emission level (mg/Nm <sup>3</sup> ) <sup>(a) (b)</sup>	
Dust (or Total Suspended Particulates)	5	
Carbon Monoxide	100	
NOx	200	
SO <sub>2</sub>	50	
VOCs (including methane) <sup>(c)</sup>	20	
HCl	10	
HF	1	

Notes:

(a) All values refer to an oxygen content in the exhaust gas of 11% and dry basis.

(b) Hourly average concentration

(c) The VOCs emission limit include methane as biogas is adopted as fuel in the combustion process.

#### 3.1.2 *Odour*

To determine the effectiveness of the proposed odour mitigation measures and to ensure that the operation of the ORRC1 will not cause adverse odour impacts, odour monitoring of the CAPCS stack (see *Section 3.1.1*) and odour patrol will be carried out.

Odour patrol shall be conducted by independent trained personnel/ competent persons in summer months (i.e. from July to September) for the first two operational years of ORRC1 at monthly intervals along an odour

<sup>(1)</sup> A stand by facility. Only operate when the CHPs are not in operation or when the biogas generated exceeded the utilisation rate of the CHPs.

patrol route at the Project Site boundary as shown in Annex  $A^{(1)}$ .

The perceived odour intensity is divided into 5 levels. *Table 3.6* describes the odour intensity for different levels.

Table 3.6Odour Intensity Level

Level	Odour Intensity
0	Not detected. No odour perceived or an odour so weak that it cannot be easily characterised or described
1	Slight identifiable odour, and slight chance to have odour nuisance
2	Moderate identifiable odour, and moderate chance to have odour nuisance
3	Strong identifiable, likely to have odour nuisance
4	Extreme severe odour, and unacceptable odour level

*Table 3.7* shows the action level and limit level to be used for odour patrol. Should any exceedance of the action and limit levels occurs, actions in accordance with the event and action plan in *Table 3.8* should be carried out.

#### Table 3.7Action and Limit Levels for Odour Nuisance

Parameter	Action Level	Limit Level
Odour Nuisance (from odour patrol)	When one documented compliant is received <sup>(a)</sup> , or Odour Intensity of 2 is measured from odour patrol.	Two or more documented complaints are received <sup>(a)</sup> within a week; or Odour intensity of 3 or above is measured from odour patrol.

(a) Once the complaint is received by the Project Proponent (EPD), the Project Proponent would investigate and verify the complaint whether it is related to the potential odour emission from the ORRC1 and its on-site wastewater treatment unit.

#### Table 3.8Event and Action Plan for Odour Monitoring

Event	Action			
	Person-in-charge of Odour Monitoring	Project Proponent <sup>(a)</sup>		
Action Level				
Exceedance of action level (Odour Patrol)	<ol> <li>Identify source/reason of exceedance;</li> <li>Repeat odour patrol to confirm finding.</li> </ol>	<ol> <li>Carry out investigation to identify the source/reason of exceedance.</li> <li>Investigation should be completed within 2 weeks;</li> <li>Rectify any unacceptable practice;</li> <li>Implement more mitigation measures in necessary;</li> <li>Inform Drainage Services Department (DSD) or the operator of the Siu Ho Wan Sewage Treatment Works (SHWSTW) if exceedance is considered to be caused by</li> </ol>		

(1) The odour patrol route was changed during this reporting period to include sampling points that are frequently visited by visitors and eliminate sampling points that are not visited by visitors.

Event	Action			
	Person-in-charge of Odour Monitoring	Project Proponent <sup>(a)</sup>		
		the operation of the SHWSTW.		
		5. Inform North Lantau Refuse Transfer Station (NLTS) operator if exceedance is considered to be caused by the operation of NLTS.		
Exceedance of action level (Odour Complaints)	<ol> <li>Identify source/reason of exceedance;</li> <li>Carry out odour patrol to determine to down intermitty</li> </ol>	1. Carry out investigation and verify the complaint whether it is related to potential odour emission from the nearby SHWSTW;		
I i i,	determinate odour intensity.	2. Carry out investigation to identify the		
		source/reason of exceedance. Investigation should be completed within 2 weeks;		
		3. Rectify any unacceptable practice;		
		4. Implement more mitigation measures if necessary;		
		5. Inform DSD or the operator of the SHWSTW if exceedance is considered to be caused by the operation of the SHWSTW.		
		6. Inform NLTS operator if exceedance is considered to be caused by the operation of NLTS.		
Limit Level				
Exceedance of limit level	<ol> <li>Identify source/reason of exceedance;</li> <li>Inform EPD;</li> <li>Repeat odour patrol to</li> </ol>	<ol> <li>Carry out investigation to identify the source/reason of exceedance.</li> <li>Investigation should be completed within 2 week;</li> </ol>		
	confirm findings;	2. Rectify any unacceptable practice;		
	4. Increase odour patrol	3. Formulate remedial actions;		
	frequency to bi-weekly;	4. Ensure remedial actions properly		
	5. Assess effectiveness of	implemented;		
	remedial action and keep EPD informed of the results;	5. If exceedance continues, consider what more/enhanced mitigation measures		
	6. If exceedance stops, cease additional odour patrol.	should be implemented; 6. Inform DSD or the operator of the SHWSTW if exceedance is considered to be caused by the operation of the SHWSTW.		

(a) Project Proponent shall identify an implementation agent.

#### 3.2 SITE AUDIT

Environmental mitigation measures (related to air quality, water quality, waste, land contamination, hazard-to-life, and landscape and visual) to be implemented during the operation phase of the Project are recommended in the approved EIA Report and EM&A Manual and are summarised in *Annex C*. Monthly site audits for operation phase will be carried out to check the implementation of these measures.

#### 3.2.1 Water Quality

Compliance audits are to be undertaken to ensure that a valid discharge licence has been issued by EPD prior to the discharge of effluent from the operation of the Project site. The audit shall be conducted to ensure that the effluent quality is in compliance with the discharge licence requirements. As stipulated in the operation phase discharge licence, effluent discharge are to be sampled monthly from the outlet chamber of the Effluent Storage Tank, while effluent discharge are to be sampled bi-monthly from the Petrol Interceptors. The effluent quality shall meet the discharge limits as described in Table 3.9 and Table 3.10.

Table 3.9 Discharge Limits for Effluent from the Outlet Chamber of the Effluent Storage Tank

Parameters	Discharge Limit (mg/L)
Flow Rate (m <sup>3</sup> /day) <sup>(a)</sup>	645
pH (pH units) <sup>(b)</sup>	6-10 <sup>(c)</sup>
Suspended Solids <sup>(b)</sup>	800
Biochemical Oxygen Demand (5 days, 20°) <sup>(b)</sup>	800
Chemical Oxygen Demand <sup>(b)</sup>	2,000
Oil & Grease <sup>(b)</sup>	40
Total Nitrogen <sup>(b)</sup>	200
Total Phosphorus <sup>(b)</sup>	50
Surfactants (total) <sup>(b)</sup>	25

accordance to Section B2 of the Effluent Discharge Licence under the WPCO.

Table 3.10 Discharge Limits for Effluent from the Petrol Interceptors

Parameters	Discharge Limit (mg/L)
Flow Rate (m <sup>3</sup> /day)	245 <sup>(a)</sup>
Suspended Solids <sup>(b)</sup>	30
Chemical Oxygen Demand <sup>(c)</sup>	80
Oil & Grease <sup>(c)</sup>	20
Surfactants (total) <sup>(b)</sup>	15

#### Notes:

- (a) The surface runoff flow rate limit was estimated by the overall yearly rainfall data. As the actual flowrate from the petrol interceptors depends on the weather condition instead of the performance of the petrol interceptor, monitoring and reporting of this parameter is not required. Hence this parameter is not reported in Table 4.7 and Table 4.8.
- (b) Parameter not required to be reported in accordance to Section B2 of the Effluent Discharge Licence under the WPCO.
- (c) Parameters required to be reported in accordance to Section B2 of the Effluent Discharge Licence under the WPCO.

<sup>(</sup>b) Parameters required to be monitored and reported by the Contractor in accordance to Section B2 of the Effluent Discharge Licence under the WPCO.

Range. (c)

#### 3.2.2 Landscape and Visual

In accordance with EM&A Manual, the landscape and visual mitigation measures shall be implemented.

For operation phase, site inspection shall be conducted once a month for the first year of operation of the Project. All measures as stated in the implementation schedule of the EM&A Manual (see *Annex C*), including compensatory planting, undertaken by both the Contractor and the specialist Landscape Sub-Contractor during the first year of the operation phase shall be audited by a Registered Landscape Architect (RLA) to ensure compliance with the intended aims of the measures and the effectiveness of the mitigation measures. After the one-year maintenance period, the landscape maintenance and monitoring shall be carried out by the Contractor.

#### 4 MONITORING RESULTS

#### 4.1 AIR QUALITY

#### 4.1.1 Operation Phase Monitoring

The concentrations of concerned air pollutants emitted from the stacks of the CAPCS, CHP, and ASP during the reporting period are monitored on-line by the continuous environmental monitoring system (CEMS). During the reporting period, there is no need to operate the standby flare and therefore no monitoring of the flare stack was undertaken.

With reference to the emission limits shown in *Tables 3.2, 3.3* and *3.4*, the hourly average concentrations and the number of exceedances of the concerned air emissions monitored for the CAPCS, CHP and ASP during this reporting period are presented in *Tables 4.1* to *4.5*.

It should be noted that measurements recorded under abnormal operating conditions, e.g. start up and stopping of stacks, unstable operation, test runs and interference of sensor, are disregarded.

Table 4.1Hourly Average of Parameters Recorded for CAPCS

Parameter	Range of Hourly Average Conc. (mg/Nm <sup>3</sup> )	Emission Limit (mg/Nm <sup>3</sup> )	Exceedance Identified	Remarks	
VOCs (including methane)	0.00 - 0.00	680	Nil	Nil	
Dust (or TSP)	0.00 - 0.17	6	Nil	Nil	
Odour (including $NH_3 \& H_2S$ ) <sup>(a)</sup>	0.00 - 185.66	220	Nil	Nil	
Note:					
(a) The odour unit is $OU/Nm^3$ .					

#### Table 4.2Hourly Average of Parameters Recorded for CHP 1

Parameter	Range of Hourly Average Conc. (mg/Nm <sup>3</sup> ) <sup>(a)</sup>	Max. Emission Limit (mg/Nm <sup>3</sup> )	Exceedance Identified	Remarks
Dust (or TSP)	0 - 4	15	Nil	Nil
Carbon Monoxide	0 - 103	650	Nil	Nil
NOx	0 - 475	300	Identified (c)	System unstable (e.g. low efficiency, unstable column temperature)
SO <sub>2</sub>	0 - 192	50	Identified (d)	De-sulphurization system tripped / Under Maintenance
VOCs (including methane) <sup>(b)</sup>	0 - 1,013	1,500	Nil	Nil
HCl	0 - 4	10	Nil	Nil
HF	0 - 1	1	Nil	Nil
Notes:				

ENVIRONMENTAL RESOURCES MANAGEMENT

OSCAR BIOENERGY JOINT-VENTURE

Parameter	Range of Hourly	Max. Emission	Exceedance	Remarks
	Average Conc.	Limit (mg/Nm <sup>3</sup> )	Identified	
	(mg/Nm <sup>3</sup> ) <sup>(a)</sup>			

- (a) All values refer to an oxygen content in the exhaust gas of 6% and dry basis.
- (b) The VOCs emission limit include methane as biogas is adopted as fuel in the combustion process.
- (c) Dates with exceedances on NOx (number of exceedance on the day) were identified on 1 (24), 2 (18), 6 (12), 7 (24), 8 (24), 9 (24), 10 (24), 11(7), 13 (8), 14 (24), 15 (15), 16 (24), 17 (24), 18 (16), 19 (1), 20 (22), 21 (24), 22 (21), 23 (22), 24 (24), 25 (21), 26 (21), 27 (9), 29 (1), 30 (24) and 31 (24) July 2022.
- (d) Dates with exceedances on SO<sub>2</sub> (number of exceedance on the day) were identified on 18 (1), 19 (10), 22 (6) and 23 (5) July 2022.

#### Table 4.3Hourly Average of Parameters Recorded for CHP 2

Parameter	Range of Hourly Average Conc. (mg/Nm <sup>3</sup> ) <sup>(a)</sup>	Max. Emission Limit (mg/Nm <sup>3</sup> )	Exceedance Identified	Remarks
Dust (or TSP)	0 - 2	15	Nil	Nil
Carbon Monoxide	0 - 359	650	Nil	Nil
NOx	0 - 544	300	Identified <sup>(c)</sup>	System unstable (e.g. low efficiency, unstable column temperature)
SO <sub>2</sub>	0 - 51	50	Identified (d)	De-sulphurization system tripped / Under Maintenance
VOCs (including methane) <sup>(b)</sup>	0 - 909	1,500	Nil	Nil
HCl	0 - 2	10	Nil	Nil
HF	0 - 1	1	Nil	Nil

Notes:

(a) All values refer to an oxygen content in the exhaust gas of 6% and dry basis.

(b) The VOCs emission limit include methane as biogas is adopted as fuel in the combustion process.

(c) Dates with exceedances on NOx (number of exceedance on the day) were identified on 1
(24), 2 (24), 3 (24), 4 (24), 5 (24), 6 (20), 7 (18), 8 (12), 9 (21), 10 (24), 11 (24), 12 (20), 13 (15), 17 (12), 18 (4), 19 (5), 20 (9), 26 (17), 27 (19), 28 (11) and 29 (9) July 2022.

(d) Date with exceedances on SO<sub>2</sub> (number of exceedance on the day) was identified on 10 (1) July 2022.

#### Table 4.4Hourly Average of Parameters Recorded for CHP 3

Parameter	Range of Hourly Average Conc. (mg/Nm <sup>3</sup> ) <sup>(a)</sup>	Max. Emission Limit (mg/Nm³)	Exceedances Identified	Remarks
Dust (or TSP)	0 - 1	15	Nil	Nil
Carbon Monoxide	0 - 146	650	Nil	Nil
NOx	0 – 550	300	Identified <sup>(c)</sup>	System unstable (e.g. low efficiency, unstable column temperature )

Parameter	Range of Hourly Average Conc. (mg/Nm <sup>3</sup> ) <sup>(a)</sup>	Max. Emission Limit (mg/Nm³)	Exceedances Identified	Remarks
SO <sub>2</sub>	0 - 204	50	Identified (d)	De-sulphurization system tripped / Under Maintenance
VOCs (including methane) <sup>(b)</sup>	0 - 1,058	1,500	Nil	Nil
HC1	0 - 6	10	Nil	Nil
HF	0 - 1	1	Nil	Nil

#### Notes:

(a) All values refer to an oxygen content in the exhaust gas of 6% and dry basis.

- (b) The VOCs emission limit include methane as biogas is adopted as fuel in the combustion process.
- (c) Dates with exceedances on NOx (number of exceedance on the day) were identified on 2 (1), 11 (4), 12 (20), 13 (11), 15 (6), 16 (4), 17 (2), 20 (11), 21 (23), 22 (21), 23 (19), 24 (16), 25 (8), 26 (6), 27 (10), 28 (16), 29 (16), 30 (2) and 31 (11) July 2022.
- (d) Dates with exceedances on SO<sub>2</sub> (number of exceedance on the day) were identified on 2
  (5), 3 (3), 4 (4), 12 (9), 13 (2), 16 (7), 17 (1), 20 (8), 21 (5), 22 (14), 23 (15), 24 (14), 25 (1), 26 (2), 27 (2), 29 (2), 30 (1) and 31 (2) July 2022.

#### Table 4.5Hourly Average of Parameters Recorded for ASP

Parameter	Range of Hourly Average Conc. (mg/Nm <sup>3</sup> ) <sup>(a)</sup>	Max. Emission Limit (mg/Nm <sup>3</sup> )	Exceedances Identified	Remarks
Dust (or TSP)	0 – 0	5	Nil	Nil
Carbon Monoxide	0 - 41	100	Nil	Nil
NOx	0 - 434	200	Identified (c)	System unstable (e.g. low efficiency, unstable column temperature )
SO <sub>2</sub>	0 - 175	50	Identified (d)	De-sulphurization system tripped / Under Maintenance
VOCs (including methane) <sup>(b)</sup>	0 - 6	20	Nil	Nil
NH3	0 - 150	35	Identified <sup>(e)</sup>	System unstable (e.g. low efficiency, unstable column temperature )
HCl	0 – 0	10	Nil	Nil
HF	0 - 1	1	Nil	Nil

#### Notes:

(a) All values refer to an oxygen content in the exhaust gas of 11% and dry basis.

(b) The VOCs emission limit include methane as biogas is adopted as fuel in the combustion process.

(c) Dates with exceedances on NOx (number of exceedance on the day) were identified on 2 (3), 3 (8), 4 (3), 5 (3), 6 (1), 7 (6), 8 (4), 11 (1), 12 (2), 13 (4), 14 (2), 16 (2), 17 (1), 18 (5), 19 (1), 20 (2), 22 (3), 23 (7), 24 (3), 25 (3), 26 (4), 28 (2), 29 (6), 30 (6) and 31 (5) July 2022.

(d) Dates with exceedances on SO<sub>2</sub> (number of exceedance on the day) were identified on 22
 (5) and 23 (4) July 2022.

(e) Dates with exceedances on NH3 (number of exceedance on the day) were identified on 9 (1), 10 (2), 11 (2), 14 (1), 15 (5), 16 (3), 18 (2), 19 (1), 20 (1), 21 (2), 22 (6), 23 (1), 24 (2), 27 (1), 28 (2), 29 (1) and 31 (1) July 2022.

#### 4.2 ODOUR

#### 4.2.1 *Operation Phase Monitoring*

Two rounds of odour patrol were conducted by the independent odour patrol team of ALS Technichem (HK) Pty Ltd on 6 and 19 July 2021. According to the EM&A Manual and EP requirements, it is considered an exceedance if the odour intensity recorded by the panellists is Level 2 or above. During this reporting period, level 2 Odour Intensity was recorded in one location during the patrol on 6 July. A subsequent odour patrol conducted on 19 July recorded an Odour Intensity less than 2. The results of odour patrol and the investigation report are shown in Annex G and F, respectively.

#### 4.3 WATER QUALITY

#### 4.3.1 Operation Phase Monitoring

Effluent discharge was sampled from the outlet chamber of the Effluent Storage Tank monthly and from the Petrol Interceptor(s) bi-monthly as stipulated in the operation phase discharge licence. The results of the discharge samples from the outlet chamber of the Effluent Storage Tank are recorded in *Table 4.6* and the results from the Petrol Interceptors are recorded in *Table 4.7* and *Table 4.8*.

## Table 4.6Results of the Discharge Sample from the Outlet Chamber of the Effluent<br/>Storage Tank

Parameters	Discharged Effluent Concentration (mg/L)	Discharge Limit (mg/L)	Compliance with Discharge Limit
Flow Rate $(m^3/day)^{(a)}$	8 - 239 <sup>(e)</sup>	645	Yes
pH (pH units) <sup>(b)</sup>	6.99 – 8.32 <sup>(e)</sup>	6-10 (c)	Yes
Suspended Solids <sup>(b) (d)</sup>	126 <sup>(d)</sup>	800	Yes
Biochemical Oxygen Demand (5 days, 20°) <sup>(b) (d)</sup>	60 (d)	800	Yes
Chemical Oxygen Demand (b) (d)	475 (d)	2,000	Yes
Oil & Grease <sup>(b) (d)</sup>	<5 (d)	40	Yes
Total Nitrogen <sup>(b) (d)</sup>	112 <sup>(d)</sup>	200	Yes
Total Phosphorus <sup>(b) (d)</sup>	37.5 <sup>(d)</sup>	50	Yes
Surfactants (total) <sup>(b) (d)</sup>	<1.0 <sup>(d)</sup>	25	Yes

Notes:

(a) Parameter not required to be reported in accordance to Section B2 of the Effluent Discharge Licence under the WPCO.

(b) Parameters required to be reported in accordance to Section B2 of the Effluent Discharge Licence under the WPCO.

(c) Daily Range.

- (d) Effluent sample collected on 8 July 2022.
- (e) Data collected daily.

#### Table 4.7Results of the Discharge Sample from the Petrol Interceptor 1

Parameters	Discharged Effluent Concentration (mg/L)	0	Compliance with Discharge Limit
Suspended Solids (b)	_ (a)	30	_ (a)
Chemical Oxygen Demand (c)	_ (a)	80	_ (a)
Oil & Grease (c)	_ (a)	20	_ (a)
Surfactants (total) <sup>(b)</sup>	_ (a)	15	_ (a)
Notes:			

(a) No sampling was required in July 2022

- (b) Parameter not required to be reported in accordance to Section B2 of the Effluent Discharge Licence under the WPCO.
- (c) Parameters required to be reported in accordance to Section B2 of the Effluent Discharge Licence under the WPCO.

Table 4.8Results of the Discharge Sample from the Petrol Interceptor 2

Parameters	Discharged Effluent Concentration (mg/L)	0	Compliance with Discharge Limit
Suspended Solids <sup>(b)</sup>	_ (a)	30	_ (a)
Chemical Oxygen Demand (c)	_ (a)	80	_ (a)
Oil & Grease (c)	_ (a)	20	_ (a)
Surfactants (total) <sup>(b)</sup>	_ (a)	15	_ (a)

#### Notes:

(a) No sampling was required in July 2022.

- (b) Parameter not required to be reported in accordance to Section B2 of the Effluent Discharge Licence under the WPCO.
- (c) Parameters required to be reported in accordance to Section B2 of the Effluent Discharge Licence under the WPCO.

#### 4.4 WASTE MANAGEMENT

#### 4.4.1 Operation Phase Monitoring

Wastes generated from the operation of the Project include chemical waste, wastes generated from pre-treatment process and general refuse <sup>(1)</sup>. Reference has been made to the Monthly Summary Waste Flow Table prepared by the Contractor (see *Annex D*). With reference to the relevant handling records and trip tickets of this Project, the quantities of different types of waste generated from the operation of the Project in the reporting month are summarised in *Table 4.9*.

<sup>(1)</sup> Public fill and construction waste may only be generated during maintenance works when there are civil or structural works.

#### Table 4.9Quantities of Waste Generated from the Operation of the Project

	isposed		ecycled <sup>(b)</sup>	Disposed of at	Recycled <sup>(c)</sup>
WTC	Landfill	(a)		Landfill <sup>(a)</sup>	2
L <sup>(d)</sup> 43	30.89 to	nnes 5	.87 tonnes	2.76 tonnes (e)	0.00 tonne
					L <sup>(d)</sup> 430.89 tonnes 5.87 tonnes 2.76 tonnes <sup>(e)</sup>

(a) Waste generated from pre-treatment process and general refuse other than chemical waste and recyclables were disposed of at NENT Landfill by sub-contractors.

(b) Among waste generated from pre-treatment process, 4.75 tonnes of metals, 1.12 tonnes of papers/ cardboard packing and 0.00 tonnes of plastics were sent to recyclers for recycling during the reporting period.

(c) Among general refuse, 0.00 kg of metals, 0.00 kg of papers/ cardboard packing and 0.00 kg of plastics were sent to recyclers for recycling during the reporting period.

(d) No chemical waste was disposed of at CWTC in July 2022.

(e) It was assumed that four 240-litre bins filled with 80% of general refuse were collected at each collection. The general refuse density was assumed to be around 0.15 kg/L.

#### 5 SITE AUDIT

#### 5.1 Environmental Site Audit

#### 5.1.1 *Operation Phase*

The monthly inspection for the operation phase of the Project on 29 July 2022 covered the operation phase environmental site audit. Joint site inspection was conducted by representatives of the Contractor, IEC, and the MT on 29 July 2022 as required for the operation of the Project.

The audits checked the implementation of the recommended mitigation measures for air quality, landscape and visual, water quality, waste (land contamination) and hazard-to-life stated in the Implementation Schedule (see *Annex C*).

Key observations during the reporting period are summarised as follows:

29 July 2022

• No particular observation during this inspection.

Other than the above observations, the Contractor has implemented environmental mitigation measures recommended in the approved EIA Report and EM&A Manual.

#### 5.2 LANDSCAPE AND VISUAL AUDIT

Inspection of the landscape and visual mitigation measures for the operation phase of the Project was performed on 29 July 2022.

It was confirmed that the necessary landscape and visual mitigation measures during the operation phase as summarised in *Annex C* were generally implemented by the Contractor. No specific observation was found during the joint site inspection on 29 July 2022. No non-compliance in relation to the landscape and visual mitigation measures was identified during the site audits in this reporting period and therefore no further actions are required. The ET/MT will keep track of the EM&A programme to check compliance with environmental requirements and the proper implementation of all necessary mitigation measures.

#### 6 ENVIRONMENTAL NON-CONFORMANCE AND DEFICIENCIES

#### 6.1 SUMMARY OF ENVIRONMENTAL NON-COMPLIANCE AND DEFICIENCIES

Non-compliance of emission limits of  $NO_x$  and  $SO_2$  from the CHPs and  $NO_x$ ,  $SO_2$  and  $NH_3$  from ASP were recorded during the reporting period.

The Contractor has reviewed the organic waste treatment processes (i.e. waste reception, waste pre-treatment, anaerobic digesters, and composting processes) and found that they were operated normally during the reporting period. The Contractor has investigated the de-sulphurisation system, CHPs and the ASP, the potential causes for the exceedance were identified.

Odour Intensity of 2 was recorded in one location during the reporting period. The Contractor has identified the mixing of scents of garbage and deodorising agent used for the SBT cleaning undertaken during the odour patrol as the source of the odour.

The investigation reports of the above exceedance are presented in Annex F.

#### 6.2 SUMMARY OF ENVIRONMENTAL COMPLAINT

No complaint was received during the reporting period.

#### 6.3 SUMMARY OF ENVIRONMENTAL SUMMON AND SUCCESSFUL PROSECUTION

No summon/prosecution was received during the reporting period. The cumulative summons/prosecution log is shown in *Annex E*.

### 7 FUTURE KEY ISSUES

### 7.1 Key Issues for the Coming Month

Activities to be undertaken for the coming reporting period are:

- Operation of the Project; and
- CHP2 overhaul.

8

This EM&A Report presents the EM&A programme undertaken during the reporting period from **1 to 31 July 2022** in accordance with EM&A Manual (Version F) and requirements of EP (FEP-01/395/2010/C).

For the operation phase, exceedances of the emission limits for the CHPs and ASP stack monitoring were recorded under normal operating conditions during the reporting period (see *Table 8.1*).

Stack Exceedances During the Reporting Period					
Cogeneration Unit 1 (CHP 1)	• Exceeded emission limit of NOx on 1, 2, 6, 7, 8, 9, 10, 11, 13, 14, 15, 16, 17, 18, 19, 20, 21, 22, 23, 24, 25, 26, 27, 29, 30 and 31 July 2022.				
	• Exceeded emission limit of SO2 on 18, 19, 22 and 23 July 2022.				
Cogeneration Unit 2 (CHP 2)	• Exceeded emission limit of NOx on 1, 2, 3, 4, 5, 6, 7, 8, 9, 10, 11, 12, 13, 17, 18, 19, 20, 26, 27, 28 and 29 July 2022.				
	• Exceeded emission limit of SO2 on 10 July 2022.				
Cogeneration Unit 3 (CHP 3)	• Exceeded emission limit of NOx on 2, 11, 12, 13, 15, 16, 17, 20, 21, 22, 23, 24, 25, 26, 27, 28, 29, 30 and 31 July 2022.				
	• Exceeded emission limit of SO <sub>2</sub> on 2, 3, 4, 12, 13, 16, 17, 20, 21, 22, 23, 24, 25, 26, 27, 29, 30 and 31 July 2022.				
Ammonia Stripping	• Exceeded emission limit of NOx on 2, 3, 4, 5, 6, 7, 8, 11, 12, 13, 14, 16, 17, 18, 19, 20, 22, 23, 24, 25, 26, 28, 29, 30 and 31 July 2022.				
Plant (ASP)	• Exceeded emission limit of SO <sub>2</sub> on 22 and 23 July 2022.				
	<ul> <li>Exceeded emission limit of NH3 on 9, 10, 11, 14, 15, 16, 18, 19, 20, 21, 22, 23, 24, 27, 28, 29 and 31 July 2022.</li> </ul>				

#### Table 8.1Exceedances for Stack Emissions

Non-compliance of emission limits of NOx and SO<sub>2</sub> from the CHPs and NO<sub>x</sub>, SO<sub>2</sub> and NH<sub>3</sub> from ASP were recorded during the reporting period. Noncompliance of emission limits of SO<sub>2</sub> from the CHPs occurred due to tripping of the de-sulphurisation system caused by residual sulphur from the exhaust heat exchangers. The exceedances of NO<sub>x</sub> from the CHPs occurred due to system instability caused by prolonged usage of the CHPs. The exceedance of NO<sub>x</sub>, SO<sub>2</sub> and NH<sub>3</sub> from ASP occurred due to system instability caused by issues in the ASP column and heat exchanger.

Odour Intensity of 2 was recorded in one location during an odour patrol on 6 July 2022. The Contractor has identified the mixing of the scents of garbage and de-odorising agent used for the SBT cleaning undertaken during the odour patrol as the source of the odour.


The environmental control /mitigation measures related to air quality, water quality, waste (including land contamination prevention), hazard-to-life and landscape and visual recommended in the approved EIA Report and the EM&A Manual were properly implemented by the Contractor during the reporting month.

Monthly landscape and visual monitoring were conducted in the reporting period. The necessary landscape and visual mitigation measures recommended in the approved EIA Report were generally implemented by the Contractor.

No complaint/summon/prosecution was received.

Annex A

## Project Layout

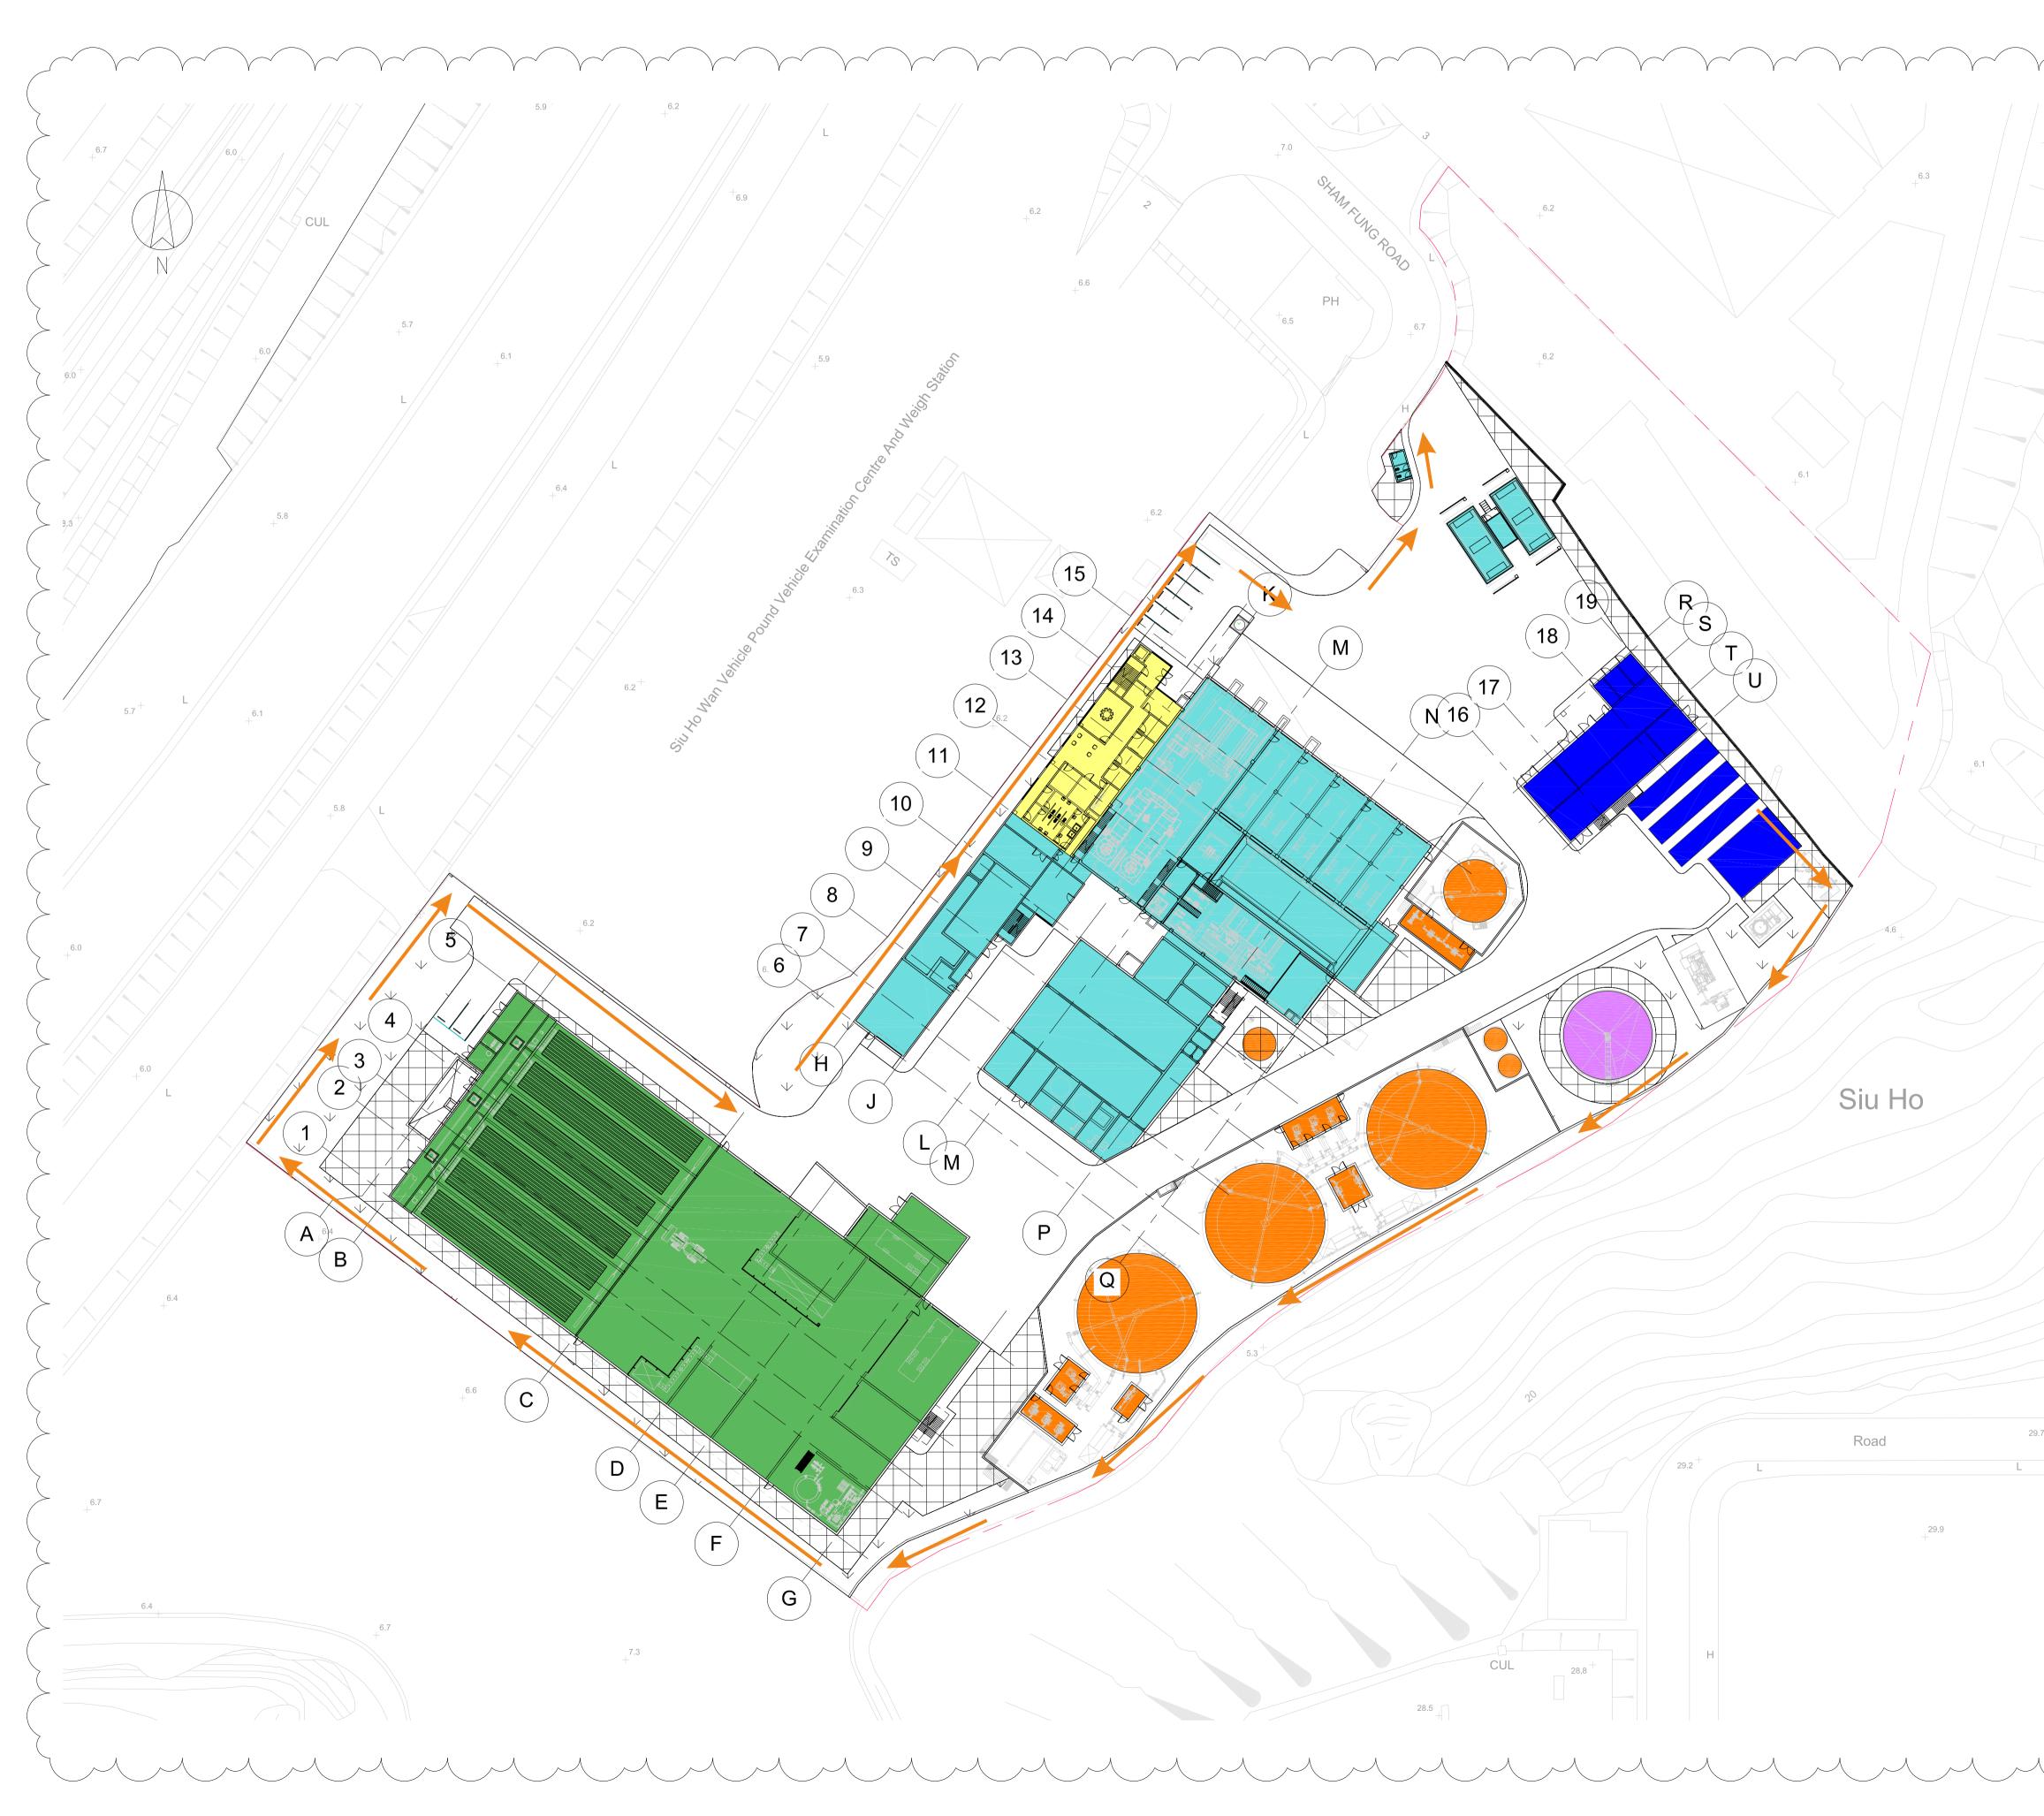



$\sim$	
Ý ~	γ · _
	-
-///	
	_
	-
CUL	
GOL	
	-
	-
	-
30.1	
+	-
	-
	29.8 <del>-</del>
	-
<sup>30.3</sup> +	-

Key Patrol Route						
A01	05/03/15	CW	MВ	Імтесн ва	CKGROUNDS UPDATED	
A00 REV	18/02/15 DATE	CW BY	MB APP	DRAFT ISS		
CLIEN						
CLIENT'S CONSULTANT						
CONT		AECC	DM AS	IA CO. LT	D.	
CONTRACTOR STTA ATAL ROSROCA OSCAR BIOENERGY JV						
LEAD	DESIGNER					
LEAD DESIGNER ARUP Ove Arup & Partners Hong Kong Limited						
ENVIRONMENTAL TEAM						
<b>Meinhardt Infrastructure and Environment Limited</b> 邁進基建環保工程顧問有限公司						
PROJECT ORGANIC WASTE TREATMENT FACILITIES PHASE 1 EP/SP/61/10						
STATUS						
DRAFT ISSUE DRAWING TITLE SITE LAYOUT						
DRAWN	CW	СНЕ	ECKED F	RS	APPROVED DP	
scale job n 239		AWING 1	١0.	0−0−C	DATE 12/02/15 REV. A-1001 A01	
					0279222v.cdr	

Annex B

Project Organisation Chart with Contact Details



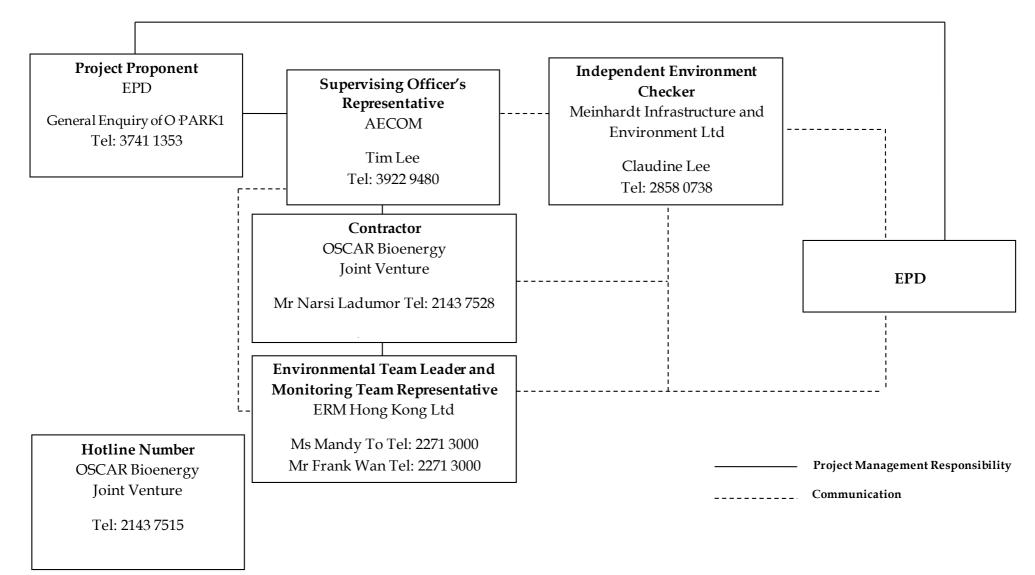

Annex C

Implementation Schedule of Mitigation Measures

EIA Ref.	EM&A	Environmental Protection Measures	Location/ Timing	Status
	Log Ref.			
Summary c	of Environmenta	al Mitigation Measures in the EIA and EM&A Manual	•	•
A. A	Air Quality			
3.78	2.7 & 2.13 - 2.19	Air Pollution Control (Construction Dust) Regulation & Good Site Practices	OWTF Stacks/ During Commissioning Stage	$\checkmark$
		<ul> <li>Commissioning tests shall be conducted to confirm the centralized air pollution control unit, the cogen units, the standby flaring unit and ASP against the design emission levels as stated in Tables 2.2 - 2.5.</li> <li>Odour monitoring shall be conducted at the stack exhaust of the centralized air pollution control unit weekly in the first month of the commissioning stage.</li> </ul>	Commussioning Stage	
3.78	2.7-2.12	Air Pollution Control and Stack Monitoring •Stack monitoring shall be installed for the centralized air pollution control unit, cogen units and ASP of OWTF to ensure that the air emissions from OWTF would meet the design emission limits as well as EPD criteria.	During Operation	$\checkmark$
3.78	2.20- 2.28	•Odour Patrol at site boundary of OWTF	OWTF Site Boundary/During Operation (The need to continue the odour patrol after the end of the 2-year monitoring period would depend on the monitoring results and should be agreed with EPD)	$\checkmark$
B. H	lazard to Life	·	•	
4.103	3.4	Operation Phase         •3m high fence should be constructed along the boundary facing the SHWWTW         •Emergency evacuation procedures should be formulated and the Contractor should ensure on site staff should be familiar with these procedures. Diagram showing the escape routes to a safe place should be posted in the site notice boards and at the entrance/exit of site. A copy of the latest version emergency procedures should be dispatched to Tung Chung Fire Station for reference once available.	Work Site / During Operation Period	1
		•The emergency procedures should specify means of providing a rapid and direct warning		

### Annex C Summary of Mitigation Measures Implementation Schedule for Operation Phase

EIA Ref.	EM&A	Environmental Protection Measures	Location/ Timing	Status
	Log Ref.			
		(e.g. Siren and Flashing Light) to personnel on site in the event of chlorine gas release in the SHWWTW.		
		•The Contractor should establish a communication channel with the SHWWTW operation		
		personnel and FSD. In case of any hazardous incidents in the treatment works, operation		
		personnel of SHWWTW should advise the Contractor to inform personnel on site to proceed		
		with emergency procedure. The Contractor should appoint a Liaison Officer to communicate		
		with FSD Incident Commander on site in case of emergency.		
		•Periodic drills should be coordinated and conducted to ensure all on site personnel are		
		familiar with the emergency procedures. Upon completion of the drills, a review on every step		
		taken should be conducted to identify area of improvement. Prior notice of periodic drills		
		should be given to Station Commander of Tung Chung Fire Station. Joint operational exercise		
		with FSD and SHWWTW is recommended.		
	Vater Quality			
5.44	4.5	Wastewater from Organic Waste Treatment Process	Work Site / During Design &	$\checkmark$
		The Project site will be equipped with an adequately sized wastewater treatment plant. A	Operation Period	
		high rate type of active sludge system specifically designed for the removal of nitrogen		
		components from the wastewater in combination with conversion of residual BOD and COD		
		would be deployed. The wastewater treatment plant would also be incorporated with		
		SHARON or annamox technology or equivalent to achieve high total overall nitrogen		
		removal. Wastewater generated from the OWTF (including wastewater from dewatering		
		process, leachate from waste reception area, condensate from biogas handling, wastewater		
		from scrubber of air treatment system and any surplus water from truck washing facility) will be diverted to the wastewater treatment plant. Treated effluent will then be stored		
		temporarily in order to be used as process water within the plants. The storage volume		
		would be around 20 m3. Overflow from the tank will be discharged to foul sewers. The		
		polluting parameters in effluent shall be in compliance with the requirements specified in the		
		TM- DSS. The design, installation and operation of the wastewater treatment plant shall be		
		licensed under the Waste Disposal Ordinance and subject to the effluent monitoring as		
		required under the WPCO which is under the ambit of regional office (RO) of EPD. To		
		ensure that wastewater can be adequately treated and effluent from treatment plant can		
		meet the standards listed in TM- DSS, the following mitigation measure should be		
		conducted.		
		Cleaning and maintenance of treatment facilities should be conducted on a regular		
		basis to ensure that removal rate of each treatment facility would not be reduced.		
		Cleaning and maintenance of pipelines should be carried out on a regular basis to		

EM&A Log Ref.	Environmental Protection Measures	Location/ Timing	Status
	<ul> <li>prevent block of pipeline and leaching of wastewater, and therefore prevent overflowed or leached wastewater discharging into nearby drainages and water streams.</li> <li>Regular site inspection should be conducted to ensure that no wastewater can be directly discharged into nearby water streams.</li> </ul>		
4.5	In the scrubber, spraying water should be re-circulated to minimize the need for external water. The spraying water would be collected at the bottom of the scrubber. Excess water would be discharged to the wastewater treatment plant as described in Section 5.54.	Work Site / During Design & Operation Period	$\checkmark$
4.5	The waste reception, treatment facilities and compost storages of OWTF should be located in enclosed buildings to prevent generation of contaminated rain runoff. All surface runoff such as washed water generated in the treatment processes areas should be properly collected and diverted to the on-site wastewater treatment plant as described in Section 5.54.	Work Site / During Design & Operation Period	$\checkmark$
4.5	All drainage system for collection and transferring wastewater generated in the OWTF to the on- site wastewater treatment plant as described in Section 5.54 should be capable of preventing clogging and easy maintenance and cleaning.	Work Site / During Design & Operation Period	V
Vaste Managen	nent "	-	
5.12	Good Site PracticesGood operational practices should be adopted to Minimize waste management impacts:•Obtain the necessary waste disposal permits from the appropriate authorities, in accordancewith the Waste Disposal Ordinance (Cap. 354), Waste Disposal (Chemical Waste) (General)Regulation and the Land (Miscellaneous Provision) Ordinance (Cap. 28);•Nomination of an approved person to be responsible for good site practice, arrangements forcollection and effective disposal to an appropriate facility of all wastes generated at the site;•Use of a waste haulier licensed to collect specific category of waste;•A trip-ticket system should be included as one of the contractual requirements andimplemented by the Environmental Team to monitor the disposal of solid wastes at publicfilling facilities and landfills, and to control fly tipping. Reference should be made to ETWBTCW No. 31/2004.•Training of site personnel in proper waste management and chemical waste handlingprocedures;•Separation of chemical wastes for special handling and appropriate treatment at a licensedfacility:	During Operation Period	
	Log Ref.           4.5           4.5           4.5           4.5           Vaste Manager	Log Ref.           Prevent block of pipeline and leaching of wastewater, and therefore prevent overflowed or leached wastewater discharging into nearby drainages and water streams.           • Regular site inspection should be conducted to ensure that no wastewater can be directly discharged into nearby water streams.           4.5         In the scrubber, spraying water should be re-circulated to minimize the need for external water. The spraying water would be collected at the bottom of the scrubber. Excess water would be discharged to the wastewater treatment plant as described in Section 5.54.           4.5         The waste reception, treatment facilities and compost storages of OWTF should be located in enclosed buildings to prevent generation of contaminated rain runoff. All surface runoff such as washed water generated in the treatment plant as described in Section 5.54.           4.5         All drainage system for collection and transferring wastewater generated in the OWTF to the on- site wastewater treatment plant as described in Section 5.54 should be capable of preventing clogging and easy maintenance and cleaning. <i>Management</i> 5.12         Good Site Practices Good operational practices should be adopted to Minimize waste management impacts: •Obtain the necessary waste disposal permits from the appropriate authorities, in accordance with the Waste Disposal Ordinance (Cap. 354), Waste Disposal (Chemical Waste) (General) Regulation and the Land (Miscellaneous Provision) Ordinance (Cap. 28);           •Nomination of an approved person to be responsible for good site practice, arrangements for collection and effective disposal to an appropriate facility of all wastes generated at the site; •Use of a waste haulier licensed to collect spec	Log Ref.         Prevent block of pipeline and leaching of wastewater, and therefore prevent overflowed or leached wastewater discharging into nearby drainages and water sitraams.         Prevent block of pipeline and leaching of wastewater, and therefore prevent overflowed or leached wastewater discharging into nearby drainages and water           4.5         In the scrubber, spraying water should be conducted to ensure that no wastewater can be directly discharged into nearby water streams.         Work Site / During Design & Operation Period           4.5         In the scrubber, spraying water would be collected at the bottom of the scrubber. Excess water would be discharged to the wastewater treatment plant as described in Section 5.54.         Work Site / During Design & Operation Period           4.5         The waste reception, treatment facilities and compost storages of OWTF should be located in enclosed buildings to prevent generation of contaminated rain runoff. All surface runoff such as washed water generated in the treatment processes areas should be property collected and diverted to the on-site wastewater treatment plant as described in Section 5.54.         Work Site / During Design & Operation Period           4.5         All drainage system for collection and transferring wastewater generated in the OWTF to the on- site wastewater treatment plant as described in Section 5.54.         Work Site / During Design & Operation Period           5.12         Cool operational practices should be adopted to Minimize waste management impacts: -Obtain the necessary waste disposal permits from the appropriate authorities, in accordance with the Waste Disposal Ordinance (Cap. 354), Waste Disposal (Chemical Waste) (General) Regulation and effective disposal t

EIA Ref.	EM&A	Environmental Protection Measures	Location/ Timing	Status
	Log Ref.			
		interceptors;		
		•Provision of sufficient waste disposal points and regular collection for disposal;		
		•Adoption of appropriate measures to minimize windblown litter and dust during		
		transportation of waste, such as covering trucks or transporting wastes in enclosed containers;		
		and		
		•Implementation of a recording system for the amount of wastes generated, recycled and		
		disposed of (including the disposal sites).		
6.51	5.13	<u>Waste Reduction Measures</u>	During Operation Period	$\checkmark$
		Good management and control can prevent the generation of significant amounts of waste. It is		
		recommended that the following good operational practices should be adopted to ensure waste		
		reduction:		
		•Segregation and storage of different types of waste in different containers, skips or stockpiles		
		to enhance reuse or recycling of materials and their proper disposal;		
		•Encourage collection of aluminum cans, plastic bottles and packaging material (e.g. carton		
		boxes) and office paper by individual collectors. Separate labelled bins should be provided to		
		help segregate this waste from other general refuse generated by the work force; and		
		•Any unused chemicals or those with remaining functional capacity should be reused as far as		
6.50	5.14	practicable.		1
6.52	5.14	Wastes Generated from Pre-Treatment Process	Pre-Treatment Process/ During	V
		Wastes generated from pre-treatment process should be recycled as far as possible. Wastes generated from pre- treatment process should also be separated from any chemical waste and	Operation Period	
		stored in covered skips. The recyclables should be collected by licensed collectors, while the rest		
		of the waste should be removed from the site on a daily basis to minimize odour, pest and litter		
		impacts. Open burning must be strictly prohibited.		
6.53-6.56	5.15-5.18	Chemical Wastes	Whole Site / During Operation	
		•Chemical waste generated from machinery maintenance and servicing should be managed in	Period	
		accordance with Code of Practice on the Packaging, Labelling and storage of Chemical Wastes		
		under the provisions of Waste Disposal (Chemical Waste) (General) Regulation. The chemical		
		waste should be collected by drum-type containers and removed by licensed chemical waste		
		contractors.		
		•Plant / equipment maintenance schedules should be planned in order to minimize the		

EIA Ref.	EM&A	Environmental Protection Measures	Location/ Timing	Status
	Log Ref.			
		generation of chemical waste.		
		•Non-recyclable chemical wastes and lubricants should be disposed of at appropriate facilities,		
		such as CWTC. Copies or counterfoils from collection receipts issued by the licensed waste		
		collector should be kept for recording purpose.		
		•Recyclable chemical waste will be transported off-site for treatment by a licensed collector. The		
		Contractor will need to register with EPD as a chemical waste producer. Where possible,		
		chemical wastes (e.g. waste lubricants) would be recycled at appropriate facilities, such as		
		Dunwell's oil re-refinery.		
6.57-6.58	5.19-5.20	<u>General Refuse</u>	Whole Site / During Operation	$\checkmark$
		•Waste generated in offices should be reduced through segregation and collection of recyclables.	Period	
		To promote the recycling of wastes such as used paper, aluminum cans and plastic bottles, it is		
		recommended that recycling bins should be clearly labelled and placed at locations with easy		
		access. For the collection of recyclable materials, they should be collected by licensed collectors.		
		•General refuse, other than segregated recyclable wastes, should be separated from any chemical		
		waste and stored in covered skips. The general refuse should be removed from the site on a		
		daily basis to minimize odour, pest and litter impacts. Also, open burning of refuse must be		
		strictly prohibited.		
<i>E. P</i>	5.21 (i)	Contamination Preventive Measures	Evel Oil Sterre on Container	
0.05	5.21 (1)	<u>Fuel Oil Containers</u> •Fuel oil should be stored in suitable containers.	Fuel Oil Storage Containers /During Operation Period	V
		•All fuel oil containers should be securely closed.	/ During Operation Period	
		•Appropriate labels showing the name of fuel oil should be posted on the containers.		
		•Drip trays should be provided for all containers.		
6.65	5.21 (ii)	<u>Storage Area</u>	Fuel Oil Storage Area / During	$\checkmark$
		•Distance between the fuel oil refuelling points and the fuel oil containers should be minimized.	Operation Period	
		•The storage area should be used for fuel oil storage only.		
		•No surface water drains or foul sewers should be connected to the storage area.		
		•The storage area should be enclosed by three sides by a wall and have an impermeable floor or		
		surface.		
6.65	5.21 (iii)	Fuel Oil Spillage Response	Whole Site / During Operation	$\checkmark$
		An Oil Spill Response Plan should be prepared by the operator to document the appropriate	Phase	

EIA Ref.	EM&A	Environmental Protection Measures	Location/ Timing	Status
	Log Ref.			
		response procedures for oil spillage incident in detail. General procedures to be taken in case of		
		fuel oil spillage are presented below.		
		• <u>Training</u>		
		Training on oil spill response actions should be given to relevant staff. The training		
		should cover the followings:		
		- Tools & resources to combat oil spillage and fire, e.g. locations of oil spill		
		handling equipment and firefighting equipment;		
		- General methods to deal with oil spillage and fire incidents;		
		- Procedures for emergency drills in the event of oil spills and fire; and		
		- Regular drills should be carried out.		
		<u>Communication</u>		
		Establish communication channel with the Fire Services Department (FSD) and EPD to		
		report any oil spillage incident so that necessary assistance from relevant department		
		could be quickly sought.		
		<u>Response Procedure</u>		
		Any fuel oil spillage within the Project Site should be immediately reported to the Site		
		Manager with necessary details including location, source, possible cause and extent of		
		the spillage		
		Site Manager should immediately attend to the spillage and initiate any appropriate		
		action to confine and clean up the spillage. The response procedures should include the		
		following:		
		<ul> <li>Identify and isolate the source of spillage as soon as possible.</li> </ul>		
		- Contain the oil spillage and avoid infiltration into soil / groundwater and		
		discharge to storm water channels.		
		- Remove the oil spillage.		
		- Clean up the contaminated area.		
		- If the oil spillage occurs during refuelling, the refuelling operation should		
		immediately be stopped.		
		<ul> <li>Recovered contaminated fuel oil and the associated material to remove the</li> </ul>		
		spilled oil should be considered as chemical waste. The handling and		
		disposal procedures for chemical wastes are discussed in the following		
		paragraphs.		
6.66	5.22 (i)	Chemicals and Chemical Wastes Handling & Storage	Whole Site / During Operation	$\checkmark$

EIA Ref.	EM&A	Environmental Protection Measures	Location/ Timing	Status
	Log Ref.			
		<ul> <li>Chemicals and chemical wastes should only be stored in suitable containers in purpose-built areas.</li> <li>The storage of chemical wastes should comply with the requirements of the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes.</li> <li>The storage areas for chemicals and chemical wastes should have an impermeable floor or surface. The impermeable floor I surface should possess the following properties:         <ul> <li>Not liable to chemically react with the materials and their containers to be stored.</li> <li>Able to withstand normal loading and physical damage caused by container handling</li> <li>The integrity and condition of the impermeable floor or surface should be inspected at regular intervals to ensure that it is satisfactorily maintained</li> </ul> </li> <li>For liquid chemicals and chemical wastes storage, the storage area should be bonded to contain at least 110% of the storage capacity of the largest containers or 20% of the total quantity of the chemicals/chemical wastes stored, whichever is the greater.</li> <li>Storage container should be checked at regular intervals for their structural integrity and to ensure that the caps or fill points are tightly closed.</li> <li>Chemical handling should be conducted by trained workers under supervision.</li> </ul>	Period	
6.66	5.22 (ii)	Chemicals and Chemical Wastes Spillage Response         A Chemicals and / or Chemical Wastes Spillage Response Plan should be prepared by the operator to document in detail the appropriate response procedures for chemicals or chemical wastes spillage incidents. General procedures to be undertaken in case of chemicals I chemical waste spillages are presented below         • Training         • Training on spill response actions should be given to relevant staff. The training should cover the followings:         • Tools & resources to handle spillage, e.g. locations of spill handling equipment;         • General methods to deal with spillage; and         • Procedures for emergency drills in the event of spills.         • Communication         Establish communication channel with Fire Services Department (FSD) and EPD to report the spillage incident so that necessary assistance from relevant department	Whole Site / During Operation Period	√

EIA Ref. EM&A	Environmental Protection Measures	Location/ Timing	Status
Log Ref.			
6.67 - 5.23- 5.25 6.69	<ul> <li>could be quickly sought.</li> <li>Response Procedures Any spillage within OWTF site should be reported to the Site Manager. Site Manager shall attend to the spillage and initiate any appropriate actions needed to confine and clean up the spillage. The response procedures should include the followings: <ul> <li>Identify and isolate the source of spillage as soon as possible;</li> <li>Contain the spillage and avoid infiltration into soil / groundwater and discharge to storm water channels (in case the spillage occurs at locations out of the designated storage areas); <ul> <li>Remove the spillage; the removal method / procedures documented in the Material Safety Data Sheet (MSDS) of the chemicals spilled should be observed;</li> <li>Clean up the contaminated area (in case the spillage occurs at locations out of the designated storage areas); and <ul> <li>The waste arising from the cleanup operation should be considered as chemical wastes.</li> </ul> </li> <li>Incident Record</li> <li>After any spillage, an incident report should be prepared by the Site Manager. The incident report should contain details of the incident including the cause of the incident, the material spilled and estimated spillage amount, and also the response actions undertaken. The incident record should be kept carefully and able to be retrieved when necessary. <ul> <li>The incident report should provide sufficient details for the evaluation of any environmental impacts due to the spillage and assessment of the effectiveness of measures taken.</li> <li>In case any spillage or accidents results in significant land contamination, EPD should be informed inmediately and the Project operator should be responsible for the cleanup of the affected area. The responses procedures described in Sections 6.65 - 6.66 of the EIA Report should be followed accordingly together with the land contamination assessment and remediation guidelines stipulated in the <i>Guidance Note for Risk-based Remediation Goals for Contaminated La</i></li></ul></li></ul></li></ul></li></ul>	Whole Site / During Operation Period	√

EIA Ref.	EM&A	Environmental Protection Measures	Location/ Timing	Status
	Log Ref.			
7.98 &	Table 6.2	Operation Phase	Within Project Area / During	
Table 7.8		<ul> <li>Aesthetic design of the facade, including its colour theme, pattern, texture, materials, finishing and associated structures to harmonize with the surrounding settings</li> <li>Grass / groundcover planting to soften the roof</li> <li>Heavy standard tree planting to screen proposed associated structures</li> <li>Grasscrete paving to soften the harshness of large paved surface areas wherever possible</li> </ul>	Design & Operation Stages	

Remark:

- $\sqrt{}$  Compliance of Mitigation Measures
- <> Compliance of Mitigation but need improvement
- x Non-compliance of Mitigation Measures
- ▲ Non-compliance of Mitigation Measures but rectified by OSCAR Bioenergy JV
- Δ Deficiency of Mitigation Measures but rectified by OSCAR Bioenergy JV
- N/A Not Applicable in Reporting Period

Annex D

Waste Flow Table

## No. EP/SP/61/10 of Organic Resources Recovery Centre (Phase 1) Monthly Summary Waste Flow Table

		Wast	e Generated from Pr	retreatment Process					Genera	l Refuse			
Month	Chemical Waste	Disposed of at Landfill (see Note 1)	Metals (see Note 2)	Paper/ cardboard packaging (see Note 2)	Plastics (see Note 3)	Dispose Landfill (se & 4	ee Note 1	Metals (see	e Note 2)	Paper/ ca packaging 2)		Plas (see N	
	Litre	tonne	tonne	tonne	tonne	No. of collection	tonne	No. of collection	tonne	No. of collection	tonne	No. of collection	tonne
March 2019	1,200	477.08	0	0	0	26	1.50	0	0	0	0	0	0
April 2019	0	455.60	0	0	0	22	1.27	0	0	0	0	0	0
May 2019	1,000	528.22	0	0	0	25	2.88	0	0	0	0	1	0.39
June 2019	0	459.23	0	0	0	24	2.76	0	0	0	0	0	0
July 2019	0	521.79	0	0	0	26	3.00	0	0	0	0	0	0
August 2019	40	441.05	0	0	0	27	3.11	0	0	0	0	0	0
September 2019	1,800	576.28	0	0	0	24	2.76	0	0	0	0	0	0
October 2019	0	441.22	0	0	0	25	2.88	0	0	0	0	0	0
November 2019	1,600	451.57	0	0	0	26	3.00	0	0	0	0	0	0
December 2019	1,009	488.13	0	0	0	24	2.76	0	0	0	0	0	0
January 2020	0	388.20	0	0	0	23	2.65	0	0	0	0	0	0
February 2020	4,525	372.97	0	0	0	24	2.76	0	0	0	0	0	0
March 2020	1,200	351.71	0	0	0	27	3.11	0	0	0	0	0	0
April 2020	0	363.92	0	0	0	21	2.42	0	0	0	0	0	0
May 2020	800	294.36	0	0	0	25	2.88	0	0	0	0	0	0
June 2020	0	347.23	0	0	0	25	2.88	0	0	0	0	0	0
July 2020	200	852.07	0	0	0	26	3.00	0	0	0	0	0	0
August 2020	0	700.25	0	1.20	0	25	2.88	0	0	0	0	0	0
September 2020	400	579.64	0	5.31	0	26	3.00	0	0	0	0	0	0
October 2020	0	840.75	0	5.83	0	24	2.76	0	0	0	0	0	0
November 2020	0	688.20	0	0.80	0	25	2.88	0	0	0	0	0	0
December 2020	766	685.47	0	0	0	25	2.88	0	0	0	0	0	0
January 2021	1,800	634.00	0	0	0	25	2.88	0	0	0	0	0	0
February 2021	6,120	377.72	0	0	0	21	2.42	0	0	0	0	0	0
March 2021	6,000	325.21	0	0	0	27	3.11	0	0	0	0	0	0

		Wast	e Generated from Pr	retreatment Process					Genera	l Refuse			
Month	Chemical Waste	Disposed of at Landfill (see Note 1)	Metals (see Note 2)	Paper/ cardboard packaging (see Note 2)	Plastics (see Note 3)	Dispose Landfill (s & ·	ee Note 1	Metals (see	e Note 2)	Paper/ ca packaging 2)	(see Note	Plas (see N	
	Litre	tonne	tonne	tonne	tonne	No. of collection	tonne	No. of collection	tonne	No. of collection	tonne	No. of collection	tonne
April 2021	9,700	651.29	0	0	0	22	2.53	0	0	0	0	0	0
May 2021	4,000	671.03	0	0	0	24	2.76	0	0	0	0	0	0
June 2021	0	558.72	0	0	0	25	2.88	0	0	0	0	0	0
July 2021	0	382.74	0	0	0	26	3.00	0	0	0	0	0	0
August 2021	3,420	687.05	0	0	0	26	3.00	0	0	0	0	0	0
September 2021	2,400	304.01	0	0	0	25	2.88	0	0	0	0	0	0
October 2021	0	342.38	0	0	0	23	2.65	0	0	0	0	0	0
November 2021	2,000	394.26	0	0	0	26	3.00	0	0	0	0	0	0
December 2021	0	392.44	0	0.67	0	22	2.53	0	0	0	0	0	0
January 2022	0	359.27	0	0	0	23	2.65	0	0	0	0	0	0
February 2022	0	260.57	0	0	0	21	2.42	0	0	0	0	0	0
March 2022	0	253.75	0	0	0	23	2.65	0	0	0	0	0	0
April 2022	1,240	253.45	0	0	0	22	2.53	0	0	0	0	0	0
May 2022	0	354.94	0	0	0	24	2.76	0	0	0	0	0	0
June 2022	0	383.35	1.79	0.08	0	25	2.88	0	0	0	0	0	0
July 2022	0	430.89	4.75	1.12	0	24	2.76	0	0	0	0	0	0
Total	51,220	19,322.02	6.54	15.01	0	999	112.32	0	0	0	0	1	0.39

Notes:

1. General refuse was disposed of at NENT by subcontractors.

Metal and paper/cardboard packaging were collected by recycler for recycling. 2.

 Plastics refer to plastic bottles/containers, plastic sheets/foam from packaging material collected by recycler for recycling.
 It was assumed that four 240-litre bins filled with 80% of general refuse were collected at each collection. The general refuse density was assumed to be around 0.15 kg/L.

Annex E

Environmental Complaint, Environmental Summons and Persecution Log

<b>Reporting Month</b>	Number of Complaints in Reporting Month	Number of Summons/Prosecutions in Reporting Month
May 2015	0	0
June 2015	0	0
July 2015	0	0
August 2015	0	0
September 2015	0	0
October 2015	0	0
November 2015	0	0
December 2015	0	0
January 2016	0	0
February 2016	0	0
March 2016	0	0
April 2016	0	0
May 2016	0	0
June 2016	0	0
July 2016	0	0
August 2016	0	0
September 2016	0	0
October 2016	0	0

# Annex E Cumulative Complaint and Summons/Prosecutions Log

Reporting Month	Number of Complaints in Reporting Month	Number of Summons/Prosecutions in Reporting Month
November 2016	0	0
December 2016	0	0
January 2017	0	0
February 2017	0	0
March 2017	0	0
April 2017	0	0
May 2017	0	0
June 2017	0	0
July 2017	0	0
August 2017	0	0
September 2017	0	0
October 2017	0	0
November 2017	0	0
December 2017	0	0
January 2018	0	0
February 2018	0	0
March 2018	0	0
April 2018	0	0
May 2018	0	0
June 2018	0	0

Reporting Month	Number of Complaints in Reporting Month	Number of Summons/Prosecutions in Reporting Month
July 2018	0	0
August 2018	0	0
September 2018	1	0
October 2018	0	0
November 2018	0	0
December 2018	0	0
January 2019	0	0
February 2019	0	0
March 2019	0	0
April 2019	0	0
May 2019	0	0
June 2019	0	0
July 2019	0	0
August 2019	0	0
September 2019	0	0
October 2019	0	0
November 2019	0	0
December 2019	0	0
January 2020	0	0
February 2020	0	0

Reporting Month	Number of Complaints in Reporting Month	Number of Summons/Prosecutions in Reporting Month
March 2020	0	0
April 2020	0	0
May 2020	0	0
June 2020	0	0
July 2020	0	0
August 2020	0	0
September 2020	0	0
October 2020	0	0
November 2020	0	0
December 2020	0	0
January 2021	0	0
February 2021	0	0
March 2021	0	0
April 2021	0	0
May 2021	0	0
June 2021	0	0
July 2021	0	0
August 2021	0	0
September 2021	0	0
October 2021	0	0

Reporting Month	Number of Complaints in Reporting Month	Number of Summons/Prosecutions in Reporting Month
November 2021	0	0
December 2021	0	0
January 2022	0	0
February 2022	0	0
March 2022	0	0
April 2022	0	0
May 2022	0	0
June 2022	0	0
July 2022	0	0
<b>Overall Total</b>	1	0

#### ENVIRONMENTAL RESOURCES MANAGEMENT

Annex F

Investigation Report

Date	1 – 31 July 2022
Time	Continuous monitoring throughout July 2022
Monitoring Location	Continuous Environmental Monitoring System (CEMS)
Parameter	Various emission parameters of the Cogeneration Units (CHP) and
	the Ammonia Stripping Plant (ASP)
Exceedance Description	<ol> <li>Continuous monitoring was carried out at the CAPCS, CHP and ASP throughout the reporting period using the CEMS. According to the EM&amp;A Manual, exceedance is considered if the emission concentration of the concerned pollutants is higher than the emission limits stated in Tables 2.2, 2.3 and 2.5 of the EM&amp;A Manual (Version F) for CAPCS, CHP and ASP respectively. The concentration of the concerned air pollutants were monitored on-line by the CEMS. Exceedances of various emission parameters were recorded on the CEMS including:         <ul> <li>NOx and SO<sub>2</sub> from the CHPs</li> <li>NOx, SO<sub>2</sub>, and NH<sub>3</sub> from ASP</li> </ul> </li> <li>The Contractor has investigated the cause of the exceedance and identified that</li> <li>The exceedances of SO<sub>2</sub> from the CHPs occurred due to tripping of the de-sulphurisation system resulted from the residue of sulphur accumulated at the exhaust heat exchangers.</li> <li>The exceedances of NO<sub>x</sub> from CHPs occurred due to system instability caused by prolonged usage of the CHPs.</li> <li>The exceedance of NOx, SO<sub>2</sub> and NH<sub>3</sub> from ASP</li> <li>The exceedance of NOx, SO<sub>2</sub> and NH<sub>3</sub> from ASP</li> <li>The exceedance of NOx, SO<sub>2</sub> and NH<sub>3</sub> from ASP</li> </ol>
to be Taken	CHPs to remove potential sulphur residue from the exhaust gas
	system and replaced all catalytic convertors with an aim to
	improve the CO removal efficiency of the system. The Contractor has also arranged cleaning of the ASP heat exchanger to optimise its performance. A planned overhaul of CHP 2 is expected to complete in the part reporting period
Remedial Works and	CHP 2 is expected to complete in the next reporting period.
	The Contractor has arranged a specialist to review the CEMS
Follow-up Actions	system performance and accuracy since last reporting period. The specialist will formulate plan(s) to improve the accuracy of the SICK system.
	The Contractor is recommended to closely monitor the processes, including the modification works and follow-up emission monitoring of the ASP to avoid exceedance.

## Investigation Report of CEMS Exceedances

The Contractor should review the routine inspection and
maintenance schedule of the ASP and conduct preventative
maintenance to avoid similar re-occurrence of the equipment
failure.

Prepared by:Angela Yung (MT representative)Date8 August 2022

Date	6 July 2022
Time	10:42 am
Monitoring Location	Location 7 (at the car park outside the Visitor Centre)
Parameter	Odour Intensity
Exceedance Description	<ol> <li>According to the EM&amp;A Manual, exceedance is considered if Odour Intensity recorded at the odour patrol is Level 2 or above. During the odour patrol on 6 July 2022 morning, the odour patrol panellists identified the scent of garbage with Odour Intensity of 2 at location 7 (refer to Annex G for location detail). An Odour Intensity lower than 2 was later recorded at the same monitoring location in the afternoon of the same day.</li> <li>An investigation was carried out by the Contractor and the source of the odour was a mixture of the scents of garbage and the de-odorising agent used for the Suspension Buffer</li> </ol>
	Tank (SBT) cleaning undertaken during the odour patrol <sup>(1)</sup> .
Action Taken / Action to be Taken	Another round of odour patrol was carried out on 19 July 2022, the Odour Intensity recorded from this odour patrol was under 2 (refer to Annex G for the result of both rounds of odour patrol).
Remedial Works and Follow-up Actions	The Contractor is currently exploring alternative de-odorising agent(s) to minimise the odour impact.

#### Investigation Report of Odour Exceedances

Prepared by:	Angela Yung (MT representative)
Date	9 August 2022

<sup>(1)</sup> SBT cleaning was carried out from 30 June to 19 July 2022.

Annex G

Odour Patrol Result



ALS Technichem (HK) Pty Ltd 11/F, Chung Shun Knitting Centre 1-3 Wing Yip Street Kwai Chung, N.T., Hong Kong 1+852 2610 1044 <u>E</u>+852 2610 2021

CERTIFICATE OF ANALYSIS									
CLIENT:	OSCAR BIOENERGY JOINT VENTURE	WORK ORDER:	HK2225675						
CONTACT:	MS ANGEL TJIA								
ADDRESS:	NO. 5, SHAM FUNG ROAD,	LABORATORY:	HONG KONG						
	SIU HO WAN, NORTH LANTAU	SUB-BATCH:	0						
	ISLAND, NT, HONG KONG	DATE OF PATROL:	06 JULY, 2022						
		DATE OF ISSUE:	18 JULY, 2022						
PROJECT:	ODOUR PATROL FOR THE ORGANIC RESOURCES	SAMPLE TYPE:	ODOUR PATROL						
	RECOVERY CENTRE PHASE 1 IN SIU HO WAN	*							
SITE:	ORGANIC RESOURCES RECOVERY CENTRE PHASE 1 (O-PARK 1)	NO. OF LOCATIONS:	8						

#### COMMENTS

Odour Patrol was conducted by the staff of ALS Technichem (HK) Pty Ltd during 10:40 - 11:12, 11:34 - 12:00 and 15:55 - 16:13. Additional odour patrol was conducted in the morning time due to having an odour intensity level of 2 at location 7.

Sampling information (Project name, Sample ID) is provided by client.

NOTES

This is the Final Report and supersedes any preliminary report with this batch number.

The results related only to the items tested. All pages of this report have been checked and approved for release.

Richard Managing Director Hong Kong

This report may not be reproduced except with prior written approval from ALS Technichem (HK) Pty Ltd.



#### 1. Summary of Work

The odour patrol was conducted during daytime and evening time.

#### 2. Odour Patrol

Odour patrolling is a process to make use of the calibrated olfactory senses (i.e. the nasal sense) of the patrol members to evaluate the odour and its intensity during a patrol exercise at the site.

The patrol work was conducted by two odour patrol team members from ALS Technichem (HK) Pty Ltd during each time session. All members are free from any respiratory diseases during patrol day. None of the members has been working or living in the area of the vicinity of the inspection zone.

The patrol team was required to move slowly from one to the other monitoring locations and use their olfactory senses to detect odour at each location.

The location of odour sources and the areas to be affected by the odour nuisance were identified as much as possible.

During the patrolling, the meteorological and surrounding information were recorded:

- the prevailing weather condition;
- the wind direction;
- the wind speed;
- location where odour is spotted;
- possible source of odour;
- perceived intensity of the odour;
- duration of odour; and
- characteristics of the odour detected.

The perceived intensity is to be divided into 5 levels which are ranked in an ascending order as follows:

0	Not detected	No odour perceives or an odour so weak that it cannot be easily characterised or described				
1	1 Slight Identifiable odour, slight					
2	Moderate	Identifiable odour, moderate				
3	Strong	Identifiable odour, strong				
4	Extreme	Severe odour				

The odour patrol location was shown in Appendix 1.



3. 3.1 **Odour Patrol Result:** 

# Daytime (First Round):

Location	Panellist	Weather	Time	т	RH	WS	WD (Degree)	Odour	Duration of	Duration of	Duration of	Duration of	Duration of	Duration of	Duration of	Direction from	On-Site O	bservation
Loca	Pane	Wea	Time	(°C)	(%)	(m/s)	W (Deg	Intensity	Odour	Odour Source	Odour Characteristics	Potential Odour Source						
8	1	Cloudy	10:40	28.4	84.7	0.5	152	1	Continuous	Side wind	Garbage	Pre-Treatment						
0	2	Cloudy	10.40	20.4	04.7	0.5	172	1	Continuous	Side Willd	Garbaye	Hall						
7	1	Cloudy	10:42	28.8	87.9	1.1	167	2	Continuous	Downwind	Garbage	#3 Pre- Treatment Hall						
	2	Cloudy	10.42	20.0	07.9	1.1	107	2	Continuous	Downwind	Garbaye	(Gate opened)						
2	1	Cloudy	10:45	28.4	90.6	0.0		1	Continuous	Continuous NA	Piegos	Biogas Tank						
2	2	Cloudy	10.43	20.4	90.0	0.0		1	Continuous			Biogas	Valve Holder					
3	1	Cloudy	10:46	28.6	93.7	0.0	0.0	0.0	0.0	0.0		0.0		0		NA NA	NA	
S	2	Cloudy	10.40	20.0	95.7	0.0		0	NA	NA		NA						
5	1	Claudy	10.50	29.3	89.3	0.0		1	Intermittent	NA	Grassy	Vegetation						
5	2	Cloudy	10:50	29.5	09.3	0.0		0	NA	NA	NA	NA						



tion	illist	ther	Times	т	RH	WS	WD egree)	Odour Duration		Direction	On-Site O	bservation
Location	Panellist	Weather	Time	(°C)	(%)	(m/s)	WD (Degre	Intensity	Intensity Odour	from Source	Odour Characteristics	Potential Odour Source
6	1	Cloudy	11:06	29.5	86.2	1.8	113	0	NA	NA	NA	NA
	2	cloudy	11.00	23.5	00.2	1.0	115	0				
9	1	Cloudy	11:09	29.5	85.7	1.6	158	1	Intermittent	Downwind	Compost	Composting Hall
9	2	Cloudy	11.09	29.5	05.7	1.0	130	1	mermittent	Downwind	Composi	Compositing fram
10	1	Claudy	11:12	25.5	73.1			0	NA	NA	NA	NA
10	2	Cloudy	11.12	23.5	/3.1	-	_	0	NA	NА	NA	NA

Remark: T: Air Temperature; RH: Relative Humidity; WS: Wind Speed; WD: Wind Direction.



# 3.2 Daytime (Second Round):

Location	Panellist	Weather	Time	т	RH	WS	WD (Degree)	Odour	Duration of	Direction	On-Site Observation			
Loca	Pane	Wea	Time	(°C)	(%)	(m/s)	(Deg	Intensity	Odour	from Source	Odour Characteristics	Potential Odour Source		
8	1	Claudy	11:34	29.8	<b>01 0</b>	0.6	1 4 4	0	NA	NA	NA	NA		
0	2	Cloudy	11.54	29.0	84.9	0.6	144	0		NA	NA NA	NA		
7	1	- Cloudy 11:36	11:36	11.20	11.20	29.6	85.0		170	1	Continuous	Downwind		#4 Pre- Treatment Hall
	2			29.0	03.0	0.4	176	1	Continuous	Downwind	Garbage	(Gate opened)		
2	1	Claudu	1	20.4	96.4	0.0	011	1	Continuous	Side wind	Biogas	Biogas Tank Valve Holder		
2	2	Cloudy	11:48	30.4	86.4	0.9		1	Intermittent					
3	1	Cloudy	11:49	30.3	87.9	0.0		1	Intermittent	NA	Biogas	Biogas Tank Valve Holder		
5	2	cloudy	uuy 11.49 )	50.5	07.9			0	NA	NA	NA	NA		
F	1	Claud	11:53	29.7	89.1	0.0		1		NA	Cracov	Vagatation		
5	2	Cloudy						1	Continuous	NA	Grassy	Vegetation		



cation	illist	ther	Times	т	RH	WS	D Iree)	Odour	Duration of	Direction	On-Site Observation	
Loca	Panellist	Weather	Time	(°C)	(%)	(m/s)	WD (Degree)	Intensity	Odour	from Source	Odour Characteristics	Potential Odour Source
6	1	Cloudy	11:55	29.7	88.4	1.1	117	0	NA	NA	NA	NA
	2	cloudy		2317				0				
0	1	Claudy	y 11:57	20.0	070	0.3	265	0	NA	NA	NA	NA
9	9 2	Cloudy		29.9	87.8			0		NA		
10	1	Claudy	12.00	25.5	71.1	-		0	NA	NA	NA	NA
10	2	Cloudy	12:00					0				

Remark: T: Air Temperature; RH: Relative Humidity; WS: Wind Speed; WD: Wind Direction.



## 3.3 Evening time:

Location	Panellist	Weather	Time	т		WS	D ree)	Odour	Duration of	Direction	On-Site Observation	
Loca	Pane	Wea	Time	(°C)	RH (%)	(m/s)	WD (Degree)	Intensity	Odour	from Source	Odour Characteristics	Potential Odour Source
8	1	Cloudy	15:55	28.9	81.2	0.0		0		NA	NA	
0	2	Cloudy	13.33	20.9	01.2	0.0		0	NA			NA
7	1	Cloudy	15:58	29.8	77.7	1.1	183	1	Continuous	Downwind	Garbage	#1 Pre- Treatment Hall
	2	Cloudy	13.30	29.0	//./	1.1	105	1	Continuous		Guibage	
2	1	Cloudy	16:01	6:01 29.2	79.5	1.1	039	1	Intermittent	Side wind	Biogas	Biogas Tank Valve Holder
2	2	Cloudy						1				
3	1	Cloudy	16.02	20.0	70.9	1 2	096	0		NA	NA	NA
5	2	Cloudy	16:02	29.0	79.8	1.3		0	NA	NA	NA	
5	1	Cloudy	y 16:06	20.2	01 /	0.0		0	NA	NA	NA	NA
	2			30.2	81.4			0				



tion	Panellist	Weather	Time	т	RH	WS	WD (Degree)	Odour	Duration of Odour	Direction from Source	On-Site Observation	
Location	Pane	Wea	Time	(°C)	(%)	(m/s)	W (Deg	Intensity			Odour Characteristics	Potential Odour Source
6	1	Cloudy	16:08	29.5	79.7		120	0			NA	NA
0	2 Cloudy	Cloudy	10.08	29.5	79.7	0.8	129	0	NA	NA		
9	1	Claudy	16:10	20.6	9.6 82.5	0.0		0	NA	NA	NA	NA
9	2	Cloudy		29.0				0				
10	1	- Cloudy	ıdy 16:13	25.2	.3 69.0 0 NA NA			0				
10 —	2			25.3		NA	A NA	NA				

Remark:

Air Temperature; Relative Humidity; Wind Speed; Wind Direction. T:

RH: WS: WD:



## **Odour Patrol Route**








A2.1 Odour Patrol at Different Locations - Daytime (First round)



Location: 2



Location: 7

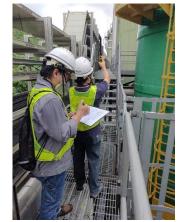

Location: 3



Location: 8



Location: 5



Location: 9



Location: 6



Location: 10 Page 10 of 14



A2.2 Odour Patrol at Different Locations - Daytime (Second Round)



Location: 2



Location: 3



Location: 5



Location: 6



Location: 7



Location: 8



Location: 9



Location: 10

Page 11 of 14



A2.2 Odour Patrol at Different Locations - Evening time



Location: 2



Location: 7





Location: 8



Location: 5



Location: 9



Location: 6




Location: 10

Page 12 of 14




#### Extract of Meteorological Observations from Hong Kong Airport Observatory Station

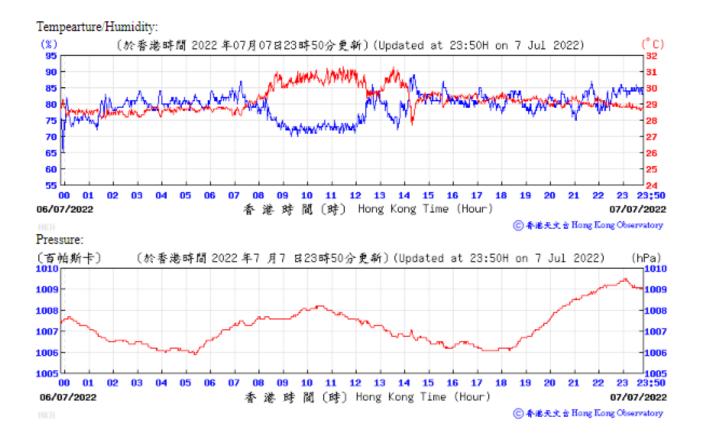

Page 13 of 14



#### Wind Direction:

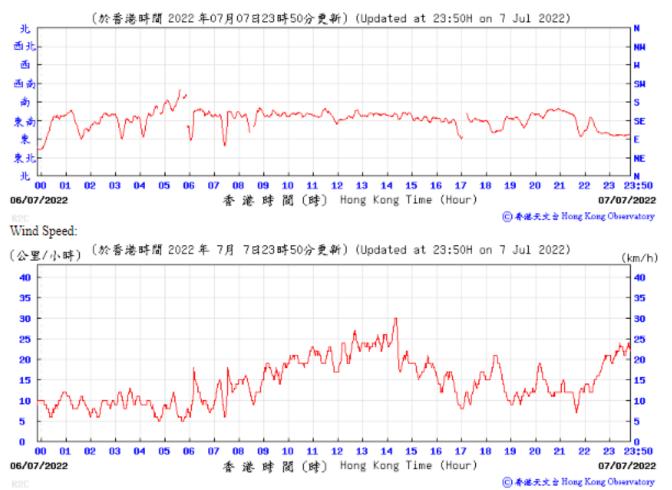



ALS Technichem (HK) Pty Ltd 11/F, Chung Shun Knitting Centre 1-3 Wing Yip Street Kwai Chung, N.T., Hong Kong <u>T</u>+852 2610 1044 <u>F</u>+852 2610 2021

CERTIFICATE OF ANALYSIS										
CLIENT:	OSCAR BIOENERGY JOINT	WORK ORDER:	HK2227993							
CONTACT:	VENTURE MS ANGEL TJIA									
ADDRESS:	NO. 5, SHAM FUNG ROAD,	LABORATORY:	HONG KONG							
	SIU HO WAN, NORTH LANTAU	SUB-BATCH:	0							
	ISLAND, NT, HONG KONG	DATE OF PATROL:	19 JULY 2022							
		DATE OF ISSUE:	26 JULY 2022							
PROJECT:	AD HOC ODOUR PATROL FOR THE ORGANIC RESOURCES	SAMPLE TYPE:	ODOUR PATROL							
	RECOVERY CENTRE PHASE 1 IN									
	SIU HO WAN									
SITE:	ORGANIC RESOURCES	NO. OF	8							
	RECOVERY CENTRE PHASE 1 (O-PARK 1)	LOCATIONS:								

#### COMMENTS

This was an ad hoc odour patrol event requested by the client and conducted by ALS Technichem staff during 11:03 - 11:20.

Sampling information (Project name, Sample ID) is provided by client.

NOTES

This is the Final Report and supersedes any preliminary report with this batch number.

The results related only to the items tested. All pages of this report have been checked and approved for release.

Richard Fung Managing Director Hong Kong

This report may not be reproduced except with prior written approval from ALS Technichem (HK) Pty Ltd.



#### 1. Summary of Work

This ad hoc odour patrol was conducted on 19 July 2022 at eight (8) selected locations as requested by the client.

#### 2. Odour Patrol

Odour patrolling is a process to make use of the calibrated olfactory senses (i.e. the nasal sense) of the patrol members to evaluate the odour and its intensity during a patrol exercise at the site.

The patrol work was conducted by two odour patrol team members from ALS Technichem (HK) Pty Ltd during each time session. All members are free from any respiratory diseases during patrol day. None of the members has been working or living in the area of the vicinity of the inspection zone.

The patrol team was required to move slowly from one to the other monitoring locations and use their olfactory senses to detect odour at each location.

The location of odour sources and the areas to be affected by the odour nuisance were identified as much as possible.

During the patrolling, the meteorological and surrounding information were recorded:

- the prevailing weather condition;
- the wind direction;
- the wind speed;
- location where odour is spotted;
- possible source of odour;
- perceived intensity of the odour;
- duration of odour; and
- characteristics of the odour detected.

The perceived intensity is to be divided into 5 levels which are ranked in an ascending order as follows:

0	Not detected	No odour perceives or an odour so weak that it cannot be easily characterised or described
1	Slight	Identifiable odour, slight
2	Moderate	Identifiable odour, moderate
3	Strong	Identifiable odour, strong
4	Extreme	Severe odour

The odour patrol location was shown in Appendix 1.



## 3. Odour Patrol Result:

Location	Panellist	Weather	Time	т	RH	WS	WD (Degree)	Odour	Duration of	Direction	On-Site Observation	
Loca	Pane	Wea	Time	(°C)	(%)	(m/s)	бәД) М	Intensity	Odour	from Source	Odour Characteristics	Potential Odour Source
8	1	Fine	11:03	33.1	77.4	1.9	100	1	Intermittent	Side wind	Garbage	Pre-Treatment
0	2	Fille	11.05	55.1	//.4	1.9	186	1	mermittent	Side willd	Garbage	Hall
7	1	Fine 11:04	11:04	33.0	75.6	0.8	130	1	Intermittent	Side wind	Garbage	Pre-Treatment Hall
	2	Fille		55.0				1		Side wind	Garbage	
2	1	Fino	Fine 11:07	31.8	82.8	0.8	153	0	NA	NA	NA	NA
2	2	Fille		21.0				0				
3	1	Fino	11.00	22.1	01 7	0 0	120	0		NA	NA	NA
5	2	Fine	11:09	32.1	84.3	0.8		0	NA	NA	NA	
5	1	Fine	11.17	31.4	86.1	1.2	109	1		Downwind	Grassy	Vegetation
ر ا	2		11:12					1	Intermittent			



tion	Location	Weather	Times	т	RH	ws	WD egree)	Odour	Duration of Odour	Direction from Source	On-Site Observation	
Loca	Pane	Wea	Time	(°C)	(%)	(m/s)	(Degre	Intensity			Odour Characteristics	Potential Odour Source
6	1	Fine	Fine 11:14	32.6	80.6	0.6	124	0	NA	NA	NA	NA
	2							0				
9	1	Fine	11:17	31.9	87.0	0.7	292	1	Continuous	Upwind	Compost	Composting Hall
9	2	Fine		51.9	87.0			1				
10	1	Fino	11:20	26.9	72.7	NA	NA	1	NA	NA	Musty	Air Conditioning System
10	2	Fine		20.9				1				


Remark:

Air Temperature; Relative Humidity; Wind Speed; Wind Direction. T: RH: WS:

WD:



#### **Odour Patrol Route**

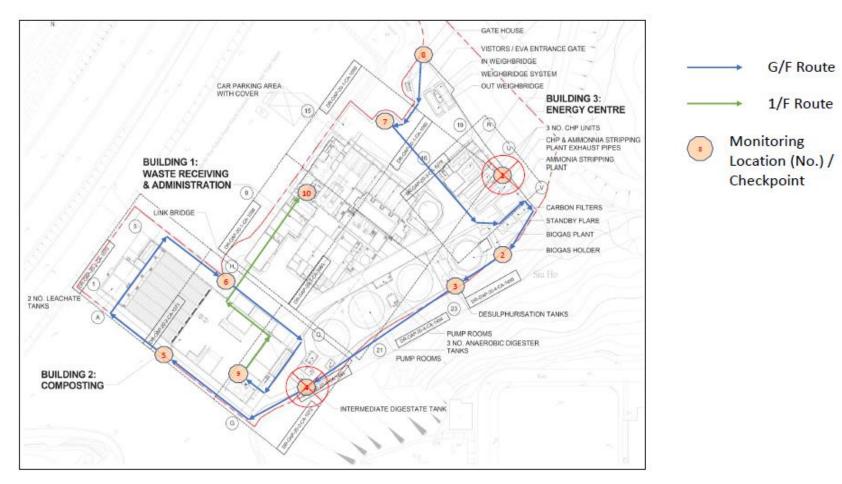





Location: 2



Location: 7



Location: 3



Location: 8



Location: 5



Location: 9




Location: 6



Location: 10



#### Extract of Meteorological Observations from Hong Kong Airport Observatory Station

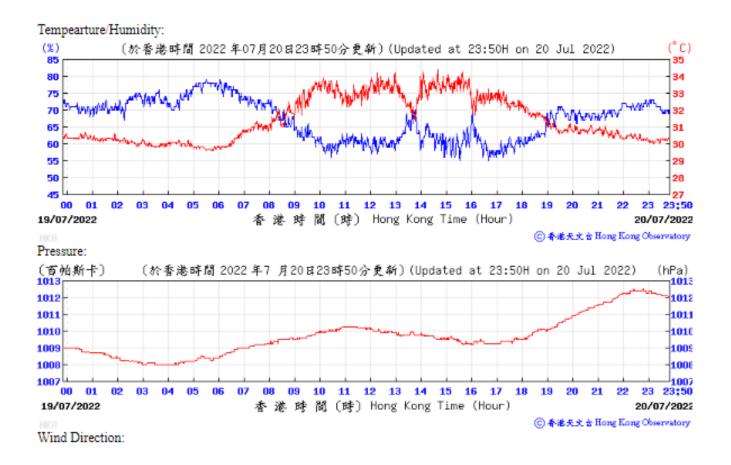



#### Wind Direction:

