



Installation of Additional Gas-fired Generation Unit (CCGT Unit No.2)

Quarterly EM&A Report No. 21

22 March 2022 Project No.: 0554663



Document details	
Document title	Installation of Additional Gas-fired Generation Unit (CCGT Unit No.2)
Document subtitle	Quarterly EM&A Report No.21
Project No.	0554663
Date	22 March 2022
Version	1
Author	SC
Client Name	Castle Peak Power Company Limited (CAPCO)

Document history

				ERM appro	ERM approval to issue	
Version	Revision	Author	Reviewed by	Name	Date	Comments
Draft	1.0	SC	JN	JN	22.3.2022	-



Installation of Additional Gas-fired Generation Units at the Black Point Power Station (CCGT Unit No. 2) Environmental Certification Sheet No. EP-507/2016/C, FEP-03/507/2016/C and FEP-04/507/2016/C

Reference Document/Plan

Document/ Plan to be Certified/ Verified :	Quarterly EM&A Report No.21
Date of Report:	22 March 2022
Date prepared by ET:	22 March 2022
Date received by IEC:	

Reference EM&A Manual/ EP Requirement

EM&A Manual (AEIAR-197/2016): Sections 15.1 & 15.5

Content: Quarterly EM&A Reports

In accordance with Annex 21 of the EIAO-TM, a copy of the monthly, quarterly summary and final review EM&A reports will be made available to the Director of Environmental Protection.

The ET Leader will submit Quarterly EM&A Summary Reports for the construction phase EM&A works only.

ET Certification

I hereby certify that the above referenced document/plan complies with the above referenced requirement of EM&A Manual (AEIAR-197/2016).

Dr Jasmine Ng, Environmental Team Leader:

1.16	[
	ALLINE
2	asmile

Date:

22 March 2022

IEC Verification

I hereby verify that the above referenced document/plan complies with the above referenced requirement of EM&A Manual (AEIAR-197/2016).

Mr Thomas Chan, Independent Environmental Checker:

Non len

Date: 25 March 2022

Signature Page

22 March 2022

Installation of Additional Gas-fired Generation Unit (CCGT Unit No.2)

Quarterly EM&A Report No.21

Dr Jasmine Ng Partner

ERM-Hong Kong, Limited 2509, 25/F One Harbourfront 18 Tak Fung Street Hung Hom, Kowloon Hong Kong

© Copyright 2022 by ERM Worldwide Group Ltd and/or its affiliates ("ERM"). All rights reserved. No part of this work may be reproduced or transmitted in any form, or by any means, without the prior written permission of ERM.

CONTENTS

EXEC	UTIVE	SUMMARY	. 6			
	Environ	ry of the Construction Works undertaken during the Reporting Period mental Site Inspection	. 6			
	Environ	mental Exceedance/Non-conformance/Complaint/Summons and Prosecution	. 6			
1.	INTRO	DUCTION	.7			
	1.1 1.2	Purpose of the Report Structure of the Report				
2.	PROJE	CT INFORMATION	. 8			
	2.1 2.2 2.3 2.4 2.5	Background General Site Description Construction Programme and Activities Project Organisation Status of Environmental Licenses, Notification and Permits	8 8 9			
3.	3. ENVIRONMENTAL MONITORING REQUIREMENT					
	3.1	Water Quality Monitoring	11			
4.	IMPLE	MENTATION STATUS OF THE ENVIRONMENTAL PROTECTION REQUIREMENTS				
			12			
	4.1 4.2	Submissions under the Project				
5.	MONIT	ORING RESULTS	13			
	5.1	Waste Management	13			
6.	ENVIR	ONMENTAL SITE INSPECTION	15			
7.	ENVIR	ONMENTAL NON-CONFORMANCE	16			
		 7.1.1 Summary of Monitoring Exceedance	16 16			
8.	CONCI		17			

List of Appendices

APPENDIX A	WORKS AREA FOR CCGT UNITS NO. 1 AND NO. 2 AT THE BLACK POINT POWER STATION
APPENDIX B	CONSTRUCTION PROGRAMME FOR THE REPORTING PERIOD AND COMING MONTHS
APPENDIX C	PROJECT ORGANISATION FOR EM&A IMPLEMENTATION
APPENDIX D	SUMMARY OF IMPLEMENTATION STATUS OF ENVIRONMENTAL MITIGATION
APPENDIX E	WASTE FLOW TABLE

List of Tables

Table 2.1	Summary of the Construction Activities Undertaken during the Reporting Period	9
Table 2.2	Summary of the Status of Valid Environmental Licence, Notification, Permit and	
	Documentations for CCGT Unit No. 2	10
Table 4.1	Status of Required Submission under the CCGT Unit No. 2	12
Table 5.1	Quantities of Waste Generated from CCGT Unit No. 2	13
Table 5.2	Comparison of Estimated Amount of Waste and Actual Amount Generated during th	e
	Reporting Period for CCGT Unit No. 2	14
Table 6.1	Summary of the findings and recommendation for the site inspection in the Reportin	g
	Month	15

EXECUTIVE SUMMARY

The construction works of CCGT Unit No. 2 of the **Additional Gas-fired Generation Units Project at the Black Point Power Station** commenced on 4 June 2020. This is the 21st quarterly Environmental Monitoring and Audit (EM&A) report presenting the EM&A works carried out during the period from 1 December 2021 to 28 February 2022 for CCGT Unit No. 2 in accordance with the EM&A Manual and the requirements of EP-507/2016/C, EP-507/2016/D, FEP-04/507/2016/C and FEP-04/507/2016/D.

Summary of the Construction Works undertaken during the Reporting Period

The major construction works undertaken during the reporting period include:

CCGT Unit No. 2	
Month	Construction Activities undertaken
December 2021	 Site preparation and mobilisation;
	 Concreting for permanent structures and plinths;
	 Rebar works and formwork installation;
	 Blinding works;
	 Backfilling of trench for pipe installation;
	 Permanent road construction; and
	Pressure test for PAB pipe.
January 2022	 Site preparation and mobilisation;
	 Concreting for permanent structures and plinths;
	 Rebar works and formwork installation;
	 Blinding works;
	 Backfilling of trench for pipe installation; and
	Pressure test for PAB pipe.
February 2022	 Site preparation and mobilisation;
	 Concreting for permanent structures and plinths;
	 Rebar works and formwork installation;
	 Blinding works;
	 Backfilling of trench for pipe installation; and
	Pressure test for PAB pipe.

Environmental Site Inspection

For CCGT Unit No.2, joint weekly site inspections were conducted by representatives of the Contractors, CAPCO Project Team and ET on 2, 10, 16, 23 and 30 December 2021; 6, 13, 20, 27 and 31 January 2022; and 17 and 24 February 2022. The site inspection on 11 February 2022 was cancelled due to the outbreak of COVID-19 in the Project site. The representative of the IEC joined the site inspections on 2 December 2021, 6 January 2022 and 24 February 2022. Details of the audit findings and implementation status are presented in *Section 6*.

Environmental Exceedance/Non-conformance/Complaint/Summons and Prosecution

For CCGT Unit No.2:

No non-compliance event was recorded during the reporting period.

No complaint was received during the reporting period.

No summon or prosecution was received in this reporting period.

1. INTRODUCTION

The Castle Peak Power Company Limited (CAPCO) is a joint venture between CLP Power Hong Kong Limited (CLP) and China Southern Power Grid Company Limited with CLP as the operator. ERM-Hong Kong, Limited (ERM) and Mott MacDonald Hong Kong Limited were appointed by CAPCO as the Environmental Team (ET) and the Independent Environmental Checker (IEC), respectively, to undertake the Environmental Monitoring and Audit (EM&A) activities for the installation of CCGT Unit No. 2 of the Additional Gas-fired Generation Units Project at the Black Point Power Station (BPPS) ("the Project").

1.1 Purpose of the Report

This is the twenty-first quarterly EM&A report which summarises the audit findings during the reporting period from 1 December 2021 to 28 February 2022 for CCGT Unit No. 2.

1.2 Structure of the Report

Following this introductory section, the remainder of this *Quarterly EM&A Report* is organised as follows:

Section 2: Project Information

It summarises the background and scope of the project, site description, project organisation and contact details, construction programme, construction works undertaken and status of the Environmental Permits/Licenses during the reporting period;

Section 3: Environmental Monitoring Requirement

It presents the environmental monitoring requirements for the Project;

Section 4: Implementation Status of the Environmental Protection Requirements

It summarises the implementation of environmental protection measures during the reporting period;

Section 5: Monitoring Results

It summarises the monitoring results obtained in the reporting period;

Section 6: Environmental Site Inspection

It summarises the audit findings of the weekly site inspections undertaken within the reporting period;

Section 7: Environmental Non-conformance

It summarises any monitoring exceedance, environmental complaints and summons within the reporting period;

Section 8: Conclusion

2. PROJECT INFORMATION

2.1 Background

The scope of the Project involves the phased construction and operation of up to two additional combined cycle gas turbine (CCGT) units (with an installed capacity of up to 1,200 MW) at the BPPS. The additional generation units will be of CCGT configuration using natural gas as the primary fuel. It is a Designated Project under the *Environmental Impact Assessment Ordinance* (Cap. 499) (EIAO). The current EM&A Programme includes CCGT Unit No. 2.

An EIA of the Additional Gas-fired Generation Units Project was prepared in accordance with the *EIA Study Brief* (No. ESB-286/2015) and the *Technical Memorandum of the Environmental Impact Assessment Process* (*EIAO-TM*) and submitted under the EIAO in February 2016. Subsequent to the approval of the EIA (*EIAO Register Number AEIAR-197/2016*), an Environmental Permit (EP-507/2016) (EP) for CCGT Unit No. 1 was granted by the Director of Environmental Protection (DEP) on 14 June 2016.

An application for Variation of Environmental Permit (No. VEP-575/2020) was submitted to EPD on 30 March 2020 to include CCGT Unit No. 2 and the Variation of Environmental Permit (EP-507/2016/C) was granted on 27 April 2020.

Application for Further Environmental Permit (FEP-201/2020) was submitted to EPD on 3 August 2020 and the Further Environmental Permit (FEP-03/507/2016/C) was granted to the Contractor, Gammon Engineering & Construction Company Limited, of the CCGT Unit No. 2 on 28 August 2020. Further Environmental Permit (FEP-04/507/2016/C) was granted to the Contractor, Siemens Energy Limited, of the CCGT Unit No. 2 on 6 August 2021. The Contractor, Gammon Engineering & Construction Company Limited, had completed the early civil works, and the application for surrender of FEP (FEP-03/507/2016/C) was submitted to EPD on 25 November 2021 and approved on 30 November 2021.

Applications for Variation of Environmental Permits were submitted to EPD on 30 November 2021 to cater for the proposed changes of Project site area and cooling tower. The Variation of Environmental Permit (EP-507/2016/D) was granted on 21 December 2021 and the Further Environmental Permit (FEP-04/507/2016/D) was granted to the Contractor, Siemens Energy Limited, of the CCGT Unit No. 2 on 21 December 2021.

2.2 General Site Description

The proposed location for the Project is within the existing boundaries of the BPPS site. The size of the land reserved for the additional generation units and the associated facilities (the Project Site) is about 33,760 m². Construction works for CCGT Unit No.2 are currently ongoing at the Project Site.

The location plan of key Project components for CCGT Unit No. 2 is shown in Appendix A.

2.3 Construction Programme and Activities

A summary of the major construction activities undertaken in this reporting period is shown in **Table 2.1**. The construction programme for CCGT Unit No. 2 is presented in **Appendix B**.

Table 2.1Summary of the Construction Activities Undertaken during the
Reporting Period

CCGT Unit No. 2	
Month	Construction Activities undertaken
December 2021	 Site preparation and mobilisation;
	 Concreting for permanent structures and plinths;
	 Rebar works and formwork installation;
	 Blinding works;
	 Backfilling of trench for pipe installation;
	 Permanent road construction; and
	Pressure test for PAB pipe.
January 2022	 Site preparation and mobilisation;
	 Concreting for permanent structures and plinths;
	 Rebar works and formwork installation;
	 Blinding works;
	 Backfilling of trench for pipe installation; and
	Pressure test for PAB pipe.
February 2022	 Site preparation and mobilisation;
	 Concreting for permanent structures and plinths;
	 Rebar works and formwork installation;
	 Blinding works;
	 Backfilling of trench for pipe installation; and
	Pressure test for PAB pipe.

2.4 Project Organisation

The project organisational chart and contact details for CCGT Unit No. 2 are shown in Appendix C.

2.5 Status of Environmental Licenses, Notification and Permits

A summary of the valid permits, licences, and/or notifications on environmental protection for CCGT Unit No.2 is presented in *Table 2.2*.

Permit/ Licences/ Notification	Reference	Validity Period	Remarks
Environmental Permit	EP-507/2016	Throughout the Contract	Permit granted on 14 Jun 2016
Variation of Environmental Permit	EP-507/2016/C	Throughout the Contract	Permit granted on 27 Apr 2020
	EP-507/2016/D	Throughout the Contract	Permit granted on 21 Dec 2021
Further Environmental Permit	FEP-04/507/2016/C	Throughout the Contract	Permit granted on 6 Aug 2021
	FEP-04/507/2016/D	Throughout the Contract	Permit granted on 21 Dec 2021
Notification Pursuant to Section 3(1) of the <i>Air Pollution Control</i>	458265	Throughout the Contract	EPD Acknowledgement of receipt dated 17 Jul 2020
(Construction Dust) Regulation	468383	Throughout the Contract	EPD Acknowledgement of receipt dated 9 Jun 2021
Chemical Waste Producer Registration	WPN5213-432- G2892-01	Throughout the Contract	Registration approved on 24 Aug 2020
Billing Account for Disposal of Construction Waste	7037977	Throughout the Contract	Approved on 5 Aug 2020 Surrendered on 12 Nov 2021
	7039993	Throughout the Contract	Approved on 16 Mar 2021
Construction Noise Permit	GW-RW0341-21	25 Aug 2021 – 18 Feb 2022	Approved on 23 Aug 2021
	GW-RW0057-22	19 Feb 2021 – 18 Aug 2022	Approved on 28 Jan 2022
Wastewater Discharge Licence	WT00037278-2020	28 Jan 2021 – 31 Jan 2026	Licence granted on 28 Jan 2021

Table 2.2Summary of the Status of Valid Environmental Licence,
Notification, Permit and Documentations for CCGT Unit No. 2

3. ENVIRONMENTAL MONITORING REQUIREMENT

3.1 Water Quality Monitoring

In accordance with the EM&A Manual, monitoring works are required at a frequency of once per week on the first year of commissioning of the CCGT Unit No.2. The monitoring details including monitoring requirement, locations of monitoring stations will be confirmed and approved by EPD before commissioning of the CCGT Unit No.2.

4. IMPLEMENTATION STATUS OF THE ENVIRONMENTAL PROTECTION REQUIREMENTS

4.1 Submissions under the Project

The Contractors have implemented all the environmental mitigation measures and requirements as stated in the EIA Report, Environmental Permit (EP) and EM&A Manual for the installation of CCGT Unit No. 2.

The implementation status of the environmental mitigation measures for CCGT Unit No.2 during the reporting period is summarised in *Appendix D*. The status of the required submissions under the EP and EM&A Manual for the Project is presented in *Table 4.1*.

Table 4.1 Status of Required Submission under the CCGT Unit No. 2					
EP Condition	Submission	Submission Date			
Sections 15.1 & 15.5 of EM&A	20th Quarterly EM&A Report	23 December 2021			
Manual (AEIAR-197/2016)					
Sections 15.1 & 15.6 of EM&A	5 th Annual EM&A Report	25 January 2022			
Manual (AEIAR-197/2016)					
Condition 3.2 under Environmental	60 th Monthly EM&A Report	14 December 2021			
Permit No. EP-507/2016/C, EP-	61 st Monthly EM&A Report	12 January 2022			
507/2016/D, FEP-04/507/2016/C and FEP-04/507/2016/D	62 nd Monthly EM&A Report	14 February 2022			

4.2 Marine Vessel Operation

During the reporting period, 9 vessels for transport of equipment and materials from Siemens were operated (6, 10, 11 and 13 January 2022; 21 and 22 February 2022).

In accordance with the Vessel Control Plan prepared for the Project under Condition 2.4 of the EP, an environmental briefing to vessel operators was conducted prior to the vessel operations. The environmental briefing has included the following content:

- Requirements under the EP and Vessel Control Plan;
- General education on local cetaceans;
- Predefined and regular marine travel routes for this Project;
- Vessel speed limit within designated areas and areas identified as high presence of Indo-Pacific humpback dolphin;
- Guidelines for safe vessel operation in the presence of cetaceans;
- Guidelines on effluent /wastewater handling from vessels to prevent avoidable water quality impacts; and
- Policy of no dumping of rubbish, food, oil, or chemicals from vessels.

Details of the monitoring method and procedures have been agreed with the IEC before implementation and communicated with the vessel operators. Warning will be noticed to the vessel operators if the predefined and regular marine travel route is not followed. The record of marine travel routes of the works vessels was provided by the vessel operators for inspection and monitoring purposes. There was no major observation and no non-compliance was recorded.

5. MONITORING RESULTS

5.1 Waste Management

The waste generated from this Project includes inert construction and demolition (C&D) materials, and non-inert C&D materials. Non-inert C&D materials are made up of general refuse and recyclable wastes such as plastics and paper/cardboard packaging waste. Steel materials generated from the project are also grouped into non-inert C&D materials as the materials were not disposed of with other inert C&D materials.

With reference to relevant handling records and trip tickets of CCGT Unit No. 2, the quantities of different types of waste generated in the reporting period are summarised in **Table 5.1**. Details of waste management data are presented in **Appendix E.**

Reporting Month			Quantit	у		
	Inert C&D	Chemical	No	on-inert C&D M	/ laterials	
	Materials	laterials Waste (d) General Ro	General Refuse (c)	Recycled materials		
	(a) (b)	Paper/card board	Plastics	Metals		
	(in '000m ³)	(in'000 kg)	(in '000m ³)	(in'000 kg)	(in'000 kg)	(in'000 kg)
December 2021	0.610	0	0.028	0	0	33.150
January 2022	0.002	0	0.012	0	0.410	59.830
February 2022	0.003	0	0.012	0	0	112.650

Table 5.1 Quantities of Waste Generated from CCGT Unit No. 2

Notes:

(a) Inert C&D materials include bricks, concrete, building debris, rubble and excavated spoil.

(b) The inert C&D materials generated from the Project were sent to Tuen Mun Area 38 or Tseung Kwan O Area 137 Fill Bank during the reporting period.

(c) The general refuse generated from the Project was sent to WENT landfill during the reporting period.

(d) Chemical waste includes waste oil and spent pipes with lubricating oil. It is assumed density of waste oil to be 0.8 kg/L.

(e) The cut-off date for waste management data during the reporting period:

- December 2021: 31 December 2021;
- January 2022: 31 January 2022; and
- February 2022: 28 February 2022.

The estimated amount of waste generated from the Project predicted by EIA Report and the actual cumulative quantities of waste generated from the construction phase of the Project during the reporting period are presented in *Table 5.2*. Mitigation measures recommended in EIA Report were implemented by the Contractor as far as practicable and were considered effective in reducing the total quantity of wastes generated during the reporting period.

Table 5.2Comparison of Estimated Amount of Waste and Actual Amount
Generated during the Reporting Period for CCGT Unit No. 2

Type of Material	Estimated Amount for Project	Actual Amount during Reporting Period
Total Amount of Inert C&D	85.050	0.059
Materials disposed as Public Fill ^(a) (in '000m ³)		
Amount of Inert C&D	12.010	0.005
Materials Reused in the		
Contract (in '000m ³)		
Amount of Inert C&D	-	0.551
Materials Reused in Other		
Projects (in '000m ³)		
Total Amount of Non-Inert	1.525	0.052
C&D Materials and General		
Refuse disposed at WENT		
Landfill ^(b) (in '000m ³)		
Chemical Waste ^(c) (in '000kg)	10.20	0
Notes [.]		

Notes:

(a) Inert C&D materials include site clearance waste, excavated materials, building works generated from construction of CCGT Unit No.2 for the entire project.

(b) Non-inert C&D materials include site clearance waste, excavated materials, building works generated from construction period of CCGT Unit No.2 for the entire project. The amount of general refuse was estimated 780 kg per day for construction of CCGT Unit No.2. There are 71 working days in the reporting period.

(c) Chemical waste includes waste oil and spent pipes with lubricating oil. Density of waste oil is assumed to be 0.8 kg/L. There are 3 months in the reporting period.

6. ENVIRONMENTAL SITE INSPECTION

For CCGT Unit No.2, joint weekly site inspections were conducted by representatives of the Contractors, CAPCO Project Team and ET on 2, 10, 16, 23 and 30 December 2021; 6, 13, 20, 27 and 31 January 2022; and 17 and 24 February 2022. The site inspection on 11 February 2022 was cancelled due to the outbreak of COVID-19 in the Project site. The representative of the IEC joined the site inspections on 2 December 2021, 6 January 2022 and 24 February 2022. No non-compliance was recorded during the site inspections.

Findings and recommendations for the site inspection in this reporting month are summarised in *Table 6.1*.

Month	Date	Findings and Recommendations
December 2021	2 December 2021	The Contractor (Siemens) was reminded to provide sufficient watering along the haul road for dust suppression.
		Regarding the planter audit, CAPCO was recommended to closely monitor BPT800 and BPT945, and clean the weeds and trash regularly.
	10 December 2021	The Contractor (Siemens) was reminded to provide sufficient watering for dust suppression.
	16 December 2021	There were no major observations.
	23 December 2021	There were no major observations.
	30 December 2021	There were no major observations.
January 2022	6 January 2022	The Contractor (Siemens) was reminded to clear dusty material on the haul road and provide sufficient watering for dust suppression.
		Regarding the planter audit, CAPCO was recommended to closely monitor BPT800 and BPT945, clean the weeds and trash regularly and ensure the presence of tree tags on each tree.
	13 January 2022	The Contractor (Siemens) was reminded to provide sufficient watering for dust suppression.
	20 January 2022	There were no major observations.
	27 January 2022	There were no major observations.
	31 January 2022	There were no major observations.
February 2022	11 February 2022	The site inspection was cancelled due to the outbreak of COVID-19 in the Project site.
	17 February 2022	There were no major observations.
	24 February 2022	There were no major observations.
		Regarding the planter audit, CAPCO was recommended to closely monitor BPT800 and BPT945, clean the weeds and trash regularly and ensure the presence of tree tags on each tree.

Table 6.1Summary of the findings and recommendation for the site
inspection in the Reporting Month

All follow-up actions requested by ET and IEC during the site inspections were undertaken as reported by CAPCO and the Contractor. The abovementioned environmental issues had been addressed and mitigated during the reporting period.

 www.erm.com
 Version: 1
 Project No.: 0554663
 Client: Castle Peak Power Company Limited (CAPCO)
 22 March 2022

 P:\Projects\0554663 CLP Power Hong Kong Limited CLP CCGT D2 ET.MT\05 Submission\06 EM&A Report\Quarterly EM&A Report\21.202112 - 202202\0554663

 Quarterly EM&A Report -2112to2202_v1.docx

7. ENVIRONMENTAL NON-CONFORMANCE

7.1.1 Summary of Monitoring Exceedance

No environmental monitoring is required during construction of CCGT Unit No.2.

7.1.2 Summary of Environmental Non-compliance

No non-compliance event was recorded during the reporting period for CCGT Unit No.2.

7.1.3 Summary of Environmental Compliant

No environmental complaint was received during the reporting period for CCGT Unit No.2.

7.1.4 Summary of Environmental Summon and Successful Prosecution

No summon or prosecution was received during the reporting period for CCGT Unit No.2.

8. CONCLUSIONS

This 21st quarterly Environmental Monitoring and Audit (EM&A) Report presents the EM&A works carried out during the period from 1 December 2021 to 28 February 2022 for CCGT Unit No. 2 in accordance with the EM&A Manual and the requirements of EP-507/2016/C, EP-507/2016/D, FEP-04/507/2016/C and FEP-04/507/2016/D.

Three vessels for transport of equipment and materials were operated during the reporting period and no non-compliance was recorded.

No non-compliance event was recorded during the reporting period.

No environmental complaint, summon or prosecution was received during the reporting period.


The Contractor have implemented possible and feasible mitigation measures to mitigate the potential environmental impacts during construction. The ET will continue to keep track of the EM&A programme to ensure compliance of environmental requirements and the effectiveness and efficiency of the mitigation measures implemented. If necessary, the Contractor will provide more mitigation measures to further alleviate the impacts.

APPENDIX A WORKS AREA FOR CCGT UNITS NO. 1 AND NO. 2 AT THE BLACK POINT POWER STATION

 www.erm.com
 Version: 1
 Project No.: 0554663
 Client: Castle Peak Power Company Limited (CAPCO)
 22 March 2022

 P:\Projects\0554663
 CLP Power Hong Kong Limited CLP CCGT D2
 ET.MT\05
 Submission\06
 EM&A Report\21.202112 - 202202\0554663

 Quarterly EM&A Report -2112to2202_v1.docx
 EM&A
 Report -2112to2202_v1.docx
 EM&A

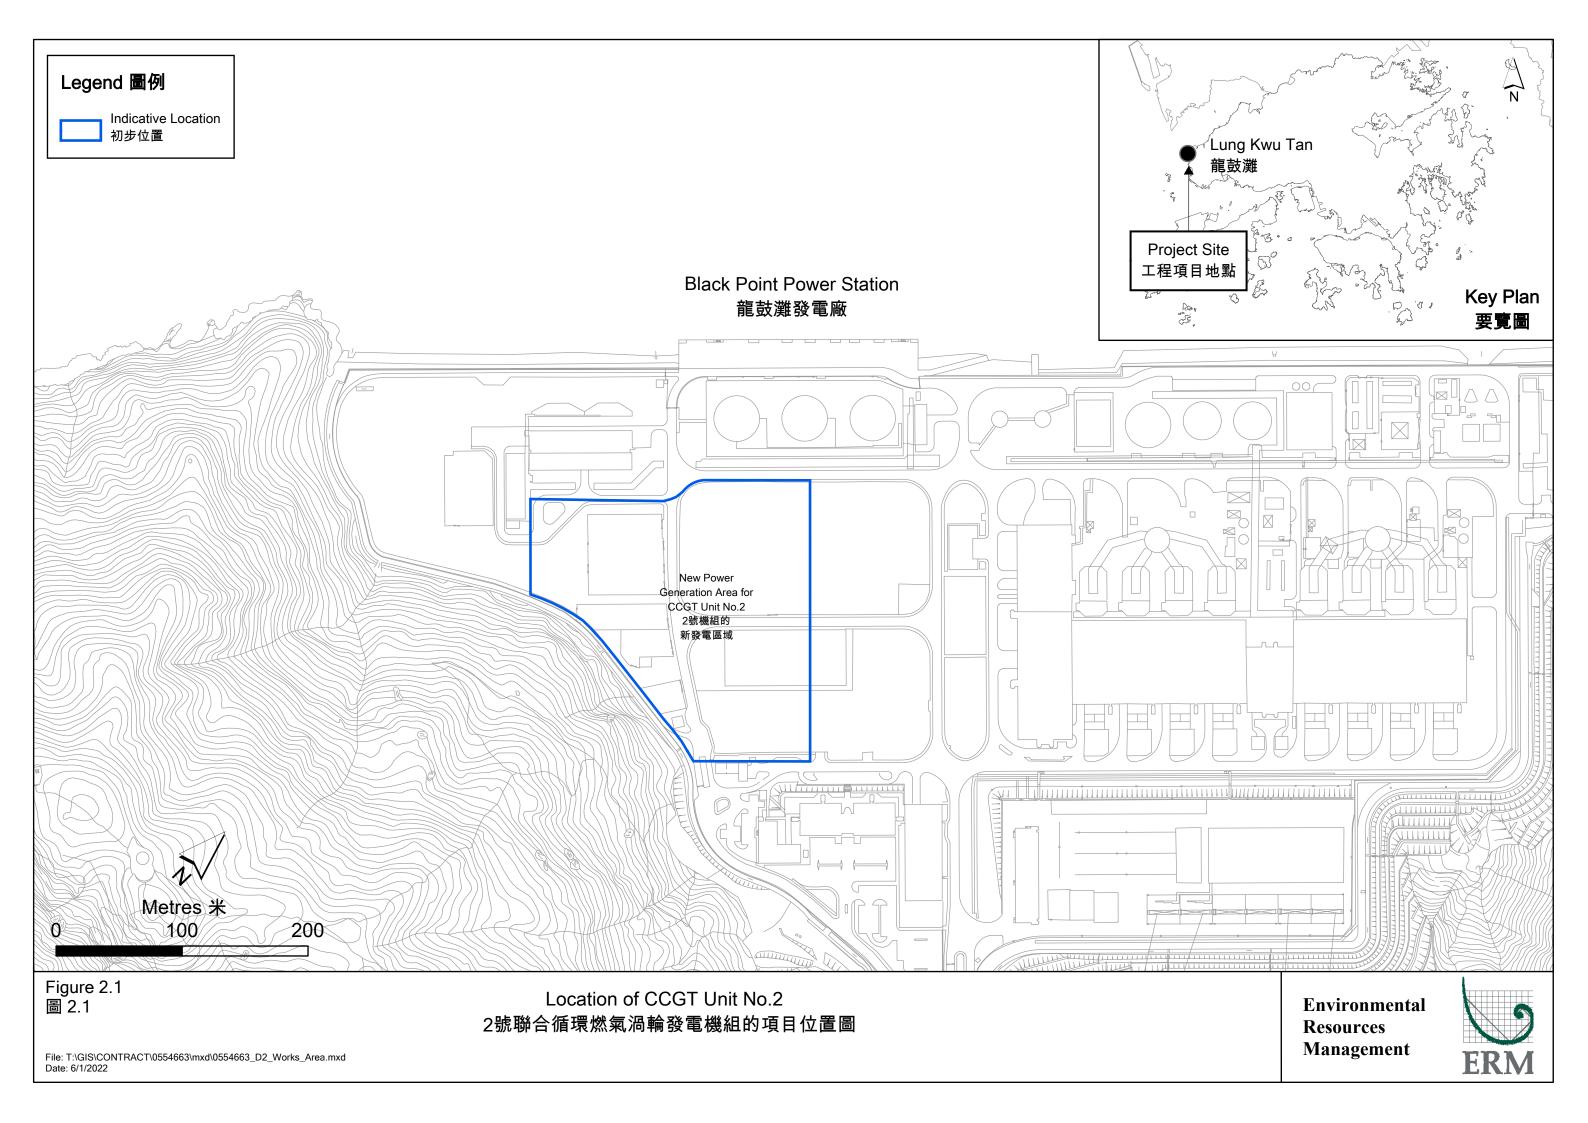

APPENDIX B CONSTRUCTION PROGRAMME FOR THE REPORTING PERIOD AND COMING MONTHS


 www.erm.com
 Version: 1
 Project No.: 0554663
 Client: Castle Peak Power Company Limited (CAPCO)
 22 March 2022

 P:\Projects\0554663
 CLP Power Hong Kong Limited CLP CCGT D2
 ET.MT\05
 Submission\06
 EM&A Report\21.202112 - 202202\0554663

 Quarterly EM&A Report -2112to2202_v1.docx
 EM&A
 Report -2112to2202_v1.docx
 EM&A

	Ye	ar 202	20					Ye	ear 2	021								Ye	ar 20	22				T				Y	ear	2023	}					Ye	ar 2	024	
CCGT Unit No.2	6 7 8	9 10	11	12	1 2	3	4	5	6 7	7 8	9	10	11	12 1	2	3	4	5 (3 7	8	9	10 ′	11 1:	2 1	2	3	4	5	6	7	8	9 1	0 1	1 12	2 1	2	3 4	5	6
Set up of Site Office		\square	\square	\neg	\mp	\square	\square	\neg	_	Ŧ		\square	\neg	\mp	Ŧ			\mp	Ŧ			\neg	+	Ŧ	F			\neg	\neg	\neg	\mp	\mp	\mp	\mp	F	\square	\mp	Ŧ	Ŧ
Site Establishment			¢	\downarrow	+	t		\mp	+	t	F			+	t			+	+			\ddagger	+	+	t	Ħ			4	\downarrow	+	+	+	+	t	H	+	t	‡
Civil Works										t	F		+	+	t		Ħ	‡	ŧ			‡	+	+	t	Ħ			4	+	+	‡	+	+	t	Ħ	+	t	‡
Equipment Supply & Installation, Commissioning																								İ															
																														- 1									
opendix B					Pı	relin	nina	ry C	ons	truc	tion	Pro	gra	mm	e fo	r CC	GT	Uni	t No	2											E1 Ra	nvii eso	on	mer	ntal				-

APPENDIX C PROJECT ORGANISATION FOR EM&A IMPLEMENTATION

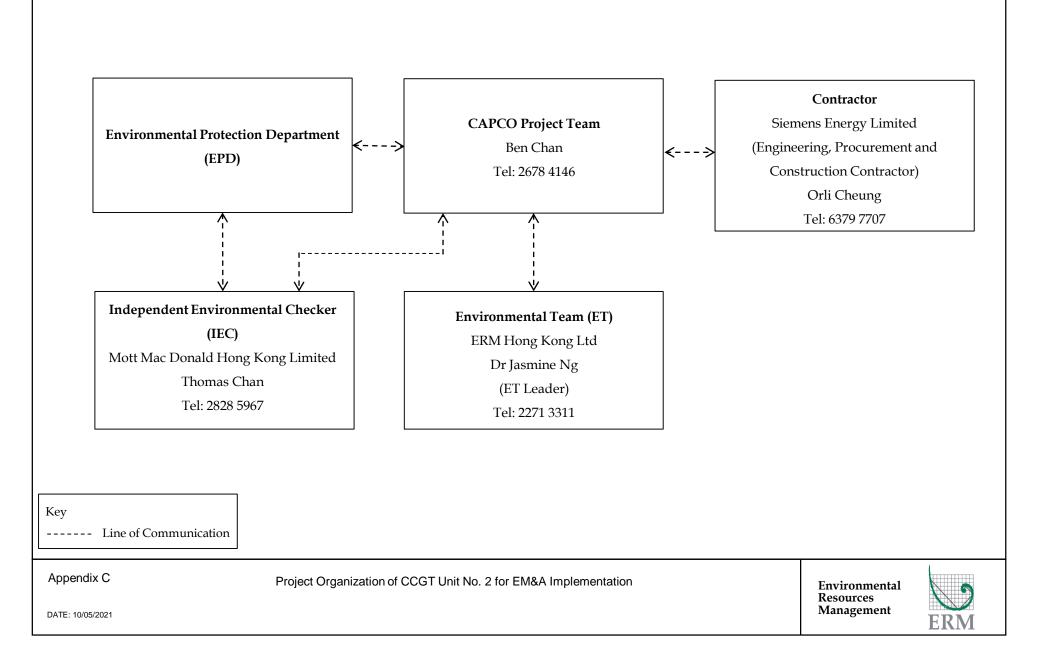

APPENDIX D SUMMARY OF IMPLEMENTATION STATUS OF ENVIRONMENTAL MITIGATION

Appendix D - Environmental Mitigation Implementation Status for Additional CCGT Units Project at BPPS

Note:

- ✓ Compliance of Mitigation Measures
- <> Compliance of Mitigation but need improvement
- x Non-compliance of Mitigation Measures
- ▲ Non-compliance of Mitigation Measures but rectified by the Contractor
- Δ Deficiency of Mitigation Measures but rectified by the Contractor
- N/A Not Applicable in Reporting Period

EIA Reference	EM&A Reference	Recommended Environmental Protection Measures/ Mitigation Measures	Who implement measures?	to When to implement the measures?	the Implementation Status
Air Quality					
S4.10.1	S3.1	Impervious dust screen or sheeting will be provided to enclose scaffolding from the ground floor level of building for construction of superstructure of the new buildings.	Contractor	Construction Stage	√
S4.10.1	S3.1	Impervious sheet will be provided for skip hoist for material transport.	Contractor	Construction Stage	\checkmark
S4.10.1	S3.1	The area where dusty work takes place should be sprayed with water or a dust suppression chemical immediately prior to, during and immediately after dusty activities as far as practicable.	Contractor	Construction Stage	\checkmark
S4.10.1	S3.1	All dusty materials should be sprayed with water or a dust suppression chemical immediately prior to any loading, unloading or transfer operation.	Contractor	Construction Stage	\checkmark
S4.10.1	S3.1	Dropping heights for excavated materials should be controlled to a practical height to minimise the fugitive dust arising from unloading.	Contractor	Construction Stage	\checkmark
S4.10.1	S3.1	During transportation by truck, materials should not be loaded to a level higher than the side and tail boards, and should be dampened or covered before transport.	Contractor	Construction Stage	\checkmark
S4.10.1	S3.1	Wheel washing device should be provided at the exits of the work sites. Immediately before leaving a construction site, every vehicle shall be washed to remove any dusty material from its body and wheels as far as practicable.	Contractor	Construction Stage	√
S4.10.1	S3.1	Road sections between vehicle-wash areas and vehicular entrance will be paved.	Contractor	Construction Stage	\checkmark
S4.10.1	S3.1	Hoarding of not less than 1.8m high from ground level will be provided along the length of the Project Site boundary.	Contractor	Construction Stage	\checkmark

EIA Reference	EM&A Reference	Recommended Environmental Protection Measures/ Mitigation Measures	Who implement measures?	to When to implement the measures?	the Implementation Status
S4.10.1	S3.1	Haul roads will be kept clear of dusty materials and will be sprayed with water so as to maintain the entire road surface wet at all times.	Contractor	Construction Stage	<>
S4.10.1	S3.1	Temporary stockpiles of dusty materials will be either covered entirely by impervious sheets or sprayed with water to maintain the entire surface wet all the time.	Contractor	Construction Stage	\checkmark
S4.10.1	S3.1	Stockpiles of more than 20 bags of cement, dry pulverised fuel ash and dusty construction materials will be covered entirely by impervious sheeting sheltered on top and 3-sides.	Contractor	Construction Stage	\checkmark
S4.10.1	S3.1	All exposed areas will be kept wet always to minimise dust emission.	Contractor	Construction Stage	✓
S4.10.1	S3.1	Ultra-low-sulphur diesel (ULSD) will be used for all construction plant on-site, as defined as diesel fuel containing not more than 0.005% sulphur by weight) as stipulated in <i>Environment, Transport and Works Bureau Technical Circular (ETWB-TC(W)) No 19/2005</i> on Environmental Management on Construction Sites.	Contractor	Construction Stage	~
S4.10.1	S3.1	The engine of the construction equipment during idling will be switched off.	Contractor	Construction Stage	\checkmark
S4.10.1	S3.1	Regular maintenance of construction equipment deployed on-site will be conducted to prevent black smoke emission.	Contractor	Construction Stage	\checkmark
S4.11.2	S3.2	It is recommended to continuously monitor and record the levels of air pollutants of the exhaust gas streams emitted from the stacks of the additional CCGT units by means of CEMS per the licence requirements. Continuous monitoring of ambient concentrations of SO ₂ , NO and NO ₂ will be continued at the current CLP's AQMSs.	CAPCO	Operational Stage	N/A

Hazard to I	Life				
S5.6	S4	All construction workers shall comply with CLP's safety policy and requirements.	Contractor	Construction Stage	\checkmark
S5.6	S4	Method statements and risk assessments shall be prepared and safety control measures shall be in place before commencement of work.	Contractor	Construction Stage	\checkmark
S5.6	S4	All work procedures shall be complied with the operating plant procedures or guidelines and regulatory requirements.	Contractor	Construction Stage	\checkmark
S5.6	S4	Work permit system, on-site pre-work risk assessment and emergency response procedure shall be in place before commencement of work.	Contractor	Construction Stage	\checkmark
S5.6	S4	All construction workers shall equip with appropriate PPE when working at the Project Site.	Contractor	Construction Stage	\checkmark

EIA Reference	EM&A Reference	Recommended Environmental Protection Measures/ Mitigation Measures		to When to implement the measures?	e Implementation Status
S5.6	S4	Safety training and briefings shall be provided to all construction workers.	Contractor	Construction Stage	\checkmark
S5.6	S4	All construction workers shall be under close site supervision.	Contractor	Construction Stage	\checkmark
S5.6	S4	Regular site safety inspections shall be conducted during the construction phase of the Project.	Contractor	Construction Stage	✓
S5.13	S4	Ensure speed limit enforcement is specified in the contractor's method statement to limit the speed of construction vehicles on-site.	Contractor	Construction Stage	\checkmark
S5.13	S4	Conduct speed checks to ensure enforcement of speed limits and to ensure adequate site access control.	Contractor	Construction Stage	\checkmark
S5.13	S4	Provide escort for hydrogen and CO ₂ delivery vehicle drivers to ensure the right access route is used during the construction phases of the Project.	Contractor	Construction Stage	\checkmark
S5.13	S4	A lifting plan, with detailed risk assessment, should be prepared and endorsed for heavy lifting of large equipment.	Contractor	Construction Stage	√
S5.13	S4	Vehicle crash barrier, designed for the specific speed limit at the BPPS, should be provided between the construction site and the distillate oil storage facilities during 1 st CCGT unit construction phase. Also, a vehicle crash barrier is to be provided between the construction site and the 1 st CCGT unit during 2 nd CCGT unit construction phase.	Contractor	Construction Stage	✓
S5.13	S4	Any lifting operation near or over live equipment should be strictly minimised. If such operation cannot be avoided, lifting activities should be assessed, controlled and supervised. Adequate protection covers should also be provided on the existing BPPS facilities in case the operation of lifting equipment has a potential to impact live equipment at BPPS. Process isolation should be achieved in case that live equipment protection becomes impractical.	Contractor	Construction Stage	v
S5.13	S4	The hydrogen road trailer and carbon dioxide road tanker delivery should follow alternative route, which is further from the construction site, during crane operation and movement of construction vehicles in the vicinity.	Contractor	Construction Stage	✓
S5.13	S4	Ensure that a hazardous area classification study is conducted and hazardous area maps are updated before the start of the construction activities to ensure ignition sources are controlled during both construction and operation phases.	Contractor	Construction Stage	✓

EIA Reference	EM&A Reference	Recommended Environmental Protection Measures/ Mitigation Measures	Who implement measures?		Status
S5.13	S4	Ensure work permit system for hot work activities within the Project Site is specified in the contractor's method statement to minimise/ control ignition sources during construction phase.	Contractor	Construction Stage	\checkmark
S5.13	S4	Ensure effective communication system/ protocol is in place between the construction contractors and operation staff.	Contractor	Construction Stage	\checkmark
S5.13	S4	Ensure the Project Construction Emergency Response Plan is integrated with the Emergency Response Plan for the BPPS during construction phases. The plan should address stop work instructions to be promptly communicated to all construction workers performing hot works in case a confirmed flammable gas (natural gas and hydrogen) detection at the BPPS.	Contractor	Construction Stage	~
S5.13	S4	Ensure that construction activities do not impede the functions of fire and gas detection system, fire protection system, muster areas, fire-fighting vehicle access and escape routes.	Contractor	Construction Stage	*
S5.13	S4	Ensure a Job Safety Analysis is conducted for construction activities of the Project during the construction phases, to identify and analyse hazards associated with the construction activities (e.g. lifting operations by cranes) onto the existing plant facilities and operations. Potential risks of the construction activities shall be assessed, and risk precautionary measures shall be implemented in Contractor's works procedures.	Contractor	Construction Stage	✓
Water Quality					
S 7.9	S6.5	Reduction of dredging rate from 4,000 m ³ per day to 740 m ³ per day for dredging at the seawater intake and discharge outfall	Contractor	Construction Stage	N/A
S 7.9	S6.5	Deploy floating type silt curtain around grab dredger	Contractor	Construction Stage	N/A
S 7.9	S6.5	Deploy single layer of floating type silt curtain surrounding coral colonies identify at dive survey Transect C (SR18). The silt curtain surrounding SR18 should provide sufficient clearance to the coral colonies such that no direct impact from the installation and anchoring of silt curtain would be inflicted on the coral colonies.	Contractor	Construction Stage	N/A
S 7.9	S6.5	The contractor shall regularly inspect the silt curtains and check that they are moored and marked to avoid danger to marine traffic. Regular inspection on the integrity of the silt curtain should be carried out by the contractor and any damage to the silt curtain shall be repaired by the contractor promptly. Relevant marine works shall only be undertaken when the repair is fixed to the satisfaction of the engineer.	Contractor	Construction Stage	N/A

EIA Reference	EM&A Reference	Recommended Environmental Protection Measures/ Mitigation Measures	Who to implement th measures?		Status
S 7.9	S6.5	Construction of intake and outfall structure shall be conducted behind drained cofferdam.	Contractor	Construction Stage	N/A
S 7.9	S6.5	All vessels should be well maintained and inspected before use to limit any potential discharges to the marine environment.	Contractor	Construction Stage	N/A
S 7.9	S6.5	All vessels must have a clean ballast system.	Contractor	Construction Stage	N/A
S 7.9	S6.5	No discharge of sewage/grey wastewater should be allowed. Wastewater from potentially contaminated area on working vessels should be minimised and collected. These kinds of wastewater should be brought back to port and discharged at appropriate collection and treatment system.	Contractor	Construction Stage	N/A
S 7.9	S6.5	No soil waste is allowed to be disposed overboard.	Contractor	Construction Stage	N/A
S 7.9	S6.5	Silt removal facilities such as silt traps or sedimentation facilities will be provided to remove silt particles from runoff to meet the requirements of the TM standard under the WPCO. The design of silt removal facilities will be based on the guidelines provided in ProPECC PN 1/94. All drainage facilities and erosion and sediment control structures will be inspected on a regular basis and maintained to confirm proper and efficient operation at all times and particularly during rainstorms. Deposited silt and grit will be removed regularly.	Contractor	Construction Stage	*
S 7.9	S6.5	Earthworks to form the final surfaces will be followed up with surface protection and drainage works to prevent erosion caused by rainstorms.	Contractor	Construction Stage	\checkmark
S 7.9	S6.5	Appropriate surface drainage will be designed and provided where necessary.	Contractor	Construction Stage	\checkmark
S 7.9	S6.5	The precautions to be taken at any time of year when rainstorms are likely together with the actions to be taken when a rainstorm is imminent or forecasted and actions to be taken during or after rainstorms are summarised in Appendix A2 of ProPECC PN 1/94.	Contractor	Construction Stage	×
S 7.9	S6.5	Oil interceptors will be provided in the drainage system where necessary and regularly emptied to prevent the release of oil and grease into the storm water drainage system after accidental spillages.	Contractor	Construction Stage	✓
S 7.9	S6.5	Temporary and permanent drainage pipes and culverts provided to facilitate runoff discharge, if any, will be adequately designed for the controlled release of storm flows.	Contractor	Construction Stage	✓

EIA Reference	EM&A Reference	Recommended Environmental Protection Measures/ Mitigation Measures		to When to implement t ne measures?	he Implementation Status
S 7.9	S6.5	The temporary diverted drainage, if any, will be reinstated to the original condition when the construction work has finished or when the temporary diversion is no longer required.	Contractor	Construction Stage	\checkmark
S 7.9	S6.5	Appropriate infiltration control, such as cofferdam wall, should be adopted to limit groundwater inflow to the excavation works areas in the Project site. Groundwater pumped out from excavation area should be discharged into the storm system via silt removal facilities.	Contractor	Construction Stage	✓
S 7.9	S6.5	Appropriate numbers of portable toilets shall be provided by a licensed contractor to serve the construction workers over the construction site to prevent direct disposal of sewage into the water environment.	Contractor	Construction Stage	✓
S 7.9	S6.5	The contingency plan for the existing operation of the BPPS is considered sufficient for directing immediate response to any accidental spillage event.	CAPCO	Construction Stage	\checkmark
S 7.9	S6.5	Mitigation measures required for maintenance dredging at seawater intake and discharge outfall would be the same as that recommended for construction phase dredging operation	Contractor	Construction Stage	N/A
S7.9 and S7.12	S6.2-S6.5	A water quality monitoring programme shall be implemented for the construction phase.	ET	Construction Stage	N/A
S7.9 and S7.12	S6.2-S6.5	To ensure compliance to the effluent standard, regular monitoring of effluent quality is recommended during normal operation. Furthermore, marine water monitoring at selected nearby WSRs during the first year of project commission are recommended to ensure compliance to WQO or other water quality criteria.	ET/ CAPCO	Operational Stage	N/A
Waste Managen	nent				
S8.5.1	Table 7.1	The Contractor must ensure that all the necessary waste disposal and marine dumping permits or licences are obtained prior to the commencement of the construction works.	Contractor	Construction Stage	✓
S8.5.1	S7.2	The contractor will open a billing account with EPD in accordance with the Waste Disposal (Charges for Disposal of Construction Waste) Regulation for the payment of disposal charges.	Contractor	Construction Stage	√
S8.5.1	S7.2	A trip-ticket system will be established in accordance with <i>DEVB TC(W)</i> No. 6/2010 to monitor the reuse of surplus excavated materials off-site and disposal of construction waste and general refuse at transfer facilities/ landfills, and to control fly-tipping.	Contractor	Construction Stage	✓

EIA Reference	EM&A Reference	Recommended Environmental Protection Measures/ Mitigation Measures	Who implement measures?	to When to implement t the measures?	he Implementation Status
S8.5.1	\$7.2	A WMP as stated in the <i>PNAP ADV-19</i> for the amount of waste generated, recycled and disposed of (including the disposal sites) will be established and implemented during the construction phase as part of the Environmental Management Plan (EMP). The Contractor will be required to prepare the EMP and submits it to the Architect/ Engineer under the Contract for approval prior to implementation.	Contractor	Construction Stage	✓
S8.5.1	Table 7.1	The management of dredged/ excavated sediment management requirement from <i>PNAP ADV-21</i> will be incorporated in the Specification of the Contract Documents.	CAPCO/ Contractor	Construction Stage	N/A
S8.5.1	S7.2	C&D materials will be segregated on-site into public fill and construction waste and stored in different containers or skips to facilitate reuse of the public fill and proper disposal of the construction waste. Specific areas of the Site will be designated for such segregation and storage if immediate use is not practicable. Prefabrication will be adopted as far as practicable to reduce the construction waste arisings.	Contractor	Construction Stage	*
S8.5.1	S7.2	The Contractor will register as a chemical waste producer with the EPD. Chemical waste will be handled in accordance with the Code of Practice on the Packaging, Handling and Storage of Chemical Wastes.	Contractor	Construction Stage	4
S8.5.1	S7.2	 Containers used for storage of chemical wastes will: Be suitable for the substance they are holding, resistant to corrosion, maintained in a good condition, and securely closed; Have a capacity of less than 450 L unless the specifications have been approved by the EPD; and Display a label in English and Chinese in accordance with instructions prescribed in 	Contractor	Construction Stage	•
		Display a label in English and Chinese in accordance with instructions prescribed in Schedule 2 of the Regulations.			
S8.5.1	\$7.2	 The storage area for chemical wastes will: Be clearly labelled and used solely for the storage of chemical waste; Be enclosed on at least 3 sides; Have an impermeable floor and bunding, of capacity to accommodate 110% of the volume of the largest container or 20% by volume of the chemical waste stored in that area, whichever is the greatest; 	Contractor	Construction Stage	✓

EIA Reference	EM&A Reference	Recommended Environmental Protection Measures/ Mitigation Measures		to When to implement the measures?	he Implementation Status
		Have adequate ventilation;			
		 Be covered to prevent rainfall entering (water collected within the bund must be tested and disposed of as chemical waste, if necessary); and 			
		 Be arranged so that incompatible materials are appropriately separated. 			
S8.5.1	S7.2	Chemical waste will be disposed of:	Contractor	Construction Stage	\checkmark
		Via a licensed waste collector; and			
		• To a facility licensed to receive chemical waste, such as the Chemical Waste Treatment Facility which also offers a chemical waste collection service and can supply the necessary storage containers.			
S8.5.1	S7.2	General refuse will be stored in enclosed bins separately from construction and chemical wastes. The general refuse will be delivered to the WENT Landfill, separately from construction and chemical wastes, on a daily basis to reduce odour, pest and litter impacts.	Contractor	Construction Stage	✓
S8.5.1	S7.2	Recycling bins will be provided at strategic locations within the Project Site to facilitate recovery of recyclable materials (including aluminium can, waste paper, glass bottles and plastic bottles) from the Project Site. Materials recovered will be sold for recycling.	Contractor	Construction Stage	✓
S8.5.1	S7.2	To avoid any odour and litter impact, appropriate number of portable toilets will be provided for workers on-site.	Contractor	Construction Stage	\checkmark
S8.5.1	S7.2	At the commencement of the construction works, training will be provided to workers on the concepts of site cleanliness and on appropriate waste management procedures, including waste reduction, reuse and recycling.	Contractor	Construction Stage	✓
Land Contamin	ation				
S9.8	S8	 During construction stage, good house-keeping practices shall be maintained by the Contractor to minimise the risk of land contamination due to construction activities, including but not limited to the followings: Minimise the chemical stock within Project Site, only store the amount of chemicals needed; Designated chemical/ chemical waste storage shall be established on concrete paved ground, as far as practicable. Secondary containments shall be provided for storage of chemicals/ chemical wastes; 	Contractor	Construction Stage	✓

EIA Reference	EM&A Reference	Recommended Environmental Protection Measures/ Mitigation Measures	Who implement measures?	e Implementation Status		
		Conduct regular maintenance and inspection on plants and equipment, particularly those involve the use of fuel, hydraulic oil or any sort of chemicals; and				
		Divert rainfall and surface run-off around construction areas.				
Ecology						
\$10.9.2	S9.1	The vessel operators will be required to control and manage all effluent from vessels to prevent avoidable water quality impacts.	Contractor	Construction Stage	N/A	
S10.9.2	S9.1	A policy of no dumping of rubbish, food, oil, or chemicals will be strictly enforced. This will also be covered in the contractor briefings.	Contractor	Construction Stage	N/A	
\$10.9.2	S9.1	The effects of construction of the Project on the water quality of the area will be reduced with the implementation of mitigation measures as described in the Water Quality Impact Assessment.	Contractor	Construction Stage	N/A	
S10.9.3	S9.1	All vessel operators working on the Project construction will be given a briefing, alerting them to the possible presence of dolphins in the marine works areas, and the guidelines for safe vessel operation in the presence of cetaceans. The use of high-speed vessels will be avoided as far as possible. All vessels used in this Project will be required to slow to 10 knots around the Project's marine works areas and area with high dolphin usage.	Contractor	Construction Stage	N/A	
510.9.3	S9.1	The vessel operators of this Project will be required to use predefined and regular routes.	Contractor	Construction Stage	N/A	
510.9.3	S9.2.1	A marine mammal exclusion zone within a radius of 250 m from dredger will be implemented during the construction phase. Qualified observer(s) will scan an exclusion zone of 250 m radius around the work area for at least 30 minutes prior to the start of dredging. If cetaceans are observed in the exclusion zone, dredging will be delayed until they have left the area.	Contractor	Construction Stage	N/A	
510.9.4	S9.1	Structures will utilise appropriate design to complement the surrounding landscape wherever possible. Materials and finishes will be considered during detailed design.	CAPCO	Construction Stage	*	
S10.9.4	S9.1	All of the major lighting sources will be pointed inward and downwards to avoid disturbances to wildlife.	CAPCO	Construction Stage	✓	

EIA Reference	EM&A Reference	Recommended Environmental Protection Measures/ Mitigation Measures	Who implement measures?	he Implementation Status	
S10.9.4	S9.1	Good site practices and precautionary measures are recommended to be implemented to avoid encroachment onto the nearby natural habitats, minimise disturbance to wildlife, and ensure air and water quality is maintained. Mitigations measures as mentioned in the air quality (Section 4 in Approved EIA Report ref. no. AEIAR-197/2016) and water quality (Section 7 in Approved EIA Report ref. no. AEIAR-197/2016) assessments will be consequently instigated to minimise dust and surface runoff to adjacent wildlife and natural habitats during construction activities.	CAPCO/ Contractor	Construction Stage	✓
S10.9.4	S9.1	Erect fences or demarcate along the boundary of the works area before the commencement of works to prevent vehicle movements, and encroachment of staffs, onto adjacent areas.	CAPCO/ Contractor	Construction Stage	√
S10.9.4	S9.1	Avoid any damage and unnecessary disturbance to the surrounding natural habitats.	CAPCO/ Contractor	Construction Stage	\checkmark
Landscape & V	isual				
S12.8	S11	Sensitive architectural design of the new facilities. This should take into account material texture, colour, finished to structure and the context of the site.	CAPCO/ Design Contractor	Construction Stage	N/A
S12.8	S11	Reinstatement. Following construction, areas temporarily affected by the construction works, will be reinstated to their former state. This will include the artificial shoreline as well as parts of some roads.	CAPCO/ Contractor	Construction Stage	N/A
S12.8	S11	Preservation of vegetation. Plants affected by the proposed Project are all within movable planters. Prior to construction, these affected moveable planters should be re-located to a suitable area, still within the BPPS, taking care to ensure the existing health status of the vegetation is maintained or enhanced at the new location. Once construction is complete the final location of the moveable planters should be integrated into the LMP.	CAPCO/ Contractor	Construction Stage	✓
S12.8	S11	Update Landscape Master Plan (LMP) to take account of the changes brought about by the Project and explore suitable areas where soft landscaping may be installed amongst the new facilities. The LMP should give due consideration to the possibility of re-provisioning of disturbed lands and provision of screen planting within the facility boundaries as far as practicable.	Qualified Landscape Professional employed Project Proponent	Construction Stage	N/A

APPENDIX E WASTE FLOW TABLE

 www.erm.com
 Version: 1
 Project No.: 0554663
 Client: Castle Peak Power Company Limited (CAPCO)
 22 March 2022

 P:\Projects\0554663
 CLP Power Hong Kong Limited CLP CCGT D2
 ET.MT\05
 Submission\06
 EM&A Report\21.202112 - 202202\0554663

 Quarterly EM&A Report -2112to2202_v1.docx
 EM&A
 Report -2112to2202_v1.docx
 EM&A

Month	Actual Quantities of Inert C&D Materials Generated Monthly $^{(1)}$					Actual Quantities of C&D Wastes Generated Monthly					
	Total Quantity Generated (in '000m ³)	Broken Concrete ⁽⁵⁾ (in '000m ³)	Reused in the Contract (in '000m ³)	Reused in other Projects (in '000m ³)	Disposed as Public Fill ⁽³⁾ (in '000m ³)	Metals	Paper/ cardboard packaging	Plastics ⁽²⁾	Chemical Waste ⁽⁴⁾	Others, e.g. general refuse ⁽³⁾ (in '000m ³)	
T 04	``````````````````````````````````````	· ,	· ,		, ,	(in '000kg)	(in '000kg)	(in '000kg)	(in'000 kg)		
Jan-21	3.014	0.000	1.856	0.000	1.158	9.500	0.000	0.000	0.000	0.006	
Feb-21	5.791	0.000	4.641	0.000	1.150	0.000	0.000	0.000	0.000	0.016	
Mar-21	1.387	0.000	0.338	0.000	1.049	0.000	0.000	0.000	1.120	0.072	
Apr-21	1.578	0.000	0.000	0.000	1.578	10.850	0.000	0.000	0.000	0.009	
May-21	1.512	0.000	0.000	0.000	1.512	0.000	0.000	0.000	0.000	0.023	
Jun-21	0.990	0.000	0.000	0.000	0.990	0.000	0.000	0.000	0.000	0.074	
Sub-total	14.272	0.000	6.835	0.000	7.437	20.350	0.000	0.000	1.120	0.200	
Jul-21	1.368	0.000	1.337	0.000	0.031	0.000	0.000	0.000	0.000	0.072	
Aug-21	0.010	0.000	0.000	0.000	0.010	0.000	0.000	0.000	0.000	0.046	
Sep-21	0.048	0.000	0.000	0.000	0.048	10.920	0.000	0.000	0.000	0.028	
Oct-21	0.013	0.000	0.008	0.000	0.005	50.540	0.069	0.000	0.000	0.022	
Nov-21	0.088	0.000	0.005	0.000	0.083	46.840	0.000	0.000	0.000	0.039	
Dec-21	0.610	0.000	0.003	0.551	0.056	33.150	0.000	0.000	0.000	0.028	
Total (2021)	16.409	0.000	8.188	0.551	7.670	161.800	0.069	0.000	1.120	0.435	
2020	7.095	0.602	5.250	0.001	1.243	226.030	0.000	0.000	0.000	0.029	
Cumulative	23.504	0.602	13.438	0.552	8.913	387.830	0.069	0.000	1.120	0.464	

Monthly Summary Waste Flow Table for 2021

Notes:

- (1) Inert C&D materials include bricks, concrete, building debris, rubble and excavated spoil.
- (2) Plastics refer to plastic bottles/containers, plastic sheets/foam form packaging material.
- (3) Density Assumption: 1.6(kg/l) for Public Fill and 0.9(kg/l) for General Refuse.
- (4) Chemical waste includes waste oil. Density of waste oil is assumed to be 0.8 kg/L.
- (5) Density of broken concrete is assumed to be 2.5 ton/m^3 .
- (6) The waste management data in June 2021 have been updated according to the latest information from the Contractor in August 2021.
- (7) The cut-off date for waste management data is 31 December 2021.

Month	Actual Quantities of Inert C&D Materials Generated Monthly $^{(1)}$					Actual Quantities of C&D Wastes Generated Monthly				
	Total Quantity Generated (in '000m ³)	Broken Concrete ⁽⁵⁾ (in '000m ³)	Reused in the Contract (in '000m ³)	Reused in other Projects (in '000m ³)	Disposed as Public Fill ⁽³⁾ (in '000m ³)	Metals (in '000kg)	Paper/ cardboard packaging (in '000kg)	Plastics ⁽²⁾ (in '000kg)	Chemical Waste ⁽⁴⁾ (in'000 kg)	Others, e.g. general refuse ⁽³⁾ (in '000m ³)
Jan-22	0.002	0.000	0.002	0.000	0.000	59.830	0.000	0.410	0.000	0.012
Feb-22	0.003	0.000	0.000	0.000	0.003	112.650	0.000	0.000	0.000	0.012
Mar-22	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
Apr-22	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
May-22	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
Jun-22	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
Sub-total	0.005	0.000	0.002	0.000	0.003	172.480	0.000	0.410	0.000	0.024
Jul-22	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
Aug-22	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
Sep-22	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
Oct-22	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
Nov-22	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
Dec-22	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
Total (2022)	0.005	0.000	0.002	0.000	0.003	172.480	0.000	0.410	0.000	0.024
2020	7.095	0.602	5.250	0.001	1.243	226.030	0.000	0.000	0.000	0.029
2021	16.409	0.000	8.188	0.551	7.670	161.800	0.069	0.000	1.120	0.435
Cumulative	23.509	0.602	13.440	0.552	8.916	560.310	0.069	0.410	1.120	0.488

Monthly Summary Waste Flow Table for 2022

Notes:

- (1) Inert C&D materials include bricks, concrete, building debris, rubble and excavated spoil.
- (2) Plastics refer to plastic bottles/containers, plastic sheets/foam form packaging material.
- (3) Density Assumption: 1.6(kg/l) for Public Fill and 0.9(kg/l) for General Refuse.
- (4) Chemical waste includes waste oil. Density of waste oil is assumed to be 0.8 kg/L.
- (5) Density of broken concrete is assumed to be 2.5 ton/m^3 .
- (6) The cut-off date for waste management data is 28 February 2022.