

HALCROW

Consulting Engineers

Halcrow Asia Partnership Ltd
Consulting Engineers
3201 Central Plaza
18 Harbour Road Wanchai Hong Kong
Telephone 28029228
International Telephone +852 28029228
Cable HIPARTHOK
Fax 28278352
International Fax +852 28278352

合
樂
顧
問
工
程
師

As Distribution List
Attached

19 December 1994

RC/LPD/17/856


Our ref
Your ref

Dear Sir

**LANTAU PORT DEVELOPMENT - STAGE 1
CONTAINER TERMINALS NO. 10 AND 11
ANCILLARY WORKS (DESIGN)
Environmental Impact Assessment
Final Report**

Please find enclosed your copies of the Environmental Impact Assessment Final Report distributed on behalf of CED.

Yours faithfully

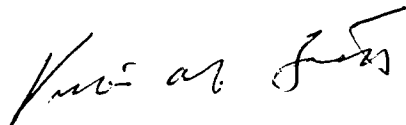

V M Scott
Project Manager

Encl

Directors
B J Whelan BSc MICE MIHT MHKIE
(Managing Director)
G Daughton BSc CGeol FGS
Anthony W C Wong BSc MSc RPE MHKIE CEng MIStructE MIHT
V M Scott BSc FICE
A C Cadwallader BA (Secretary)



ISO 9001 : 1987
Certificate No: CC215



Government of Hong Kong
Civil Engineering Department
Civil Engineering Office

**LANTAU PORT DEVELOPMENT
- STAGE 1
CONTAINER TERMINALS NO. 10 & 11
ANCILLARY WORKS (DESIGN)**

Environmental Impact Assessment

Final Report

December 1994

Halcrow Asia Partnership Ltd has prepared this report in accordance with the instructions of Civil Engineering Department for their sole and specific use. Any other persons who use any information contained herein do so at their own risk.

Halcrow Asia Partnership Ltd

in association with

Mott MacDonald Hong Kong Ltd

Urbis Travers Morgan Ltd

Wilbur Smith Associates

First Pacific Davies (Hong Kong) Ltd

3201 Central Plaza, 18 Harbour Road, Wan Chai, Hong Kong
Telephone: 802 9228 Fax: 827 8352

**LANTAU PORT DEVELOPMENT - STAGE 1
CONTAINER TERMINALS NO. 10 & 11
ANCILLARY WORKS (DESIGN)**

**Environmental Impact Assessment
Final Report**

Doc No: RC/LPD/037

Serial No: 011

Contents Amendment Record

This report has been issued and amended as follows:

Issue	Revision	Description	Date	Signed
1	0	First Issue	16/12/94	A J Kirby

Revisions to the document to be marked thus: |

**Civil Engineering Department
Lantau Port Development - Stage 1
Container Terminals No. 10 & 11
Ancillary Work (Design)**

**Environmental Impact Assessment
Final Report
Volume 1 Text**

**Civil Engineering Department
Lantau Port Development - Stage 1
Container Terminals No. 10 & 11
Ancillary Work (Design)**

**Environmental Impact Assessment
Final Report
Volume 1 Text**

CONTENTS

	Page
1. INTRODUCTION	1-1
1.1 Background	1-1
1.2 Objectives of the Environmental Assessment Study	1-2
1.3 Approach	1-3
2. ENVIRONMENTAL LEGISLATION AND STANDARDS	2-1
2.1 Introduction	2-1
2.2 Noise Quality	2-1
2.3 Air Quality	2-3
2.4 Water Quality	2-4
2.5 Marine Sediments	2-5
2.6 Other Relevant Legislation	2-7
2.7 Ecology	2-7
2.8 Hong Kong Planning Standards and Guidelines	2-8
3. PROJECT DESCRIPTION	3-1
3.1 Proposed Site	3-1
3.2 Construction Phase	3-2
3.2.1 Introduction	3-2
3.2.2 Construction Programme	3-2
3.2.3 Construction Traffic and Site Access	3-3
3.2.4 Construction Activities	3-3
3.3 Operation Activities	3-4
4. ENVIRONMENTAL FRAMEWORK	4-1
4.1 Introduction	4-1
4.2 Areas Containing Sensitive Receivers	4-1
4.2.1 Sensitive Receivers for Air and Noise	4-1
4.2.2 Sensitive Receivers for Water	4-3
4.3 Baseline Noise Levels	4-3
4.4 Baseline Air Quality	4-3
4.5 Water Quality	4-4
4.6 Marine Sediments	4-6
4.7 Waste	4-7
4.8 Land Contamination	4-7

	Page
5. NOISE ASSESSMENT	5-1
5.1 Key Issues	5-1
5.2 Construction Phase	5-1
5.2.1 Assessment Methodology, Criteria and Assumptions	5-1
5.2.2 Reclamation, Breakwater and Infrastructure	5-4
5.2.3 Haul Road Traffic	5-5
5.2.4 CT10 and 11	5-5
5.2.5 Construction Noise	5-17
5.2.6 Mitigation Measures	5-19
5.2.7 Compliance Monitoring	5-21
5.3 Operational Phase	5-21
5.3.1 Assessment Methodology, Assumptions and Criteria	5-24
5.3.2 Impact Assessment and Evaluation	5-33
5.4 Monitoring and Audit	5-33
5.5 Conclusions	5-33
5.5.1 Construction Phase	5-33
5.5.2 Operation Phase	5-34
5.6 Recommendations	6-1
6. AIR QUALITY	6-1
6.1 Key Issues	6-1
6.2 Baseline Conditions	6-2
6.3 Air Sensitive Receivers	6-2
6.4 Construction Phase	6-2
6.4.1 Assessment Methodology	6-3
6.4.2 Impact from the Ancillary Works	6-5
6.4.3 Impact from CT10 and 11	6-6
6.4.4 Cumulative Impact	6-8
6.4.5 Recommendation	6-9
6.4.6 Dust Monitoring & Audit	6-12
6.5 Operation Phase	6-12
6.5.1 Assessment Methodology and Impact Assessment	6-12
6.5.2 Impact Assessment and Evaluation	6-13
6.5.3 Industrial Emissions	6-14
6.5.4 Mitigation Measures	6-14
6.6 Conclusions and Recommendations	6-14
6.6.1 Construction Activities	6-14
6.6.2 Operational Activities	6-14
6.6.3 Monitoring & Audit	7-1
7. WATER QUALITY	7-1
7.1 Introduction	7-1
7.2 Methodology	7-1
7.2.1 Water Quality Studies	7-1
7.2.2 Presentation of Results	7-2
7.3 Impacts from Reclamation on Water Circulation	7-2
7.3.1 Modelling Scenarios	7-2
7.3.2 Water Circulation	7-2
7.3.3 Sedimentation	7-4
7.3.4 WAHMO Water Quality Modelling	7-4

7.4	Impacts from Dredging	7-6
	7.4.1 Introduction	7-6
7.5	Cumulative Water Quality Impacts	7-9
7.6	Monitoring and Audit	7-12
	7.6.1 Water Quality	7-12
7.7	Conclusions	7-15
7.8	Recommendations	7-17
8.	MARINE ECOLOGY	8-1
8.1	Background	8-1
8.2	Species Present in Study Area	8-1
	8.2.1 Fisheries	8-2
8.3	Intertidal Habitats	8-2
8.4	Benthic Fauna	8-3
8.5	Dolphin Survey	8-4
8.6	Impacts to Marine Ecology and the Fishing Industry	8-8
8.7	Monitoring Requirements	8-11
8.8	Conclusions	8-12
8.9	Recommendations	8-13

LIST OF TABLES

2.1	Area Sensitivity Rating
2.2	Acceptable Noise Levels for Construction
2.3	Acceptable Noise Levels for Operation
2.4	Hong Kong Air Quality Objectives
2.5	Summary of Water Quality Objectives for Southern Waters
2.6	Classification of Dredged Sediments for Marine Disposal
4.1	Measured L_{90} Background Noise Levels
4.2	Mean Measured Pollutant Concentrations at Discovery Bay
4.3	Summary of Existing Water Quality Monitoring Data
4.4	Sediment Quality Data
5.1	Assessment Criteria for Construction Noise other than Percussive Piling
5.2	Construction Noise Levels - Ancillary Works (dB(A) L_{eq})
5.3	Construction Noise Levels - CT10 and 11 (dB(A) L_{eq})
5.4	Cumulative Construction Noise Levels (dB(A) L_{eq})
5.5	Construction Noise Levels - Breakwater and Approach Channel (dB(A) L_{eq})
5.6	Construction Noise Levels - Placing Fill for the Reclamation (dB(A) L_{eq})
5.7	Construction Noise Levels - Haul Road Traffic (dB(A) L_{eq})
5.8	Construction Noise Action Plan
5.9	Powered Mechanical Equipment for CBA
5.10	Frequency Spectrum for Powered Mechanical Equipment
5.11	Equipment Assumed at Each Notional Source
5.12	Total Noise Level from CBA - Unmitigated
5.13	Total Noise Level from CBA - Mitigated by CT11 Western Noise Bund Extension
5.14	Total Noise Level from CBA - Mitigated with 5m High Barriers Only
5.15	Total Noise Level from CBA Mitigated with 5m High Noise Barrier and the Extension to the Western Noise Bund
5.16	Total Noise Level from CBA - Sensitivity Test for Ultra Quiet Equipment

LIST OF TABLES (Cont'd)

- 6.1 Concentration of Selected Pollutants at Discovery Bay and Tung Chung
- 6.2 Air Sensitive Receivers
- 6.3 Predicted TSP Levels without Mitigation
- 6.4 Predicted TSP Levels with Mitigation Option A

- 6.5 Predicted TSP Levels with Mitigation Option B
- 6.6 Predicted Mitigation TSP Concentration due to CT10 and 11
- 6.7 Cumulative TSP Levels at Sensitive Receivers (Option A)
- 6.8 Dust Levels for the Advance Works Dredged Option with Option A Mitigation
- 6.9 Trigger, Action and Target Levels for Dust
- 6.10 Proposed Action Plan for Dust
- 6.11 Predicted Hourly Pollutant Levels at Sensitive Receivers

- 7.1 Potential for Sediment Deposition or Erosion
- 7.2 Relative Changes in Water Quality
- 7.3 Changes in Water Quality
- 7.4 Dredging and Reclamation Works
- 7.5 Summary of the Impacts of Dredging on Sensitive Receivers
- 7.6 Near Field Suspended Sediment Loads from Dredging
- 7.7 Summary of Elutriate Test Results
- 7.8 Impacts of Total Inorganic Nitrogen from Dredging
- 7.9 Effluent Loads from Discovery Bay and Peng Chau (2011)
- 7.10 Summary of Mass Transfer of Pollutants and Resulting Concentrations
- 7.11 Action Plan for Water Quality Monitoring
- 7.12 The Trigger, Action and Target Levels Requirements for Suspended Solids at Monitoring Stations Adjacent to Fish Culture Zone

- 8.1 1989-90 Estimated Fisheries Production by Small Craft
- 8.2 Frequently Occurring Benthic Species in the Study Area
- 8.3 Total Distance Travelled Each Day
- 8.4 Habitat Loss due to Construction of CT10 and CT11
- 8.5 The Trigger, Action and Target Levels requirements for suspended solids at monitoring stations adjacent to Fish Culture Zones

LIST OF APPENDICES

VOLUME I

- A Study Brief
- B Construction Programme
 - B1 Latest Programme
 - B2 Original Programme
- C Construction and Operation
 - C1 Construction Activities
 - C2 Construction Traffic
 - C3 Operation Traffic
- D Noise Impact Assessment
 - D1 Construction and Operation Noise Assessment from the Container Terminal Study Final Report
 - D2 Graphs of Construction Noise Impacts without Mitigation
 - D3 Sensitivity Test for Revised Construction Programme and Advance Works Dredged Option
 - D4 Assessment of the Noise Barriers required to achieve the Zero Contribution Criterion for the CBA
 - D5 Requirement for Buildings to Replace the Temporary Western Noise Bund Extension
- E Air Pollution Assessment
 - E1 Emission Factors
 - E2 Dust Impacts without Mitigation
 - E3 Dust Impacts with Mitigation
 - E3.1 Option A (Watering)
 - E3.2 Option B (Watering plus-Paving the Haul Road)
 - E4 Sensitivity Test for Higher Haul Road Speeds
 - E5 Sensitivity Test for Revised Construction Programme
 - E6 Sensitivity Test for Advance Works Dredged Option

VOLUME II

- F Water Quality Assessment
 - F1 Sediment Testing Programme and Results
 - F2 WAHMO Model Results
 - F2.1 Scope of WAHMO Modelling
 - F2.2 Hydrodynamic Model
 - F2.3 Sediment Model
 - F2.4 Water Quality Model
 - F2.5 Sediment Plume Model
 - F3 Hydrodynamic Studies
 - F4 Sedimentation Studies
 - F5 Water Quality Studies

VOLUME III

- G Ecology Assessment**
 - G1 Dolphin Survey**
 - G1.1 Methodology**
 - G2.1 Dolphin Survey Report**
 - G2 Dolphin Survey Analysis**
 - G3 Fauna Found Within the Study Area**
 - G3.1 Common Sandy Shore Fauna**
 - G3.2 Common Muddy Shore Fauna**
 - G3.3 Common Rocky Shore Fauna**